

SCHOOL DISTRICT OF PHILADELPHIA



Asbestos Hazard Emergency Response Act “AHERA”

THREE-YEAR RE-INSPECTION 2015-2016 and ASBESTOS MANAGEMENT PLAN for the

Mastery Charter School @ Harrity

**ULCS# 3407
Building # B131001-1
5601 Christian Street
Philadelphia, Pennsylvania
19143**

Year Built: 1913

January 2016

Conducted by:

Accredited Environmental Technologies, Incorporated
Batta Environmental Associates, Incorporated
Criterion Laboratories, Incorporated
Environmental Testing Consultants, LLC
G & C Environmental Services, Incorporated
KEM Partners, Incorporated
Synertech, Inc.
TTI Environmental, Inc.
USA Environmental Management, Inc.
The Vertex Companies, Inc.

Management Plan Prepared by:
Criterion Labs, Inc. and Synertech Inc.

This report must remain in the Main Office as mandated by the US EPA AHERA Regulations.

AHERA THREE-YEAR REINSPECTION VOLUME IX

Table of Contents

Transmittal Letter

Executive Summary

- I. Summary list of Confirmed Asbestos Containing Building Materials
- II. Summary list of Assumed Asbestos Contain Building Materials
- III. Summary list of Non-Asbestos Containing Building Materials
- IV. Summary list of Non Suspect Asbestos Containing Building Materials
- V. Summary List of Auditorium DATA for this location
- VI. Summary list of Attic and/or Crawlspace DATA for this location
- VII. Summary list of Pipe Chase/Pipe Shaft DATA for this location

Section I Report of Re-Inspection

- A. Introduction
- B. Three-Year Re-inspection IX Overview
- C. Post- Management Plan Activities and Changes
 - C.1 - Sampling and Analysis
 - C.2 - New Floor Tile Sampling
 - C.3 - Abatement Activity
 - C.4 - Periodic (Six-Month) Surveillance (Damaged Materials)

Section II Re-Inspection Data

- A. Introduction
- B. Re-Inspection Key Definitions
- C. Room by Room Location Log Report

Section III Certificates

- A. Management Planner/Building Inspector Certificates

Section IV	Cross Reference Table	Page 1-8
	Asbestos Management Program	Page 9-19

SCHOOL DISTRICT OF PHILADELPHIA
EDUCATIONAL CENTER
440 NORTH BROAD STREET
PHILADELPHIA, PENNSYLVANIA 19130

OFFICE OF ENVIRONMENTAL MANAGEMENT AND SERVICES

PHONE (215)-400-4750

January 2016

TO: All Principals
All Building Administrators

FROM: Fran Burns
Chief Operating Officer

Francine Locke, M.S., Director
Office of Environmental Management and Services

SUBJECT: AHERA Three (3) Year Re-inspection IX report

In order to comply with the provisions of the Asbestos Hazard Emergency Response Act (AHERA) the attached report is submitted to you. The law requires that this report be kept in the Main/Principal's office. It cannot be removed from these locations. *If the school (program) is relocated to a different building, these environmental documents are to be safely retained for the next school/building occupants.* All asbestos reports must be available to the public and Federal EPA upon request.



Fran Burns
Chief Operation Officer

Francine Locke, M.S., Director
Office of Environmental Management
and Services

Executive Summary

This Asbestos Hazard Emergency Response Act (AHERA) Three-Year Re-inspection “Volume # IX” Management Plan at this location, has been completed and the report of re-inspection submitted to the School District of Philadelphia. The re-inspections in all School District of Philadelphia buildings of 2015-2016 were conducted and completed between October 5th, 2015 through March 30th, 2016 as a joint project by Accredited Environmental Technologies, Inc., Batta Environmental Associates, Inc., Criterion Laboratories, Inc., Environmental Testing Consultants, LLC, G & C Environmental Services, Inc., KEM Partners, Inc., Synertech, Inc., TTI Environmental, Inc., USA Environmental Management, Inc. and The Vertex Companies, Inc.

In general, the School District of Philadelphia Office of Environmental Management and Services conducts Environmental Impact Evaluations and provides Asbestos Inspection Reports prior to any renovation, demolition and/or maintenance activities. The AHERA report must be reviewed prior to any renovation, demolition and/or maintenance activities in order to avoid the unknowing disturbance to Asbestos Containing Building Materials identified within this location. In addition, prior to work activities above all drop ceilings this report should be reviewed to avoid potential disturbances to Asbestos Containing Materials. Refer to Section IV of the Cross Reference Table, for additional Asbestos Management Program information. Contact the Office of Environmental Management and Services to have an Environmental Impact Evaluation conducted prior to any renovation, demolition and/or maintenance activities within this facility.

The information contained in this report was obtained from the original Asbestos Management Plan for the school, from update reports on changes and activities since the completion of the 1st Management Plan for each location and from all prior inspections performed and documented in Volume # I through Volume VIII (dated respectively 1992, 1995, 1998, 2001, 2004, 2007, 2010 or 2013) (if applicable) - and by this Three-Year Re-inspection of this school. The re-inspection report/Management Plan of 2015-2016 were reviewed and prepared collectively by Management Planner Megan Vala, Mary Anne Lerro of Criterion Laboratories, Inc. and/or Monique Causley, of Synertech Inc.

The 2015-2016 inspection process included the addition of a comprehensive Room by Room Inventory of all Thermal (T), Surfacing (S) and Miscellaneous (M) Materials specific to each room of this facility. Inspections of each room's thermal, ceilings, walls, floors and miscellaneous items regardless of Asbestos Content are categorized on the Room by Room Location Log Report for this location. Rooms or areas of the facility that were not accessible at the time of the inspection are marked with an "X". The Room by Room Location Log Report is found in Section II C of this Management Plan.

All Presumed or Suspect Asbestos Containing Building Materials (ACBMs), listed in the following summary charts are categorized as Confirmed, Assumed, Non-Asbestos, and/or Non-Suspect (ACBMs) were identified in the original Management Plan, or in the Volume I through Volume VIII AHERA Three-Year Re-inspection reports, and were re-inspected as part of this project.

As mandated by the U S EPA AHERA regulations, periodic Six-Month inspections and Three-Year Re-inspections of this location will be performed and the Inspection Data in this report will be updated accordingly.

Please feel free to contact the School District of Philadelphia's Office of Environmental Management and Services (OEMS) regarding any comments, questions, or concerns regarding this report or any Environmental related topic. OEMS staff can be reached at (215) 400 4750, via fax at (215) 400 4751 or via e-mail at flocke@philasd.org and/or gfunod@philasd.org.

Additional information can be found on our website. Here is the link to the OEMS website.
<http://webgui.phila.k12.pa.us/offices/e/environmental>

I. Summary list of Confirmed Asbestos Containing Building Materials within this facility

These charts are to be used for a quick reference* in order to avoid the unknowing disturbance of Asbestos Containing Materials during any and all Operations, Maintenance, Renovation, and/or Demolition activities at this location. *These materials have been sampled and Laboratory Analysis has CONFIRMED the presence of Asbestos. Contact OEMS prior to the disturbance of any of the following materials.*

Confirmed Asbestos Containing Building Materials for this location

Floor Tile VAT 9" x 9"	Pipe Fitting Insulation	Pipe Insulation 2-6 inch
------------------------	-------------------------	--------------------------

** Always refer to the Room by Room Logs for each specific material classification as the material classification findings may be different in various rooms throughout this facility.*

*** Some Materials may have multiple classifications (Confirmed, Assumed, NAD and Non Suspect) within this facility.*

II. Summary list of Assumed Asbestos Containing Building Materials within this facility

These charts are to be used for a quick reference* in order to avoid the unknowing disturbance of Asbestos Containing Materials during any and all Operations, Maintenance, Renovation, and/or Demolition activities at this location. These materials have not been sampled and should not be disturbed until verification of Asbestos Content. Contact OEMS for assessment and sampling prior to the disturbance of these materials.

Assumed Asbestos Containing Building Materials for this location

Blackboard Glue Dots	Plaster Walls	Transite Cove Base
Ceiling Tile 1' x 1'	Sink Undercoat Mastic	Transite Sills
Floor Tile VAT 12" x 12"	Transite	Vibration Damper Cloth

** Always refer to the Room by Room Logs for each specific material classification as the material classification findings may be different in various rooms throughout this facility.*

*** Some Materials may have multiple classifications (Confirmed, Assumed, NAD and Non Suspect) within this facility.*

III. Summary list of Non-Asbestos Containing Building Materials within this facility

These charts are to be used for a quick reference* in order to avoid the unknowing disturbance of Asbestos Containing Materials during any and all Operations, Maintenance, Renovation, and/or Demolition activities at this location. *These materials have been sampled and Laboratory Analysis has indicated NO Asbestos present or NO ASBESTOS DETECTED (NAD).*

Non- Asbestos Containing Building Materials for this location

Plaster Wall	Ceiling Tile 2' x 4'	Plaster Ceiling
--------------	----------------------	-----------------

** Always refer to the Room by Room Logs for each specific material classification as the material classification findings may be different in various rooms throughout this facility.*

*** Some Materials may have multiple classifications (Confirmed, Assumed, NAD and Non Suspect) within this facility.*

IV. Summary list of Non-Suspect Asbestos Containing Building Materials within this facility

These charts are to be used for a quick reference* in order to avoid the unknowing disturbance of Asbestos Containing Materials during any and all Operations, Maintenance, Renovation, and/or Demolition activities at this location. These materials are not typically known to contain Asbestos.

Non-Suspect Asbestos Containing Building Materials for this location

Brick Wall	Concrete Ceiling	Metal Ceiling
Carpet	Fiberglass Ceiling Tile 2' x 4'	Metal Floor
Cement Floor	Fiberglass Pipe Fitting Insulation	Metal Wall
Ceramic Tile Floors	Fiberglass Pipe Insulation	Partition Room Dividers
Ceramic Tile Walls	Glass Wall	Sheetrock Ceiling
Concrete Block Wall	Marble Floor	Sheetrock Wall

** Always refer to the Room by Room Logs for each specific material classification as the material classification findings may be different in various rooms throughout this facility.*

*** Some Materials may have multiple classifications (Confirmed, Assumed, NAD and Non Suspect) within this facility.*

V. Summary list of Auditorium DATA for this location

These charts are to be used for a quick reference of the Auditorium DATA within this facility. Sampling of the Auditorium Ceilings throughout the District is more difficult because of the various ceiling heights. As sampling occurs this information is updated on a case by case basis for each specific location and facility.

This is a list of known materials for this location's Auditorium

Auditorium		
Auditorium/Cafeteria	Floor Tile VAT 12" x 12"	Assumed
Auditorium/Cafeteria	Cement Floor	Non Suspect ACM
Auditorium/Cafeteria	Concrete Ceiling	Non Suspect ACM
Auditorium/Cafeteria	Concrete Block Wall	Non Suspect ACM
Auditorium/Cafeteria	Partition Room Dividers	Non Suspect ACM

** Always refer to the Room by Room Logs for each specific material classification as the material classification findings may be different in various rooms throughout this facility.*

*** Some Materials may have multiple classifications (Confirmed, Assumed, NAD and Non Suspect) within this facility.*

VI. Summary list of Attic and/or Crawlspace DATA for this location

These charts are to be used for a quick reference regarding the Attics and/or Crawlspaces inspection DATA within this facility. Contact OEMS prior to entering any attic or crawlspace within this facility and refer to the below chart and legend for Category Rank determination. The Data relative to these spaces is updated as conditions change regarding Abatement or Renovation activity on a case by case basis for each specific location and facility. In general, Crawlspaces are below the basement or 1st floor and Attics are above the floor space.

Category Rank Legend

"A" - No Asbestos Containing Materials - Sample Results indicate NO ACM on pipes, fittings, elbows, or equipment located within this functional space, and NO VISIBLE DEBRIS or DAMAGE observed at time of this inspection.
"B" - Asbestos Containing Materials Exist - Sample Results indicate ACM on pipes, fittings, elbows, or equipment located within this functional space, HOWEVER, NO VISIBLE DEBRIS or DAMAGE observed at time of this inspection.
"C" - Asbestos Containing Materials Exist - Sample Results indicate ACM on pipes, fittings, elbows, or equipment located within this functional space, and LOCALIZED VISIBLE DEBRIS or DAMAGE observed at time of this inspection.
"D" - Asbestos Containing Materials Exist - Sample Results indicate ACM on pipes, fittings, elbows, or equipment located within this functional space and DISTRIBUTED VISIBLE DEBRIS or SIGNIFICANT DAMAGE observed at time of this inspection.
"E" - No Bulk Sample Results Available SUSPECT ACM OBSERVED. Contact OEMS immediately for additional instructions.

Attic/Crawlspace	Access Area	Floor Surface	Category Rank	Comments
Attic	4th Floor Stairwell "B"	Wire Lathe	A	Fiberglass Pipe
Crawlspace	X	X	X	No Crawlspace

VII. Summary list of Pipe Chase/Pipe Shaft DATA for this location

These charts are to be used for a quick reference regarding the information known about the Pipe Chases and/or Pipe Shafts inspection DATA within this facility. Contact OEMS prior to performing renovation activities any Pipe Chase and/or Pipe Shaft within this facility and refer to the below chart and legend for Asbestos Content of various materials identified within each space. The Data relative to these spaces is updated as conditions change regarding Inspection, Abatement and/or Renovation activity on a case by case basis for each specific location and facility. In general, Pipe Chases are horizontal spaces and Pipe Shafts are vertical spaces.

<i>Element</i>	<i>Floor</i>	<i>On Site Room Name</i>	<i>Material</i>	<i>Confirmed /Assumed NAD/Non Suspect</i>	<i>Amount of Material</i>	<i>Amount of Damage</i>
1	3	Girl's Restroom Pipe Chase	Pipe Fitting Insulation	Confirmed	27 EA	0
1	3	Girl's Restroom Pipe Chase	Fiberglass Pipe Insulation	Non Suspect ACM	75 SF	0
1	3	Girl's Restroom Pipe Chase	Concrete Ceiling	Non Suspect ACM	45 SF	0
1	3	Girl's Restroom Pipe Chase	Concrete Block Wall	Non Suspect ACM	360 SF	0
1	3	Girl's Restroom Pipe Chase	Cement Floor	Non Suspect ACM	45 SF	0
1	2	Girl's Restroom Pipe Chase	Pipe Fitting Insulation	Confirmed	4 EA	0
1	2	Girl's Restroom Pipe Chase	Fiberglass Pipe Insulation	Non Suspect ACM	50 LF	0
1	2	Girl's Restroom Pipe Chase	Concrete Ceiling	Non Suspect ACM	45 SF	0
1	2	Girl's Restroom Pipe Chase	Concrete Block Wall	Non Suspect ACM	360 SF	0
1	2	Girl's Restroom Pipe Chase	Cement Floor	Non Suspect ACM	45 SF	0
1	1	Auditorium/Cafeteria Girl's Restroom Pipe Chase	Pipe Fitting Insulation	Confirmed	6 EA	0
1	1	Auditorium/Cafeteria Girl's Restroom Pipe Chase	Fiberglass Pipe Insulation	Non Suspect ACM	50 LF	0
1	1	Auditorium/Cafeteria Girl's Restroom Pipe Chase	Concrete Ceiling	Non Suspect ACM	60 SF	0
1	1	Auditorium/Cafeteria Girl's Restroom Pipe Chase	Concrete Block Wall	Non Suspect ACM	460 SF	0
1	1	Auditorium/Cafeteria Girl's Restroom Pipe Chase	Cement Floor	Non Suspect ACM	60 SF	0
1	B	Classroom 106 Restroom Pipe Chase	Fiberglass Pipe Insulation	Non Suspect ACM	5 LF	0
1	B	Classroom 106 Restroom Pipe Chase	Concrete Ceiling	Non Suspect ACM	20 SF	0
1	B	Classroom 106 Restroom Pipe Chase	Concrete Block Wall	Non Suspect ACM	220 SF	0
1	B	Classroom 106 Restroom Pipe Chase	Cement Floor	Non Suspect ACM	20 SF	0
1	B	Girl's Restroom Pipe Chase	Pipe Fitting Insulation	Confirmed	1 EA	0
1	B	Girl's Restroom Pipe Chase	Fiberglass Pipe Insulation	Non Suspect ACM	10 LF	0
1	B	Girl's Restroom Pipe Chase	Concrete Ceiling	Non Suspect ACM	45 SF	0
1	B	Girl's Restroom Pipe Chase	Concrete Block Wall	Non Suspect ACM	360 SF	0
1	B	Girl's Restroom Pipe Chase	Cement Floor	Non Suspect ACM	45 SF	0

Section I

Report of Re-Inspection

A. Introduction

B. Three-Year Re-Inspection IX Overview

C. Post-Management Plan Activities and Changes

C.1 Sampling and Analysis

C.2 New Floor Tile Sampling

C.3 Abatement Activity

C.4 Periodic Six-Month Surveillance (Damaged Materials)

Section I - A

Report of Re-inspection

Introduction

The Three-Year Re-inspection IX was performed to fulfill the requirements of 40 CFR Part 763 - the Asbestos Hazard Emergency Response Act (AHERA). As required by AHERA, each Local Education Agency (LEA) must re-inspect all known confirmed or assumed Asbestos Containing Building Material (ACBM) located in the LEA's facilities. This re-inspection is intended to update the original Asbestos Management Plan for the LEA's facilities.

Multiple Building Inspectors of several firms performed the 2015/2016 re-inspection. The re-inspection report/Management Plan of 2015-2016 were reviewed and prepared collectively by Management Planner Megan Vala, Mary Anne Lerro of Criterion Laboratories, Inc. and Monique Causley, of Synertech Inc.

All of the certificates can be found in Section III.

During the re-inspection of each School District of Philadelphia facility, all of the Management Plans for that facility were reviewed. Information from the conclusions section of that report is included in this report. Additionally, information on activities such as abatements, cleanings, sampling and inspections, which have taken place since the completion of the original Management Plan, were reviewed during the re-inspection. Information on those activities is included in this report.

As mandated by the U S EPA AHERA regulations, all future periodic Six-Month inspections and Three-Year Re-inspections of this location will be performed and the Inspection Data in this report will be updated accordingly.

Section I - B

Three-Year Re-inspection IX Overview

Each homogeneous area of Asbestos Containing Building Material (ACBM) listed in the original Management Plan or in the 1992, 1995, 1998, 2001, etc., Three-Year Re-inspection reports were inspected for the AHERA Three-Year Re-inspection Volume IX, and the information for that material verified. Any changes to a homogeneous area listed in the updates to the Management Plans were verified. Any area of suspected ACBM found in the course of the re-inspection, and not listed in the Management Plan or updates, were either assumed to contain asbestos or sampled and analyzed to determine their asbestos content. Any such new areas either assumed to contain asbestos or determined through analysis to contain asbestos were included in the report of the Three-Year Re-inspection. The results of the AHERA Three-Year Re-inspection IX are tabulated in the Room by Room log reports located in *Section II-C* of this report.

As previously noted, all future periodic Six-Month inspections and Three-Year Re-inspections of this location will be performed and the Inspection Data in this report will be updated accordingly.

Section I – C.1

Post Management Plan Activities/Changes

Information on activities affecting Asbestos Containing Building Materials (ACBMs) at this location is contained in updates to the Management Plan. These updates are kept on file by the School District of Philadelphia and were reviewed for this project. Updates to the Management Plan include the following: *Sampling and Analysis, New Tile Installation, Abatement Activity and Periodic Six-Month Surveillance Data.*

Sampling and Analysis

In the event Sampling occurs, data will be listed here.

Section I – C.2

Information on the installation of new floor tiles/renovation activities affecting Asbestos Containing Building Materials (ACBMs) at this location is contained in updates to the Management Plan. These updates are kept on file by the School District of Philadelphia and were reviewed for this project. Updates to the Management Plan include the following:

New Floor Tile Sampling

In the event that new tile is installed, the material must be tested prior to installation.

Section I – C.3

Information on the Asbestos Abatement and renovation activities affecting Asbestos Containing Building Materials (ACBMs) at this location is contained in updates to the Management Plan. These updates are kept on file by the School District of Philadelphia and were reviewed for this project. Updates to the Management Plan include the following:

Abatement Activity

In the event Abatement occurs, data will be listed here.

Section I – C.4

Information on the AHERA inspection that noted damage to various Building Materials at this location is contained in updates to the Management Plan. These updates are kept on file by the School District of Philadelphia and were reviewed for this project. Work orders are created for Corrective Action responses and tracked for completion. Updates to the Management Plan include the following:

Periodic (Six-Month) Surveillance (Damaged Materials)

<i>Date</i>	<i>Element</i>	<i>Floor</i>	<i>On Site Room Name</i>	<i>Material</i>	<i>Amount of Material</i>	<i>Amount of Damage</i>
11/07/2016	1	3	Teacher's Lounge Room 400	Pipe Fitting Insulation	6 EA	1 EA
11/07/2016	1	3	Classroom 409	Floor Tile VAT 12" x 12"	838 SF	1 SF
11/07/2016	1	3	Hallway outside Teacher's Lounge 400 to Office 403	Floor Tile VAT 9" x 9"	205 SF	5 SF
11/07/2016	1	2	Classroom 310	Pipe Insulation 2-6 inch	24 LF	1 LF
11/07/2016	1	2	Classroom 312 Restroom	Pipe Insulation 2-6 inch	12 LF	1 LF
11/07/2016	1	2	Hallway outside Classrooms 311-312	Floor Tile VAT 9" x 9"	60 SF	2 SF
11/07/2016	1	1	Conference Room 200	Floor Tile VAT 9" x 9"	322 SF	5 SF
11/07/2016	1	1	Classroom 208	Floor Tile VAT 12" x 12"	830 SF	2 SF
11/07/2016	1	1	Stage	Floor Tile VAT 12" x 12"	1014 SF	5 SF
11/07/2016	1	B	Administrative Suite Office adjacent to Mechanical Room Closet	Pipe Fitting Insulation	8 EA	1 EA
11/07/2016	1	B	Boiler Room Storage	Pipe Fitting Insulation	21 EA	2 EA
11/07/2016	1	B	Classroom 109	Floor Tile VAT 12" x 12"	1250 SF	1 SF
11/07/2016	1	B	Classroom 109 Coat Closet	Floor Tile VAT 12" x 12"	80 SF	2 SF

Section II

Re-Inspection Data

A. Introduction

B. Re-Inspection Key Definitions

C. Room by Room Location Log Report

Section II - A

Re-inspection Data

Introduction

The following information documents the Three-Year Re-inspection IX of the subject school/facility. The Homogeneous Area Reports were produced using the building inspector's field data on the facility. The key to the Homogeneous Area Report is outlined in the following pages of this report.

Section II - B
(page 1 of 4)

SCHOOL DISTRICT OF PHILADELPHIA
AHERA THREE YEAR RE-INSPECTION IX

ITEM	DEFINITION
ULCS#	Individual identification number assigned to each school within the School District of Philadelphia.
HOMOGENEOUS AREA ID#	Identification number assigned to each homogeneous area in a school/facility. Each section of the homogeneous area ID is significant. 1010/01/01/01 A B C D A. Is the ULCS# for the school. B. Designates the specific building/building area within the school. C. Designates the floor or level within the building/building area. D. Designates the homogeneous material within that floor or level. Note: Item D may be a number or a letter.
SYSTEM AFFECTED	Corresponds to the AHERA system for classifying materials. T : Thermal System S : Surfacing System M : Miscellaneous
ITEM AFFECTED	Is a description of the homogeneous material.
ORIGINAL INSPECTION DATA	This section contains the information found in the original Management Plan (1988-1989).
AMOUNT OF MATERIAL/ UNIT	Quantity of material, and measuring unit. Units include: Square Feet (SF) Each (EA) Linear Feet (LF) Cubic Feet (CF).

**SCHOOL DISTRICT OF PHILADELPHIA
AHERA THREE YEAR RE-INSPECTION IX**

RE-INSPECTION FORM KEY

ITEM	DEFINITION
CND Condition	Corresponds to AHERA condition rating for materials. 0 : No Damage 1 : Damage 2 : Significant Damage
DP Damage Potential	Corresponds to the AHERA material assessment system. 1 : Potential for Damage 2 : Potential for Significant Damage
ASMD Assumed Asbestos	This means that a material was not sampled for asbestos content during the original Management Plan inspection.
RA Response Action	This corresponds to the AHERA system of response action rating for materials. 1 : Establish O&M Program 2 : Repair and Establish O&M Program 3 : Enclose 4 : Encapsulate 5 : Remove 6 : Partial Removal and Establish O&M Program
CHANGES	This section describes changes to the homogeneous material in the twenty-four years since the original AHERA inspection. The abbreviations are defined below. RMVD : Removed ENCL : Enclosed ENCP : Encapsulated DMGD : Damaged SMPLD : Sampled MTRL : Material RPRD : Repaired N/L : None Located RPLCD : Replaced

**SCHOOL DISTRICT OF PHILADELPHIA
AHERA THREE-YEAR RE-INSPECTION IX**

RE-INSPECTION FORM KEY

ITEM	DEFINITION												
THREE YEAR RE-INSPECTION	<p>This section contains the information obtained from the Three-Year Re-inspection IX. With three exceptions, the information categories are identical in format and meaning to those found in the original inspection data section. The three exceptions are defined below.</p>												
DMGD AMT Amount Damaged	<p>This section gives the quantity of damaged material in a homogeneous area. The quantity is shown in the same format as the amount of material/unit section.</p>												
NF Newly Friable	<p>This section identifies materials in the original Management Plan which have since become friable.</p>												
RA Response Action	<p>This rating is based on the AHERA regulations, and is comparable to the RA rating found in the "Original Inspection Data" section. The following table details the response actions.</p> <table><tr><td>1.</td><td>Establish O&M Program</td></tr><tr><td>2.</td><td>Repair and Establish O&M Program</td></tr><tr><td>3.</td><td>Enclose</td></tr><tr><td>4.</td><td>Encapsulate</td></tr><tr><td>5.</td><td>Remove</td></tr><tr><td>6.</td><td>Partial Removal and Establish O&M Program</td></tr></table> <p>a. High Priority Response The homogeneous material has been scheduled for abatement or other response action.</p> <p>b. Medium Priority Response The homogeneous material will be scheduled for abatement or other response action as soon as the high priority responses have been addressed.</p> <p>c. Low Priority Response The homogeneous material will be scheduled for abatement or other response action as soon as the medium priority responses have been addressed.</p> <p>d. On-Going Response/Operations and Maintenance The homogeneous material does not require abatement or other response action at present, and should be included in the facility's on-going operations and maintenance program.</p>	1.	Establish O&M Program	2.	Repair and Establish O&M Program	3.	Enclose	4.	Encapsulate	5.	Remove	6.	Partial Removal and Establish O&M Program
1.	Establish O&M Program												
2.	Repair and Establish O&M Program												
3.	Enclose												
4.	Encapsulate												
5.	Remove												
6.	Partial Removal and Establish O&M Program												

**SCHOOL DISTRICT OF PHILADELPHIA
AHERA THREE-YEAR RE-INSPECTION IX**

RE-INSPECTION FORM KEY

The information presented in the changes section has been compiled from a variety of sources, including the Re-inspection and the following:

- * Quality Control/Quality Assurance Reports of asbestos abatement projects, prepared by consultants to the School District.
- * Permit and Notification Forms for asbestos abatement projects.
- * Periodic Surveillance Forms
- * Operations and Maintenance activities performed by School District personnel.
- * Verbal information from School District personnel.
- * Reports of sampling and analysis of suspected materials by both School District personnel and outside consultants.

**ROOM BY
ROOM
LOCATION LOG
REPORT**

This section gives information, including damage amount and location, for a specific homogeneous material on a room-by-room basis and follows the Re-inspection form.

NOTE: The disparate nature of the above sources of information prohibits the verification of much information within the scope of the AHERA Three-Year Re-inspection. Discrepancies and omissions may exist in this information, and therefore is included on an "as is" basis. The inspectors for the Three-Year Re-inspection IX evaluated homogeneous areas based on the materials current condition and location, as evidenced during the inspector's site visit.

Section II - C

Room by Room Location Log Report

These charts are to be used for a quick reference* in order to avoid the unknowing disturbance of Asbestos Containing Materials during any and all Operations, Maintenance, Renovation, and/or Demolition activities at this location.

NOTE:

*Contact OEMS prior to the disturbance of any of the materials that are listed as **Confirmed and/or Assumed**.*

The quantities listed for (NAD) non-asbestos containing materials and/or Non-Suspect Materials are only estimated and were not measured for the purpose of this report. Field verification of quantities for renovation purposes would be necessary.

1310/3407 Mastery Charter @ Harrity 2015-2016 AHERA Three Year Report

School District of Philadelphia Mastery Charter School @ Harrity (K-8) 5601 Christian Street, Philadelphia, PA 19143 ULCS# 1310/3407 Year Built: 1913			AHERA Three-Year Reinspection 2015-2016 Room by Room Location Log Report										Reinspection Date: 1/6/16 Building Inspector: Norman Harrison Number: ACC-0915-6-011 Management Planner: Monique Causley Certificate Number: ACC-0215-8-010				
Element	Floor	Room	On Site Room Name	System Affected	Material Description	HID#	Confirmed Assumed NAD Non Suspect ACM	Amount of Material	SF LF EA	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic Crawl Space Ranking	Damage Potential (DP)	Newly Friable (NF)	Response Action (RA)
1	3	Teacher's Lounge Room 400	Teacher's Lounge Room 400	M	Floor Tile VAT 9" x 9"	1310/01/03/21	Confirmed	350	SF	0	SF	Green			1	No	1/D
1	3	Teacher's Lounge Room 400	Teacher's Lounge Room 400	N/A	Cement Floor		Non Suspect ACM	350	SF	0	SF				N/A	N/A	N/A
1	3	Teacher's Lounge Room 400	Teacher's Lounge Room 400	N/A	Ceiling Tile 2' x 4'		NAD	350	SF	0	SF				N/A	N/A	N/A
1	3	Teacher's Lounge Room 400	Teacher's Lounge Room 400	N/A	Concrete Ceiling		Non Suspect ACM	350	SF	0	SF				N/A	N/A	N/A
1	3	Teacher's Lounge Room 400	Teacher's Lounge Room 400	N/A	Brick Wall		Non Suspect ACM	1100	SF	0	SF				N/A	N/A	N/A
1	3	Teacher's Lounge Room 400	Teacher's Lounge Room 400	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	15	LF	0	LF				N/A	N/A	N/A
1	3	Teacher's Lounge Room 400	Teacher's Lounge Room 400	T	Pipe Fitting Insulation	1310/01/03/22	Confirmed	6	EA	1	EA				1	Yes	2/B
1	3	Elevator Equipment Room	Elevator Equipment Room	N/A	Cement Floor		Non Suspect ACM	56	SF	0	SF				N/A	N/A	N/A
1	3	Elevator Equipment Room	Elevator Equipment Room	N/A	Ceiling Tile 2' x 4'		NAD	56	SF	3	SF				N/A	N/A	N/A
1	3	Elevator Equipment Room	Elevator Equipment Room	N/A	Concrete Ceiling		Non Suspect ACM	56	SF	0	SF				N/A	N/A	N/A
1	3	Elevator Equipment Room	Elevator Equipment Room	N/A	Concrete Block Wall		Non Suspect ACM	300	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 401	Classroom 401	N/A	Wood Floor		Non Suspect ACM	840	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 401	Classroom 401	N/A	Fiberglass Ceiling Tile 2' x 4'		Non Suspect ACM	840	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 401	Classroom 401	N/A	Plaster Ceiling		NAD	840	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 401	Classroom 401	N/A	Plaster Walls		NAD	1395	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 401	Classroom 401	M	Blackboard Glue Dots	1300/01/03/USA/NH/2600	Assumed	5	SF	0	SF				1	No	1/D
1	3	Classroom 402	Classroom 402	N/A	Fiberglass Ceiling Tile 2' x 4'		Non Suspect ACM	840	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 402	Classroom 402	N/A	Plaster Ceiling		NAD	840	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 402	Classroom 402	N/A	Plaster Walls		NAD	1395	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 402	Classroom 402	N/A	Wood Floor		Non Suspect ACM	840	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 402	Classroom 402	M	Blackboard Glue Dots	1300/01/03/USA/NH/2600	Assumed	90	SF	0	SF				1	No	1/D
1	3	Office 403 adjacent to Classroom 402	Office 403 adjacent to Classroom 402	M	Floor Tile VAT 12" x 12"	1310/01/03/NN	Assumed	196	SF	0	SF	Blue			1	No	1/D
1	3	Office 403 adjacent to Classroom 402	Office 403 adjacent to Classroom 402	N/A	Cement Floor		Non Suspect ACM	196	SF	0	SF				N/A	N/A	N/A
1	3	Office 403 adjacent to Classroom 402	Office 403 adjacent to Classroom 402	N/A	Plaster Ceiling		NAD	196	SF	0	SF				N/A	N/A	N/A
1	3	Office 403 adjacent to Classroom 402	Office 403 adjacent to Classroom 402	N/A	Plaster Walls		NAD	300	SF	0	SF				N/A	N/A	N/A
1	3	Office 403 adjacent to Classroom 402	Office 403 adjacent to Classroom 402	M	Transite Cove Base	1310/01/03/VER/BB/2320	Assumed	70	SF	0	SF				1	No	1/D
1	3	Classroom 404	Classroom 404	N/A	Wood Floor		Non Suspect ACM	840	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 404	Classroom 404	N/A	Fiberglass Ceiling Tile 2' x 4'		Non Suspect ACM	868	SF	3	SF				N/A	N/A	N/A
1	3	Classroom 404	Classroom 404	N/A	Plaster Ceiling		NAD	868	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 404	Classroom 404	N/A	Plaster Walls		NAD	1080	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 404	Classroom 404	N/A	Sheetrock Wall		Non Suspect ACM	340	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 404	Classroom 404	M	Blackboard Glue Dots	1300/01/03/USA/NH/2600	Assumed	5	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 404 Small Closet	Classroom 404 Small Closet	N/A	Wood Ceiling		Non Suspect ACM	15	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 404 Small Closet	Classroom 404 Small Closet	N/A	Wood Walls		Non Suspect ACM	130	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 404 Small Closet	Classroom 404 Small Closet	N/A	Wood Floor		Non Suspect ACM	15	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 404 Large Closet	Classroom 404 Large Closet	N/A	Wood Ceiling		Non Suspect ACM	25	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 404 Large Closet	Classroom 404 Large Closet	N/A	Wood Walls		Non Suspect ACM	160	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 404 Large Closet	Classroom 404 Large Closet	N/A	Wood Floor		Non Suspect ACM	25	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 405	Classroom 405	N/A	Wood Floor		Non Suspect ACM	840	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 405	Classroom 405	N/A	Fiberglass Ceiling Tile 2' x 4'		Non Suspect ACM	840	SF	2	SF				N/A	N/A	N/A
1	3	Classroom 405	Classroom 405	N/A	Plaster Ceiling		NAD	840	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 405	Classroom 405	N/A	Plaster Walls		NAD	720	SF	0	SF		Wood		N/A	N/A	N/A
1	3	Classroom 405	Classroom 405	N/A	Partition Room Dividers		Non Suspect ACM	675	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 406	Classroom 406	N/A	Cement Floor		Non Suspect ACM	810	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 406	Classroom 406	M	Floor Tile VAT 12" x 12"	1310/01/03/NN	Assumed	810	SF	0	SF	White			1	No	1/D
1	3	Classroom 406	Classroom 406	N/A	Ceiling Tile 2' x 4'		NAD	810	SF	1	SF				N/A	N/A	N/A
1	3	Classroom 406	Classroom 406	N/A	Concrete Ceiling		Non Suspect ACM	810	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 406	Classroom 406	N/A	Concrete Block Wall		Non Suspect ACM	960	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 406	Classroom 406	N/A	Sheetrock Wall		Non Suspect ACM	180	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 406	Classroom 406	M	Transite	1310/01/03/VER/BB/2305	Assumed	6	SF	0	SF				1	No	1/D
1	3	Classroom 406	Classroom 406	M	Sink Undercoat Mastic	1310/01/03/VER/BB/2602	Assumed	16	SF	0	SF	Black			1	No	1/D
1	3	Classroom 407	Classroom 407	N/A	Wood Floor		Non Suspect ACM	840	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 407	Classroom 407	M	Floor Tile VAT 12" x 12"	1310/01/03/NN	Assumed	811	SF	0	SF	White			1	No	1/D
1	3	Classroom 407	Classroom 407	M	Floor Tile VAT 12" x 12"	1310/01/03/NN	Assumed	23	SF	0	SF	Tan			1	No	1/D
1	3	Classroom 407	Classroom 407	M	Floor Tile VAT 12" x 12"	1310/01/03/NN	Assumed	6	SF	0	SF	Blue			1	No	1/D
1	3	Classroom 407	Classroom 407	N/A	Ceiling Tile 2' x 4'		NAD	840	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 407	Classroom 407	N/A	Plaster Ceiling		NAD	840	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 407	Classroom 407	N/A	Plaster Walls		NAD	720	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 407	Classroom 407	N/A	Sheetrock Wall		Non Suspect ACM	675	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 408 (Art)	Classroom 408 (Art)	M	Floor Tile VAT 12" x 12"	1310/01/03/NN	Assumed	810	SF	0	SF	White			1	No	1/D
1	3	Classroom 408 (Art)	Classroom 408 (Art)	N/A	Cement Floor		Non Suspect ACM	810	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 408 (Art)	Classroom 408 (Art)	N/A	Ceiling Tile 2' x 4'		NAD	810	SF	1	SF				N/A	N/A	N/A
1	3	Classroom 408 (Art)	Classroom 408 (Art)	N/A	Concrete Ceiling		Non Suspect ACM	810	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 408 (Art)	Classroom 408 (Art)	N/A	Concrete Block Wall		Non Suspect ACM	960	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 408 (Art)	Classroom 408 (Art)	N/A	Sheetrock Wall		Non Suspect ACM	180	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 408 (Art)	Classroom 408 (Art)	M	Transite	1310/01/03/VER/BB/2305	Assumed	18	SF	0	SF				1	No	1/D
1	3	Classroom 408 (Art)	Classroom 408 (Art)	M	Transite	1310/01/03/VER/BB/2305	Assumed	6	SF	0	SF				1	No	1/D
1	3	Classroom 409	Classroom 409	N/A	Wood Floor		Non Suspect ACM	840	SF	1	SF				N/A	N/A	N/A
1	3	Classroom 409	Classroom 409	M	Floor Tile VAT 12" x 12"	1310/01/03/NN	Assumed	838	SF	1	SF	White			1	No	6/C
1	3	Classroom 409	Classroom 409	M	Floor Tile VAT 12" x 12"	1310/01/03/NN	Assumed	2	SF	0	SF	Blue			1	No	1/D
1	3	Classroom 409	Classroom 409	N/A	Ceiling Tile 2' x 4'		NAD	840	SF	2	SF				N/A	N/A	N/A
1	3	Classroom 409	Classroom 409	N/A	Plaster Ceiling		NAD	840	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 409	Classroom 409	N/A	Plaster Walls		NAD	720	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 409	Classroom 409	N/A	Sheetrock Wall		Non Suspect ACM	675	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 409	Classroom 409	M	Blackboard Glue Dots	1300/01/03/USA/NH/2600	Assumed	5	SF	0	SF				1	No	1/D

1310/3407 Mastery Charter @ Harrity 2015-2016 AHERA Three Year Report

School District of Philadelphia Mastery Charter School @ Harrity (K-8) 5601 Christian Street, Philadelphia, PA 19143 ULCS# 1310/3407 Year Built: 1913		AHERA Three-Year Reinspection 2015-2016 Room by Room Location Log Report										Reinspection Date: 1/6/16 Building Inspector: Norman Harrison Number: ACC-0915-6-011 Management Planner: Monique Causley Certificate Number: ACC-0215-8-010					
E l e m e n t	F l o o r																
		On Site Room Name	System Affected	Material Description	HID#	Confirmed Assumed NAD Non Suspect ACM	Amount of Material	SF LF EA	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic Crawl Space Ranking	Damage Potential (DP)	Newly Friable (NF)	Response Action (RA)	
1	3	Classroom 410	N/A	Wood Floor		Non Suspect ACM	840	SF	0	SF						N/A	
1	3	Classroom 410	N/A	Fiberglass Ceiling Tile 2' x 4'		Non Suspect ACM	868	SF	2	SF						N/A	
1	3	Classroom 410	N/A	Plaster Ceiling		NAD	868	SF	0	SF						N/A	
1	3	Classroom 410	N/A	Plaster Walls		NAD	1080	SF	0	SF						N/A	
1	3	Classroom 410	M	Blackboard Glue Dots	1300/01/03/USA/NH/2600	Assumed	5	SF	0	SF				1	No	1/D	
1	3	Classroom 410	N/A	Partition Room Dividers		Non Suspect ACM	340	SF	0	SF		Wood		N/A	N/A	N/A	
1	3	Classroom 410 Small Closet	N/A	Wood Ceiling		Non Suspect ACM	15	SF	0	SF				N/A	N/A	N/A	
1	3	Classroom 410 Small Closet	N/A	Wood Walls		Non Suspect ACM	130	SF	0	SF				N/A	N/A	N/A	
1	3	Classroom 410 Small Closet	N/A	Wood Floor		Non Suspect ACM	15	SF	0	SF				N/A	N/A	N/A	
1	3	Classroom 410 Large Closet	N/A	Wood Ceiling		Non Suspect ACM	25	SF	0	SF				N/A	N/A	N/A	
1	3	Classroom 410 Large Closet	N/A	Wood Walls		Non Suspect ACM	160	SF	0	SF				N/A	N/A	N/A	
1	3	Classroom 410 Large Closet	N/A	Wood Floor		Non Suspect ACM	25	SF	0	SF				N/A	N/A	N/A	
1	3	Office 411	N/A	Wood Floor		Non Suspect ACM	195	SF	0	SF				N/A	N/A	N/A	
1	3	Office 411	N/A	Plaster Ceiling		NAD	195	SF	0	SF				N/A	N/A	N/A	
1	3	Office 411	N/A	Plaster Walls		NAD	350	SF	0	SF				N/A	N/A	N/A	
1	3	Office 411	N/A	Wood Walls		Non Suspect ACM	125	SF	0	SF				N/A	N/A	N/A	
1	3	Office 411 Restroom	N/A	Wood Floor		Non Suspect ACM	50	SF	0	SF				N/A	N/A	N/A	
1	3	Office 411 Restroom	N/A	Plaster Ceiling		NAD	50	SF	0	SF				N/A	N/A	N/A	
1	3	Office 411 Restroom	N/A	Plaster Walls		NAD	125	SF	5	SF				N/A	N/A	N/A	
1	3	Office 411 Restroom	N/A	Wood Panel Wall		Non Suspect ACM	125	SF	0	SF				N/A	N/A	N/A	
1	3	Office 412	N/A	Carpet		Non Suspect ACM	196	SF	0	SF				N/A	N/A	N/A	
1	3	Office 412	N/A	Cement Floor		Non Suspect ACM	196	SF	0	SF				N/A	N/A	N/A	
1	3	Office 412	N/A	Plaster Ceiling		NAD	196	SF	0	SF				N/A	N/A	N/A	
1	3	Office 412	N/A	Plaster Walls		NAD	300	SF	0	SF				N/A	N/A	N/A	
1	3	Office 412	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	30	LF	0	LF				N/A	N/A	N/A	
1	3	Office 412	N/A	Fiberglass Pipe Fitting Insulation		Non Suspect ACM	6	EA	0	EA				N/A	N/A	N/A	
1	3	Office 412	M	Transite Cove Base	1310/01/03/VER/BB/2320	Assumed	70	SF	0	SF				1	No	1/D	
1	3	Office 412 Closet	N/A	Concrete Ceiling		Non Suspect ACM	15	SF	0	SF				N/A	N/A	N/A	
1	3	Office 412 Closet	N/A	Concrete Block Wall		Non Suspect ACM	80	SF	0	SF				N/A	N/A	N/A	
1	3	Office 412 Closet	N/A	Cement Floor		Non Suspect ACM	15	SF	0	SF				N/A	N/A	N/A	
1	3	Classroom 413	N/A	Wood Floor		Non Suspect ACM	840	SF	0	SF				N/A	N/A	N/A	
1	3	Classroom 413	N/A	Fiberglass Ceiling Tile 2' x 4'		Non Suspect ACM	840	SF	2	SF				N/A	N/A	N/A	
1	3	Classroom 413	N/A	Plaster Ceiling		NAD	840	SF	0	SF				N/A	N/A	N/A	
1	3	Classroom 413	N/A	Plaster Walls		NAD	1395	SF	0	SF				N/A	N/A	N/A	
1	3	Classroom 413	M	Blackboard Glue Dots	1300/01/03/USA/NH/2600	Assumed	5	SF	0	SF				N/A	N/A	N/A	
1	3	Classroom 414	N/A	Wood Floor		Non Suspect ACM	840	SF	0	SF				N/A	N/A	N/A	
1	3	Classroom 414	N/A	Fiberglass Ceiling Tile 2' x 4'		Non Suspect ACM	800	SF	2	SF				N/A	N/A	N/A	
1	3	Classroom 414	N/A	Plaster Ceiling		NAD	800	SF	0	SF				N/A	N/A	N/A	
1	3	Classroom 414	N/A	Plaster Walls		NAD	1235	SF	0	SF				N/A	N/A	N/A	
1	3	Classroom 414	N/A	Sheetrock Wall		Non Suspect ACM	160	SF	0	SF				N/A	N/A	N/A	
1	3	Classroom 414	M	Blackboard Glue Dots	1300/01/03/USA/NH/2600	Assumed	5	SF	0	SF				N/A	N/A	N/A	
1	3	Classroom 414 Restroom	N/A	Fiberglass Ceiling Tile 2' x 4'		Non Suspect ACM	40	SF	0	SF				N/A	N/A	N/A	
1	3	Classroom 414 Restroom	N/A	Plaster Ceiling		NAD	40	SF	0	SF				N/A	N/A	N/A	
1	3	Classroom 414 Restroom	N/A	Plaster Walls		NAD	160	SF	0	SF				N/A	N/A	N/A	
1	3	Classroom 414 Restroom	N/A	Sheetrock Wall		Non Suspect ACM	160	SF	0	SF				N/A	N/A	N/A	
1	3	Classroom 414 Restroom	N/A	Ceramic Tile Floors		Non Suspect ACM	40	SF	0	SF				N/A	N/A	N/A	
1	3	Classroom 415	M	Floor Tile VAT 9" x 9"	1310/01/03/21	Confirmed	258	SF	0	SF	Green			1	No	1/D	
1	3	Classroom 415	N/A	Fiberglass Ceiling Tile 2' x 4'		Non Suspect ACM	323	SF	0	SF				N/A	N/A	N/A	
1	3	Classroom 415	N/A	Concrete Ceiling		Non Suspect ACM	323	SF	0	SF				N/A	N/A	N/A	
1	3	Classroom 415	N/A	Concrete Block Wall		Non Suspect ACM	865	SF	0	SF				N/A	N/A	N/A	
1	3	Classroom 415	M	Floor Tile VAT 12" x 12"	1310/01/03/NN	Assumed	42	SF	0	SF	Blue	This blue 12x12 is different than the other blue 12x12 in this space.		1	No	1/D	
1	3	Classroom 415	M	Floor Tile VAT 12" x 12"	1310/01/03/NN	Assumed	23	SF	0	SF	Blue			1	No	1/D	
1	3	Girl's Restroom	N/A	Ceramic Tile Floors		Non Suspect ACM	209	SF	0	SF				N/A	N/A	N/A	
1	3	Girl's Restroom	N/A	Plaster Ceiling		NAD	209	SF	0	SF				N/A	N/A	N/A	
1	3	Girl's Restroom	N/A	Concrete Block Wall		Non Suspect ACM	600	SF	0	SF				N/A	N/A	N/A	
1	3	Girl's Restroom Pipe Chase	T	Pipe Fitting Insulation	1310/01/03/22	Confirmed	27	EA	0	EA				1	No	1/D	
1	3	Girl's Restroom Pipe Chase	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	75	LF	0	LF				N/A	N/A	N/A	
1	3	Girl's Restroom Pipe Chase	N/A	Concrete Ceiling		Non Suspect ACM	45	SF	0	SF				N/A	N/A	N/A	
1	3	Girl's Restroom Pipe Chase	N/A	Concrete Block Wall		Non Suspect ACM	360	SF	0	SF				N/A	N/A	N/A	
1	3	Girl's Restroom Pipe Chase	N/A	Cement Floor		Non Suspect ACM	45	SF	0	SF				N/A	N/A	N/A	
1	3	Men's Restroom	N/A	Ceramic Tile Floors		Non Suspect ACM	56	SF	0	SF				N/A	N/A	N/A	
1	3	Men's Restroom	N/A	Plaster Ceiling		NAD	56	SF	0	SF				N/A	N/A	N/A	
1	3	Men's Restroom	N/A	Concrete Block Wall		Non Suspect ACM	300	SF	0	SF				N/A	N/A	N/A	
1	3	Women's Restroom	N/A	Ceramic Tile Floors		Non Suspect ACM	42	SF	0	SF				N/A	N/A	N/A	
1	3	Women's Restroom	N/A	Plaster Ceiling		NAD	42	SF	0	SF				N/A	N/A	N/A	
1	3	Women's Restroom	N/A	Concrete Block Wall		Non Suspect ACM	260	SF	0	SF				N/A	N/A	N/A	
1	3	Custodial Closet between Boy's and Women's Restrooms	N/A	Plaster Ceiling		NAD	40	SF	0	SF				N/A	N/A	N/A	
1	3	Custodial Closet between Boy's and Women's Restrooms	N/A	Concrete Block Wall		Non Suspect ACM	240	SF	0	SF				N/A	N/A	N/A	
1	3	Custodial Closet between Boy's and Women's Restrooms	N/A	Cement Floor		Non Suspect ACM	40	SF	0	SF				N/A	N/A	N/A	
1	3	Boy's Restroom	N/A	Ceramic Tile Floors		Non Suspect ACM	209	SF	0	SF				N/A	N/A	N/A	
1	3	Boy's Restroom	N/A	Plaster Ceiling		NAD	209	SF	0	SF				N/A	N/A	N/A	
1	3	Boy's Restroom	N/A	Concrete Block Wall		Non Suspect ACM	600	SF	0	SF				N/A	N/A	N/A	

1310/3407 Mastery Charter @ Harrity 2015-2016 AHERA Three Year Report

School District of Philadelphia Mastery Charter School @ Harrity (K-8) 5601 Christian Street, Philadelphia, PA 19143 ULCS# 1310/3407 Year Built: 1913			AHERA Three-Year Reinspection 2015-2016 Room by Room Location Log Report										Reinspection Date: 1/6/16 Building Inspector: Norman Harrison Number: ACC-0915-6-011 Management Planner: Monique Causley Certificate Number: ACC-0215-8-010			
Element	Floor	On Site Room Name	System Affected	Material Description	HID#	Confirmed Assumed NAD Non Suspect ACM	Amount of Material	SF LF EA	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic Crawl Space Ranking	Damage Potential (DP)	Newly Friable (NF)	Response Action (RA)
1	3	Hallway from Classroom 415 to Office 412	M	Floor Tile VAT 9" x 9"	1310/01/03/21	Confirmed	45	SF	0	SF	Green			1	No	1/D
1	3	Hallway from Classroom 415 to Office 412	N/A	Ceiling Tile 2' x 4'		NAD	567	SF	0	SF				N/A	N/A	N/A
1	3	Hallway from Classroom 415 to Office 412	N/A	Plaster Ceiling		NAD	567	SF	0	SF				N/A	N/A	N/A
1	3	Hallway from Classroom 415 to Office 412	N/A	Concrete Block Wall		Non Suspect ACM	160	SF	0	SF				N/A	N/A	N/A
1	3	Hallway from Classroom 415 to Office 412	N/A	Cement Floor		Non Suspect ACM	567	SF	0	SF				N/A	N/A	N/A
1	3	Hallway from Classroom 415 to Office 412	N/A	Plaster Walls		NAD	1620	SF	0	SF				N/A	N/A	N/A
1	3	Hallway from Classroom 415 to Office 412	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	20	LF	0	LF				N/A	N/A	N/A
1	3	Hallway from Classroom 415 to Office 412	M	Transite Cove Base	1310/01/03/VER/BB/2320	Assumed	162	SF	0	SF				1	No	1/D
1	3	Hallway outside Teacher's Lounge 400 to Office 403	M	Floor Tile VAT 9" x 9"	1310/01/03/21	Confirmed	205	SF	5	SF	Green			1	No	6/C
1	3	Hallway outside Teacher's Lounge 400 to Office 403	N/A	Ceiling Tile 2' x 4'		NAD	630	SF	1	SF				N/A	N/A	N/A
1	3	Hallway outside Teacher's Lounge 400 to Office 403	N/A	Plaster Ceiling		NAD	630	SF	0	SF				N/A	N/A	N/A
1	3	Hallway outside Teacher's Lounge 400 to Office 403	N/A	Concrete Block Wall		Non Suspect ACM	390	SF	0	SF				N/A	N/A	N/A
1	3	Hallway outside Teacher's Lounge 400 to Office 403	N/A	Cement Floor		Non Suspect ACM	630	SF	0	SF				N/A	N/A	N/A
1	3	Hallway outside Teacher's Lounge 400 to Office 403	N/A	Plaster Walls		NAD	1800	SF	0	SF				N/A	N/A	N/A
1	3	Hallway outside Teacher's Lounge 400 to Office 403	M	Transite Cove Base	1310/01/03/VER/BB/2320	Assumed	180	SF	0	SF				1	No	1/D
1	3	Hallway outside Classrooms 404-410	N/A	Cement Floor		Non Suspect ACM	1380	SF	0	SF				N/A	N/A	N/A
1	3	Hallway outside Classrooms 404-410	N/A	Ceiling Tile 2' x 4'		NAD	1380	SF	0	SF				N/A	N/A	N/A
1	3	Hallway outside Classrooms 404-410	N/A	Plaster Ceiling		NAD	1380	SF	0	SF				N/A	N/A	N/A
1	3	Hallway outside Classrooms 404-410	M	Transite Cove Base	1310/01/03/VER/BB/2320	Assumed	225	SF	0	SF				1	No	1/D
1	3	Stairwell 4 adjacent to Classroom 415	N/A	Cement Floor		Non Suspect ACM	324	SF	0	SF				N/A	N/A	N/A
1	3	Stairwell 4 adjacent to Classroom 415	N/A	Fiberglass Ceiling Tile 2' x 4'		Non Suspect ACM	324	SF	0	SF				N/A	N/A	N/A
1	3	Stairwell 4 adjacent to Classroom 415	N/A	Concrete Ceiling		Non Suspect ACM	324	SF	0	SF				N/A	N/A	N/A
1	3	Stairwell 4 adjacent to Classroom 415	N/A	Concrete Block Wall		Non Suspect ACM	715	SF	0	SF				N/A	N/A	N/A
1	3	Stairwell 4 adjacent to Classroom 415	N/A	Brick Wall		Non Suspect ACM	380	SF	0	SF				N/A	N/A	N/A
1	3	Stairwell 3 adjacent to Classroom 410	N/A	Cement Floor		Non Suspect ACM	266	SF	0	SF				N/A	N/A	N/A
1	3	Stairwell 3 adjacent to Classroom 410	N/A	Plaster Ceiling		NAD	266	SF	0	SF				N/A	N/A	N/A
1	3	Stairwell 3 adjacent to Classroom 410	N/A	Plaster Walls		NAD	925	SF	0	SF				N/A	N/A	N/A
1	3	Stairwell 3 adjacent to Classroom 410	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	20	LF	0	LF				N/A	N/A	N/A
1	3	Stairwell 3 adjacent to Classroom 410	M	Transite Cove Base	1310/01/03/VER/BB/2320	Assumed	70	SF	0	SF				1	No	1/D
1	3	Stairwell 2 adjacent to Classroom 404	N/A	Cement Floor		Non Suspect ACM	240	SF	0	SF				N/A	N/A	N/A
1	3	Stairwell 2 adjacent to Classroom 404	N/A	Plaster Ceiling		NAD	240	SF	5	SF				N/A	N/A	N/A
1	3	Stairwell 2 adjacent to Classroom 404	N/A	Plaster Walls		NAD	955	SF	0	SF				N/A	N/A	N/A
1	3	Stairwell 2 adjacent to Classroom 404	M	Transite Cove Base	1310/01/03/VER/BB/2320	Assumed	70	SF	0	SF				1	No	1/D
1	3	Stairwell 1 adjacent to Teacher's Lounge 400	N/A	Cement Floor		Non Suspect ACM	324	SF	0	SF				N/A	N/A	N/A
1	3	Stairwell 1 adjacent to Teacher's Lounge 400	N/A	Fiberglass Ceiling Tile 2' x 4'		Non Suspect ACM	162	SF	0	SF				N/A	N/A	N/A
1	3	Stairwell 1 adjacent to Teacher's Lounge 400	N/A	Ceiling Tile 2' x 4'		NAD	162	SF	5	SF				N/A	N/A	N/A
1	3	Stairwell 1 adjacent to Teacher's Lounge 400	N/A	Concrete Ceiling		Non Suspect ACM	324	SF	0	SF				N/A	N/A	N/A
1	3	Stairwell 1 adjacent to Teacher's Lounge 400	N/A	Brick Wall		Non Suspect ACM	380	SF	0	SF				N/A	N/A	N/A
1	3	Stairwell 1 adjacent to Teacher's Lounge 400	N/A	Concrete Block Wall		Non Suspect ACM	715	SF	0	SF				N/A	N/A	N/A
1	2	IMC Lobby	N/A	Ceiling Tile 2' x 4'		NAD	285	SF	0	SF				N/A	N/A	N/A
1	2	IMC Lobby	N/A	Concrete Ceiling		Non Suspect ACM	285	SF	0	SF				N/A	N/A	N/A
1	2	IMC Lobby	N/A	Concrete Block Wall		Non Suspect ACM	280	SF	0	SF				N/A	N/A	N/A
1	2	IMC Lobby	N/A	Sheetrock Wall		Non Suspect ACM	280	SF	0	SF				N/A	N/A	N/A
1	2	IMC Lobby	N/A	Carpet		Non Suspect ACM	285	SF	0	SF				N/A	N/A	N/A
1	2	IMC Lobby	N/A	Cement Floor		Non Suspect ACM	285	SF	0	SF				N/A	N/A	N/A
1	2	IMC Lobby Storage Alcove	N/A	Fiberglass Ceiling Tile 2' x 4'		Non Suspect ACM	30	SF	0	SF				N/A	N/A	N/A
1	2	IMC Lobby Storage Alcove	N/A	Concrete Ceiling		Non Suspect ACM	30	SF	0	SF				N/A	N/A	N/A
1	2	IMC Lobby Storage Alcove	N/A	Concrete Block Wall		Non Suspect ACM	220	SF	0	SF				N/A	N/A	N/A
1	2	IMC Lobby Storage Alcove	N/A	Carpet		Non Suspect ACM	30	SF	0	SF				N/A	N/A	N/A
1	2	IMC Lobby Storage Alcove	N/A	Cement Floor		Non Suspect ACM	30	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 300A	N/A	Ceiling Tile 2' x 4'		NAD	265	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 300A	N/A	Concrete Ceiling		Non Suspect ACM	265	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 300A	N/A	Concrete Block Wall		Non Suspect ACM	350	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 300A	N/A	Wood Walls		Non Suspect ACM	350	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 300A	N/A	Carpet		Non Suspect ACM	265	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 300A	N/A	Cement Floor		Non Suspect ACM	265	SF	0	SF		Sink is present but could not be accessed for sink undercoat mastic due to stored materials.		N/A	N/A	N/A
1	2	Classroom 300A Closet	x	x		x	x	x	x	x	x			1	No	1/D
1	2	IMC 300B	N/A	Carpet		Non Suspect ACM	1030	SF	0	SF				N/A	N/A	N/A
1	2	IMC 300B	N/A	Cement Floor		Non Suspect ACM	1030	SF	0	SF				N/A	N/A	N/A
1	2	IMC 300B	N/A	Ceiling Tile 2' x 4'		NAD	1030	SF	1	SF				N/A	N/A	N/A
1	2	IMC 300B	N/A	Concrete Ceiling		Non Suspect ACM	1030	SF	0	SF				N/A	N/A	N/A
1	2	IMC 300B	N/A	Concrete Block Wall		Non Suspect ACM	1030	SF	0	SF				N/A	N/A	N/A
1	2	IMC 300B	N/A	Sheetrock Wall		Non Suspect ACM	270	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 300C	N/A	Carpet		Non Suspect ACM	650	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 300C	N/A	Cement Floor		Non Suspect ACM	650	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 300C	N/A	Ceiling Tile 2' x 4'		NAD	650	SF	3	SF				N/A	N/A	N/A
1	2	Classroom 300C	N/A	Concrete Ceiling		Non Suspect ACM	650	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 300C	N/A	Concrete Block Wall		Non Suspect ACM	560	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 300C	N/A	Sheetrock Wall		Non Suspect ACM	560	SF	0	SF				N/A	N/A	N/A
1	2	IMC Copy Room	N/A	Fiberglass Ceiling Tile 2' x 4'		Non Suspect ACM	340	SF	3	SF				N/A	N/A	N/A
1	2	IMC Copy Room	N/A	Concrete Ceiling		Non Suspect ACM	340	SF	0	SF				N/A	N/A	N/A

1310/3407 Mastery Charter @ Harrity 2015-2016 AHERA Three Year Report

School District of Philadelphia		AHERA Three-Year Reinspection 2015-2016										Reinspection Date: 1/6/16				
Mastery Charter School @ Harrity (K-8)		Room by Room Location Log Report										Building Inspector: Norman Harrison				
5601 Christian Street, Philadelphia, PA 19143												Number: ACC-0915-6-011				
ULCS# 1310/3407												Management Planner: Monique Causley				
Year Built: 1913												Certificate Number: ACC-0215-8-010				
Element	Floor	On Site Room Name	System Affected	Material Description	HID#	Confirmed Assumed NAD Non Suspect ACM	Amount of Material	SF LF EA	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic Crawl Space Ranking	Damage Potential (DP)	Newly Friable (NF)	Response Action (RA)
1	2	IMC Copy Room	N/A	Concrete Block Wall		Non Suspect ACM	800	SF	0	SF				N/A	N/A	N/A
1	2	IMC Copy Room	M	Floor Tile VAT 9" x 9"	1310/01/02/16	Confirmed	340	SF	0	SF	Green			1	No	1/D
1	2	IMC Copy Room	N/A	Cement Floor		Non Suspect ACM	340	SF	0	SF				N/A	N/A	N/A
1	2	IMC Copy Room	M	Sink Undercoat Mastic	1310/01/02/VER/BB/2602	Assumed	10	SF	0	SF				1	No	1/D
1	2	IMC Copy Room Closet	N/A	Fiberglass Ceiling Tile 2' x 4'		Non Suspect ACM	20	SF	2	SF				N/A	N/A	N/A
1	2	IMC Copy Room Closet	N/A	Concrete Ceiling		Non Suspect ACM	20	SF	0	SF				N/A	N/A	N/A
1	2	IMC Copy Room Closet	N/A	Concrete Block Wall		Non Suspect ACM	280	SF	0	SF				N/A	N/A	N/A
1	2	IMC Copy Room Closet	M	Floor Tile VAT 9" x 9"	1310/01/02/16	Confirmed	20	SF	0	SF	Green			1	No	1/D
1	2	IMC Copy Room Closet	N/A	Cement Floor		Non Suspect ACM	20	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 301	N/A	Fiberglass Ceiling Tile 2' x 4'		Non Suspect ACM	265	SF	0	SF		Inspector did not list		N/A	N/A	N/A
1	2	Classroom 301	N/A	Concrete Ceiling		Non Suspect ACM	265	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 301	N/A	Concrete Block Wall		Non Suspect ACM	700	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 301	M	Floor Tile VAT 12" x 12"	1310/01/02/DD	Assumed	265	SF	0	SF				1	No	1/D
1	2	Classroom 301	N/A	Cement Floor		Non Suspect ACM	265	SF	0	SF				N/A	N/A	N/A
1	2	Storage Room adjacent to Elevator	M	Floor Tile VAT 9" x 9"	1310/01/02/16	Confirmed	60	SF	0	SF	Green			1	No	1/D
1	2	Storage Room adjacent to Elevator	N/A	Cement Floor		Non Suspect ACM	60	SF	0	SF				N/A	N/A	N/A
1	2	Storage Room adjacent to Elevator	N/A	Fiberglass Ceiling Tile 2' x 4'		Non Suspect ACM	60	SF	7	SF				N/A	N/A	N/A
1	2	Storage Room adjacent to Elevator	N/A	Concrete Ceiling		Non Suspect ACM	60	SF	0	SF				N/A	N/A	N/A
1	2	Storage Room adjacent to Elevator	N/A	Concrete Block Wall		Non Suspect ACM	300	SF	0	SF				N/A	N/A	N/A
1	2	Storage Room adjacent to Elevator	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	20	LF	0	LF				N/A	N/A	N/A
1	2	Classroom 302	N/A	Wood Floor		Non Suspect ACM	840	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 302	N/A	Fiberglass Ceiling Tile 2' x 4'		Non Suspect ACM	840	SF	2	SF				N/A	N/A	N/A
1	2	Classroom 302	N/A	Plaster Ceiling		NAD	840	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 302	N/A	Plaster Walls		NAD	1100	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 302	M	Blackboard Glue Dots	1300/01/02/USA/NH/2600	Assumed	5	SF	0	SF				1	No	1/D
1	2	Classroom 302	T	Pipe Insulation 2-6 inch	1310/01/02/14	Confirmed	24	LF	0	LF		More likely above ceiling tile.		1	No	1/D
1	2	Classroom 303	N/A	Wood Floor		Non Suspect ACM	840	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 303	N/A	Fiberglass Ceiling Tile 2' x 4'		Non Suspect ACM	840	SF	2	SF				N/A	N/A	N/A
1	2	Classroom 303	N/A	Plaster Ceiling		NAD	840	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 303	N/A	Plaster Walls		NAD	1100	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 303	M	Blackboard Glue Dots	1300/01/02/USA/NH/2600	Assumed	5	SF	0	SF				1	No	1/D
1	2	Classroom 303	T	Pipe Insulation 2-6 inch	1310/01/02/14	Confirmed	24	LF	0	LF		More likely above ceiling tile.		1	No	1/D
1	2	Classroom 304	N/A	Ceiling Tile 2' x 4'		NAD	320	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 304	N/A	Plaster Ceiling		NAD	320	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 304	N/A	Concrete Block Wall		Non Suspect ACM	720	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 304	M	Floor Tile VAT 9" x 9"	1310/01/02/16	Confirmed	305	SF	0	SF				1	No	1/D
1	2	Classroom 304	M	Floor Tile VAT 9" x 9"	1310/01/02/16	Confirmed	15	SF	0	SF				1	No	1/D
1	2	Classroom 304	N/A	Cement Floor		Non Suspect ACM	320	SF	0	SF				N/A	N/A	N/A
1	2	Mechanical Room adjacent to Classroom 304	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	125	LF	0	LF				N/A	N/A	N/A
1	2	Mechanical Room adjacent to Classroom 304	N/A	Plaster Ceiling		NAD	320	SF	0	SF				N/A	N/A	N/A
1	2	Mechanical Room adjacent to Classroom 304	N/A	Plaster Walls		NAD	200	SF	0	SF				N/A	N/A	N/A
1	2	Mechanical Room adjacent to Classroom 304	N/A	Concrete Block Wall		Non Suspect ACM	520	SF	0	SF				N/A	N/A	N/A
1	2	Mechanical Room adjacent to Classroom 304	N/A	Cement Floor		Non Suspect ACM	320	SF	0	SF				N/A	N/A	N/A
1	2	Mechanical Room adjacent to Classroom 304	M	Vibration Damper Cloth	1310/01/02/JJ	Assumed	20	SF	0	SF				1	No	1/D
1	2	Office 305	M	Floor Tile VAT 12" x 12"	1310/01/02/DD	Assumed	320	SF	0	SF	Grey			1	No	1/D
1	2	Office 305	N/A	Cement Floor		Non Suspect ACM	320	SF	0	SF				N/A	N/A	N/A
1	2	Office 305	N/A	Plaster Ceiling		NAD	320	SF	0	SF				N/A	N/A	N/A
1	2	Office 305	N/A	Plaster Walls		NAD	500	SF	0	SF				N/A	N/A	N/A
1	2	Office 305	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	6	LF	0	LF				N/A	N/A	N/A
1	2	Office 305	N/A	Fiberglass Pipe Fitting Insulation		Non Suspect ACM	6	EA	0	EA				N/A	N/A	N/A
1	2	Office 305	N/A	Transite Cove Base	1310/01/02/VER/BB/2320	Assumed	72	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 306	N/A	Wood Floor		Non Suspect ACM	840	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 306	N/A	Fiberglass Ceiling Tile 2' x 4'		Non Suspect ACM	780	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 306	N/A	Plaster Ceiling		NAD	780	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 306	N/A	Plaster Walls		NAD	775	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 306	N/A	Sheetrock Wall		Non Suspect ACM	235	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 306	M	Blackboard Glue Dots	1300/01/02/USA/NH/2600	Assumed	5	SF	0	SF				1	No	1/D
1	2	Classroom 306	T	Pipe Insulation 2-6 inch	1310/01/02/14	Confirmed	24	LF	0	LF		More likely above ceiling tile.		1	No	1/D
1	2	Classroom 306 Small Closet	N/A	Wood Ceiling		Non Suspect ACM	15	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 306 Small Closet	N/A	Wood Walls		Non Suspect ACM	130	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 306 Small Closet	N/A	Wood Floor		Non Suspect ACM	15	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 306 Large Closet	N/A	Wood Ceiling		Non Suspect ACM	25	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 306 Large Closet	N/A	Wood Walls		Non Suspect ACM	160	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 306 Large Closet	N/A	Wood Floor		Non Suspect ACM	25	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 307	N/A	Wood Floor		Non Suspect ACM	840	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 307	N/A	Fiberglass Ceiling Tile 2' x 4'		Non Suspect ACM	840	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 307	N/A	Plaster Ceiling		NAD	840	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 307	N/A	Plaster Walls		NAD	720	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 307	T	Pipe Insulation 2-6 inch	1310/01/02/14	Confirmed	24	LF	0	LF		More likely above ceiling tile.		1	No	1/D
1	2	Classroom 307	N/A	Partition Room Dividers		Non Suspect ACM	675	SF	0	SF	Wood			N/A	N/A	N/A
1	2	Classroom 308	N/A	Wood Floor		Non Suspect ACM	840	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 308	N/A	Fiberglass Ceiling Tile 2' x 4'		Non Suspect ACM	840	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 308	N/A	Plaster Ceiling		NAD	840	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 308	N/A	Plaster Walls		NAD	720	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 308	N/A	Partition Room Dividers		Non Suspect ACM	340	SF	0	SF				N/A	N/A	N/A

1310/3407 Mastery Charter @ Harrity 2015-2016 AHERA Three Year Report

School District of Philadelphia Mastery Charter School @ Harrity (K-8) 5601 Christian Street, Philadelphia, PA 19143 ULCS# 1310/3407 Year Built: 1913			AHERA Three-Year Reinspection 2015-2016 Room by Room Location Log Report										Reinspection Date: 1/6/16 Building Inspector: Norman Harrison Number: ACC-0915-6-011 Management Planner: Monique Causley Certificate Number: ACC-0215-8-010			
E l e m e n t	F l o o r	On Site Room Name	System Affected	Material Description	HID#	Confirmed Assumed NAD Non Suspect ACM	Amount of Material	SF LF EA	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic Crawl Space Ranking	Damage Potential (DP)	Newly Friable (NF)	Response Action (RA)
1	2	Classroom 308	N/A	Sheetrock Wall		Non Suspect ACM	340	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 308	M	Blackboard Glue Dots	1300/01/02/USA/NH/2600	Assumed	5	SF	0	SF				1	No	1/D
1	2	Classroom 308	T	Pipe Insulation 2-6 inch	1310/01/02/14	Confirmed	24	LF	0	LF		More likely above ceiling tile.		1	No	1/D
1	2	Classroom 309	N/A	Wood Floor		Non Suspect ACM	840	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 309	N/A	Fiberglass Ceiling Tile 2' x 4'		Non Suspect ACM	840	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 309	N/A	Plaster Ceiling		NAD	840	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 309	N/A	Plaster Walls		NAD	720	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 309	N/A	Sheetrock Wall		Non Suspect ACM	340	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 309	T	Pipe Insulation 2-6 inch	1310/01/02/14	Confirmed	24	LF	0	LF		More likely above ceiling tile.		1	No	1/D
1	2	Classroom 309	N/A	Partition Room Dividers		Non Suspect ACM	340	SF	0	SF		Wood		N/A	N/A	N/A
1	2	Classroom 310	N/A	Wood Floor		Non Suspect ACM	840	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 310	N/A	Fiberglass Ceiling Tile 2' x 4'		Non Suspect ACM	840	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 310	N/A	Plaster Ceiling		NAD	840	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 310	N/A	Plaster Walls		NAD	1060	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 310	N/A	Sheetrock Wall		Non Suspect ACM	340	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 310	M	Blackboard Glue Dots	1300/01/02/USA/NH/2600	Assumed	5	SF	0	SF				1	No	1/D
1	2	Classroom 310	T	Pipe Insulation 2-6 inch	1310/01/02/14	Confirmed	24	LF	1	LF		More likely above ceiling tile.		1	Yes	2/B
1	2	Classroom 310 Small Closet	N/A	Wood Ceiling		Non Suspect ACM	15	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 310 Small Closet	N/A	Wood Walls		Non Suspect ACM	130	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 310 Small Closet	N/A	Wood Floor		Non Suspect ACM	15	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 310 Large Closet	N/A	Wood Ceiling		Non Suspect ACM	25	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 310 Large Closet	N/A	Wood Walls		Non Suspect ACM	160	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 310 Large Closet	N/A	Wood Floor		Non Suspect ACM	25	SF	0	SF				N/A	N/A	N/A
1	2	Office adjacent to Classroom 311	N/A	Ceiling Tile 2' x 4'		NAD	60	SF	0	SF				N/A	N/A	N/A
1	2	Office adjacent to Classroom 311	N/A	Plaster Ceiling		NAD	196	SF	0	SF				N/A	N/A	N/A
1	2	Office adjacent to Classroom 311	N/A	Plaster Walls		NAD	980	SF	0	SF				N/A	N/A	N/A
1	2	Office adjacent to Classroom 311	M	Transite Cove Base	1310/01/02/VER/BB/2320	Assumed	70	SF	0	SF				1	No	1/D
1	2	Office adjacent to Classroom 311	N/A	Cement Floor		Non Suspect ACM	196	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 311	N/A	Wood Floor		Non Suspect ACM	840	SF	5	SF				N/A	N/A	N/A
1	2	Classroom 311	N/A	Fiberglass Ceiling Tile 2' x 4'		Non Suspect ACM	840	SF	1	SF				N/A	N/A	N/A
1	2	Classroom 311	N/A	Plaster Ceiling		NAD	840	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 311	N/A	Plaster Walls		NAD	1100	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 311	M	Blackboard Glue Dots	1300/01/02/USA/NH/2600	Assumed	5	SF	0	SF				1	No	1/D
1	2	Classroom 311	T	Pipe Insulation 2-6 inch	1310/01/02/14	Confirmed	24	LF	0	LF		More likely above ceiling tile.		1	No	1/D
1	2	Classroom 312	N/A	Wood Floor		Non Suspect ACM	840	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 312	N/A	Fiberglass Ceiling Tile 2' x 4'		Non Suspect ACM	800	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 312	N/A	Plaster Ceiling		NAD	800	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 312	N/A	Plaster Walls		NAD	1100	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 312	N/A	Sheetrock Wall		Non Suspect ACM	160	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 312	M	Blackboard Glue Dots	1300/01/02/USA/NH/2600	Assumed	5	SF	0	SF				1	No	1/D
1	2	Classroom 312	T	Pipe Insulation 2-6 inch	1310/01/02/14	Confirmed	12	LF	0	LF		More likely above ceiling tile.		1	No	1/D
1	2	Classroom 312 Restroom	N/A	Ceramic Tile Floors		Non Suspect ACM	40	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 312 Restroom	N/A	Fiberglass Ceiling Tile 2' x 4'		Non Suspect ACM	40	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 312 Restroom	N/A	Plaster Walls		NAD	160	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 312 Restroom	N/A	Sheetrock Wall		Non Suspect ACM	160	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 312 Restroom	T	Pipe Insulation 2-6 inch	1310/01/02/14	Confirmed	12	LF	1	LF				1	Yes	2/B
1	2	Office 313	M	Floor Tile VAT 9" x 9"	1310/01/02/16	Confirmed	260	SF	0	SF	Green			1	No	1/D
1	2	Office 313	N/A	Cement Floor		Non Suspect ACM	260	SF	0	SF				N/A	N/A	N/A
1	2	Office 313	N/A	Ceiling Tile 2' x 4'		NAD	260	SF	0	SF				N/A	N/A	N/A
1	2	Office 313	N/A	Concrete Ceiling		Non Suspect ACM	260	SF	0	SF				N/A	N/A	N/A
1	2	Office 313	N/A	Concrete Block Wall		Non Suspect ACM	580	SF	0	SF				N/A	N/A	N/A
1	2	Office 313 Elevator Mechanical Room	N/A	Fiberglass Ceiling Tile 2' x 4'		Non Suspect ACM	80	SF	0	SF				N/A	N/A	N/A
1	2	Office 313 Elevator Mechanical Room	N/A	Concrete Ceiling		Non Suspect ACM	80	SF	0	SF				N/A	N/A	N/A
1	2	Office 313 Elevator Mechanical Room	N/A	Concrete Block Wall		Non Suspect ACM	360	SF	0	SF				N/A	N/A	N/A
1	2	Office 313 Elevator Mechanical Room	M	Transite	1310/01/02/VER/BB/2305	Assumed	35	SF	0	SF				1	No	1/D
1	2	Office 313 Elevator Mechanical Room	N/A	Cement Floor		Non Suspect ACM	80	SF	0	SF				N/A	N/A	N/A
1	2	Girl's Restroom	N/A	Ceramic Tile Floors		Non Suspect ACM	209	SF	0	SF				N/A	N/A	N/A
1	2	Girl's Restroom	N/A	Plaster Ceiling		NAD	209	SF	0	SF				N/A	N/A	N/A
1	2	Girl's Restroom	N/A	Concrete Block Wall		Non Suspect ACM	465	SF	0	SF				N/A	N/A	N/A
1	2	Girl's Restroom Pipe Chase	T	Pipe Fitting Insulation	1310/01/02/17	Confirmed	4	EA	0	EA				1	No	1/D
1	2	Girl's Restroom Pipe Chase	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	50	LF	0	LF				N/A	N/A	N/A
1	2	Girl's Restroom Pipe Chase	N/A	Concrete Ceiling		Non Suspect ACM	45	SF	0	SF				N/A	N/A	N/A
1	2	Girl's Restroom Pipe Chase	N/A	Concrete Block Wall		Non Suspect ACM	360	SF	0	SF				N/A	N/A	N/A
1	2	Girl's Restroom Pipe Chase	N/A	Cement Floor		Non Suspect ACM	45	SF	0	SF				N/A	N/A	N/A
1	2	Men's Restroom	N/A	Ceramic Tile Floors		Non Suspect ACM	56	SF	0	SF				N/A	N/A	N/A
1	2	Men's Restroom	N/A	Plaster Ceiling		NAD	56	SF	0	SF				N/A	N/A	N/A
1	2	Men's Restroom	N/A	Concrete Block Wall		Non Suspect ACM	210	SF	0	SF				N/A	N/A	N/A
1	2	Women's Restroom	N/A	Ceramic Tile Floors		Non Suspect ACM	42	SF	0	SF				N/A	N/A	N/A
1	2	Women's Restroom	N/A	Plaster Ceiling		NAD	42	SF	0	SF				N/A	N/A	N/A
1	2	Women's Restroom	N/A	Concrete Block Wall		Non Suspect ACM	210	SF	0	SF				N/A	N/A	N/A
1	2	Custodial Closet between Boy's and Women's Restroom	N/A	Plaster Ceiling		NAD	40	SF	0	SF				N/A	N/A	N/A
1	2	Custodial Closet between Boy's and Women's Restroom	N/A	Concrete Block Wall		Non Suspect ACM	240	SF	0	SF				N/A	N/A	N/A

1310/3407 Mastery Charter @ Harrity 2015-2016 AHERA Three Year Report

Element Identifier		School District of Philadelphia Mastery Charter School @ Harrity (K-8) 5601 Christian Street, Philadelphia, PA 19143 ULCS# 1310/3407 Year Built: 1913		AHERA Three-Year Reinspection 2015-2016 Room by Room Location Log Report										Reinspection Date: 1/6/16 Building Inspector: Norman Harrison Number: ACC-0915-6-011 Management Planner: Monique Causley Certificate Number: ACC-0215-8-010			
				System Affected	Material Description	HID#	Confirmed Assumed NAD Non Suspect ACM	Amount of Material	SF LF EA	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic Crawl Space Ranking	Damage Potential (DP)	Newly Friable (NF)	Response Action (RA)
On Site Room Name																	
1	2	Custodial Closet between Boy's and Women's Restroom	N/A	Cement Floor		Non Suspect ACM	40	SF	0	SF				N/A	N/A	N/A	
1	2	Boy's Restroom	N/A	Ceramic Tile Floors		Non Suspect ACM	198	SF	0	SF				N/A	N/A	N/A	
1	2	Boy's Restroom	N/A	Plaster Ceiling		NAD	198	SF	0	SF				N/A	N/A	N/A	
1	2	Boy's Restroom	N/A	Concrete Block Wall		Non Suspect ACM	465	SF	0	SF				N/A	N/A	N/A	
1	2	Hallway outside Classrooms 311-312	M	Floor Tile VAT 9" x 9"	1310/01/02/16	Confirmed	60	SF	2	SF	Green			1	No	6/C	
1	2	Hallway outside Classrooms 311-312	N/A	Ceiling Tile 2' x 4'		NAD	567	SF	0	SF				N/A	N/A	N/A	
1	2	Hallway outside Classrooms 311-312	N/A	Plaster Ceiling		NAD	567	SF	0	SF				N/A	N/A	N/A	
1	2	Hallway outside Classrooms 311-312	N/A	Concrete Block Wall		Non Suspect ACM	160	SF	0	SF				N/A	N/A	N/A	
1	2	Hallway outside Classrooms 311-312	N/A	Cement Floor		Non Suspect ACM	567	SF	0	SF				N/A	N/A	N/A	
1	2	Hallway outside Classrooms 311-312	N/A	Plaster Walls		NAD	1620	SF	0	SF				N/A	N/A	N/A	
1	2	Hallway outside Classrooms 311-312	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	40	LF	0	LF				N/A	N/A	N/A	
1	2	Hallway outside Classrooms 311-312	M	Transite Cove Base	1310/01/02/VER/BB/2320	Assumed	162	SF	0	SF				1	No	1/D	
1	2	Hallway from Classrooms 301 to 303	M	Floor Tile VAT 9" x 9"	1310/01/02/16	Confirmed	360	SF	0	SF	Green			1	No	1/D	
1	2	Hallway from Classrooms 301 to 303	N/A	Ceiling Tile 2' x 4'		NAD	630	SF	0	SF				N/A	N/A	N/A	
1	2	Hallway from Classrooms 301 to 303	N/A	Plaster Ceiling		NAD	630	SF	0	SF				N/A	N/A	N/A	
1	2	Hallway from Classrooms 301 to 303	N/A	Concrete Block Wall		Non Suspect ACM	390	SF	0	SF				N/A	N/A	N/A	
1	2	Hallway from Classrooms 301 to 303	N/A	Cement Floor		Non Suspect ACM	630	SF	0	SF				N/A	N/A	N/A	
1	2	Hallway from Classrooms 301 to 303	N/A	Plaster Walls		NAD	1800	SF	0	SF				N/A	N/A	N/A	
1	2	Hallway from Classrooms 301 to 303	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	40	LF	0	LF				N/A	N/A	N/A	
1	2	Hallway from Classrooms 301 to 303	M	Transite Cove Base	1310/01/02/VER/BB/2320	Assumed	180	SF	0	SF				1	No	1/D	
1	2	Hallway from Classrooms 306 to 310	N/A	Cement Floor		Non Suspect ACM	1274	SF	0	SF				N/A	N/A	N/A	
1	2	Hallway from Classrooms 306 to 310	N/A	Ceiling Tile 2' x 4'		NAD	1274	SF	0	SF				N/A	N/A	N/A	
1	2	Hallway from Classrooms 306 to 310	N/A	Plaster Ceiling		NAD	1274	SF	0	SF				N/A	N/A	N/A	
1	2	Hallway from Classrooms 306 to 310	N/A	Plaster Walls		NAD	2220	SF	0	SF				N/A	N/A	N/A	
1	2	Hallway from Classrooms 306 to 310	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	40	LF	0	LF				N/A	N/A	N/A	
1	2	Hallway from Classrooms 306 to 310	M	Transite Cove Base	1310/01/02/VER/BB/2320	Assumed	225	SF	0	SF				1	No	1/D	
1	2	Stairwell 4 adjacent to Office 313	N/A	Cement Floor		Non Suspect ACM	324	SF	0	SF				N/A	N/A	N/A	
1	2	Stairwell 4 adjacent to Office 313	N/A	Concrete Ceiling		Non Suspect ACM	324	SF	0	SF				N/A	N/A	N/A	
1	2	Stairwell 4 adjacent to Office 313	N/A	Brick Wall		Non Suspect ACM	380	SF	0	SF				N/A	N/A	N/A	
1	2	Stairwell 4 adjacent to Office 313	N/A	Concrete Block Wall		Non Suspect ACM	715	SF	0	SF				N/A	N/A	N/A	
1	2	Stairwell 3 adjacent to Classroom 310	N/A	Cement Floor		Non Suspect ACM	266	SF	0	SF				N/A	N/A	N/A	
1	2	Stairwell 3 adjacent to Classroom 310	N/A	Plaster Ceiling		NAD	266	SF	0	SF				N/A	N/A	N/A	
1	2	Stairwell 3 adjacent to Classroom 310	N/A	Plaster Walls		NAD	925	SF	0	SF				N/A	N/A	N/A	
1	2	Stairwell 3 adjacent to Classroom 310	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	20	LF	0	LF				N/A	N/A	N/A	
1	2	Stairwell 3 adjacent to Classroom 310	M	Transite Cove Base	1310/01/02/VER/BB/2320	Assumed	70	SF	0	SF				1	No	1/D	
1	2	Stairwell 2 adjacent to Classroom 306	N/A	Cement Floor		Non Suspect ACM	240	SF	0	SF				N/A	N/A	N/A	
1	2	Stairwell 2 adjacent to Classroom 306	N/A	Plaster Ceiling		NAD	240	SF	0	SF				N/A	N/A	N/A	
1	2	Stairwell 2 adjacent to Classroom 306	N/A	Plaster Walls		NAD	955	SF	0	SF				N/A	N/A	N/A	
1	2	Stairwell 2 adjacent to Classroom 306	M	Transite Cove Base	1310/01/02/VER/BB/2320	Assumed	70	SF	0	SF				1	No	1/D	
1	2	Stairwell 1 adjacent to IMC	N/A	Cement Floor		Non Suspect ACM	324	SF	0	SF				N/A	N/A	N/A	
1	2	Stairwell 1 adjacent to IMC	N/A	Concrete Ceiling		Non Suspect ACM	324	SF	0	SF				N/A	N/A	N/A	
1	2	Stairwell 1 adjacent to IMC	N/A	Brick Wall		Non Suspect ACM	380	SF	0	SF				N/A	N/A	N/A	
1	2	Stairwell 1 adjacent to IMC	N/A	Concrete Block Wall		Non Suspect ACM	715	SF	0	SF				N/A	N/A	N/A	
1	1	Conference Room 200	M	Floor Tile VAT 9" x 9"	1310/01/01/11	Confirmed	322	SF	5	SF	Green			1	No	6/C	
1	1	Conference Room 200	N/A	Cement Floor		Non Suspect ACM	322	SF	0	SF				N/A	N/A	N/A	
1	1	Conference Room 200	N/A	Fiberglass Ceiling Tile 2' x 4'		Non Suspect ACM	322	SF	2	SF				N/A	N/A	N/A	
1	1	Conference Room 200	N/A	Concrete Ceiling		Non Suspect ACM	322	SF	0	SF				N/A	N/A	N/A	
1	1	Conference Room 200	N/A	Concrete Block Wall		Non Suspect ACM	595	SF	0	SF				N/A	N/A	N/A	
1	1	Conference Room 200	M	Blackboard Glue Dots	1300/01/01/USA/NH/2600	Assumed	5	SF	0	SF				1	No	1/D	
1	1	Classroom 201	M	Floor Tile VAT 9" x 9"	1310/01/01/11	Confirmed	1053	SF	0	SF	Green			1	No	1/D	
1	1	Classroom 201	M	Floor Tile VAT 9" x 9"	1310/01/01/11	Confirmed	25	SF	0	SF	White			1	No	1/D	
1	1	Classroom 201	M	Floor Tile VAT 12" x 12"	1310/01/01/CC	Assumed	2	SF	0	SF	Blue			1	No	1/D	
1	1	Classroom 201	N/A	Cement Floor		Non Suspect ACM	1080	SF	0	SF				N/A	N/A	N/A	
1	1	Classroom 201	N/A	Fiberglass Ceiling Tile 2' x 4'		Non Suspect ACM	1080	SF	3	SF				N/A	N/A	N/A	
1	1	Classroom 201	N/A	Concrete Ceiling		Non Suspect ACM	1080	SF	0	SF				N/A	N/A	N/A	
1	1	Classroom 201	N/A	Concrete Block Wall		Non Suspect ACM	1075	SF	0	SF				N/A	N/A	N/A	
1	1	Classroom 201	M	Blackboard Glue Dots	1300/01/01/USA/NH/2600	Assumed	5	SF	0	SF				1	No	1/D	
1	1	Classroom 201	M	Sink Undercoat Mastic	1310/01/01/VER/BB/2602	Assumed	30	SF	0	SF	Black			1	No	1/D	
1	1	Classroom 202	M	Floor Tile VAT 9" x 9"	1310/01/01/11	Confirmed	886	SF	0	SF	Green			1	No	1/D	
1	1	Classroom 202	N/A	Cement Floor		Non Suspect ACM	886	SF	0	SF				N/A	N/A	N/A	
1	1	Classroom 202	N/A	Fiberglass Ceiling Tile 2' x 4'		Non Suspect ACM	886	SF	6	SF				N/A	N/A	N/A	
1	1	Classroom 202	N/A	Concrete Ceiling		Non Suspect ACM	886	SF	0	SF				N/A	N/A	N/A	
1	1	Classroom 202	N/A	Concrete Block Wall		Non Suspect ACM	915	SF	0	SF				N/A	N/A	N/A	
1	1	Classroom 202	M	Blackboard Glue Dots	1300/01/01/USA/NH/2600	Assumed	5	SF	0	SF				1	No	1/D	
1	1	IT / MDF Office	M	Floor Tile VAT 9" x 9"	1310/01/01/11	Confirmed	170	SF	0	SF	Green			1	No	1/D	
1	1	IT / MDF Office	N/A	Cement Floor		Non Suspect ACM	170	SF	0	SF				N/A	N/A	N/A	
1	1	IT / MDF Office	N/A	Fiberglass Ceiling Tile 2' x 4'		Non Suspect ACM	170	SF	4	SF				N/A	N/A	N/A	
1	1	IT / MDF Office	N/A	Concrete Ceiling		Non Suspect ACM	170	SF	0	SF				N/A	N/A	N/A	
1	1	IT / MDF Office	N/A	Concrete Block Wall		Non Suspect ACM	380	SF	0	SF				N/A	N/A	N/A	
1	1	IT / MDF Office	N/A	Sheetrock Wall		Non Suspect ACM	140	SF	0	SF				N/A	N/A	N/A	
1	1	IT / MDF Office	M	Blackboard Glue Dots	1300/01/01/USA/NH/2600	Assumed	21	SF	0	SF				1	No	1/D	
1	1	IT / MDF Office	M	Sink Undercoat Mastic	1310/01/01/VER/BB/2602	Assumed	8	SF	0	SF	Black			1	No	1/D	
1	1	IT / MDF Office Telecommunication Equipment Room	N/A	Fiberglass Ceiling Tile 2' x 4'		Non Suspect ACM	130	SF	0	SF				N/A	N/A	N/A	
1	1	IT / MDF Office Telecommunication Equipment Room	N/A	Concrete Ceiling		Non Suspect ACM	130	SF	0	SF				N/A	N/A	N/A	

1310/3407 Mastery Charter @ Harrity 2015-2016 AHERA Three Year Report

School District of Philadelphia Mastery Charter School @ Harrity (K-8) 5601 Christian Street, Philadelphia, PA 19143 ULCS# 1310/3407 Year Built: 1913		AHERA Three-Year Reinspection 2015-2016 Room by Room Location Log Report										Reinspection Date: 1/6/16 Building Inspector: Norman Harrison Number: ACC-0915-6-011 Management Planner: Monique Causley Certificate Number: ACC-0215-8-010				
E l e m e n t	F l o o r	On Site Room Name	System Affected	Material Description	HID#	Confirmed Assumed NAD Non Suspect ACM	Amount of Material	SF LF EA	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic Crawl Space Ranking	Damage Potential (DP)	Newly Friable (NF)	Response Action (RA)
1	1	IT / MDF Office Telecommunication Equipment Room	N/A	Concrete Block Wall		Non Suspect ACM	320	SF	0	SF				N/A	N/A	N/A
1	1	IT / MDF Office Telecommunication Equipment Room	N/A	Sheetrock Wall		Non Suspect ACM	140	SF	0	SF				N/A	N/A	N/A
1	1	IT / MDF Office Telecommunication Equipment Room	M	Floor Tile VAT 9" x 9"	1310/01/01/11	Confirmed	130	SF	0	SF	Green			1	No	1/D
1	1	IT / MDF Office Telecommunication Equipment Room	N/A	Cement Floor		Non Suspect ACM	130	SF	0	SF				N/A	N/A	N/A
1	1	IT / MDF Office Telecommunication Equipment Room	M	Blackboard Glue Dots	1300/01/01/USA/NH/2600	Assumed	15	SF	0	SF				1	No	1/D
1	1	Classroom 202 Storage Room	M	Floor Tile VAT 9" x 9"	1310/01/01/11	Confirmed	98	SF	0	SF	Green			1	No	1/D
1	1	Classroom 202 Storage Room	N/A	Cement Floor		Non Suspect ACM	98	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 202 Storage Room	N/A	Fiberglass Ceiling Tile 2' x 4'		Non Suspect ACM	98	SF	16	SF				N/A	N/A	N/A
1	1	Classroom 202 Storage Room	N/A	Metal Ceiling		Non Suspect ACM	98	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 202 Storage Room	N/A	Concrete Block Wall		Non Suspect ACM	380	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 202 Hallway	N/A	Ceiling Tile 2' x 4'		NAD	75	SF	1	SF				N/A	N/A	N/A
1	1	Classroom 202 Hallway	N/A	Concrete Ceiling		Non Suspect ACM	75	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 202 Hallway	N/A	Concrete Block Wall		Non Suspect ACM	360	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 202 Hallway	M	Floor Tile VAT 9" x 9"	1310/01/01/11	Confirmed	75	SF	0	SF				1	No	1/D
1	1	Classroom 202 Hallway	N/A	Cement Floor		Non Suspect ACM	75	SF	0	SF				N/A	N/A	N/A
1	1	Custodial Closet adjacent to Elevator	T	Pipe Fitting Insulation	1310/01/01/12	Confirmed	4	EA	0	EA				1	No	1/D
1	1	Custodial Closet adjacent to Elevator	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	20	LF	0	LF				N/A	N/A	N/A
1	1	Custodial Closet adjacent to Elevator	N/A	Concrete Ceiling		Non Suspect ACM	60	SF	0	SF				N/A	N/A	N/A
1	1	Custodial Closet adjacent to Elevator	N/A	Concrete Block Wall		Non Suspect ACM	300	SF	0	SF				N/A	N/A	N/A
1	1	Custodial Closet adjacent to Elevator	M	Floor Tile VAT 9" x 9"	1310/01/01/11	Confirmed	60	SF	0	SF	Green			1	No	1/D
1	1	Custodial Closet adjacent to Elevator	N/A	Cement Floor		Non Suspect ACM	60	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 203	M	Floor Tile VAT 12" x 12"	1310/01/01/CC	Assumed	780	SF	0	SF	Blue			1	No	1/D
1	1	Classroom 203	N/A	Wood Floor		Non Suspect ACM	780	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 203	N/A	Fiberglass Ceiling Tile 2' x 4'		Non Suspect ACM	780	SF	2	SF				N/A	N/A	N/A
1	1	Classroom 203	N/A	Plaster Ceiling		NAD	780	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 203	N/A	Plaster Walls		NAD	1100	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 203	M	Blackboard Glue Dots	1300/01/01/USA/NH/2600	Assumed	5	SF	0	SF				1	No	1/D
1	1	Classroom 203	T	Pipe Insulation 2-6 inch	1310/01/01/07	Confirmed	24	LF	0	LF		More likely above ceiling tile.		1	No	1/D
1	1	Classroom 204	M	Floor Tile VAT 12" x 12"	1310/01/01/CC	Assumed	780	SF	0	SF	Blue			1	No	1/D
1	1	Classroom 204	N/A	Wood Floor		Non Suspect ACM	780	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 204	N/A	Fiberglass Ceiling Tile 2' x 4'		Non Suspect ACM	780	SF	3	SF				N/A	N/A	N/A
1	1	Classroom 204	N/A	Plaster Ceiling		NAD	780	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 204	N/A	Plaster Walls		NAD	1100	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 204	M	Blackboard Glue Dots	1300/01/01/USA/NH/2600	Assumed	5	SF	0	SF				1	No	1/D
1	1	Classroom 204	T	Pipe Insulation 2-6 inch	1310/01/01/07	Confirmed	24	LF	0	LF		More likely above ceiling tile.		1	No	1/D
1	1	Classroom 204	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	36	LF	0	LF				N/A	N/A	N/A
1	1	Nurse's Office 205	N/A	Cement Floor		Non Suspect ACM	150	SF	0	SF				N/A	N/A	N/A
1	1	Nurse's Office 205	N/A	Plaster Ceiling		NAD	150	SF	5	SF				N/A	N/A	N/A
1	1	Nurse's Office 205	N/A	Plaster Walls		NAD	200	SF	5	SF				N/A	N/A	N/A
1	1	Nurse's Office 205	M	Transite Cove Base	1310/01/01/VER/BB/2320	Assumed	49	SF	0	SF				1	No	1/D
1	1	Nurse's Office 205 Restroom	N/A	Cement Floor		Non Suspect ACM	46	SF	0	SF				N/A	N/A	N/A
1	1	Nurse's Office 205 Restroom	N/A	Plaster Ceiling		NAD	46	SF	5	SF				N/A	N/A	N/A
1	1	Nurse's Office 205 Restroom	N/A	Plaster Walls		NAD	100	SF	0	SF				N/A	N/A	N/A
1	1	Nurse's Office 205 Restroom	T	Pipe Fitting Insulation	1310/01/01/12	Confirmed	2	EA	0	EA				1	No	1/D
1	1	Nurse's Office 205 Restroom	T	Pipe Insulation 2-6 inch	1310/01/01/07	Confirmed	21	LF	0	LF				1	No	1/D
1	1	Nurse's Office 205 Restroom	M	Transite Cove Base	1310/01/01/VER/BB/2320	Assumed	21	SF	0	SF				1	No	1/D
1	1	Classroom 206	N/A	Wood Floor		Non Suspect ACM	840	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 206	N/A	Fiberglass Ceiling Tile 2' x 4'		Non Suspect ACM	840	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 206	N/A	Plaster Ceiling		NAD	840	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 206	N/A	Plaster Walls		NAD	1035	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 206	N/A	Partition Room Dividers		Non Suspect ACM	315	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 206	M	Blackboard Glue Dots	1300/01/01/USA/NH/2600	Assumed	5	SF	0	SF				1	No	1/D
1	1	Classroom 206	T	Pipe Insulation 2-6 inch	1310/01/01/07	Confirmed	24	LF	0	LF		More likely above ceiling tile.		1	No	1/D
1	1	Classroom 206 Small Closet	N/A	Wood Ceiling		Non Suspect ACM	15	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 206 Small Closet	N/A	Wood Walls		Non Suspect ACM	130	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 206 Small Closet	N/A	Wood Floor		Non Suspect ACM	15	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 206 Large Closet	N/A	Wood Ceiling		Non Suspect ACM	25	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 206 Large Closet	N/A	Wood Walls		Non Suspect ACM	160	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 206 Large Closet	N/A	Wood Floor		Non Suspect ACM	25	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 207	N/A	Wood Floor		Non Suspect ACM	840	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 207	N/A	Fiberglass Ceiling Tile 2' x 4'		Non Suspect ACM	840	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 207	N/A	Plaster Ceiling		NAD	840	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 207	N/A	Plaster Walls		NAD	1060	SF	5	SF				N/A	N/A	N/A
1	1	Classroom 207	N/A	Sheetrock Wall		Non Suspect ACM	340	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 207	M	Blackboard Glue Dots	1300/01/01/USA/NH/2600	Assumed	5	SF	0	SF				1	No	1/D
1	1	Classroom 207	T	Pipe Insulation 2-6 inch	1310/01/01/07	Confirmed	24	LF	0	LF		More likely above ceiling tile.		1	No	1/D
1	1	Staff Restroom adjacent to Main Entrance	N/A	Cement Floor		Non Suspect ACM	136	SF	0	SF				N/A	N/A	N/A
1	1	Staff Restroom adjacent to Main Entrance	N/A	Plaster Ceiling		NAD	136	SF	0	SF				N/A	N/A	N/A
1	1	Staff Restroom adjacent to Main Entrance	N/A	Plaster Walls		NAD	200	SF	0	SF				N/A	N/A	N/A
1	1	Staff Restroom adjacent to Main Entrance	M	Transite Cove Base	1310/01/01/VER/BB/2320	Assumed	50	SF	0	SF				1	No	1/D
1	1	Staff Restroom adjacent to Main Entrance	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	6	LF	0	SF				N/A	N/A	N/A
1	1	Dean's Office near Front Desk	N/A	Ceiling Tile 2' x 4'		NAD	130	SF	0	SF				N/A	N/A	N/A
1	1	Dean's Office near Front Desk	N/A	Concrete Ceiling		Non Suspect ACM	130	SF	0	SF				N/A	N/A	N/A
1	1	Dean's Office near Front Desk	N/A	Concrete Block Wall		Non Suspect ACM	230	SF	0	SF				N/A	N/A	N/A
1	1	Dean's Office near Front Desk	N/A	Sheetrock Wall		Non Suspect ACM	230	SF	0	SF				N/A	N/A	N/A

1310/3407 Mastery Charter @ Harrity 2015-2016 AHERA Three Year Report

School District of Philadelphia Mastery Charter School @ Harrity (K-8) 5601 Christian Street, Philadelphia, PA 19143 ULCS# 1310/3407 Year Built: 1913			AHERA Three-Year Reinspection 2015-2016 Room by Room Location Log Report										Reinspection Date: 1/6/16 Building Inspector: Norman Harrison Number: ACC-0915-6-011 Management Planner: Monique Causley Certificate Number: ACC-0215-8-010			
Element	Floor	On Site Room Name	System Affected	Material Description	HID#	Confirmed Assumed NAD Non Suspect ACM	Amount of Material	SF LF EA	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic Crawl Space Ranking	Damage Potential (DP)	Newly Friable (NF)	Response Action (RA)
1	1	Dean's Office near Front Desk	M	Floor Tile VAT 12" x 12"	1310/01/01/CC	Assumed	130	SF	0	SF				1	No	1/D
1	1	Dean's Office near Front Desk	N/A	Cement Floor		Non Suspect ACM	130	SF	0	SF				N/A	N/A	N/A
1	1	Assistant Principal's Office	N/A	Cement Floor		Non Suspect ACM	136	SF	0	SF				N/A	N/A	N/A
1	1	Assistant Principal's Office	M	Floor Tile VAT 12" x 12"	1310/01/01/CC	Assumed	136	SF	0	SF				1	No	1/D
1	1	Assistant Principal's Office	N/A	Plaster Ceiling		NAD	136	SF	0	SF				N/A	N/A	N/A
1	1	Assistant Principal's Office	N/A	Plaster Walls		NAD	300	SF	0	SF				N/A	N/A	N/A
1	1	Assistant Principal's Office	M	Transite Cove Base	1310/01/01/VER/BB/2320	Assumed	50	SF	0	SF				1	No	1/D
1	1	Assistant Principal's Office	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	8	LF	0	LF				N/A	N/A	N/A
1	1	Classroom 208	M	Floor Tile VAT 12" x 12"	1310/01/01/CC	Assumed	830	SF	2	SF	Tan			1	No	6/C
1	1	Classroom 208	M	Floor Tile VAT 12" x 12"	1310/01/01/CC	Assumed	5	SF	0	SF	Blue			1	No	1/D
1	1	Classroom 208	M	Floor Tile VAT 12" x 12"	1310/01/01/CC	Assumed	5	SF	0	SF	White			1	No	1/D
1	1	Classroom 208	N/A	Wood Floor		Non Suspect ACM	840	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 208	N/A	Fiberglass Ceiling Tile 2' x 4'		Non Suspect ACM	840	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 208	N/A	Plaster Ceiling		NAD	840	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 208	N/A	Plaster Walls		NAD	1060	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 208	N/A	Sheetrock Wall		Non Suspect ACM	340	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 208	M	Blackboard Glue Dots	1300/01/01/USA/NH/2600	Assumed	5	SF	0	SF				1	No	1/D
1	1	Classroom 208	T	Pipe Insulation 2-6 inch	1310/01/01/07	Confirmed	24	LF	0	LF		More likely above ceiling tile.		1	No	1/D
1	1	Boy's Restroom near Front Desk	N/A	Fiberglass Ceiling Tile 2' x 4'		Non Suspect ACM	85	SF	0	SF				N/A	N/A	N/A
1	1	Boy's Restroom near Front Desk	N/A	Concrete Ceiling		Non Suspect ACM	85	SF	0	SF				N/A	N/A	N/A
1	1	Boy's Restroom near Front Desk	N/A	Concrete Block Wall		Non Suspect ACM	400	SF	0	SF				N/A	N/A	N/A
1	1	Boy's Restroom near Front Desk	N/A	Ceramic Tile Floors		Non Suspect ACM	85	SF	0	SF				N/A	N/A	N/A
1	1	Men's Restroom near Front Desk	N/A	Fiberglass Ceiling Tile 2' x 4'		Non Suspect ACM	40	SF	0	SF				N/A	N/A	N/A
1	1	Men's Restroom near Front Desk	N/A	Concrete Ceiling		Non Suspect ACM	40	SF	0	SF				N/A	N/A	N/A
1	1	Men's Restroom near Front Desk	N/A	Concrete Block Wall		Non Suspect ACM	260	SF	0	SF				N/A	N/A	N/A
1	1	Men's Restroom near Front Desk	N/A	Ceramic Tile Floors		Non Suspect ACM	40	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 208	M	Floor Tile VAT 12" x 12"	1310/01/01/CC	Assumed	840	SF	0	SF				1	No	1/D
1	1	Classroom 209	N/A	Wood Floor		Non Suspect ACM	840	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 209	N/A	Fiberglass Ceiling Tile 2' x 4'		Non Suspect ACM	840	SF	1	SF				N/A	N/A	N/A
1	1	Classroom 209	N/A	Plaster Ceiling		NAD	840	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 209	N/A	Plaster Walls		NAD	1100	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 209	N/A	Partition Room Dividers		Non Suspect ACM	200	SF	0	SF		Wood		N/A	N/A	N/A
1	1	Classroom 209	T	Pipe Insulation 2-6 inch	1310/01/01/07	Confirmed	24	LF	0	LF		More likely above ceiling tile.		1	No	1/D
1	1	Classroom 209 Small Closet	N/A	Wood Ceiling		Non Suspect ACM	15	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 209 Small Closet	N/A	Wood Walls		Non Suspect ACM	130	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 209 Small Closet	M	Floor Tile VAT 12" x 12"	1310/01/01/CC	Assumed	15	SF	0	SF	Tan			1	No	1/D
1	1	Classroom 209 Small Closet	N/A	Wood Floor		Non Suspect ACM	15	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 209 Large Closet	N/A	Wood Ceiling		Non Suspect ACM	25	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 209 Large Closet	N/A	Wood Walls		Non Suspect ACM	160	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 209 Large Closet	M	Floor Tile VAT 12" x 12"	1310/01/01/CC	Assumed	25	SF	0	SF	Tan			1	No	1/D
1	1	Classroom 209 Large Closet	N/A	Wood Floor		Non Suspect ACM	25	SF	0	SF				N/A	N/A	N/A
1	1	Girl's Restroom adjacent to Classroom 210	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	51	LF	0	LF				N/A	N/A	N/A
1	1	Girl's Restroom adjacent to Classroom 210	N/A	Fiberglass Ceiling Tile 2' x 4'		Non Suspect ACM	224	SF	0	SF				N/A	N/A	N/A
1	1	Girl's Restroom adjacent to Classroom 210	N/A	Plaster Ceiling		NAD	224	SF	0	SF				N/A	N/A	N/A
1	1	Girl's Restroom adjacent to Classroom 210	N/A	Plaster Walls		NAD	865	SF	0	SF				N/A	N/A	N/A
1	1	Girl's Restroom adjacent to Classroom 210	M	Transite Cove Base	1310/01/01/VER/BB/2320	Assumed	72	SF	0	SF				1	No	1/D
1	1	Girl's Restroom adjacent to Classroom 210	M	Floor Tile VAT 12" x 12"	1310/01/01/CC	Assumed	224	SF	0	SF				1	No	1/D
1	1	Girl's Restroom adjacent to Classroom 210	N/A	Cement Floor		Non Suspect ACM	224	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 210	M	Floor Tile VAT 12" x 12"	1310/01/01/CC	Assumed	408	SF	0	SF	Blue	More likely above ceiling tile.		1	No	1/D
1	1	Classroom 210	M	Floor Tile VAT 12" x 12"	1310/01/01/CC	Assumed	12	SF	0	SF				1	No	1/D
1	1	Classroom 210	N/A	Wood Floor		Non Suspect ACM	840	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 210	N/A	Fiberglass Ceiling Tile 2' x 4'		Non Suspect ACM	840	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 210	N/A	Plaster Ceiling		NAD	840	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 210	N/A	Plaster Walls		NAD	1100	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 210	M	Blackboard Glue Dots	1300/01/01/USA/NH/2600	Assumed	5	SF	0	SF				1	No	1/D
1	1	Classroom 210	T	Pipe Insulation 2-6 inch	1310/01/01/07	Confirmed	24	LF	0	LF		More likely above ceiling tile.		1	No	1/D
1	1	Classroom 210	N/A	Carpet		Non Suspect ACM	420	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 211	M	Floor Tile VAT 12" x 12"	1310/01/01/CC	Assumed	420	SF	0	SF	Tan			1	No	1/D
1	1	Classroom 211	N/A	Wood Floor		Non Suspect ACM	840	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 211	N/A	Fiberglass Ceiling Tile 2' x 4'		Non Suspect ACM	840	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 211	N/A	Plaster Ceiling		NAD	840	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 211	N/A	Plaster Walls		NAD	1100	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 211	M	Blackboard Glue Dots	1300/01/01/USA/NH/2600	Assumed	5	SF	0	SF				1	No	1/D
1	1	Classroom 211	T	Pipe Insulation 2-6 inch	1310/01/01/07	Confirmed	24	LF	0	LF		More likely above ceiling tile.		1	No	1/D
1	1	Classroom 211	N/A	Carpet		Non Suspect ACM	420	SF	0	SF				N/A	N/A	N/A
1	1	Stage	M	Floor Tile VAT 12" x 12"	1310/01/01/CC	Assumed	1014	SF	5	SF	Tan			1	No	6/C
1	1	Stage	N/A	Wood Floor		Non Suspect ACM	1014	SF	0	SF				N/A	N/A	N/A
1	1	Stage	N/A	Metal Ceiling		Non Suspect ACM	1014	SF	0	SF				N/A	N/A	N/A
1	1	Stage	S	Plaster Walls	1310/01/01/YY	Assumed	235	SF	0	SF				N/A	N/A	N/A
1	1	Stage	N/A	Concrete Block Wall		Non Suspect ACM	1640	SF	0	SF				N/A	N/A	N/A
1	1	Stage	T	Pipe Fitting Insulation	1310/01/01/12	Confirmed	8	EA	0	EA				1	No	1/D
1	1	Stage	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	30	LF	0	LF				N/A	N/A	N/A
1	1	Former Weight Room	N/A	Cement Floor		Non Suspect ACM	260	SF	0	SF				N/A	N/A	N/A
1	1	Former Weight Room	N/A	Plaster Ceiling		NAD	260	SF	0	SF				N/A	N/A	N/A
1	1	Former Weight Room	N/A	Fiberglass Ceiling Tile 2' x 4'		Non Suspect ACM	130	SF	0	SF				N/A	N/A	N/A

1310/3407 Mastery Charter @ Harrity 2015-2016 AHERA Three Year Report

School District of Philadelphia Mastery Charter School @ Harrity (K-8) 5601 Christian Street, Philadelphia, PA 19143 ULCS# 1310/3407 Year Built: 1913				AHERA Three-Year Reinspection 2015-2016 Room by Room Location Log Report										Reinspection Date: 1/6/16 Building Inspector: Norman Harrison Number: ACC-0915-6-011 Management Planner: Monique Causley Certificate Number: ACC-0215-8-010			
E l e m e n t	F l o o r	On Site Room Name		System Affected	Material Description	HID#	Confirmed Assumed NAD Non Suspect ACM	Amount of Material	SF LF EA	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic Crawl Space Ranking	Damage Potential (DP)	Newly Friable (NF)	Response Action (RA)
1	1	Former Weight Room		N/A	Concrete Block Wall		Non Suspect ACM	290	SF	0	SF				N/A	N/A	N/A
1	1	Former Weight Room		N/A	Sheetrock Wall		Non Suspect ACM	80	SF	0	SF				N/A	N/A	N/A
1	1	Former Weight Room		N/A	Carpet		Non Suspect ACM	420	SF	0	SF				N/A	N/A	N/A
1	1	Gym Office		M	Floor Tile VAT 12" x 12"	1310/01/01/CC	Assumed	200	SF	0	SF	Tan			1	No	1/D
1	1	Gym Office		N/A	Cement Floor		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A
1	1	Gym Office		N/A	Fiberglass Ceiling Tile 2' x 4'		Non Suspect ACM	200	SF	5	SF				N/A	N/A	N/A
1	1	Gym Office		N/A	Concrete Ceiling		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A
1	1	Gym Office		N/A	Plaster Walls		NAD	260	SF	0	SF				N/A	N/A	N/A
1	1	Gym Office		N/A	Concrete Block Wall		Non Suspect ACM	260	SF	0	SF				N/A	N/A	N/A
1	1	Gym Office Restroom		N/A	Ceramic Tile Floors		Non Suspect ACM	60	SF	0	SF				N/A	N/A	N/A
1	1	Gym Office Restroom		N/A	Plaster Ceiling		NAD	60	SF	0	SF				N/A	N/A	N/A
1	1	Gym Office Restroom		N/A	Concrete Block Wall		Non Suspect ACM	125	SF	0	SF				N/A	N/A	N/A
1	1	Gym Office Closet		N/A	Fiberglass Ceiling Tile 2' x 4'		Non Suspect ACM	6	SF	0	SF				N/A	N/A	N/A
1	1	Gym Office Closet		N/A	Concrete Ceiling		Non Suspect ACM	6	SF	0	SF				N/A	N/A	N/A
1	1	Gym Office Closet		N/A	Plaster Walls		NAD	100	SF	0	SF				N/A	N/A	N/A
1	1	Gym Office Closet		N/A	Cement Floor		Non Suspect ACM	6	SF	0	SF				N/A	N/A	N/A
1	1	Auditorium/Cafeteria		M	Floor Tile VAT 12" x 12"	1310/01/01/CC	Assumed	4000	SF	0	SF	Tan			1	No	1/D
1	1	Auditorium/Cafeteria		N/A	Cement Floor		Non Suspect ACM	4000	SF	0	SF				N/A	N/A	N/A
1	1	Auditorium/Cafeteria		N/A	Concrete Ceiling		Non Suspect ACM	4000	SF	0	SF				N/A	N/A	N/A
1	1	Auditorium/Cafeteria		N/A	Concrete Block Wall		Non Suspect ACM	4140	SF	0	SF				N/A	N/A	N/A
1	1	Auditorium/Cafeteria		N/A	Partition Room Dividers		Non Suspect ACM	1000	SF	0	SF				N/A	N/A	N/A
1	1	Auditorium/Cafeteria Girl's Restroom		N/A	Ceramic Tile Floors		Non Suspect ACM	180	SF	0	SF				N/A	N/A	N/A
1	1	Auditorium/Cafeteria Girl's Restroom		N/A	Plaster Ceiling		NAD	180	SF	0	SF				N/A	N/A	N/A
1	1	Auditorium/Cafeteria Girl's Restroom		N/A	Concrete Block Wall		Non Suspect ACM	465	SF	0	SF				N/A	N/A	N/A
1	1	Auditorium/Cafeteria Girl's Restroom Pipe Chase		T	Pipe Fitting Insulation	1310/01/01/12	Confirmed	6	EA	0	EA				1	No	1/D
1	1	Auditorium/Cafeteria Girl's Restroom Pipe Chase		N/A	Fiberglass Pipe Insulation		Non Suspect ACM	50	LF	0	LF				N/A	N/A	N/A
1	1	Auditorium/Cafeteria Girl's Restroom Pipe Chase		N/A	Concrete Ceiling		Non Suspect ACM	60	SF	0	SF				N/A	N/A	N/A
1	1	Auditorium/Cafeteria Girl's Restroom Pipe Chase		N/A	Concrete Block Wall		Non Suspect ACM	460	SF	0	SF				N/A	N/A	N/A
1	1	Auditorium/Cafeteria Girl's Restroom Pipe Chase		N/A	Cement Floor		Non Suspect ACM	60	SF	0	SF				N/A	N/A	N/A
1	1	Auditorium/Cafeteria Boy's Restroom		N/A	Ceramic Tile Floors		Non Suspect ACM	180	SF	0	SF				N/A	N/A	N/A
1	1	Auditorium/Cafeteria Boy's Restroom		N/A	Plaster Ceiling		NAD	180	SF	0	SF				N/A	N/A	N/A
1	1	Auditorium/Cafeteria Boy's Restroom		N/A	Concrete Block Wall		Non Suspect ACM	385	SF	0	SF				N/A	N/A	N/A
1	1	Auditorium/Cafeteria Boy's Restroom		N/A	Sheetrock Wall		Non Suspect ACM	75	SF	0	SF				N/A	N/A	N/A
1	1	Teacher's Lounge		M	Floor Tile VAT 12" x 12"	1310/01/01/CC	Assumed	309	SF	0	SF	Tan			1	No	1/D
1	1	Teacher's Lounge		N/A	Cement Floor		Non Suspect ACM	309	SF	0	SF				N/A	N/A	N/A
1	1	Teacher's Lounge		N/A	Ceiling Tile 2' x 4'		NAD	309	SF	0	SF				N/A	N/A	N/A
1	1	Teacher's Lounge		N/A	Concrete Ceiling		Non Suspect ACM	309	SF	0	SF				N/A	N/A	N/A
1	1	Teacher's Lounge		N/A	Concrete Block Wall		Non Suspect ACM	550	SF	0	SF				N/A	N/A	N/A
1	1	Teacher's Lounge		N/A	Sheetrock Wall		Non Suspect ACM	90	SF	0	SF				N/A	N/A	N/A
1	1	Teacher's Lounge Telecommunication Equipment Room		N/A	Ceiling Tile 2' x 4'		NAD	55	SF	0	SF				N/A	N/A	N/A
1	1	Teacher's Lounge Telecommunication Equipment Room		N/A	Concrete Ceiling		Non Suspect ACM	55	SF	0	SF				N/A	N/A	N/A
1	1	Teacher's Lounge Telecommunication Equipment Room		N/A	Concrete Block Wall		Non Suspect ACM	150	SF	0	SF				N/A	N/A	N/A
1	1	Teacher's Lounge Telecommunication Equipment Room		N/A	Sheetrock Wall		Non Suspect ACM	150	SF	0	SF				N/A	N/A	N/A
1	1	Teacher's Lounge Telecommunication Equipment Room		M	Floor Tile VAT 12" x 12"	1310/01/01/CC	Assumed	55	SF	0	SF				1	No	1/D
1	1	Teacher's Lounge Telecommunication Equipment Room		N/A	Cement Floor		Non Suspect ACM	55	SF	0	SF				N/A	N/A	N/A
1	1	Kitchen		N/A	Ceramic Tile Floors		Non Suspect ACM	2210	SF	0	SF				N/A	N/A	N/A
1	1	Kitchen		M	Ceiling Tile 1' x 1'	1310/01/01/CC	Assumed	2210	SF	0	SF				1	No	1/D
1	1	Kitchen		N/A	Concrete Ceiling		Non Suspect ACM	2210	SF	0	SF				N/A	N/A	N/A
1	1	Kitchen		N/A	Concrete Block Wall		Non Suspect ACM	1780	SF	0	SF				N/A	N/A	N/A
1	1	Kitchen		N/A	Fiberglass Pipe Insulation		Non Suspect ACM	120	SF	0	SF				N/A	N/A	N/A
1	1	Kitchen		T	Pipe Fitting Insulation	1310/01/01/12	Confirmed	24	LF	0	LF				1	No	1/D
1	1	Kitchen Storage		N/A	Ceramic Tile Floors		Non Suspect ACM	378	SF	0	SF				N/A	N/A	N/A
1	1	Kitchen Storage		M	Ceiling Tile 1' x 1'	1310/01/01/CC	Assumed	378	SF	0	SF				1	No	1/D
1	1	Kitchen Storage		N/A	Concrete Ceiling		Non Suspect ACM	378	SF	0	SF				N/A	N/A	N/A
1	1	Kitchen Storage		N/A	Concrete Block Wall		Non Suspect ACM	660	SF	0	SF				N/A	N/A	N/A
1	1	Kitchen Office		N/A	Ceramic Tile Floors		Non Suspect ACM	40	SF	0	SF				N/A	N/A	N/A
1	1	Kitchen Office		M	Ceiling Tile 1' x 1'	1310/01/01/CC	Assumed	40	SF	0	SF				N/A	N/A	N/A
1	1	Kitchen Office		N/A	Concrete Ceiling		Non Suspect ACM	40	SF	0	SF				N/A	N/A	N/A
1	1	Kitchen Office		N/A	Concrete Block Wall		Non Suspect ACM	210	SF	0	SF				N/A	N/A	N/A
1	1	Hallway outside Freight Elevator		T	Pipe Fitting Insulation	1310/01/01/12	Confirmed	2	EA	0	EA				1	No	1/D
1	1	Hallway outside Freight Elevator		N/A	Fiberglass Pipe Insulation		Non Suspect ACM	25	LF	0	LF				N/A	N/A	N/A
1	1	Hallway outside Freight Elevator		N/A	Ceiling Tile 2' x 4'		NAD	100	SF	0	SF				N/A	N/A	N/A
1	1	Hallway outside Freight Elevator		N/A	Concrete Ceiling		Non Suspect ACM	100	SF	0	SF				N/A	N/A	N/A
1	1	Hallway outside Freight Elevator		N/A	Concrete Block Wall		Non Suspect ACM	400	SF	0	SF				N/A	N/A	N/A
1	1	Hallway outside Freight Elevator		N/A	Ceramic Tile Floors		Non Suspect ACM	100	SF	0	SF				N/A	N/A	N/A
1	1	Gym		N/A	Metal Ceiling		Non Suspect ACM	2025	SF	0	SF				N/A	N/A	N/A
1	1	Gym		N/A	Sheetrock Wall		Non Suspect ACM	3640	SF	0	SF				N/A	N/A	N/A
1	1	Gym		M	Transite Sills	1310/01/01/VER/BB/2300	Assumed	15	SF	0	SF				1	No	1/D
1	1	Gym		M	Floor Tile VAT 12" x 12"	1310/01/01/CC	Assumed	2025	SF	0	SF				1	No	1/D
1	1	Gym		N/A	Cement Floor		Non Suspect ACM	2025	SF	0	SF				N/A	N/A	N/A

1310/3407 Mastery Charter @ Harrity 2015-2016 AHERA Three Year Report

School District of Philadelphia Mastery Charter School @ Harrity (K-8) 5601 Christian Street, Philadelphia, PA 19143 ULCS# 1310/3407 Year Built: 1913			AHERA Three-Year Reinspection 2015-2016 Room by Room Location Log Report										Reinspection Date: 1/6/16 Building Inspector: Norman Harrison Number: ACC-0915-6-011 Management Planner: Monique Causley Certificate Number: ACC-0215-8-010			
E l e m e n t	F l o o r	On Site Room Name	System Affected	Material Description	HID#	Confirmed Assumed NAD Non Suspect ACM	Amount of Material	SF LF EA	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic Crawl Space Ranking	Damage Potential (DP)	Newly Friable (NF)	Response Action (RA)
1	1	Gym Storage Room	N/A	Sheetrock Ceiling		Non Suspect ACM	135	SF	0	SF				N/A	N/A	N/A
1	1	Gym Storage Room	N/A	Sheetrock Wall		Non Suspect ACM	520	SF	0	SF				N/A	N/A	N/A
1	1	Gym Storage Room	N/A	Cement Floor		Non Suspect ACM	135	SF	0	SF				N/A	N/A	N/A
1	1	Hallway outside Classrooms 201-204	M	Floor Tile VAT 12" x 12"	1310/01/01/CC	Assumed	200	SF	0	SF	Blue			1	No	1/D
1	1	Hallway outside Classrooms 201-204	M	Floor Tile VAT 12" x 12"	1310/01/01/CC	Assumed	200	SF	0	SF	White			1	No	1/D
1	1	Hallway outside Classrooms 201-204	N/A	Cement Floor		Non Suspect ACM	630	SF	0	SF				N/A	N/A	N/A
1	1	Hallway outside Classrooms 201-204	N/A	Ceiling Tile 2' x 4'		NAD	630	SF	0	SF				N/A	N/A	N/A
1	1	Hallway outside Classrooms 201-204	N/A	Plaster Ceiling		NAD	630	SF	0	SF				N/A	N/A	N/A
1	1	Hallway outside Classrooms 201-204	N/A	Concrete Block Wall		Non Suspect ACM	390	SF	0	SF				N/A	N/A	N/A
1	1	Hallway outside Classrooms 201-204	N/A	Plaster Walls		NAD	1800	SF	0	SF				N/A	N/A	N/A
1	1	Hallway outside Classrooms 201-204	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	40	LF	0	LF				N/A	N/A	N/A
1	1	Hallway outside Classrooms 201-204	M	Transite Cove Base	1310/01/01/VER/BB/2320	Assumed	180	SF	0	SF				1	No	1/D
1	1	Hallway outside Classrooms 206-209	N/A	Cement Floor		Non Suspect ACM	1274	SF	0	SF				N/A	N/A	N/A
1	1	Hallway outside Classrooms 206-209	N/A	Ceiling Tile 2' x 4'		NAD	1274	SF	0	SF				N/A	N/A	N/A
1	1	Hallway outside Classrooms 206-209	N/A	Plaster Ceiling		NAD	1274	SF	0	SF				N/A	N/A	N/A
1	1	Hallway outside Classrooms 206-209	N/A	Plaster Walls		NAD	2220	SF	0	SF				N/A	N/A	N/A
1	1	Hallway outside Classrooms 206-209	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	36	LF	0	LF				N/A	N/A	N/A
1	1	Hallway outside Classrooms 206-209	M	Transite Cove Base	1310/01/01/VER/BB/2320	Assumed	225	SF	0	SF				1	No	1/D
1	1	Main Entrance Hallway	N/A	Cement Floor		Non Suspect ACM	260	SF	0	SF				N/A	N/A	N/A
1	1	Main Entrance Hallway	N/A	Plaster Walls		NAD	720	SF	0	SF				N/A	N/A	N/A
1	1	Main Entrance Hallway	N/A	Ceiling Tile 2' x 4'		NAD	260	SF	0	SF				N/A	N/A	N/A
1	1	Main Entrance Hallway	N/A	Plaster Ceiling		NAD	260	SF	0	SF				N/A	N/A	N/A
1	1	Main Entrance Hallway	M	Transite Cove Base	1310/01/01/VER/BB/2320	Assumed	72	SF	0	SF				1	No	1/D
1	1	Hallway outside Classroom 210 to Gym	N/A	Cement Floor		Non Suspect ACM	930	SF	0	SF				N/A	N/A	N/A
1	1	Hallway outside Classroom 210 to Gym	M	Floor Tile VAT 12" x 12"	1310/01/01/CC	Assumed	315	SF	0	SF	Multi			1	No	1/D
1	1	Hallway outside Classroom 210 to Gym	N/A	Plaster Walls		NAD	2060	SF	0	SF				N/A	N/A	N/A
1	1	Hallway outside Classroom 210 to Gym	N/A	Concrete Block Wall		Non Suspect ACM	160	SF	0	SF				N/A	N/A	N/A
1	1	Hallway outside Classroom 210 to Gym	N/A	Ceiling Tile 2' x 4'		NAD	930	SF	0	SF				N/A	N/A	N/A
1	1	Hallway outside Classroom 210 to Gym	N/A	Plaster Ceiling		NAD	930	SF	0	SF				N/A	N/A	N/A
1	1	Hallway outside Classroom 210 to Gym	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	40	LF	0	LF				N/A	N/A	N/A
1	1	Hallway outside Classroom 210 to Gym	M	Transite Cove Base	1310/01/01/VER/BB/2320	Assumed	206	SF	0	SF				1	No	1/D
1	1	Stairwell 1 adjacent to Classroom 203	N/A	Cement Floor		Non Suspect ACM	324	SF	0	SF				N/A	N/A	N/A
1	1	Stairwell 1 adjacent to Classroom 203	N/A	Concrete Ceiling		Non Suspect ACM	324	SF	0	SF				N/A	N/A	N/A
1	1	Stairwell 1 adjacent to Classroom 203	N/A	Brick Wall		Non Suspect ACM	380	SF	0	SF				N/A	N/A	N/A
1	1	Stairwell 1 adjacent to Classroom 203	N/A	Concrete Block Wall		Non Suspect ACM	715	SF	0	SF				N/A	N/A	N/A
1	1	Stairwell 2 adjacent to Classroom 206	N/A	Cement Floor		Non Suspect ACM	240	SF	0	SF				N/A	N/A	N/A
1	1	Stairwell 2 adjacent to Classroom 206	N/A	Plaster Ceiling		NAD	240	SF	0	SF				N/A	N/A	N/A
1	1	Stairwell 2 adjacent to Classroom 206	N/A	Plaster Walls		NAD	955	SF	0	SF				N/A	N/A	N/A
1	1	Stairwell 2 adjacent to Classroom 206	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	20	LF	0	LF				N/A	N/A	N/A
1	1	Stairwell 2 adjacent to Classroom 206	M	Transite Cove Base	1310/01/01/VER/BB/2320	Assumed	70	SF	0	SF				1	No	1/D
1	1	Main Entrance Stairwell	N/A	Ceramic Tile Floors		Non Suspect ACM	105	SF	0	SF				N/A	N/A	N/A
1	1	Main Entrance Stairwell	N/A	Marble Floor		Non Suspect ACM	105	SF	0	SF				N/A	N/A	N/A
1	1	Main Entrance Stairwell	N/A	Plaster Ceiling		NAD	210	SF	0	SF				N/A	N/A	N/A
1	1	Main Entrance Stairwell	N/A	Plaster Walls		NAD	815	SF	0	SF				N/A	N/A	N/A
1	1	Main Entrance Stairwell	N/A	Ceramic Tile Walls		Non Suspect ACM	410	SF	0	SF				N/A	N/A	N/A
1	1	Stairwell 3 adjacent to Classroom 209	N/A	Cement Floor		Non Suspect ACM	266	SF	0	SF				N/A	N/A	N/A
1	1	Stairwell 3 adjacent to Classroom 209	N/A	Plaster Ceiling		NAD	266	SF	0	SF				N/A	N/A	N/A
1	1	Stairwell 3 adjacent to Classroom 209	N/A	Plaster Walls		NAD	925	SF	0	SF				N/A	N/A	N/A
1	1	Stairwell 3 adjacent to Classroom 209	M	Transite Cove Base	1310/01/01/VER/BB/2320	Assumed	70	SF	0	SF				1	No	1/D
1	1	Stairwell 4 adjacent to Classroom 211	T	Pipe Fitting Insulation	1310/01/01/12	Confirmed	7	EA	0	SF				1	No	1/D
1	1	Stairwell 4 adjacent to Classroom 211	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	15	LF	0	SF				N/A	N/A	N/A
1	1	Stairwell 4 adjacent to Classroom 211	N/A	Concrete Ceiling		Non Suspect ACM	324	SF	0	SF				N/A	N/A	N/A
1	1	Stairwell 4 adjacent to Classroom 211	N/A	Concrete Block Wall		Non Suspect ACM	715	SF	0	SF				N/A	N/A	N/A
1	1	Stairwell 4 adjacent to Classroom 211	N/A	Brick Wall		Non Suspect ACM	380	SF	0	SF				N/A	N/A	N/A
1	1	Stairwell 4 adjacent to Classroom 211	N/A	Cement Floor		Non Suspect ACM	324	SF	0	SF				N/A	N/A	N/A
1	B	Administrative Suite Copy Room	M	Floor Tile VAT 12" x 12"	1310/01/0B/PP	Assumed	210	SF	0	SF	Blue			1	No	1/D
1	B	Administrative Suite Copy Room	N/A	Cement Floor		Non Suspect ACM	210	SF	0	SF				N/A	N/A	N/A
1	B	Administrative Suite Copy Room	N/A	Ceiling Tile 2' x 4'		NAD	210	SF	0	SF				N/A	N/A	N/A
1	B	Administrative Suite Copy Room	N/A	Concrete Ceiling		Non Suspect ACM	210	SF	0	SF				N/A	N/A	N/A
1	B	Administrative Suite Copy Room	N/A	Concrete Block Wall		Non Suspect ACM	360	SF	0	SF				N/A	N/A	N/A
1	B	Administrative Suite Copy Room	N/A	Glass Wall		Non Suspect ACM	170	SF	0	SF				N/A	N/A	N/A
1	B	Administrative Suite Center Cubicle Area	M	Floor Tile VAT 12" x 12"	1310/01/0B/PP	Assumed	920	SF	0	SF	Blue			1	No	1/D
1	B	Administrative Suite Center Cubicle Area	N/A	Cement Floor		Non Suspect ACM	920	SF	0	SF				N/A	N/A	N/A
1	B	Administrative Suite Center Cubicle Area	N/A	Ceiling Tile 2' x 4'		NAD	920	SF	0	SF				N/A	N/A	N/A
1	B	Administrative Suite Center Cubicle Area	N/A	Concrete Ceiling		Non Suspect ACM	920	SF	0	SF				N/A	N/A	N/A
1	B	Administrative Suite Center Cubicle Area	N/A	Concrete Block Wall		Non Suspect ACM	825	SF	0	SF				N/A	N/A	N/A
1	B	Administrative Suite Center Cubicle Area	N/A	Glass Wall		Non Suspect ACM	170	SF	0	SF				N/A	N/A	N/A
1	B	Administrative Suite Testing Room	M	Floor Tile VAT 12" x 12"	1310/01/0B/PP	Assumed	225	SF	0	SF	Blue			1	No	1/D
1	B	Administrative Suite Testing Room	N/A	Cement Floor		Non Suspect ACM	225	SF	0	SF				N/A	N/A	N/A
1	B	Administrative Suite Testing Room	N/A	Ceiling Tile 2' x 4'		NAD	225	SF	0	SF				N/A	N/A	N/A
1	B	Administrative Suite Testing Room	N/A	Concrete Ceiling		Non Suspect ACM	225	SF	0	SF				N/A	N/A	N/A
1	B	Administrative Suite Testing Room	N/A	Concrete Block Wall		Non Suspect ACM	490	SF	0	SF				N/A	N/A	N/A
1	B	Administrative Suite Speech Office	M	Floor Tile VAT 12" x 12"	1310/01/0B/PP	Assumed	225	SF	0	SF	Blue			1	No	1/D
1	B	Administrative Suite Speech Office	N/A	Cement Floor		Non Suspect ACM	225	SF	0	SF				N/A	N/A	N/A
1	B	Administrative Suite Speech Office	N/A	Ceiling Tile 2' x 4'		NAD	225	SF	0	SF				N/A	N/A	N/A

1310/3407 Mastery Charter @ Harrity 2015-2016 AHERA Three Year Report

School District of Philadelphia Mastery Charter School @ Harrity (K-8) 5601 Christian Street, Philadelphia, PA 19143 ULCS# 1310/3407 Year Built: 1913			AHERA Three-Year Reinspection 2015-2016 Room by Room Location Log Report										Reinspection Date: 1/6/16 Building Inspector: Norman Harrison Number: ACC-0915-6-011 Management Planner: Monique Causley Certificate Number: ACC-0215-8-010			
E l e m e n t	F l o o r	On Site Room Name	System Affected	Material Description	HID#	Confirmed Assumed NAD Non Suspect ACM	Amount of Material	SF LF EA	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic Crawl Space Ranking	Damage Potential (DP)	Newly Friable (NF)	Response Action (RA)
1	B	Administrative Suite Speech Office	N/A	Concrete Block Wall		Non Suspect ACM	480	SF	0	SF				N/A	N/A	N/A
1	B	Administrative Suite Speech Office	M	Sink Undercoat Mastic	1310/01/0B/VER/BB/2602	Assumed	5	SF	0	SF				1	No	1/D
1	B	Administrative Suite Assistant Dean's Office	M	Floor Tile VAT 12" x 12"	1310/01/0B/PP	Assumed	195	SF	0	SF	Blue			1	No	1/D
1	B	Administrative Suite Assistant Dean's Office	N/A	Cement Floor		Non Suspect ACM	195	SF	0	SF				N/A	N/A	N/A
1	B	Administrative Suite Assistant Dean's Office	N/A	Fiberglass Ceiling Tile 2' x 4'		Non Suspect ACM	195	SF	0	SF				N/A	N/A	N/A
1	B	Administrative Suite Assistant Dean's Office	N/A	Concrete Ceiling		Non Suspect ACM	195	SF	0	SF				N/A	N/A	N/A
1	B	Administrative Suite Assistant Dean's Office	N/A	Concrete Block Wall		Non Suspect ACM	450	SF	0	SF				N/A	N/A	N/A
1	B	Administrative Suite Assistant Dean's Office Restroom	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	2	LF	0	LF				N/A	N/A	N/A
1	B	Administrative Suite Assistant Dean's Office Restroom	N/A	Plaster Ceiling		NAD	25	SF	0	SF				N/A	N/A	N/A
1	B	Administrative Suite Assistant Dean's Office Restroom	N/A	Concrete Block Wall		Non Suspect ACM	160	SF	0	SF				N/A	N/A	N/A
1	B	Administrative Suite Assistant Dean's Office Restroom	N/A	Ceramic Tile Floors		Non Suspect ACM	25	SF	0	SF				N/A	N/A	N/A
1	B	Administrative Suite Assistant Dean's Office Closet	x	x		x	x	x	x	x	x	No access		x	x	x
1	B	Administrative Suite Office adjacent to Exterior Entrance	M	Floor Tile VAT 12" x 12"	1310/01/0B/PP	Assumed	225	SF	0	SF	Blue			1	No	1/D
1	B	Administrative Suite Office adjacent to Exterior Entrance	N/A	Cement Floor		Non Suspect ACM	225	SF	0	SF				N/A	N/A	N/A
1	B	Administrative Suite Office adjacent to Exterior Entrance	N/A	Fiberglass Ceiling Tile 2' x 4'		Non Suspect ACM	225	SF	0	SF				N/A	N/A	N/A
1	B	Administrative Suite Office adjacent to Exterior Entrance	N/A	Concrete Ceiling		Non Suspect ACM	225	SF	0	SF				N/A	N/A	N/A
1	B	Administrative Suite Office adjacent to Exterior Entrance	N/A	Concrete Block Wall		Non Suspect ACM	480	SF	0	SF				N/A	N/A	N/A
1	B	Closet	N/A	Metal Ceiling		Non Suspect ACM	25	SF	0	SF				N/A	N/A	N/A
1	B	Administrative Suite Office adjacent to Exterior Entrance Closet	N/A	Concrete Block Wall		Non Suspect ACM	160	SF	0	SF				N/A	N/A	N/A
1	B	Administrative Suite Office adjacent to Exterior Entrance Closet	M	Floor Tile VAT 12" x 12"	1310/01/0B/PP	Assumed	25	SF	0	SF	Blue			1	No	1/D
1	B	Administrative Suite Office adjacent to Exterior Entrance Closet	N/A	Cement Floor		Non Suspect ACM	25	SF	0	SF				N/A	N/A	N/A
1	B	Administrative Suite Hallway to Exterior Entrance	N/A	Fiberglass Ceiling Tile 2' x 4'		Non Suspect ACM	45	SF	0	SF				N/A	N/A	N/A
1	B	Administrative Suite Hallway to Exterior Entrance	N/A	Concrete Ceiling		Non Suspect ACM	45	SF	0	SF				N/A	N/A	N/A
1	B	Administrative Suite Hallway to Exterior Entrance	N/A	Concrete Block Wall		Non Suspect ACM	220	SF	0	SF				N/A	N/A	N/A
1	B	Administrative Suite Hallway to Exterior Entrance	M	Floor Tile VAT 12" x 12"	1310/01/0B/PP	Assumed	45	SF	0	SF	Grey			1	No	1/D
1	B	Administrative Suite Hallway to Exterior Entrance	N/A	Cement Floor		Non Suspect ACM	45	SF	0	SF				N/A	N/A	N/A
1	B	Administrative Suite Mechanical Room	N/A	Cement Floor		Non Suspect ACM	225	SF	0	SF				N/A	N/A	N/A
1	B	Administrative Suite Mechanical Room	M	Floor Tile VAT 12" x 12"	1310/01/0B/PP	Assumed	225	SF	0	SF	Blue			1	No	1/D
1	B	Administrative Suite Mechanical Room	N/A	Fiberglass Ceiling Tile 2' x 4'		Non Suspect ACM	225	SF	0	SF				N/A	N/A	N/A
1	B	Administrative Suite Mechanical Room	N/A	Concrete Block Wall		Non Suspect ACM	480	SF	0	SF				N/A	N/A	N/A
1	B	Administrative Suite Mechanical Room	T	Pipe Fitting Insulation	1310/01/0B/06	Confirmed	17	EA	0	EA				1	No	1/D
1	B	Administrative Suite Mechanical Room	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	30	LF	0	LF				N/A	N/A	N/A
1	B	Administrative Suite Mechanical Room	M	Vibration Damper Cloth	1310/01/0B/25	Assumed	10	SF	0	SF				1	No	1/D
1	B	Administrative Suite Mechanical Room	M	Sink Undercoat Mastic	1310/01/0B/VER/BB/2602	Assumed	8	SF	0	SF	White			1	No	1/D
1	B	Administrative Suite Office adjacent to Mechanical Room	M	Floor Tile VAT 12" x 12"	1310/01/0B/PP	Assumed	295	SF	0	SF	Blue			1	No	1/D
1	B	Administrative Suite Office adjacent to Mechanical Room	N/A	Cement Floor		Non Suspect ACM	295	SF	0	SF				N/A	N/A	N/A
1	B	Administrative Suite Office adjacent to Mechanical Room	N/A	Fiberglass Ceiling Tile 2' x 4'		Non Suspect ACM	295	SF	0	SF				N/A	N/A	N/A
1	B	Administrative Suite Office adjacent to Mechanical Room	N/A	Concrete Ceiling		Non Suspect ACM	295	SF	0	SF				N/A	N/A	N/A
1	B	Administrative Suite Office adjacent to Mechanical Room	N/A	Concrete Block Wall		Non Suspect ACM	700	SF	0	SF				N/A	N/A	N/A
1	B	Administrative Suite Office adjacent to Mechanical Room Closet	T	Pipe Fitting Insulation	1310/01/0B/06	Confirmed	8	EA	1	EA				1	Yes	2/B
1	B	Administrative Suite Office adjacent to Mechanical Room Closet	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	20	LF	0	LF				N/A	N/A	N/A
1	B	Administrative Suite Office adjacent to Mechanical Room Closet	N/A	Fiberglass Ceiling Tile 2' x 4'		Non Suspect ACM	20	SF	0	SF				N/A	N/A	N/A
1	B	Administrative Suite Office adjacent to Mechanical Room Closet	N/A	Concrete Ceiling		Non Suspect ACM	20	SF	0	SF				N/A	N/A	N/A
1	B	Administrative Suite Office adjacent to Mechanical Room Closet	N/A	Concrete Block Wall		Non Suspect ACM	180	SF	0	SF				N/A	N/A	N/A
1	B	Administrative Suite Office adjacent to Mechanical Room Closet	M	Floor Tile VAT 12" x 12"	1310/01/0B/PP	Assumed	20	SF	0	SF	Blue			1	No	1/D
1	B	Administrative Suite Office adjacent to Mechanical Room Closet	N/A	Cement Floor		Non Suspect ACM	20	SF	0	SF				N/A	N/A	N/A
1	B	Administrative Suite Classroom 101	M	Floor Tile VAT 12" x 12"	1310/01/0B/PP	Assumed	68	SF	0	SF	Grey			1	No	1/D
1	B	Administrative Suite Classroom 101	M	Floor Tile VAT 12" x 12"	1310/01/0B/PP	Assumed	212	SF	0	SF	Blue			1	No	1/D
1	B	Administrative Suite Classroom 101	N/A	Cement Floor		Non Suspect ACM	280	SF	0	SF				N/A	N/A	N/A
1	B	Administrative Suite Classroom 101	N/A	Ceiling Tile 2' x 4'		NAD	280	SF	2	SF				N/A	N/A	N/A
1	B	Administrative Suite Classroom 101	N/A	Concrete Ceiling		Non Suspect ACM	280	SF	0	SF				N/A	N/A	N/A
1	B	Administrative Suite Classroom 101	N/A	Concrete Block Wall		Non Suspect ACM	680	SF	0	SF				N/A	N/A	N/A
1	B	Administrative Suite Classroom 101 Restroom	N/A	Plaster Ceiling		NAD	25	SF	0	SF				N/A	N/A	N/A
1	B	Administrative Suite Classroom 101 Restroom	N/A	Concrete Block Wall		Non Suspect ACM	160	SF	0	SF				N/A	N/A	N/A
1	B	Administrative Suite Classroom 101 Restroom	N/A	Ceramic Tile Floors		Non Suspect ACM	25	SF	0	SF				N/A	N/A	N/A
1	B	Administrative Suite Classroom 101 Lactation Room	N/A	Ceiling Tile 2' x 4'		NAD	40	SF	0	SF				N/A	N/A	N/A
1	B	Administrative Suite Classroom 101 Lactation Room	N/A	Concrete Ceiling		Non Suspect ACM	40	SF	0	SF				N/A	N/A	N/A
1	B	Administrative Suite Classroom 101 Lactation Room	N/A	Concrete Block Wall		Non Suspect ACM	260	SF	0	SF				N/A	N/A	N/A
1	B	Administrative Suite Classroom 101 Lactation Room	M	Floor Tile VAT 12" x 12"	1310/01/0B/PP	Assumed	40	SF	0	SF	Grey			1	No	1/D
1	B	Administrative Suite Classroom 101 Lactation Room	N/A	Cement Floor		Non Suspect ACM	40	SF	0	SF				N/A	N/A	N/A
1	B	Classroom 102	M	Floor Tile VAT 12" x 12"	1310/01/0B/PP	Assumed	960	SF	0	SF	Blue			1	No	1/D
1	B	Classroom 102	N/A	Carpet		Non Suspect ACM	290	SF	0	SF				N/A	N/A	N/A

1310/3407 Mastery Charter @ Harrity 2015-2016 AHERA Three Year Report

<div>School District of Philadelphia</div> <div>Mastery Charter School @ Harrity (K-8)</div> <div>5601 Christian Street, Philadelphia, PA 19143</div> <div>ULCS# 1310/3407</div> <div>Year Built: 1913</div>			AHERA Three-Year Reinspection 2015-2016										Reinspection Date: 1/6/16						
			Room by Room Location Log Report										Building Inspector: Norman Harrison						
													Number: ACC-0915-6-011						
													Management Planner: Monique Causley						
													Certificate Number: ACC-0215-8-010						
Element	Floor	Room	On Site Room Name	System Affected	Material Description	HID#	Confirmed Assumed NAD	Amount of Material	SF	LF	Amount of Damage	SF	LF	Color required for VAT	Comments/Description/Notes	Attic Crawl Space Ranking	Damage Potential (DP)	Newly Friable (NF)	Response Action (RA)
1	B	Classroom 102	N/A	Cement Floor			Non Suspect ACM	1250	SF		0	SF					N/A	N/A	N/A
1	B	Classroom 102	N/A	Fiberglass Ceiling Tile 2' x 4'			Non Suspect ACM	1250	SF		0	SF					N/A	N/A	N/A
1	B	Classroom 102	N/A	Concrete Ceiling			Non Suspect ACM	1250	SF		0	SF					N/A	N/A	N/A
1	B	Classroom 102	N/A	Concrete Block Wall			Non Suspect ACM	1305	SF		0	SF					N/A	N/A	N/A
1	B	Classroom 102	N/A	Plaster Walls			NAD	195	SF		0	SF					N/A	N/A	N/A
1	B	Classroom 102	N/A	Fiberglass Pipe Insulation			Non Suspect ACM	10	LF		0	LF					N/A	N/A	N/A
1	B	Classroom 102 Coat Closet	M	Floor Tile VAT 12" x 12"	1310/01/0B/PP		Assumed	135	SF		0	SF		Blue			1	No	1/D
1	B	Classroom 102 Coat Closet	N/A	Cement Floor			Non Suspect ACM	135	SF		0	SF					N/A	N/A	N/A
1	B	Classroom 102 Coat Closet	N/A	Fiberglass Ceiling Tile 2' x 4'			Non Suspect ACM	135	SF		0	SF					N/A	N/A	N/A
1	B	Classroom 102 Coat Closet	N/A	Concrete Ceiling			Non Suspect ACM	135	SF		0	SF					N/A	N/A	N/A
1	B	Classroom 102 Coat Closet	N/A	Plaster Walls			NAD	120	SF		0	SF					N/A	N/A	N/A
1	B	Classroom 102 Coat Closet	N/A	Concrete Block Wall			Non Suspect ACM	440	SF		0	SF					N/A	N/A	N/A
1	B	Classroom 102 Restroom	N/A	Ceramic Tile Floors			Non Suspect ACM	65	SF		0	SF					N/A	N/A	N/A
1	B	Classroom 102 Restroom	N/A	Plaster Ceiling			NAD	65	SF		0	SF					N/A	N/A	N/A
1	B	Classroom 102 Restroom	N/A	Concrete Block Wall			Non Suspect ACM	260	SF		0	SF					N/A	N/A	N/A
1	B	Classroom 102 Small Closet	M	Floor Tile VAT 9" x 9"	1310/01/0B/04		Confirmed	8	SF		0	SF		Green			1	No	1/D
1	B	Classroom 102 Small Closet	N/A	Cement Floor			Non Suspect ACM	8	SF		0	SF					N/A	N/A	N/A
1	B	Classroom 102 Small Closet	N/A	Fiberglass Ceiling Tile 2' x 4'			Non Suspect ACM	8	SF		0	SF					N/A	N/A	N/A
1	B	Classroom 102 Small Closet	N/A	Concrete Ceiling			Non Suspect ACM	8	SF		0	SF					N/A	N/A	N/A
1	B	Classroom 102 Small Closet	N/A	Concrete Block Wall			Non Suspect ACM	120	SF		0	SF					N/A	N/A	N/A
1	B	Classroom 102 Large Closet	N/A	Fiberglass Ceiling Tile 2' x 4'			Non Suspect ACM	70	SF		0	SF					N/A	N/A	N/A
1	B	Classroom 102 Large Closet	N/A	Concrete Ceiling			Non Suspect ACM	70	SF		0	SF					N/A	N/A	N/A
1	B	Classroom 102 Large Closet	N/A	Concrete Block Wall			Non Suspect ACM	340	SF		0	SF					N/A	N/A	N/A
1	B	Classroom 102 Large Closet	M	Floor Tile VAT 9" x 9"	1310/01/0B/04		Confirmed	70	SF		0	SF					1	No	1/D
1	B	Classroom 102 Large Closet	N/A	Cement Floor			Non Suspect ACM	70	SF		0	SF					N/A	N/A	N/A
1	B	Classroom 103	M	Floor Tile VAT 12" x 12"	1310/01/0B/PP		Assumed	420	SF		0	SF		Blue			1	No	1/D
1	B	Classroom 103	M	Floor Tile VAT 12" x 12"	1310/01/0B/PP		Assumed	420	SF		0	SF		Grey			1	No	1/D
1	B	Classroom 103	N/A	Cement Floor			Non Suspect ACM	840	SF		0	SF					N/A	N/A	N/A
1	B	Classroom 103	N/A	Fiberglass Ceiling Tile 2' x 4'			Non Suspect ACM	840	SF		1	SF					N/A	N/A	N/A
1	B	Classroom 103	N/A	Brick Wall			Non Suspect ACM	1060	SF		0	SF					N/A	N/A	N/A
1	B	Classroom 103	N/A	Concrete Block Wall			Non Suspect ACM	340	SF		0	SF					N/A	N/A	N/A
1	B	Classroom 103	N/A	Fiberglass Pipe Insulation			Non Suspect ACM	40	LF		0	LF					N/A	N/A	N/A
1	B	Classroom 103	T	Pipe Fitting Insulation	1310/01/0B/06		Confirmed	2	LF		0	LF					1	No	1/D
1	B	Classroom 105	M	Floor Tile VAT 12" x 12"	1310/01/0B/PP		Assumed	420	SF		0	SF		Blue			1	No	1/D
1	B	Classroom 105	M	Floor Tile VAT 12" x 12"	1310/01/0B/PP		Assumed	420	SF		0	SF		Grey			1	No	1/D
1	B	Classroom 105	N/A	Cement Floor			Non Suspect ACM	840	SF		0	SF					N/A	N/A	N/A
1	B	Classroom 105	N/A	Fiberglass Ceiling Tile 2' x 4'			Non Suspect ACM	840	SF		0	SF					N/A	N/A	N/A
1	B	Classroom 105	N/A	Brick Wall			Non Suspect ACM	1060	SF		0	SF					N/A	N/A	N/A
1	B	Classroom 105	N/A	Concrete Block Wall			Non Suspect ACM	340	SF		0	SF					N/A	N/A	N/A
1	B	Classroom 105	N/A	Fiberglass Pipe Insulation			Non Suspect ACM	40	LF		0	LF					N/A	N/A	N/A
1	B	Office across from Classroom 105	M	Floor Tile VAT 9" x 9"	1310/01/0B/04		Confirmed	274	SF		0	SF		Green			1	No	1/D
1	B	Office across from Classroom 105	M	Floor Tile VAT 12" x 12"	1310/01/0B/PP		Assumed	46	SF		0	SF		Blue			1	No	1/D
1	B	Office across from Classroom 105	N/A	Cement Floor			Non Suspect ACM	320	SF		0	SF					N/A	N/A	N/A
1	B	Office across from Classroom 105	N/A	Fiberglass Ceiling Tile 2' x 4'			Non Suspect ACM	320	SF		0	SF					N/A	N/A	N/A
1	B	Office across from Classroom 105	N/A	Concrete Ceiling			Non Suspect ACM	320	SF		0	SF					N/A	N/A	N/A
1	B	Office across from Classroom 105	N/A	Brick Wall			Non Suspect ACM	160	SF		0	SF					N/A	N/A	N/A
1	B	Office across from Classroom 105	N/A	Concrete Block Wall			Non Suspect ACM	560	SF		0	SF					N/A	N/A	N/A
1	B	Building Engineer's Office	T	Pipe Fitting Insulation	1310/01/0B/06		Confirmed	16	EA		0	SF					1	No	1/D
1	B	Building Engineer's Office	T	Pipe Insulation 2-6 inch	1310/01/0B/01		Confirmed	53	LF		0	SF					1	No	1/D
1	B	Building Engineer's Office	N/A	Fiberglass Pipe Insulation			Non Suspect ACM	75	LF		0	SF					N/A	N/A	N/A
1	B	Building Engineer's Office	N/A	Concrete Ceiling			Non Suspect ACM	196	SF		0	SF					N/A	N/A	N/A
1	B	Building Engineer's Office	N/A	Brick Wall			Non Suspect ACM	840	SF		0	SF					N/A	N/A	N/A
1	B	Building Engineer's Office	M	Floor Tile VAT 12" x 12"	1310/01/0B/PP		Assumed	25	SF		0	SF					1	No	1/D
1	B	Building Engineer's Office	N/A	Cement Floor			Non Suspect ACM	196	SF		0	SF					N/A	N/A	N/A
1	B	Staff Restroom across from Cafeteria	N/A	Ceramic Tile Floors			Non Suspect ACM	84	SF		0	SF					N/A	N/A	N/A
1	B	Staff Restroom across from Cafeteria	N/A	Plaster Ceiling			NAD	84	SF		0	SF					N/A	N/A	N/A
1	B	Staff Restroom across from Cafeteria	N/A	Brick Wall			Non Suspect ACM	210	SF		0	SF					N/A	N/A	N/A
1	B	Staff Restroom across from Cafeteria	N/A	Concrete Block Wall			Non Suspect ACM	100	SF		0	SF					N/A	N/A	N/A
1	B	Cafeteria	N/A	Cement Floor			Non Suspect ACM	1014	SF		0	SF		Tan			N/A	N/A	N/A
1	B	Cafeteria	N/A	Fiberglass Ceiling Tile 2' x 4'			Non Suspect ACM	1664	SF		0	SF					N/A	N/A	N/A
1	B	Cafeteria	N/A	Concrete Ceiling			Non Suspect ACM	1664	SF		0	SF					N/A	N/A	N/A
1	B	Cafeteria	N/A	Brick Wall			Non Suspect ACM	1500	SF		0	SF					N/A	N/A	N/A
1	B	Cafeteria	N/A	Fiberglass Pipe Fitting Insulation			Non Suspect ACM	101	EA		0	EA					N/A	N/A	N/A
1	B	Cafeteria	N/A	Fiberglass Pipe Insulation			Non Suspect ACM	101	LF		0	LF					N/A	N/A	N/A
1	B	Cafeteria Closet	N/A	Concrete Ceiling			Non Suspect ACM	20	SF		0	SF					N/A	N/A	N/A
1	B	Cafeteria Closet	N/A	Brick Wall			Non Suspect ACM	180	SF		0	SF					N/A	N/A	N/A
1	B	Cafeteria Closet	N/A	Cement Floor			Non Suspect ACM	20	SF		0	SF					N/A	N/A	N/A
1	B	Custodial Storage adjacent to Cafeteria	N/A	Fiberglass Ceiling Tile 2' x 4'			Non Suspect ACM	80	SF		0	SF					N/A	N/A	N/A
1	B	Custodial Storage adjacent to Cafeteria	N/A	Concrete Ceiling			Non Suspect ACM	80	SF		0	SF					N/A	N/A	N/A
1	B	Custodial Storage adjacent to Cafeteria	N/A	Brick Wall			Non Suspect ACM	260	SF		0	SF					N/A	N/A	N/A
1	B	Custodial Storage adjacent to Cafeteria	N/A	Cement Floor			Non Suspect ACM	80	SF		0	SF					N/A	N/A	N/A
1	B	Custodial Staff Office	N/A	Fiberglass Pipe Insulation			Non Suspect ACM	25	LF		0	SF					N/A	N/A	N/A
1	B	Custodial Staff Office	N/A	Concrete Ceiling			Non Suspect ACM	220	SF		0	SF					N/A	N/A	N/A
1	B	Custodial Staff Office	N/A	Brick Wall			Non Suspect ACM	1080	SF		0	SF					N/A	N/A	N/A
1	B	Custodial Staff Office	N/A	Cement Floor			Non Suspect ACM	220	SF		0	SF					N/A	N/A	N/A

1310/3407 Mastery Charter @ Harrity 2015-2016 AHERA Three Year Report

School District of Philadelphia		AHERA Three-Year Reinspection 2015-2016										Reinspection Date: 1/6/16							
Mastery Charter School @ Harrity (K-8)		Room by Room Location Log Report										Building Inspector: Norman Harrison							
5601 Christian Street, Philadelphia, PA 19143												Number: ACC-0915-6-011							
ULCS# 1310/3407												Management Planner: Monique Causley							
Year Built: 1913												Certificate Number: ACC-0215-8-010							
E l e m e n t	F l o o r	On Site Room Name	System Affected	Material Description	HID#	Confirmed Assumed NAD	Amount of Material	SF LF EA	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic Crawl Space Ranking	Damage Potential (DP)	Newly Friable (NF)	Response Action (RA)			
1	B	Fan Room behind Custodial Staff Office	N/A	Cement Floor		Non Suspect ACM	256	SF	0	SF				N/A	N/A	N/A			
1	B	Fan Room behind Custodial Staff Office	N/A	Concrete Ceiling		Non Suspect ACM	256	SF	0	SF				N/A	N/A	N/A			
1	B	Fan Room behind Custodial Staff Office	N/A	Brick Wall		Non Suspect ACM	500	SF	0	SF				N/A	N/A	N/A			
1	B	Fan Room behind Custodial Staff Office	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	50	LF	0	SF				N/A	N/A	N/A			
1	B	Fan Room adjacent to Cafeteria	N/A	Cement Floor		Non Suspect ACM	323	SF	0	SF				N/A	N/A	N/A			
1	B	Fan Room adjacent to Cafeteria	N/A	Concrete Ceiling		Non Suspect ACM	323	SF	0	SF				N/A	N/A	N/A			
1	B	Fan Room adjacent to Cafeteria	N/A	Brick Wall		Non Suspect ACM	500	SF	0	SF				N/A	N/A	N/A			
1	B	Classroom 106	M	Floor Tile VAT 9" x 9"	1310/01/0B/04	Confirmed	1330	SF	0	SF	Green			1	No	1/D			
1	B	Classroom 106	N/A	Cement Floor		Non Suspect ACM	1330	SF	0	SF				N/A	N/A	N/A			
1	B	Classroom 106	N/A	Fiberglass Ceiling Tile 2' x 4'		Non Suspect ACM	1330	SF	2	SF				N/A	N/A	N/A			
1	B	Classroom 106	N/A	Concrete Ceiling		Non Suspect ACM	1330	SF	0	SF				N/A	N/A	N/A			
1	B	Classroom 106	N/A	Concrete Block Wall		Non Suspect ACM	1310	SF	0	SF				N/A	N/A	N/A			
1	B	Classroom 106	N/A	Sheetrock Wall		Non Suspect ACM	370	SF	0	SF				N/A	N/A	N/A			
1	B	Classroom 106	N/A	Carpet		Non Suspect ACM	360	SF	0	SF				N/A	N/A	N/A			
1	B	Classroom 106	M	Sink Undercoat Mastic	1310/01/0B/VER/BB/2602	Assumed	4	SF	0	SF	Black			1	No	1/D			
1	B	Classroom 106 Restroom	N/A	Ceramic Tile Floors		Non Suspect ACM	108	SF	0	SF				N/A	N/A	N/A			
1	B	Classroom 106 Restroom	N/A	Plaster Ceiling		NAD	108	SF	5	SF				N/A	N/A	N/A			
1	B	Classroom 106 Restroom	N/A	Brick Wall		Non Suspect ACM	75	SF	0	SF				N/A	N/A	N/A			
1	B	Classroom 106 Restroom	N/A	Concrete Block Wall		Non Suspect ACM	180	SF	0	SF				N/A	N/A	N/A			
1	B	Classroom 106 Restroom Pipe Chase	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	5	LF	0	SF				N/A	N/A	N/A			
1	B	Classroom 106 Restroom Pipe Chase	N/A	Concrete Ceiling		Non Suspect ACM	20	SF	0	SF				N/A	N/A	N/A			
1	B	Classroom 106 Restroom Pipe Chase	N/A	Concrete Block Wall		Non Suspect ACM	220	SF	0	SF				N/A	N/A	N/A			
1	B	Classroom 106 Restroom Pipe Chase	N/A	Cement Floor		Non Suspect ACM	20	SF	0	SF				N/A	N/A	N/A			
1	B	Classroom 106 Office	N/A	Fiberglass Ceiling Tile 2' x 4'		Non Suspect ACM	290	SF	0	SF				N/A	N/A	N/A			
1	B	Classroom 106 Office	N/A	Concrete Ceiling		Non Suspect ACM	290	SF	0	SF				N/A	N/A	N/A			
1	B	Classroom 106 Office	N/A	Concrete Block Wall		Non Suspect ACM	570	SF	0	SF				N/A	N/A	N/A			
1	B	Classroom 106 Office	N/A	Sheetrock Wall		Non Suspect ACM	370	SF	0	SF				N/A	N/A	N/A			
1	B	Classroom 106 Office	M	Floor Tile VAT 9" x 9"	1310/01/0B/04	Confirmed	290	SF	0	SF				1	No	1/D			
1	B	Classroom 106 Office	N/A	Cement Floor		Non Suspect ACM	290	SF	0	SF				N/A	N/A	N/A			
1	B	Fan Room adjacent to Boiler Room	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	75	SF	0	SF				N/A	N/A	N/A			
1	B	Fan Room adjacent to Boiler Room	N/A	Concrete Ceiling		Non Suspect ACM	810	SF	0	SF				N/A	N/A	N/A			
1	B	Fan Room adjacent to Boiler Room	N/A	Brick Wall		Non Suspect ACM	2055	SF	0	SF				N/A	N/A	N/A			
1	B	Fan Room adjacent to Boiler Room	N/A	Cement Floor		Non Suspect ACM	810	SF	0	SF				N/A	N/A	N/A			
1	B	Boiler Room	N/A	Cement Floor		Non Suspect ACM	1800	SF	0	SF				N/A	N/A	N/A			
1	B	Boiler Room	N/A	Concrete Ceiling		Non Suspect ACM	1800	SF	0	SF				N/A	N/A	N/A			
1	B	Boiler Room	N/A	Brick Wall		Non Suspect ACM	3000	SF	0	SF				N/A	N/A	N/A			
1	B	Boiler Room	N/A	Fiberglass Pipe Fitting Insulation		Non Suspect ACM	101	EA	0	EA				N/A	N/A	N/A			
1	B	Boiler Room	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	101	LF	0	LF				N/A	N/A	N/A			
1	B	Boiler Room Storage	N/A	Cement Floor		Non Suspect ACM	1809	SF	0	SF				N/A	N/A	N/A			
1	B	Boiler Room Storage	N/A	Concrete Ceiling		Non Suspect ACM	405	SF	0	SF				N/A	N/A	N/A			
1	B	Boiler Room Storage	N/A	Metal Ceiling		Non Suspect ACM	1404	SF	0	SF				N/A	N/A	N/A			
1	B	Boiler Room Storage	N/A	Plaster Ceiling		NAD	595	SF	0	SF				N/A	N/A	N/A			
1	B	Boiler Room Storage	N/A	Brick Wall		Non Suspect ACM	1500	SF	0	SF				N/A	N/A	N/A			
1	B	Boiler Room Storage	T	Pipe Fitting Insulation	1310/01/0B/06	Confirmed	21	EA	2	EA				1	Yes	2/C			
1	B	Boiler Room Storage	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	50	LF	0	LF				N/A	N/A	N/A			
1	B	Office adjacent to Stairwell 3	M	Floor Tile VAT 12" x 12"	1310/01/0B/PP	Assumed	10	SF	0	SF	Blue			1	No	1/D			
1	B	Office adjacent to Stairwell 3	M	Floor Tile VAT 9" x 9"	1310/01/0B/04	Confirmed	134	SF	0	SF	Green			1	No	1/D			
1	B	Office adjacent to Stairwell 3	N/A	Cement Floor		Non Suspect ACM	144	SF	0	SF				N/A	N/A	N/A			
1	B	Office adjacent to Stairwell 3	N/A	Fiberglass Ceiling Tile 2' x 4'		Non Suspect ACM	144	SF	0	SF				N/A	N/A	N/A			
1	B	Office adjacent to Stairwell 3	N/A	Concrete Ceiling		Non Suspect ACM	144	SF	0	SF				N/A	N/A	N/A			
1	B	Office adjacent to Stairwell 3	N/A	Concrete Block Wall		Non Suspect ACM	195	SF	0	SF				N/A	N/A	N/A			
1	B	Office adjacent to Stairwell 3	N/A	Plaster Walls		NAD	195	SF	0	SF				N/A	N/A	N/A			
1	B	Office adjacent to Stairwell 3 Closet	N/A	Concrete Ceiling		Non Suspect ACM	30	SF	0	SF				N/A	N/A	N/A			
1	B	Office adjacent to Stairwell 3 Closet	N/A	Brick Wall		Non Suspect ACM	110	SF	0	SF				N/A	N/A	N/A			
1	B	Office adjacent to Stairwell 3 Closet	N/A	Concrete Block Wall		Non Suspect ACM	110	SF	0	SF				N/A	N/A	N/A			
1	B	Office adjacent to Stairwell 3 Closet	M	Floor Tile VAT 9" x 9"	1310/01/0B/04	Confirmed	30	SF	0	SF	Green			1	No	1/D			
1	B	Office adjacent to Stairwell 3 Closet	N/A	Cement Floor		Non Suspect ACM	30	SF	0	SF				N/A	N/A	N/A			
1	B	Classroom 110	M	Floor Tile VAT 12" x 12"	1310/01/0B/PP	Assumed	1014	SF	0	SF	Tan			1	No	1/D			
1	B	Classroom 110	N/A	Cement Floor		Non Suspect ACM	1014	SF	0	SF				N/A	N/A	N/A			
1	B	Classroom 110	N/A	Fiberglass Ceiling Tile 2' x 4'		Non Suspect ACM	1014	SF	0	SF				N/A	N/A	N/A			
1	B	Classroom 110	N/A	Concrete Ceiling		Non Suspect ACM	1014	SF	0	SF				N/A	N/A	N/A			
1	B	Classroom 110	N/A	Concrete Block Wall		Non Suspect ACM	520	SF	0	SF				N/A	N/A	N/A			
1	B	Classroom 110	N/A	Plaster Walls		NAD	520	SF	0	SF				N/A	N/A	N/A			
1	B	Classroom 110	M	Blackboard Glue Dots	1310/01/0B/USA/NH/2600	Assumed	5	SF	0	SF				1	No	1/D			
1	B	Classroom 110	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	10	LF	0	LF				N/A	N/A	N/A			
1	B	Classroom 110 Restroom	M	Floor Tile VAT 12" x 12"	1310/01/0B/PP	Assumed	6	SF	0	SF	Tan			1	No	1/D			
1	B	Classroom 110 Restroom	N/A	Cement Floor		Non Suspect ACM	6	SF	0	SF				N/A	N/A	N/A			
1	B	Classroom 110 Restroom	N/A	Ceramic Tile Floors		Non Suspect ACM	57	SF	0	SF				N/A	N/A	N/A			
1	B	Classroom 110 Restroom	N/A	Fiberglass Ceiling Tile 2' x 4'		Non Suspect ACM	63	SF	0	SF				N/A	N/A	N/A			
1	B	Classroom 110 Restroom	N/A	Concrete Ceiling		Non Suspect ACM	63	SF	0	SF				N/A	N/A	N/A			
1	B	Classroom 110 Restroom	N/A	Plaster Walls		NAD	75	SF	0	SF				N/A	N/A	N/A			
1	B	Classroom 110 Restroom	N/A	Concrete Block Wall		Non Suspect ACM	185	SF	0	SF				N/A	N/A	N/A			
1	B	Classroom 110 Restroom	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	10	LF	0	LF				N/A	N/A	N/A			
1	B	Classroom 110 Coat Closet	M	Floor Tile VAT 12" x 12"	1310/01/0B/PP	Assumed	84	SF	0	SF	Tan			1	No	1/D			
1	B	Classroom 110 Coat Closet	N/A	Cement Floor		Non Suspect ACM	84	SF	0	SF				N/A	N/A	N/A			

1310/3407 Mastery Charter @ Harrity 2015-2016 AHERA Three Year Report

School District of Philadelphia		AHERA Three-Year Reinspection 2015-2016										Reinspection Date: 1/6/16				
Mastery Charter School @ Harrity (K-8)		Room by Room Location Log Report										Building Inspector: Norman Harrison				
5601 Christian Street, Philadelphia, PA 19143												Number: ACC-0915-6-011				
ULCS# 1310/3407												Management Planner: Monique Causley				
Year Built: 1913												Certificate Number: ACC-0215-8-010				
E l e m e n t	F l o o r	On Site Room Name	System Affected	Material Description	HID#	Confirmed Assumed NAD Non Suspect ACM	Amount of Material	SF LF EA	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic Crawl Space Ranking	Damage Potential (DP)	Newly Friable (NF)	Response Action (RA)
1	B	Classroom 110 Coat Closet	N/A	Fiberglass Ceiling Tile 2' x 4'		Non Suspect ACM	84	SF	0	SF				N/A	N/A	N/A
1	B	Classroom 110 Coat Closet	N/A	Concrete Ceiling		Non Suspect ACM	84	SF	0	SF				N/A	N/A	N/A
1	B	Classroom 110 Coat Closet	N/A	Concrete Block Wall		Non Suspect ACM	305	SF	0	SF				N/A	N/A	N/A
1	B	Building Engineer's Storage Room adjacent to Classroom 110	M	Floor Tile VAT 9" x 9"	1310/01/0B/04	Confirmed	270	SF	0	SF				1	No	1/D
1	B	Building Engineer's Storage Room adjacent to Classroom 110	N/A	Cement Floor		Non Suspect ACM	270	SF	0	SF				N/A	N/A	N/A
1	B	Building Engineer's Storage Room adjacent to Classroom 110	N/A	Concrete Ceiling		Non Suspect ACM	270	SF	0	SF				N/A	N/A	N/A
1	B	Building Engineer's Storage Room adjacent to Classroom 110	N/A	Concrete Block Wall		Non Suspect ACM	330	SF	0	SF				N/A	N/A	N/A
1	B	Building Engineer's Storage Room adjacent to Classroom 110	N/A	Plaster Walls		NAD	330	SF	0	SF				N/A	N/A	N/A
1	B	Hallway outside Freight Elevator	N/A	Fiberglass Ceiling Tile 2' x 4'		Non Suspect ACM	195	SF	0	SF				N/A	N/A	N/A
1	B	Hallway outside Freight Elevator	N/A	Concrete Ceiling		Non Suspect ACM	195	SF	0	SF				N/A	N/A	N/A
1	B	Hallway outside Freight Elevator	N/A	Concrete Block Wall		Non Suspect ACM	500	SF	0	SF				N/A	N/A	N/A
1	B	Hallway outside Freight Elevator	N/A	Cement Floor		Non Suspect ACM	195	SF	0	SF				N/A	N/A	N/A
1	B	Classroom 109	M	Floor Tile VAT 12" x 12"	1310/01/0B/PP	Assumed	1250	SF	1	SF	Tan			1	No	6/C
1	B	Classroom 109	N/A	Non Suspect ACM		Non Suspect ACM	1250	SF	0	SF				N/A	N/A	N/A
1	B	Classroom 109	N/A	Carpet		Non Suspect ACM	270	SF	0	SF				N/A	N/A	N/A
1	B	Classroom 109	N/A	Fiberglass Ceiling Tile 2' x 4'		Non Suspect ACM	1250	SF	1	SF				N/A	N/A	N/A
1	B	Classroom 109	N/A	Concrete Ceiling		Non Suspect ACM	1250	SF	0	SF				N/A	N/A	N/A
1	B	Classroom 109	N/A	Concrete Block Wall		Non Suspect ACM	1200	SF	0	SF				N/A	N/A	N/A
1	B	Classroom 109	N/A	Plaster Walls		NAD	300	SF	0	SF				N/A	N/A	N/A
1	B	Classroom 109	M	Sink Undercoat Mastic	1310/01/0B/VER/BB/2602	Assumed	4	SF	0	SF				1	No	1/D
1	B	Classroom 109	M	Blackboard Glue Dots	1310/01/0B/USA/NH/2600	Assumed	5	SF	0	SF				1	No	1/D
1	B	Classroom 109	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	10	LF	0	LF				N/A	N/A	N/A
1	B	Classroom 109 Coat Closet	M	Floor Tile VAT 12" x 12"	1310/01/0B/PP	Assumed	80	SF	2	SF	Tan			1	No	6/C
1	B	Classroom 109 Coat Closet	N/A	Cement Floor		Non Suspect ACM	80	SF	0	SF				N/A	N/A	N/A
1	B	Classroom 109 Coat Closet	N/A	Fiberglass Ceiling Tile 2' x 4'		Non Suspect ACM	80	SF	0	SF				N/A	N/A	N/A
1	B	Classroom 109 Coat Closet	N/A	Concrete Ceiling		Non Suspect ACM	80	SF	0	SF				N/A	N/A	N/A
1	B	Classroom 109 Coat Closet	N/A	Concrete Block Wall		Non Suspect ACM	360	SF	0	SF				N/A	N/A	N/A
1	B	Classroom 109 Restroom	N/A	Ceramic Tile Floors		Non Suspect ACM	65	SF	0	SF				N/A	N/A	N/A
1	B	Classroom 109 Restroom	N/A	Plaster Ceiling		NAD	65	SF	0	SF				N/A	N/A	N/A
1	B	Classroom 109 Restroom	N/A	Concrete Block Wall		Non Suspect ACM	260	SF	0	SF				N/A	N/A	N/A
1	B	Classroom 109 Small Closet	N/A	Fiberglass Ceiling Tile 2' x 4'		Non Suspect ACM	8	SF	0	SF				N/A	N/A	N/A
1	B	Classroom 109 Small Closet	N/A	Concrete Ceiling		Non Suspect ACM	8	SF	0	SF				N/A	N/A	N/A
1	B	Classroom 109 Small Closet	N/A	Concrete Block Wall		Non Suspect ACM	120	SF	0	SF				N/A	N/A	N/A
1	B	Classroom 109 Small Closet	M	Floor Tile VAT 9" x 9"	1310/01/0B/04	Confirmed	8	SF	0	SF	Green			1	No	1/D
1	B	Classroom 109 Small Closet	N/A	Cement Floor		Non Suspect ACM	8	SF	0	SF				N/A	N/A	N/A
1	B	Classroom 109 Large Closet	N/A	Fiberglass Ceiling Tile 2' x 4'		Non Suspect ACM	60	SF	0	SF				N/A	N/A	N/A
1	B	Classroom 109 Large Closet	N/A	Concrete Ceiling		Non Suspect ACM	60	SF	0	SF				N/A	N/A	N/A
1	B	Classroom 109 Large Closet	N/A	Concrete Block Wall		Non Suspect ACM	220	SF	0	SF				N/A	N/A	N/A
1	B	Classroom 109 Large Closet	N/A	Plaster Walls		NAD	100	SF	15	SF				N/A	N/A	N/A
1	B	Classroom 109 Large Closet	M	Floor Tile VAT 9" x 9"	1310/01/0B/04	Confirmed	60	SF	0	SF				1	No	1/D
1	B	Classroom 109 Large Closet	N/A	Cement Floor		Non Suspect ACM	60	SF	0	SF				N/A	N/A	N/A
1	B	Classroom 108	M	Floor Tile VAT 12" x 12"	1310/01/0B/PP	Assumed	980	SF	0	SF	Tan			1	No	1/D
1	B	Classroom 108	N/A	Carpet		Non Suspect ACM	270	SF	0	SF				N/A	N/A	N/A
1	B	Classroom 108	N/A	Cement Floor		Non Suspect ACM	1250	SF	0	SF				N/A	N/A	N/A
1	B	Classroom 108	N/A	Fiberglass Ceiling Tile 2' x 4'		Non Suspect ACM	1250	SF	0	SF				N/A	N/A	N/A
1	B	Classroom 108	N/A	Concrete Ceiling		Non Suspect ACM	1250	SF	0	SF				N/A	N/A	N/A
1	B	Classroom 108	N/A	Concrete Block Wall		Non Suspect ACM	1500	SF	0	SF				N/A	N/A	N/A
1	B	Classroom 108	M	Blackboard Glue Dots	1310/01/0B/USA/NH/2600	Assumed	5	SF	0	SF				1	No	1/D
1	B	Classroom 108	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	10	LF	0	LF				N/A	N/A	N/A
1	B	Classroom 108 Large Closet	N/A	Fiberglass Ceiling Tile 2' x 4'		Non Suspect ACM	60	SF	0	SF				N/A	N/A	N/A
1	B	Classroom 108 Large Closet	N/A	Concrete Ceiling		Non Suspect ACM	60	SF	0	SF				N/A	N/A	N/A
1	B	Classroom 108 Large Closet	N/A	Concrete Block Wall		Non Suspect ACM	320	SF	0	SF				N/A	N/A	N/A
1	B	Classroom 108 Large Closet	M	Floor Tile VAT 9" x 9"	1310/01/0B/04	Confirmed	60	SF	0	SF				1	No	1/D
1	B	Classroom 108 Large Closet	N/A	Cement Floor		Non Suspect ACM	60	SF	0	SF				N/A	N/A	N/A
1	B	Classroom 108 Restroom	N/A	Ceramic Tile Floors		Non Suspect ACM	65	SF	0	SF				N/A	N/A	N/A
1	B	Classroom 108 Restroom	N/A	Plaster Ceiling		NAD	65	SF	0	SF				N/A	N/A	N/A
1	B	Classroom 108 Restroom	N/A	Concrete Block Wall		Non Suspect ACM	260	SF	0	SF				N/A	N/A	N/A
1	B	Classroom 108 Small Closet	N/A	Fiberglass Ceiling Tile 2' x 4'		Non Suspect ACM	8	SF	0	SF				N/A	N/A	N/A
1	B	Classroom 108 Small Closet	N/A	Concrete Ceiling		Non Suspect ACM	8	SF	0	SF				N/A	N/A	N/A
1	B	Classroom 108 Small Closet	N/A	Concrete Block Wall		Non Suspect ACM	120	SF	0	SF				N/A	N/A	N/A
1	B	Classroom 108 Small Closet	M	Floor Tile VAT 9" x 9"	1310/01/0B/04	Confirmed	8	SF	0	SF	Green			1	No	1/D
1	B	Classroom 108 Small Closet	N/A	Cement Floor		Non Suspect ACM	8	SF	0	SF				N/A	N/A	N/A
1	B	Classroom 108 Coat Closet	M	Floor Tile VAT 12" x 12"	1310/01/0B/PP	Assumed	80	SF	0	SF	Tan			1	No	1/D
1	B	Classroom 108 Coat Closet	N/A	Cement Floor		Non Suspect ACM	80	SF	0	SF				N/A	N/A	N/A
1	B	Classroom 108 Coat Closet	N/A	Fiberglass Ceiling Tile 2' x 4'		Non Suspect ACM	80	SF	0	SF				N/A	N/A	N/A
1	B	Classroom 108 Coat Closet	N/A	Concrete Ceiling		Non Suspect ACM	80	SF	0	SF				N/A	N/A	N/A
1	B	Classroom 108 Coat Closet	N/A	Concrete Block Wall		Non Suspect ACM	360	SF	0	SF				N/A	N/A	N/A
1	B	Boy's Restroom	N/A	Ceramic Tile Floors		Non Suspect ACM	320	SF	0	SF				N/A	N/A	N/A
1	B	Boy's Restroom	N/A	Plaster Ceiling		NAD	320	SF	0	SF				N/A	N/A	N/A
1	B	Boy's Restroom	N/A	Concrete Block Wall		Non Suspect ACM	580	SF	0	SF				N/A	N/A	N/A
1	B	Custodial Closet between Boy's and Girl's Restrooms	N/A	Plaster Ceiling		NAD	70	SF	0	SF				N/A	N/A	N/A

1310/3407 Mastery Charter @ Harrity 2015-2016 AHERA Three Year Report

School District of Philadelphia Mastery Charter School @ Harrity (K-8) 5601 Christian Street, Philadelphia, PA 19143 ULCS# 1310/3407 Year Built: 1913			AHERA Three-Year Reinspection 2015-2016 Room by Room Location Log Report										Reinspection Date: 1/6/16 Building Inspector: Norman Harrison Number: ACC-0915-6-011 Management Planner: Monique Causley Certificate Number: ACC-0215-8-010			
Element	Floor	Room	System Affected	Material Description	HID#	Confirmed Assumed NAD Non Suspect ACM	Amount of Material	SF LF EA	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic Crawl Space Ranking	Damage Potential (DP)	Newly Friable (NF)	Response Action (RA)
1	B	Custodial Closet between Boy's and Girl's Restrooms	N/A	Concrete Block Wall		Non Suspect ACM	240	SF	0	SF				N/A	N/A	N/A
1	B	Custodial Closet between Boy's and Girl's Restrooms	N/A	Brick Wall		Non Suspect ACM	100	SF	0	SF				N/A	N/A	N/A
1	B	Custodial Closet between Boy's and Girl's Restrooms	M	Transite Cove Base	1310/01/0B/VER/BB/2320	Assumed	35	SF	0	SF				1	No	1/D
1	B	Custodial Closet between Boy's and Girl's Restrooms	M	Floor Tile VAT 9" x 9"	1310/01/0B/04	Confirmed	70	SF	0	SF				1	No	1/D
1	B	Custodial Closet between Boy's and Girl's Restrooms	N/A	Cement Floor		Non Suspect ACM	70	SF	0	SF				N/A	N/A	N/A
1	B	Girl's Restroom	N/A	Ceramic Tile Floors		Non Suspect ACM	238	SF	0	SF				N/A	N/A	N/A
1	B	Girl's Restroom	N/A	Plaster Ceiling		NAD	238	SF	0	SF				N/A	N/A	N/A
1	B	Girl's Restroom	N/A	Ceiling Tile 2' x 4'		NAD	238	SF	2	SF				N/A	N/A	N/A
1	B	Girl's Restroom	N/A	Concrete Block Wall		Non Suspect ACM	500	SF	0	SF				N/A	N/A	N/A
1	B	Girl's Restroom Pipe Chase	T	Pipe Fitting Insulation	1310/01/0B/06	Confirmed	1	EA	0	EA		Limited inspection. Large access panel is painted shut.		1	No	1/D
1	B	Girl's Restroom Pipe Chase	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	10	LF	0	LF		Limited inspection. Large access panel is painted shut.		N/A	N/A	N/A
1	B	Girl's Restroom Pipe Chase	N/A	Concrete Ceiling		Non Suspect ACM	45	SF	0	SF		Limited inspection. Large access panel is painted shut.		N/A	N/A	N/A
1	B	Girl's Restroom Pipe Chase	N/A	Concrete Block Wall		Non Suspect ACM	360	SF	0	SF				N/A	N/A	N/A
1	B	Girl's Restroom Pipe Chase	N/A	Cement Floor		Non Suspect ACM	45	SF	0	SF		Limited inspection. Large access panel is painted shut.		N/A	N/A	N/A
1	B	Hallway outside Classroom 110	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	10	LF	0	SF				N/A	N/A	N/A
1	B	Hallway outside Classroom 110	N/A	Fiberglass Ceiling Tile 2' x 4'		Non Suspect ACM	855	SF	0	SF				N/A	N/A	N/A
1	B	Hallway outside Classroom 110	N/A	Concrete Ceiling		Non Suspect ACM	855	SF	0	SF				N/A	N/A	N/A
1	B	Hallway outside Classroom 110	N/A	Concrete Block Wall		Non Suspect ACM	640	SF	0	SF				N/A	N/A	N/A
1	B	Hallway outside Classroom 110	N/A	Brick Wall		Non Suspect ACM	1260	SF	0	SF				N/A	N/A	N/A
1	B	Hallway outside Classroom 110	M	Transite Cove Base	1310/01/0B/VER/BB/2320	Assumed	190	SF	0	SF				1	No	1/D
1	B	Hallway outside Classroom 110	M	Floor Tile VAT 12" x 12"	1310/01/0B/PP	Assumed	290	SF	0	SF	Tan			1	No	1/D
1	B	Hallway outside Classroom 110	N/A	Cement Floor		Non Suspect ACM	855	SF	0	SF				N/A	N/A	N/A
1	B	Hallway outside Classrooms 108-109	N/A	Fiberglass Ceiling Tile 2' x 4'		Non Suspect ACM	330	SF	0	SF				N/A	N/A	N/A
1	B	Hallway outside Classrooms 108-109	N/A	Concrete Ceiling		Non Suspect ACM	330	SF	0	SF				N/A	N/A	N/A
1	B	Hallway outside Classrooms 108-109	N/A	Concrete Block Wall		Non Suspect ACM	780	SF	0	SF				N/A	N/A	N/A
1	B	Hallway outside Classrooms 108-109	M	Floor Tile VAT 9" x 9"	1310/01/0B/04	Confirmed	330	SF	0	SF	Green			1	No	1/D
1	B	Hallway outside Classrooms 108-109	N/A	Cement Floor		Non Suspect ACM	330	SF	0	SF				N/A	N/A	N/A
1	B	Hallway outside Classroom 106-Boiler Room	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	24	LF	0	LF				N/A	N/A	N/A
1	B	Hallway outside Classroom 106-Boiler Room	N/A	Fiberglass Ceiling Tile 2' x 4'		Non Suspect ACM	900	SF	0	SF				N/A	N/A	N/A
1	B	Hallway outside Classroom 106-Boiler Room	N/A	Concrete Ceiling		Non Suspect ACM	900	SF	0	SF				N/A	N/A	N/A
1	B	Hallway outside Classroom 106-Boiler Room	N/A	Brick Wall		Non Suspect ACM	1210	SF	0	SF				N/A	N/A	N/A
1	B	Hallway outside Classroom 106-Boiler Room	N/A	Plaster Walls		NAD	105	SF	0	SF				N/A	N/A	N/A
1	B	Hallway outside Classroom 106-Boiler Room	M	Transite Cove Base	1310/01/0B/VER/BB/2320	Assumed	164	SF	0	SF				1	No	1/D
1	B	Hallway outside Classroom 106-Boiler Room	N/A	Cement Floor		Non Suspect ACM	900	SF	0	SF				N/A	N/A	N/A
1	B	Hallway outside Cafeteria	N/A	Fiberglass Ceiling Tile 2' x 4'		Non Suspect ACM	430	SF	0	SF				N/A	N/A	N/A
1	B	Hallway outside Cafeteria	N/A	Concrete Ceiling		Non Suspect ACM	430	SF	0	SF				N/A	N/A	N/A
1	B	Hallway outside Cafeteria	N/A	Brick Wall		Non Suspect ACM	635	SF	0	SF				N/A	N/A	N/A
1	B	Hallway outside Cafeteria	N/A	Plaster Walls		NAD	105	SF	0	SF				N/A	N/A	N/A
1	B	Hallway outside Cafeteria	M	Transite Cove Base	1310/01/0B/VER/BB/2320	Assumed	92	SF	0	SF				1	No	1/D
1	B	Hallway outside Cafeteria	N/A	Cement Floor		Non Suspect ACM	430	SF	0	SF				N/A	N/A	N/A
1	B	Hallway outside Classrooms 102-105	N/A	Fiberglass Ceiling Tile 2' x 4'		Non Suspect ACM	780	SF	0	SF				N/A	N/A	N/A
1	B	Hallway outside Classrooms 102-105	N/A	Concrete Ceiling		Non Suspect ACM	780	SF	0	SF				N/A	N/A	N/A
1	B	Hallway outside Classrooms 102-105	N/A	Brick Wall		Non Suspect ACM	680	SF	0	SF				N/A	N/A	N/A
1	B	Hallway outside Classrooms 102-105	N/A	Concrete Block Wall		Non Suspect ACM	1010	SF	0	SF				N/A	N/A	N/A
1	B	Hallway outside Classrooms 102-105	M	Transite Cove Base	1310/01/0B/VER/BB/2320	Assumed	126	SF	0	SF				1	No	1/D
1	B	Hallway outside Classrooms 102-105	M	Floor Tile VAT 12" x 12"	1310/01/0B/PP	Assumed	136	SF	0	SF	Blue			1	No	1/D
1	B	Hallway outside Classrooms 102-105	M	Floor Tile VAT 12" x 12"	1310/01/0B/PP	Assumed	136	SF	0	SF	Grey			1	No	1/D
1	B	Hallway outside Classrooms 102-105	N/A	Cement Floor		Non Suspect ACM	780	SF	0	SF				N/A	N/A	N/A
1	B	Hallway outside Administrative Suite	N/A	Fiberglass Ceiling Tile 2' x 4'		Non Suspect ACM	115	SF	0	SF				N/A	N/A	N/A
1	B	Hallway outside Administrative Suite	N/A	Concrete Ceiling		Non Suspect ACM	115	SF	0	SF				N/A	N/A	N/A
1	B	Hallway outside Administrative Suite	N/A	Concrete Block Wall		Non Suspect ACM	290	SF	0	SF				N/A	N/A	N/A
1	B	Hallway outside Administrative Suite	M	Floor Tile VAT 12" x 12"	1310/01/0B/PP	Assumed	58	SF	0	SF				1	No	1/D
1	B	Hallway outside Administrative Suite	M	Floor Tile VAT 12" x 12"	1310/01/0B/PP	Assumed	58	SF	0	SF				1	No	1/D
1	B	Hallway outside Administrative Suite	N/A	Cement Floor		Non Suspect ACM	115	SF	0	SF				N/A	N/A	N/A
1	B	Stairwell 1 adjacent to Classroom 103	N/A	Cement Floor		Non Suspect ACM	273	SF	0	SF				N/A	N/A	N/A
1	B	Stairwell 1 adjacent to Classroom 103	N/A	Concrete Ceiling		Non Suspect ACM	273	SF	0	SF				N/A	N/A	N/A
1	B	Stairwell 1 adjacent to Classroom 103	N/A	Brick Wall		Non Suspect ACM	550	SF	0	SF				N/A	N/A	N/A
1	B	Stairwell 1 adjacent to Classroom 103	N/A	Concrete Block Wall		Non Suspect ACM	1225	SF	0	SF				N/A	N/A	N/A
1	B	Stairwell 1 adjacent to Classroom 103	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	20	LF	0	LF				N/A	N/A	N/A
1	B	Stairwell 2 adjacent to Cafeteria	N/A	Cement Floor		Non Suspect ACM	190	SF	0	SF				N/A	N/A	N/A
1	B	Stairwell 2 adjacent to Cafeteria	N/A	Plaster Ceiling		NAD	190	SF	0	SF				N/A	N/A	N/A
1	B	Stairwell 2 adjacent to Cafeteria	N/A	Plaster Walls		NAD	580	SF	0	SF				N/A	N/A	N/A
1	B	Stairwell 2 adjacent to Cafeteria	N/A	Transite Cove Base	1310/01/0B/VER/BB/2320	Assumed	58	SF	0	SF				N/A	N/A	N/A
1	B	Stairwell 3 adjacent to Boiler Room	N/A	Plaster Ceiling		NAD	190	SF	0	SF				N/A	N/A	N/A
1	B	Stairwell 3 adjacent to Boiler Room	N/A	Plaster Walls		NAD	580	SF	0	SF				N/A	N/A	N/A
1	B	Stairwell 3 adjacent to Boiler Room	M	Transite Cove Base	1310/01/0B/VER/BB/2320	Assumed	58	SF	0	SF				1	No	1/D
1	B	Stairwell 3 adjacent to Boiler Room	N/A	Cement Floor		Non Suspect ACM	190	SF	0	SF				N/A	N/A	N/A
1	B	Passenger Elevator	M	Floor Tile VAT 9" x 9"	1310/01/0B/04	Confirmed	30	SF	0	SF				1	No	1/D
1	B	Freight Elevator	N/A	Metal Ceiling		Non Suspect ACM	40	SF	0	SF				N/A	N/A	N/A
1	B	Freight Elevator	N/A	Metal Wall		Non Suspect ACM	210	SF	0	SF				N/A	N/A	N/A
1	B	Freight Elevator	N/A	Metal Floor		Non Suspect ACM	40	SF	0	SF				N/A	N/A	N/A
1	A	Attic at Stairwell B	x	x		x	x	x	x	x	x	FG Pipe	A	N/A	N/A	N/A

1310/3407 Mastery Charter @ Harrity 2015-2016 AHERA Three Year Report

Element F l o o r		School District of Philadelphia Mastery Charter School @ Harrity (K-8) 5601 Christian Street, Philadelphia, PA 19143 ULCS# 1310/3407 Year Built: 1913		AHERA Three-Year Reinspection 2015-2016 Room by Room Location Log Report										Reinspection Date: 1/6/16					
														Building Inspector: Norman Harrison					
														Number: ACC-0915-6-011					
														Management Planner: Monique Causley					
														Certificate Number: ACC-0215-8-010					
		On Site Room Name	System Affected	Material Description	HID#	Confirmed Assumed NAD Non Suspect ACM	Amount of Material	SF LF EA	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic Crawl Space Ranking	Damage Potential (DP)	Newly Friable (NF)	Response Action (RA)			
1	C	Crawl Space	x	x		x	x	x	x	x	x	None	None	N/A	N/A	N/A			

Section III Certificates

A. Management Planner/Building Inspector Certificates

Section III – A

Management Planner/Building Inspector Certificates

These charts indicate the Name, Course Date, Expiration Date and Corresponding Certificate Number of the Management Planner and Building Inspector of individuals that participated in the AHERA 3 Year Inspection and Management Plan process of 2015/2016.

Management Planner	Date Granted	Expiration Date	Certificate Number
Monique Causley	2/15/2015	2/16/2016	ACC-0215-8-010
Monique Causley	2/16/2016	2/17/2017	ACC-0216-8-001
Megan Vala	5/22/2015	6/22/2016	740728
Mary Anne Lerro	4/5/2016	4/5/2017	742327

Building Inspector	Date Granted	Expiration Date	Certificate Number
Scott Magee	8/15/2015	8/15/2016	70016699C
William Garrity	8/15/2015	8/15/2016	70016699A
Bernard Brunner	10/2/2015	8/2/2016	45397
Mary Anne Lerro	3/3/2015	3/3/2016	740092
Mary Anne Lerro	4/5/2016	4/5/2017	742322
James Madden	12/11/2014	12/11/2015	ACC-1214-6-010
James Madden	12/3/2015	12/3/2016	ACC-1215-6-018
Troy Ray	3/15/2015	3/19/2016	ACC-0355-6-011
Ananth Vinjamuri	9/29/2015	9/29/2016	374
Shelton Williams	9/29/2015	9/29/2016	375
Paul Davis	2/12/2015	2/12/2016	ACC-0215-6-015
Paul Davis	2/2/2016	2/2/2017	741836
Bernard Bryson	2/16/2015	2/16/2016	ACC-0125-6-031
Bernard Bryson	2/15/2016	2/15/2017	ACC-0216-6-005
Alexander Roman	9/18/2015	9/18/2016	EHSBIR-150619-008
Norm Harrison	9/2/2015	9/2/2016	ACC-0915-6-011
Kelly Mayberry	2/20/2015	2/20/2016	EHSBIR-150220-005
Kelly Mayberry	2/18/2016	2/18/2017	EHSBIR-160218-006
Andrew Hine	5/6/2015	5/6/2016	AI05042015-3
Maryellen Leotta	2/12/2015	2/12/2016	ACC-0215-6-024

Certificate of Completion

awarded to

Monique Causley

for successfully completing the prescribed course of study in

Pennsylvania Asbestos Management Planner Refresher Course

under TSCA Title II

presented by

ACCESS TRAINING SERVICES, INC.
7921 River Road, Pennsauken, NJ 08110
(856) 665-3449

2/16/15

Course Date

N/A

Exam Date

2/16/16

Expiration Date

Not Provided

Social Security Number

ACC-0215-8-010

Certificate Number

Mark K. Schlager
Training Director

Certificate of Completion

awarded to

Monique Causley

for successfully completing the prescribed course of study in

Pennsylvania Asbestos Management Planner Refresher Course

under TSCA Title II

presented by

ACCESS TRAINING SERVICES, INC.
7921 River Road, Pennsauken, NJ 08110
(856) 665-3449

2/15/16

Course Date

N/A

Exam Date

2/15/17

Expiration Date

Not Provided

Social Security Number

ACC-0216-8-001

Certificate Number

Mark K. Schlüger
Training Director

Certificate of Training

CRITERION LABORATORIES, INC.

HEREBY CERTIFIES THAT

Megan Vala

HAS SUCCESSFULLY COMPLETED A 16 HOUR COURSE ENTITLED

Asbestos Management Planner Initial

INCLUDING CLASSROOM INSTRUCTION

05/21/2015 to 05/22/2015

Exam passed on this 22nd day of May 2015 - Score - 94

Approved for AHERA Accreditation Under TSCA Title II

3370 Progress Drive, Suite J
Bensalem, PA 19020
(215) 244-1300 - Phone
(215) 244-4349 - Fax
www.criterionlabs.com

Course is conducted in English

DIRECTOR:



James A. Welts, CIH, President

Certificate of Training

CRITERION LABORATORIES, INC.

HEREBY CERTIFIES THAT

Mary Anne Lerro

HAS SUCCESSFULLY COMPLETED A 4 HOUR COURSE ENTITLED

Asbestos Management Planner Refresher

INCLUDING CLASSROOM INSTRUCTION


on this 5th day of April 2016

Approved for AHERA Accreditation Under TSCA Title II

3370 Progress Drive, Suite J
Bensalem, PA 19020
(215) 244-1300 - Phone
(215) 244-4349 - Fax
www.criterionlabs.com

Course is conducted in English

DIRECTOR:



James A. Welts, CIH, President

EMSL ANALYTICAL, INC.

Certifies that

Scott Magee

has successfully completed the course of study for the

Asbestos Building Inspector Refresher Course

for Accreditation under TSCA Title II

EMSL Certificate No. 70016699C


Approved by:

PA Dept. of Labor and Industry
Accreditation # 137

Course Date: 8/15/2015
Granted: 8/15/2015
Expiration Date: 8/15/2016

Sponsored by:

EMSL Analytical, Inc.
200 Route 130 North
Cinnaminson, NJ 08077
Phone: (800) 220-3675
Fax: (856) 786-5973
www.emsl.com

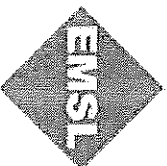

Michael P. Menz

Michael P. Menz, CIH
Training Director

Environmental, Mold, Bacteria, IAQ, Asbestos, Lead, Forensic and Materials Testing Since 1981

EMSL ANALYTICAL, INC.

Certifies that

William Garrity

has successfully completed the course of study for the

Asbestos Building Inspector Refresher Course

for Accreditation under TSCA Title II

EMSL Certificate No. 70016699A


Approved by:

PA Dept. of Labor and Industry
Accreditation # 137

Course Date: 8/15/2015
Granted: 8/15/2015
Expiration Date: 8/15/2016

Sponsored by:

EMSL Analytical, Inc.
200 Route 130 North
Cinnaminson, NJ 08077
Phone: (800) 220-3675
Fax: (856) 786-5973
www.emsl.com

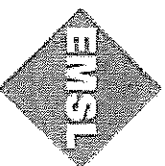

Michael P. Menz

Michael P. Menz, CIH
Training Director

Environmental, Mold, Bacteria, IAQ, Asbestos, Lead, Forensic and Materials Testing Since 1981

45397

National Asbestos & Environmental Training Institute

CERTIFICATE OF COMPLETION

AHERA/EPA Accredited Per 40 CFR Part 763
Asbestos Accreditation under TSCA Title II

This is to certify that

 
Bernard Brunner, Jr.

Successfully completed the course entitled

**1/2-Day New York State/EPA/AHERA Asbestos Building Inspector Annual Refresher on
October 2, 2015**

Examination Passed October 2, 2015

Expiration Date on October 2, 2016


Doris L. Adler
President, NAEETI

Per 10 NYCRR Part 73.2 (L) (1), DOH 2832 Certificate of Completion of Asbestos
Safety Training is the only official record of training for N.Y.S. students.

Language: English

ABIH 1/2 CM POINT

3321 Doris Avenue, Building B, Ocean, NJ 07712

Phone (732) 531-5571

Fax (732) 531-5956

www.naeti.com

Number 740092

Expiration Date:
03/03/2016

Certificate of Training

CRITERION LABORATORIES, INC.

HEREBY CERTIFIES THAT

Mary Anne Lerro

HAS SUCCESSFULLY COMPLETED A 4 HOUR COURSE ENTITLED

Asbestos Building Inspector Refresher

on this 3rd day of March 2015

Exam passed on this 3rd day of March 2015 - Score - 84

Approved for AHERA Accreditation Under TSCA Title II

3370 Progress Drive, Suite J
Bensalem, PA 19020
(215) 244-1300 - Phone
(215) 244-4349 - Fax
www.criterionlabs.com

Course is conducted in English

DIRECTOR:

James A. Weltz
James A. Weltz, CIH, President

Certificate of Training

CRITERION LABORATORIES, INC.

HEREBY CERTIFIES THAT

Mary Anne Lerro

HAS SUCCESSFULLY COMPLETED A 4 HOUR COURSE ENTITLED

Asbestos Building Inspector Refresher

INCLUDING CLASSROOM INSTRUCTION

on this 5th day of April 2016


Exam passed on this 5th day of April 2016 - Score - 88

Approved for AHERA Accreditation Under TSCA Title II

3370 Progress Drive, Suite J
Bensalem, PA 19020
(215) 244-1300 - Phone
(215) 244-4349 - Fax
www.criterionlabs.com

Course is conducted in English

DIRECTOR:

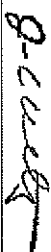

James A. Welts, CIH, President

Certificate of Completion

James Madden

for successfully completing the prescribed course of study in

Pennsylvania Asbestos Building Inspector Refresher Course

under TSCA Title II

presented by
ACCESS TRAINING SERVICES, INC.
7921 River Road, Pennsauken, NJ 08110
(856) 665-3449

12/11/14

Course Date

N/A

Exam Date

12/11/15

Expiration Date

Not Provided

Social Security Number

ACC-1214-6-010

Certificate Number

Mark K. Schlüger
Training Director

Certificate of Completion

James Madden

for successfully completing the prescribed course of study in

Pennsylvania Asbestos Building Inspector Refresher Course

under TSCA Title II

presented by

ACCESS TRAINING SERVICES, INC.
7921 River Road, Pennsauken, NJ 08110
(856) 665-3449

12/3/15

Course Date

N/A

Exam Date

12/3/16

Expiration Date

Not Provided

Social Security Number

ACC-1215-6-018

Certificate Number

Mark K. Schlüger
Training Director

Certificate of Completion

Troy A. Ray

for successfully completing the prescribed course of study in

Pennsylvania Asbestos Building Inspector Refresher Course

under TSCA Title II

presented by

ACCESS TRAINING SERVICES, INC.
7921 River Road, Pennsauken, NJ 08110
(856) 665-3449

3/19/15
Course Date

N/A
Exam Date

3/19/16
Expiration Date

Not Provided
Social Security Number

ACC-0355-6-011
Certificate Number

Mark K. Schlager
Training Director

CERTIFICATE NO 374

G&C Environmental Services, Inc. (#294)
2 Street Road, Newtown Square, Pennsylvania 19073
Telephone: (610) 993-9202 Facsimile: (610) 993-9232
Email: Training@gcenviro.com
www.GCenviro.com

This document certifies that Ananth K. Vinjamuri has successfully completed this
State of New York Department of Health Approved AHERA BUILDING INSPECTOR

REFRESHER COURSE, completed as required for asbestos accreditation under the Toxic

Substances Control Act, Title II. This course was held from 09/29/2015 to 09/29/2015.
MM DD YR MM DD YR

The examination date was 09/29/2015. This certificate expires one year from the date of
MM DD YR MM DD YR
successful completion of the examination 09/29/2016.
MM DD YR

*The official record of successful training completion is the New York State Department of
Health certificate of asbestos safety training completion (DPH 2832).*

Gail M. Conner
Training Director

Gail M. Conner

CERTIFICATE NO 375

G&C Environmental Services, Inc. (#294)
2 Street Road, Newtown Square, Pennsylvania 19073
Telephone: (610) 993-9202 Facsimile: (610) 993-9232
Email: Training@gcenviro.com
www.GCenviro.com

This document certifies that Shelton Williams has successfully completed this
State of New York Department of Health Approved AHERA BUILDING INSPECTOR

REFRESHER COURSE, completed as required for asbestos accreditation under the Toxic

Substances Control Act, Title II. This course was held from 09/29/2015 to 09/29/2015.

The examination date was 09/29/2015. This certificate expires one year from the date of
successful completion of the examination 09/29/2016.

*The official record of successful training completion is the New York State Department of
Health certificate of asbestos safety training completion (DPH 2832).*

Gail M. Conner
Training Director

Gail M. Conner

Certificate of Completion

Paul M. Davis

for successfully completing the prescribed course of study in

Pennsylvania Asbestos Building Inspector Refresher Course

under TSCA Title II

presented by

ACCESS TRAINING SERVICES, INC.
7921 River Road, Pennsauken, NJ 08110
(856) 665-3449

2/12/15

Course Date

N/A

Exam Date

2/12/16

Expiration Date

Not Provided

Social Security Number

ACC-0215-6-015

Certificate Number

Mark K. Schlüger
Training Director

Certificate of Training

CRITERION LABORATORIES, INC.

HEREBY CERTIFIES THAT

Paul M. Davis

HAS SUCCESSFULLY COMPLETED A 4 HOUR COURSE ENTITLED

Asbestos Building Inspector Refresher

INCLUDING CLASSROOM INSTRUCTION

on this 2nd day of February 2016

Exam passed on this 2nd day of February 2016 - Score - 92

Approved for AHERA Accreditation Under TSCA Title II

3370 Progress Drive, Suite J
Bensalem, PA 19020
(215) 244-1300 - Phone
(215) 244-4349 - Fax
www.criterionlabs.com

Course is conducted in English

DIRECTOR:

James A. Welch

James A. Welch, CIH, President

Certificate of Completion

Bernard J. Bryson


for successfully completing the prescribed course of study in

Pennsylvania Asbestos Building Inspector Refresher Course

under TSCA Title II

presented by

ACCESS TRAINING SERVICES, INC.
7921 River Road, Pennsauken, NJ 08110
(856) 665-3449

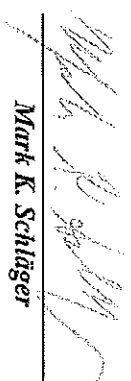2/16/15	N/A	2/16/16
<i>Course Date</i>	<i>Exam Date</i>	<i>Expiration Date</i>
Not Provided	ACC-0125-6-031	
<i>Social Security Number</i>	<i>Certificate Number</i>	Mark K. Schlager <i>Training Director</i>

Certificate of Completion

Bernard J. Bryson

for successfully completing the prescribed course of study in

Pennsylvania Asbestos Building Inspector Refresher Course

under TSCA Title II

presented by

ACCESS TRAINING SERVICES, INC.
7921 River Road, Pennsauken, NJ 08110
(856) 665-3449

2/15/16

Course Date

N/A

Exam Date

2/15/17

Expiration Date

Not Provided

Social Security Number

ACC-0216-6-005

Certificate Number

Mark K. Schlager
Training Director

EHS TRAINING INSTITUTE, INC.
A Division of BATTI, Inc.

Certificate of Completion

AHERA Building Inspector

(Refresher)

Awarded To:
Alexander Roman

SS#:XXX-XX-1743
Who has completed this 4-hour course and examination,
EPA Approved under TSCA Title II
AHERA / ASHARA Rule
40 CFR Part 763.

EHS TRAINING INSTITUTE, INC.
A Division of BATTI, Inc.
Delaware Industrial Park • 6 Garfield Way
Newark, DE 19713-5817
(302) 737-3376 • Fax (302) 737-5764

Course Date: **September 18, 2015**
Date of Expiration: **September 18, 201**
Certification Number : **EHSBIR 150619-008**


Todd K. Zeisloff, Instructor


Neeraj K. Batta, President

Certificate of Completion

Norman Harrison

for successfully completing the prescribed course of study in

Pennsylvania Asbestos Building Inspector Refresher Course

under TSCA Title II

presented by

**ACCESS TRAINING SERVICES, INC.
7921 River Road, Pennsauken, NJ 08109
(856) 665-3449**

9/2/15

Course Date

N/A

Exam Date

9/2/16


Expiration Date

Not Provided

Social Security Number

ACC-0915-6-011

Certificate Number

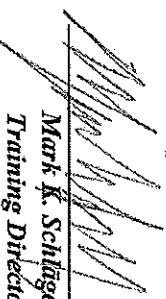
Mark K. Schlager
Training Director

EHS TRAINING INSTITUTE, INC.
A Division of BATTI, Inc.

Certificate of Completion

AHERA Building Inspector

(Refresher)

Awarded To:

Kelly Mayberry

SS#:XXX-XX-1551

Who has completed this 4-hour course and examination,

EPA Approved under TSCA Title II

AHERA / ASHARA Rule

40 CFR Part 763.

EHS TRAINING INSTITUTE, INC.

A Division of BATTI, Inc.

Delaware Industrial Park • 6 Garfield Way

Newark, DE 19713-5817

(302) 737-3376 • Fax (302) 737-5764

Course Date: February 20, 2015

Date of Expiration: February 20, 2016

Certification Number : EHSBIR 150220-005


Todd K. Zeislott, Instructor


Neeraj K. Batta, President

EHS TRAINING INSTITUTE, INC.

A Division of BATTI, Inc.

Certificate of Completion

AHERA Building Inspector

(Refresher)

Awarded To:

Kelly Mayberry

SS#:XXX-XX-1551

Who has completed this 4-hour course and examination,

EPA Approved under TSCA Title II

AHERA / ASHARA Rule

40 CFR Part 763.

EHS TRAINING INSTITUTE, INC.

A Division of BATTI, Inc.

Delaware Industrial Park • 6 Garfield Way

Newark, DE 19713-5817

(302) 737-3376 • Fax (302) 737-5764

Course Date: February 18, 2016

Date of Expiration: February 18, 2017

Certification Number : EHSBIR 160218-006

Todd K. Zeisloff, Instructor

Neeraj K. Batta, President

AEROSOL MONITORING & ANALYSIS, INC.

This is to certify that
ANDREW HINE

*has met the attendance requirements and successfully completed
the course entitled*

3-DAY EPA AHERA INSPECTOR

For Accreditation Under TSCA Title II

05/04/2015 to 05/06/2015

Course Date

05/06/2015

Exam Date

5/6/2016

Expiration Date

STEVE SIERACKI

Principal Instructor

Steve Sieracki

A105042015-3

Certification No.

E. Rush Barnett

Course Director

E. Rush Barnett

1331 Ashton Road

P.O.Box 646

Hanover, MD 21076

P: 410-684-3327

F: 410-684-3724

www.amatraining.com

Certificate of Completion

Maryellen Leotta

for successfully completing the prescribed course of study in

Pennsylvania Asbestos Building Inspector Refresher Course

under TSCA Title II

presented by

ACCESS TRAINING SERVICES, INC.
7921 River Road, Pennsauken, NJ 08110
(856) 665-3449

2/12/15

Course Date

N/A

Exam Date

2/12/16

Expiration Date

Not Provided

Social Security Number

ACC-0215-6-024

Certificate Number

Mark K. Schlager
Training Director

Section IV

Cross Reference Table

Asbestos Hazard Emergency Response Act (AHERA) Environmental Compliance Audit Cross Reference Table

In response to the AHERA Environmental Compliance Audit a Cross Reference Table has been prepared for inclusion into the Environmental Management Plan. The purpose of this Cross Reference Table is to link the following documents to the AHERA Management Plan.

Cross Reference Table	
3 Year Reinspection Report follows this Cross Reference Table documentation.	
Subject Matter	Location of Required Documents
Designated Person	Pages 1 - 3
Annual Notification	Pages 4 - 5
6 Month Periodic Surveillance Outline of Events	Page 6
3 Year Re-inspections Outline of Events	Page 7
Asbestos Management Program (operations and maintenance)	Pages 8 - 19
Asbestos Investigation Report (AIR)	Attachment 1 Letter Dated August 4, 2006
Training (included in the Asbestos Management Program)	<p>The original records are centralized at the School District's Environmental Library. Copies are maintained on staff and are required to be maintained in the latest Reinspection Report.</p> <p>2 hour awareness training records for all Building Engineers, Custodian Assistants and maintenance personnel</p> <p>40 hour worker/supervisor training records for the OEMS A-Team and various AST tradesmen.</p>
Response Actions (monthly mailings if applicable)	The original documents are on file at the School District's Environmental Library.
	Copies of the original are mailed to the Schools Main Office for retention with the Management Plan documentation. These documents are typically kept separate from the management plan in an update binder due to the potential volume of response action reports.

SCHOOL DISTRICT OF PHILADELPHIA

ASBESTOS DESIGNATED PERSON

Gerald F Junod
Office of Capital Programs
Environmental Management & Services
440 N Broad Street, 3rd Floor
Philadelphia, PA 19130
Telephone: 215 400 6738
Fax: 215 400 4751

Drexel University- Asbestos Building Inspector Course	January 9-11, 1989 24 Hours
Drexel University- Asbestos Management Planner Course	January 12-13, 1989 16 Hours
Criterion Laboratories, Inc. - Asbestos Management Planner Course	October 11-12, 2012 16 Hours

<u>Annual Building Inspector Refreshers</u> 4 Hours Drexel University Criterion Laboratories, Inc Access Training Services, Inc.	1990 to Present
---	------------------------

<u>Annual Building Management Planner Refreshers</u> 4 Hours Drexel University Criterion Laboratories, Inc 4 Hours	1990 to 1994 2013 to Present
---	---

Environmental Manager, School District of Philadelphia

Manages the design and implementation of asbestos and lead projects for the Capital Improvement Program and other District Departments including Facilities & Operations and Information Technology. Ensures that asbestos abatement and lead remediation projects are expertly designed and executed in accordance with industry best management practice standards and regulations.

Manager, City of Philadelphia Asbestos Control Program

Served as the Asbestos Control Program Manager for the City of Philadelphia, Department of Public Health, Air Management Services, Asbestos Control Unit from August 1, 2003 through October 23, 2006.

Mid Atlantic Regional Environmental Consortium (MAREC)

Former member with attendance and participation commitments of all quarterly EPA Region III and yearly National Asbestos Regulatory Conferences sponsored by the EPA and the National Conference of State Legislators respectively as a representative for the City of Philadelphia Department of Public Health Air Management Services from 1994 through 2006.

Philadelphia Environmental Task Force

Former member of the Philadelphia Environmental Task force as a representative and point of contact for the City of Philadelphia Department of Public Health Air Management Services Asbestos Control Unit from 2002 through 2006.

Asbestos Instructor

Worked as the primary instructor for the initial and annual Asbestos Project Inspector training and licensing program as mandated by City of Philadelphia Department of Public Health Asbestos Control Regulations from August 1994 through October 2006.

Worked as a lead instructor with an Environmental Consulting Firm and approved by the US EPA for the initial and annual refresher training courses for various asbestos occupational disciplines such as the Building Inspector, Management Planner and Worker/Supervisor from 1991 through 1994.

I certify that the general, local agency responsibilities as stipulated in Section 763.84 will be met.



Gerald F. Junod

Asbestos Designated Person

Environmental Manager

Office of Environmental Management and Services

SCHOOL DISTRICT OF PHILADELPHIA

Accreditation Information Statement

All persons who inspect for Asbestos Containing Building Materials (ACBM) and who will design or carry out response actions with respect to assumed and confirmed ACBM, will be accredited by an EPA approved course and/or a State Contractors Accreditation Program under Sections 206 (c) and 206 (b) of Title II of the ACT.



**Gerald F. Junod
Asbestos Designated Person
Environmental Manager
Office of Environmental Management and Services**

SCHOOL DISTRICT OF PHILADELPHIA
OFFICE OF CAPITAL PROGRAMS
440 NORTH BROAD STREET, SUITE 373
PHILADELPHIA, PENNSYLVANIA 19130

OFFICE OF ENVIRONMENTAL MANAGEMENT AND SERVICES

PHONE (215)-400-4750

September 2015

TO: Principals
Building Administrators/Occupants
Parents/Guardians

FROM: Fran Burns
Chief Operating Officer

Francine Locke, M.S., Director
Office of Environmental Management and Services

SUBJECT: Annual EPA Notification Letter


Pursuant to the Federal Environmental Protection Agency (EPA) mandate, as required by 40 C.F.R. 763.84 (c)(d) of public access to environmental records, this letter is to acknowledge the availability of your facility's Asbestos Hazard Emergency Response Act (AHERA) Management Plan.

Each member of the school staff, parents/guardians, temporary workers and/or contractors, are required to receive a copy of the Notification Letter. At the direction of the Principal, a copy is to be posted on the bulletin boards and an appropriate amount of copies are to be generated for distribution.


Note: The AHERA Three-Year Reinspection reports, in colored binders; White with Pink, Tan, Black, Red, Dark Blue, Green, Yellow and White, are Federal EPA mandated inspection documents. The School District of Philadelphia is subject to severe monetary penalties if the reports and associated paperwork are not available to the EPA and the public upon request.

It is incumbent on designated school personnel to gather and retain this data as it is delivered, in one location for future review. Acceptable locations include the Principal's Office or Main Office for the primary data. The Building Engineer should maintain any secondary or duplicate copies.

If you have any questions, please call 215-400-4750. Thank you for your cooperation.



Fran Burns
Chief Operating Officer

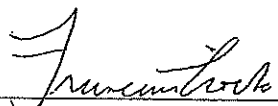

Francine Locke, M.S., Director
Office of Environmental Management
and Services

c: Danielle Floyd

AHERA-4
8/21/15



School District of Philadelphia
OFFICIAL NOTICE

PLEASE POST

September 2015

TO: Principals
Building Administrators
Building Engineers
Building Occupants
Parents/Guardians

FROM: Fran Burns
Chief Operating Officer

Francine Locke, M.S., Director
Office of Environmental Management and Services

SUBJECT: Annual Notification Letter: Asbestos Hazard Emergency Response Act

The Federal Register published on October 30, 1987, Subpart E, in Schools: Final Rule and Notice, 763.84 (c)(d) states that each local education agency shall ensure that workers and building occupants or guardians are to be informed at least once each school year about inspections, response actions and post-response action activities including re-inspections and periodic surveillance activities. The School District as the Local Education Agency (LEA), retains such reports that are available for public inspection in the Office of the Principal or Building Administrator.

The Principal or Building Administrator is required to do the following with this notification:

- 1) Post in a Public Place or Main Office
- 2) Inform Building Occupants
- 3) Send a copy of this notification to Parents or Guardians
- 4) Insert a copy into the latest AHERA Three-Year Reinspection report (white/pink binder) in your office or facility.

A handwritten signature of Fran Burns in black ink.

Fran Burns
Chief Operating Officer

A handwritten signature of Francine Locke in black ink.

Francine Locke, M.S., Director
Office of Environmental Management
and Services

c: Danielle Floyd

AHERA-4a
8/21/15

SCHOOL DISTRICT OF PHILADELPHIA
Education Center
440 North Broad Street
Philadelphia, Pennsylvania 19130

Office of Environmental Management and Services

215-400-4750

AHERA
Six Month Surveillance
Outline of Events

- Pursuant to the Federal Environmental Protection Agency (EPA) mandate, as required by 40 CFR 763.92(b), the following procedure is to be implemented. At least once every six (6) months after a Management Plan is in effect, each Local Education Agency (LEA) shall conduct a periodic surveillance in each building that it owns or leases that contains Asbestos Containing Building Materials (ACBM) or is assumed to contain ACBM.
- The first Bi-Annual Inspection starts in the Spring (March, April, May) and again in the Fall (October, November, December) of each year. The Building Engineer/Assistant should assist the Building Inspector with appropriate access to all areas including (Crawlspace/Attics) and rooms in the facility. There is no action required of the Principal.
- The Building Inspector shall visually inspect all areas that are identified in the Management Plan as ACBM or assumed ACBM. The date of the surveillance is recorded, the inspectors name and any changes in the conditions of the materials.
- The Building Inspector shall make a copy of the inspection document and insert into the front of the latest Management Plan (AHERA Three Year Reinspection report). The original document is returned to the LEA's Environmental Library and filed.

SCHOOL DISTRICT OF PHILADELPHIA
Education Center
440 North Broad Street
Philadelphia, Pennsylvania 19130

Office of Environmental Management and Services

215-400-4750

AHERA
Three Year Reinspection
Outline of Events

- Pursuant to the Federal Environmental Protection Agency (EPA) mandate, as required by 40 CFR 763.85(b) the following procedure is to be implemented. At least once every three (3) years after a Management Plan is in effect, each Local Education Agency (LEA) shall conduct a reinspection of each building that it owns or leases that contains Asbestos Containing Building Material's (ACBM's) or is assumed to contain ACBM.
- Subsequent Three Year Re-inspections (2009, 2012, 2015, etc) shall start in the Fall (October, November, December, January). The Building Engineer/Assistant should assist the Building Inspector with appropriate access to all areas including (Crawlspaces/Attics) and rooms in the facility. There is no action required of the Principal.
- An accredited Building Inspector shall visually inspect and touch to determine friability, all areas that are identified in the Management Plan as ACBM or assumed ACBM. The date of the surveillance is recorded, the inspectors name and any changes in the conditions of the materials. The Building Inspectors state of accreditation and license number is required.
- After the inspection, the Building Inspector shall make a copy of the inspection documents and insert into the front of the latest Management Plan (AHERA Three Year Reinspection report). The original document is returned to the LEA's Environmental Library and filed.
- The Building Inspector shall return the reinspection data to the Management Planner to be assessed and determine appropriate response actions and a report issued (AHERA Three Year Reinspection report). One copy of the report is delivered to the schools Principal to be permanently retained with all previous environmental data. Another copy is retained in the LEA's Environmental Library.



School District of Philadelphia
Office of Environmental Management & Services
440 North Broad Street
Philadelphia, PA 19130
(215) 400-4750

**School District of Philadelphia
Asbestos Management Program**

TABLE OF CONTENTS

Definitions.....	Page 9
1. Introduction.....	Page 10
2. Summary of Asbestos Management Plan	
3. Asbestos Management Plan Execution.....	Page 11
a. General Execution	
4. Summary of Program Execution	
a. Asbestos Management Plan Execution	
5. Responsibilities	
a. OEMS	
b. Asbestos Worker/Supervisor “A-TEAM”.....	Page 12
c. Asbestos Designated Person	
d. Supervisor or Project Manager (Capital, Maintenance & Facilities)	
e. Employee Capital.....	Page 13
f. Employee Maintenance	
g. Employee Facilities and Custodial	
6. Requirements.....	Page 14
a. Employee Exposure Monitoring	
b. Employee Notification	
c. Observation of Monitoring	
d. Training Program	
e. Access of Information	
f. Record Keeping	
7. AHERA O&M Plan.....	Page 15
a. Controls	
8. O&M Response Actions.....	Page 16
a. Facility Maintenance Isolation of Area	
b. Unlikely Contact with ACM/PACM	
c. Accidental Disturbance of ACM/PACM	
d. Planned Disturbance of ACM/PACM	
e. Miscellaneous ACM/PACM.....	Page 17
f. Vinyl Asbestos Floor Tile	
g. Mastic/Adhesives	
h. Woven Vibration Dampers	
i. Other Work Practices	
j. Fiber Release Episodes	
9. References and Resources.....	Page 18

DEFINITIONS / ACRONYMS

ACM/PACM:	Asbestos Containing Material/Potential Asbestos Containing Material
AHERA:	Asbestos Hazard Emergency Response Act
AIR FORM:	Asbestos Inspection Report Form
Amended Water:	Water to which a surfactant (soap) has been added
AMP:	Asbestos Management Program/Asbestos Management Plan
Asbestos Designate Person:	Individual assigned by the district to oversee asbestos related issues.
Asbestos Regulated Area:	Location that is posted as an asbestos work area in which only approved and accredited personnel are permitted to enter
AST:	Asbestos Support Team involving approved and accredited school district tradespersons personnel that are school district person
A-TEAM:	School District of Philadelphia asbestos workers
CIP:	Capital Improvement Program
Consultant:	Asbestos consulting firm hired by the District
Demolition Directive:	Memorandum – August 4, 2006 from Patrick Henwood
EPA:	Environmental Protection Agency
In House Personnel:	School District of Philadelphia asbestos workers
LEA:	Local Education Agency
O&M:	Operations and Maintenance
OEMS:	Office of Environmental Management and Services
OSHA:	Occupational Safety and Health Administration
PEL:	Permissible Exposure Limit
PSD or SDP:	Philadelphia School District/School District of Philadelphia
PSIT:	Philadelphia School Improvement Team
STEL:	Short Term Exposure Limit

1. Introduction

The School District of Philadelphia, Asbestos Policy Statement:

“The School District of Philadelphia is dedicated to providing a safe and healthful work environment for its employees, students, faculty, contractors and visitors. In recognition of the potential health problems associated with asbestos, the School District of Philadelphia is committed to a comprehensive asbestos control program. This program is implemented and maintained through the School District of Philadelphia's Office of Environmental Management and Services (OEMS).”

OEMS has the responsibility of establishing procedures for asbestos abatement, asbestos inspection, air monitoring, renovation and demolition activities within all School District of Philadelphia owned or leased facilities.

These procedures are developed to ensure that:

- (1) People are not exposed to significant levels of asbestos fibers
- (2) Asbestos waste is handled and disposed of properly
- (3) Members of the School District of Philadelphia community have access to the Office of Environmental Management and Services for information, assistance, guidance, and interpretation regarding asbestos related matters.
- (4) Members of the School District of Philadelphia community have access to the Asbestos Management Plans as required and outlined in the US EPA AHERA regulations including annual written notification to all parents.
- (5) Compliance with all applicable Federal, State and Local Asbestos Regulations

Requirements outlined in this manual are mandatory in nature where the word “SHALL” is used and are advisory in nature where the word “SHOULD” is used.

2. Summary of Asbestos Management Program

The School District of Philadelphia's Asbestos Management Program was established to meet the requirements of Federal, State, and Local Regulations.

These regulations include, but are not limited to:

- US Environmental Protection Agency Asbestos Hazard Emergency Response Act (US EPA AHERA) and National Emissions Standard for Hazardous Air Pollutants subpart M, Part 61 (NESHAP);
- US Department of Labor, Occupational Safety and Health Administration (OSHA) General Industry Standard (29 CFR 1910.1001) and the OSHA Asbestos Standard for the Construction Industry (29 CFR 1926.1101);
- The Commonwealth of Pennsylvania, Department of Labor and Industry, Asbestos Occupations, Accreditation and Certification Act;
- The City of Philadelphia, Department of Public Health, Asbestos Control Regulations.

3. Asbestos Management Program Execution

a) General Execution

The Office of Environmental Management and Services (OEMS) develops, implements and manages safety and health programs for the School District of Philadelphia faculty, staff and students and assists with ensuring that all contractors comply with Federal, State and Local Environmental Regulations. The OEMS provides the oversight of School District of Philadelphia employees (Asbestos A-Team), environmental consultants, and asbestos abatement contractors for all projects within the School District of Philadelphia concerning Asbestos Containing Materials.

The control of safety and health hazards at the School District of Philadelphia is primarily through the implementation of engineering, work practice and administrative controls. Personal Protective Equipment (PPE) is used to supplement these controls or whenever the controls are not feasible or are in the process of being implemented. PPE is also recommended whenever exposures to chemical, physical or biological agents can be prevented or reduced by its use.

This written program establishes the procedures necessary to:

- 1) meet established standards and federal regulations for occupational exposure to asbestos fibers;
- 2) meet the requirements of the City of Philadelphia Asbestos Control Regulations which encompasses the disturbance and/or abatement of asbestos containing building materials;
- 3) provide the necessary health and safety protection to the School District of Philadelphia staff, faculty, students, contractors and visitors.

This program is strengthened by input and cooperation with the Philadelphia Federation of Teachers (PFT), Health and Welfare Fund.

4. Summary of Program Execution

a) Asbestos Management Program Execution

The Asbestos Management Program is administered by the Office of Environmental Management and Services (OEMS). OEMS provides the following services primarily through professional consultants:

- (1) exposure monitoring services;
- (2) building inspection/surveys (bulk sampling) for the identification of asbestos containing materials;
- (3) asbestos project design services;
- (4) asbestos abatement project and air monitoring services;
- (5) emergency response to fiber release episodes;
- (6) education/information;
- (7) medical monitoring;
- (8) training for School District of Philadelphia personnel

5. Responsibilities

a) Office of Environmental Management and Services

OEMS is responsible for performing the following functions:

- (1) Developing and administering of the Asbestos Management Program.
- (2) Providing asbestos-related services to all School District of Philadelphia departments.
- (3) Conducting required training of the Asbestos Management Program and working jointly with departments to schedule training.
- (4) Identifying and posting areas where labeling/signage are required.
- (5) Medical Monitoring of OEMS "A-TEAM" and other departments "AST" Asbestos Program staff.

- (6) Certification and training as required for OEMS "A-TEAM" and other departments "AST" Asbestos program staff.
- (7) Record keeping as outlined in Section 3.5 and all records as by required by US EPA AHERA regulations.

b) Asbestos Worker/Supervisor - "A-TEAM"

- (1) OEMS shall ensure that all "A-TEAM" workers/supervisors adhere to the following requirements:
 - a) Attend an initial Worker/Supervisor Asbestos Course;
 - b) Maintain the annual re-certification per EPA AHERA requirements and Commonwealth of Pennsylvania Asbestos Occupations, Accreditation and Certifications Act;
 - c) Undergo an annual Asbestos Medical Evaluation;
 - d) Undergo an annual Respirator Medical Clearance;
 - e) Undergo an annual Respirator Fit Testing.

c) Asbestos Designated Person

The Asbestos Designated Person is responsible for:

- (1) Assuring the health and safety of employees, students and visitors in the School District of Philadelphia facilities under his/her control.
- (2) Being kept informed of all areas under his or her jurisdiction where potential asbestos exposures exist and initiating protection programs that adhere to the Asbestos Management Program requirements of this manual.
- (3) Assuring that Asbestos Management Program requirements are adhered to by principal investigators, project managers, supervisors, or division heads, and School District of Philadelphia personnel under their supervision.
- (4) Ensuring that all employees within the Asbestos Management Program comply with (OSHA 1910.1001 (j) (7) (iv)) and the US EPA AHERA regulations by attending the required training.
- (5) Ensure the posting of:
 - a) Warning labels/signage
 - b) Commonwealth of Pennsylvania Asbestos Abatement and Demolition/Renovation Notification form
 - c) Asbestos Inspection Reports (AIR) form (where required)
 - d) Ensuring that Construction Projects follow the Demolition Directive procedures as outlined in the August 4, 2006 letter.

d) Supervisor or Project Manager (Capital, Maintenance and Facilities)

Each person in charge of a project, maintenance/repair, renovation/demolition, or other activity from the Departments of Capital, Maintenance, and/or Facilities, where asbestos containing material may be present is responsible for:

Identifying, with the assistance of OEMS, asbestos containing building materials prior to any disturbance of these materials. Various Federal (EPA and OSHA) and Local (City of Philadelphia Asbestos Control Regulations) require Asbestos Inspections prior to renovation/demolition activities. This shall be accomplished by always following the Asbestos Management Program Procedures as follows:

- (1) Ensure that the requirements of the Asbestos Management Program Procedures are followed by all personnel, trades, and contractors who are involved with the project;

- (2) Review of the required Asbestos Inspection Report (AIR) form (Attachment 1) and AHERA Management Plan documents prior to activities that may disturb any Asbestos Containing Materials;
- (3) Perform all project related duties as outlined in the Project Management Responsibilities;
- (4) Keep the department chairperson or director informed on any actions proposed or taken regarding the Asbestos Management Plan;
- (5) Ensuring that Construction Projects follow the Demolition Directive procedure outlined in the August 4, 2006 letter.

e) Employee – Capital

School District of Philadelphia Capital employees and/or consultants shall:

- (1) Ensure that no suspect or asbestos containing building materials are disturbed in the course of the projects they are performing or managing. This shall be accomplished by notifying their supervisor and OEMS by issuance of a work order permit (a.k.a PSIT Service Request Form) and verifying that the materials which may be disturbed are non-asbestos containing. If this information is not available or verification has not been made, these materials should not be disturbed.
- (2) Immediately notify OEMS and their supervisor in the event of a potential fiber release episode upon discovery of visible damage to asbestos containing materials.
- (3) Ensuring that Construction Projects follow the Demolition Directive procedures as outlined in the August 4, 2006 letter.

The types of projects represented as part of the Capital Improvement Program are as follows:

- (1) Complete Renovation of an existing building that addresses all facility component concerns and educational program needs;
- (2) Major Renovation of an existing building addressing significant facility component and educational improvements;
- (3) Addition to an existing building (either as an attachment or stand-alone structure) to accommodate needed program space;
- (4) Conversion of an existing facility to accommodate a change in educational program;
- (5) Facility Component Improvement of specific facility needs (i.e. electrical or HVAC system upgrades, ADA improvements, life safety improvements, exterior renovations, etc.)

f) Employee – Maintenance

School District of Philadelphia Maintenance employees shall:

- (1) Ensure that no suspect or asbestos containing building materials are disturbed in the course of their duties or work they are performing. This shall be accomplished by notifying their supervisor and OEMS by issuance of a work order permit and verifying that the materials which may be disturbed are non-asbestos containing. If this information is not available or verification has not been made, these materials should not be disturbed.
- (2) Immediately notify OEMS and their supervisor in the event of a potential fiber release episode or upon discovery of visible damage to asbestos containing materials.
- (3) All employees involved in maintenance activities shall attend required Asbestos Awareness training program within 60 days of employment.

g) Employee – Facilities & Custodial

School District of Philadelphia Facilities and Custodial employees shall:

- (1) Ensure that no suspect or asbestos containing building materials are disturbed in the course of their duties or work they are performing. This shall be accomplished by notifying their supervisor and OEMS by issuance of a work permit and verifying that the materials which may be disturbed are non-asbestos containing. If this information is not available or verification has not been made, these materials should not be disturbed;
- (2) Immediately notify OEMS and their supervisor in the event of a potential fiber release episode or upon discovery of visible damage to asbestos containing materials.
- (3) All employees involved in Facilities and Custodial activities shall attend require Asbestos Awareness training program within 60 days of employment.

6. Requirements

a) Employee Exposure Monitoring

When information indicates that an employee's exposure to asbestos fibers may equal or exceed an 8-hour time-weighted average of 0.1 f/cc * (per OSHA 1910.1001 & 1926.1101), OEMS shall develop and implement an asbestos exposure monitoring program. The sampling strategy shall be designed to identify employees by work task (job classification) that is exposed to asbestos fibers that exceed an 8-hour time-weighted average of 0.1 f/cc.

b) Employee Notification

OEMS shall notify in writing, each employee exposed to asbestos fibers at or above an 8-hour time weighted average of 0.1 f/cc.

c) Observation and Monitoring

OEMS shall provide employees or their representatives with an opportunity to observe any exposure measurements conducted.

d) Training Program

OEMS shall institute a training program which meets the requirements of AHERA for all employees who perform maintenance operations in a facility/school which contains asbestos containing materials or presumed asbestos containing materials and 1910.1001 (j), and the Commonwealth of Pennsylvania Department of Labor and Industry and the City of Philadelphia Asbestos Control Regulations. The affected departments shall ensure employee participation in this program. The OEMS "A-TEAM" and other departments "AST" Asbestos Program staff training shall be conducted annually for each employee as required by all Federal, State and Local for each asbestos discipline.

All Asbestos Awareness training as required by AHERA shall be performed within 60 days of employment and shall include:

- Health effects of asbestos
- Locations of ACM and PACM in the building/facility
- Recognition of CM and PACM damage and deterioration
- Requirements of the OSHA 1910.1001 standard relating to maintenance
- Proper response to fiber release episodes
- Procedure to be followed to isolate areas affected by fiber release

e) Access to Information

OEMS shall make available to affected employees or their representative's copies of the Occupational Safety and Health Administration (OSHA) General Industry Standard Part 1910.1001 and the department shall post a copy in the workplace.

f) Record Keeping

OEMS shall maintain an accurate record of all employee exposure measurements. OEMS and/or the School District of Philadelphia Human Resources Department shall maintain records of employee medical monitoring program. OEMS shall maintain all employee training records. All records shall be provided upon request to employees, former employees, representatives designated by the individual employee.

7. AHERA OPERATIONS AND MAINTENANCE PLAN

a) CONTROLS

i. Work Order System

Minimizing disruption of ACM/PACM during maintenance and renovation activities is the primary goal and task encountered by OEMS. Operations and maintenance employees and contractors should be warned to avoid conducting any maintenance work which may disturb ACM/PACM. Initiating a work order system, where all work orders or requests are channeled through the Office of Environmental Management and Services (OEMS), will be the method used to control and minimize disruption of ACM/PACM.

Any work performed by in-house personnel or contractors that could or will impact ACM/PACM shall be coordinated by OEMS. A completed Asbestos Inspection Report Form (Attachment 1) shall be issued to in-house personnel and/or all contractors whose work could impact ACM/PACM. This form should accompany each contract issued to an outside contractor and posted on the jobsite.

All work order requests for maintenance and renovation activities in areas where ACM/PACM is suspected or known to be present are to be submitted to OEMS prior to proceeding with work. OEMS is responsible for reviewing asbestos survey records for information about the presence of ACM/PACM in the area where the work is to be performed. OEMS should physically inspect the area to ensure existing records reflect actual conditions. If no asbestos is present, a work order is not necessary and the planned actions can proceed. If ACM/PACM is found to be present in the area, OEMS will sign the work order application and obtain an approved and accredited asbestos contractor or assign OEMS "A-TEAM" to abate the ACM/PACM.

ii. Regulated Areas

The owner will identify and regulate all areas where airborne concentrations of ACM/PACM exceed the Permissible Exposure Limit (PEL)* (Per OSHA determined to be 0.1 f/cc) and/or short term exposure limit (STEL) (Per OSHA determined to be 0.1 f/cc), or there is reasonable possibility that the (PEL) and/or (STEL) may be exceeded. All ACM/PACM removal activities involving thermal system insulation ACM/PACM (Class I), surfacing ACM/PACM (Class I), and miscellaneous ACM/PACM such as floor tile, roofing, and siding mastic, etc. (Class II), and repair and maintenance operations where thermal system insulation and surfacing ACM/PACM is likely to be disturbed (Class III) will be performed in accordance with federal, state, and local regulations. All asbestos abatement work and activities will be designed and managed as asbestos regulated areas. These areas will be demarcated and labeled.

iii. Warning Signs

Warning signs shall be displayed at all approaches to each asbestos regulated area. The asbestos abatement contractor will provide OSHA warning signs in all regulated areas during removal, repair, and other maintenance activities. OEMS will provide AIRs to all contractors who must inform all employees and supervisors working in locations contiguous to asbestos regulated areas of the potential hazards and work practices required.

iv. Warning Labels

Warning labels and/or signage shall be affixed to all raw materials, mixtures, scrap, waste, debris, and other products containing asbestos fibers, or to their containers. Generally, the asbestos abatement contractor or OEMS A-Team personnel will provide all warning labels for ACM/PACM containment.

8. O & M RESPONSE ACTIONS

The Asbestos Management Program general O&M procedures are outlined in this section. Additional requirements specific to asbestos abatement activities are included in the Project Design documents for all Asbestos Abatement Work. Regular cleaning, inspection, and reporting of ACM/PACM deterioration or other problems must be diligently practiced by all employees including custodial and maintenance personnel.

a) Facility Maintenance Isolation of Area Responsibilities

Maintenance personnel are often required to work in areas where ACM/PACM may potentially be disturbed. Most maintenance activities are conducted by in-house staff, outside contractors, or a combination.

Emergency fiber release episodes, such as pipe fitting or valve breaks, emergency boiler work, or mechanical equipment repair will be responded to by OEMS A-Team personnel or asbestos abatement contractor personnel. The owner's maintenance staff will: (1) isolate the emergency fiber release area; (2) post warning signs to prevent unauthorized access, and (3) notify their supervisor and OEMS. OEMS will ensure that the fiber release area remains isolated and is properly cleaned by and approved and accredited abatement contractor or by OEMS A-TEAM personnel.

b) Unlikely Contact with ACM/PACM

Maintenance activities or repairs which can be performed without contacting or disturbing the ACM/PACM require little more than normal care and good workmanship. For example, valves which are either uncovered or covered with non-asbestos insulation can be packed or repaired without disturbing asbestos insulation on nearby pipes. The major precaution is to ensure that maintenance and custodial personnel are familiar with procedures such as isolating the area, posting warning signs, and notifying OEMS in the event of any accidental ACM/PACM disturbance.

c) Accidental Disturbance of ACM/PACM

Maintenance and facilities personnel shall notify OEMS any time a fiber release is suspected. If friable ACM/PACM becomes airborne in the building,

d) Planned Disturbance of ACM/PACM

Maintenance activities that may impact ACM/PACM include access to a valve, flange, duct, or related system component.

Where asbestos-containing insulation must be removed to maintain or repair the thermal system, the ACM/PACM will imminently be disturbed. ACM/PACM removal work shall be conducted by OEMS A-Team personnel or an approved and accredited asbestos abatement contractor.

If friable ACM/PACM becomes airborne in the building, maintenance and facilities personnel shall secure the area and contact OEMS. OEMS shall respond accordingly.

e) Miscellaneous ACM/PACM

Miscellaneous types of ACM/PACM may include vinyl asbestos floor tiles, mastics/adhesives and woven vibration dampers. Disturbance of these materials should be avoided. Routine maintenance activities involving these materials should not pose a problem if handled properly. Questions on the proper removal and disposal of miscellaneous ACM/PACM should be directed to OEMS. OEMS will contact an approved and accredited asbestos abatement contractor or utilize OEMS A-TEAM personnel to assist with miscellaneous ACM/PACM clean-up activities.

f) Vinyl Asbestos Floor Tile

Asbestos-containing floor tiles in good condition are considered non-friable unless they are crushed, drilled, sawed, sanded or disturbed by any activity that breaks up the material. Routine maintenance of these materials should employ the use of non-abrasive buffers and wet cleaning technique. Broken or loose floor tiles should be removed and disposed of as asbestos waste by OEMS. Remaining debris should be vacuumed with a HEPA vacuum and the area wet mopped using amended water.

g) Mastics/Adhesives

Mastics and adhesives containing asbestos in good condition are considered non-friable and do not pose a potential health concern unless crushed, drilled, sawed, sanded, or otherwise abraded. Questions on the proper removal should be directed to OEMS.

h) Woven Vibration Dampers

Woven vibration dampers in good condition are considered non-friable and do not pose a potential health concern unless cut, crushed, drilled, sawed, sanded, or otherwise abraded. Questions on the proper removal should be directed to OEMS.

i) Other Work Practices

Any special work not included in this section should be addressed to OEMS for review prior to the initiation of work that may involve the disturbance of ACM/PACM.

j) Fiber Release Episodes

Facilities and maintenance staff should report to OEMS the presence of asbestos debris, water or physical damage to ACM/PACM, or any other evidence of possible fiber release. OEMS should have the OEMS A-Team personnel or an approved and accredited abatement contractor respond to the site to clean up debris and make repairs as soon as possible. OEMS will also contact a consultant to conduct air monitoring and prepare a report and submit at project completion to OEMS for each episode. OEMS will forward the reports for each site location AHERA Management Plan accordingly.

9. REFERENCES and RESOURCES

Applicable regulations for asbestos projects impacted by renovation, demolition, and maintenance activities.

- **Philadelphia Air Management Services – Asbestos Control Unit**
<http://www.phila.gov/health/units/ams/Asbestos/asbestos.html>
- **Pennsylvania Asbestos Occupations, Accreditation and Certification Act**
<http://www.dli.state.pa.us/landi/cwp/view.asp?a=185&q=56262&landiNav=>
- **United States Environmental Protection Agency Asbestos Home Page**
<http://www.epa.gov/asbestos/>
- **Occupational Safety and Health Administration (OSHA) Asbestos Home**
<http://www.osha.gov/SLTC/asbestos>