

		Dates: 11/21/2022-12/21/2023	Lead-Safe Certification Assessment Report						
		Michael A Martin Certification #006416	Theodore Roosevelt Elementary School						
		Inspection Company: Criterion Labs	430 Washington Ln, Philadelphia, PA 19144						
E l e m e n t	F l o o r	On-Site Room Name	Component	Substrate Material	Paint Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
1	3	Classroom 303	W1	Plaster	Blue	Cracking	5	26.2	Positive
1	3	Classroom 303	W2	Plaster	Tan	Flaking	1	34.1	Positive
1	3	Classroom 303	W3	Plaster	Tan	Flaking	1	11.7	Positive
1	3	Classroom 303	W4	N/A	N/A	N/A	N/A	N/A	N/A
1	3	Classroom 303	Ceiling	Plaster	Tan	Cracking	32	31.3	Positive
1	3	Stairwell across from Classroom 303	Floor	Concrete	Blue	N/A	N/A	0	Negative
1	3	Stairwell across from Classroom 303	W1	Metal	Brown	None	0	15.3	Positive
1	3	Stairwell across from Classroom 303	W2	Plaster	Tan	None	0	11.1	Positive
1	3	Stairwell across from Classroom 303	W3	Plaster	Tan	None	0	9.1	Positive
1	3	Stairwell across from Classroom 303	W4	Plaster	Tan	N/A	N/A	0	Negative
1	3	Stairwell across from Classroom 303	Ceiling	Plaster	Tan	None	0	17.4	Positive
1	3	Custodial Closet across from Classroom 303	Floor	Concrete	Grey	N/A	N/A	0.04	Negative
1	3	Custodial Closet across from Classroom 303	W1	Plaster	Tan	Chipping	2	18	Positive
1	3	Custodial Closet across from Classroom 303	W2	Plaster	Tan	Chipping	2	17.9	Positive
1	3	Custodial Closet across from Classroom 303	W3	Plaster	Tan	Cracking	7	14.3	Positive
1	3	Custodial Closet across from Classroom 303	W4	Plaster	Tan	Chipping	5	12.3	Positive
1	3	Custodial Closet across from Classroom 303	Ceiling	Plaster	Tan	Chipping	5	No access	No Access
1	3	Custodial Closet across from Classroom 303 Pipe Chase	Floor	No Access	No Access	No Access	No Access	No Access	No Access
1	3	Custodial Closet across from Classroom 303 Pipe Chase	W1	N/A	N/A	N/A	N/A	N/A	N/A
1	3	Custodial Closet across from Classroom 303 Pipe Chase	W2	N/A	N/A	N/A	N/A	N/A	N/A
1	3	Custodial Closet across from Classroom 303 Pipe Chase	W3	N/A	N/A	N/A	N/A	N/A	N/A
1	3	Custodial Closet across from Classroom 303 Pipe Chase	W4	N/A	N/A	N/A	N/A	N/A	N/A
1	3	Custodial Closet across from Classroom 303 Pipe Chase	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
1	3	Boy's Restroom across from Classroom 303	Floor	Concrete	Grey	None	0	0.04	Negative
1	3	Boy's Restroom across from Classroom 303	W1	Brick	Tan	None	N/A	0	Negative
1	3	Boy's Restroom across from Classroom 303	W2	CMU	Tan	None	N/A	0	Negative
1	3	Boy's Restroom across from Classroom 303	W3	Brick	Tan	None	N/A	0	Negative
1	3	Boy's Restroom across from Classroom 303	W4	CMU	Tan	None	N/A	0	Negative
1	3	Boy's Restroom across from Classroom 303	Ceiling	Plaster	Tan	Cracking	2	18	Positive
1	3	Storage Room 300A	Floor	N/A	N/A	N/A	N/A	N/A	N/A
1	3	Storage Room 300A	W1	Brick	Tan	N/A	N/A	0.07	Negative

		Dates: 11/21/2022-12/21/2023	Lead-Safe Certification Assessment Report						
		Michael A Martin Certification #006416	Theodore Roosevelt Elementary School						
		Inspection Company: Criterion Labs	430 Washington Ln, Philadelphia, PA 19144						
E l e m e n t	F l o o r	On-Site Room Name	Component	Substrate Material	Paint Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
1	3	Storage Room 300A	W2	Sheetrock	Tan	N/A	N/A	0	Negative
1	3	Storage Room 300A	W3	Brick	Tan	N/A	N/A	0.09	Negative
1	3	Storage Room 300A	W4	Brick	Tan	N/A	N/A	0.06	Negative
1	3	Storage Room 300A	Ceiling	Plaster	Tan	Cracking	30	29.5	Positive
1	3	Storage Room 300B	Floor	N/A	N/A	N/A	N/A	N/A	N/A
1	3	Storage Room 300B	W1	Brick	Tan	N/A	N/A	0.05	Negative
1	3	Storage Room 300B	W2	Sheetrock	Tan	N/A	N/A	0	Negative
1	3	Storage Room 300B	W3	Brick	Tan	N/A	N/A	0.13	Negative
1	3	Storage Room 300B	W4	Sheetrock	Tan	N/A	N/A	0	Negative
1	3	Storage Room 300B	Ceiling	Plaster	Tan	Cracking	60	33.8	Positive
1	3	Room next to Stairwell across from Classroom 305	Floor	N/A	N/A	N/A	N/A	N/A	N/A
1	3	Room next to Stairwell across from Classroom 305	W1	Brick	Tan	N/A	N/A	0.04	Negative
1	3	Room next to Stairwell across from Classroom 305	W2	Brick	Tan	N/A	N/A	0.07	Negative
1	3	Room next to Stairwell across from Classroom 305	W3	Brick	Tan	N/A	N/A	0.04	Negative
1	3	Room next to Stairwell across from Classroom 305	W4	Sheetrock	Tan	N/A	N/A	0	Negative
1	3	Room next to Stairwell across from Classroom 305	Ceiling	Plaster	Tan	Cracking	30	32.4	Positive
1	3	Classroom 304	Floor	Wood	Brown	N/A	0	0	Negative
1	3	Classroom 304	W1	Plaster	Tan	None	0	29	Positive
1	3	Classroom 304	W2	Wood	Brown	N/A	0	0	Negative
1	3	Classroom 304	W3	Plaster	Tan	None	0	27.9	Positive
1	3	Classroom 304	W4	Wood	Brown	N/A	0	0	Negative
1	3	Classroom 304	Ceiling	Plaster	Tan	Chipping	15	36.6	Positive
1	3	Classroom 305	Floor	Wood	Brown	N/A	0	0	Negative
1	3	Classroom 305	W1	Plaster	Blue	Chipping	1	25.6	Positive
1	3	Classroom 305	W2	Wood	Brown	N/A	N/A	N/A	N/A
1	3	Classroom 305	W3	Plaster	Tan	Chipping	1	24.9	Positive
1	3	Classroom 305	W4	Plaster	Tan	None	0	11.9	Positive
1	3	Classroom 305	Ceiling	Plaster	Tan	Alligating	10	30.3	Positive
1	3	Classroom 305	door	Wood	Brown	None	N/A	0	Negative
1	3	Classroom 305	radiator	Metal	Gray	None	N/A	0.09	Negative
1	3	Classroom 305	riser	Metal	Tan	None	0	6.6	Positive
1	3	Classroom 305	baseboard	Wood	Brown	None	N/A	0.1	Negative
1	3	Stairwell across from Classroom 305	Floor	Concrete	Blue	None	0	2.1	Positive
1	3	Stairwell across from Classroom 305	W1	Metal	Brown	None	0	10.6	Positive
1	3	Stairwell across from Classroom 305	W2	Plaster	Tan	None	0	0.04	Negative
1	3	Stairwell across from Classroom 305	W3	Plaster	Tan	None	0	16.8	Positive

		Dates: 11/21/2022-12/21/2023	Lead-Safe Certification Assessment Report						
		Michael A Martin Certification #006416	Theodore Roosevelt Elementary School						
		Inspection Company: Criterion Labs	430 Washington Ln, Philadelphia, PA 19144						
E l e m e n t	F l o o r	On-Site Room Name	Component	Substrate Material	Paint Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
1	3	Stairwell across from Classroom 305	W4	Plaster	Tan	None	0	22.1	Positive
1	3	Stairwell across from Classroom 305	Ceiling	Plaster	Tan	None	0	20.7	Positive
1	3	Classroom 306	Floor	Wood	Brown	N/A	N/A	0	N/A
1	3	Classroom 306	W1	Plaster	Blue	None	0	16.9	Positive
1	3	Classroom 306	W2	Plaster	Tan	None	0	28.6	Positive
1	3	Classroom 306	W3	Plaster	Tan	None	0	21.8	Positive
1	3	Classroom 306	W4	Plaster	Tan	None	0	18	Positive
1	3	Classroom 306	Ceiling	Plaster	Tan	Cracking	15	31	Positive
1	3	Classroom 307	Floor	Wood	Brown	None	0	0	Negative
1	3	Classroom 307	W1	Plaster	Blue	None	0	23.2	Positive
1	3	Classroom 307	W2	Plaster	Tan	None	0	29.3	Positive
1	3	Classroom 307	W3	Plaster	Tan	Cracking	10	31.9	Positive
1	3	Classroom 307	W4	Plaster	Tan	Chipping	2	0	Negative
1	3	Classroom 307	Ceiling	Plaster	Tan	Cracking	20	30.7	Positive
1	3	Classroom 308	Floor	N/A	N/A	None	N/A	N/A	N/A
1	3	Classroom 308	W1	Plaster	Blue	Chipping	3	18.4	Positive
1	3	Classroom 308	W2	Plaster	Tan	Flaking	2	22	Positive
1	3	Classroom 308	W3	Plaster	Tan	Chipping	1	18.1	Positive
1	3	Classroom 308	W4	Plaster	Tan	None	0	0.01	Negative
1	3	Classroom 308	Ceiling	Spline	Unpainted	Unpainted	0	Unpainted	Unpainted
1	3	Classroom 309	Floor	Wood	Brown	N/A	0	0	Negative
1	3	Classroom 309	W1	Plaster	Blue	Chipping	1	19	Positive
1	3	Classroom 309	W2	Plaster	Tan	None	0	21.2	Positive
1	3	Classroom 309	W3	Plaster	Tan	None	0	18	Positive
1	3	Classroom 309	W4	Plaster	Tan	None	0	21.5	Positive
1	3	Classroom 309	Ceiling	Plaster	Tan	Chipping	50	29.5	Positive
1	3	Classroom 309 Closet	Floor	Wood	Brown	N/A	0	0	Negative
1	3	Classroom 309 Closet	W1	Plaster	Tan	None	0	0	Negative
1	3	Classroom 309 Closet	W2	Plaster	Tan	None	0	11.8	Positive
1	3	Classroom 309 Closet	W3	Plaster	Tan	None	0	6.3	Positive
1	3	Classroom 309 Closet	W4	Plaster	Tan	None	0	8.4	Positive
1	3	Classroom 309 Closet	Ceiling	No Access	No Access	No Access	No Access	No Access	No Access
1	3	Classroom 310	Floor	Wood	Brown	None	0	0	Negative
1	3	Classroom 310	W1	Plaster	Blue	Flaking	2	19	Positive
1	3	Classroom 310	W2	Plaster	Tan	None	0	12.5	Positive
1	3	Classroom 310	W3	Plaster	Tan	None	0	19.3	Positive

		Dates: 11/21/2022-12/21/2023	Lead-Safe Certification Assessment Report						
		Michael A Martin Certification #006416	Theodore Roosevelt Elementary School						
		Inspection Company: Criterion Labs	430 Washington Ln, Philadelphia, PA 19144						
E l e m e n t	F l o o r	On-Site Room Name	Component	Substrate Material	Paint Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
1	3	Classroom 310	W4	Plaster	Tan	None	0	25.2	Positive
1	3	Classroom 310	Ceiling	Plaster	Tan	Cracking	15	35.2	Positive
1	3	Classroom 310 Closet	Floor	No Access	No Access	No Access	No Access	No Access	No Access
1	3	Classroom 310 Closet	W1	No Access	No Access	No Access	No Access	No Access	No Access
1	3	Classroom 310 Closet	W2	No Access	No Access	No Access	No Access	No Access	No Access
1	3	Classroom 310 Closet	W3	No Access	No Access	No Access	No Access	No Access	No Access
1	3	Classroom 310 Closet	W4	No Access	No Access	No Access	No Access	No Access	No Access
1	3	Classroom 310 Closet	Ceiling	No Access	No Access	No Access	No Access	No Access	No Access
1	3	Classroom 311	Floor	N/A	N/A	N/A	N/A	N/A	N/A
1	3	Classroom 311	W1	Plaster	Blue	Chipping	1	19.6	Positive
1	3	Classroom 311	W2	Plaster	Tan	None	0	0	Negative
1	3	Classroom 311	W3	Plaster	Tan	None	0	24.2	Positive
1	3	Classroom 311	W4	Plaster	Tan	None	0	0.01	Negative
1	3	Classroom 311	Ceiling	Plaster	Tan	Chipping	20	27	Positive
1	3	Classroom 311 and 312 Closet	Floor	N/A	N/A	N/A	N/A	N/A	N/A
1	3	Classroom 311 and 312 Closet	W1	Plaster	Tan	None	0	0	Negative
1	3	Classroom 311 and 312 Closet	W2	Plaster	Tan	None	0	17.2	Positive
1	3	Classroom 311 and 312 Closet	W3	Plaster	Tan	None	0	17.4	Positive
1	3	Classroom 311 and 312 Closet	W4	Plaster	Tan	None	0	0	Negative
1	3	Classroom 311 and 312 Closet	Ceiling	Plaster	Tan	Chipping	20	26.8	Positive
1	3	Classroom 312	Floor	N/A	N/A	N/A	N/A	N/A	N/A
1	3	Classroom 312	W1	Plaster	Blue	Chipping	1	23.1	Positive
1	3	Classroom 312	W2	Plaster	Tan	None	0	23.6	Positive
1	3	Classroom 312	W3	Plaster	Tan	None	0	18	Positive
1	3	Classroom 312	W4	Plaster	Tan	None	0	28.6	Positive
1	3	Classroom 312	Ceiling	Plaster	Tan	Chipping	25	29.3	Positive
1	3	Classroom 313	Floor	N/A	N/A	N/A	0	N/A	N/A
1	3	Classroom 313	W1	Plaster	Blue	None	0	27.4	Positive
1	3	Classroom 313	W2	Plaster	Tan	None	0	27	Positive
1	3	Classroom 313	W3	Plaster	Tan	None	0	28.3	Positive
1	3	Classroom 313	W4	Plaster	Tan	None	0	12.4	Positive
1	3	Classroom 313	Ceiling	Plaster	Tan	Chipping	60	35.7	Positive
1	3	Classroom 314	Floor	Wood	Brown	None	0	0	Negative
1	3	Classroom 314	W1	Plaster	Blue	Chipping	2	20.1	Positive
1	3	Classroom 314	W2	Plaster	Tan	None	0	23.4	Positive
1	3	Classroom 314	W3	Plaster	Tan	None	0	30.6	Positive

		Dates: 11/21/2022-12/21/2023	Lead-Safe Certification Assessment Report						
		Michael A Martin Certification #006416	Theodore Roosevelt Elementary School						
		Inspection Company: Criterion Labs	430 Washington Ln, Philadelphia, PA 19144						
E l e m e n t	F l o o r	On-Site Room Name	Component	Substrate Material	Paint Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
1	3	Classroom 314	W4	N/A	N/A	N/A	N/A	N/A	N/A
1	3	Classroom 314	Ceiling	Plaster	Tan	Chipping	15	30.7	Positive
1	3	Stairwell across from Classroom 314	Floor	Concrete	Blue	None	0	1.9	Positive
1	3	Stairwell across from Classroom 314	W1	Metal	Brown	None	0	6.4	Positive
1	3	Stairwell across from Classroom 314	W2	Plaster	Tan	None	0	21.8	Positive
1	3	Stairwell across from Classroom 314	W3	Plaster	Tan	None	0	22.6	Positive
1	3	Stairwell across from Classroom 314	W4	Plaster	Tan	None	0	19.3	Positive
1	3	Stairwell across from Classroom 314	Ceiling	Plaster	Tan	None	0	22.6	Positive
1	3	Classroom 324A	Floor	N/A	N/A	N/A	N/A	N/A	N/A
1	3	Classroom 324A	W1	Brick	Tan	None	0	0.3	Negative
1	3	Classroom 324A	W2	Brick	Tan	None	0	0.03	Negative
1	3	Classroom 324A	W3	Brick	Tan	None	0	4	Positive
1	3	Classroom 324A	W4	Brick	Tan	None	0	0.24	Negative
1	3	Classroom 324A	Ceiling	Plaster	Tan	Cracking	25	29.2	Positive
1	3	Classroom 324B	Floor	N/A	N/A	N/A	N/A	N/A	N/A
1	3	Classroom 324B	W1	Brick	Tan	None	0	0.11	Negative
1	3	Classroom 324B	W2	Sheetrock	Tan	None	0	0	Negative
1	3	Classroom 324B	W3	Brick	Tan	None	0	8.5	Positive
1	3	Classroom 324B	W4	Brick	Tan	None	0	0.03	Negative
1	3	Classroom 324B	Ceiling	Plaster	Tan	Cracking	25	28.2	Positive
1	3	Classroom 324C	Floor	Tile	N/A	N/A	N/A	N/A	N/A
1	3	Classroom 324C	W1	Brick	Tan	None	0	0.5	Negative
1	3	Classroom 324C	W2	Brick	Tan	None	0	0.5	Negative
1	3	Classroom 324C	W3	Brick	Tan	None	0	3	Positive
1	3	Classroom 324C	W4	Sheetrock	Tan	None	0	0	Negative
1	3	Classroom 324C	Ceiling	Plaster	Tan	Cracking	30	2.5	Positive
1	3	Classroom 315	Floor	Wood	Brown	None	0	0	Negative
1	3	Classroom 315	W1	Plaster	Blue	Chipping	1	30.4	Positive
1	3	Classroom 315	W2	Wood	Brown	N/A	N/A	N/A	N/A
1	3	Classroom 315	W3	Plaster	Tan	None	0	27.7	Positive
1	3	Classroom 315	W4	Sheetrock	Tan	None	0	0	Negative
1	3	Classroom 315	Ceiling	Plaster	Tan	Chipping	20	33	Positive
1	3	Classroom 316	Floor	Wood	Brown	None	0	0	Negative
1	3	Classroom 316	W1	Plaster	Blue	None	0	22	Positive
1	3	Classroom 316	W2	Sheetrock	Tan	None	0	0	Negative
1	3	Classroom 316	W3	Plaster	Tan	Chipping	3	33.3	Positive

		Dates: 11/21/2022-12/21/2023	Lead-Safe Certification Assessment Report						
		Michael A Martin Certification #006416	Theodore Roosevelt Elementary School						
		Inspection Company: Criterion Labs	430 Washington Ln, Philadelphia, PA 19144						
E l e m e n t	F l o o r	On-Site Room Name	Component	Substrate Material	Paint Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
1	3	Classroom 316	W4	Plaster	Tan	None	0	30.5	Positive
1	3	Classroom 316	Ceiling	Plaster	Tan	Cracking	25	32.4	Positive
1	3	Girl's Restroom across from Classroom 316	Floor	Concrete	Grey	None	0	0.01	Negative
1	3	Girl's Restroom across from Classroom 316	W1	Brick	Tan	None	0	0.01	Negative
1	3	Girl's Restroom across from Classroom 316	W2	Brick	Tan	None	0	0.01	Negative
1	3	Girl's Restroom across from Classroom 316	W3	Brick	Tan	None	0	0.03	Negative
1	3	Girl's Restroom across from Classroom 316	W4	Brick	N/A	N/A	N/A	N/A	N/A
1	3	Girl's Restroom across from Classroom 316	Ceiling	Plaster	Tan	None	0	17	Positive
1	3	Custodial Closet across from Classroom 316	Floor	N/A	N/A	N/A	N/A	N/A	N/A
1	3	Custodial Closet across from Classroom 316	W1	Plaster	Blue	None	0	11.6	Positive
1	3	Custodial Closet across from Classroom 316	W2	Plaster	Blue	Flaking	5	12.2	Positive
1	3	Custodial Closet across from Classroom 316	W3	Plaster	Blue	Flaking	6	15.4	Positive
1	3	Custodial Closet across from Classroom 316	W4	Plaster	Blue	None	0	22.8	Positive
1	3	Custodial Closet across from Classroom 316	Ceiling	No Access	No Access	No Access	No Access	No Access	No Access
1	3	Stairwell across from Classroom 316	Floor	Concrete	Grey	None	0	0	Negative
1	3	Stairwell across from Classroom 316	W1	Metal	Brown	None	0	6	Positive
1	3	Stairwell across from Classroom 316	W2	Plaster	Tan	None	0	14.7	Positive
1	3	Stairwell across from Classroom 316	W3	Plaster	Tan	None	0	20.6	Positive
1	3	Stairwell across from Classroom 316	W4	Plaster	Tan	Flaking	2	17.5	Positive
1	3	Stairwell across from Classroom 316	Ceiling	Plaster	Tan	None	0	18.7	Positive
1	3	Lounge outside Women's Restroom next to Classroom 316	Floor	Wood	Brown	None	0	0.03	Negative
1	3	Lounge outside Women's Restroom next to Classroom 316	W1	Wood	Brown	None	0	0	Negative
1	3	Lounge outside Women's Restroom next to Classroom 316	W2	Plaster	Tan	None	0	22.1	Positive
1	3	Lounge outside Women's Restroom next to Classroom 316	W3	Plaster	Tan	None	0	25.9	Positive
1	3	Lounge outside Women's Restroom next to Classroom 316	W4	Plaster	Tan	None	0	26.3	Positive
1	3	Lounge outside Women's Restroom next to Classroom 316	Ceiling	Plaster	Tan	Cracking	15	24.6	Positive
1	3	Women's Restroom next to Classroom 316	Floor	N/A	N/A	N/A	N/A	N/A	N/A
1	3	Women's Restroom next to Classroom 316	W1	Plaster	Tan	None	0	20.2	Positive
1	3	Women's Restroom next to Classroom 316	W2	Plaster	Tan	None	0	23.6	Positive
1	3	Women's Restroom next to Classroom 316	W3	Plaster	Tan	Chipping	2	24.2	Positive
1	3	Women's Restroom next to Classroom 316	W4	Plaster	Tan	None	0	23.9	Positive

		Dates: 11/21/2022-12/21/2023	Lead-Safe Certification Assessment Report						
		Michael A Martin Certification #006416	Theodore Roosevelt Elementary School						
		Inspection Company: Criterion Labs	430 Washington Ln, Philadelphia, PA 19144						
E l e m e n t	F l o o r	On-Site Room Name	Component	Substrate Material	Paint Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
1	3	Women's Restroom next to Classroom 316	Ceiling	Plaster	White	None	0	0	Negative
1	3	Classroom 317	Floor	Wood	Brown	None	0	0.02	Negative
1	3	Classroom 317	W1	Plaster	Blue	Cracking	2	31.2	Positive
1	3	Classroom 317	W2	Plaster	Tan	None	0	30.1	Positive
1	3	Classroom 317	W3	Plaster	Tan	None	0	28	Positive
1	3	Classroom 317	W4	Plaster	Tan	None	0	28.1	Positive
1	3	Classroom 317	Ceiling	Plaster	Tan	Cracking	34	31.2	Positive
1	3	Classroom 318	Floor	Wood	Brown	None	0	0	Negative
1	3	Classroom 318	W1	Plaster	Blue	None	0	21.9	Positive
1	3	Classroom 318	W2	Plaster	Tan	None	0	25.8	Positive
1	3	Classroom 318	W3	Plaster	Tan	None	0	35.4	Positive
1	3	Classroom 318	W4	Plaster	Tan	None	0	13.5	Positive
1	3	Classroom 318	Ceiling	Plaster	Tan	Cracking	12	34	Positive
1	3	Women's Restroom next to Classroom 316	drain line	Metal	Tan	None	0	23	Positive
1	3	Women's Restroom next to Classroom 316	door	Wood	Brown	None	N/A	0.09	Negative
1	3	Women's Restroom next to Classroom 316	door casing	Wood	Brown	None	N/A	0.13	Negative
1	3	Fire Stairwell near Classroom 316	Floor	Concrete	Grey	None	0	0.01	Negative
1	3	Fire Stairwell near Classroom 316	W1	Brick	Tan	None	0	15.7	Positive
1	3	Fire Stairwell near Classroom 316	W2	Brick	Tan	None	0	15.2	Positive
1	3	Fire Stairwell near Classroom 316	W3	Brick	Red	None	0	15.9	Positive
1	3	Fire Stairwell near Classroom 316	W4	Brick	Tan	None	0	17	Positive
1	3	Fire Stairwell near Classroom 316	Ceiling	Plaster	Tan	None	0	2.4	Positive
1	3	Classroom 319	Floor	Wood	Brown	None	0	0	Negative
1	3	Classroom 319	W1	Plaster	Blue	None	0	29.9	Positive
1	3	Classroom 319	W2	Plaster	Tan	None	0	0.05	Negative
1	3	Classroom 319	W3	Plaster	Tan	None	0	27.1	Positive
1	3	Classroom 319	W4	Sheetrock	Tan	None	0	0	Negative
1	3	Classroom 319	Ceiling	Plaster	Tan	Cracking	27	1.6	Positive
1	3	Classroom 320	Floor	Wood	Brown	None	0	0	Negative
1	3	Classroom 320	W1	Plaster	Blue	None	0	30.4	Positive
1	3	Classroom 320	W2	Sheetrock	Tan	None	0	0.24	Negative
1	3	Classroom 320	W3	Plaster	Tan	Chipping	1	37	Positive
1	3	Classroom 320	W4	Plaster	Tan	Flaking	2	14.4	Positive
1	3	Classroom 320	Ceiling	Plaster	Tan	Cracking	25	28.3	Positive
1	3	Classroom 321	Floor	Wood	Brown	None	0	0.01	Negative
1	3	Classroom 321	W1	Plaster	Blue	Flaking	2	26.5	Positive

		Dates: 11/21/2022-12/21/2023	Lead-Safe Certification Assessment Report						
		Michael A Martin Certification #006416	Theodore Roosevelt Elementary School						
		Inspection Company: Criterion Labs	430 Washington Ln, Philadelphia, PA 19144						
E l e m e n t	F l o o r	On-Site Room Name	Component	Substrate Material	Paint Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
1	3	Classroom 321	W2	Plaster	Tan	None	0	25.3	Positive
1	3	Classroom 321	W3	Plaster	Tan	None	0	29	Positive
1	3	Classroom 321	W4	Sheetrock	Tan	None	0	0	Negative
1	3	Classroom 321	Ceiling	Plaster	Tan	Cracking	30	36.8	Positive
1	3	Classroom 322	Floor	Wood	Brown	None	0	0	Negative
1	3	Classroom 322	W1	Plaster	Blue	None	0	41.5	Positive
1	3	Classroom 322	W2	Sheetrock	Tan	None	0	0.3	Negative
1	3	Classroom 322	W3	Plaster	Tan	None	0	29.7	Positive
1	3	Classroom 322	W4	Plaster	Tan	None	0	36.3	Positive
1	3	Classroom 322	Ceiling	Plaster	Tan	Cracking	25	27.2	Positive
1	3	Fire Stairwell near Classroom 301	Floor	Concrete	Grey	None	0	0.03	Negative
1	3	Fire Stairwell near Classroom 301	W1	Brick	Tan	None	0	25	Positive
1	3	Fire Stairwell near Classroom 301	W2	Brick	Tan	None	0	21.7	Positive
1	3	Fire Stairwell near Classroom 301	W3	Brick	Red	None	0	0	Negative
1	3	Fire Stairwell near Classroom 301	W4	Brick	Tan	None	0	19.4	Positive
1	3	Fire Stairwell near Classroom 301	Ceiling	Plaster	Tan	None	0	11.1	Positive
1	3	Copy Room 301	Floor	N/A	N/A	N/A	N/A	N/A	N/A
1	3	Copy Room 301	W1	Plaster	Blue	None	0	0	Negative
1	3	Copy Room 301	W2	Plaster	Tan	None	0	0.03	Negative
1	3	Copy Room 301	W3	Plaster	Tan	None	0	36.7	Positive
1	3	Copy Room 301	W4	Plaster	Tan	None	0	0.05	Negative
1	3	Copy Room 301	Ceiling	Plaster	Tan	Cracking	39	38.1	Positive
1	3	Copy Room 301 Office	Floor	N/A	N/A	N/A	N/A	N/A	N/A
1	3	Copy Room 301 Office	W1	Plaster	Blue	None	0	0.01	Negative
1	3	Copy Room 301 Office	W2	Plaster	Tan	None	0	0.1	Negative
1	3	Copy Room 301 Office	W3	Plaster	Tan	None	0	39.9	Positive
1	3	Copy Room 301 Office	W4	Plaster	Tan	None	0	37.9	Positive
1	3	Copy Room 301 Office	Ceiling	Plaster	Tan	Cracking	20	34.2	Positive
1	3	Classroom 302	Floor	Wood	Brown	Chipping	10	0	Negative
1	3	Classroom 302	W1	Plaster	Blue	None	0	31.2	Positive
1	3	Classroom 302	W2	Plaster	Tan	None	0	37.9	Positive
1	3	Classroom 302	W3	Plaster	Tan	None	0	42.7	Positive
1	3	Classroom 302	W4	Plaster	Tan	None	0	0.03	Negative
1	3	Classroom 302	Ceiling	Plaster	Tan	Cracking	25	39.8	Positive
1	3	Elevator	Floor	N/A	N/A	N/A	N/A	N/A	N/A
1	3	Elevator	W1	N/A	N/A	N/A	N/A	N/A	N/A

		Dates: 11/21/2022-12/21/2023	Lead-Safe Certification Assessment Report						
		Michael A Martin Certification #006416	Theodore Roosevelt Elementary School						
		Inspection Company: Criterion Labs	430 Washington Ln, Philadelphia, PA 19144						
E l e m e n t	F l o o r	On-Site Room Name	Component	Substrate Material	Paint Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
1	3	Elevator	W2	N/A	N/A	N/A	N/A	N/A	N/A
1	3	Elevator	W3	N/A	N/A	N/A	N/A	N/A	N/A
1	3	Elevator	W4	N/A	N/A	N/A	N/A	N/A	N/A
1	3	Elevator	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
1	3	Lounge outside Men's Restroom next to Classroom 302	Floor	N/A	N/A	N/A	N/A	N/A	N/A
1	3	Lounge outside Men's Restroom next to Classroom 302	W1	Wood	Brown	None	0	0	Negative
1	3	Lounge outside Men's Restroom next to Classroom 302	W2	Plaster	Tan	None	0	3.2	Positive
1	3	Lounge outside Men's Restroom next to Classroom 302	W3	Plaster	Tan	None	0	0.06	Negative
1	3	Lounge outside Men's Restroom next to Classroom 302	W4	Plaster	Tan	None	0	21.9	Positive
1	3	Lounge outside Men's Restroom next to Classroom 302	Ceiling	Plaster	Tan	Flaking	20	26.8	Positive
1	3	Men's Restroom next to Classroom 302	Floor	N/A	N/A	N/A	N/A	N/A	N/A
1	3	Men's Restroom next to Classroom 302	W1	Plaster	White	None	0	21.2	Positive
1	3	Men's Restroom next to Classroom 302	W2	Plaster	White	None	0	0	Negative
1	3	Men's Restroom next to Classroom 302	W3	Plaster	White	None	0	0	Negative
1	3	Men's Restroom next to Classroom 302	W4	Plaster	White	None	0	26.2	Positive
1	3	Men's Restroom next to Classroom 302	Ceiling	Plaster	Tan	None	0	16.9	Positive
1	3	Hallway outside Classrooms 303-305	Floor	Concrete	Blue	None	0	0.22	Negative
1	3	Hallway outside Classrooms 303-305	W1	Plaster	Tan	None	0	11.3	Positive
1	3	Hallway outside Classrooms 303-305	W2	Plaster	Tan	None	0	21.8	Positive
1	3	Hallway outside Classrooms 303-305	W3	Plaster	Tan	None	0	25.9	Positive
1	3	Hallway outside Classrooms 303-305	W4	Plaster	Tan	Flaking	2	19.3	Positive
1	3	Hallway outside Classrooms 303-305	Ceiling	Plaster	Tan	Cracking	40	28.2	Positive
1	3	Hallway outside Classrooms 306-313	Floor	Concrete	Blue	None	0	0.19	Negative
1	3	Hallway outside Classrooms 306-313	W1	Plaster	Tan	None	0	23.9	Positive
1	3	Hallway outside Classrooms 306-313	W2	Plaster	Tan	None	0	31.2	Positive
1	3	Hallway outside Classrooms 306-313	W3	Plaster	Tan	None	0	27.9	Positive
1	3	Hallway outside Classrooms 306-313	W4	Plaster	Tan	None	0	25.9	Positive
1	3	Hallway outside Classrooms 306-313	Ceiling	Plaster	Tan	Chipping	40	0.26	Negative
1	3	Hallway outside Classrooms 314-316	Floor	Concrete	Blue	None	0	0.3	Negative
1	3	Hallway outside Classrooms 314-316	W1	Plaster	Tan	None	0	23.3	Positive
1	3	Hallway outside Classrooms 314-316	W2	Plaster	Tan	None	0	24.9	Positive

		Dates: 11/21/2022-12/21/2023	Lead-Safe Certification Assessment Report						
		Michael A Martin Certification #006416	Theodore Roosevelt Elementary School						
		Inspection Company: Criterion Labs	430 Washington Ln, Philadelphia, PA 19144						
E l e m e n t	F l o o r	On-Site Room Name	Component	Substrate Material	Paint Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
1	3	Hallway outside Classrooms 314-316	W3	Plaster	Tan	None	0	27.7	Positive
1	3	Hallway outside Classrooms 314-316	W4	Plaster	Tan	None	0	26.7	Positive
1	3	Hallway outside Classrooms 314-316	Ceiling	Plaster	Tan	Chipping	40	24.7	Positive
1	3	Hallway outside Classrooms 317-302	Floor	Concrete	Blue	None	0	0.5	Negative
1	3	Hallway outside Classrooms 317-302	W1	Plaster	Tan	None	0	21.1	Positive
1	3	Hallway outside Classrooms 317-302	W2	Plaster	Tan	None	0	28.1	Positive
1	3	Hallway outside Classrooms 317-302	W3	Plaster	Tan	None	0	20.8	Positive
1	3	Hallway outside Classrooms 317-302	W4	Plaster	Tan	None	0	25.5	Positive
1	3	Hallway outside Classrooms 317-302	Ceiling	Plaster	Tan	Cracking	120	28.7	Positive
1	2	Classroom 203	Floor	Wood	Brown	None	0	0	Negative
1	2	Classroom 203	W1	Plaster	Blue	Cracking	1	24.8	Positive
1	2	Classroom 203	W2	Plaster	Tan	None	0	11.4	Positive
1	2	Classroom 203	W3	Plaster	Tan	None	0	21.6	Positive
1	2	Classroom 203	W4	Sheetrock	Tan	None	0	0	Negative
1	2	Classroom 203	Ceiling	Plaster	Tan	Flaking	20	20.7	Positive
1	2	Stairwell across from Classroom 203	Floor	Concrete	Blue	None	0	0.5	Negative
1	2	Stairwell across from Classroom 203	W1	Metal	Brown	None	0	6.9	Positive
1	2	Stairwell across from Classroom 203	W2	Plaster	Tan	Cracking	4	18.4	Positive
1	2	Stairwell across from Classroom 203	W3	Plaster	Tan	None	0	15.9	Positive
1	2	Stairwell across from Classroom 203	W4	Plaster	Tan	Cracking	3	8.6	Positive
1	2	Stairwell across from Classroom 203	Ceiling	Plaster	Tan	none	0	24.2	Positive
1	3	Boy's Restroom across from Classroom 303	duct	Metal	Tan	None	N/A	0	Negative
1	3	Boy's Restroom across from Classroom 303	stall frame	Metal	Tan	None	N/A	0	Negative
1	3	Boy's Restroom across from Classroom 303	W3	Plaster	Tan	None	0	19.3	Positive
1	2	Boy's Restroom across Classroom 204	Floor	Concrete	Grey	None	0	0.01	Negative
1	2	Boy's Restroom across Classroom 204	W1	Brick	Tan	None	0	0.1	Negative
1	2	Boy's Restroom across Classroom 204	W2	Brick	Tan	None	0	0.2	Negative
1	2	Boy's Restroom across Classroom 204	W3	Brick	Tan	None	0	0.1	Negative
1	2	Boy's Restroom across Classroom 204	W4	cmu	Tan	None	0	0	Negative
1	2	Boy's Restroom across Classroom 204	Ceiling	Concrete	White	none	0	0.02	Negative
1	2	Classroom 200A	Floor	Concrete	Brown	None	0	0.01	Negative
1	2	Classroom 200A	W1	Brick	Tan	None	0	0.14	Negative
1	2	Classroom 200A	W2	cmu	Tan	None	0	0.03	Negative
1	2	Classroom 200A	W3	Brick	Tan	None	0	0.28	Negative
1	2	Classroom 200A	W4	Brick	Tan	None	0	0.05	Negative
1	2	Classroom 200A	Ceiling	Plaster	Tan	Flaking	5	27.6	Positive

		Dates: 11/21/2022-12/21/2023	Lead-Safe Certification Assessment Report						
		Michael A Martin Certification #006416	Theodore Roosevelt Elementary School						
		Inspection Company: Criterion Labs	430 Washington Ln, Philadelphia, PA 19144						
E l e m e n t	F l o o r	On-Site Room Name	Component	Substrate Material	Paint Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
1	2	Classroom 200C	Floor	Concrete	Brown	None	0	0	Negative
1	2	Classroom 200C	W1	Brick	Tan	None	0	0.21	Negative
1	2	Classroom 200C	W2	Brick	Tan	None	0	0.3	Negative
1	2	Classroom 200C	W3	Brick	Tan	None	0	0.23	Negative
1	2	Classroom 200C	W4	Sheetrock	Tan	None	0	0	Negative
1	2	Classroom 200C	Ceiling	Plaster	Tan	Flaking	5	19.7	Positive
1	2	Classroom 200B	Floor	N/A	N/A	N/A	N/A	N/A	N/A
1	2	Classroom 200B	W1	Brick	Tan	None	0	0.24	Negative
1	2	Classroom 200B	W2	Sheetrock	Tan	None	0	0	Negative
1	2	Classroom 200B	W3	Brick	Tan	None	0	0.3	Negative
1	2	Classroom 200B	W4	cmu	Tan	None	0	0.01	Negative
1	2	Classroom 200B	Ceiling	Plaster	Tan	Flaking	7	21	Positive
1	3	Custodial Closet across from Classroom 316	drain line	Metal	Tan	None	0	14.8	Positive
1	3	Custodial Closet across from Classroom 316	door jamb	Wood	Brown	None	N/A	0.11	Negative
1	3	Custodial Closet across from Classroom 316	door	Wood	Brown	None	N/A	0	Negative
1	2	Custodial Closet across from Classroom 203	Floor	Concrete	Grey	None	0	0.15	Negative
1	2	Custodial Closet across from Classroom 203	W1	Plaster	Blue	None	0	16.6	Positive
1	2	Custodial Closet across from Classroom 203	W2	Plaster	Blue	None	0	17.4	Positive
1	2	Custodial Closet across from Classroom 203	W3	Plaster	Blue	Cracking	6	16.8	Positive
1	2	Custodial Closet across from Classroom 203	W4	Plaster	Blue	Cracking	10	20.4	Positive
1	2	Custodial Closet across from Classroom 203	Ceiling	Plaster	Blue	Chipping	3	24.6	Positive
1	2	Custodial Closet across from Classroom 203	drain line	Metal	Blue	None	N/A	0.14	Negative
1	2	Custodial Closet across from Classroom 203	door	Wood	Brown	None	N/A	0	Negative
1	2	Custodial Closet across from Classroom 203	door casing	Metal	Brown	None	N/A	0	Negative
1	2	Custodial Closet across from Classroom 203 Pipe Chase	Floor	No Access	No Access	No Access	No Access	No Access	No Access
1	2	Custodial Closet across from Classroom 203 Pipe Chase	W1	No Access	No Access	No Access	No Access	No Access	No Access
1	2	Custodial Closet across from Classroom 203 Pipe Chase	W2	No Access	No Access	No Access	No Access	No Access	No Access
1	2	Custodial Closet across from Classroom 203 Pipe Chase	W3	No Access	No Access	No Access	No Access	No Access	No Access
1	2	Custodial Closet across from Classroom 203 Pipe Chase	W4	No Access	No Access	No Access	No Access	No Access	No Access
1	2	Custodial Closet across from Classroom 203 Pipe Chase	Ceiling	No Access	No Access	No Access	No Access	No Access	No Access
1	2	Boy's Restroom across Classroom 204	fame post	Metal	Tan	None	N/A	0.5	Negative

		Dates: 11/21/2022-12/21/2023	Lead-Safe Certification Assessment Report						
		Michael A Martin Certification #006416	Theodore Roosevelt Elementary School						
		Inspection Company: Criterion Labs	430 Washington Ln, Philadelphia, PA 19144						
E l e m e n t	F l o o r	On-Site Room Name	Component	Substrate Material	Paint Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
1	2	Boy's Restroom across Classroom 204	door casing	Wood	Brown	None	N/A	0.02	Negative
1	2	IMC Room 204/205	Floor	N/A	N/A	N/A	N/A	N/A	N/A
1	2	IMC Room 204/205	W1	Plaster	White	None	0	0	Negative
1	2	IMC Room 204/205	W2	Sheetrock	Green	None	0	0	Negative
1	2	IMC Room 204/205	W3	Plaster	White	None	0	22.8	Positive
1	2	IMC Room 204/205	W4	Plaster	White	None	0	26.5	Positive
1	2	IMC Room 204/205	Ceiling	Plaster	Tan	Flaking	25	22.9	Positive
1	2	IMC Room 204/205 Work Room	Floor	N/A	N/A	N/A	N/A	N/A	N/A
1	2	IMC Room 204/205 Work Room	W1	Sheetrock	White	None	0	0	Negative
1	2	IMC Room 204/205 Work Room	W2	Plaster	White	None	0	0	Negative
1	2	IMC Room 204/205 Work Room	W3	Plaster	White	None	0	0	Negative
1	2	IMC Room 204/205 Work Room	W4	Sheetrock	White	None	0	0	Negative
1	2	IMC Room 204/205 Work Room	Ceiling	Plaster	Tan	Flaking	5	23	Positive
1	2	Stairwell across from Classroom 205	Floor	Concrete	Blue	None	0	2.7	Positive
1	2	Stairwell across from Classroom 205	W1	Plaster	Brown	None	0	12.9	Positive
1	2	Stairwell across from Classroom 205	W2	Plaster	Tan	None	0	19.4	Positive
1	2	Stairwell across from Classroom 205	W3	Plaster	Tan	None	0	21.1	Positive
1	2	Stairwell across from Classroom 205	W4	Plaster	Tan	None	0	20.2	Positive
1	2	Stairwell across from Classroom 205	Ceiling	Plaster	Tan	none	0	24	Positive
1	2	206 Lobby to Administrative Offices	Floor	N/A	N/A	N/A	N/A	N/A	N/A
1	2	206 Lobby to Administrative Offices	W1	Plaster	Tan	None	0	21.1	Positive
1	2	206 Lobby to Administrative Offices	W2	Sheetrock	Tan	None	0	0	Negative
1	2	206 Lobby to Administrative Offices	W3	Sheetrock	Tan	None	0	0	Negative
1	2	206 Lobby to Administrative Offices	W4	Sheetrock	Tan	None	0	0.02	Negative
1	2	206 Lobby to Administrative Offices	Ceiling	Plaster	Tan	Flaking	10	22.6	Positive
1	2	206 Lobby to Administrative Offices	baseboard	Wood	Brown	None	N/A	0.06	Negative
1	2	206 Lobby to Administrative Offices	door casing	Metal	Brown	None	N/A	0.06	Negative
1	2	206 Lobby to Administrative Offices	door	Wood	Brown	None	N/A	0	Negative
1	2	Vice Principal's Office 206A	Floor	N/A	N/A	N/A	N/A	N/A	N/A
1	2	Vice Principal's Office 206A	W1	Sheetrock	Tan	None	0	0	Negative
1	2	Vice Principal's Office 206A	W2	Plaster	Tan	None	0	0.03	Negative
1	2	Vice Principal's Office 206A	W3	Plaster	Tan	None	0	29.2	Positive
1	2	Vice Principal's Office 206A	W4	Sheetrock	Tan	None	0	0.02	Negative
1	2	Vice Principal's Office 206A	Ceiling	Plaster	Tan	Flaking	7	18.9	Positive
1	2	Office 206B	Floor	N/A	N/A	N/A	N/A	N/A	N/A
1	2	Office 206B	W1	Sheetrock	Tan	None	0	0.01	Negative

		Dates: 11/21/2022-12/21/2023	Lead-Safe Certification Assessment Report						
		Michael A Martin Certification #006416	Theodore Roosevelt Elementary School						
		Inspection Company: Criterion Labs	430 Washington Ln, Philadelphia, PA 19144						
E l e m e n t	F l o o r	On-Site Room Name	Component	Substrate Material	Paint Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
1	2	Office 206B	W2	Sheetrock	Tan	None	0	0.03	Negative
1	2	Office 206B	W3	Sheetrock	Tan	None	0	0	Negative
1	2	Office 206B	W4	Sheetrock	Tan	None	0	0.02	Negative
1	2	Office 206B	Ceiling	Plaster	Tan	Flaking	7	24.7	Positive
1	2	Office 206C	Floor	N/A	N/A	N/A	N/A	N/A	N/A
1	2	Office 206C	W1	Sheetrock	Tan	None	0	0.03	Negative
1	2	Office 206C	W2	Sheetrock	Tan	None	0	0.01	Negative
1	2	Office 206C	W3	Plaster	Tan	None	0	18.8	Positive
1	2	Office 206C	W4	Sheetrock	Tan	None	0	0.04	Negative
1	2	Office 206C	Ceiling	Plaster	Tan	Flaking	5	19.4	Positive
1	2	Office 206D	Floor	N/A	N/A	N/A	N/A	N/A	N/A
1	2	Office 206D	W1	Sheetrock	Tan	None	0	0.08	Negative
1	2	Office 206D	W2	Sheetrock	Tan	None	0	0.01	Negative
1	2	Office 206D	W3	Plaster	Tan	None	0	23.8	Positive
1	2	Office 206D	W4	Plaster	Tan	None	0	4.4	Positive
1	2	Office 206D	Ceiling	Plaster	Tan	Flaking	5	27.5	Positive
1	2	Office 206E	Floor	N/A	N/A	N/A	N/A	N/A	N/A
1	2	Office 206E	W1	Sheetrock	Tan	None	0	0.01	Negative
1	2	Office 206E	W2	Sheetrock	Tan	None	0	0.02	Negative
1	2	Office 206E	W3	Plaster	Tan	None	0	27.5	Positive
1	2	Office 206E	W4	Plaster	Tan	None	0	0.02	Negative
1	2	Office 206E	Ceiling	Plaster	Tan	Flaking	7	21.6	Positive
1	2	Office 207 Lobby area to Left of 206 Suites	Floor	N/A	N/A	N/A	N/A	N/A	N/A
1	2	Office 207 Lobby area to Left of 206 Suites	W1	Plaster	Tan	None	0	23.3	Positive
1	2	Office 207 Lobby area to Left of 206 Suites	W2	Plaster	Tan	None	0	30.7	Positive
1	2	Office 207 Lobby area to Left of 206 Suites	W3	Plaster	Tan	None	0	0.06	Negative
1	2	Office 207 Lobby area to Left of 206 Suites	W4	Sheetrock	Tan	None	0	0.02	Negative
1	2	Office 207 Lobby area to Left of 206 Suites	Ceiling	Concrete	N/A	N/A	N/A	N/A	N/A
1	2	Office 207 Lobby area to Left of 206 Suites	baseboard	Wood	Brown	None	N/A	0.02	Negative
1	2	Office 207 Lobby area to Left of 206 Suites	door	Metal	Brown	None	N/A	0	Negative
1	2	Counselor Office next to 206 Suites	Floor	Tile	N/A	N/A	N/A	N/A	N/A
1	2	Counselor Office next to 206 Suites	W1	Sheetrock	Tan	None	0	0.01	Negative
1	2	Counselor Office next to 206 Suites	W2	Plaster	Tan	None	0	19.8	Positive
1	2	Counselor Office next to 206 Suites	W3	Plaster	Tan	None	0	26.2	Positive
1	2	Counselor Office next to 206 Suites	W4	Sheetrock	Tan	None	0	0.03	Negative
1	2	Counselor Office next to 206 Suites	Ceiling	Concrete	N/A	N/A	N/A	N/A	N/A

		Dates: 11/21/2022-12/21/2023	Lead-Safe Certification Assessment Report						
		Michael A Martin Certification #006416	Theodore Roosevelt Elementary School						
		Inspection Company: Criterion Labs	430 Washington Ln, Philadelphia, PA 19144						
E l e m e n t	F l o o r	On-Site Room Name	Component	Substrate Material	Paint Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
1	2	Conference Room adjacent to Principal's Office (Lobby Area)	Floor	N/A	N/A	N/A	N/A	N/A	N/A
1	2	Conference Room adjacent to Principal's Office (Lobby Area)	W1	Plaster	Tan	None	0	28.7	Positive
1	2	Conference Room adjacent to Principal's Office (Lobby Area)	W2	Sheetrock	Tan	None	0	0.02	Negative
1	2	Conference Room adjacent to Principal's Office (Lobby Area)	W3	Sheetrock	Tan	None	0	0.02	Negative
1	2	Conference Room adjacent to Principal's Office (Lobby Area)	W4	Sheetrock	Tan	None	0	0	Negative
1	2	Conference Room adjacent to Principal's Office (Lobby Area)	Ceiling	Concrete	N/A	N/A	N/A	N/A	N/A
1	2	Counselor Office next to 206 Suites	baseboard	Wood	Brown	None	N/A	0.05	Negative
1	2	Counselor Office next to 206 Suites	window apron	Wood	Brown	None	N/A	0.06	Negative
1	2	Counselor Office next to 206 Suites	window casing	Metal	Brown	None	N/A	0.02	Negative
1	2	Counselor Office next to 206 Suites	door casing	Metal	Brown	None	N/A	0.01	Negative
1	2	Office next to Counselor's Office	Floor	N/A	N/A	N/A	N/A	N/A	N/A
1	2	Office next to Counselor's Office	W1	Sheetrock	Tan	None	0	0	Negative
1	2	Office next to Counselor's Office	W2	Sheetrock	Tan	None	0	0	Negative
1	2	Office next to Counselor's Office	W3	Plaster	Tan	None	0	23.1	Positive
1	2	Office next to Counselor's Office	W4	Sheetrock	Tan	None	0	0.03	Negative
1	2	Office next to Counselor's Office	Ceiling	Concrete	N/A	N/A	N/A	N/A	N/A
1	2	Conference Room adjacent to Principal's Office (Lobby Area)	baseboard	Wood	Brown	None	N/A	0.05	Negative
1	2	Conference Room adjacent to Principal's Office (Lobby Area)	door	Wood	Brown	None	N/A	0	Negative
1	2	Second Office from Right in Conference Room	Floor	N/A	N/A	N/A	N/A	N/A	N/A
1	2	Second Office from Right in Conference Room	W1	Sheetrock	Tan	None	0	0.06	Negative
1	2	Second Office from Right in Conference Room	W2	Sheetrock	Tan	None	0	0.02	Negative
1	2	Second Office from Right in Conference Room	W3	Plaster	Tan	None	0	15.3	Positive
1	2	Second Office from Right in Conference Room	W4	Plaster	Tan	None	0	21.4	Positive
1	2	Second Office from Right in Conference Room	Ceiling	Concrete	N/A	N/A	N/A	N/A	N/A
1	2	Second Office from Left in Conference Room	Floor	N/A	N/A	N/A	N/A	N/A	N/A
1	2	Second Office from Left in Conference Room	W1	Sheetrock	Tan	None	0	0.01	Negative
1	2	Second Office from Left in Conference Room	W2	Plaster	Tan	None	0	36.8	Positive
1	2	Second Office from Left in Conference Room	W3	Plaster	Tan	None	0	21.9	Positive
1	2	Second Office from Left in Conference Room	W4	Sheetrock	Tan	None	0	0.01	Negative

		Dates: 11/21/2022-12/21/2023	Lead-Safe Certification Assessment Report						
		Michael A Martin Certification #006416	Theodore Roosevelt Elementary School						
		Inspection Company: Criterion Labs	430 Washington Ln, Philadelphia, PA 19144						
E l e m e n t	F l o o r	On-Site Room Name	Component	Substrate Material	Paint Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
1	2	Second Office from Left in Conference Room	Ceiling	Concrete	N/A	N/A	N/A	N/A	N/A
1	2	Office next to Art Room	Floor	N/A	N/A	N/A	N/A	N/A	N/A
1	2	Office next to Art Room	W1	Sheetrock	Tan	None	0	0.03	Negative
1	2	Office next to Art Room	W2	Sheetrock	Tan	None	0	0.02	Negative
1	2	Office next to Art Room	W3	Plaster	Tan	None	0	27.4	Positive
1	2	Office next to Art Room	W4	Sheetrock	Tan	None	0	0.01	Negative
1	2	Office next to Art Room	Ceiling	Concrete	N/A	N/A	N/A	N/A	N/A
1	2	Art Room 208	Floor	N/A	N/A	N/A	N/A	N/A	N/A
1	2	Art Room 208	W1	Sheetrock	Tan	None	0	0	Negative
1	2	Art Room 208	W2	Sheetrock	Orange	None	0	0.02	Negative
1	2	Art Room 208	W3	Sheetrock	Tan	Moisture Damage	15	15.3	Positive
1	2	Art Room 208	W4	Sheetrock	Tan	None	0	0	Negative
1	2	Art Room 208	Ceiling	Plaster	Tan	Flaking	35	25.6	Positive
1	2	Art Room 208 Storage	Floor	N/A	N/A	N/A	N/A	N/A	N/A
1	2	Art Room 208 Storage	W1	Plaster	White	None	0	14.6	Positive
1	2	Art Room 208 Storage	W2	Sheetrock	White	None	0	0.02	Negative
1	2	Art Room 208 Storage	W3	Plaster	White	None	0	16.3	Positive
1	2	Art Room 208 Storage	W4	Plaster	White	None	0	17.1	Positive
1	2	Art Room 208 Storage	Ceiling	Plaster	Green	none	0	13.6	Positive
1	2	Art Room 208 Restroom	Floor	N/A	N/A	N/A	N/A	N/A	N/A
1	2	Art Room 208 Restroom	W1	Sheetrock	White	None	0	0.01	Negative
1	2	Art Room 208 Restroom	W2	Plaster	White	None	0	12.8	Positive
1	2	Art Room 208 Restroom	W3	Plaster	White	None	0	13.8	Positive
1	2	Art Room 208 Restroom	W4	Plaster	White	None	0	13.9	Positive
1	2	Art Room 208 Restroom	Ceiling	Plaster	White	none	0	16.9	Positive
1	2	Stairwell Next to Main Office	Floor	N/A	N/A	N/A	N/A	N/A	N/A
1	2	Stairwell Next to Main Office	W1	Plaster	White	None	0	23.8	Positive
1	2	Stairwell Next to Main Office	W2	Plaster	White	None	0	26.4	Positive
1	2	Stairwell Next to Main Office	W3	Plaster	White	None	0	26.2	Positive
1	2	Stairwell Next to Main Office	W4	Plaster	White	None	0	1.7	Positive
1	2	Stairwell Next to Main Office	Ceiling	Plaster	White	None	0	2.6	Positive
1	2	Auditorium Balcony	Floor	No Access	No Access	No Access	No Access	No Access	No Access
1	2	Auditorium Balcony	W1	No Access	No Access	No Access	No Access	No Access	No Access
1	2	Auditorium Balcony	W2	No Access	No Access	No Access	No Access	No Access	No Access
1	2	Auditorium Balcony	W3	No Access	No Access	No Access	No Access	No Access	No Access
1	2	Auditorium Balcony	W4	No Access	No Access	No Access	No Access	No Access	No Access

		Dates: 11/21/2022-12/21/2023	Lead-Safe Certification Assessment Report						
		Michael A Martin Certification #006416	Theodore Roosevelt Elementary School						
		Inspection Company: Criterion Labs	430 Washington Ln, Philadelphia, PA 19144						
E l e m e n t	F l o o r	On-Site Room Name	Component	Substrate Material	Paint Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
1	2	Auditorium Balcony	Ceiling	No Access	No Access	No Access	No Access	No Access	No Access
1	2	Pipe Chase on Auditorium Balcony	Floor	No Access	No Access	No Access	No Access	No Access	No Access
1	2	Pipe Chase on Auditorium Balcony	W1	No Access	No Access	No Access	No Access	No Access	No Access
1	2	Pipe Chase on Auditorium Balcony	W2	No Access	No Access	No Access	No Access	No Access	No Access
1	2	Pipe Chase on Auditorium Balcony	W3	No Access	No Access	No Access	No Access	No Access	No Access
1	2	Pipe Chase on Auditorium Balcony	W4	No Access	No Access	No Access	No Access	No Access	No Access
1	2	Pipe Chase on Auditorium Balcony	Ceiling	No Access	No Access	No Access	No Access	No Access	No Access
1	2	Auditorium Balcony Projection Room	Floor	No Access	No Access	No Access	No Access	No Access	No Access
1	2	Auditorium Balcony Projection Room	W1	No Access	No Access	No Access	No Access	No Access	No Access
1	2	Auditorium Balcony Projection Room	W2	No Access	No Access	No Access	No Access	No Access	No Access
1	2	Auditorium Balcony Projection Room	W3	No Access	No Access	No Access	No Access	No Access	No Access
1	2	Auditorium Balcony Projection Room	W4	No Access	No Access	No Access	No Access	No Access	No Access
1	2	Auditorium Balcony Projection Room	Ceiling	No Access	No Access	No Access	No Access	No Access	No Access
1	2	Teacher's Lounge 209	Floor	Tile	N/A	N/A	N/A	N/A	N/A
1	2	Teacher's Lounge 209	W1	Plaster	tan	none	0	16.6	Positive
1	2	Teacher's Lounge 209	W2	Plaster	Tan	Cracking	1	16.4	Positive
1	2	Teacher's Lounge 209	W3	Plaster	Tan	None	0	31.2	Positive
1	2	Teacher's Lounge 209	W4	Plaster	Tan	None	0	29.3	Positive
1	2	Teacher's Lounge 209	Ceiling	Plaster	Tan	Flaking	20	29.2	Positive
1	2	Nurse's Office Waiting Area	Floor	N/A	N/A	N/A	N/A	N/A	N/A
1	2	Nurse's Office Waiting Area	W1	Plaster	Tan	None	0	25.2	Positive
1	2	Nurse's Office Waiting Area	W2	Sheetrock	Tan	None	0	0	Negative
1	2	Nurse's Office Waiting Area	W3	Sheetrock	Tan	None	0	0	Negative
1	2	Nurse's Office Waiting Area	W4	Sheetrock	Tan	None	0	0	Negative
1	2	Nurse's Office Waiting Area	Ceiling	Plaster	Tan	Flaking	10	30.7	Positive
1	2	Nurse's Office	Floor	N/A	N/A	N/A	N/A	N/A	N/A
1	2	Nurse's Office	W1	Sheetrock	Tan	None	0	0.02	Negative
1	2	Nurse's Office	W2	Sheetrock	Tan	None	0	0.03	Negative
1	2	Nurse's Office	W3	Plaster	Tan	Cracking	8	24.2	Positive
1	2	Nurse's Office	W4	Sheetrock	Tan	None	0	0	Negative
1	2	Nurse's Office	Ceiling	Plaster	Tan	Flaking	10	28.9	Positive
1	2	Nurse's Office Restroom	Floor	N/A	N/A	N/A	N/A	N/A	N/A
1	2	Nurse's Office Restroom	W1	Plaster	Yellow	None	0	0	Negative
1	2	Nurse's Office Restroom	W2	Plaster	Yellow	None	0	0	Negative
1	2	Nurse's Office Restroom	W3	Plaster	Yellow	None	0	0	Negative
1	2	Nurse's Office Restroom	W4	Plaster	Yellow	None	0	0	Negative

		Dates: 11/21/2022-12/21/2023	Lead-Safe Certification Assessment Report						
		Michael A Martin Certification #006416	Theodore Roosevelt Elementary School						
		Inspection Company: Criterion Labs	430 Washington Ln, Philadelphia, PA 19144						
E l e m e n t	F l o o r	On-Site Room Name	Component	Substrate Material	Paint Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
1	2	Nurse's Office Restroom	Ceiling	Plaster	Tan	Flaking	5	26.2	Positive
1	2	Nurse's Office Exam Room	Floor	N/A	N/A	N/A	N/A	N/A	N/A
1	2	Nurse's Office Exam Room	W1	Sheetrock	Tan	No Access	0	0.06	Negative
1	2	Nurse's Office Exam Room	W2	Sheetrock	Tan	No Access	0	0.01	Negative
1	2	Nurse's Office Exam Room	W3	Plaster	Tan	No Access	0	30.8	Positive
1	2	Nurse's Office Exam Room	W4	Plaster	Tan	No Access	0	25.6	Positive
1	2	Nurse's Office Exam Room	Ceiling	Plaster	Tan	Flaking	5	27.9	Positive
1	2	Nurse's Office Exam Room Closet	Floor	No Access	No Access	No Access	No Access	No Access	No Access
1	2	Nurse's Office Exam Room Closet	W1	No Access	No Access	No Access	No Access	No Access	No Access
1	2	Nurse's Office Exam Room Closet	W2	No Access	No Access	No Access	No Access	No Access	No Access
1	2	Nurse's Office Exam Room Closet	W3	No Access	No Access	No Access	No Access	No Access	No Access
1	2	Nurse's Office Exam Room Closet	W4	No Access	No Access	No Access	No Access	No Access	No Access
1	2	Nurse's Office Exam Room Closet	Ceiling	No Access	No Access	No Access	No Access	No Access	No Access
1	2	Classroom 210	Floor	N/A	N/A	N/A	N/A	N/A	N/A
1	2	Classroom 210	W1	Plaster	White	None	0	9.6	Positive
1	2	Classroom 210	W2	Plaster	Orange	None	0	14.5	Positive
1	2	Classroom 210	W3	Plaster	White	None	0	31.1	Positive
1	2	Classroom 210	W4	cmu	White	None	0	0.01	Negative
1	2	Classroom 210	Ceiling	Plaster	Tan	Flaking	15	28.6	Positive
1	2	Classroom 211	Floor	N/A	N/A	N/A	N/A	N/A	N/A
1	2	Classroom 211	W1	Plaster	White	None	0	29.7	Positive
1	2	Classroom 211	W2	cmu	Orange	None	0	0	Negative
1	2	Classroom 211	W3	Plaster	White	Chipping	3	32.7	Positive
1	2	Classroom 211	W4	Plaster	White	None	0	26.6	Positive
1	2	Classroom 211	Ceiling	Plaster	Tan	Flaking	25	24.7	Positive
1	2	Hallway between Classrooms 210-211	Floor	N/A	N/A	N/A	N/A	N/A	N/A
1	2	Hallway between Classrooms 210-211	W1	Plaster	White	None	0	9.6	Positive
1	2	Hallway between Classrooms 210-211	W2	Plaster	White	None	0	28.4	Positive
1	2	Hallway between Classrooms 210-211	W3	Sheetrock	White	None	0	0	Negative
1	2	Hallway between Classrooms 210-211	W4	cmu	White	None	0	0	Negative
1	2	Hallway between Classrooms 210-211	Ceiling	No Access	No Access	No Access	No Access	No Access	No Access
1	2	Classroom 211 Storage	Floor	N/A	N/A	N/A	N/A	N/A	N/A
1	2	Classroom 211 Storage	W1	Sheetrock	White	None	0	0	Negative
1	2	Classroom 211 Storage	W2	Plaster	White	None	0	30.2	Positive
1	2	Classroom 211 Storage	W3	Plaster	White	None	0	32.3	Positive
1	2	Classroom 211 Storage	W4	cmu	White	None	0	0	Negative

		Dates: 11/21/2022-12/21/2023	Lead-Safe Certification Assessment Report						
		Michael A Martin Certification #006416	Theodore Roosevelt Elementary School						
		Inspection Company: Criterion Labs	430 Washington Ln, Philadelphia, PA 19144						
E l e m e n t	F l o o r	On-Site Room Name	Component	Substrate Material	Paint Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
1	2	Classroom 211 Storage	Ceiling	No Access	No Access	No Access	No Access	No Access	No Access
1	2	Classroom 212	Floor	N/A	N/A	N/A	0	N/A	N/A
1	2	Classroom 212	W1	Plaster	Blue	Chipping	1	26.7	Positive
1	2	Classroom 212	W2	Plaster	Tan	None	0	0.03	Negative
1	2	Classroom 212	W3	Plaster	Tan	None	0	24.6	Positive
1	2	Classroom 212	W4	Plaster	Tan	None	0	19.4	Positive
1	2	Classroom 212	Ceiling	Plaster	Tan	Flaking	20	23.5	Positive
1	2	Stairwell across from Classroom 212	Floor	Concrete	Blue	N/A	0	0.25	Negative
1	2	Stairwell across from Classroom 212	W1	Metal	Brown	None	0	10.1	Positive
1	2	Stairwell across from Classroom 212	W2	Plaster	Tan	None	0	8	Positive
1	2	Stairwell across from Classroom 212	W3	Plaster	Tan	None	0	17.1	Positive
1	2	Stairwell across from Classroom 212	W4	Plaster	Tan	None	0	14.8	Positive
1	2	Stairwell across from Classroom 212	Ceiling	Plaster	Tan	None	0	22.9	Positive
1	2	Classroom 221A	Floor	N/A	N/A	N/A	N/A	N/A	N/A
1	2	Classroom 221A	W1	Brick	Tan	N/A	N/A	0.04	Negative
1	2	Classroom 221A	W2	CMU	Tan	N/A	N/A	0.02	Negative
1	2	Classroom 221A	W3	Brick	Tan	N/A	N/A	0.05	Negative
1	2	Classroom 221A	W4	Brick	Tan	N/A	N/A	0.02	Negative
1	2	Classroom 221A	Ceiling	Plaster	Tan	Flaking	5	18.4	Positive
1	2	Classroom 213	Floor	Wood	N/A	N/A	N/A	N/A	N/A
1	2	Classroom 213	W1	Plaster	Blue	Chipping	1	23.1	Positive
1	2	Classroom 213	W2	Plaster	Tan	None	0	32.7	Positive
1	2	Classroom 213	W3	Plaster	Tan	None	0	25.9	Positive
1	2	Classroom 213	W4	Sheetrock	Tan	N/A	0	0.4	Negative
1	2	Classroom 213	Ceiling	Plaster	Tan	Flaking	7	22.5	Positive
1	2	Classroom 221B	Floor	N/A	N/A	N/A	N/A	N/A	N/A
1	2	Classroom 221B	W1	Brick	Tan	None	0	0.3	Negative
1	2	Classroom 221B	W2	Sheetrock	Tan	None	0	0	Negative
1	2	Classroom 221B	W3	Brick	Tan	None	0	0.4	Negative
1	2	Classroom 221B	W4	CMU	Tan	None	0	0.07	Negative
1	2	Classroom 221B	Ceiling	Plaster	Tan	Flaking	5	16.3	Positive
1	2	Classroom 221C	Floor	Concrete	Brown	None	0	0.01	Negative
1	2	Classroom 221C	W1	Brick	Tan	None	0	0.4	Negative
1	2	Classroom 221C	W2	Brick	Tan	None	0	0.4	Negative
1	2	Classroom 221C	W3	Brick	Tan	None	0	0.6	Negative
1	2	Classroom 221C	W4	Sheetrock	Tan	None	0	0	Negative

		Dates: 11/21/2022-12/21/2023	Lead-Safe Certification Assessment Report						
		Michael A Martin Certification #006416	Theodore Roosevelt Elementary School						
		Inspection Company: Criterion Labs	430 Washington Ln, Philadelphia, PA 19144						
E l e m e n t	F l o o r	On-Site Room Name	Component	Substrate Material	Paint Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
1	2	Classroom 221C	Ceiling	Plaster	Tan	Flaking	5	20.4	Positive
1	2	Girl's Restroom across from Classroom 214	Floor	Concrete	Grey	Friction	6	0.02	Negative
1	2	Girl's Restroom across from Classroom 214	W1	Plaster	Tan	None	0	23.6	Positive
1	2	Girl's Restroom across from Classroom 214	W2	Plaster	Tan	None	0	21.3	Positive
1	2	Girl's Restroom across from Classroom 214	W3	Plaster	Tan	None	0	4.2	Positive
1	2	Girl's Restroom across from Classroom 214	W4	Plaster	Tan	None	0	22.7	Positive
1	2	Girl's Restroom across from Classroom 214	Ceiling	Plaster	Tan	none	0	21.5	Positive
1	2	Custodial Closet across from Classroom 214	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
1	2	Custodial Closet across from Classroom 214	W1	Plaster	Gray	None	0	15.2	Positive
1	2	Custodial Closet across from Classroom 214	W2	Plaster	Gray	None	0	16.6	Positive
1	2	Custodial Closet across from Classroom 214	W3	Plaster	Gray	None	0	13.8	Positive
1	2	Custodial Closet across from Classroom 214	W4	Plaster	Gray	None	0	10.4	Positive
1	2	Custodial Closet across from Classroom 214	Ceiling	Plaster	Tan	None	0	29	Positive
1	2	Custodial Closet across from Classroom 214	drainline	Metal	Grey	None	N/A	0.5	Negative
1	2	Custodial Closet across from Classroom 214	door	Wood	Brown	None	N/A	0	Negative
1	2	Custodial Closet across from Classroom 214 Pipe Chase	Floor	No Access	No Access	No Access	No Access	No Access	No Access
1	2	Custodial Closet across from Classroom 214 Pipe Chase	W1	No Access	No Access	No Access	No Access	No Access	No Access
1	2	Custodial Closet across from Classroom 214 Pipe Chase	W2	No Access	No Access	No Access	No Access	No Access	No Access
1	2	Custodial Closet across from Classroom 214 Pipe Chase	W3	No Access	No Access	No Access	No Access	No Access	No Access
1	2	Custodial Closet across from Classroom 214 Pipe Chase	W4	No Access	No Access	No Access	No Access	No Access	No Access
1	2	Custodial Closet across from Classroom 214 Pipe Chase	Ceiling	No Access	No Access	No Access	No Access	No Access	No Access
1	2	Classroom 214	Floor	Wood	N/A	N/A	N/A	N/A	N/A
1	2	Classroom 214	W1	Plaster	Blue	Chipping	3	26.8	Positive
1	2	Classroom 214	W2	Sheetrock	Tan	None	0	0	Negative
1	2	Classroom 214	W3	Plaster	Tan	None	0	26.2	Positive
1	2	Classroom 214	W4	Plaster	Tan	None	0	13.6	Positive
1	2	Classroom 214	Ceiling	Plaster	Tan	Flaking	10	29	Positive
1	2	Stairwell Next to Classroom 214	Floor	Concrete	Blue	None	0	0.5	Negative
1	2	Stairwell Next to Classroom 214	W1	Metal	Brown	None	0	13.2	Positive
1	2	Stairwell Next to Classroom 214	W2	Plaster	Tan	None	0	22.4	Positive
1	2	Stairwell Next to Classroom 214	W3	Plaster	Tan	None	0	25.3	Positive

		Dates: 11/21/2022-12/21/2023	Lead-Safe Certification Assessment Report						
		Michael A Martin Certification #006416	Theodore Roosevelt Elementary School						
		Inspection Company: Criterion Labs	430 Washington Ln, Philadelphia, PA 19144						
E l e m e n t	F l o o r	On-Site Room Name	Component	Substrate Material	Paint Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
1	2	Stairwell Next to Classroom 214	W4	Plaster	Tan	None	0	16.5	Positive
1	2	Stairwell Next to Classroom 214	Ceiling	Plaster	Tan	None	0	18.8	Positive
1	2	Lounge Outside Women's Restroom next to Classroom 214	Floor	N/A	N/A	N/A	N/A	N/A	N/A
1	2	Lounge Outside Women's Restroom next to Classroom 214	W1	Wood	Brown	None	0	0	Negative
1	2	Lounge Outside Women's Restroom next to Classroom 214	W2	Plaster	Tan	Cracking	2	27.3	Positive
1	2	Lounge Outside Women's Restroom next to Classroom 214	W3	Plaster	Tan	None	0	21	Positive
1	2	Lounge Outside Women's Restroom next to Classroom 214	W4	Plaster	Tan	Cracking	5	35.2	Positive
1	2	Lounge Outside Women's Restroom next to Classroom 214	Ceiling	Plaster	Tan	None	0	20.4	Positive
1	2	Women's Restroom next to Classroom 214	Floor	N/A	N/A	N/A	N/A	N/A	N/A
1	2	Women's Restroom next to Classroom 214	W1	Plaster	Tan	None	0	20.7	Positive
1	2	Women's Restroom next to Classroom 214	W2	Plaster	Tan	None	0	25.2	Positive
1	2	Women's Restroom next to Classroom 214	W3	Plaster	tan	None	0	22	Positive
1	2	Women's Restroom next to Classroom 214	W4	Plaster	tan	None	0	30.2	Positive
1	2	Women's Restroom next to Classroom 214	Ceiling	Plaster	Tan	None	0	19	Positive
1	2	Classroom 215	Floor	N/A	N/A	N/A	N/A	N/A	N/A
1	2	Classroom 215	W1	Plaster	Orange	none	0	0	Negative
1	2	Classroom 215	W2	Plaster	Tan	none	0	25.5	Positive
1	2	Classroom 215	W3	Plaster	Tan	none	0	25.8	Positive
1	2	Classroom 215	W4	Plaster	Tan	none	0	0	Negative
1	2	Classroom 215	Ceiling	Plaster	Tan	None	0	23.1	Positive
1	2	Classroom 216	Floor	Wood	N/A	N/A	N/A	N/A	N/A
1	2	Classroom 216	W1	Plaster	Blue	Flaking	2	29.9	Positive
1	2	Classroom 216	W2	Plaster	Tan	Chipping	3	0	Negative
1	2	Classroom 216	W3	Plaster	Tan	Moisture Damage	5	27.2	Positive
1	2	Classroom 216	W4	Plaster	Tan	None	0	13.5	Positive
1	2	Classroom 216	Ceiling	Plaster	Tan	None	0	20.4	Positive
1	2	Fire Stairwell near Classroom 216	Floor	Concrete	Gray	N/A	0	0.01	Negative
1	2	Fire Stairwell near Classroom 216	W1	Brick	Tan	None	0	17.6	Positive
1	2	Fire Stairwell near Classroom 216	W2	Brick	Tan	None	0	20.6	Positive
1	2	Fire Stairwell near Classroom 216	W3	Metal	Red	N/A	0	0	Negative
1	2	Fire Stairwell near Classroom 216	W4	Brick	Tan	None	0	19.5	Positive

		Dates: 11/21/2022-12/21/2023	Lead-Safe Certification Assessment Report						
		Michael A Martin Certification #006416	Theodore Roosevelt Elementary School						
		Inspection Company: Criterion Labs	430 Washington Ln, Philadelphia, PA 19144						
E l e m e n t	F l o o r	On-Site Room Name	Component	Substrate Material	Paint Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
1	2	Fire Stairwell near Classroom 216	Ceiling	Plaster	Tan	None	0	7.1	Positive
1	2	Classroom 217	Floor	Wood	N/A	N/A	0	N/A	N/A
1	2	Classroom 217	W1	Plaster	Blue	Flaking	2	25.1	Positive
1	2	Classroom 217	W2	Plaster	Tan	N/A	0	0	Negative
1	2	Classroom 217	W3	Plaster	Tan	None	0	30.9	Positive
1	2	Classroom 217	W4	Sheetrock	Tan	N/A	0	0	Negative
1	2	Classroom 217	Ceiling	Plaster	Tan	Flaking	10	31.7	Positive
1	2	Classroom 218	Floor	Wood	N/A	N/A	0	N/A	N/A
1	2	Classroom 218	W1	Plaster	Blue	None	0	23.3	Positive
1	2	Classroom 218	W2	Sheetrock	Tan	N/A	0	0	Negative
1	2	Classroom 218	W3	Plaster	Tan	None	0	3.6	Positive
1	2	Classroom 218	W4	Plaster	Tan	None	0	25.8	Positive
1	2	Classroom 218	Ceiling	Plaster	Tan	Flaking	5	26.6	Positive
1	2	Classroom 218	Radiator	Metal	Gray	None	0	1.5	Positive
1	2	Classroom 218	Riser	Metal	Tan	None	N/A	0.01	Negative
1	2	Classroom 218	Baseboard	Wood	Brown	None	N/A	0.15	Negative
1	2	Classroom 218	Door	Wood	Brown	None	N/A	0	Negative
1	2	Storage across from Classroom 218	Floor	N/A	N/A	N/A	0	N/A	N/A
1	2	Storage across from Classroom 218	W1	Plaster	Tan	N/A	0	0.01	Negative
1	2	Storage across from Classroom 218	W2	Plaster	Tan	N/A	0	0.04	Negative
1	2	Storage across from Classroom 218	W3	Plaster	Tan	N/A	0	0.01	Negative
1	2	Storage across from Classroom 218	W4	Plaster	Tan	N/A	0	0.01	Negative
1	2	Storage across from Classroom 218	Ceiling	Plaster	Tan	N/A	0	0	Negative
1	2	Classroom 219	Floor	Wood	N/A	N/A	0	N/A	N/A
1	2	Classroom 219	W1	Plaster	Blue	Flaking	2	21.6	Positive
1	2	Classroom 219	W2	Plaster	Tan	None	0	20.2	Positive
1	2	Classroom 219	W3	Plaster	Tan	None	0	4	Positive
1	2	Classroom 219	W4	Sheetrock	Tan	N/A	0	0.24	Negative
1	2	Classroom 219	Ceiling	Plaster	Tan	Flaking	20	25	Positive
1	2	Storage across from Classroom 219	Floor	Concrete	N/A	N/A	0	N/A	N/A
1	2	Storage across from Classroom 219	W1	Concrete	Tan	N/A	0	0	Negative
1	2	Storage across from Classroom 219	W2	Concrete	Tan	N/A	0	0	Negative
1	2	Storage across from Classroom 219	W3	Concrete	Tan	N/A	0	0	Negative
1	2	Storage across from Classroom 219	W4	Concrete	Tan	N/A	0	0	Negative
1	2	Storage across from Classroom 219	Ceiling	No Access	No Access	No Access	No Access	No Access	No Access
1	2	Classroom 220	Floor	Wood	N/A	N/A	0	N/A	N/A

		Dates: 11/21/2022-12/21/2023	Lead-Safe Certification Assessment Report						
		Michael A Martin Certification #006416	Theodore Roosevelt Elementary School						
		Inspection Company: Criterion Labs	430 Washington Ln, Philadelphia, PA 19144						
E l e m e n t	F l o o r	On-Site Room Name	Component	Substrate Material	Paint Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
1	2	Classroom 220	W1	Plaster	Blue	Flaking	2	26.6	Positive
1	2	Classroom 220	W2	Sheetrock	Tan	N/A	0	0.16	Negative
1	2	Classroom 220	W3	Plaster	Tan	None	0	23.1	Positive
1	2	Classroom 220	W4	Plaster	Tan	None	0	25.5	Positive
1	2	Classroom 220	Ceiling	Plaster	Tan	Flaking	5	19.3	Positive
1	2	Fire Stairwell next to Classroom 220	Floor	Concrete	Gray	N/A	0	0.01	Negative
1	2	Fire Stairwell next to Classroom 220	W1	Brick	Tan	None	0	13	Positive
1	2	Fire Stairwell next to Classroom 220	W2	Brick	Tan	None	0	13.5	Positive
1	2	Fire Stairwell next to Classroom 220	W3	Metal	Red	N/A	0	0	Negative
1	2	Fire Stairwell next to Classroom 220	W4	Brick	Tan	None	0	18.9	Positive
1	2	Fire Stairwell next to Classroom 220	Ceiling	Plaster	Tan	None	0	8.9	Positive
1	2	Classroom 201	Floor	Wood	N/A	N/A	0	N/A	N/A
1	2	Classroom 201	W1	Plaster	Blue	None	0	21	Positive
1	2	Classroom 201	W2	Plaster	Tan	None	0	21.2	Positive
1	2	Classroom 201	W3	Plaster	Tan	None	0	23.1	Positive
1	2	Classroom 201	W4	Plaster	Tan	N/A	0	0	Negative
1	2	Classroom 201	Ceiling	Plaster	Tan	Flaking	5	25	Positive
1	2	Classroom 202	Floor	Wood	N/A	N/A	0	N/A	N/A
1	2	Classroom 202	W1	Plaster	Blue	None	0	29	Positive
1	2	Classroom 202	W2	Plaster	Tan	None	0	8.5	Positive
1	2	Classroom 202	W3	Plaster	Tan	None	0	4.9	Positive
1	2	Classroom 202	W4	Plaster	Tan	None	0	25	Positive
1	2	Classroom 202	Ceiling	Plaster	Tan	Flaking	5	21.5	Positive
1	2	Lounge outside Men's Restroom next to Classroom 202	Floor	Tile	N/A	N/A	0	N/A	N/A
1	2	Lounge outside Men's Restroom next to Classroom 202	W1	Wooden Glass Wall Frame	N/A	N/A	0	N/A	N/A
1	2	Lounge outside Men's Restroom next to Classroom 202	W2	Plaster	Tan	N/A	0	0	Negative
1	2	Lounge outside Men's Restroom next to Classroom 202	W3	Plaster	Tan	None	0	27.4	Positive
1	2	Lounge outside Men's Restroom next to Classroom 202	W4	Plaster	Tan	Chipping	8	1.3	Positive
1	2	Lounge outside Men's Restroom next to Classroom 202	Ceiling	Plaster	Tan	Flaking	10	29.7	Positive
1	2	Men's Restroom next to Classroom 202	Floor	Tile	N/A	N/A	0	N/A	N/A
1	2	Men's Restroom next to Classroom 202	W1	Plaster	Tan	None	0	27.3	Positive

		Dates: 11/21/2022-12/21/2023	Lead-Safe Certification Assessment Report						
		Michael A Martin Certification #006416	Theodore Roosevelt Elementary School						
		Inspection Company: Criterion Labs	430 Washington Ln, Philadelphia, PA 19144						
E l e m e n t	F l o o r	On-Site Room Name	Component	Substrate Material	Paint Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
1	2	Men's Restroom next to Classroom 202	W2	Plaster	Tan	N/A	0	0	Negative
1	2	Men's Restroom next to Classroom 202	W3	Plaster	Tan	Chipping	2	24.7	Positive
1	2	Men's Restroom next to Classroom 202	W4	Plaster	Tan	None	0	23.9	Positive
1	2	Men's Restroom next to Classroom 202	Ceiling	Plaster	Tan	N/A	0	0	Negative
1	2	Women's Restroom next to Classroom 214	Window Casing	Wood	Tan	None	N/A	0.8	Negative
1	2	Women's Restroom next to Classroom 214	Radiator Cover	Metal	Tan	None	N/A	0	Negative
1	2	Women's Restroom next to Classroom 214	Riser	Metal	Gray	None	0	4	Positive
1	2	Hallway outside Classrooms 212-214	Floor	Concrete	Blue	None	0	1.4	Positive
1	2	Hallway outside Classrooms 212-214	W1	Plaster	Tan	None	0	20.6	Positive
1	2	Hallway outside Classrooms 212-214	W2	Plaster	Tan	None	0	21.6	Positive
1	2	Hallway outside Classrooms 212-214	W3	Plaster	Tan	None	0	19.7	Positive
1	2	Hallway outside Classrooms 212-214	W4	Plaster	Tan	None	0	17.9	Positive
1	2	Hallway outside Classrooms 212-214	Ceiling	Plaster	Tan	Flaking	30	17.6	Positive
1	2	Hallway outside Classrooms 215-202	Floor	Concrete	Blue	N/A	0	0.5	Negative
1	2	Hallway outside Classrooms 215-202	W1	Plaster	Gray	None	0	17.2	Positive
1	2	Hallway outside Classrooms 215-202	W2	Plaster	Gray	None	0	29.6	Positive
1	2	Hallway outside Classrooms 215-202	W3	Plaster	Gray	None	0	20.3	Positive
1	2	Hallway outside Classrooms 215-202	W4	Plaster	Gray	None	0	20.2	Positive
1	2	Hallway outside Classrooms 215-202	Ceiling	Plaster	Tan	Flaking	5	0.12	Negative
1	2	Stairwell across from Classroom 205	radiator	Metal	Gray	None	0	2.2	Positive
1	2	Stairwell across from Classroom 205	window casing	Metal	Brown	None	0	7.9	Positive
1	2	Stairwell across from Classroom 205	stair post	Wood	Brown	None	N/A	0.2	Negative
1	2	Stairwell across from Classroom 205	hand rail	Wood	Brown	None	N/A	0.02	Negative
1	2	Stairwell across from Classroom 205	stair stringer	Concrete	Grey	None	0	3.4	Positive
1	2	Stairwell across from Classroom 205	stair stringer	Concrete	Blue	None	0	3.7	Positive
1	2	Hallway outside Classrooms 203-205	Floor	Concrete	Blue	N/A	0	0.22	Negative
1	2	Hallway outside Classrooms 203-205	W1	Plaster	Tan	None	0	21.6	Positive
1	2	Hallway outside Classrooms 203-205	W2	Plaster	Tan	None	0	13.2	Positive
1	2	Hallway outside Classrooms 203-205	W3	Plaster	Tan	None	0	23.5	Positive
1	2	Hallway outside Classrooms 203-205	W4	Plaster	Tan	None	0	16.2	Positive
1	2	Hallway outside Classrooms 203-205	Ceiling	Plaster	Tan	N/A	0	0.2	Negative
1	2	Hallway outside Office 206 Suite to Main Office	Floor	Concrete	Tan	N/A	0	0.27	Negative
1	2	Hallway outside Office 206 Suite to Main Office	W1	Plaster	Tan	None	0	22.4	Positive
1	2	Hallway outside Office 206 Suite to Main Office	W2	Plaster	Tan	None	0	22.3	Positive
1	2	Hallway outside Office 206 Suite to Main Office	W3	Plaster	Tan	None	0	19.1	Positive
1	2	Hallway outside Office 206 Suite to Main Office	W4	Plaster	Tan	None	0	10.8	Positive

		Dates: 11/21/2022-12/21/2023	Lead-Safe Certification Assessment Report						
		Michael A Martin Certification #006416	Theodore Roosevelt Elementary School						
		Inspection Company: Criterion Labs	430 Washington Ln, Philadelphia, PA 19144						
E l e m e n t	F l o o r	On-Site Room Name	Component	Substrate Material	Paint Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
1	2	Hallway outside Office 206 Suite to Main Office	Ceiling	Plaster	Tan	Flaking	12	31.5	Positive
1	2	2nd Floor Marble Hallway	Floor	N/A	N/A	N/A	0	N/A	N/A
1	2	2nd Floor Marble Hallway	W1	Plaster	Tan	None	0	22.2	Positive
1	2	2nd Floor Marble Hallway	W2	Plaster	Tan	None	0	29.06	Positive
1	2	2nd Floor Marble Hallway	W3	Plaster	Tan	None	0	24.1	Positive
1	2	2nd Floor Marble Hallway	W4	Plaster	Tan	None	0	19.4	Positive
1	2	2nd Floor Marble Hallway	Ceiling	Plaster	Tan	None	0	25.6	Positive
1	2	Hallway outside Nurse's Office to Classroom 211	Floor	Concrete	Blue	N/A	0	0.03	Negative
1	2	Hallway outside Nurse's Office to Classroom 211	W1	Plaster	Tan	None	0	18.6	Positive
1	2	Hallway outside Nurse's Office to Classroom 211	W2	Plaster	Tan	None	0	23.6	Positive
1	2	Hallway outside Nurse's Office to Classroom 211	W3	Plaster	Tan	None	0	18.7	Positive
1	2	Hallway outside Nurse's Office to Classroom 211	W4	Plaster	Tan	None	0	22.7	Positive
1	2	Hallway outside Nurse's Office to Classroom 211	Ceiling	Plaster	Tan	Flaking	20	19.4	Positive
1	1	Cafeteria B	Floor	N/A	N/A	N/A	N/A	N/A	N/A
1	1	Cafeteria B	W1	Brick	White	N/A	0	0.14	Negative
1	1	Cafeteria B	W2	Brick	Grey	N/A	0	0.4	Negative
1	1	Cafeteria B	W3	Brick	White	N/A	0	0.08	Negative
1	1	Cafeteria B	W4	CMU	Green	N/A	0	0.04	Negative
1	1	Cafeteria B	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
1	1	Cafeteria B Ticket Booth	Floor	N/A	N/A	N/A	N/A	N/A	N/A
1	1	Cafeteria B Ticket Booth	W1	Brick	Tan	N/A	N/A	0.02	Negative
1	1	Cafeteria B Ticket Booth	W2	Brick	Tan	N/A	N/A	0.5	Negative
1	1	Cafeteria B Ticket Booth	W3	Brick	Tan	N/A	N/A	0.03	Negative
1	1	Cafeteria B Ticket Booth	W4	Brick	Tan	N/A	N/A	0.06	Negative
1	1	Cafeteria B Ticket Booth	Ceiling	Concrete	Tan	N/A	N/A	0.06	Negative
1	1	Cafeteria B Serving Area	Floor	Tile	N/A	N/A	N/A	N/A	N/A
1	1	Cafeteria B Serving Area	W1	Brick	Tan	N/A	N/A	0.5	Negative
1	1	Cafeteria B Serving Area	W2	Brick	Tan	N/A	N/A	0.15	Negative
1	1	Cafeteria B Serving Area	W3	Brick	Tan	N/A	N/A	0.3	Negative
1	1	Cafeteria B Serving Area	W4	CMU	Tan	N/A	N/A	0.02	Negative
1	1	Cafeteria B Serving Area	Ceiling	Tile	N/A	N/A	N/A	N/A	N/A
1	1	Kitchen	Floor	Tile	N/A	N/A	N/A	N/A	N/A
1	1	Kitchen	W1	Brick	Tan	N/A	N/A	0.3	Negative
1	1	Kitchen	W2	Brick	Tan	N/A	N/A	0.4	Negative
1	1	Kitchen	W3	Brick	Tan	N/A	N/A	0.3	Negative
1	1	Kitchen	W4	Brick	Tan	N/A	N/A	0.5	Negative

		Dates: 11/21/2022-12/21/2023	Lead-Safe Certification Assessment Report						
		Michael A Martin Certification #006416	Theodore Roosevelt Elementary School						
		Inspection Company: Criterion Labs	430 Washington Ln, Philadelphia, PA 19144						
E l e m e n t	F l o o r	On-Site Room Name	Component	Substrate Material	Paint Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
1	1	Kitchen	Ceiling	Concrete	Tan	None	0	7.9	Positive
1	1	Kitchen Refrigerator Room	Floor	Tile	N/A	N/A	N/A	N/A	N/A
1	1	Kitchen Refrigerator Room	W1	Brick	Tan	N/A	N/A	0.21	Negative
1	1	Kitchen Refrigerator Room	W2	Brick	Tan	N/A	N/A	0.3	Negative
1	1	Kitchen Refrigerator Room	W3	Brick	Tan	N/A	N/A	0.18	Negative
1	1	Kitchen Refrigerator Room	W4	Brick	Tan	N/A	N/A	0.18	Negative
1	1	Kitchen Refrigerator Room	Ceiling	Concrete	Tan	None	0	2.3	Positive
1	1	Small Kitchen Storage Room	Floor	Concrete	Gray	Flaking	10	0	Negative
1	1	Small Kitchen Storage Room	W1	Plaster	Tan	Flaking	4	0.04	Negative
1	1	Small Kitchen Storage Room	W2	CMU	Tan	N/A	N/A	0.25	Negative
1	1	Small Kitchen Storage Room	W3	Plaster	Tan	None	0	15.3	Positive
1	1	Small Kitchen Storage Room	W4	Plaster	Tan	N/A	N/A	0.4	Negative
1	1	Small Kitchen Storage Room	Ceiling	No Access	No Access	No Access	No Access	No Access	No Access
1	1	Large Kitchen Storage Room	Floor	Concrete	Red	N/A	N/A	0.14	Negative
1	1	Large Kitchen Storage Room	W1	Brick	Tan	N/A	N/A	0.12	Negative
1	1	Large Kitchen Storage Room	W2	Brick	Tan	N/A	N/A	0.26	Negative
1	1	Large Kitchen Storage Room	W3	Brick	Tan	N/A	N/A	0.3	Negative
1	1	Large Kitchen Storage Room	W4	Brick	Tan	N/A	N/A	0.6	Negative
1	1	Large Kitchen Storage Room	Ceiling	Plaster	Tan	None	0	8.6	Positive
1	1	Kitchen Office	Floor	Tile	N/A	N/A	N/A	N/A	N/A
1	1	Kitchen Office	W1	Plaster	Tan	None	0	14.2	Positive
1	1	Kitchen Office	W2	Plaster	Tan	None	0	13.3	Positive
1	1	Kitchen Office	W3	Plaster	Tan	None	0	14.7	Positive
1	1	Kitchen Office	W4	Plaster	Tan	None	0	16.7	Positive
1	1	Kitchen Office	Ceiling	Plaster	Tan	None	0	11.5	Positive
1	1	Kitchen Office	Drain Line	Metal	Tan	None	N/A	0.6	Negative
1	1	Kitchen Office	Riser	Metal	Gray	None	N/A	0.13	Negative
1	1	Kitchen Office	Radiator	Metal	Gray	None	N/A	0.05	Negative
1	1	Vestibule outside Kitchen Staff Locker Room	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
1	1	Vestibule outside Kitchen Staff Locker Room	W1	Brick	Tan	N/A	N/A	0.5	Negative
1	1	Vestibule outside Kitchen Staff Locker Room	W2	Brick	Tan	N/A	N/A	0.4	Negative
1	1	Vestibule outside Kitchen Staff Locker Room	W3	Brick	Tan	N/A	N/A	0.02	Negative
1	1	Vestibule outside Kitchen Staff Locker Room	W4	Brick	Tan	N/A	N/A	0.5	Negative
1	1	Vestibule outside Kitchen Staff Locker Room	Ceiling	Plaster	Tan	None	0	11.2	Positive
1	1	Vestibule outside Kitchen Staff Locker Room	Exit Door	Metal	Red	None	N/A	0	Negative
1	1	Vestibule outside Kitchen Staff Locker Room	Entrance Door	Wood	Brown	Flaking	5	0	Negative

		Dates: 11/21/2022-12/21/2023	Lead-Safe Certification Assessment Report						
		Michael A Martin Certification #006416	Theodore Roosevelt Elementary School						
		Inspection Company: Criterion Labs	430 Washington Ln, Philadelphia, PA 19144						
E l e m e n t	F l o o r	On-Site Room Name	Component	Substrate Material	Paint Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
1	1	Kitchen Staff Locker Room	Floor	Tile	N/A	N/A	N/A	N/A	N/A
1	1	Kitchen Staff Locker Room	W1	Plaster	Tan	N/A	N/A	0.04	Negative
1	1	Kitchen Staff Locker Room	W2	Plaster	Tan	N/A	N/A	18.5	Negative
1	1	Kitchen Staff Locker Room	W3	Plaster	Tan	None	0	16.7	Positive
1	1	Kitchen Staff Locker Room	W4	Plaster	Tan	None	0	19.9	Positive
1	1	Kitchen Staff Locker Room	Drain Line	Metal	Tan	None	N/A	0.3	Negative
1	1	Kitchen Staff Locker Room	Riser	Metal	Tan	None	0	8.8	Positive
1	1	Kitchen Staff Locker Room	Ceiling	Plaster	Tan	None	0	15.6	Positive
1	1	Cafeteria A Service Area	Floor	Tile	N/A	N/A	N/A	N/A	N/A
1	1	Cafeteria A Service Area	W1	Brick	Tan	N/A	N/A	0.24	Negative
1	1	Cafeteria A Service Area	W2	Brick	Tan	N/A	N/A	0.5	Negative
1	1	Cafeteria A Service Area	W3	CMU	Tan	N/A	N/A	0.02	Negative
1	1	Cafeteria A Service Area	W4	Brick	Tan	N/A	N/A	0.22	Negative
1	1	Cafeteria A Service Area	Ceiling	Spline	N/A	N/A	N/A	N/A	N/A
1	1	Cafeteria A	Floor	Tile	N/A	N/A	N/A	N/A	N/A
1	1	Cafeteria A	W1	Brick	White	N/A	N/A	0.5	Negative
1	1	Cafeteria A	W2	CMU	Blue	N/A	N/A	0.02	Negative
1	1	Cafeteria A	W3	Brick	White	N/A	N/A	0.28	Negative
1	1	Cafeteria A	W4	Brick	Gray	N/A	N/A	0.14	Negative
1	1	Cafeteria A	Ceiling	Spline	N/A	N/A	N/A	N/A	N/A
1	1	Cafeteria A Ticket Booth	Floor	Tile	N/A	N/A	N/A	N/A	N/A
1	1	Cafeteria A Ticket Booth	W1	Brick	Tan	N/A	N/A	0.05	Negative
1	1	Cafeteria A Ticket Booth	W2	Brick	Tan	N/A	N/A	0.4	Negative
1	1	Cafeteria A Ticket Booth	W3	Brick	Tan	N/A	N/A	0.24	Negative
1	1	Cafeteria A Ticket Booth	W4	Brick	Tan	N/A	N/A	0.4	Negative
1	1	Cafeteria A Ticket Booth	Ceiling	Concrete	Tan	N/A	N/A	0.07	Negative
1	1	Former Locker Room across from Cafeteria	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
1	1	Former Locker Room across from Cafeteria	W1	Brick	Tan	N/A	N/A	0.01	Negative
1	1	Former Locker Room across from Cafeteria	W2	Brick	Tan	N/A	N/A	0.07	Negative
1	1	Former Locker Room across from Cafeteria	W3	CMU	Blue	N/A	N/A	0.04	Negative
1	1	Former Locker Room across from Cafeteria	W4	Brick	Tan	N/A	N/A	0.04	Negative
1	1	Former Locker Room across from Cafeteria	Ceiling	Concrete	Tan	None	0	3.9	Positive
1	1	Former Locker Room across from Cafeteria Restroom	Floor	Tile	N/A	N/A	N/A	N/A	N/A
1	1	Former Locker Room across from Cafeteria	Radiator	Metal	Gray	None	N/A	0.1	Negative
1	1	Former Locker Room across from Cafeteria	Riser	Metal	Silver	None	N/A	0.01	Negative
1	1	Former Locker Room across from Cafeteria	Drain Line	Metal	Tan	None	N/A	0.4	Negative

		Dates: 11/21/2022-12/21/2023	Lead-Safe Certification Assessment Report						
		Michael A Martin Certification #006416	Theodore Roosevelt Elementary School						
		Inspection Company: Criterion Labs	430 Washington Ln, Philadelphia, PA 19144						
E l e m e n t	F l o o r	On-Site Room Name	Component	Substrate Material	Paint Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
1	1	Former Locker Room across from Cafeteria Restroom	W1	Brick	Tan	N/A	N/A	0.13	Negative
1	1	Former Locker Room across from Cafeteria Restroom	W2	Brick	Tan	N/A	N/A	0.21	Negative
1	1	Former Locker Room across from Cafeteria Restroom	W3	Brick	Tan	N/A	N/A	0.11	Negative
1	1	Former Locker Room across from Cafeteria Restroom	W4	CMU	Tan	N/A	N/A	0.15	Negative
1	1	Former Locker Room across from Cafeteria Restroom	Ceiling	Concrete	Tan	None	0	16.6	Positive
1	1	Office to Left of Exit to Parking Lot	Floor	Concrete	Brown	Flaking	15	20.6	Positive
1	1	Office to Left of Exit to Parking Lot	W1	Brick	Tan	Flaking	10	0.07	Negative
1	1	Office to Left of Exit to Parking Lot	W2	Brick	Tan	Flaking	10	0.02	Negative
1	1	Office to Left of Exit to Parking Lot	W3	Brick	Tan	Flaking	15	0.6	Negative
1	1	Office to Left of Exit to Parking Lot	W4	Brick	Tan	Flaking	10	0.04	Negative
1	1	Office to Left of Exit to Parking Lot	Ceiling	Concrete	Tan	None	0	5.3	Positive
1	1	Office to Left of Exit to Parking Lot Restroom	Floor	Concrete	Brown	N/A	N/A	0.07	Negative
1	1	Office to Left of Exit to Parking Lot Restroom	W1	Drywall	Tan	N/A	N/A	0	Negative
1	1	Office to Left of Exit to Parking Lot Restroom	W2	Brick	Tan	N/A	N/A	0.12	Negative
1	1	Office to Left of Exit to Parking Lot Restroom	W3	Brick	Tan	N/A	N/A	0.5	Negative
1	1	Office to Left of Exit to Parking Lot Restroom	W4	Brick	Tan	N/A	N/A	0.5	Negative
1	1	Office to Left of Exit to Parking Lot Restroom	Ceiling	Concrete	N/A	N/A	N/A	N/A	N/A
1	1	Hallway outside Cafeteria at Corner of Building near Parking Lot	Floor	Concrete	Blue	None	0	18.3	Positive
1	1	Hallway outside Cafeteria at Corner of Building near Parking Lot	W1	Plaster	Tan	None	0	21.3	Positive
1	1	Hallway outside Cafeteria at Corner of Building near Parking Lot	W2	Plaster	Tan	None	0	4.8	Positive
1	1	Hallway outside Cafeteria at Corner of Building near Parking Lot	W3	Plaster	Tan	None	0	30	Positive
1	1	Hallway outside Cafeteria at Corner of Building near Parking Lot	W4	Plaster	Tan	None	0	13.3	Positive
1	1	Hallway outside Cafeteria at Corner of Building near Parking Lot	Ceiling	Plaster	Tan	Chipping	12	17.9	Positive
1	1	Hallway to Rear entrance adjacent to Cafeteria at Corner of Building near Parking Lot	Floor	Concrete	Blue	N/A	N/A	0.12	Negative
1	1	Hallway to Rear entrance adjacent to Cafeteria at Corner of Building near Parking Lot	W1	Plaster	Tan	N/A	N/A	0.03	Negative
1	1	Hallway to Rear entrance adjacent to Cafeteria at Corner of Building near Parking Lot	W2	Plaster	Tan	None	0	18.2	Positive
1	1	Hallway to Rear entrance adjacent to Cafeteria at Corner of Building near Parking Lot	W3	Plaster	Tan	None	0	17.2	Positive

		Dates: 11/21/2022-12/21/2023	Lead-Safe Certification Assessment Report						
		Michael A Martin Certification #006416	Theodore Roosevelt Elementary School						
		Inspection Company: Criterion Labs	430 Washington Ln, Philadelphia, PA 19144						
E l e m e n t	F l o o r	On-Site Room Name	Component	Substrate Material	Paint Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
1	1	Hallway to Rear entrance adjacent to Cafeteria at Corner of Building near Parking Lot	W4	Plaster	Tan	None	0	22	Positive
1	1	Hallway to Rear entrance adjacent to Cafeteria at Corner of Building near Parking Lot	Ceiling	Plaster	Tan	None	0	24.1	Positive
1	1	Hallway outside Office to Left of Exit to Parking Lot	Floor	Concrete	Blue	N/A	N/A	0.17	Negative
1	1	Hallway outside Office to Left of Exit to Parking Lot	W1	Plaster	Tan	None	0	26.1	Positive
1	1	Hallway outside Office to Left of Exit to Parking Lot	W2	Plaster	Tan	None	0	26.4	Positive
1	1	Hallway outside Office to Left of Exit to Parking Lot	W3	Plaster	Tan	None	0	26.3	Positive
1	1	Hallway outside Office to Left of Exit to Parking Lot	W4	Plaster	Tan	None	0	25.4	Positive
1	1	Hallway outside Office to Left of Exit to Parking Lot	Ceiling	Plaster	Tan	Flaking	10	22.7	Positive
1	1	1st Floor Stairwell 1	Floor	Concrete	Blue	N/A	N/A	0	Negative
1	1	1st Floor Stairwell 1	W1	Glass Wall	Brown	None	0	6.6	Positive
1	1	1st Floor Stairwell 1	W2	Plaster	Tan	None	0	9.4	Positive
1	1	1st Floor Stairwell 1	W3	Plaster	Tan	None	0	19.4	Positive
1	1	1st Floor Stairwell 1	W4	Plaster	Tan	None	0	14.9	Positive
1	1	1st Floor Stairwell 1	Ceiling	Plaster	Tan	None	0	21.2	Positive
1	1	1st Floor Stairwell 1	Riser	Metal	Tan	None	0	9.2	Positive
1	1	1st Floor Stairwell 1 Closet	Floor	No Access	No Access	No Access	No Access	No Access	No Access
1	1	1st Floor Stairwell 1 Closet	W1	No Access	No Access	No Access	No Access	No Access	No Access
1	1	1st Floor Stairwell 1 Closet	W2	No Access	No Access	No Access	No Access	No Access	No Access
1	1	1st Floor Stairwell 1 Closet	W3	No Access	No Access	No Access	No Access	No Access	No Access
1	1	1st Floor Stairwell 1 Closet	W4	No Access	No Access	No Access	No Access	No Access	No Access
1	1	1st Floor Stairwell 1 Closet	Ceiling	No Access	No Access	No Access	No Access	No Access	No Access
1	2	Classroom 214	radiator	Metal	Gray	None	0	1.9	Positive
1	2	Classroom 214	riser	Metal	Tan	None	0	13.2	Positive
1	2	Classroom 214	door	Wood	Brown	None	N/A	0	Negative
1	1	Closet between Stairwell 1 and Custodial Closet	Floor	Concrete	Gray	N/A	N/A	0.04	Negative
1	1	Closet between Stairwell 1 and Custodial Closet	W1	Tile	N/A	N/A	N/A	N/A	N/A
1	1	Closet between Stairwell 1 and Custodial Closet	W2	Plaster	Tan	None	0	1.5	Positive
1	1	Closet between Stairwell 1 and Custodial Closet	W3	Plaster	Tan	N/A	N/A	0	Negative
1	1	Closet between Stairwell 1 and Custodial Closet	W4	Plaster	Tan	None	0	6.3	Positive
1	1	Closet between Stairwell 1 and Custodial Closet	Ceiling	No Access	No Access	No Access	No Access	No Access	No Access
1	1	Custodial Closet across from Classroom 110	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
1	1	Custodial Closet across from Classroom 110	W1	Plaster	Tan	None	0	6.9	Positive
1	1	Custodial Closet across from Classroom 110	W2	Plaster	Tan	None	0	12.8	Positive
1	1	Custodial Closet across from Classroom 110	W3	Plaster	Tan	None	0	10.1	Positive

		Dates: 11/21/2022-12/21/2023	Lead-Safe Certification Assessment Report						
		Michael A Martin Certification #006416	Theodore Roosevelt Elementary School						
		Inspection Company: Criterion Labs	430 Washington Ln, Philadelphia, PA 19144						
E l e m e n t	F l o o r	On-Site Room Name	Component	Substrate Material	Paint Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
1	1	Custodial Closet across from Classroom 110	W4	Plaster	Tan	None	0	9.9	Positive
1	1	Custodial Closet across from Classroom 110	Ceiling	Plaster	Tan	Flaking	2	15.9	Positive
1	1	Custodial Closet across from Classroom 110	Drain Line	Metal	Tan	None	N/A	0.05	Negative
1	1	Custodial Closet across from Classroom 110	Riser Cover	Metal	Tan	None	N/A	0.04	Negative
1	1	Classroom 110	Floor	Tile	N/A	N/A	N/A	N/A	N/A
1	1	Classroom 110	W1	Plaster	Gray	Flaking	2	0.02	Negative
1	1	Classroom 110	W2	Plaster	Orange	Flaking	1	10.8	Positive
1	1	Classroom 110	W3	Plaster	Gray	Flaking	3	28.8	Positive
1	1	Classroom 110	W4	Plaster	Gray	None	0	17.3	Positive
1	1	Classroom 110	Ceiling	Plaster	Tan	Flaking	8	22.5	Positive
1	1	Classroom 110	Baseboard	Wood	Gray	None	N/A	0.07	Negative
1	1	Classroom 110	Radiator	Metal	Gray	none	N/A	0.17	Negative
1	1	Classroom 110	Window Casing	Wood	Gray	None	0	5.9	Positive
1	1	Classroom 110	Window Apron	Wood	Gray	None	N/A	0.04	Negative
1	1	Classroom 110	Door Casing	Wood	Gray	None	0	4.3	Positive
1	1	Classroom 110 Restroom	Floor	Concrete	Blue	Flaking	2	0.01	Negative
1	1	Classroom 110 Restroom	W1	Plaster	Tan	None	0	19.5	Positive
1	1	Classroom 110 Restroom	W2	Plaster	Tan	None	0	18.6	Positive
1	1	Classroom 110 Restroom	W3	Plaster	Tan	None	0	3.5	Positive
1	1	Classroom 110 Restroom	W4	Plaster	Tan	None	0	4.6	Positive
1	1	Classroom 110 Restroom	Ceiling	Plaster	Tan	Chipping	5	12.5	Positive
1	1	Classroom 109	Floor	Concrete	Gray	N/A	N/A	0.4	Negative
1	1	Classroom 109	W1	Brick	White	N/A	N/A	0.05	Negative
1	1	Classroom 109	W2	Brick	White	N/A	N/A	0.23	Negative
1	1	Classroom 109	W3	Brick	White	Moisture Damage	75	0.86	Negative
1	1	Classroom 109	W4	Brick	Orange	N/A	N/A	0.05	Negative
1	1	Classroom 109	Ceiling	Plaster	Tan	Chipping	25	7.5	Positive
1	1	Girl's Restroom next to Classroom 109	Floor	Concrete	Gray	N/A	N/A	0.01	Negative
1	1	Girl's Restroom next to Classroom 109	W1	Plaster	Tan	None	0	17.07	Positive
1	1	Girl's Restroom next to Classroom 109	W2	Plaster	Tan	None	0	15.1	Positive
1	1	Girl's Restroom next to Classroom 109	W3	Plaster	Tan	Moisture Damage	10	20.5	Positive
1	1	Girl's Restroom next to Classroom 109	W4	Plaster	Tan	None	0	18.8	Positive
1	1	Girl's Restroom next to Classroom 109	Ceiling	Plaster	Tan	None	0	21.8	Positive
1	1	Classroom 108	Floor	Concrete	Gray	N/a	N/A	0.05	Negative
1	1	Classroom 108	W1	Plaster	Gray	None	0	25.1	Positive
1	1	Classroom 108	W2	Plaster	Orange	N/A	N/A	0	Negative

		Dates: 11/21/2022-12/21/2023	Lead-Safe Certification Assessment Report						
		Michael A Martin Certification #006416	Theodore Roosevelt Elementary School						
		Inspection Company: Criterion Labs	430 Washington Ln, Philadelphia, PA 19144						
E l e m e n t	F l o o r	On-Site Room Name	Component	Substrate Material	Paint Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
1	1	Classroom 108	W3	Plaster	Gray	None	0	33.7	Positive
1	1	Classroom 108	W4	Plaster	Gray	None	0	24.9	Positive
1	1	Classroom 108	Ceiling	Plaster	Tan	Flaking	5	21.3	Positive
1	1	Classroom 108	Radiator	Metal	Gray	None	N/A	0.04	Negative
1	1	Classroom 108 Closet	Floor	Concrete	Gray	None	0	6.8	Positive
1	1	Classroom 108 Closet	W1	Plaster	Tan	None	0	20.1	Positive
1	1	Classroom 108 Closet	W2	Plaster	Tan	N/A	N/A	0	Negative
1	1	Classroom 108 Closet	W3	Plaster	Tan	None	0	13.9	Positive
1	1	Classroom 108 Closet	W4	Plaster	Tan	None	0	15.7	Positive
1	1	Classroom 108 Closet	Ceiling	No Access	No Access	No Access	No Access	No Access	No Access
1	1	Stairwell across from Classroom 108	Floor	Concrete	Blue	N/A	N/A	0.01	Negative
1	1	Stairwell across from Classroom 108	W1	Wood	Brown	None	0	11.3	Positive
1	1	Stairwell across from Classroom 108	W2	Plaster	Tan	None	0	20	Positive
1	1	Stairwell across from Classroom 108	W3	Plaster	Tan	None	0	18.3	Positive
1	1	Stairwell across from Classroom 108	W4	Plaster	Tan	None	0	18.6	Positive
1	1	Stairwell across from Classroom 108	Ceiling	Plaster	Tan	None	0	22.1	Positive
1	1	Stairwell across from Classroom 108	Stringer	Metal	Gray	None	N/A	2.3	Positive
1	1	Stairwell across from Classroom 108	Drain Line	Metal	Tan	None	N/A	10	Positive
1	1	Stairwell across from Classroom 108	Stair Post	Metal	Brown	None	N/A	0.2	Negative
1	1	Stairwell across from Classroom 108 Crawlspace	Floor	No Access	No Access	No Access	No Access	No Access	No Access
1	1	Stairwell across from Classroom 108 Crawlspace	W1	No Access	No Access	No Access	No Access	No Access	No Access
1	1	Stairwell across from Classroom 108 Crawlspace	W2	No Access	No Access	No Access	No Access	No Access	No Access
1	1	Stairwell across from Classroom 108 Crawlspace	W3	No Access	No Access	No Access	No Access	No Access	No Access
1	1	Stairwell across from Classroom 108 Crawlspace	W4	No Access	No Access	No Access	No Access	No Access	No Access
1	1	Stairwell across from Classroom 108 Crawlspace	Ceiling	No Access	No Access	No Access	No Access	No Access	No Access
1	1	Classroom 110 Restroom	Riser	Metal	Brown	None	N/A	0.04	Negative
1	1	Classroom 110 Restroom	Radiator	Metal	Gray	None	N/A	0.24	Negative
1	1	Classroom 110 Restroom	Riser	Metal	Silver	None	N/A	4.4	Positive
1	1	Hallway outside Classrooms 108-110	Floor	Concrete	Blue	N/A	N/A	0.19	Negative
1	1	Hallway outside Classrooms 108-110	W1	Plaster	Gray	None	0	20	Positive
1	1	Hallway outside Classrooms 108-110	W2	Plaster	Gray	None	0	20.7	Positive
1	1	Hallway outside Classrooms 108-110	W3	Plaster	Gray	None	0	24.4	Positive
1	1	Hallway outside Classrooms 108-110	W4	Plaster	Gray	None	0	28.6	Positive
1	1	Hallway outside Classrooms 108-110	Ceiling	Plaster	Tan	Chipping	25	7.4	Positive
1	1	Classroom to Right of Classroom 107	Floor	Concrete	Gray	Flaking	10	1.2	Positive
1	1	Classroom to Right of Classroom 107	W1	Plaster	Blue	N/A	N/A	0.04	Negative

		Dates: 11/21/2022-12/21/2023	Lead-Safe Certification Assessment Report						
		Michael A Martin Certification #006416	Theodore Roosevelt Elementary School						
		Inspection Company: Criterion Labs	430 Washington Ln, Philadelphia, PA 19144						
E l e m e n t	F l o o r	On-Site Room Name	Component	Substrate Material	Paint Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
1	1	Classroom to Right of Classroom 107	W2	Plaster	Tan	N/A	N/A	0.02	Negative
1	1	Classroom to Right of Classroom 107	W3	Plaster	Tan	Moisture Damage	25	21.1	Positive
1	1	Classroom to Right of Classroom 107	W4	Plaster	Tan	Moisture Damage	30	0.01	Negative
1	1	Classroom to Right of Classroom 107	Ceiling	Plaster	Tan	Flaking	15	13.7	Positive
1	1	Hallway outside Classroom to Right of Classroom 107	Floor	Concrete	Blue	N/A	N/A	0.08	Negative
1	1	Hallway outside Classroom to Right of Classroom 107	W1	Plaster	Gray	None	0	5.1	Positive
1	1	Hallway outside Classroom to Right of Classroom 107	W2	Plaster	Gray	None	0	18.3	Positive
1	1	Hallway outside Classroom to Right of Classroom 107	W3	Plaster	Gray	None	0	20.5	Positive
1	1	Hallway outside Classroom to Right of Classroom 107	W4	Plaster	Gray	None	0	14.2	Positive
1	1	Hallway outside Classroom to Right of Classroom 107	Ceiling	Plaster	Tan	Chipping	25	17.5	Positive
1	1	Classroom 107	Floor	Concrete	Gray	None	0	27.9	Positive
1	1	Classroom 107	W1	Plaster	Gray	None	0	23.7	Positive
1	1	Classroom 107	W2	Plaster	Gray	None	0	30.1	Positive
1	1	Classroom 107	W3	Plaster	Gray	None	0	22.7	Positive
1	1	Classroom 107	W4	Plaster	Gray	None	0	29.5	Positive
1	1	Classroom 107	Ceiling	Plaster	Tan	None	0	23.4	Positive
1	1	Classroom 107 Closet	Floor	Tile	N/A	N/A	N/A	N/A	N/A
1	1	Classroom 107 Closet	W1	Plaster	White	None	0	13.1	Positive
1	1	Classroom 107 Closet	W2	Plaster	White	None	0	0.4	Positive
1	1	Classroom 107 Closet	W3	Drywall	White	N/A	N/A	0.7	Negative
1	1	Classroom 107 Closet	W4	Plaster	White	N/A	N/A	14.4	Negative
1	1	Classroom 107 Closet	Ceiling	No Access	No Access	No Access	No Access	No Access	No Access
1	1	Classroom/Office 106	Floor	Concrete	Gray	N/A	N/A	0.23	Negative
1	1	Classroom/Office 106	W1	Plaster	Gray	None	0	31.3	Positive
1	1	Classroom/Office 106	W2	Plaster	Blue	N/A	N/A	0	Negative
1	1	Classroom/Office 106	W3	Plaster	Gray	N/A	N/A	0.01	Negative
1	1	Classroom/Office 106	W4	Plaster	Gray	None	0	23.6	Positive
1	1	Classroom/Office 106	Ceiling	Plaster	Tan	None	0	20.1	Positive
1	1	Classroom/Office 106 Closet	Floor	Tile	N/A	N/A	N/A	N/A	N/A
1	1	Classroom/Office 106 Closet	W1	Plaster	Gray	None	0	13	Positive
1	1	Classroom/Office 106 Closet	W2	Plaster	Gray	None	0	13.9	Positive
1	1	Classroom/Office 106 Closet	W3	Plaster	Gray	N/A	N/A	0	Negative
1	1	Classroom/Office 106 Closet	W4	Plaster	Gray	None	0	15.7	Positive
1	1	Classroom/Office 106 Closet	Ceiling	Plaster	Tan	None	0	22.5	Positive
1	1	Stairs to IMC on Classroom Side	Floor	Tile	N/A	N/A	N/A	0.23	Negative
1	1	Stairs to IMC on Classroom Side	W1	Brick	Tan	N/A	N/A	0.23	Negative

		Dates: 11/21/2022-12/21/2023	Lead-Safe Certification Assessment Report						
		Michael A Martin Certification #006416	Theodore Roosevelt Elementary School						
		Inspection Company: Criterion Labs	430 Washington Ln, Philadelphia, PA 19144						
E l e m e n t	F l o o r	On-Site Room Name	Component	Substrate Material	Paint Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
1	1	Stairs to IMC on Classroom Side	W2	Drywall	Tan	N/A	N/A	0.19	Negative
1	1	Stairs to IMC on Classroom Side	W3	Drywall	Tan	N/A	N/A	0.06	Negative
1	1	Stairs to IMC on Classroom Side	W4	Brick	Tan	N/A	N/A	0.3	Negative
1	1	Stairs to IMC on Classroom Side	Ceiling	Concrete	Tan	None	0	2.2	Positive
1	1	IMC	Floor	Tile	N/A	N/A	N/A	0.4	Negative
1	1	IMC	W1	Brick	Tan	Moisture Damage	30	0.09	Negative
1	1	IMC	W2	CMU	Tan	N/A	N/A	0.13	Negative
1	1	IMC	W3	Brick	Tan	N/A	N/A	0.01	Negative
1	1	IMC	W4	Brick	Tan	N/A	N/A	0.24	Negative
1	1	IMC	Ceiling	No Access	No Access	No Access	No Access	No Access	No Access
1	1	IMC Left Storage Room	Floor	Tile	N/A	N/A	N/A	N/A	N/A
1	1	IMC Left Storage Room	W1	CMU	Tan	N/A	N/A	0.03	Negative
1	1	IMC Left Storage Room	W2	CMU	Tan	N/A	N/A	0.08	Negative
1	1	IMC Left Storage Room	W3	CMU	Tan	N/A	N/A	0.16	Negative
1	1	IMC Left Storage Room	W4	Brick	Tan	N/A	N/A	0.05	Negative
1	1	IMC Left Storage Room	Ceiling	Concrete	Tan	N/A	N/A	0.17	Negative
1	1	IMC Center Storage Room	Floor	Tile	N/A	N/A	N/A	N/A	N/A
1	1	IMC Center Storage Room	W1	CMU	Tan	N/A	N/A	0.1	Negative
1	1	IMC Center Storage Room	W2	CMU	Tan	N/A	N/A	0.06	Negative
1	1	IMC Center Storage Room	W3	Plaster	Tan	N/A	N/A	0.09	Negative
1	1	IMC Center Storage Room	W4	Plaster	Tan	None	0	24.04	Positive
1	1	IMC Center Storage Room	Ceiling	Concrete	Tan	None	0	3.2	Positive
1	1	IMC Right Storage Room #####	Floor	Tile	N/A	N/A	N/A	N/A	N/A
1	1	IMC Right Storage Room	W1	Brick	Tan	N/A	N/A	0.1	Negative
1	1	IMC Right Storage Room	W2	Brick	Tan	N/A	N/A	0.11	Negative
1	1	IMC Right Storage Room	W3	Brick	Tan	N/A	N/A	0.37	Negative
1	1	IMC Right Storage Room	W4	Brick	Tan	N/A	N/A	0.2	Negative
1	1	IMC Right Storage Room	Ceiling	Concrete	Tan	N/A	N/A	0.09	Negative
1	1	IMC Storage with Elevator	Floor	Tile	N/A	N/A	N/A	N/A	N/A
1	1	IMC Storage with Elevator	W1	CMU	Tan	N/A	N/A	0.12	Negative
1	1	IMC Storage with Elevator	W2	Brick	Tan	N/A	N/A	0.06	Negative
1	1	IMC Storage with Elevator	W3	Brick	Tan	N/A	N/A	0.11	Negative
1	1	IMC Storage with Elevator	W4	Brick	Tan	N/A	N/A	0.06	Negative
1	1	IMC Storage with Elevator	Ceiling	No Access	No Access	No Access	No Access	No Access	No Access
1	1	IMC Hallway to Kitchen	Floor	Tile	N/A	N/A	N/A	N/A	N/A
1	1	IMC Hallway to Kitchen	W1	CMU	Tan	N/A	N/A	0.18	Negative

		Dates: 11/21/2022-12/21/2023	Lead-Safe Certification Assessment Report						
		Michael A Martin Certification #006416	Theodore Roosevelt Elementary School						
		Inspection Company: Criterion Labs	430 Washington Ln, Philadelphia, PA 19144						
E l e m e n t	F l o o r	On-Site Room Name	Component	Substrate Material	Paint Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
1	1	IMC Hallway to Kitchen	W2	CMU	Tan	N/A	N/A	0.09	Negative
1	1	IMC Hallway to Kitchen	W3	CMU	Tan	N/A	N/A	0.1	Negative
1	1	IMC Hallway to Kitchen	W4	CMU	Tan	N/A	N/A	0.05	Negative
1	1	IMC Hallway to Kitchen	Ceiling	Concrete	Tan	N/A	N/A	0.11	Negative
1	1	Library Office	Floor	Tile	N/A	N/A	N/A	N/A	N/A
1	1	Library Office	W1	Brick	Tan	N/A	N/A	0	Negative
1	1	Library Office	W2	Brick	Tan	N/A	N/A	0.1	Negative
1	1	Library Office	W3	Brick	Tan	N/A	N/A	0.02	Negative
1	1	Library Office	W4	Brick	Tan	N/A	N/A	0.02	Negative
1	1	Library Office	Ceiling	Concrete	Tan	N/A	N/A	0	Negative
1	1	Library Office Closet	Floor	N/A	N/A	N/A	N/A	N/A	N/A
1	1	Library Office Closet	W1	N/A	N/A	N/A	N/A	N/A	N/A
1	1	Library Office Closet	W2	N/A	N/A	N/A	N/A	N/A	N/A
1	1	Library Office Closet	W3	N/A	N/A	N/A	N/A	N/A	N/A
1	1	Library Office Closet	W4	N/A	N/A	N/A	N/A	N/A	N/A
1	1	Library Office Closet	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
1	1	IMC Kitchen	Floor	Tile	N/A	N/A	N/A	N/A	N/A
1	1	IMC Kitchen	W1	CMU	Tan	N/A	N/A	0.07	Negative
1	1	IMC Kitchen	W2	Brick	Tan	N/A	N/A	0.12	Negative
1	1	IMC Kitchen	W3	Brick	Tan	N/A	N/A	0.11	Negative
1	1	IMC Kitchen	W4	CMU	Tan	N/A	N/A	0.09	Negative
1	1	IMC Kitchen	Ceiling	No Access	No Access	No Access	No Access	No Access	No Access
1	1	IMC Kitchen Closet	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
1	1	IMC Kitchen Closet	W1	Brick	White	N/A	N/A	0.01	Negative
1	1	IMC Kitchen Closet	W2	Brick	White	N/A	N/A	0.01	Negative
1	1	IMC Kitchen Closet	W3	Brick	White	N/A	N/A	0.02	Negative
1	1	IMC Kitchen Closet	W4	Brick	White	N/A	N/A	0.02	Negative
1	1	IMC Kitchen Closet	Ceiling	Concrete	White	N/A	N/A	0.01	Negative
1	1	Stairwell to IMC across from Cafeteria	Floor	Tile	N/A	N/A	N/A	N/A	N/A
1	1	Stairwell to IMC across from Cafeteria	W1	Brick	Tan	N/A	N/A	0.22	Negative
1	1	Stairwell to IMC across from Cafeteria	W2	Brick	Tan	N/A	N/A	0.116	Negative
1	1	Stairwell to IMC across from Cafeteria	W3	Brick	Tan	N/A	N/A	0.07	Negative
1	1	Stairwell to IMC across from Cafeteria	W4	Brick	Tan	N/A	N/A	0.12	Negative
1	1	Stairwell to IMC across from Cafeteria	Ceiling	Plaster	Tan	N/A	N/A	0	Negative
1	1	Stairwell to IMC across from Cafeteria Storage Room	Floor	Concrete	Blue	N/A	N/A	0.5	Negative
1	1	Stairwell to IMC across from Cafeteria Storage Room	W1	Plaster	Tan	None	0	20.1	Positive

		Dates: 11/21/2022-12/21/2023	Lead-Safe Certification Assessment Report						
		Michael A Martin Certification #006416	Theodore Roosevelt Elementary School						
		Inspection Company: Criterion Labs	430 Washington Ln, Philadelphia, PA 19144						
E l e m e n t	F l o o r	On-Site Room Name	Component	Substrate Material	Paint Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
1	1	Stairwell to IMC across from Cafeteria Storage Room	W2	Plaster	Tan	None	0	16.1	Positive
1	1	Stairwell to IMC across from Cafeteria Storage Room	W3	Plaster	Tan	None	0	18.4	Positive
1	1	Stairwell to IMC across from Cafeteria Storage Room	W4	Plaster	Tan	None	0	19.7	Positive
1	1	Stairwell to IMC across from Cafeteria Storage Room	Ceiling	Concrete	N/A	N/A	N/A	N/A	N/A
1	1	Stairwell to IMC across from Cafeteria Vestibule	Floor	Concrete	N/A	N/A	N/A	0.7	Negative
1	1	Stairwell to IMC across from Cafeteria Vestibule	W1	Brick	Tan	N/A	N/A	0.1	Negative
1	1	Stairwell to IMC across from Cafeteria Vestibule	W2	Brick	Tan	N/A	N/A	0	Negative
1	1	Stairwell to IMC across from Cafeteria Vestibule	W3	Brick	Tan	N/A	N/A	0.4	Negative
1	1	Stairwell to IMC across from Cafeteria Vestibule	W4	Brick	Tan	N/A	N/A	0.2	Negative
1	1	Stairwell to IMC across from Cafeteria Vestibule	Ceiling	Concrete	Tan	N/A	N/A	0	Negative
1	1	Stairwell to IMC across from Cafeteria Storage Room to Left of Entrance to Stairwell 1	Floor	N/A	N/A	N/A	N/A	N/A	N/A
1	1	Stairwell to IMC across from Cafeteria Storage Room to Left of Entrance to Stairwell 1	W1	N/A	N/A	N/A	N/A	N/A	N/A
1	1	Stairwell to IMC across from Cafeteria Storage Room to Left of Entrance to Stairwell 1	W2	N/A	N/A	N/A	N/A	N/A	N/A
1	1	Stairwell to IMC across from Cafeteria Storage Room to Left of Entrance to Stairwell 1	W3	N/A	N/A	N/A	N/A	N/A	N/A
1	1	Stairwell to IMC across from Cafeteria Storage Room to Left of Entrance to Stairwell 1	W4	N/A	N/A	N/A	N/A	N/A	N/A
1	1	Stairwell to IMC across from Cafeteria Storage Room to Left of Entrance to Stairwell 1	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
1	1	Stairwell to IMC across from Cafeteria Storage Room to Right of Entrance to Stairwell 1	Floor	N/A	N/A	N/A	N/A	N/A	N/A
1	1	Stairwell to IMC across from Cafeteria Storage Room to Right of Entrance to Stairwell 1	W1	N/A	N/A	N/A	N/A	N/A	N/A
1	1	Stairwell to IMC across from Cafeteria Storage Room to Right of Entrance to Stairwell 1	W2	N/A	N/A	N/A	N/A	N/A	N/A
1	1	Stairwell to IMC across from Cafeteria Storage Room to Right of Entrance to Stairwell 1	W3	N/A	N/A	N/A	N/A	N/A	N/A
1	1	Stairwell to IMC across from Cafeteria Storage Room to Right of Entrance to Stairwell 1	W4	N/A	N/A	N/A	N/A	N/A	N/A
1	1	Stairwell to IMC across from Cafeteria Storage Room to Right of Entrance to Stairwell 1	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
1	1	Classroom 105	Floor	Concrete	Gray	None	0	0.05	Negative
1	1	Classroom 105	W1	Plaster	White	None	0	19.4	Positive
1	1	Classroom 105	W2	Plaster	White	None	0	8.2	Positive
1	1	Classroom 105	W3	Plaster	White	None	0	19.8	Positive

		Dates: 11/21/2022-12/21/2023	Lead-Safe Certification Assessment Report						
		Michael A Martin Certification #006416	Theodore Roosevelt Elementary School						
		Inspection Company: Criterion Labs	430 Washington Ln, Philadelphia, PA 19144						
E l e m e n t	F l o o r	On-Site Room Name	Component	Substrate Material	Paint Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
1	1	Classroom 105	W4	Plaster	Orange	Flaking	1	0	Negative
1	1	Classroom 105	Ceiling	Plaster	Tan	Chipping	20	8.8	Positive
1	1	Classroom 105 Coat Closet	Floor	Concrete	Gray	None	0	0	Negative
1	1	Classroom 105 Coat Closet	W1	Plaster	Gray	None	0	15	Positive
1	1	Classroom 105 Coat Closet	W2	Drywall	Gray	None	0	0	Negative
1	1	Classroom 105 Coat Closet	W3	Plaster	Gray	None	0	13.4	Positive
1	1	Classroom 105 Coat Closet	W4	Plaster	Gray	None	0	0	Negative
1	1	Classroom 105 Coat Closet	Ceiling	Plaster	Tan	None	0	16.2	Positive
1	1	Classroom 105 Coat Closet Storage Closet	Floor	Concrete	Gray	None	0	0	Negative
1	1	Classroom 105 Coat Closet Storage Closet	W1	Drywall	Gray	None	0	0	Negative
1	1	Classroom 105 Coat Closet Storage Closet	W2	Plaster	Gray	None	0	0	Negative
1	1	Classroom 105 Coat Closet Storage Closet	W3	Plaster	Gray	None	0	13.8	Positive
1	1	Classroom 105 Coat Closet Storage Closet	W4	Plaster	Gray	None	0	0	Positive
1	1	Classroom 105 Coat Closet Storage Closet	Ceiling	Plaster	Tan	None	0	15.8	Positive
1	1	Hallway outside Classrooms 105-107	Floor	Concrete	Blue	None	0	0.24	Negative
1	1	Hallway outside Classrooms 105-107	W1	Plaster	Gray	None	0	23.4	Positive
1	1	Hallway outside Classrooms 105-107	W2	Plaster	Gray	None	0	24.8	Positive
1	1	Hallway outside Classrooms 105-107	W3	Plaster	Gray	None	0	29.1	Positive
1	1	Hallway outside Classrooms 105-107	W4	Plaster	Gray	None	0	28.18	Positive
1	1	Hallway outside Classrooms 105-107	Ceiling	Plaster	Gray	None	0	20.2	Positive
1	1	Hallway Corridor at IMC side of Auditorium	Floor	Tile	N/A	N/A	N/A	N/A	N/A
1	1	Hallway Corridor at IMC side of Auditorium	W1	Plaster	Tan	None	0	20.3	Positive
1	1	Hallway Corridor at IMC side of Auditorium	W2	Plaster	Tan	Moisture Damage	100	0	Negative
1	1	Hallway Corridor at IMC side of Auditorium	W3	Plaster	Tan	None	0	21.17	Positive
1	1	Hallway Corridor at IMC side of Auditorium	W4	Plaster	Tan	None	0	21.6	Positive
1	1	Hallway Corridor at IMC side of Auditorium	Ceiling	Plaster	White	Moisture Damage	7	16.2	Positive
1	1	Auditorium	Floor	Wood	N/A	N/A	N/A	N/A	N/A
1	1	Auditorium	W1	Plaster	Tan	None	0	11	Positive
1	1	Auditorium	W2	Plaster	Tan	N/A	N/A	0	Negative
1	1	Auditorium	W3	Plaster	Tan	None	0	17.5	Positive
1	1	Auditorium	W4	Plaster	Tan	None	0	17.4	Positive
1	1	Auditorium	Ceiling	Plaster	White	None	0	10.4	Positive
1	1	Auditorium Stage	Floor	Wood	N/A	N/A	N/A	N/A	N/A
1	1	Auditorium Stage	W1	Plaster	Black	N/A	N/A	0	Negative
1	1	Auditorium Stage	W2	Plaster	Black	N/A	N/A	0	Negative
1	1	Auditorium Stage	W3	Plaster	Black	Flaking	3	11.6	Positive

		Dates: 11/21/2022-12/21/2023	Lead-Safe Certification Assessment Report						
		Michael A Martin Certification #006416	Theodore Roosevelt Elementary School						
		Inspection Company: Criterion Labs	430 Washington Ln, Philadelphia, PA 19144						
E l e m e n t	F l o o r	On-Site Room Name	Component	Substrate Material	Paint Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
1	1	Auditorium Stage	W4	Plaster	Black	None	0	16.8	Positive
1	1	Auditorium Stage	Ceiling	No Access	No Access	No Access	No Access	No Access	No Access
1	1	Storage to Left of Auditorium	Floor	Wood	N/A	N/A	N/A	N/A	N/A
1	1	Storage to Left of Auditorium	W1	Plaster	Tan	None	0	2.5	Positive
1	1	Storage to Left of Auditorium	W2	Plaster	Tan	None	0	2.4	Positive
1	1	Storage to Left of Auditorium	W3	Plaster	Tan	None	0	11.2	Positive
1	1	Storage to Left of Auditorium	W4	Plaster	Tan	None	0	16.2	Positive
1	1	Storage to Left of Auditorium	Ceiling	Plaster	Tan	N/A	N/A	0.16	Negative
1	1	Storage to To Right of Auditorium	Floor	Wood	N/A	N/A	N/A	N/A	N/A
1	1	Storage to To Right of Auditorium	W1	Plaster	Tan	None	0	9.8	Positive
1	1	Storage to To Right of Auditorium	W2	Plaster	Tan	None	0	9.4	Positive
1	1	Storage to To Right of Auditorium	W3	Plaster	Tan	None	0	11.5	Positive
1	1	Storage to To Right of Auditorium	W4	Plaster	Tan	None	0	10.7	Positive
1	1	Storage to To Right of Auditorium	Ceiling	Plaster	Tan	N/A	N/A	0	Negative
1	1	Hallway Corridor at Left side of Auditorium	Floor	Tile	N/A	N/A	N/A	N/A	N/A
1	1	Hallway Corridor at Left side of Auditorium	W1	Plaster	Tan	None	0	10.2	Positive
1	1	Hallway Corridor at Left side of Auditorium	W2	Plaster	Tan	Cracking	8	19.3	Positive
1	1	Hallway Corridor at Left side of Auditorium	W3	Plaster	Tan	Moisture Damage	30	0.1	Negative
1	1	Hallway Corridor at Left side of Auditorium	W4	Plaster	Tan	None	0	25	Positive
1	1	Hallway Corridor at Left side of Auditorium	Ceiling	Plaster	White	Moisture Damage	5	14	Positive
1	1	Women's Restroom across from Auditorium	Floor	Concrete	Gray	N/A	N/A	0.6	Negative
1	1	Women's Restroom across from Auditorium	W1	Plaster	Tan	None	0	17.5	Positive
1	1	Women's Restroom across from Auditorium	W2	Plaster	Tan	None	0	15.9	Positive
1	1	Women's Restroom across from Auditorium	W3	Drywall	Tan	N/A	N/A	0	Negative
1	1	Women's Restroom across from Auditorium	W4	Plaster	Tan	None	0	14.6	Positive
1	1	Women's Restroom across from Auditorium	Ceiling	Plaster	White	None	0	16.8	Positive
1	1	Men's Restroom across from Auditorium	Floor	Concrete	Gray	None	0	2.5	Positive
1	1	Men's Restroom across from Auditorium	W1	Plaster	Tan	N/A	N/A	0	Negative
1	1	Men's Restroom across from Auditorium	W2	Plaster	Tan	None	0	22.5	Positive
1	1	Men's Restroom across from Auditorium	W3	Drywall	Tan	N/A	N/A	0	Negative
1	1	Men's Restroom across from Auditorium	W4	Plaster	Tan	N/A	N/A	0	Negative
1	1	Men's Restroom across from Auditorium	Ceiling	Plaster	White	None	0	17.9	Positive
1	1	Main Entrance Vestibule	Floor	Tile	N/A	N/A	N/A	N/A	N/A
1	1	Main Entrance Vestibule	W1	Marble	N/A	N/A	N/A	N/A	N/A
1	1	Main Entrance Vestibule	W2	Marble	N/A	N/A	N/A	N/A	N/A
1	1	Main Entrance Vestibule	W3	Marble	N/A	N/A	N/A	N/A	N/A

		Dates: 11/21/2022-12/21/2023	Lead-Safe Certification Assessment Report						
		Michael A Martin Certification #006416	Theodore Roosevelt Elementary School						
		Inspection Company: Criterion Labs	430 Washington Ln, Philadelphia, PA 19144						
E l e m e n t	F l o o r	On-Site Room Name	Component	Substrate Material	Paint Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
1	1	Main Entrance Vestibule	W4	Marble	N/A	N/A	N/A	N/A	N/A
1	1	Main Entrance Vestibule	Ceiling	Plaster	White	Moisture Damage	12	22.7	Positive
1	1	Main Entrance Lobby	Floor	Tile	N/A	N/A	N/A	N/A	N/A
1	1	Main Entrance Lobby	W1	Marble	N/A	N/A	N/A	N/A	N/A
1	1	Main Entrance Lobby	W2	Marble	N/A	N/A	N/A	N/A	N/A
1	1	Main Entrance Lobby	W3	Marble	N/A	N/A	N/A	N/A	N/A
1	1	Main Entrance Lobby	W4	Marble	N/A	N/A	N/A	N/A	N/A
1	1	Main Entrance Lobby	Ceiling	Plaster	White	N/A	N/A	0.4	Negative
1	1	Main Lobby Stairs next to Classroom 105	Floor	Marble	N/A	N/A	N/A	N/A	N/A
1	1	Main Lobby Stairs next to Classroom 105	W1	Plaster	Gray	None	0	22.9	Positive
1	1	Main Lobby Stairs next to Classroom 105	W2	Plaster	Gray	None	0	30.4	Positive
1	1	Main Lobby Stairs next to Classroom 105	W3	Plaster	Gray	None	0	28.7	Positive
1	1	Main Lobby Stairs next to Classroom 105	W4	Plaster	Gray	N/A	N/A	0	Negative
1	1	Main Lobby Stairs next to Classroom 105	Ceiling	Plaster	White	None	0	17.2	Positive
1	1	Main Lobby Stairs next to Classroom 104	Floor	Marble	N/A	N/A	N/A	N/A	N/A
1	1	Main Lobby Stairs next to Classroom 104	W1	Plaster	N/A	None	0	31.5	Positive
1	1	Main Lobby Stairs next to Classroom 104	W2	Plaster	N/A	None	0	27.6	Positive
1	1	Main Lobby Stairs next to Classroom 104	W3	Plaster	N/A	None	0	25.7	Positive
1	1	Main Lobby Stairs next to Classroom 104	W4	Plaster	N/A	None	0	21.6	Positive
1	1	Main Lobby Stairs next to Classroom 104	Ceiling	Plaster	White	None	0	19	Positive
1	1	1st Floor Marble Hallway	Floor	Tile	N/A	N/A	N/A	N/A	N/A
1	1	1st Floor Marble Hallway	W1	Plaster	Tan	None	0	22.5	Positive
1	1	1st Floor Marble Hallway	W2	Plaster	Tan	None	0	22.6	Positive
1	1	1st Floor Marble Hallway	W3	Plaster	Tan	None	0	19.9	Positive
1	1	1st Floor Marble Hallway	W4	Plaster	Tan	None	0	20.6	Positive
1	1	1st Floor Marble Hallway	Ceiling	Plaster	White	None	0	18.1	Positive
1	1	Main Office Room 104	Floor	Tile	N/A	N/A	N/A	N/A	N/A
1	1	Main Office Room 104	W1	Brick	White	N/A	N/A	0.18	Negative
1	1	Main Office Room 104	W2	Brick	White	N/A	N/A	0.1	Negative
1	1	Main Office Room 104	W3	Brick	White	N/A	N/A	0.12	Negative
1	1	Main Office Room 104	W4	Drywall	White	N/A	N/A	0	Negative
1	1	Main Office Room 104	Ceiling	Plaster	White	Flaking	60	12.4	Positive
1	1	Principal's Office Room 104A	Floor	Concrete	Gray	N/A	N/A	0	Negative
1	1	Principal's Office Room 104A	W1	Drywall	White	N/A	N/A	0	Negative
1	1	Principal's Office Room 104A	W2	Brick	White	N/A	N/A	0.8	Negative
1	1	Principal's Office Room 104A	W3	Brick	White	N/A	N/A	0.18	Negative

		Dates: 11/21/2022-12/21/2023	Lead-Safe Certification Assessment Report						
		Michael A Martin Certification #006416	Theodore Roosevelt Elementary School						
		Inspection Company: Criterion Labs	430 Washington Ln, Philadelphia, PA 19144						
E l e m e n t	F l o o r	On-Site Room Name	Component	Substrate Material	Paint Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
1	1	Principal's Office Room 104A	W4	Drywall	White	N/A	N/A	0	Negative
1	1	Principal's Office Room 104A	Ceiling	Plaster	White	Flaking	15	22	Positive
1	1	Principal's Office Storage	Floor	Tile	N/A	N/A	N/A	N/A	N/A
1	1	Principal's Office Storage	W1	Drywall	White	N/A	N/A	0	Negative
1	1	Principal's Office Storage	W2	Brick	White	N/A	N/A	0.4	Negative
1	1	Principal's Office Storage	W3	Brick	White	N/A	N/A	0.11	Negative
1	1	Principal's Office Storage	W4	Drywall	White	N/A	N/A	0	Negative
1	1	Principal's Office Storage	Ceiling	Plaster	White	None	0	15.4	Positive
1	1	Main Office Secured Storage	Floor	Concrete	Gray	N/A	N/A	0.05	Negative
1	1	Main Office Secured Storage	W1	Brick	White	N/A	N/A	0.11	Negative
1	1	Main Office Secured Storage	W2	Brick	White	N/A	N/A	0.07	Negative
1	1	Main Office Secured Storage	W3	Brick	White	N/A	N/A	0.06	Negative
1	1	Main Office Secured Storage	W4	Brick	White	N/A	N/A	0.07	Negative
1	1	Main Office Secured Storage	Ceiling	Plaster	White	None	0	13	Positive
1	1	Hallway to Men's Restroom	Floor	Concrete	Gray	None	0	14.9	Positive
1	1	Hallway to Men's Restroom	W1	Plaster	Tan	None	0	22.6	Positive
1	1	Hallway to Men's Restroom	W2	Plaster	Tan	None	0	25.5	Positive
1	1	Hallway to Men's Restroom	W3	Plaster	Tan	None	0	24.1	Positive
1	1	Hallway to Men's Restroom	W4	Plaster	Tan	Flaking	3	26.6	Positive
1	1	Hallway to Men's Restroom	Ceiling	Plaster	Tan	Flaking	6	17.8	Positive
1	1	Men's Restroom between Classroom 104 and Room C	Floor	Concrete	Gray	N/A	N/A	0.18	Negative
1	1	Men's Restroom between Classroom 104 and Room C	W1	Plaster	Tan	None	0	19.1	Positive
1	1	Men's Restroom between Classroom 104 and Room C	W2	Plaster	Tan	None	0	29.7	Positive
1	1	Men's Restroom between Classroom 104 and Room C	W3	Plaster	Tan	None	0	20	Positive
1	1	Men's Restroom between Classroom 104 and Room C	W4	Plaster	Tan	None	0	23	Positive
1	1	Men's Restroom between Classroom 104 and Room C	Ceiling	Plaster	Tan	Flaking	5	19.6	Positive
1	1	Vestibule outside Classroom 103 and Room C	Floor	Tile	N/A	N/A	N/A	N/A	N/A
1	1	Vestibule outside Classroom 103 and Room C	W1	Brick	White	N/A	N/A	0.14	Negative
1	1	Vestibule outside Classroom 103 and Room C	W2	Drywall	White	N/A	N/A	0	Negative
1	1	Vestibule outside Classroom 103 and Room C	W3	Drywall	White	N/A	N/A	0	Negative
1	1	Vestibule outside Classroom 103 and Room C	W4	Brick	White	N/A	N/A	0.13	Negative
1	1	Vestibule outside Classroom 103 and Room C	Ceiling	Plaster	White	None	0	10.5	Positive
1	1	Classroom 103	Floor	Concrete	Gray	N/A	N/A	0.11	Negative
1	1	Classroom 103	W1	Drywall	White	N/A	N/A	0.23	Negative
1	1	Classroom 103	W2	Brick	Orange	N/A	N/A	0	Negative
1	1	Classroom 103	W3	Brick	White	N/A	N/A	0.4	Negative

		Dates: 11/21/2022-12/21/2023	Lead-Safe Certification Assessment Report						
		Michael A Martin Certification #006416	Theodore Roosevelt Elementary School						
		Inspection Company: Criterion Labs	430 Washington Ln, Philadelphia, PA 19144						
E l e m e n t	F l o o r	On-Site Room Name	Component	Substrate Material	Paint Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
1	1	Classroom 103	W4	Brick	White	N/A	N/A	0.6	Negative
1	1	Classroom 103	Ceiling	Plaster	White	N/A	N/A	0	Negative
1	1	Room C next to Classroom 103 (Paint Storage Room)	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
1	1	Room C next to Classroom 103 (Paint Storage Room)	W1	Brick	Tan	N/A	N/A	0.05	Negative
1	1	Room C next to Classroom 103 (Paint Storage Room)	W2	Drywall	Tan	N/A	N/A	0	Negative
1	1	Room C next to Classroom 103 (Paint Storage Room)	W3	Brick	Tan	N/A	N/A	0.1	Negative
1	1	Room C next to Classroom 103 (Paint Storage Room)	W4	Brick	Tan	N/A	N/A	0.4	Negative
1	1	Room C next to Classroom 103 (Paint Storage Room)	Ceiling	Plaster	Tan	None	0	11.5	Positive
1	1	Room C next to Classroom 103 (Paint Storage Room) Closet	Floor	Concrete	Gray	N/A	N/A	0.02	Negative
1	1	Room C next to Classroom 103 (Paint Storage Room) Closet	W1	Brick	Tan	N/A	N/A	0.03	Negative
1	1	Room C next to Classroom 103 (Paint Storage Room) Closet	W2	Brick	Tan	N/A	N/A	0.15	Negative
1	1	Room C next to Classroom 103 (Paint Storage Room) Closet	W3	Brick	Tan	N/A	N/A	0.07	Negative
1	1	Room C next to Classroom 103 (Paint Storage Room) Closet	W4	Brick	Tan	N/A	N/A	0.08	Negative
1	1	Room C next to Classroom 103 (Paint Storage Room) Closet	Ceiling	No Access	No Access	No Access	No Access	No Access	No Access
1	1	Hallway outside Classrooms 103-104	Floor	Concrete	Blue	N/A	N/A	0.03	Negative
1	1	Hallway outside Classrooms 103-104	W1	Plaster	Gray	None	0	23.4	Positive
1	1	Hallway outside Classrooms 103-104	W2	Plaster	Gray	None	0	21.9	Positive
1	1	Hallway outside Classrooms 103-104	W3	Plaster	Gray	None	0	19.6	Positive
1	1	Hallway outside Classrooms 103-104	W4	Plaster	Gray	None	0	26.5	Positive
1	1	Hallway outside Classrooms 103-104	Ceiling	Plaster	Tan	Flaking	10	24.3	Positive
1	1	Hallway to Side Entrance adjacent to Classroom 103	Floor	Concrete	Blue	N/A	N/A	0.26	Negative
1	1	Hallway to Side Entrance adjacent to Classroom 103	W1	Metal	Red	N/A	N/A	0	Negative
1	1	Hallway to Side Entrance adjacent to Classroom 103	W2	Plaster	Gray	None	0	30.2	Positive
1	1	Hallway to Side Entrance adjacent to Classroom 103	W3	Plaster	Gray	None	0	24.5	Positive
1	1	Hallway to Side Entrance adjacent to Classroom 103	W4	Plaster	Gray	None	0	24.4	Positive
1	1	Hallway to Side Entrance adjacent to Classroom 103	Ceiling	Plaster	Gray	Moisture Damage	15	24.3	Positive
1	1	Stairwell to Former Gym near Classroom 104	Floor	No Access	No Access	No Access	No Access	No Access	No Access
1	1	Stairwell to Former Gym near Classroom 104	W1	No Access	No Access	No Access	No Access	No Access	No Access
1	1	Stairwell to Former Gym near Classroom 104	W2	No Access	No Access	No Access	No Access	No Access	No Access
1	1	Stairwell to Former Gym near Classroom 104	W3	No Access	No Access	No Access	No Access	No Access	No Access
1	1	Stairwell to Former Gym near Classroom 104	W4	No Access	No Access	No Access	No Access	No Access	No Access

		Dates: 11/21/2022-12/21/2023	Lead-Safe Certification Assessment Report						
		Michael A Martin Certification #006416	Theodore Roosevelt Elementary School						
		Inspection Company: Criterion Labs	430 Washington Ln, Philadelphia, PA 19144						
E l e m e n t	F l o o r	On-Site Room Name	Component	Substrate Material	Paint Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
1	1	Stairwell to Former Gym near Classroom 104	Ceiling	No Access	No Access	No Access	No Access	No Access	No Access
1	1	Stairwell to Former Gym near Classroom 104 Storage Room	Floor	No Access	No Access	No Access	No Access	No Access	No Access
1	1	Stairwell to Former Gym near Classroom 104 Storage Room	W1	No Access	No Access	No Access	No Access	No Access	No Access
1	1	Stairwell to Former Gym near Classroom 104 Storage Room	W2	No Access	No Access	No Access	No Access	No Access	No Access
1	1	Stairwell to Former Gym near Classroom 104 Storage Room	W3	No Access	No Access	No Access	No Access	No Access	No Access
1	1	Stairwell to Former Gym near Classroom 104 Storage Room	W4	No Access	No Access	No Access	No Access	No Access	No Access
1	1	Stairwell to Former Gym near Classroom 104 Storage Room	Ceiling	No Access	No Access	No Access	No Access	No Access	No Access
1	1	Stairwell to Former Gym near Classroom 104 Vestibule	Floor	No Access	No Access	No Access	No Access	No Access	No Access
1	1	Stairwell to Former Gym near Classroom 104 Vestibule	W1	No Access	No Access	No Access	No Access	No Access	No Access
1	1	Stairwell to Former Gym near Classroom 104 Vestibule	W2	No Access	No Access	No Access	No Access	No Access	No Access
1	1	Stairwell to Former Gym near Classroom 104 Vestibule	W3	No Access	No Access	No Access	No Access	No Access	No Access
1	1	Stairwell to Former Gym near Classroom 104 Vestibule	W4	No Access	No Access	No Access	No Access	No Access	No Access
1	1	Stairwell to Former Gym near Classroom 104 Vestibule	Ceiling	No Access	No Access	No Access	No Access	No Access	No Access
1	1	Stairwell to Former Gym near Classroom 104 Closet to Left of Entrance to Stairwell across from Classroom B	Floor	No Access	No Access	No Access	No Access	No Access	No Access
1	1	Stairwell to Former Gym near Classroom 104 Closet to Left of Entrance to Stairwell across from Classroom B	W1	No Access	No Access	No Access	No Access	No Access	No Access
1	1	Stairwell to Former Gym near Classroom 104 Closet to Left of Entrance to Stairwell across from Classroom B	W2	No Access	No Access	No Access	No Access	No Access	No Access
1	1	Stairwell to Former Gym near Classroom 104 Closet to Left of Entrance to Stairwell across from Classroom B	W3	No Access	No Access	No Access	No Access	No Access	No Access
1	1	Stairwell to Former Gym near Classroom 104 Closet to Left of Entrance to Stairwell across from Classroom B	W4	No Access	No Access	No Access	No Access	No Access	No Access
1	1	Stairwell to Former Gym near Classroom 104 Closet to Left of Entrance to Stairwell across from Classroom B	Ceiling	No Access	No Access	No Access	No Access	No Access	No Access

		Dates: 11/21/2022-12/21/2023	Lead-Safe Certification Assessment Report						
		Michael A Martin Certification #006416	Theodore Roosevelt Elementary School						
		Inspection Company: Criterion Labs	430 Washington Ln, Philadelphia, PA 19144						
E l e m e n t	F l o o r	On-Site Room Name	Component	Substrate Material	Paint Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
1	1	Stairwell to Former Gym near Classroom 104 Closet to Right of Entrance to Stairwell across from Classroom B	Floor	No Access	No Access	No Access	No Access	No Access	No Access
1	1	Stairwell to Former Gym near Classroom 104 Closet to Right of Entrance to Stairwell across from Classroom B	W1	No Access	No Access	No Access	No Access	No Access	No Access
1	1	Stairwell to Former Gym near Classroom 104 Closet to Right of Entrance to Stairwell across from Classroom B	W2	No Access	No Access	No Access	No Access	No Access	No Access
1	1	Stairwell to Former Gym near Classroom 104 Closet to Right of Entrance to Stairwell across from Classroom B	W3	No Access	No Access	No Access	No Access	No Access	No Access
1	1	Stairwell to Former Gym near Classroom 104 Closet to Right of Entrance to Stairwell across from Classroom B	W4	No Access	No Access	No Access	No Access	No Access	No Access
1	1	Stairwell to Former Gym near Classroom 104 Closet to Right of Entrance to Stairwell across from Classroom B	Ceiling	No Access	No Access	No Access	No Access	No Access	No Access
1	1	Former Gym near Classroom 104	Floor	No Access	No Access	No Access	No Access	No Access	No Access
1	1	Former Gym near Classroom 104	W1	No Access	No Access	No Access	No Access	No Access	No Access
1	1	Former Gym near Classroom 104	W2	No Access	No Access	No Access	No Access	No Access	No Access
1	1	Former Gym near Classroom 104	W3	No Access	No Access	No Access	No Access	No Access	No Access
1	1	Former Gym near Classroom 104	W4	No Access	No Access	No Access	No Access	No Access	No Access
1	1	Former Gym near Classroom 104	Ceiling	No Access	No Access	No Access	No Access	No Access	No Access
1	1	Former Gym near Classroom 104 Office	Floor	No Access	No Access	No Access	No Access	No Access	No Access
1	1	Former Gym near Classroom 104 Office	W1	No Access	No Access	No Access	No Access	No Access	No Access
1	1	Former Gym near Classroom 104 Office	W2	No Access	No Access	No Access	No Access	No Access	No Access
1	1	Former Gym near Classroom 104 Office	W3	No Access	No Access	No Access	No Access	No Access	No Access
1	1	Former Gym near Classroom 104 Office	W4	No Access	No Access	No Access	No Access	No Access	No Access
1	1	Former Gym near Classroom 104 Office	Ceiling	No Access	No Access	No Access	No Access	No Access	No Access
1	1	Former Gym near Classroom 104 Office Closet	Floor	No Access	No Access	No Access	No Access	No Access	No Access
1	1	Former Gym near Classroom 104 Office Closet	W1	No Access	No Access	No Access	No Access	No Access	No Access
1	1	Former Gym near Classroom 104 Office Closet	W2	No Access	No Access	No Access	No Access	No Access	No Access
1	1	Former Gym near Classroom 104 Office Closet	W3	No Access	No Access	No Access	No Access	No Access	No Access
1	1	Former Gym near Classroom 104 Office Closet	W4	No Access	No Access	No Access	No Access	No Access	No Access
1	1	Former Gym near Classroom 104 Office Closet	Ceiling	No Access	No Access	No Access	No Access	No Access	No Access
1	1	Former Gym near Classroom 104 Closet below Stairs	Floor	No Access	No Access	No Access	No Access	No Access	No Access

		Dates: 11/21/2022-12/21/2023	Lead-Safe Certification Assessment Report						
		Michael A Martin Certification #006416	Theodore Roosevelt Elementary School						
		Inspection Company: Criterion Labs	430 Washington Ln, Philadelphia, PA 19144						
E l e m e n t	F l o o r	On-Site Room Name	Component	Substrate Material	Paint Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
1	1	Former Gym near Classroom 104 Closet below Stairs	W1	No Access	No Access	No Access	No Access	No Access	No Access
1	1	Former Gym near Classroom 104 Closet below Stairs	W2	No Access	No Access	No Access	No Access	No Access	No Access
1	1	Former Gym near Classroom 104 Closet below Stairs	W3	No Access	No Access	No Access	No Access	No Access	No Access
1	1	Former Gym near Classroom 104 Closet below Stairs	W4	No Access	No Access	No Access	No Access	No Access	No Access
1	1	Former Gym near Classroom 104 Closet below Stairs	Ceiling	No Access	No Access	No Access	No Access	No Access	No Access
1	1	Former Gym near Classroom 104 Left Storage Room	Floor	No Access	No Access	No Access	No Access	No Access	No Access
1	1	Former Gym near Classroom 104 Left Storage Room	W1	No Access	No Access	No Access	No Access	No Access	No Access
1	1	Former Gym near Classroom 104 Left Storage Room	W2	No Access	No Access	No Access	No Access	No Access	No Access
1	1	Former Gym near Classroom 104 Left Storage Room	W3	No Access	No Access	No Access	No Access	No Access	No Access
1	1	Former Gym near Classroom 104 Left Storage Room	W4	No Access	No Access	No Access	No Access	No Access	No Access
1	1	Former Gym near Classroom 104 Left Storage Room	Ceiling	No Access	No Access	No Access	No Access	No Access	No Access
1	1	Former Gym near Classroom 104 Center Storage Room	Floor	No Access	No Access	No Access	No Access	No Access	No Access
1	1	Former Gym near Classroom 104 Center Storage Room	W1	No Access	No Access	No Access	No Access	No Access	No Access
1	1	Former Gym near Classroom 104 Center Storage Room	W2	No Access	No Access	No Access	No Access	No Access	No Access
1	1	Former Gym near Classroom 104 Center Storage Room	W3	No Access	No Access	No Access	No Access	No Access	No Access
1	1	Former Gym near Classroom 104 Center Storage Room	W4	No Access	No Access	No Access	No Access	No Access	No Access
1	1	Former Gym near Classroom 104 Center Storage Room	Ceiling	No Access	No Access	No Access	No Access	No Access	No Access
1	1	Former Gym near Classroom 104 Right Storage Room	Floor	No Access	No Access	No Access	No Access	No Access	No Access
1	1	Former Gym near Classroom 104 Right Storage Room	W1	No Access	No Access	No Access	No Access	No Access	No Access
1	1	Former Gym near Classroom 104 Right Storage Room	W2	No Access	No Access	No Access	No Access	No Access	No Access
1	1	Former Gym near Classroom 104 Right Storage Room	W3	No Access	No Access	No Access	No Access	No Access	No Access
1	1	Former Gym near Classroom 104 Right Storage Room	W4	No Access	No Access	No Access	No Access	No Access	No Access
1	1	Former Gym near Classroom 104 Right Storage Room	Ceiling	No Access	No Access	No Access	No Access	No Access	No Access
1	1	Room B	Floor	Concrete	Gray	N/A	N/A	0.03	Negative
1	1	Room B	W1	Brick	Tan	N/A	N/A	0.24	Negative
1	1	Room B	W2	Brick	Tan	N/A	N/A	0.05	Negative
1	1	Room B	W3	Brick	Tan	N/A	N/A	0.04	Negative
1	1	Room B	W4	Brick	Tan	N/A	N/A	0.06	Negative
1	1	Room B	Ceiling	Plaster	Tan	None	0	16.2	Positive
1	1	Room B Closet	Floor	Concrete	Gray	N/A	N/A	0.05	Negative
1	1	Room B Closet	W1	Brick	Tan	N/A	N/A	0.4	Negative

		Dates: 11/21/2022-12/21/2023	Lead-Safe Certification Assessment Report						
		Michael A Martin Certification #006416	Theodore Roosevelt Elementary School						
		Inspection Company: Criterion Labs	430 Washington Ln, Philadelphia, PA 19144						
E l e m e n t	F l o o r	On-Site Room Name	Component	Substrate Material	Paint Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
1	1	Room B Closet	W2	Brick	Tan	N/A	N/A	0.01	Negative
1	1	Room B Closet	W3	Brick	Tan	N/A	N/A	0.4	Negative
1	1	Room B Closet	W4	Brick	Tan	Flaking	10	0.15	Negative
1	1	Room B Closet	Ceiling	Plaster	Tan	None	0	17.2	Positive
1	1	Stairwell across from Classroom B	Floor	Concrete	Blue	N/A	N/A	0.03	Negative
1	1	Stairwell across from Classroom B	W1	Wood Glass Pane Frame	Brown	None	0	6.9	Positive
1	1	Stairwell across from Classroom B	W2	Plaster	Tan	None	0	20	Positive
1	1	Stairwell across from Classroom B	W3	Plaster	Tan	N/A	N/A	0	Negative
1	1	Stairwell across from Classroom B	W4	Plaster	Tan	None	0	20.7	Positive
1	1	Stairwell across from Classroom B	Ceiling	Plaster	Tan	None	0	22.6	Positive
1	1	Stairwell across from Classroom B	Hand Rail	Wood	Brown	None	N/A	0.04	Negative
1	1	Stairwell across from Classroom B	Rail Post	Metal	Brown	None	N/A	0.29	Negative
1	1	Stairwell across from Classroom B	Stair Stringer	Concrete	Gray	None	N/A	1.9	Positive
1	1	Stairwell across from Classroom B	Riser	Metal	Tan	None	N/A	14.9	Positive
1	1	Stairwell across from Classroom B Crawlspace	Floor	No Access	No Access	No Access	No Access	No Access	No Access
1	1	Stairwell across from Classroom B Crawlspace	W1	No Access	No Access	No Access	No Access	No Access	No Access
1	1	Stairwell across from Classroom B Crawlspace	W2	No Access	No Access	No Access	No Access	No Access	No Access
1	1	Stairwell across from Classroom B Crawlspace	W3	No Access	No Access	No Access	No Access	No Access	No Access
1	1	Stairwell across from Classroom B Crawlspace	W4	No Access	No Access	No Access	No Access	No Access	No Access
1	1	Stairwell across from Classroom B Crawlspace	Ceiling	No Access	No Access	No Access	No Access	No Access	No Access
1	1	Classroom 102	Floor	Concrete	Gray	N/A	N/A	0	Negative
1	1	Classroom 102	W1	Brick	White	None	0	1.5	Positive
1	1	Classroom 102	W2	Brick	White	None	0	1.1	Positive
1	1	Classroom 102	W3	Brick	White	Moisture Damage	2	0.7	Negative
1	1	Classroom 102	W4	Brick	Orange	N/A	N/A	0.25	Negative
1	1	Classroom 102	Ceiling	Plaster	Tan	Flaking	5	19.2	Positive
1	1	Classroom 101A	Floor	Concrete	Gray	N/A	N/A	0.01	Negative
1	1	Classroom 101A	W1	Brick	White	N/A	N/A	0.02	Negative
1	1	Classroom 101A	W2	Brick	White	N/A	N/A	0.08	Negative
1	1	Classroom 101A	W3	Brick	White	N/A	N/A	0.19	Negative
1	1	Classroom 101A	W4	Brick	Orange	N/A	N/A	0.19	Negative
1	1	Classroom 101A	Ceiling	Plaster	Tan	None	0	12.9	Positive
1	1	Classroom 101A Storage Closet	Floor	Wood	N/A	N/A	N/A	N/A	N/A
1	1	Classroom 101A Storage Closet	W1	Brick	Tan	N/A	N/A	0.19	Negative
1	1	Classroom 101A Storage Closet	W2	Brick	Tan	N/A	N/A	0.03	Negative

		Dates: 11/21/2022-12/21/2023	Lead-Safe Certification Assessment Report						
		Michael A Martin Certification #006416	Theodore Roosevelt Elementary School						
		Inspection Company: Criterion Labs	430 Washington Ln, Philadelphia, PA 19144						
E l e m e n t	F l o o r	On-Site Room Name	Component	Substrate Material	Paint Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
1	1	Classroom 101A Storage Closet	W3	Brick	Tan	N/A	N/A	0.3	Negative
1	1	Classroom 101A Storage Closet	W4	Brick	Tan	N/A	N/A	0.17	Negative
1	1	Classroom 101A Storage Closet	Ceiling	Plaster	White	None	0	6.9	Positive
1	1	Custodial Closet across from Storage Room 100	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
1	1	Custodial Closet across from Storage Room 100	W1	Plaster	Blue	None	0	19.5	Positive
1	1	Custodial Closet across from Storage Room 100	W2	Plaster	Blue	None	0	24.12	Positive
1	1	Custodial Closet across from Storage Room 100	W3	Plaster	Blue	Cracking	3	10.5	Positive
1	1	Custodial Closet across from Storage Room 100	W4	Plaster	Blue	None	0	12.7	Positive
1	1	Custodial Closet across from Storage Room 100	Ceiling	Plaster	Tan	Flaking	5	18.3	Positive
1	1	Classroom 101A Storage Closet	Shelving Frame	Wood	Tan	None	N/A	0.01	Negative
1	1	Classroom 101A Storage Closet	Shelving	Wood	Tan	None	N/A	0.1	Negative
1	1	Boy's Restroom across from Storage Room 101	Floor	Concrete	Gray	N/A	N/A	0	Negative
1	1	Boy's Restroom across from Storage Room 101	W1	Plaster	Gray	None	0	12.9	Positive
1	1	Boy's Restroom across from Storage Room 101	W2	Plaster	Gray	None	0	16	Positive
1	1	Boy's Restroom across from Storage Room 101	W3	Plaster	Gray	None	0	7.6	Positive
1	1	Boy's Restroom across from Storage Room 101	W4	Plaster	Gray	None	0	19.6	Positive
1	1	Boy's Restroom across from Storage Room 101	Ceiling	Concrete	White	N/A	N/A	0.4	Negative
1	1	Stairwell across from Storage Room 100	Floor	Concrete	Blue	N/A	N/A	0.17	Negative
1	1	Stairwell across from Storage Room 100	W1	Metal Glass Paned Frame Wall	Brown	None	0	10	Positive
1	1	Stairwell across from Storage Room 100	W2	Plaster	Tan	None	0	17.5	Positive
1	1	Stairwell across from Storage Room 100	W3	Plaster	Tan	None	0	19	Positive
1	1	Stairwell across from Storage Room 100	W4	Plaster	Tan	None	0	18.6	Positive
1	1	Stairwell across from Storage Room 100	Ceiling	Plaster	Tan	N/A	N/A	0.4	Negative
1	1	Stairwell across from Storage Room 100 Closet	Floor	Concrete	Blue	None	0	5.6	Positive
1	1	Stairwell across from Storage Room 100 Closet	W1	N/A	N/A	N/A	N/A	N/A	N/A
1	1	Stairwell across from Storage Room 100 Closet	W2	Plaster	Tan	None	0	17.4	Positive
1	1	Stairwell across from Storage Room 100 Closet	W3	Plaster	Tan	N/A	N/A	0.9	Negative
1	1	Stairwell across from Storage Room 100 Closet	W4	Plaster	Tan	None	0	17.9	Positive
1	1	Stairwell across from Storage Room 100 Closet	Ceiling	Plaster	Tan	None	0	20.6	Positive
1	1	Hallway outside Storage Room 100 to Room B	Floor	Concrete	Blue	N/A	N/A	0.24	Negative
1	1	Hallway outside Storage Room 100 to Room B	W1	Plaster	Tan	None	0	22.7	Positive
1	1	Hallway outside Storage Room 100 to Room B	W2	Plaster	Tan	None	0	22.4	Positive
1	1	Hallway outside Storage Room 100 to Room B	W3	Plaster	Tan	None	0	30	Positive
1	1	Hallway outside Storage Room 100 to Room B	W4	Plaster	Tan	None	0	22.1	Positive
1	1	Hallway outside Storage Room 100 to Room B	Ceiling	Plaster	Tan	None	0	22.3	Positive

		Dates: 11/21/2022-12/21/2023	Lead-Safe Certification Assessment Report						
		Michael A Martin Certification #006416	Theodore Roosevelt Elementary School						
		Inspection Company: Criterion Labs	430 Washington Ln, Philadelphia, PA 19144						
E l e m e n t	F l o o r	On-Site Room Name	Component	Substrate Material	Paint Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
1	1	Building Engineer's Office	Floor	Concrete	Gray	Flaking	20	24.1	Positive
1	1	Building Engineer's Office	W1	Brick	Tan	N/A	N/A	0.02	Negative
1	1	Building Engineer's Office	W2	Brick	Tan	N/A	N/A	0.23	Negative
1	1	Building Engineer's Office	W3	Brick	Tan	N/A	N/A	0.19	Negative
1	1	Building Engineer's Office	W4	Brick	Tan	N/A	N/A	0.06	Negative
1	1	Building Engineer's Office	Ceiling	Concrete	White	N/A	N/A	0.01	Negative
1	1	Building Engineer's Office	Riser	Metal	Gray	None	N/A	0.01	Negative
1	1	Building Engineer's Office	Radiator	Metal	Gray	None	N/A	0.11	Negative
1	1	Hallway outside Building Engineer's Office	Floor	Concrete	Blue	N/A	N/A	0.9	Negative
1	1	Hallway outside Building Engineer's Office	W1	Plaster	Tan	None	0	20.1	Positive
1	1	Hallway outside Building Engineer's Office	W2	Plaster	Tan	None	0	31.3	Positive
1	1	Hallway outside Building Engineer's Office	W3	Plaster	Tan	None	0	14.8	Positive
1	1	Hallway outside Building Engineer's Office	W4	Plaster	Tan	None	0	13.4	Positive
1	1	Hallway outside Building Engineer's Office	Ceiling	Plaster	Tan	Moisture Damage	35	20.5	Positive
1	1	Classroom across from Cafeteria closest to Washington Lane	Floor	Tile	N/A	N/A	N/A	N/A	N/A
1	1	Classroom across from Cafeteria closest to Washington Lane	W1	Brick	Tan	N/A	N/A	0.03	Negative
1	1	Classroom across from Cafeteria closest to Washington Lane	W2	Brick	Tan	N/A	N/A	0.05	Negative
1	1	Classroom across from Cafeteria closest to Washington Lane	W3	Brick	Tan	N/A	N/A	0.04	Negative
1	1	Classroom across from Cafeteria closest to Washington Lane	W4	CMU	Tan	N/A	N/A	0.01	Negative
1	1	Classroom across from Cafeteria closest to Washington Lane	Ceiling	Concrete	White	Flaking	40	14.9	Positive
1	1	Hallway to Rear Entrance adjacent to Cafeteria	Floor	Concrete	Blue	N/A	N/A	0.18	Negative
1	1	Hallway to Rear Entrance adjacent to Cafeteria	W1	Plaster	Tan	None	0	25.4	Positive
1	1	Hallway to Rear Entrance adjacent to Cafeteria	W2	Plaster	Tan	None	0	20.5	Positive
1	1	Hallway to Rear Entrance adjacent to Cafeteria	W3	Plaster	Tan	None	0	14.3	Positive
1	1	Hallway to Rear Entrance adjacent to Cafeteria	W4	Plaster	Tan	None	0	19.8	Positive
1	1	Hallway to Rear Entrance adjacent to Cafeteria	Ceiling	Plaster	Tan	Flaking	5	15.6	Positive
1	1	Hallway outside Classroom 197	Floor	Concrete	Blue	N/A	N/A	0.5	Negative
1	1	Hallway outside Classroom 197	W1	Plaster	Tan	None	0	25	Positive
1	1	Hallway outside Classroom 197	W2	Plaster	Tan	None	0	13.2	Positive
1	1	Hallway outside Classroom 197	W3	Plaster	Tan	None	0	22.8	Positive
1	1	Hallway outside Classroom 197	W4	Plaster	Tan	None	0	19.4	Positive

		Dates: 11/21/2022-12/21/2023	Lead-Safe Certification Assessment Report						
		Michael A Martin Certification #006416	Theodore Roosevelt Elementary School						
		Inspection Company: Criterion Labs	430 Washington Ln, Philadelphia, PA 19144						
E l e m e n t	F l o o r	On-Site Room Name	Component	Substrate Material	Paint Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
1	1	Hallway outside Classroom 197	Ceiling	Sheetrock	Tan	N/A	N/A	0	Negative
1	B	Fan Room Closest to Parking Lot	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
1	B	Fan Room Closest to Parking Lot	W1	Brick	Gray	N/A	N/A	0.1	Negative
1	B	Fan Room Closest to Parking Lot	W2	Brick	White	N/A	N/A	0.02	Negative
1	B	Fan Room Closest to Parking Lot	W3	Brick	Gray	N/A	N/A	0.2	Negative
1	B	Fan Room Closest to Parking Lot	W4	Brick	White	N/A	N/A	0.08	Negative
1	B	Fan Room Closest to Parking Lot	Ceiling	Concrete	N/A	N/A	N/A	N/A	N/A
1	B	Fan Room Closest to Parking Lot	Fan Unit	Metal	Silver	None	0	22.8	Positive
1	B	Fan Room Closest to Parking Lot	Hand Rail	Metal	Gray	None	0	5.9	Positive
1	B	Storage Room between Boiler Room and Fan Room	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
1	B	Storage Room between Boiler Room and Fan Room	W1	Brick	White	N/A	N/A	0.4	Negative
1	B	Storage Room between Boiler Room and Fan Room	W2	Concrete	White	N/A	N/A	0.2	Negative
1	B	Storage Room between Boiler Room and Fan Room	W3	Concrete	White	N/A	N/A	0.3	Negative
1	B	Storage Room between Boiler Room and Fan Room	W4	Concrete	White	N/A	N/A	0.14	Negative
1	B	Storage Room between Boiler Room and Fan Room	Ceiling	Concrete	White	N/A	N/A	0	Negative
1	B	Boiler Room Left Storage Area	Floor	No Access	No Access	No Access	No Access	No Access	No Access
1	B	Boiler Room Left Storage Area	W1	No Access	No Access	No Access	No Access	No Access	No Access
1	B	Boiler Room Left Storage Area	W2	No Access	No Access	No Access	No Access	No Access	No Access
1	B	Boiler Room Left Storage Area	W3	No Access	No Access	No Access	No Access	No Access	No Access
1	B	Boiler Room Left Storage Area	W4	No Access	No Access	No Access	No Access	No Access	No Access
1	B	Boiler Room Left Storage Area	Ceiling	No Access	No Access	No Access	No Access	No Access	No Access
1	B	Boiler Room	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
1	B	Boiler Room	W1	Brick	White	Flaking	5	0.04	Negative
1	B	Boiler Room	W2	Concrete	White	Flaking	30	27.2	Positive
1	B	Boiler Room	W3	Concrete	White	Flaking	10	38.4	Positive
1	B	Boiler Room	W4	Concrete	White	Flaking	50	1.5	Positive
1	B	Boiler Room	Ceiling	Concrete	White	N/A	N/A	0.05	Negative
1	B	Electrical Room	Floor	Concrete	Brown	Friction	40	0.05	Negative
1	B	Electrical Room	W1	Brick	Gray	Flaking	15	16.2	Positive
1	B	Electrical Room	W2	Concrete	Gray	Flaking	20	10	Positive
1	B	Electrical Room	W3	Brick	Gray	Flaking	25	8.3	Positive
1	B	Electrical Room	W4	Brick	Gray	Flaking	15	4.6	Positive
1	B	Electrical Room	Ceiling	Concrete	white	None	0	7.3	Positive
1	B	Fan Room adjacent to Electrical Room	Floor	Concrete	Brown	N/A	N/A	0.01	Negative
1	B	Fan Room adjacent to Electrical Room	W1	Brick	Gray	N/A	N/A	0.09	Negative
1	B	Fan Room adjacent to Electrical Room	W2	Concrete	Gray	Flaking	20	0.4	Negative

		Dates: 11/21/2022-12/21/2023	Lead-Safe Certification Assessment Report						
		Michael A Martin Certification #006416	Theodore Roosevelt Elementary School						
		Inspection Company: Criterion Labs	430 Washington Ln, Philadelphia, PA 19144						
E l e m e n t	F l o o r	On-Site Room Name	Component	Substrate Material	Paint Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
1	B	Fan Room adjacent to Electrical Room	W3	Concrete	Gray	Flaking	30	0.03	Negative
1	B	Fan Room adjacent to Electrical Room	W4	Brick	Gray	N/A	N/A	0.21	Negative
1	B	Fan Room adjacent to Electrical Room	Ceiling	Concrete	White	N/A	N/A	0.17	Negative
1	B	Fan Room adjacent to Electrical Room	W1	Brick	White	Flaking	10	0.15	Negative
1	B	Fan Room adjacent to Electrical Room	W2	Concrete	White	None	N/A	0.16	Negative
1	B	Fan Room adjacent to Electrical Room	W3	Concrete	White	None	N/A	0.15	Negative
1	B	Fan Room adjacent to Electrical Room	W4	Brick	White	None	N/A	0.07	Negative
1	B	Fan Room adjacent to Electrical Room	Fan unit	Metal	Gray	Flaking	500	9.2	Positive
1	B	Hallway between Fan Rooms	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
1	B	Hallway between Fan Rooms	W1	Brick	Gray	N/A	0	0	Negative
1	B	Hallway between Fan Rooms	W2	Concrete	Gray	N/A	0	0.02	Negative
1	B	Hallway between Fan Rooms	W3	Brick	Gray	N/A	0	0.02	Negative
1	B	Hallway between Fan Rooms	W4	Brick	Gray	N/A	0	0.08	Negative
1	B	Hallway between Fan Rooms	Ceiling	Concrete	White	N/A	0	0.01	Negative
1	B	Fan Room Closest to Element 2	Floor	Concrete	Gray	N/A	0	0	Negative
1	B	Fan Room Closest to Element 2	W1	Brick	Gray	Flaking	4	0.8	Negative
1	B	Fan Room Closest to Element 2	W2	brick	Gray	Flaking	6	0.13	Negative
1	B	Fan Room Closest to Element 2	W3	brick	Gray	Flaking	5	0.07	Negative
1	B	Fan Room Closest to Element 2	W4	brick	Gray	Flaking	5	0.06	Negative
1	B	Fan Room Closest to Element 2	Ceiling	Concrete	White	N/A	0	0.11	Negative
1	B	Stairwell to Boiler Room	Floor	Concrete	gray	Flaking	5	6.2	Positive
1	B	Stairwell to Boiler Room	W1	brick	Tan	None	0	2.7	Positive
1	B	Stairwell to Boiler Room	W2	brick	Tan	Flaking	5	0.3	Negative
1	B	Stairwell to Boiler Room	W3	brick	Tan	Flaking	6	2.1	Positive
1	B	Stairwell to Boiler Room	W4	Concrete	Tan	Flaking	4	16.7	Positive
1	B	Stairwell to Boiler Room	Ceiling	Concrete	Gray	N/A	0	0	Negative
2	1	Hallway from Element 1 to Stairwell	Floor	Tile	N/A	N/A	0	N/A	N/A
2	1	Hallway from Element 1 to Stairwell	W1	CMU	Orange	N/A	0	0	Negative
2	1	Hallway from Element 1 to Stairwell	W2	CMU	Orange	N/A	0	0	Negative
2	1	Hallway from Element 1 to Stairwell	W3	CMU	Orange	N/A	0	0	Negative
2	1	Hallway from Element 1 to Stairwell	W4	CMU	Orange	N/A	0	0	Negative
2	1	Hallway from Element 1 to Stairwell	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
2	1	Element 2 Stairwell	Floor	Concrete	Blue	N/A	0	0	Negative
2	1	Element 2 Stairwell	W1	CMU	Tan	N/A	0	0.01	Negative
2	1	Element 2 Stairwell	W2	CMU	Tan	N/A	0	0	Negative
2	1	Element 2 Stairwell	W3	CMU	Tan	N/A	0	0	Negative

		Dates: 11/21/2022-12/21/2023	Lead-Safe Certification Assessment Report						
		Michael A Martin Certification #006416	Theodore Roosevelt Elementary School						
		Inspection Company: Criterion Labs	430 Washington Ln, Philadelphia, PA 19144						
E l e m e n t	F l o o r	On-Site Room Name	Component	Substrate Material	Paint Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
2	1	Element 2 Stairwell	W4	CMU	Tan	N/A	0	0	Negative
2	1	Element 2 Stairwell	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
2	1	Hallway from Stairwell to Gyms	Floor	Tile	N/A	N/A	N/A	N/A	N/A
2	1	Hallway from Stairwell to Gyms	W1	CMU	Blue	N/A	N/A	0	Negative
2	1	Hallway from Stairwell to Gyms	W2	CMU	Blue	N/A	N/A	0	Negative
2	1	Hallway from Stairwell to Gyms	W3	CMU	Yellow	N/A	N/A	0	Negative
2	1	Hallway from Stairwell to Gyms	W4	CMU	Tan	N/A	N/A	0.01	Negative
2	1	Hallway from Stairwell to Gyms	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
2	1	Hallway from Stairwell to Gyms Entrance Vestibule	Floor	N/A	N/A	N/A	N/A	N/A	N/A
2	1	Hallway from Stairwell to Gyms Entrance Vestibule	W1	N/A	N/A	N/A	N/A	N/A	N/A
2	1	Hallway from Stairwell to Gyms Entrance Vestibule	W2	N/A	N/A	N/A	N/A	N/A	N/A
2	1	Hallway from Stairwell to Gyms Entrance Vestibule	W3	N/A	N/A	N/A	N/A	N/A	N/A
2	1	Hallway from Stairwell to Gyms Entrance Vestibule	W4	N/A	N/A	N/A	N/A	N/A	N/A
2	1	Hallway from Stairwell to Gyms Entrance Vestibule	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
2	1	Girl's Gymnasium	Floor	Wood	N/A	N/A	N/A	N/A	N/A
2	1	Girl's Gymnasium	W1	CMU	Yellow	N/A	N/A	0.01	Negative
2	1	Girl's Gymnasium	W2	CMU	Yellow	N/A	N/A	0	Negative
2	1	Girl's Gymnasium	W3	CMU	Yellow	N/A	N/A	0	Negative
2	1	Girl's Gymnasium	W4	CMU	Yellow	N/A	N/A	0	Negative
2	1	Girl's Gymnasium	Ceiling	No Access	No Access	No Access	No Access	No Access	No Access
2	1	Girl's Gymnasium Locker Room	Floor	Tile	N/A	N/A	N/A	N/A	N/A
2	1	Girl's Gymnasium Locker Room	W1	CMU	Tan	N/A	N/A	0	Negative
2	1	Girl's Gymnasium Locker Room	W2	CMU	Tan	N/A	N/A	0	Negative
2	1	Girl's Gymnasium Locker Room	W3	CMU	Tan	N/A	N/A	0	Negative
2	1	Girl's Gymnasium Locker Room	W4	CMU	Tan	N/A	N/A	0	Negative
2	1	Girl's Gymnasium Locker Room	Ceiling	Drywall	Tan	N/A	N/A	0	Negative
2	1	Girl's Gymnasium Locker Room Restroom	Floor	Tile	N/A	N/A	N/A	0	Negative
2	1	Girl's Gymnasium Locker Room Restroom	W1	CMU	Tan	N/A	N/A	0	Negative
2	1	Girl's Gymnasium Locker Room Restroom	W2	CMU	Tan	N/A	N/A	0	Negative
2	1	Girl's Gymnasium Locker Room Restroom	W3	CMU	Tan	N/A	N/A	0	Negative
2	1	Girl's Gymnasium Locker Room Restroom	W4	CMU	Tan	N/A	N/A	0	Negative
2	1	Girl's Gymnasium Locker Room Restroom	Ceiling	Drywall	Tan	N/A	N/A	0	Negative
2	1	Girl's Gymnasium Equipment Storage	Floor	Tile	N/A	N/A	N/A	N/A	N/A
2	1	Girl's Gymnasium Equipment Storage	W1	CMU	Tan	N/A	N/A	0.03	Negative
2	1	Girl's Gymnasium Equipment Storage	W2	CMU	Tan	N/A	N/A	0.05	Negative
2	1	Girl's Gymnasium Equipment Storage	W3	CMU	Tan	N/A	N/A	0	Negative

		Dates: 11/21/2022-12/21/2023	Lead-Safe Certification Assessment Report						
		Michael A Martin Certification #006416	Theodore Roosevelt Elementary School						
		Inspection Company: Criterion Labs	430 Washington Ln, Philadelphia, PA 19144						
E l e m e n t	F l o o r	On-Site Room Name	Component	Substrate Material	Paint Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
2	1	Girl's Gymnasium Equipment Storage	W4	CMU	Tan	N/A	N/A	0.05	Negative
2	1	Girl's Gymnasium Equipment Storage	Ceiling	Drywall	Tan	N/A	N/A	0	Negative
2	1	Girl's Gymnasium Office	Floor	Tile	N/A	N/A	N/A	N/A	N/A
2	1	Girl's Gymnasium Office	W1	CMU	Yellow	N/A	N/A	0.06	Negative
2	1	Girl's Gymnasium Office	W2	CMU	Yellow	N/A	N/A	0.05	Negative
2	1	Girl's Gymnasium Office	W3	CMU	Yellow	N/A	N/A	0.12	Negative
2	1	Girl's Gymnasium Office	W4	CMU	Yellow	N/A	N/A	0.02	Negative
2	1	Girl's Gymnasium Office	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
2	1	Girl's Gymnasium Office Closet	Floor	Tile	Tan	N/A	N/A	N/A	N/A
2	1	Girl's Gymnasium Office Closet	W1	CMU	Tan	N/A	N/A	0.1	Negative
2	1	Girl's Gymnasium Office Closet	W2	CMU	Tan	N/A	N/A	0.05	Negative
2	1	Girl's Gymnasium Office Closet	W3	CMU	Tan	N/A	N/A	0.06	Negative
2	1	Girl's Gymnasium Office Closet	W4	CMU	Tan	N/A	N/A	0.08	Negative
2	1	Girl's Gymnasium Office Closet	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
2	1	Girl's Gymnasium Office Restroom	Floor	Tile	N/A	N/A	N/A	N/A	N/A
2	1	Girl's Gymnasium Office Restroom	W1	CMU	Tan	N/A	N/A	0	Negative
2	1	Girl's Gymnasium Office Restroom	W2	CMU	Tan	N/A	N/A	0	Negative
2	1	Girl's Gymnasium Office Restroom	W3	CMU	Tan	N/A	N/A	0	Negative
2	1	Girl's Gymnasium Office Restroom	W4	CMU	Tan	N/A	N/A	0	Negative
2	1	Girl's Gymnasium Office Restroom	Ceiling	Drywall	Tan	N/A	N/A	0	Negative
2	1	Girl's Gymnasium Office Restroom Pipe Chase	Floor	N/A	N/A	N/A	N/A	N/A	N/A
2	1	Girl's Gymnasium Office Restroom Pipe Chase	W1	N/A	N/A	N/A	N/A	N/A	N/A
2	1	Girl's Gymnasium Office Restroom Pipe Chase	W2	N/A	N/A	N/A	N/A	N/A	N/A
2	1	Girl's Gymnasium Office Restroom Pipe Chase	W3	N/A	N/A	N/A	N/A	N/A	N/A
2	1	Girl's Gymnasium Office Restroom Pipe Chase	W4	N/A	N/A	N/A	N/A	N/A	N/A
2	1	Girl's Gymnasium Office Restroom Pipe Chase	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
2	1	Girl's Restroom near Gymnasium	Floor	Tile	N/A	N/A	N/A	N/A	N/A
2	1	Girl's Restroom near Gymnasium	W1	CMU	Tan	N/A	N/A	0	Negative
2	1	Girl's Restroom near Gymnasium	W2	CMU	Tan	N/A	N/A	0	Negative
2	1	Girl's Restroom near Gymnasium	W3	CMU	Tan	N/A	N/A	0	Negative
2	1	Girl's Restroom near Gymnasium	W4	CMU	Tan	N/A	N/A	0	Negative
2	1	Girl's Restroom near Gymnasium	Ceiling	Drywall	Tan	N/A	N/A	0	Negative
2	1	Boy's Gymnasium	Floor	Wood	N/A	N/A	N/A	N/A	N/A
2	1	Boy's Gymnasium	W1	CMU	Blue	N/A	N/A	0.08	Negative
2	1	Boy's Gymnasium	W2	CMU	Blue	N/A	N/A	0.01	Negative
2	1	Boy's Gymnasium	W3	CMU	Blue	N/A	N/A	0.02	Negative

		Dates: 11/21/2022-12/21/2023	Lead-Safe Certification Assessment Report						
		Michael A Martin Certification #006416	Theodore Roosevelt Elementary School						
		Inspection Company: Criterion Labs	430 Washington Ln, Philadelphia, PA 19144						
E l e m e n t	F l o o r	On-Site Room Name	Component	Substrate Material	Paint Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
2	1	Boy's Gymnasium	W4	CMU	Blue	N/A	N/A	0	Negative
2	1	Boy's Gymnasium	Ceiling	No Access	No Access	No Access	No Access	No Access	No Access
2	1	Boy's Gymnasium Equipment Storage	Floor	Tile	N/A	N/A	N/A	N/A	N/A
2	1	Boy's Gymnasium Equipment Storage	W1	CMU	Tan	N/A	N/A	0.02	Negative
2	1	Boy's Gymnasium Equipment Storage	W2	CMU	Tan	N/A	N/A	0.12	Negative
2	1	Boy's Gymnasium Equipment Storage	W3	CMU	Tan	N/A	N/A	0	Negative
2	1	Boy's Gymnasium Equipment Storage	W4	CMU	Tan	N/A	N/A	0.13	Negative
2	1	Boy's Gymnasium Equipment Storage	Ceiling	Drywall	Tan	N/A	N/A	0	Negative
2	1	Boy's Gymnasium Equipment Storage Pipe Chase near Entrance	Floor	N/A	N/A	N/A	N/A	N/A	N/A
2	1	Boy's Gymnasium Equipment Storage Pipe Chase near Entrance	W1	N/A	N/A	N/A	N/A	N/A	N/A
2	1	Boy's Gymnasium Equipment Storage Pipe Chase near Entrance	W2	N/A	N/A	N/A	N/A	N/A	N/A
2	1	Boy's Gymnasium Equipment Storage Pipe Chase near Entrance	W3	N/A	N/A	N/A	N/A	N/A	N/A
2	1	Boy's Gymnasium Equipment Storage Pipe Chase near Entrance	W4	N/A	N/A	N/A	N/A	N/A	N/A
2	1	Boy's Gymnasium Equipment Storage Pipe Chase near Entrance	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
2	1	Boy's Gymnasium Equipment Storage Pipe Chase at Rear	Floor	N/A	N/A	N/A	N/A	N/A	N/A
2	1	Boy's Gymnasium Equipment Storage Pipe Chase at Rear	W1	N/A	N/A	N/A	N/A	N/A	N/A
2	1	Boy's Gymnasium Equipment Storage Pipe Chase at Rear	W2	N/A	N/A	N/A	N/A	N/A	N/A
2	1	Boy's Gymnasium Equipment Storage Pipe Chase at Rear	W3	N/A	N/A	N/A	N/A	N/A	N/A
2	1	Boy's Gymnasium Equipment Storage Pipe Chase at Rear	W4	N/A	N/A	N/A	N/A	N/A	N/A
2	1	Boy's Gymnasium Equipment Storage Pipe Chase at Rear	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
2	1	Boy's Gymnasium Locker Room	Floor	Tile	N/A	N/A	N/A	N/A	N/A
2	1	Boy's Gymnasium Locker Room	W1	CMU	Tan	N/A	N/A	0	Negative
2	1	Boy's Gymnasium Locker Room	W2	CMU	Tan	N/A	N/A	0.01	Negative
2	1	Boy's Gymnasium Locker Room	W3	CMU	Tan	N/A	N/A	0	Negative
2	1	Boy's Gymnasium Locker Room	W4	CMU	Tan	N/A	N/A	0	Negative
2	1	Boy's Gymnasium Locker Room	Ceiling	Drywall	Tan	N/A	N/A	0	Negative

		Dates: 11/21/2022-12/21/2023	Lead-Safe Certification Assessment Report						
		Michael A Martin Certification #006416	Theodore Roosevelt Elementary School						
		Inspection Company: Criterion Labs	430 Washington Ln, Philadelphia, PA 19144						
E l e m e n t	F l o o r	On-Site Room Name	Component	Substrate Material	Paint Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
2	1	Boy's Gymnasium Locker Room Restroom	Floor	Tile	N/A	N/A	N/A	N/A	N/A
2	1	Boy's Gymnasium Locker Room Restroom	W1	CMU	Tan	N/A	N/A	0	Negative
2	1	Boy's Gymnasium Locker Room Restroom	W2	CMU	Tan	N/A	N/A	0	Negative
2	1	Boy's Gymnasium Locker Room Restroom	W3	CMU	Tan	N/A	N/A	0	Negative
2	1	Boy's Gymnasium Locker Room Restroom	W4	CMU	Tan	N/A	N/A	0	Negative
2	1	Boy's Gymnasium Locker Room Restroom	Ceiling	Drywall	Tan	N/A	N/A	0	Negative
2	1	Boy's Gymnasium Office	Floor	Tile	N/A	N/A	N/A	N/A	N/A
2	1	Boy's Gymnasium Office	W1	CMU	Tan	N/A	N/A	0.02	Negative
2	1	Boy's Gymnasium Office	W2	CMU	Tan	N/A	N/A	0.04	Negative
2	1	Boy's Gymnasium Office	W3	CMU	Tan	N/A	N/A	0.01	Negative
2	1	Boy's Gymnasium Office	W4	CMU	Tan	N/A	N/A	0	Negative
2	1	Boy's Gymnasium Office	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
2	1	Boy's Gymnasium Office Closet	Floor	Tile	N/A	N/A	N/A	N/A	N/A
2	1	Boy's Gymnasium Office Closet	W1	CMU	Tan	N/A	N/A	0.02	Negative
2	1	Boy's Gymnasium Office Closet	W2	CMU	Tan	N/A	N/A	0.04	Negative
2	1	Boy's Gymnasium Office Closet	W3	CMU	Tan	N/A	N/A	0.02	Negative
2	1	Boy's Gymnasium Office Closet	W4	CMU	Tan	N/A	N/A	0.03	Negative
2	1	Boy's Gymnasium Office Closet	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
2	1	Boy's Gymnasium Office Restroom	Floor	N/A	N/A	N/A	N/A	N/A	N/A
2	1	Boy's Gymnasium Office Restroom	W1	CMU	Tan	N/A	N/A	0	Negative
2	1	Boy's Gymnasium Office Restroom	W2	CMU	Tan	N/A	N/A	0.01	Negative
2	1	Boy's Gymnasium Office Restroom	W3	CMU	Tan	N/A	N/A	0	Negative
2	1	Boy's Gymnasium Office Restroom	W4	CMU	Tan	N/A	N/A	0	Negative
2	1	Boy's Gymnasium Office Restroom	Ceiling	Drywall	Tan	N/A	N/A	0	Negative
2	1	Boy's Gymnasium Office Restroom Pipe Chase	Floor	N/A	N/A	N/A	N/A	N/A	N/A
2	1	Boy's Gymnasium Office Restroom Pipe Chase	W1	N/A	N/A	N/A	N/A	N/A	N/A
2	1	Boy's Gymnasium Office Restroom Pipe Chase	W2	N/A	N/A	N/A	N/A	N/A	N/A
2	1	Boy's Gymnasium Office Restroom Pipe Chase	W3	N/A	N/A	N/A	N/A	N/A	N/A
2	1	Boy's Gymnasium Office Restroom Pipe Chase	W4	N/A	N/A	N/A	N/A	N/A	N/A
2	1	Boy's Gymnasium Office Restroom Pipe Chase	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
2	1	Boy's Restroom near Gymnasium	Floor	Tile	N/A	N/A	N/A	N/A	N/A
2	1	Boy's Restroom near Gymnasium	W1	CMU	Tan	N/A	N/A	0.03	Negative
2	1	Boy's Restroom near Gymnasium	W2	CMU	Tan	N/A	N/A	0.01	Negative
2	1	Boy's Restroom near Gymnasium	W3	CMU	Tan	N/A	N/A	0	Negative
2	1	Boy's Restroom near Gymnasium	W4	CMU	Tan	N/A	N/A	0	Negative
2	1	Boy's Restroom near Gymnasium	Ceiling	Drywall	Tan	N/A	N/A	0	Negative

		Dates: 11/21/2022-12/21/2023	Lead-Safe Certification Assessment Report						
		Michael A Martin Certification #006416	Theodore Roosevelt Elementary School						
		Inspection Company: Criterion Labs	430 Washington Ln, Philadelphia, PA 19144						
E l e m e n t	F l o o r	On-Site Room Name	Component	Substrate Material	Paint Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
2	1	Classroom near Right side of Gymnasium	Floor	Tile	N/A	N/A	N/A	N/A	N/A
2	1	Classroom near Right side of Gymnasium	W1	Drywall	Tan	N/A	N/A	0	Negative
2	1	Classroom near Right side of Gymnasium	W2	CMU	Tan	N/A	N/A	0	Negative
2	1	Classroom near Right side of Gymnasium	W3	CMU	Tan	N/A	N/A	0	Negative
2	1	Classroom near Right side of Gymnasium	W4	CMU	Tan	N/A	N/A	0	Negative
2	1	Classroom near Right side of Gymnasium	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
2	1	Vestibule outside Classroom near Right side of Gymnasium	Floor	Tile	N/A	N/A	N/A	N/A	N/A
2	1	Vestibule outside Classroom near Right side of Gymnasium	W1	CMU	Tan	N/A	N/A	0	Negative
2	1	Vestibule outside Classroom near Right side of Gymnasium	W2	Drywall	Tan	N/A	N/A	0.01	Negative
2	1	Vestibule outside Classroom near Right side of Gymnasium	W3	CMU	Tan	N/A	N/A	0	Negative
2	1	Vestibule outside Classroom near Right side of Gymnasium	W4	CMU	Tan	N/A	N/A	0	Negative
2	1	Vestibule outside Classroom near Right side of Gymnasium	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
2	1	Ticket Booth	Floor	Concrete	Brown	N/A	N/A	0.02	Negative
2	1	Ticket Booth	W1	CMU	Tan	N/A	N/A	0	Negative
2	1	Ticket Booth	W2	CMU	Tan	N/A	N/A	0	Negative
2	1	Ticket Booth	W3	CMU	Tan	N/A	N/A	0	Negative
2	1	Ticket Booth	W4	CMU	Tan	N/A	N/A	0	Negative
2	1	Ticket Booth	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
2	1	Ticket Booth Pump Room	Floor	Concrete	Gray	N/A	N/A	0.02	Negative
2	1	Ticket Booth Pump Room	W1	CMU	Tan	N/A	N/A	0	Negative
2	1	Ticket Booth Pump Room	W2	Concrete	Tan	N/A	N/A	0	Negative
2	1	Ticket Booth Pump Room	W3	Concrete	Tan	N/A	N/A	0	Negative
2	1	Ticket Booth Pump Room	W4	CMU	Tan	N/A	N/A	0	Negative
2	1	Ticket Booth Pump Room	Ceiling	Concrete	Tan	N/A	N/A	0	Negative
1	A	Auditorium Attic	Floor	N/A	N/A	N/A	N/A	N/A	N/A
1	A	Auditorium Attic	W1	N/A	N/A	N/A	N/A	N/A	N/A
1	A	Auditorium Attic	W2	N/A	N/A	N/A	N/A	N/A	N/A
1	A	Auditorium Attic	W3	N/A	N/A	N/A	N/A	N/A	N/A
1	A	Auditorium Attic	W4	N/A	N/A	N/A	N/A	N/A	N/A
1	A	Auditorium Attic	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
1	A	Main Attic	Floor	N/A	N/A	N/A	N/A	N/A	N/A

		Dates: 11/21/2022-12/21/2023	Lead-Safe Certification Assessment Report						
		Michael A Martin Certification #006416	Theodore Roosevelt Elementary School						
		Inspection Company: Criterion Labs	430 Washington Ln, Philadelphia, PA 19144						
E l e m e n t	F l o o r	On-Site Room Name	Component	Substrate Material	Paint Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
1	A	Main Attic	W1	N/A	N/A	N/A	N/A	N/A	N/A
1	A	Main Attic	W2	N/A	N/A	N/A	N/A	N/A	N/A
1	A	Main Attic	W3	N/A	N/A	N/A	N/A	N/A	N/A
1	A	Main Attic	W4	N/A	N/A	N/A	N/A	N/A	N/A
1	A	Main Attic	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
1	C	Crawlspace	Floor	N/A	N/A	N/A	N/A	N/A	N/A
1	C	Crawlspace	W1	N/A	N/A	N/A	N/A	N/A	N/A
1	C	Crawlspace	W2	N/A	N/A	N/A	N/A	N/A	N/A
1	C	Crawlspace	W3	N/A	N/A	N/A	N/A	N/A	N/A
1	C	Crawlspace	W4	N/A	N/A	N/A	N/A	N/A	N/A
1	C	Crawlspace	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
1	C	Crawlspace	Floor	N/A	N/A	N/A	N/A	N/A	N/A
1	3	Classroom 313	sill	Concrete	Brown	Chipping	2	0.04	Negative
1	3	Classroom 313	baseboard	Wood	Brown	None	N/A	0.26	Negative
1	3	Classroom 313	radiator	Metal	Grey	None	N/A	0.27	Negative
1	3	Classroom 313	drain pipe	Metal	Tan	None	N/A	0.3	Negative
1	3	Classroom 313	door	Wood	Brown	None	N/A	0	Negative
1	3	Classroom 314	Baseboard	Wood	Brown	None	N/A	0.05	Negative
1	3	Classroom 314	blackboard frame	Wood	Brown	None	N/A	0.09	Negative
1	3	Classroom 314	riser	Metal	Tan	None	0	6.4	Positive
1	3	Classroom 314	door	Wood	Brown	None	N/A	0	Negative
1	3	Stairwell Across from Classroom 212	radiator	Metal	Gray	None	N/A	0.05	Negative
1	3	Stairwell Across from Classroom 212	handrail	Wood	Brown	None	N/A	0.06	Negative
1	3	Stairwell Across from Classroom 212	stair post	Metal	Brown	None	N/A	0.22	Negative
1	3	Classroom 324A	radiator	Metal	Grey	None	0	1.9	Positive
1	3	Classroom 324A	riser	Metal	Tan	None	N/A	0.01	Negative
1	3	Classroom 324A	baseboard	Concrete	Brown	None	N/A	0.13	Negative
1	3	Classroom 324B	baseboard	Concrete	Brown	None	N/A	0.12	Negative
1	3	Classroom 324B	door	Wood	Brown	None	N/A	0	Negative
1	3	Classroom 324A	door	Wood	Brown	None	N/A	0	Negative
1	3	Classroom 315	blackboard frame	Wood	Brown	None	N/A	0.05	Negative
1	3	Classroom 315	radiator	Metal	Grey	None	N/A	0.04	Negative
1	3	Classroom 315	baseboard	Concrete	Brown	None	N/A	0.03	Negative
1	3	Classroom 315	window apron	Wood	Brown	None	N/A	0.11	Negative

		Dates: 11/21/2022-12/21/2023	Lead-Safe Certification Assessment Report						
		Michael A Martin Certification #006416	Theodore Roosevelt Elementary School						
		Inspection Company: Criterion Labs	430 Washington Ln, Philadelphia, PA 19144						
E l e m e n t	F l o o r	On-Site Room Name	Component	Substrate Material	Paint Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
1	3	Classroom 315	door	Wood	Brown	None	N/A	0	Negative
1	3	Girl's Restroom across from Classroom 316	frame	Metal	Black	None	N/A	0.11	Negative
1	3	Girl's Restroom across from Classroom 316	frame	Metal	Tan	None	N/A	0.19	Negative
1	1	Custodial Closet across from Storage Room 100	Drain Line	Metal	Blue	None	N/A	0.18	Negative
1	1	Custodial Closet across from Storage Room 100	Riser Cover	Metal	Tan	None	N/A	0.27	Negative
1	1	1st Floor Stairwell 1	baseboard	Concrete	Blue	None	N/A	0.5	Negative
1	1	1st Floor Stairwell 1	riser	Metal	Tan	None	0	3.6	Positive
1	1	1st Floor Stairwell 1	radiator	Metal	Gray	None	N/A	0.03	Negative
1	1	1st Floor Stairwell 1	handrail	Wood	Brown	None	N/A	0.07	Negative
1	1	1st Floor Stairwell 1	stair post	Metal	Brown	None	N/A	0.09	Negative
1	3	Lounge outside Women's Restroom next to Classroom 316	baseboard	Wood	Brown	None	N/A	0.08	Negative
1	3	Lounge outside Women's Restroom next to Classroom 316	radiator	Metal	Grey	None	N/A	0.23	Negative
1	3	Lounge outside Women's Restroom next to Classroom 316	window apron	Wood	Brown	None	N/A	0.05	Negative
1	3	Lounge outside Women's Restroom next to Classroom 316	door	Wood	Brown	None	N/A	0	Negative
1	3	Lounge outside Women's Restroom next to Classroom 316	drain line	Metal	Tan	None	N/A	0.14	Negative
1	3	Classroom 317	baseboard	Wood	Brown	None	N/A	0.05	Negative
1	3	Classroom 317	radiator	Metal	Grey	None	0	7.22	Positive
1	3	Classroom 317	window apron	Wood	Brown	None	N/A	0.04	Negative
1	3	Classroom 317	door	Wood	Brown	None	N/A	0	Negative
1	3	Classroom 318	baseboard	Wood	Brown	None	N/A	0.06	Negative
1	3	Classroom 318	radiator	Metal	Grey	None	N/A	0.05	Negative
1	3	Classroom 318	door	Wood	Brown	None	N/A	0	Negative
1	3	Fire Stairwell near Classroom 316	door	Metal	Red	None	N/A	0	Negative
1	3	Classroom 319	radiator	Metal	Grey	None	N/A	0.5	Negative
1	3	Classroom 319	baseboard	Wood	Brown	None	N/A	0.06	Negative
1	3	Classroom 319	riser	Metal	Tan	None	N/A	0.02	Negative
1	3	Classroom 319	door	Wood	Brown	None	N/A	0	Negative
1	3	Classroom 320	radiator	Metal	Grey	None	N/A	0.05	Negative
1	3	Classroom 320	baseboard	Wood	Brown	None	N/A	0.1	Negative
1	3	Classroom 320	window apron	Wood	Brown	None	N/A	0.6	Negative
1	3	Classroom 320	door	Wood	Brown	None	N/A	0	Negative

		Dates: 11/21/2022-12/21/2023	Lead-Safe Certification Assessment Report						
		Michael A Martin Certification #006416	Theodore Roosevelt Elementary School						
		Inspection Company: Criterion Labs	430 Washington Ln, Philadelphia, PA 19144						
E l e m e n t	F l o o r	On-Site Room Name	Component	Substrate Material	Paint Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
1	3	Classroom 321	riser	Metal	Tan	None	N/A	0	Negative
1	3	Classroom 321	radiator	Metal	Grey	None	N/A	0.18	Negative
1	3	Classroom 321	baseboard	Wood	Brown	None	N/A	0.1	Negative
1	3	Classroom 321	door	Wood	Brown	None	N/A	0.01	Negative
1	3	Classroom 322	blackboard frame	Wood	Brown	None	N/A	0.03	Negative
1	3	Classroom 322	baseboard	Wood	Brown	None	N/A	0.05	Negative
1	3	Classroom 322	radiator	Metal	Grey	None	N/A	0.04	Negative
1	3	Classroom 322	window apron	Wood	Black	None	N/A	0.11	Negative
1	3	Fire Stair near Classroom 301	door	Metal	Red	None	N/A	0	Negative
1	3	Copy Room 301	radiator	Metal	Grey	None	N/A	0.02	Negative
1	3	Copy Room 301 Office	radiator	Metal	Gray	None	N/A	0.01	Negative
1	3	Copy Room 301	door	Wood	Brown	None	N/A	0	Negative
1	3	Classroom 302	radiator	Metal	Grey	None	N/A	0.01	Negative
1	3	Classroom 302	baseboard	Wood	Brown	None	N/A	0.18	Negative
1	3	Classroom 302	window apron	Wood	Brown	None	N/A	0.12	Negative
1	3	Classroom 302	window frame	Wood	Brown	None	N/A	0.1	Negative
1	3	Classroom 302	riser	Metal	Tan	None	N/A	0.8	Negative
1	3	Classroom 302	blackboard frame	Wood	Brown	None	N/A	0	Negative
1	3	Classroom 302	closet door	Wood	Brown	None	N/A	0.03	Negative
1	3	Classroom 302	door	Wood	Brown	None	N/A	0.01	Negative
1	3	Lounge outside Men's Restroom next to Classroom 302	radiator	Metal	Grey	None	N/A	0.03	Negative
1	3	Lounge outside Men's Restroom next to Classroom 302	baseboard	Wood	Brown	None	N/A	0.05	Negative
1	3	Lounge outside Men's Restroom next to Classroom 302	door	Wood	Brown	None	N/A	0	Negative
1	3	Lounge outside Men's Restroom next to Classroom 302	drain line	Metal	Tan	None	N/A	0.2	Negative
1	3	Men's Restroom next to Classroom 302	door casing	Wood	Brown	None	N/A	0.05	Negative
1	3	Men's Restroom next to Classroom 302	door	Wood	Brown	None	N/A	0.01	Negative
1	3	Classroom 303	radiator	Metal	Grey	None	N/A	0.07	Negative
1	3	Classroom 303	riser	Metal	Tan	None	0	16.9	Positive
1	3	Classroom 303	door	Wood	Brown	None	N/A	0	Negative
1	3	Stairwell across from Classroom 303	radiator	Metal	Gray	None	N/A	0.09	Negative
1	3	Stairwell across from Classroom 303	riser	Metal	Brown	None	N/A	2.6	Negative

		Dates: 11/21/2022-12/21/2023	Lead-Safe Certification Assessment Report						
		Michael A Martin Certification #006416	Theodore Roosevelt Elementary School						
		Inspection Company: Criterion Labs	430 Washington Ln, Philadelphia, PA 19144						
E l e m e n t	F l o o r	On-Site Room Name	Component	Substrate Material	Paint Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
1	3	Custodial Closet across from Classroom 303	riser	Metal	Tan	None	0	14	Positive
1	3	Custodial Closet across from Classroom 303	baseboard	Wood	Brown	None	N/A	0.08	Negative
1	3	Classroom 304	riser	Metal	Tan	None	0	17	Positive
1	3	Classroom 304	radiator	Metal	Grey	None	N/A	0.02	Negative
1	3	Classroom 304	baseboard	Wood	Brown	None	N/A	0.06	Negative
1	3	Custodial Closet across from Classroom 303	riser	Metal	Tan	None	N/A	0.01	Negative
1	3	Custodial Closet across from Classroom 303	door	Wood	Brown	None	N/A	0	Negative
1	3	Custodial Closet across from Classroom 303	door casing	Wood	Brown	None	N/A	0	Negative
1	3	Boy's Restroom across from Classroom 303	door casing	Wood	Brown	None	N/A	0	Negative
1	3	Storage Room 300A	door casing	Wood	Brown	None	N/A	0	Negative
1	3	Storage Room 300A	radiator	Metal	Grey	None	N/A	0.9	Negative
1	3	Storage Room 300A	Floor	Wood	Brown	None	N/A	0	Negative
1	3	Room next to Stairwell across from Classroom 305	door	Wood	Brown	None	N/A	0	Negative
1	3	Room next to Stairwell across from Classroom 305	radiator	Wood	Brown	None	N/A	0.04	Negative
1	3	Stairwell across from Classroom 305	riser	Metal	Tan	Chipping	5	0.28	Negative
1	3	Stairwell across from Classroom 305	handrail	Wood	Brown	None	N/A	0.13	Negative
1	3	Stairwell across from Classroom 305	balusters	Metal	Brown	None	N/A	0.16	Negative
1	3	Classroom 306	door	Wood	Brown	Chipping	2	0	Negative
1	3	Classroom 306	radiator	Metal	Grey	None	0	2.2	Positive
1	3	Classroom 306	baseboard	Wood	Brown	None	N/A	0.08	Negative
1	3	Classroom 306	riser	Metal	Tan	None	0	9.3	Positive
1	3	Classroom 307	door chase	Wood	Brown	Chipping	1	0	Negative
1	3	Classroom 307	baseboard	Wood	Brown	None	N/A	0.11	Negative
1	3	Classroom 307	riser	Metal	Tan	None	0	2.1	Positive
1	3	Classroom 307	drainline	Metal	Tan	None	0	26	Positive
1	3	Classroom 307	window sill	Wood	Brown	None	N/A	0.06	Negative
1	3	Classroom 308	door casing	Wood	Brown	None	N/A	0.03	Negative
1	3	Classroom 308	riser	Metal	Grey	None	0	4.1	Positive
1	3	Classroom 308	baseboard	Wood	Brown	Chipping	1	0.21	Negative
1	3	Classroom 309	door casing	Wood	Brown	None	N/A	0	Negative
1	3	Classroom 309	riser	Metal	Grey	None	0	2.8	Positive
1	3	Classroom 309	riser	Metal	Tan	None	N/A	0	Negative
1	3	Classroom 309	baseboard	Wood	Brown	None	N/A	0.3	Negative
1	3	Classroom 309	radiator	Metal	Grey	Chipping	5	0.06	Negative
1	3	Classroom 309	apron	wood	Brown	None	0	0.09	Positive
1	3	Classroom 310	door	wood	Brown	Chipping	4	0	Negative

		Dates: 11/21/2022-12/21/2023	Lead-Safe Certification Assessment Report						
		Michael A Martin Certification #006416	Theodore Roosevelt Elementary School						
		Inspection Company: Criterion Labs	430 Washington Ln, Philadelphia, PA 19144						
E l e m e n t	F l o o r	On-Site Room Name	Component	Substrate Material	Paint Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
1	3	Classroom 310	riser	Metal	Grey	None	0	7.4	Positive
1	3	Classroom 310	window casing	Wood	Brown	None	N/A	0.08	Negative
1	3	Classroom 310	window sill	Wood	Brown	None	N/A	0.1	Negative
1	3	Classroom 310	window apron	Wood	Brown	None	N/A	0.05	Negative
1	3	Classroom 310	baseboard	Wood	Brown	None	N/A	0.02	Negative
1	3	Classroom 311	baseboard	Wood	Brown	None	N/A	0.1	Negative
1	3	Classroom 311	door casing	Wood	Brown	None	N/A	0.1	Negative
1	3	Classroom 312	door casing	Wood	Brown	None	N/A	0.11	Negative
	3	room 311 closer	baseboard	Wood	Brown	None	N/A	0.04	Negative
1	3	Classroom 312	door casing	Wood	Brown	None	N/A	0	Negative
1	3	Classroom 312	riser	Metal	Tan	None	0	4.7	Positive
1	3	Classroom 312	drainline	Metal	Tan	None	N/A	0	Negative
1	3	Classroom 312	drainline	Metal	Blue	None	N/A	0	Negative
1	3	Classroom 312	baseboard	Wood	Tan	None	N/A	0	Negative
1	3	Classroom 312	radiator	Metal	Tan	None	N/A	0.04	Negative
1	3	Classroom 312	door casing	Wood	Brown	None	N/A	0	Negative
1	3	Classroom 312	door	Wood	Brown	None	N/A	0	Negative
1	3	Boy's Restroom across from Classroom 303	W1	Plaster	Tan	None	0	19.6	Positive
1	3	Boy's Restroom across from Classroom 303	W2	Plaster	Tan	None	0	22.6	Positive
1	3	Boy's Restroom across from Classroom 303	W4	Plaster	Tan	None	0	25.7	Positive
1	3	Hallway outside Classrooms 306-313	radiator	Metal	Gray	None	N/A	0.5	Negative
1	3	Hallway outside Classrooms 306-313	radiator	Metal	Gray	None	N/A	0.27	Negative
1	3	Hallway outside Classrooms 306-313	radiator	Metal	Gray	None	N/A	0.5	Negative
1	3	Hallway outside Classrooms 306-313	riser	Metal	Tan	None	0	14.4	Positive
1	3	Hallway outside Classrooms 306-313	riser	Metal	Tan	None	0	19.8	Positive
1	3	Hallway outside Classrooms 306-313	radiator	Metal	Grey	None	N/A	0.5	Negative
1	3	Hallway outside Classrooms 306-313	radiator	Metal	Grey	None	N/A	0.7	Negative
1	3	Hallway outside Classrooms 306-313	riser	Metal	Grey	None	0	15.8	Positive
1	3	Hallway outside Classrooms 306-313	riser	Metal	Grey	None	N/A	0.4	Negative
1	3	Classroom 316	baseboard	Wood	Brown	None	N/A	0.06	Negative
1	3	Classroom 316	radiator	Metal	Grey	None	N/A	0.3	Negative
1	3	Classroom 316	window apron	Wood	Brown	None	N/A	0.06	Negative
1	3	Classroom 316	window sill	Wood	Brown	None	N/A	0	Negative
1	3	Classroom 316	riser	Metal	Tan	None	0	2.2	Positive
1	3	Classroom 316	door	Wood	Brown	None	N/A	0	Negative
1	3	Girl's Restroom across from Classroom 316	W1	Plaster	Tan	None	N/A	0.02	Negative

		Dates: 11/21/2022-12/21/2023	Lead-Safe Certification Assessment Report						
		Michael A Martin Certification #006416	Theodore Roosevelt Elementary School						
		Inspection Company: Criterion Labs	430 Washington Ln, Philadelphia, PA 19144						
E l e m e n t	F l o o r	On-Site Room Name	Component	Substrate Material	Paint Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
1	3	Girl's Restroom across from Classroom 316	W4	Plaster	Tan	None	N/A	0.4	Negative
1	3	Girl's Restroom across from Classroom 316	W2	Plaster	Tan	None	0	1.7	Positive
1	3	Girl's Restroom across from Classroom 316	W3	Plaster	Tan	None	0	2.8	Positive
1	3	Hallway outside Classrooms 317-302	radiator	Metal	Grey	None	N/A	0.22	Negative
1	3	Hallway outside Classrooms 317-302	riser	Metal	Tan	None	N/A	0.1	Negative
1	3	Hallway outside Classrooms 317-303	riser	Metal	Tan	None	0	10.8	Positive
1	3	Hallway outside Classrooms 317-302	radiator	Metal	Gray	None	N/A	0.07	Negative
1	3	Hallway outside Classrooms 317-302	riser	Metal	Tan	None	0	18.9	Positive
1	3	Hallway outside Classrooms 317-302	radiator	Metal	Grey	None	N/A	0.29	Negative
1	3	Hallway outside Classrooms 317-302	riser	Metal	Tan	None	N/A	0.08	Negative
1	3	Hallway outside Classrooms 317-302	radiator	Metal	Grey	None	N/A	0.5	Negative
1	3	Hallway outside Classrooms 317-302	riser	Metal	Tan	None	0	16.3	Positive
1	3	Hallway outside Classrooms 317-302	radiator	Metal	Grey	None	N/A	0.5	Negative
1	3	Hallway outside Classrooms 317-302	radiator	Metal	Gray	None	N/A	0.4	Negative
1	3	Hallway outside Classrooms 317-302	riser	Metal	Tan	None	0	15.2	Positive
1	2	Classroom 203	baseboard	Wood	Brown	None	N/A	0.1	Negative
1	2	Classroom 203	window Apron	Wood	Brown	None	N/A	0.04	Negative
1	2	Stairwell across from Classroom 203	radiator	Metal	Gray	None	0	1.9	Positive
1	2	Stairwell across from Classroom 203	stair post	Wood	Brown	None	N/A	0.27	Negative
1	2	Stairwell across from Classroom 203	riser	Metal	Tan	None	0	17.2	Positive
1	2	IMC Room 204/205 Work Room	baseboard	Wood	Grey	None	N/A	0.3	Negative
1	2	Classroom 203	door	Wood	Brown	None	N/A	0	Negative
1	2	Classroom 200A	radiator	Metal	Grey	None	0	1.4	Positive
1	2	Classroom 200A	riser	Metal	Tan	None	N/A	0.03	Negative
1	2	Classroom 200A	door	Wood	Brown	None	N/A	0	Negative
	2	200B	door	Wood	Brown	None	N/A	0	Negative
1	2	Classroom 200C	riser	Metal	Tan	None	N/A	0.23	Negative
1	2	Classroom 200C	radiator	Metal	Tan	None	0	1.9	Positive
	2	200 C	baseboard	Wood	Brown	None	N/A	0	Negative
1	2	IMC Room 204/205	radiator	Metal	Grey	None	0	1.7	Positive
1	2	IMC Room 204/205	Baseboard	Wood	Grey	None	N/A	0.4	Negative
1	2	IMC Room 204/205	door	Wood	Brown	None	N/A	0	Negative
1	2	Vice Principal's Office 206A	window casing	Wood	Brown	None	N/A	14.8	Negative
1	2	Vice Principal's Office 206A	window sill	Wood	Brown	None	N/A	0	Negative
1	2	Vice Principal's Office 206A	window apron	Wood	Brown	None	N/A	0.04	Negative
1	2	Vice Principal's Office 206A	window casing	Metal	Brown	None	N/A	0.03	Negative

		Dates: 11/21/2022-12/21/2023	Lead-Safe Certification Assessment Report						
		Michael A Martin Certification #006416	Theodore Roosevelt Elementary School						
		Inspection Company: Criterion Labs	430 Washington Ln, Philadelphia, PA 19144						
E l e m e n t	F l o o r	On-Site Room Name	Component	Substrate Material	Paint Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
1	2	Vice Principal's Office 206A	door casing	Wood	Brown	None	N/A	0.04	Negative
1	2	Office 206C	window apron	Wood	Brown	None	N/A	0.05	Negative
1	2	Office 206C	riser	Metal	Tan	None	0	9.1	Positive
1	2	Office 206C	window casing	Metal	Brown	None	N/A	0	Negative
1	2	Office 206C	door casing	Metal	Brown	None	N/A	0.02	Negative
1	2	Office 206D	riser	Metal	Tan	None	0	5.9	Positive
1	2	Office 206D	Baseboard	Wood	Brown	None	N/A	0.12	Negative
1	2	Office 206D	window apron	Wood	Brown	None	N/A	0.06	Negative
1	2	Office 206D	door casing	Metal	Brown	None	N/A	0.2	Negative
1	2	Office 206D	window casing	Metal	Brown	None	N/A	0.08	Negative
1	2	Office 206B	window casing	Wood	Brown	None	0	17.1	Positive
1	2	Office 206B	Baseboard	Wood	Brown	None	N/A	0.12	Negative
1	2	Office 206B	riser	Metal	Tan	None	0	5.7	Positive
1	2	Office 206B	window casing	Metal	Brown	None	N/A	0.03	Negative
1	2	Office 206B	door casing	Metal	Brown	None	N/A	0.02	Negative
1	2	Office 206E	window casing	Metal	Brown	None	N/A	0.02	Negative
1	2	Office 206E	door casing	Metal	Brown	None	N/A	0.06	Negative
1	2	Second Office from Left in Conference Room	Baseboard	Wood	Brown	None	0	0.05	Positive
1	2	Second Office from Left in Conference Room	door casing	Metal	Brown	None	N/A	0.06	Negative
1	2	Second Office from Left in Conference Room	window casing	Metal	Brown	None	N/A	0.01	Negative
1	2	Second Office from Left in Conference Room	riser	Metal	Tan	None	0	6.3	Positive
1	2	Second Office from Left in Conference Room	Baseboard	Wood	Brown	None	N/A	0.05	Negative
1	2	Second Office from Left in Conference Room	window casing	Metal	Brown	None	N/A	0.02	Negative
1	2	Second Office from Left in Conference Room	door casing	Metal	Brown	None	N/A	0.01	Negative
1	2	Office next to Counselor's Office	drainline	Metal	Tan	None	N/A	0.4	Negative
1	2	Office next to Counselor's Office	riser	Metal	Tan	None	0	8.3	Positive
1	2	Office next to Counselor's Office	door casing	Metal	Brown	None	N/A	0.01	Negative
1	2	Art Room 208	Baseboard	Wood	Grey	None	N/A	0.05	Negative
1	2	Art Room 208 Storage	Baseboard	Wood	Grey	None	N/A	0.02	Negative
1	2	Stairwell Next to Main Office	column	Plaster	White	None	0	26.5	Positive
1	2	Stairwell Next to Main Office	handrail	Wood	Black	None	0	26.6	Positive
1	2	Stairwell Next to Main Office	handrail post	Metal	Black	None	N/A	0.01	Negative
1	2	Teacher's Lounge 209	radiator	Metal	Grey	None	N/A	0.01	Negative
1	2	Teacher's Lounge 209	Baseboard	Wood	Brown	None	N/A	0.05	Negative
1	2	Teacher's Lounge 209	door	Wood	Brown	None	N/A	0.05	Negative
1	2	Nurse's Office Waiting Area	door	Wood	Brown	None	N/A	0	Negative

		Dates: 11/21/2022-12/21/2023	Lead-Safe Certification Assessment Report						
		Michael A Martin Certification #006416	Theodore Roosevelt Elementary School						
		Inspection Company: Criterion Labs	430 Washington Ln, Philadelphia, PA 19144						
E l e m e n t	F l o o r	On-Site Room Name	Component	Substrate Material	Paint Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
1	2	Nurse's Office	window casing	Wood	Brown	None	N/A	0.03	Negative
1	2	Nurse's Office	window apron	Wood	Brown	None	N/A	0.06	Negative
1	2	Nurse's Office Restroom	drainline	Metal	Yellow	None	N/A	0.02	Negative
1	2	Nurse's Office	Baseboard	Wood	Brown	None	N/A	0.04	Negative
1	2	Classroom 210	radiator	Metal	Gray	None	N/A	0.04	Negative
1	2	Classroom 210	door	Wood	Grey	None	N/A	0	Negative
1	2	Classroom 211 Storage	drainline	Metal	White	None	N/A	0	Negative
1	2	Classroom 211	radiator	Metal	Gray	None	0	1.3	Positive
1	2	Classroom 211	Baseboard	Wood	Gray	None	N/A	0.11	Negative
1	2	Stairwell Across from Classroom 212	handrail	Wood	Brown	None	N/A	0.26	Negative
1	2	Stairwell Across from Classroom 212	stair post	Metal	Brown	None	N/A	0.06	Negative
1	2	Stairwell Across from Classroom 212	radiator	Metal	silver	None	N/A	2.3	Negative
1	2	Stairwell Across from Classroom 212	riser	Metal	Tan	None	N/A	3.2	Negative
1	2	Classroom 212	Baseboard	Wood	Brown	No Access	N/A	0.07	Negative
1	2	Classroom 212	radiator	Metal	Gray	None	0	1.5	Positive
1	2	Classroom 212	drainline	Metal	Tan	None	0	32.8	Positive
1	2	Classroom 221A	Radiator	Metal	Gray	None	N/A	0.04	Negative
1	2	Classroom 221A	riser	Metal	Tan	None	N/A	0.01	Negative
1	2	Classroom 213	Baseboard	Wood	Brown	None	N/A	0.04	Negative
1	2	Classroom 213	radiator	Metal	Gray	None	0	1.7	Positive
1	2	Classroom 213	riser	Metal	Gray	None	0	5.8	Positive
1	2	Classroom 213	blackboard frame	Wood	Brown	None	N/A	0.08	Negative
1	2	Classroom 213	door	Wood	Brown	None	N/A	0	Negative
1	2	Classroom 221B	Radiator	Metal	Brown	None	N/A	0	Negative
1	2	Classroom 221B	Door	Wood	Brown	None	N/A	0	Negative
1	2	Classroom 221C	Door	Wood	Brown	None	N/A	0	Negative
1	2	Girl's Restroom across from Classroom 214	W2	CMU	Tan	None	N/A	0	Negative
1	2	Girl's Restroom across from Classroom 214	Drainline	Metal	Tan	None	0	16.4	Positive
1	2	Girl's Restroom across from Classroom 214	Door	Wood	Brown	None	N/A	0	Negative
1	2	Girl's Restroom across from Classroom 214	W4	Brick	Grey	None	N/A	0.01	Negative
1	2	Girl's Restroom across from Classroom 214	stall frame	Metal	Grey	None	N/A	0.26	Negative
1	2	Girl's Restroom across from Classroom 214	Stall frame	Metal	Tan	None	0	0.3	Positive
1	2	Stairwell Next to Classroom 214	radiator	Metal	Gray	None	0	1.6	Positive
1	2	Stairwell Next to Classroom 214	Handrail	Wood	Brown	None	N/A	0	Negative
1	2	Stairwell Next to Classroom 214	Stair post	Metal	Brown	None	0	3	Positive

		Dates: 11/21/2022-12/21/2023	Lead-Safe Certification Assessment Report						
		Michael A Martin Certification #006416	Theodore Roosevelt Elementary School						
		Inspection Company: Criterion Labs	430 Washington Ln, Philadelphia, PA 19144						
E l e m e n t	F l o o r	On-Site Room Name	Component	Substrate Material	Paint Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
1	2	Stairwell Next to Classroom 214	riser	Metal	Tan	None	0	1.5	Positive
1	2	Lounge outside Women;s Restroom Adjacent to 214	Radiator	Metal	Gray	None	N/A	0.01	Negative
1	2	Lounge outside Women;s Restroom Adjacent to 214	Baseboard	Wood	Brown	Flaking	10	0.07	Negative
1	2	Classroom 215	Baseboard	Wood	Gray	None	N/A	0.09	Negative
1	2	Classroom 215	Radiator	Metal	Gray	None	N/A	0	Negative
1	2	Classroom 215	Door	Wood	Brown	None	N/A	0	Negative
1	2	Classroom 216	Riser	Wood	Tan	None	N/A	0	Negative
1	2	Classroom 216	Radiator	Metal	Gray	None	0	1.7	Positive
1	2	Classroom 216	Baseboard	Wood	Brown	None	N/A	0.11	Negative
1	2	Classroom 216	Window Apron	Wood	Brown	None	N/A	0.04	Negative
1	2	Classroom 216	Blackboard Casing	Wood	Brown	None	N/A	0.03	Negative
1	2	Classroom 216	Door	Wood	Brown	None	N/A	0	Negative
1	2	Classroom 217	Radiator	Metal	Gray	None	N/A	0.01	Negative
1	2	Classroom 217	Baseboard	Wood	Brown	None	N/A	0.25	Negative
1	2	Classroom 217	Risers	Metal	Tan	None	N/A	0.01	Negative
1	2	Classroom 217	Window Apron	Wood	Brown	None	N/A	0.06	Negative
1	2	Classroom 217	Door	Wood	Brown	None	N/A	0	Negative
1	2	Classroom 217	Door Casing	Wood	Brown	None	N/A	0.05	Negative
1	2	Storage across from Classroom 218	Radiator	Metal	Gray	None	N/A	0.05	Negative
1	2	Storage across from Classroom 218	Door	Metal	Brown	None	N/A	0.02	Negative
1	2	Classroom 219	Riser	Metal	Tan	None	N/A	0	Negative
1	2	Classroom 219	Radiator	Metal	Gray	None	0	2	Positive
1	2	Classroom 219	Baseboard	Wood	Brown	None	N/A	0.04	Negative
1	2	Storage across from classroom 219	Door Casing	Wood	Brown	None	N/A	0.01	Negative
1	2	Storage across from classroom 219	Door	Wood	Brown	None	N/A	0.04	Negative
1	2	Classroom 220	Radiator	Metal	Gray	None	0	2.1	Positive
1	2	Classroom 220	Baseboard	Wood	Brown	None	N/A	0	Negative
1	2	Classroom 220	Riser	Metal	Tan	None	N/A	0	Negative
1	2	Classroom 220	Window Apron	Wood	Brown	None	N/A	0	Negative
1	2	Classroom 220	Closet Door	Wood	Brown	None	N/A	0.06	Negative
1	2	Classroom 201	Radiator	Steel	gray	None	0	1.9	Positive
1	2	Classroom 201	Baseboard	Wood	brown	None	N/A	0.08	Negative
1	2	Classroom 201	Riser	Steel	tan	None	N/A	0	Negative
1	2	Classroom 201	Window Casing	wood	brown	None	N/A	0.1	Negative
1	2	Classroom 201	Window APron	wood	brown	None	N/A	0.04	Negative

		Dates: 11/21/2022-12/21/2023	Lead-Safe Certification Assessment Report						
		Michael A Martin Certification #006416	Theodore Roosevelt Elementary School						
		Inspection Company: Criterion Labs	430 Washington Ln, Philadelphia, PA 19144						
E l e m e n t	F l o o r	On-Site Room Name	Component	Substrate Material	Paint Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
1	2	Classroom 201	Blackboard casing	wood	brown	None	N/A	0.04	Negative
1	2	Classroom 201	Closet door	wood	brown	None	N/A	0.04	Negative
1	2	Classroom 201	Door casing	wood	brown	None	N/A	0.06	Negative
1	2	Classroom 201	Door	Wood	Brown	None	N/A	0	Negative
1	2	Classroom 202	Baseboard	Wood	brown	None	N/A	0.3	Negative
1	2	Classroom 202	Radiator	steel	gray	None	0	1.4	Positive
1	2	Classroom 202	Riser	steel	tan	None	0	1.8	Positive
1	2	Classroom 202	Door	wood	brown	None	N/A	0	Negative
1	2	Lounge outside Men's Restroom next to Classroom 202	Drain Line	Metal	Tan	None	0	22.1	Positive
1	2	Lounge outside Men's Restroom next to Classroom 202	Door	Wood	Brown	None	N/A	0	Negative
1	2	Men's Restroom next to Classroom 202	Baseboard	Wood	Tan	None	N/A	0.01	Negative
1	2	Men's Restroom next to Classroom 202	Drainline	Metal	Tan	None	0	24	Positive
1	2	Men's Restroom next to Classroom 202	Window Casing	Wood	Tan	None	N/A	0.04	Negative
1	2	Second Floor Marble Hallway	Radiator	Metal	Silver	None	N/A	0.7	Negative
1	2	Second Floor Marble Hallway	Radiator	Metal	Silver	None	N/A	0.7	Negative
1	2	Second Floor Marble Hallway	Riser	Metal	Tan	None	N/A	5.9	Negative
1	2	Art Room 208 Storage	Radiator	Metal	Silver	None	N/A	0.8	Negative
1	2	Second Floor Marble Hallway	Riser	Metal	Tan	None	N/A	3.3	Negative
1	2	Second Floor Marble Hallway	Radiator	Metal	Silver	None	N/A	0.6	Negative
1	2	Second Floor Marble Hallway	Riser	Metal	Tan	None	0	14.1	Positive
1	2	Hallway outside classroom 215 to 202	Riser	Metal	Tan	None	0	13.1	Positive
1	2	Hallway outside classroom 215 to 202	Riser	Metal	Tan	None	0	19.1	Positive
1	2	Across Room 217	Riser	Metal	Tan	None	0	8.4	Positive
1	2	Hallway outside classroom 215 to 202	Radiator	Metal	Silver	None	N/A	0.07	Negative
1	2	Hallway outside classroom 215 to 202	Radiator	Metal	Silver	None	N/A	0.7	Negative
1	2	Hallway outside classroom 215 to 202	Riser	Metal	Tan	None	0	9.1	Positive
1	1	Cafeteria B	Radiator	Metal	Gray	None	N/A	0.02	Negative
1	1	Cafeteria B	Drain Line	Metal	Gray	None	N/A	0.4	Negative
1	1	Cafeteria B	Exit Door	Metal	Gray	None	N/A	0	Negative
1	1	IMC Kitchen Closet	Drain Line	Metal	Tan	None	0	6.3	Positive
1	1	Cafeteria A	Door Casing	Wood	Gray	None	N/A	0	Negative
1	1	Cafeteria A	Door	Metal	Gray	None	N/A	0.04	Negative
1	1	Cafeteria A	Radiator	Metal	Gray	None	N/A	0.03	Negative

		Dates: 11/21/2022-12/21/2023	Lead-Safe Certification Assessment Report						
		Michael A Martin Certification #006416	Theodore Roosevelt Elementary School						
		Inspection Company: Criterion Labs	430 Washington Ln, Philadelphia, PA 19144						
E l e m e n t	F l o o r	On-Site Room Name	Component	Substrate Material	Paint Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
1	1	Office to Left of Exit to Parking Lot Restroom	Radiator	Metal	Gray	None	N/A	0.08	Negative
1	1	Office to Left of Exit to Parking Lot Restroom	Drain Line	Metal	Tan	None	0	15.5	Positive
1	1	Office to Left of Exit to Parking Lot	Riser	Metal	Gray	None	N/A	0.01	Negative
1	1	Classroom 107 Closet	Door Casing	Metal	Gray	None	N/A	0.04	Negative
1	1	Classroom 105	Radiator	Metal	Gray	None	N/A	0.1	Negative
1	1	Classroom 105	Window casing	Metal	Gray	None	N/A	0.5	Negative
1	1	Classroom 105	Window apron	Metal	Gray	None	N/A	0.01	Negative
1	1	Classroom 105	Drain Line	Metal	Gray	None	N/A	0.13	Negative
1	1	Classroom 105	Door	Wood	Gray	None	N/A	0	Negative
1	1	Classroom 105	Door Casing	Wood	Gray	None	N/A	0.06	Negative
1	1	Classroom 105 Coat Closet Storage Closet	Drain Line	Metal	Gray	None	0	15.6	Positive
1	1	Classroom 105 Coat Closet Storage Closet	Riser	Metal	Gray	None	0	5.2	Positive
1	1	Classroom 105	Door Casing	Metal	Gray	None	N/A	0	Negative
1	1	Classroom 105 Coat Closet Storage Closet	Door Casing	Metal	Gray	None	N/A	0	Negative
1	1	Classroom 109	Radiator	Metal	Gray	None	N/A	0.08	Negative
1	1	Classroom 109	Window Casing	Wood	Gray	None	0	27	Positive
1	1	Classroom 109	Door Casing	Metal	Gray	None	N/A	0.01	Negative
1	1	Classroom 109	Door	Wood	Gray	None	N/A	0	Negative
1		Hallway Outside cafeteria at corner	Riser	Metal	Tan	None	N/A	0.04	Negative
1	1	Hallway outside Building Engineer's Office	Radiator	Metal	Gray	None	N/A	0.6	Negative
1	1	Hallway outside Building Engineer's Office	Riser	Metal	Gray	None	N/A	0.2	Negative
1	1	Hallway to Rear entrance adjacent to Cafeteria at Corner of Building near Parking Lot	Riser Cover	Metal	Tan	None	0	6.4	Positive
1	1	Hallway to Rear entrance adjacent to Cafeteria at Corner of Building near Parking Lot	Riser Cover	Metal	Gray	None	0	5.1	Positive
1	1	Hallway to Rear entrance adjacent to Cafeteria at Corner of Building near Parking Lot	Radiator	Metal	Gray	None	N/A	0.5	Negative
1	1	Hallway to Rear entrance adjacent to Cafeteria at Corner of Building near Parking Lot	Riser	Metal	Silver	None	0	3.7	Positive
1	1	Hallway to Rear entrance adjacent to Cafeteria at Corner of Building near Parking Lot	Riser	Metal	Tan	None	0	6.6	Positive
1	1	Hallway outside Office to Left of Exit to Parking Lot	Riser	Metal	Tan	None	0	6.8	Positive
1	1	Hallway outside Office to Left of Exit to Parking Lot	Radiator	Metal	Gray	None	N/A	0.5	Negative
1	1	Girl's Restroom next to Classroom 109	CMU Wall	CMU	Tan	None	N/A	0	Negative
1	1	Classroom to Right of Classroom 107	Radiator	Metal	Gray	None	N/A	0.05	Negative
1	1	Classroom to Right of Classroom 107	Riser	Metal	Silver	None	0	11.8	Positive

		Dates: 11/21/2022-12/21/2023	Lead-Safe Certification Assessment Report						
		Michael A Martin Certification #006416	Theodore Roosevelt Elementary School						
		Inspection Company: Criterion Labs	430 Washington Ln, Philadelphia, PA 19144						
E l e m e n t	F l o o r	On-Site Room Name	Component	Substrate Material	Paint Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
1	1	Classroom to Right of Classroom 107	Riser	metal	Tan	None	0	15.6	Positive
1	1	Classroom to Right of Classroom 107	DrainLine	Metal	Tan	None	N/A	0.19	Negative
1	1	Classroom to Right of Classroom 107	Door	Wood	Red	None	N/A	0	Negative
1	1	Hallway outside Classroom to Right of Classroom 107	Radiator	Metal	Gray	None	N/A	0.03	Negative
1	1	Hallway outside Classroom to Right of Classroom 107	Riser	Metal	Tan	None	N/A	0.21	Negative
1	1	Classroom 107	Radiator	Metal	Gray	None	N/A	0.1	Negative
1	1	Classroom 107	Window Casing	Metal	Gray	None	0	9.4	Positive
1	1	Classroom 107	Window Apron	Metal	Gray	None	N/A	0.07	Negative
1	1	Classroom 107	Built In Closet	Wood	Brown	None	0	12.1	Positive
1	1	Classroom 107	Build in closet Casing	Wood	Brown	None	0	12.2	Positive
1	1	Classroom/Office 106	Radiator	Metal	Gray	None	N/A	0.6	Negative
1	1	Classroom/Office 106	Riser Cover	Metal	White	None	N/A	0.06	Negative
1	1	Classroom/Office 106	Drain Line	Metal	Tan	None	N/A	0.03	Negative
1	1	Hallway outside Classrooms 105-107	Riser	Metal	Gray	None	0	16.2	Positive
1	1	Hallway Corridor at IMC side of Auditorium	Radiator	Metal	Gray	None	0	2.3	Positive
1	1	Hallway Corridor at IMC side of Auditorium	Wains Coating	Wood	Tan	None	0	11.2	Positive
1	1	Hallway Corridor at IMC side of Auditorium	Window Casing	Wood	Brown	None	0	4.4	Positive
1	1	Auditorium	Wains Coating	Wood	Blue	None	0	5.4	Positive
1	1	Auditorium	Door Casing	Wood	Yellow	None	0	8.8	Positive
1	1	Auditorium	Door	Wood	Yellow	None	0	7	Positive
1	1	Hallway Corridor at Left side of Auditorium	Window Casing	Wood	Tan	None	0	4.4	Positive
1	1	Hallway Corridor at Left side of Auditorium	Drain Line	Metal	Tan	None	0	2	Positive
1	1	Hallway Corridor at Left side of Auditorium	Riser	Metal	Tan	None	N/A	0.5	Negative
1	1	Hallway Corridor at Left side of Auditorium	Riser Cover	Metal	Tan	None	N/A	0.04	Negative
1	1	Hallway Corridor at Left side of Auditorium	Door Casing	Wood	Tan	None	0	6	Positive
1	1	Hallway Corridor at Left side of Auditorium	Door Casing	Metal	Brown	None	0	5	Positive
1	1	Hallway Corridor at Left side of Auditorium	Door	Metal	Black	None	0	8.9	Positive
1	1	Storage to To Right of Auditorium	Window Casing	Wood	Tan	None	0	4.5	Positive
1	1	Storage to To Right of Auditorium	Drain Line	Metal	Tan	None	0	11.4	Positive
1	1	Storage to To Right of Auditorium	Riser	Metal	Tan	None	0	1.5	Positive
1	1	Storage to To Right of Auditorium	Baseboard	Wood	Brown	None	0	5.4	Positive
1	1	Storage to To Right of Auditorium	Door Casing	Metal	Tan	None	0	8.1	Positive
1	1	Storage to To Right of Auditorium	Door Casing	Metal	Brown	None	0	13.6	Positive
1	1	Storage to To Right of Auditorium	Shelving Frame	Wood	Tan	None	N/A	0	Negative
1	1	Storage to To Right of Auditorium	Door	Wood	Black	None	0	7.3	Positive

		Dates: 11/21/2022-12/21/2023	Lead-Safe Certification Assessment Report						
		Michael A Martin Certification #006416	Theodore Roosevelt Elementary School						
		Inspection Company: Criterion Labs	430 Washington Ln, Philadelphia, PA 19144						
E l e m e n t	F l o o r	On-Site Room Name	Component	Substrate Material	Paint Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
1	1	Hallway Corridor at Left side of Auditorium	Waines Coating	Wood	Tan	None	0	6.7	Positive
1	1	Hallway Corridor at Left side of Auditorium	Radiator	Metal	Gray	None	0	2.4	Positive
1	1	Hallway Corridor at Left side of Auditorium	Window Casing	Wood	Brown	None	0	15.1	Positive
1	1	Hallway Corridor at Left side of Auditorium	Door	Wood	Brown	None	0	5.1	Positive
1	1	Hallway Corridor at Left side of Auditorium	Door Casing	Wood	Tan	None	0	7.7	Positive
1	1	Men's Restroom across from Auditorium	Baseboard	Wood	Gray	None	0	3.5	Positive
1	1	Men's Restroom across from Auditorium	Door Casing	Wood	White	None	N/A	0	Negative
1	1	Womens Restroom across from Auditorium	Door Casing	Wood	White	None	N/A	0	Negative
1	1	Main Entrance Vestibule	Door Frame Plaster At Entrance	Plaster	Yellow	None	N/A	0	Negative
1	1	Main Entrance Vestibule	Door	Metal	Black	None	N/A	0	Negative
1	1	Main Entrance Lobby	Door Frame	Wood	Yellow	None	0	22.1	Positive
1	1	Main Lobby Stairs next to Classroom 104	Hand Rail	Wood	Black	None	N/A	0.11	Negative
1	1	Main Lobby Stairs next to Classroom 104	Stair Post	Wood	Black	None	N/A	0.01	Negative
1	1	Main Lobby Stairs next to Classroom 105	Stair Post	Wood	Black	None	N/A	0.11	Negative
1	1	Main Lobby Stairs next to Classroom 105	Hand Rail	Wood	Black	None	N/A	0.02	Negative
1	1	Hallway to Men's Restroom	Baseboard	Wood	Gray	None	0	9.7	Positive
1	1	Men's Restroom between Classroom 104 and Room C	Radiator	Metal	Gray	None	N/A	0.5	Negative
1	1	Men's Restroom between Classroom 104 and Room C	Baseboard	Wood	Gray	None	N/A	6.2	Negative
1	1	Classroom 103	Window Casing	Wood	Gray	None	N/A	0.11	Negative
1	1	Classroom 103	Radiator	Metal	Gray	None	N/A	0.22	Negative
1	1	Room C next to Classroom 103 (Paint Storage Room) Closet	Radiator	Metal	Gray	None	N/A	0.18	Negative
1	1	Room C next to Classroom 103 (Paint Storage Room) Closet	Riser	Metal	Tan	None	N/A	0	Negative
1	1	Hallway to Side Entrance adjacent to Classroom 103	Radiator	Metal	Gray	None	N/A	0.09	Negative
1	1	Hallway to Side Entrance adjacent to Classroom 103	Riser	Metal	Gray	None	N/A	2.8	Negative
1	1	Classroom 102	Radiator	Metal	Gray	None	0	1.5	Positive
1	1	Classroom 102	Window casing	Metal	Gray	None	N/A	0.44	Negative
1	1	Room B	Riser	Metal	White	None	N/A	3.1	Negative
1	1	Room B	Radiator	Metal	Gray	None	N/A	0.3	Negative
1	1	Classroom 101A	Radiator	Metal	Gray	None	N/A	0.24	Negative
1	1	Classroom 101A	Riser Cover	Metal	Gray	None	N/A	0.04	Negative
1	1	Boy's Restroom across from Storage Room 101	W1	Brick	Tan	None	N/A	0.01	Negative
1	1	Boy's Restroom across from Storage Room 101	W2	CMU	Tan	None	N/A	0	Negative

		Dates: 11/21/2022-12/21/2023	Lead-Safe Certification Assessment Report						
		Michael A Martin Certification #006416	Theodore Roosevelt Elementary School						
		Inspection Company: Criterion Labs	430 Washington Ln, Philadelphia, PA 19144						
E l e m e n t	F l o o r	On-Site Room Name	Component	Substrate Material	Paint Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
1	1	Boy's Restroom across from Storage Room 101	W3	Brick	Tan	None	N/A	0.02	Negative
1	1	Boy's Restroom across from Storage Room 101	W4	CMU	Tan	None	N/A	0	Negative
1	1	Stairwell across from Storage Room 100 Closet	Stair Post	Metal	Brown	None	N/A	0.4	Negative
1	1	Stairwell across from Storage Room 100 Closet	Stair Stringer	Concrete	Brown	None	0	1.17	Positive
1	1	Stairwell across from Storage Room 100 Closet	Riser	Metal	Tan	None	0	11.5	Positive
1	1	Stairwell across from Storage Room 100 Closet	Hand Rail	Wood	Brown	None	N/A	0.1	Negative
1	1	Hallway to Rear Entrance adjacent to Cafeteria	Radiator	Metal	Gray	None	N/A	0.7	Negative
1	1	Hallway to Rear Entrance adjacent to Cafeteria	Riser	Metal	Gray	None	N/A	2.2	Negative
1	1	Principal's Office Room 104A	Radiator	Metal	Gray	None	N/A	0	Negative
1	1	Main Office Secured Storage	Radiator	Metal	Gray	None	N/A	0.03	Negative
1	B	Fan Room Closest to Element 2	Fan Unit	Metal	Gray	Flaking	500	21.2	Positive
1	B	Hallway between Fan Rooms	Steam Line	Metal	White	None	0	13.2	Positive
1	B	Electrical Room	W1	Brick	White	None	0	4.3	Positive
1	B	Electrical Room	W2	Concrete	White	None	0	1.6	Positive
1	B	Electrical Room	W3	Brick	White	None	0	10.7	Positive
1	B	Electrical Room	W4	Concrete	White	None	0	9.1	Positive
1	B	Boiler Room	Concrete Base	Concrete	Gray	N/A	N/A	0	Negative
1	B	Stairwell to Boiler Room	Handrail	Metal	Gray	None	0	8.1	Positive
1	B	Stairwell to Boiler Room	Stair Tread	Concrete	Gray	N/A	N/A	0.15	Negative
2	1	Element 2 Stairwell	Door Casing	Metal	Brown	N/A	N/A	0.12	Negative
3	1	Ticket Booth Outside Gymnasium	Door Casing	Metal	Tan	N/A	N/A	0.06	Negative
1	1	Cafeteria B	Ceiling Beam	Plaster	Tan	None	0	4.4	Positive