

SCHOOL DISTRICT OF PHILADELPHIA



Asbestos Hazard Emergency Response Act “AHERA”

THREE-YEAR RE-INSPECTION 2015-2016 and ASBESTOS MANAGEMENT PLAN for the

South Philadelphia High School

**ULCS# 2000
Building # B200001-1
2021 South Broad Street
Philadelphia, Pennsylvania
19148**

Year Built: 1957

October/November 2015

Conducted by:

Accredited Environmental Technologies, Incorporated
Batta Environmental Associates, Incorporated
Criterion Laboratories, Incorporated
Environmental Testing Consultants, LLC
G & C Environmental Services, Incorporated
KEM Partners, Incorporated
Synertech, Inc.
TTI Environmental, Inc.
USA Environmental Management, Inc.
The Vertex Companies, Inc.

Management Plan Prepared by:
Criterion Labs, Inc and Synertech Inc.

This report must remain in the Main Office as mandated by the US EPA AHERA Regulations.

AHERA THREE-YEAR REINSPECTION VOLUME IX

Table of Contents

Transmittal Letter

Executive Summary

- I. Summary list of Confirmed Asbestos Containing Building Materials
- II. Summary list of Assumed Asbestos Contain Building Materials
- III. Summary list of Non-Asbestos Containing Building Materials
- IV. Summary list of Non Suspect Asbestos Containing Building Materials
- V. Summary List of Auditorium DATA for this location
- VI. Summary list of Attic and/or Crawlspace DATA for this location
- VII. Summary list of Pipe Chase/Pipe Shaft DATA for this location

Section I Report of Re-Inspection

- A. Introduction
- B. Three-Year Re-inspection IX Overview
- C. Post- Management Plan Activities and Changes
 - C.1 - Sampling and Analysis
 - C.2 - New Floor Tile Sampling
 - C.3 - Abatement Activity
 - C.4 - Periodic (Six-Month) Surveillance (Damaged Materials)

Section II Re-Inspection Data

- A. Introduction
- B. Re-Inspection Key Definitions
- C. Room by Room Location Log Report

Section III Certificates

- A. Management Planner/Building Inspector Certificates

Section IV	Cross Reference Table	Page 1-8
	Asbestos Management Program	Page 9-19

SCHOOL DISTRICT OF PHILADELPHIA
EDUCATIONAL CENTER
440 NORTH BROAD STREET
PHILADELPHIA, PENNSYLVANIA 19130

OFFICE OF ENVIRONMENTAL MANAGEMENT AND SERVICES

PHONE (215)-400-4750

January 2016

TO: All Principals
All Building Administrators

FROM: Fran Burns
Chief Operating Officer

Francine Locke, M.S., Director
Office of Environmental Management and Services

SUBJECT: AHERA Three (3) Year Re-inspection IX report

In order to comply with the provisions of the Asbestos Hazard Emergency Response Act (AHERA) the attached report is submitted to you. The law requires that this report be kept in the Main/Principal's office. It cannot be removed from these locations. *If the school (program) is relocated to a different building, these environmental documents are to be safely retained for the next school/building occupants.* All asbestos reports must be available to the public and Federal EPA upon request.



Fran Burns
Chief Operation Officer

Francine Locke, M.S., Director
Office of Environmental Management
and Services

Executive Summary

This Asbestos Hazard Emergency Response Act (AHERA) Three-Year Re-inspection “Volume # IX” Management Plan at this location, has been completed and the report of re-inspection submitted to the School District of Philadelphia. The re-inspections in all School District of Philadelphia buildings of 2015-2016 were conducted and completed between October 5th, 2015 through March 30th, 2016 as a joint project by Accredited Environmental Technologies, Inc., Batta Environmental Associates, Inc., Criterion Laboratories, Inc., Environmental Testing Consultants, LLC, G & C Environmental Services, Inc., KEM Partners, Inc., Synertech, Inc., TTI Environmental, Inc., USA Environmental Management, Inc. and The Vertex Companies, Inc.

In general, the School District of Philadelphia Office of Environmental Management and Services conducts Environmental Impact Evaluations and provides Asbestos Inspection Reports prior to any renovation, demolition and/or maintenance activities. The AHERA report must be reviewed prior to any renovation, demolition and/or maintenance activities in order to avoid the unknowing disturbance to Asbestos Containing Building Materials identified within this location. In addition, prior to work activities above all drop ceilings this report should be reviewed to avoid potential disturbances to Asbestos Containing Materials. Refer to Section IV of the Cross Reference Table, for additional Asbestos Management Program information. Contact the Office of Environmental Management and Services to have an Environmental Impact Evaluation conducted prior to any renovation, demolition and/or maintenance activities within this facility.

The information contained in this report was obtained from the original Asbestos Management Plan for the school, from update reports on changes and activities since the completion of the 1st Management Plan for each location and from all prior inspections performed and documented in Volume # I through Volume VIII (dated respectively 1992, 1995, 1998, 2001, 2004, 2007, 2010 or 2013) (if applicable) - and by this Three-Year Re-inspection of this school. The re-inspection report/Management Plan of 2015-2016 were reviewed and prepared collectively by Management Planner Megan Vala, Mary Anne Lerro of Criterion Laboratories, Inc. and/or Monique Causley, of Synertech Inc.

The 2015-2016 inspection process included the addition of a comprehensive Room by Room Inventory of all Thermal (T), Surfacing (S) and Miscellaneous (M) Materials specific to each room of this facility. Inspections of each room's thermal, ceilings, walls, floors and miscellaneous items regardless of Asbestos Content are categorized on the Room by Room Location Log Report for this location. Rooms or areas of the facility that were not accessible at the time of the inspection are marked with an "X". The Room by Room Location Log Report is found in Section II C of this Management Plan.

All Presumed or Suspect Asbestos Containing Building Materials (ACBMs), listed in the following summary charts are categorized as Confirmed, Assumed, Non-Asbestos, and/or Non-Suspect (ACBMs) were identified in the original Management Plan, or in the Volume I through Volume VIII AHERA Three-Year Re-inspection reports, and were re-inspected as part of this project.

As mandated by the U S EPA AHERA regulations, periodic Six-Month inspections and Three-Year Re-inspections of this location will be performed and the Inspection Data in this report will be updated accordingly.

Please feel free to contact the School District of Philadelphia's Office of Environmental Management and Services (OEMS) regarding any comments, questions, or concerns regarding this report or any Environmental related topic. OEMS staff can be reached at (215) 400 4750, via fax at (215) 400 4751 or via e-mail at flocke@philasd.org and/or gfunod@philasd.org.

Additional information can be found on our website. Here is the link to the OEMS website.
<http://webgui.phila.k12.pa.us/offices/e/environmental>

I. Summary list of Confirmed Asbestos Containing Building Materials within this facility

These charts are to be used for a quick reference* in order to avoid the unknowing disturbance of Asbestos Containing Materials during any and all Operations, Maintenance, Renovation, and/or Demolition activities at this location. *These materials have been sampled and Laboratory Analysis has CONFIRMED the presence of Asbestos. Contact OEMS prior to the disturbance of any of the following materials.*

Confirmed Asbestos Containing Building Materials for this location

Floor Tile VAT 9" x 9"		
------------------------	--	--

* *Always refer to the Room by Room Logs for each specific material classification as the material classification findings may be different in various rooms throughout this facility.*

** *Some Materials may have multiple classifications (Confirmed, Assumed, NAD and Non Suspect) within this facility.*

II. Summary list of Assumed Asbestos Containing Building Materials within this facility

These charts are to be used for a quick reference* in order to avoid the unknowing disturbance of Asbestos Containing Materials during any and all Operations, Maintenance, Renovation, and/or Demolition activities at this location. These materials have not been sampled and should not be disturbed until verification of Asbestos Content. Contact OEMS for assessment and sampling prior to the disturbance of these materials.

Assumed Asbestos Containing Building Materials for this location

Acoustical Plaster Ceiling	Blackboard Glue Dots	Brick Boilers
Brick Incinerator	Fire Brick	Floor Tile VAT 12" x 12"
Radiator Insulation	Sectional Boilers	Sheetrock Ceiling
Sheetrock Wall	Sink Undercoat Mastic	Transite
Transite Electrical Panel	Transite Sills	Transite Sink
Vibration Damper Cloth		

** Always refer to the Room by Room Logs for each specific material classification as the material classification findings may be different in various rooms throughout this facility.*

*** Some Materials may have multiple classifications (Confirmed, Assumed, NAD and Non Suspect) within this facility.*

III. Summary list of Non-Asbestos Containing Building Materials within this facility

These charts are to be used for a quick reference* in order to avoid the unknowing disturbance of Asbestos Containing Materials during any and all Operations, Maintenance, Renovation, and/or Demolition activities at this location. *These materials have been sampled and Laboratory Analysis has indicated NO Asbestos present or NO ASBESTOS DETECTED (NAD).*

Non- Asbestos Containing Building Materials for this location

Ceiling Tile 1' x 1'	Pipe Fitting Insulation	Plaster Ceiling
Plaster Walls		

* *Always refer to the Room by Room Logs for each specific material classification as the material classification findings may be different in various rooms throughout this facility.*

** *Some Materials may have multiple classifications (Confirmed, Assumed, NAD and Non Suspect) within this facility.*

IV. Summary list of Non-Suspect Asbestos Containing Building Materials within this facility

These charts are to be used for a quick reference* in order to avoid the unknowing disturbance of Asbestos Containing Materials during any and all Operations, Maintenance, Renovation, and/or Demolition activities at this location. These materials are not typically known to contain Asbestos.

Non-Suspect Asbestos Containing Building Materials for this location

Brick Wall	Carpet	Ceiling Tile 2' x 4'
Cement Floor	Ceramic Tile Floors	Ceramic Tile Walls
Concrete Block Wall	Concrete Ceiling	Duct Work
Fiberglass Duct Insulation	Fiberglass Pipe Fitting Insulation	Fiberglass Pipe Insulation
Fiberglass Tank Insulation	Fire Doors	Metal Ceiling
Metal Duct Work	Metal Grating Floors/Stairs	Metal Walls
Neoprene Pipe Insulation	Partition Room Dividers	Sheetrock Wall
Wood Floor		

** Always refer to the Room by Room Logs for each specific material classification as the material classification findings may be different in various rooms throughout this facility.*

*** Some Materials may have multiple classifications (Confirmed, Assumed, NAD and Non Suspect) within this facility.*

V. Summary list of Auditorium DATA for this location

These charts are to be used for a quick reference of the Auditorium DATA within this facility. Sampling of the Auditorium Ceilings throughout the District is more difficult because of the various ceiling heights. As sampling occurs this information is updated on a case by case basis for each specific location and facility.

This is a list of known materials for this location's Auditorium

Auditorium		
Auditorium	Floor Tile VAT 9" x 9"	Confirmed
Auditorium	Ceiling Tile 1' x 1'	NAD
Auditorium	Plaster Ceiling	Assumed
Auditorium	Acoustical Plaster Walls	Assumed
Auditorium Stage	Wood Floor	Non Suspect ACM
Auditorium Stage	Acoustical Plaster Ceiling	NAD
Auditorium Stage	Acoustical Plaster Walls	NAD

** Always refer to the Room by Room Logs for each specific material classification as the material classification findings may be different in various rooms throughout this facility.*

*** Some Materials may have multiple classifications (Confirmed, Assumed, NAD and Non Suspect) within this facility.*

VI. Summary list of Attic and/or Crawlspace DATA for this location

These charts are to be used for a quick reference regarding the Attics and/or Crawlspaces inspection DATA within this facility. Contact OEMS prior to entering any attic or crawlspace within this facility and refer to the below chart and legend for Category Rank determination. The Data relative to these spaces is updated as conditions change regarding Abatement or Renovation activity on a case by case basis for each specific location and facility. In general, Crawlspaces are below the basement or 1st floor and Attics are above the floor space.

Category Rank Legend

"A" - No Asbestos Containing Materials - Sample Results indicate NO ACM on pipes, fittings, elbows, or equipment located within this functional space, and NO VISIBLE DEBRIS or DAMAGE observed at time of this inspection.
"B" - Asbestos Containing Materials Exist - Sample Results indicate ACM on pipes, fittings, elbows, or equipment located within this functional space, HOWEVER, NO VISIBLE DEBRIS or DAMAGE observed at time of this inspection.
"C" - Asbestos Containing Materials Exist - Sample Results indicate ACM on pipes, fittings, elbows, or equipment located within this functional space, and LOCALIZED VISIBLE DEBRIS or DAMAGE observed at time of this inspection.
"D" - Asbestos Containing Materials Exist - Sample Results indicate ACM on pipes, fittings, elbows, or equipment located within this functional space and DISTRIBUTED VISIBLE DEBRIS or SIGNIFICANT DAMAGE observed at time of this inspection.
"E" - No Bulk Sample Results Available SUSPECT ACM OBSERVED. Contact OEMS immediately for additional instructions.

Attic/Crawlspace	Access Area	Floor Surface	Category Rank	Comments
Attic	3 rd Floor Hallway	Wire Lathe	"A"	Insulation in good condition
Attic	3 rd Floor Storage Closet	Wire Lathe	"A"	Transite Ceiling Forms are present
Attic	Adjacent to 3 rd Floor Library	Catwalk	"A"	Transite Ceiling Forms are present
Auditorium Attic	3 rd Floor Hallway	Unknown	"A"	Transite Ceiling Forms are present
Crawl Space	Adjacent to Girl's Locker Room	Sand	"A"	Transite Ceiling Forms are present
Crawl Space	Adjacent to Ash Pit	Concrete	"A"	Transite Ceiling Forms are present
Crawl Space	Adjacent to Boiler Room/ Basement Hallway	Cement	"A"	Transite Ceiling Forms are present
Crawl Space	Adjacent to Boiler Room/ Pump Area	Dirt	"A"	Transite Ceiling Forms are present

VII. Summary list of Pipe Chase/Pipe Shaft DATA for this location

These charts are to be used for a quick reference regarding the information known about the Pipe Chases and/or Pipe Shafts inspection DATA within this facility. Contact OEMS prior to performing renovation activities any Pipe Chase and/or Pipe Shaft within this facility and refer to the below chart and legend for Asbestos Content of various materials identified within each space. The Data relative to these spaces is updated as conditions change regarding Inspection, Abatement and/or Renovation activity on a case by case basis for each specific location and facility. In general, Pipe Chases are horizontal spaces and Pipe Shafts are vertical spaces.

<i>Element</i>	<i>Floor</i>	<i>On Site Room Name</i>	<i>Material</i>	<i>Confirmed Assumed NAD Non Suspect</i>	<i>Amount of Material</i>	<i>Amount of Damage</i>	<i>Color</i>	<i>Comments</i>
1	3	Pipe Chase 1 in Storage Room 312 Suite	Concrete Ceiling	Non Suspect ACM	30 SF	0 SF		
1	3	Pipe Chase 1 in Storage Room 312 Suite	Cement Floor	Non Suspect ACM	30 SF	0 SF		
1	3	Pipe Chase 1 in Storage Room 312 Suite	Brick Wall	Non Suspect ACM	100 SF	0 SF		
1	3	Pipe Chase 1 in Storage Room 312 Suite	Fiberglass Pipe Insulation	Non Suspect ACM	101 LF	0 LF		
1	3	Pipe Chase 1 in Storage Room 312 Suite	Pipe Fitting Insulation	NAD	101 EA	0 EA		
1	3	Pipe Chase 2 in Storage Room 312 Suite	Cement Floor	Non Suspect ACM	30 SF	0 SF		
1	3	Pipe Chase 2 in Storage Room 312 Suite	Brick Wall	Non Suspect ACM	100 SF	0 SF		
1	3	Pipe Chase 2 in Storage Room 312 Suite	Fiberglass Pipe Insulation	Non Suspect ACM	101 LF	0 LF		
1	3	Pipe Chase 2 in Storage Room 312 Suite	Pipe Fitting Insulation	NAD	101 EA	0 EA		
X	X	Pipe Shaft	X	X	X	X	X	Needs to be assessed

Section I

Report of Re-Inspection

A. Introduction

B. Three-Year Re-Inspection IX Overview

C. Post-Management Plan Activities and Changes

C.1 Sampling and Analysis

C.2 New Floor Tile Sampling

C.3 Abatement Activity

C.4 Periodic Six-Month Surveillance (Damaged Materials)

Section I - A

Report of Re-inspection

Introduction

The Three-Year Re-inspection IX was performed to fulfill the requirements of 40 CFR Part 763 - the Asbestos Hazard Emergency Response Act (AHERA). As required by AHERA, each Local Education Agency (LEA) must re-inspect all known confirmed or assumed Asbestos Containing Building Material (ACBM) located in the LEA's facilities. This re-inspection is intended to update the original Asbestos Management Plan for the LEA's facilities.

Multiple Building Inspectors of several firms performed the 2015/2016 re-inspection. The re-inspection report/Management Plan of 2015-2016 were reviewed and prepared collectively by Management Planner Megan Vala, Mary Anne Lerro of Criterion Laboratories, Inc. and Monique Causley, of Synertech Inc.

All of the certificates can be found in Section III.

During the re-inspection of each School District of Philadelphia facility, all of the Management Plans for that facility were reviewed. Information from the conclusions section of that report is included in this report. Additionally, information on activities such as abatements, cleanings, sampling and inspections, which have taken place since the completion of the original Management Plan, were reviewed during the re-inspection. Information on those activities is included in this report.

As mandated by the U S EPA AHERA regulations, all future periodic Six-Month inspections and Three-Year Re-inspections of this location will be performed and the Inspection Data in this report will be updated accordingly.

Section I - B

Three-Year Re-inspection IX Overview

Each homogeneous area of Asbestos Containing Building Material (ACBM) listed in the original Management Plan or in the 1992, 1995, 1998, 2001, etc., Three-Year Re-inspection reports were inspected for the AHERA Three-Year Re-inspection Volume IX, and the information for that material verified. Any changes to a homogeneous area listed in the updates to the Management Plans were verified. Any area of suspected ACBM found in the course of the re-inspection, and not listed in the Management Plan or updates, were either assumed to contain asbestos or sampled and analyzed to determine their asbestos content. Any such new areas either assumed to contain asbestos or determined through analysis to contain asbestos were included in the report of the Three-Year Re-inspection. The results of the AHERA Three-Year Re-inspection IX are tabulated in the Room by Room log reports located in *Section II-C* of this report.

As previously noted, all future periodic Six-Month inspections and Three-Year Re-inspections of this location will be performed and the Inspection Data in this report will be updated accordingly.

Section I – C.1

Post Management Plan Activities/Changes

Information on activities affecting Asbestos Containing Building Materials (ACBMs) at this location is contained in updates to the Management Plan. These updates are kept on file by the School District of Philadelphia and were reviewed for this project. Updates to the Management Plan include the following: *Sampling and Analysis, New Tile Installation, Abatement Activity and Periodic Six-Month Surveillance Data.*

Sampling and Analysis

In the event Sampling occurs, data will be listed here.

Section I – C.2

Information on the installation of new floor tiles/renovation activities affecting Asbestos Containing Building Materials (ACBMs) at this location is contained in updates to the Management Plan. These updates are kept on file by the School District of Philadelphia and were reviewed for this project. Updates to the Management Plan include the following:

New Floor Tile Sampling

In the event that new tile is installed, the material must be tested prior to installation.

Section I – C.3

Information on the Asbestos Abatement and renovation activities affecting Asbestos Containing Building Materials (ACBMs) at this location is contained in updates to the Management Plan. These updates are kept on file by the School District of Philadelphia and were reviewed for this project. Updates to the Management Plan include the following:

Abatement Activity

In the event Abatement occurs, data will be listed here.

Section I – C.4

Information on the AHERA inspection that noted damage to various Building Materials at this location is contained in updates to the Management Plan. These updates are kept on file by the School District of Philadelphia and were reviewed for this project. Work orders are created for Corrective Action responses and tracked for completion. Updates to the Management Plan include the following:

Periodic (Six-Month) Surveillance (Damaged Materials)

<i>Date</i>	<i>Element</i>	<i>Floor</i>	<i>On Site Room Name</i>	<i>Material</i>	<i>Amount of Material</i>	<i>Amount of Damage</i>
8/2/2016	1	5	Classroom 502	Floor Tile VAT 9" x 9"	1,058 SF	5 SF
8/2/2016	1	4	Classroom 401 Science / Math Lab	Floor Tile VAT 9" x 9"	920 SF	5 SF

Section II

Re-Inspection Data

A. Introduction

B. Re-Inspection Key Definitions

C. Room by Room Location Log Report

Section II - A

Re-inspection Data

Introduction

The following information documents the Three-Year Re-inspection IX of the subject school/facility. The Homogeneous Area Reports were produced using the building inspector's field data on the facility. The key to the Homogeneous Area Report is outlined in the following pages of this report.

Section II - B
(page 1 of 4)

SCHOOL DISTRICT OF PHILADELPHIA
AHERA THREE YEAR RE-INSPECTION IX

ITEM	DEFINITION
ULCS#	Individual identification number assigned to each school within the School District of Philadelphia.
HOMOGENEOUS AREA ID#	Identification number assigned to each homogeneous area in a school/facility. Each section of the homogeneous area ID is significant. 1010/01/01/01 A B C D A. Is the ULCS# for the school. B. Designates the specific building/building area within the school. C. Designates the floor or level within the building/building area. D. Designates the homogeneous material within that floor or level. Note: Item D may be a number or a letter.
SYSTEM AFFECTED	Corresponds to the AHERA system for classifying materials. T : Thermal System S : Surfacing System M : Miscellaneous
ITEM AFFECTED	Is a description of the homogeneous material.
ORIGINAL INSPECTION DATA	This section contains the information found in the original Management Plan (1988-1989).
AMOUNT OF MATERIAL/ UNIT	Quantity of material, and measuring unit. Units include: Square Feet (SF) Each (EA) Linear Feet (LF) Cubic Feet (CF).

**SCHOOL DISTRICT OF PHILADELPHIA
AHERA THREE YEAR RE-INSPECTION IX**

RE-INSPECTION FORM KEY

ITEM	DEFINITION
CND Condition	Corresponds to AHERA condition rating for materials. 0 : No Damage 1 : Damage 2 : Significant Damage
DP Damage Potential	Corresponds to the AHERA material assessment system. 1 : Potential for Damage 2 : Potential for Significant Damage
ASMD Assumed Asbestos	This means that a material was not sampled for asbestos content during the original Management Plan inspection.
RA Response Action	This corresponds to the AHERA system of response action rating for materials. 1 : Establish O&M Program 2 : Repair and Establish O&M Program 3 : Enclose 4 : Encapsulate 5 : Remove 6 : Partial Removal and Establish O&M Program
CHANGES	This section describes changes to the homogeneous material in the twenty-four years since the original AHERA inspection. The abbreviations are defined below. RMVD : Removed ENCL : Enclosed ENCP : Encapsulated DMGD : Damaged SMPLD : Sampled MTRL : Material RPRD : Repaired N/L : None Located RPLCD : Replaced

**SCHOOL DISTRICT OF PHILADELPHIA
AHERA THREE-YEAR RE-INSPECTION IX**

RE-INSPECTION FORM KEY

ITEM	DEFINITION												
THREE YEAR RE-INSPECTION	<p>This section contains the information obtained from the Three-Year Re-inspection IX. With three exceptions, the information categories are identical in format and meaning to those found in the original inspection data section. The three exceptions are defined below.</p>												
DMGD AMT Amount Damaged	<p>This section gives the quantity of damaged material in a homogeneous area. The quantity is shown in the same format as the amount of material/unit section.</p>												
NF Newly Friable	<p>This section identifies materials in the original Management Plan which have since become friable.</p>												
RA Response Action	<p>This rating is based on the AHERA regulations, and is comparable to the RA rating found in the "Original Inspection Data" section. The following table details the response actions.</p> <table><tr><td>1.</td><td>Establish O&M Program</td></tr><tr><td>2.</td><td>Repair and Establish O&M Program</td></tr><tr><td>3.</td><td>Enclose</td></tr><tr><td>4.</td><td>Encapsulate</td></tr><tr><td>5.</td><td>Remove</td></tr><tr><td>6.</td><td>Partial Removal and Establish O&M Program</td></tr></table> <p>a. High Priority Response The homogeneous material has been scheduled for abatement or other response action.</p> <p>b. Medium Priority Response The homogeneous material will be scheduled for abatement or other response action as soon as the high priority responses have been addressed.</p> <p>c. Low Priority Response The homogeneous material will be scheduled for abatement or other response action as soon as the medium priority responses have been addressed.</p> <p>d. On-Going Response/Operations and Maintenance The homogeneous material does not require abatement or other response action at present, and should be included in the facility's on-going operations and maintenance program.</p>	1.	Establish O&M Program	2.	Repair and Establish O&M Program	3.	Enclose	4.	Encapsulate	5.	Remove	6.	Partial Removal and Establish O&M Program
1.	Establish O&M Program												
2.	Repair and Establish O&M Program												
3.	Enclose												
4.	Encapsulate												
5.	Remove												
6.	Partial Removal and Establish O&M Program												

**SCHOOL DISTRICT OF PHILADELPHIA
AHERA THREE-YEAR RE-INSPECTION IX**

RE-INSPECTION FORM KEY

The information presented in the changes section has been compiled from a variety of sources, including the Re-inspection and the following:

- * Quality Control/Quality Assurance Reports of asbestos abatement projects, prepared by consultants to the School District.
- * Permit and Notification Forms for asbestos abatement projects.
- * Periodic Surveillance Forms
- * Operations and Maintenance activities performed by School District personnel.
- * Verbal information from School District personnel.
- * Reports of sampling and analysis of suspected materials by both School District personnel and outside consultants.

**ROOM BY
ROOM
LOCATION LOG
REPORT**

This section gives information, including damage amount and location, for a specific homogeneous material on a room-by-room basis and follows the Re-inspection form.

NOTE: The disparate nature of the above sources of information prohibits the verification of much information within the scope of the AHERA Three-Year Re-inspection. Discrepancies and omissions may exist in this information, and therefore is included on an "as is" basis. The inspectors for the Three-Year Re-inspection IX evaluated homogeneous areas based on the materials current condition and location, as evidenced during the inspector's site visit.

Section II - C

Room by Room Location Log Report

These charts are to be used for a quick reference* in order to avoid the unknowing disturbance of Asbestos Containing Materials during any and all Operations, Maintenance, Renovation, and/or Demolition activities at this location.

NOTE:

*Contact OEMS prior to the disturbance of any of the materials that are listed as **Confirmed and/or Assumed**.*

The quantities listed for (NAD) non-asbestos containing materials and/or Non-Suspect Materials are only estimated and were not measured for the purpose of this report. Field verification of quantities for renovation purposes would be necessary.

2000 South Phila HS 2015-2016 AHERA Three-Year Report.xls

School District of Philadelphia South Philadelphia High School 2021 South Broad Street, Philadelphia, PA 19148 ULCS#2000 Year Built: 1957		AHERA Three-Year Reinspection 2015-2016 Room by Room Location Log Report										Reinspection Date: October 29-November 13, 2015 Building Inspector: Norman Harrison Number: ACC-0915-6-011 Management Planner: Megan Vala Number: 740728				
E l e m e n t	F l o o r	On-Site Room Name	System Affected	Material Description	HID#	Confirmed/Assumed/NAD Non Suspect ACM	Amount of Material	(SF/LF/EA)	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic/ Crawl Space Ranking	Damage Potential (DP)	Newly Friable (NF)	Response Action (RA)
1	5	Classroom 500	N/A	Ceiling Tile 1' x 1'		NAD	920	SF	0	SF				N/A	N/A	N/A
1	5	Classroom 500	M	Floor Tile VAT 12" x 12"	2000/01/05/WW	Assumed	920	SF	0	SF	White			1	No	1/D
1	5	Classroom 500	N/A	Brick Wall		Non Suspect ACM	1000	SF	0	SF				N/A	N/A	N/A
1	5	Classroom 500	M	Transite Sills	2000/01/05/USA/NH/2300	Assumed	20	SF	0	SF				1	No	1/D
1	5	Classroom 501	N/A	Ceiling Tile 1' x 1'		NAD	920	SF	0	SF				N/A	N/A	N/A
1	5	Classroom 501	M	Floor Tile VAT 12" x 12"	2000/01/05/WW	Assumed	920	SF	0	SF	Grey			1	No	1/D
1	5	Classroom 501	N/A	Brick Wall		Non Suspect ACM	1000	SF	0	SF				N/A	N/A	N/A
1	5	Classroom 501	M	Transite Sills	2000/01/05/USA/NH/2300	Assumed	20	SF	0	SF				1	No	1/D
1	5	Classroom 502	N/A	Plaster Ceiling		NAD	1058	SF	0	SF				N/A	N/A	N/A
1	5	Classroom 502	M	Floor Tile VAT 9" x 9"	2000/01/05/46	Confirmed	1058	SF	5	SF	Red			1	No	2/C
1	5	Classroom 502	N/A	Brick Wall		Non Suspect ACM	1000	SF	0	SF				N/A	N/A	N/A
1	5	Classroom 502	M	Transite Sills	2000/01/05/USA/NH/2300	Assumed	20	SF	0	SF				1	No	1/D
1	5	Classroom 503	N/A	Plaster Ceiling		NAD	1058	SF	0	SF				N/A	N/A	N/A
1	5	Classroom 503	M	Floor Tile VAT 9" x 9"	2000/01/05/46	Confirmed	1058	SF	0	SF	Green			1	No	1/D
1	5	Classroom 503	N/A	Brick Wall		Non Suspect ACM	1000	SF	0	SF				N/A	N/A	N/A
1	5	Classroom 503	M	Transite Sills	2000/01/05/USA/NH/2300	Assumed	20	SF	0	SF				1	No	1/D
1	5	Middle States Office	N/A	Plaster Ceiling		NAD	250	SF	0	SF				N/A	N/A	N/A
1	5	Middle States Office	M	Floor Tile VAT 9" x 9"	2000/01/05/46	Confirmed	250	SF	0	SF	Tan			1	No	1/D
1	5	Middle States Office	N/A	Brick Wall		Non Suspect ACM	300	SF	0	SF				N/A	N/A	N/A
1	5	Middle States Office	M	Transite Sills	2000/01/05/USA/NH/2300	Assumed	5	SF	0	SF				1	No	1/D
1	5	Office adjacent to Middle States Office	N/A	Plaster Ceiling		NAD	225	SF	0	SF				N/A	N/A	N/A
1	5	Office adjacent to Middle States Office	M	Floor Tile VAT 9" x 9"	2000/01/05/46	Confirmed	225	SF	0	SF	Tan			1	No	1/D
1	5	Office adjacent to Middle States Office	N/A	Brick Wall		Non Suspect ACM	300	SF	0	SF				N/A	N/A	N/A
1	5	Office adjacent to Middle States Office	M	Transite Sills	2000/01/05/USA/NH/2300	Assumed	5	SF	0	SF				1	No	1/D
1	5	Classroom 504	N/A	Plaster Ceiling		NAD	1058	SF	0	SF				N/A	N/A	N/A
1	5	Classroom 504	M	Floor Tile VAT 9" x 9"	2000/01/05/46	Confirmed	1058	SF	0	SF	Tan			1	No	1/D
1	5	Classroom 504	N/A	Brick Wall		Non Suspect ACM	1000	SF	0	SF				N/A	N/A	N/A
1	5	Classroom 504	M	Transite Sills	2000/01/05/USA/NH/2300	Assumed	20	SF	0	SF				1	No	1/D
1	5	Conference Room 505	N/A	Ceiling Tile 1' x 1'		NAD	1058	SF	0	SF				N/A	N/A	N/A
1	5	Conference Room 505	N/A	Carpet		Non Suspect ACM	1058	SF	0	SF				N/A	N/A	N/A
1	5	Conference Room 505	N/A	Brick Wall		Non Suspect ACM	1000	SF	0	SF				N/A	N/A	N/A
1	5	Conference Room 505	M	Transite Sills	2000/01/05/USA/NH/2300	Assumed	20	SF	0	SF				1	No	1/D
1	5	Classroom 506	N/A	Plaster Ceiling		NAD	897	SF	0	SF				N/A	N/A	N/A
1	5	Classroom 506	M	Floor Tile VAT 9" x 9"	2000/01/05/46	Confirmed	897	SF	0	SF	Green			1	No	1/D
1	5	Classroom 506	N/A	Brick Wall		Non Suspect ACM	1000	SF	0	SF				N/A	N/A	N/A
1	5	Classroom 506	M	Transite Sills	2000/01/05/USA/NH/2300	Assumed	10	SF	0	SF				1	No	1/D
1	5	Storage Room next to Classroom 506	N/A	Cement Floor		Non Suspect ACM	100	SF	0	SF				N/A	N/A	N/A
1	5	Storage Room next to Classroom 506	N/A	Concrete Block Wall		Non Suspect ACM	300	SF	0	SF				N/A	N/A	N/A
1	5	Storage Room next to Classroom 506	N/A	Concrete Ceiling		Non Suspect ACM	100	SF	0	SF				N/A	N/A	N/A
1	5	Storage Room next to Classroom 506	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	25	LF	0	LF				N/A	N/A	N/A
1	5	Storage Room next to Classroom 506	N/A	Pipe Fitting Insulation		NAD	4	EA	0	EA				N/A	N/A	N/A
1	5	Classroom 507	N/A	Plaster Ceiling		NAD	805	SF	0	SF				N/A	N/A	N/A
1	5	Classroom 507	M	Floor Tile VAT 9" x 9"	2000/01/05/46	Confirmed	805	SF	0	SF	Green			1	No	1/D
1	5	Classroom 507	N/A	Brick Wall		Non Suspect ACM	1000	SF	0	SF				N/A	N/A	N/A
1	5	Classroom 507	M	Transite Sills	2000/01/05/USA/NH/2300	Assumed	10	SF	0	SF				1	No	1/D
1	5	Classroom 508	N/A	Plaster Ceiling		NAD	744	SF	0	SF				N/A	N/A	N/A
1	5	Classroom 508	M	Floor Tile VAT 9" x 9"	2000/01/05/46	Confirmed	744	SF	0	SF	Red			1	No	1/D
1	5	Classroom 508	N/A	Brick Wall		Non Suspect ACM	800	SF	0	SF				N/A	N/A	N/A
1	5	Classroom 508	M	Transite Sills	2000/01/05/USA/NH/2300	Assumed	10	SF	0	SF				1	No	1/D
1	5	Classroom 509	N/A	Plaster Ceiling		NAD	744	SF	0	SF				N/A	N/A	N/A
1	5	Classroom 509	M	Floor Tile VAT 9" x 9"	2000/01/05/46	Confirmed	744	SF	0	SF	Blue			1	No	1/D
1	5	Classroom 509	N/A	Brick Wall		Non Suspect ACM	800	SF	0	SF				N/A	N/A	N/A
1	5	Classroom 509	M	Transite Sills	2000/01/05/USA/NH/2300	Assumed	10	SF	0	SF				1	No	1/D
1	5	Classroom 510	N/A	Ceiling Tile 1' x 1'		NAD	945	SF	0	SF				N/A	N/A	N/A
1	5	Classroom 510	M	Floor Tile VAT 9" x 9"	2000/01/05/46	Confirmed	945	SF	0	SF	Grey			1	No	1/D
1	5	Classroom 510	N/A	Brick Wall		Non Suspect ACM	1000	SF	0	SF				N/A	N/A	N/A
1	5	Classroom 510	M	Transite Sills	2000/01/05/USA/NH/2300	Assumed	15	SF	0	SF				1	No	1/D
1	5	Storage Room inside Classroom 510	N/A	Cement Floor		Non Suspect ACM	120	SF	0	SF				N/A	N/A	N/A
1	5	Storage Room inside Classroom 510	N/A	Concrete Block Wall		Non Suspect ACM	360	SF	0	SF				N/A	N/A	N/A
1	5	Storage Room inside Classroom 510	N/A	Concrete Ceiling		Non Suspect ACM	120	SF	0	SF				N/A	N/A	N/A
1	5	Storage Room inside Classroom 510	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	24	LF	0	LF				N/A	N/A	N/A
1	5	Storage Room inside Classroom 510	M	Transite Sills	2000/01/05/USA/NH/2300	Assumed	15	SF	0	SF		Window Sills		1	No	1/D
1	5	Girl's Restroom	N/A	Plaster Ceiling		NAD	460	SF	0	SF				N/A	N/A	N/A
1	5	Girl's Restroom	N/A	Cement Floor		Non Suspect ACM	460	SF	0	SF				N/A	N/A	N/A
1	5	Girl's Restroom	N/A	Brick Wall		Non Suspect ACM	460	SF	0	SF				N/A	N/A	N/A
1	5	Girl's Restroom	M	Transite Sills	2000/01/05/USA/NH/2300	Assumed	460	SF	0	SF				1	No	1/D
1	5	Classroom 511	N/A	Plaster Ceiling		NAD	744	SF	0	SF				N/A	N/A	N/A
1	5	Classroom 511	M	Floor Tile VAT 9" x 9"	2000/01/05/46	Confirmed	744	SF	0	SF	Red			1	No	1/D
1	5	Classroom 511	N/A	Brick Wall		Non Suspect ACM	800	SF	0	SF				N/A	N/A	N/A
1	5	Classroom 511	M	Transite Sills	2000/01/05/USA/NH/2300	Assumed	15	SF	0	SF				1	No	1/D
1	5	Classroom 512	N/A	Plaster Ceiling		NAD	696	SF	0	SF				N/A	N/A	N/A

2000 South Phila HS 2015-2016 AHERA Three-Year Report.xls

School District of Philadelphia South Philadelphia High School 2021 South Broad Street, Philadelphia, PA 19148 ULCS#2000 Year Built: 1957		AHERA Three-Year Reinspection 2015-2016 Room by Room Location Log Report										Reinspection Date: October 29-November 13, 2015 Building Inspector: Norman Harrison Number: ACC-0915-6-011 Management Planner: Megan Vala Number: 740728				
E l e m e n t	F l o o r	On-Site Room Name	System Affected	Material Description	HID#	Confirmed/Assumed/NAD Non Suspect ACM	Amount of Material	(SF/LF/EA)	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic/ Crawl Space Ranking	Damage Potential (DP)	Newly Friable (NF)	Response Action (RA)
1	5	Classroom 512	M	Floor Tile VAT 9" x 9"	2000/01/05/46	Confirmed	696	SF	0	SF	Grey			1	No	1/D
1	5	Classroom 512	N/A	Brick Wall		Non Suspect ACM	750	SF	0	SF				N/A	N/A	N/A
1	5	Classroom 512	M	Transite Sills	2000/01/05/USA/NH/2300	Assumed	15	SF	0	SF				1	No	1/D
1	5	Classroom 513	N/A	Ceiling Tile 1' x 1'		NAD	945	SF	0	SF				N/A	N/A	N/A
1	5	Classroom 513	M	Floor Tile VAT 9" x 9"	2000/01/05/46	Confirmed	945	SF	0	SF	Grey			1	No	1/D
1	5	Classroom 513	N/A	Brick Wall		Non Suspect ACM	1000	SF	0	SF				N/A	N/A	N/A
1	5	Classroom 513	M	Transite Sills	2000/01/05/USA/NH/2300	Assumed	15	SF	0	SF				1	No	1/D
1	5	Women's Lounge/Restroom Entrance across from Classroom 513	M	Floor Tile VAT 9" x 9"	2000/01/05/46	Confirmed	250	SF	0	SF	Multi			1	No	1/D
1	5	Women's Lounge/Restroom Entrance across from Classroom 513	N/A	Concrete Block Wall		Non Suspect ACM	750	SF	0	SF				N/A	N/A	N/A
1	5	Women's Lounge/Restroom Entrance across from Classroom 513	N/A	Concrete Ceiling		Non Suspect ACM	250	SF	0	SF				N/A	N/A	N/A
1	5	Women's Lounge/Restroom Entrance across from Classroom 513	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	30	LF	0	LF				N/A	N/A	N/A
1	5	Women's Lounge/Restroom Entrance across from Classroom 513	N/A	Pipe Fitting Insulation		NAD	4	EA	0	EA				N/A	N/A	N/A
1	5	Women's Rear Restroom in Women's Lounge across from Classroom 513	M	Floor Tile VAT 12" x 12"	2000/01/05/WW	Assumed	50	SF	0	SF	Blue			1	No	1/D
1	5	Women's Rear Restroom in Women's Lounge across from Classroom 513	N/A	Ceramic Tile Walls		Non Suspect ACM	75	SF	0	SF				N/A	N/A	N/A
1	5	Women's Rear Restroom in Women's Lounge across from Classroom 513	N/A	Concrete Block Wall		Non Suspect ACM	150	SF	0	SF				N/A	N/A	N/A
1	5	Women's Rear Restroom in Women's Lounge across from Classroom 513	N/A	Concrete Ceiling		Non Suspect ACM	50	SF	0	SF				N/A	N/A	N/A
1	5	Women's Front Restroom in Women's Lounge across from Classroom 513	M	Floor Tile VAT 9" x 9"	2000/01/05/46	Confirmed	50	SF	0	SF	Red			1	No	1/D
1	5	Women's Front Restroom in Women's Lounge across from Classroom 513	N/A	Ceramic Tile Walls		Non Suspect ACM	75	SF	0	SF				N/A	N/A	N/A
1	5	Women's Front Restroom in Women's Lounge across from Classroom 513	N/A	Concrete Block Wall		Non Suspect ACM	150	SF	0	SF				N/A	N/A	N/A
1	5	Women's Front Restroom in Women's Lounge across from Classroom 513	N/A	Concrete Ceiling		Non Suspect ACM	50	SF	0	SF				N/A	N/A	N/A
1	5	Office adjacent to Classroom 513	N/A	Ceiling Tile 1' x 1'		NAD	437	SF	0	SF				N/A	N/A	N/A
1	5	Office adjacent to Classroom 513	M	Floor Tile VAT 9" x 9"	2000/01/05/46	Confirmed	437	SF	0	SF	Green			1	No	1/D
1	5	Office adjacent to Classroom 513	N/A	Brick Wall		Non Suspect ACM	500	SF	0	SF				N/A	N/A	N/A
1	5	Office adjacent to Classroom 513	M	Transite Sills	2000/01/05/USA/NH/2300	Assumed	5	SF	0	SF				1	No	1/D
1	5	Classroom 514	N/A	Plaster Ceiling		NAD	690	SF	0	SF				N/A	N/A	N/A
1	5	Classroom 514	M	Floor Tile VAT 9" x 9"	2000/01/05/46	Confirmed	690	SF	0	SF	Green			1	No	1/D
1	5	Classroom 514	N/A	Brick Wall		Non Suspect ACM	750	SF	0	SF				N/A	N/A	N/A
1	5	Classroom 514	M	Transite Sills	2000/01/05/USA/NH/2300	Assumed	10	SF	0	SF				1	No	1/D
1	5	Janitor's Closet next to Classroom 514	N/A	Cement Floor		Non Suspect ACM	30	SF	0	SF				N/A	N/A	N/A
1	5	Janitor's Closet next to Classroom 514	N/A	Concrete Block Wall		Non Suspect ACM	90	SF	0	SF				N/A	N/A	N/A
1	5	Janitor's Closet next to Classroom 514	N/A	Concrete Ceiling		Non Suspect ACM	30	SF	0	SF				N/A	N/A	N/A
1	5	Classroom 515	N/A	Plaster Ceiling		NAD	690	SF	0	SF				N/A	N/A	N/A
1	5	Classroom 515	M	Floor Tile VAT 9" x 9"	2000/01/05/46	Confirmed	690	SF	0	SF	Green			1	No	1/D
1	5	Classroom 515	N/A	Brick Wall		Non Suspect ACM	750	SF	0	SF				N/A	N/A	N/A
1	5	Classroom 515	M	Transite Sills	2000/01/05/USA/NH/2300	Assumed	10	SF	0	SF				1	No	1/D
1	5	Classroom 516	N/A	Plaster Ceiling		NAD	713	SF	0	SF				N/A	N/A	N/A
1	5	Classroom 516	M	Floor Tile VAT 9" x 9"	2000/01/05/46	Confirmed	713	SF	0	SF	Blue			1	No	1/D
1	5	Classroom 516	N/A	Brick Wall		Non Suspect ACM	750	SF	0	SF				N/A	N/A	N/A
1	5	Classroom 516	M	Transite Sills	2000/01/05/USA/NH/2300	Assumed	10	SF	0	SF				1	No	1/D
1	5	Classroom 517	N/A	Plaster Ceiling		NAD	575	SF	0	SF				N/A	N/A	N/A
1	5	Classroom 517	M	Floor Tile VAT 9" x 9"	2000/01/05/46	Confirmed	575	SF	0	SF	Red			1	No	1/D
1	5	Classroom 517	N/A	Brick Wall		Non Suspect ACM	600	SF	0	SF				N/A	N/A	N/A
1	5	Classroom 517	M	Transite Sills	2000/01/05/USA/NH/2300	Assumed	10	SF	0	SF				1	No	1/D
1	5	Office 519A	M	Floor Tile VAT 9" x 9"	2000/01/05/46	Confirmed	240	SF	0	SF	Multi			1	No	1/D
1	5	Office 519A	N/A	Concrete Block Wall		Non Suspect ACM	720	SF	0	SF				N/A	N/A	N/A
1	5	Office 519A	N/A	Concrete Ceiling		Non Suspect ACM	240	SF	0	SF				N/A	N/A	N/A
1	5	Stairwell # 4 next to Office 519A	M	Floor Tile VAT 9" x 9"	2000/01/05/46	Confirmed	120	SF	0	SF	Black			1	No	1/D
1	5	Stairwell # 4 next to Office 519A	N/A	Cement Floor		Non Suspect ACM	80	SF	0	SF				N/A	N/A	N/A
1	5	Stairwell # 4 next to Office 519A	N/A	Concrete Block Wall		Non Suspect ACM	600	SF	0	SF				N/A	N/A	N/A
1	5	Stairwell # 4 next to Office 519A	N/A	Concrete Ceiling		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A
1	5	Stairwell # 4 next to Office 519A	T	Radiator Insulation	2000/01/05/SYN/BB/1600	Assumed	20	SF	0	SF				1	No	1/D
1	5	Classroom 518	N/A	Plaster Ceiling		NAD	780	SF	0	SF				N/A	N/A	N/A
1	5	Classroom 518	M	Floor Tile VAT 9" x 9"	2000/01/05/46	Confirmed	780	SF	0	SF	Grey			1	No	1/D
1	5	Classroom 518	N/A	Brick Wall		Non Suspect ACM	800	SF	0	SF				N/A	N/A	N/A
1	5	Classroom 518	M	Transite Sills	2000/01/05/USA/NH/2300	Assumed	15	SF	0	SF				1	No	1/D
1	5	Classroom 519	N/A	Plaster Ceiling		NAD	690	SF	0	SF				N/A	N/A	N/A
1	5	Classroom 519	M	Floor Tile VAT 9" x 9"	2000/01/05/46	Confirmed	690	SF	0	SF	Green			1	No	1/D
1	5	Classroom 519	N/A	Brick Wall		Non Suspect ACM	750	SF	0	SF				N/A	N/A	N/A
1	5	Classroom 519	M	Transite Sills	2000/01/05/USA/NH/2300	Assumed	10	SF	0	SF				1	No	1/D
1	5	Classroom 520	N/A	Plaster Ceiling		NAD	690	SF	0	SF				N/A	N/A	N/A

2000 South Phila HS 2015-2016 AHERA Three-Year Report.xls

School District of Philadelphia South Philadelphia High School 2021 South Broad Street, Philadelphia, PA 19148 ULCS#2000 Year Built: 1957		AHERA Three-Year Reinspection 2015-2016 Room by Room Location Log Report										Reinspection Date: October 29-November 13, 2015 Building Inspector: Norman Harrison Number: ACC-0915-6-011 Management Planner: Megan Vala Number: 740728				
E l e m e n t	F l o o r	On-Site Room Name	System Affected	Material Description	HID#	Confirmed/Assumed/NAD Non Suspect ACM	Amount of Material	(SF/LF/EA)	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic/ Crawl Space Ranking	Damage Potential (DP)	Newly Friable (NF)	Response Action (RA)
1	5	Classroom 520	M	Floor Tile VAT 9" x 9"	2000/01/05/46	Confirmed	690	SF	0	SF	Grey			1	No	1/D
1	5	Classroom 520	N/A	Brick Wall		Non Suspect ACM	750	SF	0	SF				N/A	N/A	N/A
1	5	Classroom 520	M	Transite Sills	2000/01/05/USA/NH/2300	Assumed	10	SF	0	SF				1	No	1/D
1	5	Classroom 521	N/A	Plaster Ceiling		NAD	660	SF	0	SF				N/A	N/A	N/A
1	5	Classroom 521	M	Floor Tile VAT 9" x 9"	2000/01/05/46	Confirmed	660	SF	0	SF	Blue			1	No	1/D
1	5	Classroom 521	N/A	Brick Wall		Non Suspect ACM	750	SF	0	SF				N/A	N/A	N/A
1	5	Classroom 521	M	Transite Sills	2000/01/05/USA/NH/2300	Assumed	15	SF	0	SF				1	No	1/D
1	5	Classroom 522	N/A	Plaster Ceiling		NAD	667	SF	0	SF				N/A	N/A	N/A
1	5	Classroom 522	M	Floor Tile VAT 9" x 9"	2000/01/05/46	Confirmed	667	SF	0	SF	Grey			1	No	1/D
1	5	Classroom 522	N/A	Brick Wall		Non Suspect ACM	750	SF	0	SF				N/A	N/A	N/A
1	5	Classroom 522	M	Transite Sills	2000/01/05/USA/NH/2300	Assumed	10	SF	0	SF				1	No	1/D
1	5	Classroom 523	N/A	Plaster Ceiling		NAD	690	SF	0	SF				N/A	N/A	N/A
1	5	Classroom 523	M	Floor Tile VAT 9" x 9"	2000/01/05/46	Confirmed	690	SF	0	SF	Red			1	No	1/D
1	5	Classroom 523	N/A	Brick Wall		Non Suspect ACM	750	SF	0	SF				N/A	N/A	N/A
1	5	Classroom 523	M	Transite Sills	2000/01/05/USA/NH/2300	Assumed	10	SF	0	SF				1	No	1/D
1	5	Classroom 524	N/A	Plaster Ceiling		NAD	696	SF	0	SF				N/A	N/A	N/A
1	5	Classroom 524	M	Floor Tile VAT 9" x 9"	2000/01/05/46	Confirmed	696	SF	0	SF	Blue			1	No	1/D
1	5	Classroom 524	N/A	Brick Wall		Non Suspect ACM	750	SF	0	SF				N/A	N/A	N/A
1	5	Classroom 524	M	Transite Sills	2000/01/05/USA/NH/2300	Assumed	10	SF	0	SF				1	No	1/D
1	5	Classroom 525	N/A	Plaster Ceiling		NAD	720	SF	0	SF				N/A	N/A	N/A
1	5	Classroom 525	M	Floor Tile VAT 9" x 9"	2000/01/05/46	Confirmed	720	SF	0	SF	Red			1	No	1/D
1	5	Classroom 525	N/A	Brick Wall		Non Suspect ACM	800	SF	0	SF				N/A	N/A	N/A
1	5	Classroom 525	M	Transite Sills	2000/01/05/USA/NH/2300	Assumed	10	SF	0	SF				1	No	1/D
1	5	Classroom 526	N/A	Plaster Ceiling		NAD	744	SF	0	SF				N/A	N/A	N/A
1	5	Classroom 526	M	Floor Tile VAT 9" x 9"	2000/01/05/46	Confirmed	744	SF	0	SF	Green			1	No	1/D
1	5	Classroom 526	N/A	Brick Wall		Non Suspect ACM	800	SF	0	SF				N/A	N/A	N/A
1	5	Classroom 526	M	Transite Sills	2000/01/05/USA/NH/2300	Assumed	10	SF	0	SF				1	No	1/D
1	5	Classroom 527	N/A	Plaster Ceiling		NAD	720	SF	0	SF				N/A	N/A	N/A
1	5	Classroom 527	M	Floor Tile VAT 9" x 9"	2000/01/05/46	Confirmed	720	SF	0	SF	Green			1	No	1/D
1	5	Classroom 527	N/A	Brick Wall		Non Suspect ACM	750	SF	0	SF				N/A	N/A	N/A
1	5	Classroom 527	M	Transite Sills	2000/01/05/USA/NH/2300	Assumed	10	SF	0	SF				1	No	1/D
1	5	Teacher's Lounge 526A	N/A	Plaster Ceiling		NAD	279	SF	0	SF				N/A	N/A	N/A
1	5	Teacher's Lounge 526A	M	Floor Tile VAT 9" x 9"	2000/01/05/46	Confirmed	279	SF	0	SF	Red			1	No	1/D
1	5	Teacher's Lounge 526A	N/A	Brick Wall		Non Suspect ACM	300	SF	0	SF				N/A	N/A	N/A
1	5	Teacher's Lounge 526A	M	Transite Sills	2000/01/05/USA/NH/2300	Assumed	10	SF	0	SF				1	No	1/D
1	5	Teacher's Lounge 526A	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	40	LF	0	LF				N/A	N/A	N/A
1	5	Teacher's Lounge 526A	N/A	Fiberglass Pipe Fitting Insulation		Non Suspect ACM	5	EA	0	EA				N/A	N/A	N/A
1	5	Boy's Restroom	N/A	Plaster Ceiling		NAD	368	SF	0	SF				N/A	N/A	N/A
1	5	Boy's Restroom	N/A	Cement Floor		Non Suspect ACM	368	SF	0	SF				N/A	N/A	N/A
1	5	Boy's Restroom	N/A	Brick Wall		Non Suspect ACM	400	SF	0	SF				N/A	N/A	N/A
1	5	Boy's Restroom	M	Transite Sills	2000/01/05/USA/NH/2300	Assumed	10	SF	0	SF				1	No	1/D
1	5	Faculty Restroom 526C	N/A	Plaster Ceiling		NAD	81	SF	0	SF				N/A	N/A	N/A
1	5	Faculty Restroom 526C	M	Floor Tile VAT 9" x 9"	2000/01/05/46	Confirmed	51	SF	0	SF	Green			1	No	1/D
1	5	Faculty Restroom 526C	N/A	Brick Wall		Non Suspect ACM	100	SF	0	SF				N/A	N/A	N/A
1	5	Faculty Restroom 526C	M	Transite Sills	2000/01/05/USA/NH/2300	Assumed	10	SF	0	SF				1	No	1/D
1	5	Faculty Restroom 526C	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	20	LF	0	LF				N/A	N/A	N/A
1	5	Faculty Restroom 526C	N/A	Fiberglass Pipe Fitting Insulation		Non Suspect ACM	4	EA	0	EA				N/A	N/A	N/A
1	5	Faculty Restroom 526C	M	Floor Tile VAT 12" x 12"	2000/01/05/WW	Assumed	30	SF	0	SF	Green			1	No	1/D
1	5	Classroom 528	N/A	Plaster Ceiling		NAD	744	SF	0	SF				N/A	N/A	N/A
1	5	Classroom 528	M	Floor Tile VAT 9" x 9"	2000/01/05/46	Confirmed	744	SF	0	SF	Green			1	No	1/D
1	5	Classroom 528	N/A	Brick Wall		Non Suspect ACM	800	SF	0	SF				N/A	N/A	N/A
1	5	Classroom 528	M	Transite Sills	2000/01/05/USA/NH/2300	Assumed	10	SF	0	SF				1	No	1/D
1	5	Classroom 529	N/A	Plaster Ceiling		NAD	720	SF	0	SF				N/A	N/A	N/A
1	5	Classroom 529	M	Floor Tile VAT 9" x 9"	2000/01/05/46	Confirmed	720	SF	0	SF	Red			1	No	1/D
1	5	Classroom 529	N/A	Brick Wall		Non Suspect ACM	800	SF	0	SF				N/A	N/A	N/A
1	5	Classroom 529	M	Transite Sills	2000/01/05/USA/NH/2300	Assumed	20	SF	0	SF				1	No	1/D
1	5	Classroom 530	N/A	Plaster Ceiling		NAD	672	SF	0	SF				N/A	N/A	N/A
1	5	Classroom 530	M	Floor Tile VAT 9" x 9"	2000/01/05/46	Confirmed	672	SF	0	SF	Grey			1	No	1/D
1	5	Classroom 530	N/A	Brick Wall		Non Suspect ACM	700	SF	0	SF				N/A	N/A	N/A
1	5	Classroom 530	M	Transite Sills	2000/01/05/USA/NH/2300	Assumed	15	SF	0	SF				1	No	1/D
1	5	Classroom 531	N/A	Plaster Ceiling		NAD	690	SF	0	SF				N/A	N/A	N/A
1	5	Classroom 531	M	Floor Tile VAT 9" x 9"	2000/01/05/46	Confirmed	690	SF	0	SF	Red			1	No	1/D
1	5	Classroom 531	N/A	Brick Wall		Non Suspect ACM	750	SF	0	SF				N/A	N/A	N/A
1	5	Classroom 531	M	Transite Sills	2000/01/05/USA/NH/2300	Assumed	10	SF	0	SF				1	No	1/D
1	5	Classroom 532	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	690	SF	0	SF				N/A	N/A	N/A
1	5	Classroom 532	M	Floor Tile VAT 9" x 9"	2000/01/05/46	Confirmed	690	SF	0	SF	Tan			1	No	1/D
1	5	Classroom 532	N/A	Brick Wall		Non Suspect ACM	750	SF	0	SF				N/A	N/A	N/A
1	5	Classroom 532	M	Transite Sills	2000/01/05/USA/NH/2300	Assumed	10	SF	0	SF				1	No	1/D
1	5	Classroom 533	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	690	SF	0	SF				N/A	N/A	N/A
1	5	Classroom 533	M	Floor Tile VAT 9" x 9"	2000/01/05/46	Confirmed	690	SF	0	SF	Tan			1	No	1/D
1	5	Classroom 533	N/A	Brick Wall		Non Suspect ACM	750	SF	0	SF				N/A	N/A	N/A
1	5	Classroom 533	M	Transite Sills	2000/01/05/USA/NH/2300	Assumed	10	SF	0	SF				1	No	1/D

2000 South Phila HS 2015-2016 AHERA Three-Year Report.xls

School District of Philadelphia South Philadelphia High School 2021 South Broad Street, Philadelphia, PA 19148 ULCS#2000 Year Built: 1957		AHERA Three-Year Reinspection 2015-2016 Room by Room Location Log Report										Reinspection Date: October 29-November 13, 2015 Building Inspector: Norman Harrison Number: ACC-0915-6-011 Management Planner: Megan Vala Number: 740728				
E l e m e n t	F l o o r	On-Site Room Name	System Affected	Material Description	HID#	Confirmed/Assumed/NAD Non Suspect ACM	Amount of Material	(SF/LF/EA)	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic/ Crawl Space Ranking	Damage Potential (DP)	Newly Friable (NF)	Response Action (RA)
1	5	Classroom 534	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	713	SF	0	SF				N/A	N/A	N/A
1	5	Classroom 534	M	Floor Tile VAT 9" x 9"	2000/01/05/46	Confirmed	713	SF	0	SF	Red			1	No	1/D
1	5	Classroom 534	N/A	Brick Wall		Non Suspect ACM	750	SF	0	SF				N/A	N/A	N/A
1	5	Classroom 534	M	Transite Sills	2000/01/05/USA/NH/2300	Assumed	10	SF	0	SF				1	No	1/D
1	5	Classroom 535	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	690	SF	0	SF				N/A	N/A	N/A
1	5	Classroom 535	M	Floor Tile VAT 9" x 9"	2000/01/05/46	Confirmed	690	SF	0	SF	Tan			1	No	1/D
1	5	Classroom 535	N/A	Brick Wall		Non Suspect ACM	750	SF	0	SF				N/A	N/A	N/A
1	5	Classroom 535	M	Transite Sills	2000/01/05/USA/NH/2300	Assumed	10	SF	0	SF				1	No	1/D
1	5	Hallway from Classrooms 507 to 531	M	Floor Tile VAT 9" x 9"	2000/01/05/46	Confirmed	4176	SF	0	SF	Black			1	No	1/D
1	5	Hallway from Classrooms 507 to 531	N/A	Ceiling Tile 1' x 1'		NAD	4176	SF	0	SF				N/A	N/A	N/A
1	5	Hallway from Classrooms 507 to 531	N/A	Concrete Block Wall		Non Suspect ACM	1500	SF	0	SF				N/A	N/A	N/A
1	5	Hallway from Classrooms 507 to 531	N/A	Plaster Walls		NAD	500	SF	0	SF				N/A	N/A	N/A
1	5	Custodial Storage	N/A	Concrete Ceiling		Non Suspect ACM	81	SF	0	SF				N/A	N/A	N/A
1	5	Custodial Storage	N/A	Cement Floor		Non Suspect ACM	81	SF	0	SF				N/A	N/A	N/A
1	5	Custodial Storage	N/A	Brick Wall		Non Suspect ACM	100	SF	0	SF				N/A	N/A	N/A
1	5	Hallway from Classrooms 514 to 522	M	Floor Tile VAT 9" x 9"	2000/01/05/46	Confirmed	1332	SF	0	SF	Black			1	No	1/D
1	5	Hallway from Classrooms 514 to 522	N/A	Ceiling Tile 1' x 1'		NAD	1332	SF	0	SF				N/A	N/A	N/A
1	5	Hallway from Classrooms 514 to 522	N/A	Concrete Block Wall		Non Suspect ACM	750	SF	0	SF				N/A	N/A	N/A
1	5	Hallway from Classrooms 514 to 522	N/A	Plaster Walls		NAD	250	SF	0	SF				N/A	N/A	N/A
1	5	Hallway from Classrooms 507 to 531	M	Floor Tile VAT 9" x 9"	2000/01/05/46	Confirmed	1314	SF	0	SF	Tan			1	No	1/D
1	5	Hallway from Classrooms 507 to 531	N/A	Ceiling Tile 1' x 1'		NAD	1314	SF	0	SF				N/A	N/A	N/A
1	5	Hallway from Classrooms 507 to 531	N/A	Concrete Block Wall		Non Suspect ACM	750	SF	0	SF				N/A	N/A	N/A
1	5	Hallway from Classrooms 507 to 531	N/A	Plaster Walls		NAD	250	SF	0	SF				N/A	N/A	N/A
1	5	Hallway from Classrooms 514 to 521	M	Floor Tile VAT 9" x 9"	2000/01/05/46	Confirmed	1376	SF	0	SF	Green			1	No	1/D
1	5	Hallway from Classrooms 514 to 521	N/A	Ceiling Tile 1' x 1'		NAD	376	SF	0	SF				N/A	N/A	N/A
1	5	Hallway from Classrooms 514 to 521	N/A	Concrete Block Wall		Non Suspect ACM	750	SF	0	SF				N/A	N/A	N/A
1	5	Hallway from Classrooms 514 to 521	N/A	Plaster Walls		NAD	250	SF	0	SF				N/A	N/A	N/A
1	5	Hallway from Classrooms 514 to 521	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	1000	SF	0	SF				N/A	N/A	N/A
1	5	Hallway from Classrooms 514 to 521	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	50	LF	0	LF				N/A	N/A	N/A
1	5	Hallway from Classrooms 514 to 521	N/A	Fiberglass Pipe Fitting Insulation		Non Suspect ACM	20	EA	0	EA				N/A	N/A	N/A
1	5	Stairwell adjacent to Boy's Restroom	M	Floor Tile VAT 9" x 9"	2000/01/05/46	Confirmed	50	SF	0	SF	Black			1	No	1/D
1	5	Stairwell adjacent to Boy's Restroom	N/A	Cement Floor		Non Suspect ACM	230	SF	0	SF				N/A	N/A	N/A
1	5	Stairwell adjacent to Boy's Restroom	N/A	Concrete Ceiling		Non Suspect ACM	280	SF	0	SF				N/A	N/A	N/A
1	5	Stairwell adjacent to Boy's Restroom	N/A	Brick Wall		Non Suspect ACM	300	SF	0	SF				N/A	N/A	N/A
1	5	Stairwell adjacent to Classroom 530	M	Floor Tile VAT 9" x 9"	2000/01/05/46	Confirmed	50	SF	0	SF	Multi			1	No	1/D
1	5	Stairwell adjacent to Classroom 530	N/A	Cement Floor		Non Suspect ACM	230	SF	0	SF				N/A	N/A	N/A
1	5	Stairwell adjacent to Classroom 530	N/A	Concrete Ceiling		Non Suspect ACM	280	SF	0	SF				N/A	N/A	N/A
1	5	Stairwell adjacent to Classroom 530	N/A	Brick Wall		Non Suspect ACM	300	SF	0	SF				N/A	N/A	N/A
1	5	Stairwell adjacent to Classroom 535	M	Floor Tile VAT 9" x 9"	2000/01/05/46	Confirmed	50	SF	0	SF	Black			1	No	1/D
1	5	Stairwell adjacent to Classroom 535	N/A	Cement Floor		Non Suspect ACM	230	SF	0	SF				N/A	N/A	N/A
1	5	Stairwell adjacent to Classroom 535	N/A	Concrete Ceiling		Non Suspect ACM	280	SF	0	SF				N/A	N/A	N/A
1	5	Stairwell adjacent to Classroom 535	N/A	Brick Wall		Non Suspect ACM	300	SF	0	SF				N/A	N/A	N/A
1	5	Stairwell adjacent to Classroom 510	M	Floor Tile VAT 9" x 9"	2000/01/05/46	Confirmed	50	SF	0	SF	Multi			1	No	1/D
1	5	Stairwell adjacent to Classroom 510	N/A	Cement Floor		Non Suspect ACM	230	SF	0	SF				N/A	N/A	N/A
1	5	Stairwell adjacent to Classroom 510	N/A	Concrete Ceiling		Non Suspect ACM	280	SF	0	SF				N/A	N/A	N/A
1	5	Stairwell adjacent to Classroom 510	N/A	Brick Wall		Non Suspect ACM	300	SF	0	SF				N/A	N/A	N/A
1	5	Stairwell adjacent to Classroom 500	M	Floor Tile VAT 12" x 12"	2000/01/05/VVW	Assumed	50	SF	0	SF	Black			1	No	1/D
1	5	Stairwell adjacent to Classroom 500	N/A	Cement Floor		Non Suspect ACM	230	SF	0	SF				N/A	N/A	N/A
1	5	Stairwell adjacent to Classroom 500	N/A	Concrete Ceiling		Non Suspect ACM	280	SF	0	SF				N/A	N/A	N/A
1	5	Stairwell adjacent to Classroom 500	N/A	Brick Wall		Non Suspect ACM	300	SF	0	SF				N/A	N/A	N/A
1	4	Hallway from Classrooms 407 to 429	N/A	Ceiling Tile 1' x 1'		NAD	4176	SF	0	SF				N/A	N/A	N/A
1	4	Hallway from Classrooms 407 to 429	M	Floor Tile VAT 9" x 9"	2000/01/04/38	Confirmed	4176	SF	0	SF	Red			1	No	1/D
1	4	Hallway from Classrooms 407 to 429	N/A	Concrete Block Wall		Non Suspect ACM	1500	SF	0	SF				N/A	N/A	N/A
1	4	Hallway from Classrooms 407 to 429	N/A	Plaster Walls		NAD	500	SF	0	SF				N/A	N/A	N/A
1	4	Hallway from Classrooms 400 to 406	M	Floor Tile VAT 9" x 9"	2000/01/04/38	Confirmed	1332	SF	0	SF	Black			1	No	1/D
1	4	Hallway from Classrooms 400 to 406	N/A	Ceiling Tile 1' x 1'		NAD	1332	SF	0	SF				N/A	N/A	N/A
1	4	Hallway from Classrooms 400 to 406	N/A	Concrete Block Wall		Non Suspect ACM	750	SF	0	SF				N/A	N/A	N/A
1	4	Hallway from Classrooms 400 to 406	N/A	Plaster Walls		NAD	250	SF	0	SF				N/A	N/A	N/A
1	4	Hallway from Classrooms 414 to 420	M	Floor Tile VAT 9" x 9"	2000/01/04/38	Confirmed	1314	SF	0	SF	Tan			1	No	1/D
1	4	Hallway from Classrooms 414 to 420	N/A	Ceiling Tile 1' x 1'		NAD	1314	SF	0	SF				N/A	N/A	N/A
1	4	Hallway from Classrooms 414 to 420	N/A	Concrete Block Wall		Non Suspect ACM	750	SF	0	SF				N/A	N/A	N/A
1	4	Hallway from Classrooms 414 to 420	N/A	Plaster Walls		NAD	250	SF	0	SF				N/A	N/A	N/A
1	4	Hallway from Classrooms 403 to 418	M	Floor Tile VAT 9" x 9"	2000/01/04/38	Confirmed	1376	SF	0	SF	Tan			1	No	1/D
1	4	Hallway from Classrooms 403 to 418	N/A	Ceiling Tile 1' x 1'		NAD	332	SF	0	SF				N/A	N/A	N/A
1	4	Hallway from Classrooms 403 to 418	N/A	Concrete Block Wall		Non Suspect ACM	750	SF	0	SF				N/A	N/A	N/A
1	4	Hallway from Classrooms 403 to 418	N/A	Plaster Walls		NAD	250	SF	0	SF				N/A	N/A	N/A
1	4	Hallway from Classrooms 403 to 418	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	1000	SF	0	SF				N/A	N/A	N/A
1	4	Hallway from Classrooms 403 to 418	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	200	LF	0	LF				N/A	N/A	N/A
1	4	Hallway from Classrooms 403 to 418	N/A	Fiberglass Pipe Fitting Insulation		Non Suspect ACM	20	EA	0	EA				N/A	N/A	N/A
1	4	Stairwell adjacent to Boy's Restroom	M	Floor Tile VAT 9" x 9"	2000/01/04/38	Confirmed	50	SF	0	SF	Tan			1	No	1/D
1	4	Stairwell adjacent to Boy's Restroom	N/A	Cement Floor		Non Suspect ACM	230	SF	0	SF				N/A	N/A	N/A
1	4	Stairwell adjacent to Boy's Restroom	N/A	Concrete Ceiling		Non Suspect ACM	280	SF	0	SF				N/A	N/A	N/A

2000 South Phila HS 2015-2016 AHERA Three-Year Report.xls

School District of Philadelphia South Philadelphia High School 2021 South Broad Street, Philadelphia, PA 19148 ULCS#2000 Year Built: 1957		AHERA Three-Year Reinspection 2015-2016 Room by Room Location Log Report										Reinspection Date: October 29-November 13, 2015 Building Inspector: Norman Harrison Number: ACC-0915-6-011 Management Planner: Megan Vala Number: 740728				
E l e m e n t	F l o o r	On-Site Room Name	System Affected	Material Description	HID#	Confirmed/Assumed/NAD Non Suspect ACM	Amount of Material	(SF/LF/EA)	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic/ Crawl Space Ranking	Damage Potential (DP)	Newly Friable (NF)	Response Action (RA)
1	4	Stairwell adjacent to Boy's Restroom	N/A	Brick Wall		Non Suspect ACM	300	SF	0	SF				N/A	N/A	N/A
1	4	Stairwell adjacent to Classroom 428	M	Floor Tile VAT 9" x 9"	2000/01/04/38	Confirmed	50	SF	0	SF	Tan			1	No	1/D
1	4	Stairwell adjacent to Classroom 428	N/A	Cement Floor		Non Suspect ACM	230	SF	0	SF				N/A	N/A	N/A
1	4	Stairwell adjacent to Classroom 428	N/A	Concrete Ceiling		Non Suspect ACM	280	SF	0	SF				N/A	N/A	N/A
1	4	Stairwell adjacent to Classroom 428	N/A	Brick Wall		Non Suspect ACM	300	SF	0	SF				N/A	N/A	N/A
1	4	Stairwell adjacent to Classroom 435	M	Floor Tile VAT 9" x 9"	2000/01/04/38	Confirmed	50	SF	0	SF	Tan			1	No	1/D
1	4	Stairwell adjacent to Classroom 435	N/A	Cement Floor		Non Suspect ACM	230	SF	0	SF				N/A	N/A	N/A
1	4	Stairwell adjacent to Classroom 435	N/A	Concrete Ceiling		Non Suspect ACM	280	SF	0	SF				N/A	N/A	N/A
1	4	Stairwell adjacent to Classroom 435	N/A	Brick Wall		Non Suspect ACM	300	SF	0	SF				N/A	N/A	N/A
1	4	Stairwell adjacent to Classroom 410	M	Floor Tile VAT 9" x 9"	2000/01/04/38	Confirmed	50	SF	0	SF	Tan			1	No	1/D
1	4	Stairwell adjacent to Classroom 410	N/A	Cement Floor		Non Suspect ACM	230	SF	0	SF				N/A	N/A	N/A
1	4	Stairwell adjacent to Classroom 410	N/A	Concrete Ceiling		Non Suspect ACM	280	SF	0	SF				N/A	N/A	N/A
1	4	Stairwell adjacent to Classroom 410	N/A	Brick Wall		Non Suspect ACM	300	SF	0	SF				N/A	N/A	N/A
1	4	Stairwell adjacent to Classroom 400	M	Floor Tile VAT 12" x 12"	2000/01/04/TT	Assumed	50	SF	0	SF	Black			1	No	1/D
1	4	Stairwell adjacent to Classroom 400	N/A	Cement Floor		Non Suspect ACM	230	SF	0	SF				N/A	N/A	N/A
1	4	Stairwell adjacent to Classroom 400	N/A	Concrete Ceiling		Non Suspect ACM	280	SF	0	SF				N/A	N/A	N/A
1	4	Stairwell adjacent to Classroom 400	N/A	Brick Wall		Non Suspect ACM	300	SF	0	SF				N/A	N/A	N/A
1	4	Classroom 400	N/A	Ceiling Tile 1' x 1'		NAD	690	SF	2	SF				N/A	N/A	N/A
1	4	Classroom 400	M	Floor Tile VAT 12" x 12"	2000/01/04/TT	Assumed	690	SF	0	SF	Tan			1	No	1/D
1	4	Classroom 400	N/A	Brick Wall		Non Suspect ACM	800	SF	0	SF				N/A	N/A	N/A
1	4	Classroom 400	M	Transite Sills	2000/01/04/USA/NH/2300	Assumed	20	SF	0	SF				1	No	1/D
1	4	Classroom 400	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	200	LF	0	LF				N/A	N/A	N/A
1	4	Classroom 400	N/A	Fiberglass Pipe Fitting Insulation		Non Suspect ACM	22	EA	0	EA				N/A	N/A	N/A
1	4	Classroom 401 Science / Math Lab	N/A	Ceiling Tile 1' x 1'		NAD	1058	SF	0	SF				N/A	N/A	N/A
1	4	Classroom 401 Science / Math Lab	M	Floor Tile VAT 12" x 12"	2000/01/04/TT	Assumed	1058	SF	0	SF	Tan			1	No	1/D
1	4	Classroom 401 Science / Math Lab	N/A	Brick Wall		Non Suspect ACM	1000	SF	0	SF				N/A	N/A	N/A
1	4	Classroom 401 Science / Math Lab	M	Transite Sills	2000/01/04/USA/NH/2300	Assumed	20	SF	0	SF				1	No	1/D
1	4	Classroom 401 Science / Math Lab	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	100	LF	0	LF				N/A	N/A	N/A
1	4	Classroom 401 Science / Math Lab	N/A	Fiberglass Pipe Fitting Insulation		Non Suspect ACM	20	EA	0	EA				N/A	N/A	N/A
1	4	Classroom 401 Science / Math Lab	N/A	Plaster Ceiling		NAD	920	SF	0	SF				N/A	N/A	N/A
1	4	Classroom 401 Science / Math Lab	M	Floor Tile VAT 9" x 9"	2000/01/04/38	Confirmed	920	SF	5	SF	Red			1	No	2/C
1	4	Classroom 401 Science / Math Lab	N/A	Brick Wall		Non Suspect ACM	1000	SF	0	SF				N/A	N/A	N/A
1	4	Classroom 401 Science / Math Lab	M	Transite Sills	2000/01/04/USA/NH/2300	Assumed	20	SF	0	SF				1	No	1/D
1	4	Classroom 401 Science / Math Lab	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	100	LF	0	LF				N/A	N/A	N/A
1	4	Classroom 401 Science / Math Lab	N/A	Fiberglass Pipe Fitting Insulation		Non Suspect ACM	12	EA	0	EA				N/A	N/A	N/A
1	4	Classroom 403	N/A	Plaster Ceiling		NAD	1058	SF	0	SF				N/A	N/A	N/A
1	4	Classroom 403	M	Floor Tile VAT 9" x 9"	2000/01/04/38	Confirmed	1058	SF	0	SF	Grey			1	No	1/D
1	4	Classroom 403	N/A	Brick Wall		Non Suspect ACM	1000	SF	0	SF				N/A	N/A	N/A
1	4	Classroom 403	M	Transite Sills	2000/01/04/USA/NH/2300	Assumed	20	SF	0	SF				1	No	1/D
1	4	Classroom 403	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	200	LF	0	LF				N/A	N/A	N/A
1	4	Classroom 403	N/A	Fiberglass Pipe Fitting Insulation		Non Suspect ACM	35	EA	0	EA				N/A	N/A	N/A
1	4	Classroom 404	N/A	Plaster Ceiling		NAD	1058	SF	0	SF				N/A	N/A	N/A
1	4	Classroom 404	M	Floor Tile VAT 9" x 9"	2000/01/04/38	Confirmed	1058	SF	0	SF	Green			1	No	1/D
1	4	Classroom 404	N/A	Brick Wall		Non Suspect ACM	1000	SF	0	SF				N/A	N/A	N/A
1	4	Classroom 404	M	Transite Sills	2000/01/04/USA/NH/2300	Assumed	20	SF	0	SF				1	No	1/D
1	4	Classroom 404	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	80	LF	0	LF				N/A	N/A	N/A
1	4	Classroom 404	N/A	Fiberglass Pipe Fitting Insulation		Non Suspect ACM	9	EA	0	EA				N/A	N/A	N/A
1	4	Classroom 405	N/A	Ceiling Tile 1' x 1'		NAD	920	SF	0	SF				N/A	N/A	N/A
1	4	Classroom 405	M	Floor Tile VAT 9" x 9"	2000/01/04/38	Confirmed	920	SF	0	SF	Green			1	No	1/D
1	4	Classroom 405	N/A	Brick Wall		Non Suspect ACM	1000	SF	0	SF				N/A	N/A	N/A
1	4	Classroom 405	M	Transite Sills	2000/01/04/USA/NH/2300	Assumed	20	SF	0	SF				1	No	1/D
1	4	Classroom 405	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	80	LF	0	LF				N/A	N/A	N/A
1	4	Classroom 405	N/A	Fiberglass Pipe Fitting Insulation		Non Suspect ACM	8	EA	0	EA				N/A	N/A	N/A
1	4	Classroom 406	N/A	Plaster Ceiling		NAD	690	SF	0	SF				N/A	N/A	N/A
1	4	Classroom 406	M	Floor Tile VAT 9" x 9"	2000/01/04/38	Confirmed	690	SF	0	SF	Green			1	No	1/D
1	4	Classroom 406	N/A	Brick Wall		Non Suspect ACM	800	SF	0	SF				N/A	N/A	N/A
1	4	Classroom 406	M	Transite Sills	2000/01/04/USA/NH/2300	Assumed	10	SF	0	SF				1	No	1/D
1	4	Classroom 406	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	100	LF	0	LF				N/A	N/A	N/A
1	4	Classroom 406	N/A	Fiberglass Pipe Fitting Insulation		Non Suspect ACM	10	EA	0	EA				N/A	N/A	N/A
1	4	Janitor's Closet across from Classroom 408	N/A	Cement Floor		Non Suspect ACM	30	SF	0	SF				N/A	N/A	N/A
1	4	Janitor's Closet across from Classroom 408	N/A	Concrete Block Wall		Non Suspect ACM	90	SF	0	SF				N/A	N/A	N/A
1	4	Janitor's Closet across from Classroom 408	N/A	Concrete Ceiling		Non Suspect ACM	30	SF	0	SF				N/A	N/A	N/A
1	4	Room next to Elevator # 1 (South Elevator)	X	X	X	X	X	X	X	X		No Access		X	X	X
1	4	Women's Student Restroom next to Elevator # 1 (South Elevator)	N/A	Cement Floor		Non Suspect ACM	400	SF	0	SF				N/A	N/A	N/A
1	4	Women's Student Restroom next to Elevator # 1 (South Elevator)	N/A	Concrete Block Wall		Non Suspect ACM	1200	SF	0	SF				N/A	N/A	N/A
1	4	Women's Student Restroom next to Elevator # 1 (South Elevator)	N/A	Concrete Ceiling		Non Suspect ACM	400	SF	0	SF				N/A	N/A	N/A
1	4	Women's Student Restroom next to Elevator # 1 (South Elevator)	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	8	LF	0	LF				N/A	N/A	N/A
1	4	Classroom 410	M	Floor Tile VAT 9" x 9"	2000/01/04/38	Confirmed	600	SF	0	SF	Multi			1	No	1/D

2000 South Phila HS 2015-2016 AHERA Three-Year Report.xls

School District of Philadelphia South Philadelphia High School 2021 South Broad Street, Philadelphia, PA 19148 ULCS#2000 Year Built: 1957		AHERA Three-Year Reinspection 2015-2016 Room by Room Location Log Report										Reinspection Date: October 29-November 13, 2015 Building Inspector: Norman Harrison Number: ACC-0915-6-011 Management Planner: Megan Vala Number: 740728				
E l e m e n t	F l o o r	On-Site Room Name	System Affected	Material Description	HID#	Confirmed/Assumed/NAD Non Suspect ACM	Amount of Material	(SF/LF/EA)	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic/ Crawl Space Ranking	Damage Potential (DP)	Newly Friable (NF)	Response Action (RA)
1	4	Classroom 410	N/A	Concrete Block Wall		Non Suspect ACM	1800	SF	0	SF				N/A	N/A	N/A
1	4	Classroom 410	N/A	Concrete Ceiling		Non Suspect ACM	600	SF	0	SF				N/A	N/A	N/A
1	4	Classroom 410	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	48	LF	0	LF				N/A	N/A	N/A
1	4	Classroom 410	N/A	Pipe Fitting Insulation		NAD	16	EA	0	EA				N/A	N/A	N/A
1	4	Classroom 410	M	Transite Sills	2000/01/04/USA/NH/2300	Assumed	10	SF	0	SF		Window Sills		1	No	1/D
1	4	Storage Room 410A	M	Floor Tile VAT 9" x 9"	2000/01/04/38	Confirmed	200	SF	0	SF	Grey			1	No	1/D
1	4	Storage Room 410A	N/A	Concrete Block Wall		Non Suspect ACM	600	SF	0	SF				N/A	N/A	N/A
1	4	Storage Room 410A	N/A	Concrete Ceiling		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A
1	4	Storage Room 410A	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	32	LF	0	LF				N/A	N/A	N/A
1	4	Storage Room 410A	N/A	Pipe Fitting Insulation		NAD	12	EA	0	EA				N/A	N/A	N/A
1	4	Storage Room 410A	M	Transite Sills	2000/01/04/USA/NH/2300	Assumed	10	SF	0	SF		Window Sills		1	No	1/D
1	4	Women's Lounge/Restroom Entrance across from Classroom 413	M	Floor Tile VAT 9" x 9"	2000/01/05/46	Confirmed	250	SF	0	SF	Multi			1	No	1/D
1	4	Women's Lounge/Restroom Entrance across from Classroom 413	N/A	Concrete Block Wall		Non Suspect ACM	750	SF	0	SF				N/A	N/A	N/A
1	4	Women's Lounge/Restroom Entrance across from Classroom 413	N/A	Concrete Ceiling		Non Suspect ACM	250	SF	0	SF				N/A	N/A	N/A
1	4	Women's Lounge/Restroom Entrance across from Classroom 413	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	15	LF	0	LF				N/A	N/A	N/A
1	4	Women's Lounge/Restroom Entrance across from Classroom 413	N/A	Pipe Fitting Insulation		NAD	6	EA	0	EA				N/A	N/A	N/A
1	4	Women's Rear Restroom in Women's Lounge across from Classroom 413	M	Floor Tile VAT 9" x 9"	2000/01/05/46	Confirmed	50	SF	0	SF	Green			1	No	1/D
1	4	Women's Rear Restroom in Women's Lounge across from Classroom 413	N/A	Ceramic Tile Walls		Non Suspect ACM	75	SF	0	SF				N/A	N/A	N/A
1	4	Women's Rear Restroom in Women's Lounge across from Classroom 413	N/A	Concrete Block Wall		Non Suspect ACM	150	SF	0	SF				N/A	N/A	N/A
1	4	Women's Rear Restroom in Women's Lounge across from Classroom 413	N/A	Concrete Ceiling		Non Suspect ACM	50	SF	0	SF				N/A	N/A	N/A
1	4	Women's Front Restroom in Women's Lounge across from Classroom 413	M	Floor Tile VAT 9" x 9"	2000/01/05/46	Confirmed	50	SF	0	SF	Red			1	No	1/D
1	4	Women's Front Restroom in Women's Lounge across from Classroom 413	N/A	Ceramic Tile Walls		Non Suspect ACM	75	SF	0	SF				N/A	N/A	N/A
1	4	Women's Front Restroom in Women's Lounge across from Classroom 413	N/A	Concrete Block Wall		Non Suspect ACM	150	SF	0	SF				N/A	N/A	N/A
1	4	Women's Front Restroom in Women's Lounge across from Classroom 413	N/A	Concrete Ceiling		Non Suspect ACM	50	SF	0	SF				N/A	N/A	N/A
1	4	Room next to Elevator # 2 (Center Elevator)	X	X	X	X	X	X	X	X		No Access		X	X	X
1	4	Stairwell # 5 across from Classroom 421	M	Floor Tile VAT 9" x 9"	2000/01/05/46	Confirmed	120	SF	0	SF	Tan			1	No	1/D
1	4	Stairwell # 5 across from Classroom 421	N/A	Cement Floor		Non Suspect ACM	80	SF	0	SF				N/A	N/A	N/A
1	4	Stairwell # 5 across from Classroom 421	N/A	Concrete Block Wall		Non Suspect ACM	600	SF	0	SF				N/A	N/A	N/A
1	4	Stairwell # 5 across from Classroom 421	N/A	Concrete Ceiling		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A
1	4	Stairwell # 5 across from Classroom 421	T	Radiator Insulation	2000/01/04/SYN/BB/1600	Assumed	20	SF	0	SF				1	No	1/D
1	4	Stairwell # 5 across from Classroom 421	M	Transite Sills	2000/01/04/USA/NH/2300	Assumed	2	SF	0	SF		Fire Extinguisher Sill		1	No	1/D
1	4	Classroom 407	N/A	Plaster Ceiling		NAD	690	SF	0	SF				N/A	N/A	N/A
1	4	Classroom 407	M	Floor Tile VAT 9" x 9"	2000/01/04/38	Confirmed	690	SF	0	SF	Green			1	No	1/D
1	4	Classroom 407	N/A	Brick Wall		Non Suspect ACM	800	SF	0	SF				N/A	N/A	N/A
1	4	Classroom 407	M	Transite Sills	2000/01/04/USA/NH/2300	Assumed	20	SF	0	SF				1	No	1/D
1	4	Classroom 407	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	40	LF	0	LF				N/A	N/A	N/A
1	4	Classroom 407	N/A	Fiberglass Pipe Fitting Insulation		Non Suspect ACM	10	EA	0	EA				N/A	N/A	N/A
1	4	Classroom 408	N/A	Plaster Ceiling		NAD	690	SF	0	SF				N/A	N/A	N/A
1	4	Classroom 408	M	Floor Tile VAT 9" x 9"	2000/01/04/38	Confirmed	690	SF	0	SF	Red			1	No	1/D
1	4	Classroom 408	N/A	Brick Wall		Non Suspect ACM	800	SF	0	SF				N/A	N/A	N/A
1	4	Classroom 408	M	Transite Sills	2000/01/04/USA/NH/2300	Assumed	20	SF	0	SF				1	No	1/D
1	4	Classroom 408	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	30	LF	0	LF				N/A	N/A	N/A
1	4	Classroom 408	N/A	Fiberglass Pipe Fitting Insulation		Non Suspect ACM	10	EA	0	EA				N/A	N/A	N/A
1	4	Classroom 409	N/A	Plaster Ceiling		NAD	690	SF	0	SF				N/A	N/A	N/A
1	4	Classroom 409	M	Floor Tile VAT 9" x 9"	2000/01/04/38	Confirmed	690	SF	0	SF	Green			1	No	1/D
1	4	Classroom 409	N/A	Brick Wall		Non Suspect ACM	800	SF	0	SF				N/A	N/A	N/A
1	4	Classroom 409	M	Transite Sills	2000/01/04/USA/NH/2300	Assumed	20	SF	0	SF				1	No	1/D
1	4	Classroom 409	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	70	LF	0	LF				N/A	N/A	N/A
1	4	Classroom 409	N/A	Fiberglass Pipe Fitting Insulation		Non Suspect ACM	12	EA	0	EA				N/A	N/A	N/A
1	4	Classroom 411	N/A	Plaster Ceiling		NAD	690	SF	0	SF				N/A	N/A	N/A
1	4	Classroom 411	M	Floor Tile VAT 9" x 9"	2000/01/04/38	Confirmed	690	SF	0	SF	Red			1	No	1/D
1	4	Classroom 411	N/A	Brick Wall		Non Suspect ACM	800	SF	0	SF				N/A	N/A	N/A
1	4	Classroom 411	M	Transite Sills	2000/01/04/USA/NH/2300	Assumed	20	SF	0	SF				1	No	1/D
1	4	Classroom 411	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	75	LF	0	LF				N/A	N/A	N/A
1	4	Classroom 411	N/A	Fiberglass Pipe Fitting Insulation		Non Suspect ACM	8	EA	0	EA				N/A	N/A	N/A
1	4	Classroom 412	N/A	Plaster Ceiling		NAD	690	SF	0	SF				N/A	N/A	N/A
1	4	Classroom 412	M	Floor Tile VAT 9" x 9"	2000/01/04/38	Confirmed	690	SF	0	SF	Green			1	No	1/D
1	4	Classroom 412	N/A	Brick Wall		Non Suspect ACM	800	SF	0	SF				N/A	N/A	N/A
1	4	Classroom 412	M	Transite Sills	2000/01/04/USA/NH/2300	Assumed	10	SF	0	SF				1	No	1/D
1	4	Classroom 412	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	90	LF	0	LF				N/A	N/A	N/A

2000 South Phila HS 2015-2016 AHERA Three-Year Report.xls

School District of Philadelphia South Philadelphia High School 2021 South Broad Street, Philadelphia, PA 19148 ULCS#2000 Year Built: 1957		AHERA Three-Year Reinspection 2015-2016 Room by Room Location Log Report										Reinspection Date: October 29-November 13, 2015 Building Inspector: Norman Harrison Number: ACC-0915-6-011 Management Planner: Megan Vala Number: 740728				
E l e m e n t	F l o o r	On-Site Room Name	System Affected	Material Description	HID#	Confirmed/Assumed/NAD Non Suspect ACM	Amount of Material	(SF/LF/EA)	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic/ Crawl Space Ranking	Damage Potential (DP)	Newly Friable (NF)	Response Action (RA)
1	4	Classroom 412	N/A	Fiberglass Pipe Fitting Insulation		Non Suspect ACM	12	EA	0	EA				N/A	N/A	N/A
1	4	Counselor's Office	N/A	Plaster Ceiling		NAD	414	SF	0	SF				N/A	N/A	N/A
1	4	Counselor's Office	M	Floor Tile VAT 9" x 9"	2000/01/04/38	Confirmed	414	SF	0	SF	Tan			1	No	1/D
1	4	Counselor's Office	N/A	Brick Wall		Non Suspect ACM	500	SF	0	SF				N/A	N/A	N/A
1	4	Counselor's Office	M	Transite Sills	2000/01/04/USA/NH/2300	Assumed	10	SF	0	SF				1	No	1/D
1	4	Counselor's Office	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	20	LF	0	LF				N/A	N/A	N/A
1	4	Counselor's Office	N/A	Fiberglass Pipe Fitting Insulation		Non Suspect ACM	6	EA	0	EA				N/A	N/A	N/A
1	4	Classroom 413	N/A	Plaster Ceiling		NAD	690	SF	0	SF				N/A	N/A	N/A
1	4	Classroom 413	M	Floor Tile VAT 9" x 9"	2000/01/04/38	Confirmed	690	SF	0	SF	Green			1	No	1/D
1	4	Classroom 413	N/A	Brick Wall		Non Suspect ACM	800	SF	0	SF				N/A	N/A	N/A
1	4	Classroom 413	M	Transite Sills	2000/01/04/USA/NH/2300	Assumed	20	SF	0	SF				1	No	1/D
1	4	Classroom 413	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	80	LF	0	LF				N/A	N/A	N/A
1	4	Classroom 413	N/A	Fiberglass Pipe Fitting Insulation		Non Suspect ACM	15	EA	0	EA				N/A	N/A	N/A
1	4	Classroom 414	N/A	Plaster Ceiling		NAD	575	SF	0	SF				N/A	N/A	N/A
1	4	Classroom 414	M	Floor Tile VAT 9" x 9"	2000/01/04/38	Confirmed	575	SF	0	SF	Green			1	No	1/D
1	4	Classroom 414	N/A	Brick Wall		Non Suspect ACM	750	SF	0	SF				N/A	N/A	N/A
1	4	Classroom 414	M	Transite Sills	2000/01/04/USA/NH/2300	Assumed	20	SF	0	SF				1	No	1/D
1	4	Classroom 414	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	80	LF	0	LF				N/A	N/A	N/A
1	4	Janitor's Closet next to Classroom 414	N/A	Cement Floor		Non Suspect ACM	30	SF	0	SF				N/A	N/A	N/A
1	4	Janitor's Closet next to Classroom 414	N/A	Concrete Block Wall		Non Suspect ACM	90	SF	0	SF				N/A	N/A	N/A
1	4	Janitor's Closet next to Classroom 414	N/A	Concrete Ceiling		Non Suspect ACM	30	SF	0	SF				N/A	N/A	N/A
1	4	Classroom 415	N/A	Plaster Ceiling		NAD	750	SF	0	SF				N/A	N/A	N/A
1	4	Classroom 415	M	Floor Tile VAT 9" x 9"	2000/01/04/38	Confirmed	750	SF	0	SF	Green			1	No	1/D
1	4	Classroom 415	N/A	Brick Wall		Non Suspect ACM	800	SF	0	SF				N/A	N/A	N/A
1	4	Classroom 415	M	Transite Sills	2000/01/04/USA/NH/2300	Assumed	20	SF	0	SF				1	No	1/D
1	4	Classroom 415	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	10	LF	0	LF				N/A	N/A	N/A
1	4	Classroom 415	N/A	Pipe Fitting Insulation		NAD	4	EA	0	EA				N/A	N/A	N/A
1	4	Classroom 416	N/A	Plaster Ceiling		NAD	750	SF	0	SF				N/A	N/A	N/A
1	4	Classroom 416	M	Floor Tile VAT 9" x 9"	2000/01/04/38	Confirmed	750	SF	0	SF	Green			1	No	1/D
1	4	Classroom 416	N/A	Brick Wall		Non Suspect ACM	800	SF	0	SF				N/A	N/A	N/A
1	4	Classroom 416	M	Transite Sills	2000/01/04/USA/NH/2300	Assumed	20	SF	0	SF				1	No	1/D
1	4	Classroom 416	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	100	LF	0	LF				N/A	N/A	N/A
1	4	Classroom 416	N/A	Pipe Fitting Insulation		NAD	20	EA	0	EA				N/A	N/A	N/A
1	4	Classroom 417	N/A	Plaster Ceiling		NAD	750	SF	0	SF				N/A	N/A	N/A
1	4	Classroom 417	M	Floor Tile VAT 9" x 9"	2000/01/04/38	Confirmed	750	SF	0	SF	Red			1	No	1/D
1	4	Classroom 417	N/A	Brick Wall		Non Suspect ACM	800	SF	0	SF				N/A	N/A	N/A
1	4	Classroom 417	M	Transite Sills	2000/01/04/USA/NH/2300	Assumed	20	SF	0	SF				1	No	1/D
1	4	Classroom 417	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	75	LF	0	LF				N/A	N/A	N/A
1	4	Classroom 417	N/A	Pipe Fitting Insulation		NAD	15	EA	0	EA				N/A	N/A	N/A
1	4	Classroom 418	N/A	Plaster Ceiling		NAD	720	SF	0	SF				N/A	N/A	N/A
1	4	Classroom 418	M	Floor Tile VAT 9" x 9"	2000/01/04/38	Confirmed	720	SF	0	SF	Green			1	No	1/D
1	4	Classroom 418	N/A	Brick Wall		Non Suspect ACM	800	SF	0	SF				N/A	N/A	N/A
1	4	Classroom 418	M	Transite Sills	2000/01/04/USA/NH/2300	Assumed	10	SF	0	SF				1	No	1/D
1	4	Classroom 418	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	100	LF	0	LF				N/A	N/A	N/A
1	4	Classroom 418	N/A	Pipe Fitting Insulation		NAD	15	EA	0	EA				N/A	N/A	N/A
1	4	Office 418A	N/A	Plaster Ceiling		NAD	336	SF	0	SF				N/A	N/A	N/A
1	4	Office 418A	M	Floor Tile VAT 9" x 9"	2000/01/04/38	Confirmed	336	SF	0	SF	Green			1	No	1/D
1	4	Office 418A	N/A	Brick Wall		Non Suspect ACM	500	SF	0	SF				N/A	N/A	N/A
1	4	Office 418A	M	Transite Sills	2000/01/04/USA/NH/2300	Assumed	10	SF	0	SF				1	No	1/D
1	4	Office 418A	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	30	LF	0	LF				N/A	N/A	N/A
1	4	Office 418A	N/A	Pipe Fitting Insulation		NAD	11	EA	0	EA				N/A	N/A	N/A
1	4	Stairwell # 4 next to Office 418A	M	Floor Tile VAT 9" x 9"	2000/01/05/46	Confirmed	120	SF	0	SF	Tan			1	No	1/D
1	4	Stairwell # 4 next to Office 418A	N/A	Cement Floor		Non Suspect ACM	80	SF	0	SF				N/A	N/A	N/A
1	4	Stairwell # 4 next to Office 418A	N/A	Concrete Block Wall		Non Suspect ACM	600	SF	0	SF				N/A	N/A	N/A
1	4	Stairwell # 4 next to Office 418A	N/A	Concrete Ceiling		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A
1	4	Stairwell # 4 next to Office 418A	T	Radiator Insulation	2000/01/04/SYN/BB/1600	Assumed	20	SF	0	SF				1	No	1/D
1	4	Classroom 432	M	Floor Tile VAT 9" x 9"	2000/01/04/38	Confirmed	720	SF	0	SF	Tan			1	No	1/D
1	4	Classroom 432	N/A	Concrete Block Wall		Non Suspect ACM	2160	SF	0	SF				N/A	N/A	N/A
1	4	Classroom 432	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	720	SF	0	SF				N/A	N/A	N/A
1	4	Classroom 432	N/A	Concrete Ceiling		Non Suspect ACM	720	SF	0	SF				N/A	N/A	N/A
1	4	Classroom 432	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	20	LF	0	LF				N/A	N/A	N/A
1	4	Staff Lounge 433	M	Floor Tile VAT 9" x 9"	2000/01/04/38	Confirmed	720	SF	0	SF	Tan			1	No	1/D
1	4	Staff Lounge 433	N/A	Concrete Block Wall		Non Suspect ACM	2160	SF	0	SF				N/A	N/A	N/A
1	4	Staff Lounge 433	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	720	SF	0	SF				N/A	N/A	N/A
1	4	Staff Lounge 433	N/A	Concrete Ceiling		Non Suspect ACM	720	SF	0	SF				N/A	N/A	N/A
1	4	Staff Lounge 433	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	20	LF	0	LF				N/A	N/A	N/A
1	4	Classroom 434	M	Floor Tile VAT 9" x 9"	2000/01/04/38	Confirmed	720	SF	0	SF	Tan			1	No	1/D
1	4	Classroom 434	N/A	Concrete Block Wall		Non Suspect ACM	2160	SF	0	SF				N/A	N/A	N/A
1	4	Classroom 434	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	720	SF	0	SF				N/A	N/A	N/A
1	4	Classroom 434	N/A	Concrete Ceiling		Non Suspect ACM	720	SF	0	SF				N/A	N/A	N/A
1	4	Classroom 434	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	16	LF	0	LF				N/A	N/A	N/A
1	4	Photo Studio Room 435	M	Floor Tile VAT 9" x 9"	2000/01/04/38	Confirmed	720	SF	0	SF	Tan			1	No	1/D

2000 South Phila HS 2015-2016 AHERA Three-Year Report.xls

School District of Philadelphia South Philadelphia High School 2021 South Broad Street, Philadelphia, PA 19148 ULCS#2000 Year Built: 1957		AHERA Three-Year Reinspection 2015-2016 Room by Room Location Log Report										Reinspection Date: October 29-November 13, 2015 Building Inspector: Norman Harrison Number: ACC-0915-6-011 Management Planner: Megan Vala Number: 740728				
E l e m e n t	F l o o r	On-Site Room Name	System Affected	Material Description	HID#	Confirmed/Assumed/NAD Non Suspect ACM	Amount of Material	(SF/LF/EA)	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic/ Crawl Space Ranking	Damage Potential (DP)	Newly Friable (NF)	Response Action (RA)
1	4	Photo Studio Room 435	N/A	Concrete Block Wall		Non Suspect ACM	2160	SF	0	SF				N/A	N/A	N/A
1	4	Photo Studio Room 435	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	720	SF	0	SF				N/A	N/A	N/A
1	4	Photo Studio Room 435	N/A	Concrete Ceiling		Non Suspect ACM	720	SF	0	SF				N/A	N/A	N/A
1	4	Photo Studio Room 435	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	20	LF	0	LF				N/A	N/A	N/A
1	4	Office 403A	M	Floor Tile VAT 9" x 9"	2000/01/04/38	Confirmed	360	SF	0	SF	Multi			1	No	1/D
1	4	Office 403A	N/A	Concrete Block Wall		Non Suspect ACM	1080	SF	0	SF				N/A	N/A	N/A
1	4	Office 403A	N/A	Concrete Ceiling		Non Suspect ACM	360	SF	0	SF				N/A	N/A	N/A
1	4	Office 403A	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	30	LF	0	LF				N/A	N/A	N/A
1	4	Office 403A	N/A	Pipe Fitting Insulation		NAD	20	EA	0	EA				N/A	N/A	N/A
1	4	Classroom 419	N/A	Plaster Ceiling		NAD	1250	SF	0	SF				N/A	N/A	N/A
1	4	Classroom 419	M	Floor Tile VAT 9" x 9"	2000/01/04/38	Confirmed	1250	SF	0	SF	Red			1	No	1/D
1	4	Classroom 419	N/A	Brick Wall		Non Suspect ACM	1500	SF	0	SF				N/A	N/A	N/A
1	4	Classroom 419	M	Transite Sills	2000/01/04/USA/NH/2300	Assumed	20	SF	0	SF				1	No	1/D
1	4	Classroom 419	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	120	LF	0	LF				N/A	N/A	N/A
1	4	Classroom 419	N/A	Pipe Fitting Insulation		NAD	20	EA	0	EA				N/A	N/A	N/A
1	4	Storage Room in Classroom 419	N/A	Cement Floor		Non Suspect ACM	80	SF	0	SF				N/A	N/A	N/A
1	4	Storage Room in Classroom 419	N/A	Concrete Block Wall		Non Suspect ACM	240	SF	0	SF				N/A	N/A	N/A
1	4	Storage Room in Classroom 419	N/A	Concrete Ceiling		Non Suspect ACM	80	SF	0	SF				N/A	N/A	N/A
1	4	Storage Room in Classroom 419	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	15	LF	0	LF				N/A	N/A	N/A
1	4	Storage Room in Classroom 419	N/A	Pipe Fitting Insulation		NAD	2	EA	0	EA				N/A	N/A	N/A
1	4	Storage Room in Classroom 419	M	Transite Sills	2000/01/04/USA/NH/2300	Assumed	5	SF	0	SF		Window Sills		1	No	1/D
1	4	Classroom 420	N/A	Plaster Ceiling		NAD	1150	SF	0	SF				N/A	N/A	N/A
1	4	Classroom 420	M	Floor Tile VAT 9" x 9"	2000/01/04/38	Confirmed	1150	SF	0	SF	Red			1	No	1/D
1	4	Classroom 420	N/A	Brick Wall		Non Suspect ACM	1200	SF	0	SF				N/A	N/A	N/A
1	4	Classroom 420	M	Transite Sills	2000/01/04/USA/NH/2300	Assumed	20	SF	0	SF				1	No	1/D
1	4	Classroom 420	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	75	LF	0	LF				N/A	N/A	N/A
1	4	Classroom 420	N/A	Pipe Fitting Insulation		NAD	15	EA	0	EA				N/A	N/A	N/A
1	4	Smaller Storage Room in Classroom 420	N/A	Cement Floor		Non Suspect ACM	50	SF	0	SF				N/A	N/A	N/A
1	4	Smaller Storage Room in Classroom 420	N/A	Concrete Block Wall		Non Suspect ACM	150	SF	0	SF				N/A	N/A	N/A
1	4	Smaller Storage Room in Classroom 420	N/A	Concrete Ceiling		Non Suspect ACM	50	SF	0	SF				N/A	N/A	N/A
1	4	Storage Room between Classrooms 419 and 420	M	Floor Tile VAT 9" x 9"	2000/01/04/38	Confirmed	160	SF	0	SF	Green			1	No	1/D
1	4	Storage Room between Classrooms 419 and 420	N/A	Concrete Block Wall		Non Suspect ACM	490	SF	0	SF				N/A	N/A	N/A
1	4	Storage Room between Classrooms 419 and 420	N/A	Concrete Ceiling		Non Suspect ACM	160	SF	0	SF				N/A	N/A	N/A
1	4	Larger Storage Room in Classroom 420	N/A	Carpet		Non Suspect ACM	100	SF	0	SF				N/A	N/A	N/A
1	4	Larger Storage Room in Classroom 420	N/A	Concrete Block Wall		Non Suspect ACM	300	SF	0	SF				N/A	N/A	N/A
1	4	Larger Storage Room in Classroom 420	N/A	Concrete Ceiling		Non Suspect ACM	100	SF	0	SF				N/A	N/A	N/A
1	4	Larger Storage Room in Classroom 420	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	15	LF	0	LF				N/A	N/A	N/A
1	4	Larger Storage Room in Classroom 420	N/A	Pipe Fitting Insulation		NAD	7	EA	0	EA				N/A	N/A	N/A
1	4	Larger Storage Room in Classroom 420	M	Transite Sills	2000/01/04/USA/NH/2300	Assumed	4	SF	0	SF		Window Sills		1	No	1/D
1	4	Classroom 417	N/A	Plaster Ceiling		NAD	690	SF	0	SF				N/A	N/A	N/A
1	4	Classroom 421	M	Floor Tile VAT 9" x 9"	2000/01/04/38	Confirmed	690	SF	0	SF	Red			1	No	1/D
1	4	Classroom 421	N/A	Brick Wall		Non Suspect ACM	750	SF	0	SF				N/A	N/A	N/A
1	4	Classroom 421	M	Transite Sills	2000/01/04/USA/NH/2300	Assumed	15	SF	0	SF				1	No	1/D
1	4	Classroom 421	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	50	LF	0	LF				N/A	N/A	N/A
1	4	Classroom 421	N/A	Pipe Fitting Insulation		NAD	8	EA	0	EA				N/A	N/A	N/A
1	4	Classroom 417	N/A	Plaster Ceiling		NAD	690	SF	0	SF				N/A	N/A	N/A
1	4	Classroom 422	M	Floor Tile VAT 9" x 9"	2000/01/04/38	Confirmed	690	SF	0	SF	Green			1	No	1/D
1	4	Classroom 422	N/A	Brick Wall		Non Suspect ACM	750	SF	0	SF				N/A	N/A	N/A
1	4	Classroom 422	M	Transite Sills	2000/01/04/USA/NH/2300	Assumed	15	SF	0	SF				1	No	1/D
1	4	Classroom 422	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	50	LF	0	LF				N/A	N/A	N/A
1	4	Classroom 422	N/A	Pipe Fitting Insulation		NAD	8	EA	0	EA				N/A	N/A	N/A
1	4	Classroom 423	N/A	Plaster Ceiling		NAD	690	SF	0	SF				N/A	N/A	N/A
1	4	Classroom 423	M	Floor Tile VAT 9" x 9"	2000/01/04/38	Confirmed	690	SF	0	SF	Red			1	No	1/D
1	4	Classroom 423	N/A	Brick Wall		Non Suspect ACM	750	SF	0	SF				N/A	N/A	N/A
1	4	Classroom 423	M	Transite Sills	2000/01/04/USA/NH/2300	Assumed	15	SF	0	SF				1	No	1/D
1	4	Classroom 423	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	60	LF	0	LF				N/A	N/A	N/A
1	4	Classroom 423	N/A	Pipe Fitting Insulation		NAD	12	EA	0	EA				N/A	N/A	N/A
1	4	Classroom 424	N/A	Plaster Ceiling		NAD	713	SF	0	SF				N/A	N/A	N/A
1	4	Classroom 424	M	Floor Tile VAT 9" x 9"	2000/01/04/38	Confirmed	713	SF	0	SF	Red			1	No	1/D
1	4	Classroom 424	N/A	Brick Wall		Non Suspect ACM	750	SF	0	SF				N/A	N/A	N/A
1	4	Classroom 424	M	Transite Sills	2000/01/04/USA/NH/2300	Assumed	15	SF	0	SF				1	No	1/D
1	4	Teacher's Lounge 424A	N/A	Plaster Ceiling		NAD	690	SF	0	SF				N/A	N/A	N/A
1	4	Teacher's Lounge 424A	M	Floor Tile VAT 9" x 9"	2000/01/04/38	Confirmed	279	SF	0	SF	Red			1	No	1/D
1	4	Teacher's Lounge 424A	N/A	Brick Wall		Non Suspect ACM	279	SF	0	SF				N/A	N/A	N/A
1	4	Teacher's Lounge 424A	M	Transite Sills	2000/01/04/USA/NH/2300	Assumed	15	SF	0	SF				1	No	1/D
1	4	Teacher's Lounge 424A	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	100	LF	0	LF				N/A	N/A	N/A
1	4	Teacher's Lounge 424A	N/A	Pipe Fitting Insulation		NAD	20	EA	0	EA				N/A	N/A	N/A
1	4	Boy's Restroom	N/A	Plaster Ceiling		NAD	368	SF	0	SF				N/A	N/A	N/A
1	4	Boy's Restroom	N/A	Cement Floor		Non Suspect ACM	368	SF	0	SF	Red			N/A	N/A	N/A
1	4	Boy's Restroom	N/A	Brick Wall		Non Suspect ACM	400	SF	0	SF				N/A	N/A	N/A
1	4	Boy's Restroom	M	Transite Sills	2000/01/04/USA/NH/2300	Assumed	15	SF	0	SF				1	No	1/D
1	4	Boy's Restroom	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	10	LF	0	LF				N/A	N/A	N/A

2000 South Phila HS 2015-2016 AHERA Three-Year Report.xls

School District of Philadelphia South Philadelphia High School 2021 South Broad Street, Philadelphia, PA 19148 ULCS#2000 Year Built: 1957		AHERA Three-Year Reinspection 2015-2016 Room by Room Location Log Report										Reinspection Date: October 29-November 13, 2015 Building Inspector: Norman Harrison Number: ACC-0915-6-011 Management Planner: Megan Vala Number: 740728				
E l e m e n t	F l o o r	On-Site Room Name	System Affected	Material Description	HID#	Confirmed/Assumed/NAD Non Suspect ACM	Amount of Material	(SF/LF/EA)	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic/ Crawl Space Ranking	Damage Potential (DP)	Newly Friable (NF)	Response Action (RA)
1	4	Boy's Restroom	N/A	Pipe Fitting Insulation		NAD	4	EA	0	EA				N/A	N/A	N/A
1	4	Teacher's Lounge Restroom	N/A	Plaster Ceiling		NAD	100	SF	0	SF				N/A	N/A	N/A
1	4	Teacher's Lounge Restroom	N/A	Cement Floor		Non Suspect ACM	100	SF	0	SF				N/A	N/A	N/A
1	4	Teacher's Lounge Restroom	N/A	Brick Wall		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A
1	4	Teacher's Lounge Restroom	M	Transite Sills	2000/01/04/USA/NH/2300	Assumed	10	SF	0	SF				1	No	1/D
1	4	Teacher's Lounge Restroom	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	80	LF	0	LF				N/A	N/A	N/A
1	4	Teacher's Lounge Restroom	N/A	Pipe Fitting Insulation		NAD	12	EA	0	EA				N/A	N/A	N/A
1	4	Classroom 425	N/A	Plaster Ceiling		NAD	690	SF	0	SF				N/A	N/A	N/A
1	4	Classroom 425	M	Floor Tile VAT 9" x 9"	2000/01/04/38	Confirmed	690	SF	0	SF	Green			1	No	1/D
1	4	Classroom 425	N/A	Brick Wall		Non Suspect ACM	750	SF	0	SF				N/A	N/A	N/A
1	4	Classroom 425	M	Transite Sills	2000/01/04/USA/NH/2300	Assumed	15	SF	0	SF				1	No	1/D
1	4	Classroom 425	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	30	LF	0	LF				N/A	N/A	N/A
1	4	Classroom 425	N/A	Pipe Fitting Insulation		NAD	7	EA	0	EA				N/A	N/A	N/A
1	4	Classroom 426	N/A	Plaster Ceiling		NAD	690	SF	0	SF				N/A	N/A	N/A
1	4	Classroom 426	M	Floor Tile VAT 9" x 9"	2000/01/04/38	Confirmed	690	SF	0	SF	Green			1	No	1/D
1	4	Classroom 426	N/A	Brick Wall		Non Suspect ACM	750	SF	0	SF				N/A	N/A	N/A
1	4	Classroom 426	M	Transite Sills	2000/01/04/USA/NH/2300	Assumed	15	SF	0	SF				1	No	1/D
1	4	Classroom 426	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	60	LF	0	LF				N/A	N/A	N/A
1	4	Classroom 426	N/A	Pipe Fitting Insulation		NAD	12	EA	0	EA				N/A	N/A	N/A
1	4	Classroom 427	N/A	Plaster Ceiling		NAD	690	SF	0	SF				N/A	N/A	N/A
1	4	Classroom 427	M	Floor Tile VAT 9" x 9"	2000/01/04/38	Confirmed	690	SF	0	SF	Red			1	No	1/D
1	4	Classroom 427	N/A	Brick Wall		Non Suspect ACM	750	SF	0	SF				N/A	N/A	N/A
1	4	Classroom 427	M	Transite Sills	2000/01/04/USA/NH/2300	Assumed	15	SF	0	SF				1	No	1/D
1	4	Classroom 427	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	60	LF	0	LF				N/A	N/A	N/A
1	4	Classroom 427	N/A	Pipe Fitting Insulation		NAD	10	EA	0	EA				N/A	N/A	N/A
1	4	Classroom 428	N/A	Plaster Ceiling		NAD	644	SF	0	SF				N/A	N/A	N/A
1	4	Classroom 428	M	Floor Tile VAT 9" x 9"	2000/01/04/38	Confirmed	644	SF	0	SF	Grey			1	No	1/D
1	4	Classroom 428	N/A	Brick Wall		Non Suspect ACM	750	SF	0	SF				N/A	N/A	N/A
1	4	Classroom 428	M	Transite Sills	2000/01/04/USA/NH/2300	Assumed	15	SF	0	SF				1	No	1/D
1	4	Classroom 428	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	90	LF	0	LF				N/A	N/A	N/A
1	4	Classroom 428	N/A	Pipe Fitting Insulation		NAD	20	EA	0	EA				N/A	N/A	N/A
1	4	Classroom 429	N/A	Plaster Ceiling		NAD	690	SF	0	SF				N/A	N/A	N/A
1	4	Classroom 429	M	Floor Tile VAT 9" x 9"	2000/01/04/38	Confirmed	690	SF	0	SF	Green			1	No	1/D
1	4	Classroom 429	N/A	Brick Wall		Non Suspect ACM	750	SF	0	SF				N/A	N/A	N/A
1	4	Classroom 429	M	Transite Sills	2000/01/04/USA/NH/2300	Assumed	15	SF	0	SF				1	No	1/D
1	4	Classroom 429	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	80	LF	0	LF				N/A	N/A	N/A
1	4	Classroom 429	N/A	Pipe Fitting Insulation		NAD	14	EA	0	EA				N/A	N/A	N/A
1	3	Classroom 300 Science Lab	N/A	Plaster Ceiling		NAD	1444	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 300 Science Lab	M	Floor Tile VAT 9" x 9"	2000/01/03/32	Confirmed	1444	SF	0	SF	Red			1	No	1/D
1	3	Classroom 300 Science Lab	N/A	Brick Wall		Non Suspect ACM	1500	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 300 Science Lab	M	Transite Sills	2000/01/03/USA/NH/2300	Assumed	20	SF	0	SF				1	No	1/D
1	3	Classroom 300 Science Lab	N/A	Fiberglass Pipe Fitting Insulation		Non Suspect ACM	100	LF	0	LF				N/A	N/A	N/A
1	3	Classroom 300 Science Lab	N/A	Pipe Fitting Insulation		NAD	17	EA	0	EA				N/A	N/A	N/A
1	3	Classroom 300 Science Lab	M	Transite Sink	2000/01/03/USA/NH/2340	Assumed	20	SF	0	SF				1	No	1/D
1	3	Storage Room adjacent to Classroom 300	N/A	Concrete Ceiling		Non Suspect ACM	90	SF	0	SF				N/A	N/A	N/A
1	3	Storage Room adjacent to Classroom 300	N/A	Cement Floor		Non Suspect ACM	90	SF	0	SF				N/A	N/A	N/A
1	3	Storage Room adjacent to Classroom 300	N/A	Brick Wall		Non Suspect ACM	120	SF	0	SF				N/A	N/A	N/A
1	3	Storage Room adjacent to Classroom 300	N/A	Fiberglass Pipe Fitting Insulation		Non Suspect ACM	80	LF	0	LF				N/A	N/A	N/A
1	3	Storage Room adjacent to Classroom 300	N/A	Pipe Fitting Insulation		NAD	20	EA	0	EA				N/A	N/A	N/A
1	3	Storage Room across from Classroom 300	N/A	Plaster Ceiling		NAD	110	SF	0	SF				N/A	N/A	N/A
1	3	Storage Room across from Classroom 300	M	Floor Tile VAT 9" x 9"	2000/01/03/32	Confirmed	110	SF	0	SF	Green			1	No	1/D
1	3	Storage Room across from Classroom 300	N/A	Brick Wall		Non Suspect ACM	150	SF	0	SF				N/A	N/A	N/A
1	3	Storage Room across from Classroom 300	N/A	Fiberglass Pipe Fitting Insulation		Non Suspect ACM	100	LF	0	LF				N/A	N/A	N/A
1	3	Storage Room across from Classroom 300	N/A	Pipe Fitting Insulation		NAD	4	EA	0	EA				N/A	N/A	N/A
1	3	Hallway Storage Closet across from Classrooms 300	M	Floor Tile VAT 9" x 9"	2000/01/03/32	Confirmed	110	SF	0	SF	Green	Access to Auditorium Attic		1	No	1/D
1	3	Hallway Storage Closet across from Classrooms 300	N/A	Concrete Block Wall		Non Suspect ACM	330	SF	0	SF				N/A	N/A	N/A
1	3	Hallway Storage Closet across from Classrooms 300	N/A	Concrete Ceiling		Non Suspect ACM	110	SF	0	SF				N/A	N/A	N/A
1	3	Hallway Storage Closet across from Classrooms 300	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	40	LF	0	LF				N/A	N/A	N/A
1	3	Hallway Storage Closet across from Classrooms 300	N/A	Pipe Fitting Insulation		NAD	12	EA	0	EA				N/A	N/A	N/A
1	3	Hallway Storage Closet across from Classrooms 300	N/A	Fire Doors		Non Suspect ACM	1	EA	0	EA		Metal Fire Door - Wood Interior		N/A	N/A	N/A
1	3	Classroom 301 Science Lab	N/A	Concrete Ceiling		Non Suspect ACM	1368	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 301 Science Lab	M	Floor Tile VAT 9" x 9"	2000/01/03/32	Confirmed	1368	SF	0	SF	Green			1	No	1/D
1	3	Classroom 301 Science Lab	N/A	Brick Wall		Non Suspect ACM	1500	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 301 Science Lab	N/A	Fiberglass Pipe Fitting Insulation		Non Suspect ACM	100	LF	0	LF				N/A	N/A	N/A
1	3	Classroom 301 Science Lab	N/A	Pipe Fitting Insulation		NAD	30	EA	0	EA				N/A	N/A	N/A
1	3	Classroom 301 Science Lab	M	Transite Sills	2000/01/03/USA/NH/2300	Assumed	20	SF	0	SF				1	No	1/D
1	3	Classroom 301 Science Lab	M	Transite Sink	2000/01/03/USA/NH/2340	Assumed	20	SF	0	SF				1	No	1/D
1	3	Classroom 301 Science Lab	M	Blackboard Glue Dots	2000/01/03/USA/NH/2600	Assumed	10	SF	0	SF				1	No	1/D
1	3	Lab Prep Room between Classrooms 300 and 301	M	Floor Tile VAT 9" x 9"	2000/01/03/32	Confirmed	110	SF	0	SF	Red			1	No	1/D
1	3	Lab Prep Room between Classrooms 300 and 301	N/A	Concrete Block Wall		Non Suspect ACM	330	SF	0	SF				N/A	N/A	N/A
1	3	Lab Prep Room between Classrooms 300 and 301	N/A	Concrete Ceiling		Non Suspect ACM	110	SF	0	SF				N/A	N/A	N/A
1	3	Lab Prep Room between Classrooms 300 and 301	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	30	LF	0	LF				N/A	N/A	N/A

2000 South Phila HS 2015-2016 AHERA Three-Year Report.xls

School District of Philadelphia South Philadelphia High School 2021 South Broad Street, Philadelphia, PA 19148 ULCS#2000 Year Built: 1957		AHERA Three-Year Reinspection 2015-2016 Room by Room Location Log Report										Reinspection Date: October 29-November 13, 2015 Building Inspector: Norman Harrison Number: ACC-0915-6-011 Management Planner: Megan Vala Number: 740728				
E l e m e n t	F l o o r	On-Site Room Name	System Affected	Material Description	HID#	Confirmed/Assumed/NAD Non Suspect ACM	Amount of Material	(SF/LF/EA)	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic/ Crawl Space Ranking	Damage Potential (DP)	Newly Friable (NF)	Response Action (RA)
1	3	Lab Prep Room between Classrooms 300 and 301	N/A	Pipe Fitting Insulation		NAD	4	EA	0	EA				N/A	N/A	N/A
1	3	Lab Prep Room between Classrooms 300 and 301	M	Transite	2000/01/04/USA/NH/2300	Assumed	65	SF	0	SF		Lab Table Top and Sink		1	No	1/D
1	3	Janitor's Closet between Classrooms 300 and 301	N/A	Cement Floor		Non Suspect ACM	30	SF	0	SF				N/A	N/A	N/A
1	3	Janitor's Closet between Classrooms 300 and 301	N/A	Concrete Block Wall		Non Suspect ACM	90	SF	0	SF				N/A	N/A	N/A
1	3	Janitor's Closet between Classrooms 300 and 301	N/A	Concrete Ceiling		Non Suspect ACM	30	SF	0	SF				N/A	N/A	N/A
1	3	Janitor's Closet between Classrooms 300 and 301	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	24	LF	0	LF				N/A	N/A	N/A
1	3	Janitor's Closet between Classrooms 300 and 301	N/A	Pipe Fitting Insulation		NAD	6	EA	0	EA				N/A	N/A	N/A
1	3	Storage Closet inside Classroom 301	N/A	Cement Floor		Non Suspect ACM	120	SF	0	SF				N/A	N/A	N/A
1	3	Storage Closet inside Classroom 301	N/A	Concrete Block Wall		Non Suspect ACM	360	SF	0	SF				N/A	N/A	N/A
1	3	Storage Closet inside Classroom 301	N/A	Concrete Ceiling		Non Suspect ACM	120	SF	0	SF				N/A	N/A	N/A
1	3	Storage Closet inside Classroom 301	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	70	LF	0	LF				N/A	N/A	N/A
1	3	Storage Closet inside Classroom 301	N/A	Pipe Fitting Insulation		NAD	12	EA	0	EA				N/A	N/A	N/A
1	3	Classroom 302	N/A	Concrete Ceiling		Non Suspect ACM	1292	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 302	M	Floor Tile VAT 9" x 9"	2000/01/03/32	Confirmed	1292	SF	0	SF	Red			1	No	1/D
1	3	Classroom 302	N/A	Brick Wall		Non Suspect ACM	1500	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 302	N/A	Fiberglass Pipe Fitting Insulation		Non Suspect ACM	200	LF	0	LF				N/A	N/A	N/A
1	3	Classroom 302	N/A	Pipe Fitting Insulation		NAD	25	EA	0	EA				N/A	N/A	N/A
1	3	Storage Room 302A	N/A	Cement Floor		Non Suspect ACM	90	SF	0	SF				N/A	N/A	N/A
1	3	Storage Room 302A	N/A	Brick Wall		Non Suspect ACM	150	SF	0	SF				N/A	N/A	N/A
1	3	Storage Room 302A	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A
1	3	Storage Room 302A	N/A	Pipe Fitting Insulation		NAD	15	EA	0	EA				N/A	N/A	N/A
1	3	Storage Room 302A	N/A	Plaster Ceiling		NAD	90	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 303	N/A	Plaster Ceiling		NAD	988	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 303	M	Floor Tile VAT 9" x 9"	2000/01/03/32	Confirmed	988	SF	0	SF	Tan			1	No	1/D
1	3	Classroom 303	N/A	Brick Wall		Non Suspect ACM	1200	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 303	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	100	LF	0	LF				N/A	N/A	N/A
1	3	Classroom 303	N/A	Pipe Fitting Insulation		NAD	10	EA	0	EA				N/A	N/A	N/A
1	3	Classroom 303	M	Transite Sills	2000/01/03/USA/NH/2300	Assumed	20	SF	0	SF				1	No	1/D
1	3	Classroom 303	M	Transite Sink	2000/01/03/USA/NH/2340	Assumed	20	SF	0	SF				1	No	1/D
1	3	Classroom 303	M	Blackboard Glue Dots	2000/01/03/USA/NH/2600	Assumed	10	SF	0	SF				1	No	1/D
1	3	Science Storage Room across from Classroom 302	X	X	X	X	X	X	X	X		No Access		X	X	X
1	3	Classroom 303 Storage Room	M	Floor Tile VAT 9" x 9"	2000/01/03/32	Confirmed	240	SF	0	SF	Green			1	No	1/D
1	3	Classroom 303 Storage Room	N/A	Plaster Ceiling		NAD	240	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 303 Storage Room	N/A	Brick Wall		Non Suspect ACM	350	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 303 Storage Room	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	20	LF	0	LF				N/A	N/A	N/A
1	3	Classroom 303 Storage Room	N/A	Pipe Fitting Insulation		NAD	6	EA	0	EA				N/A	N/A	N/A
1	3	Classroom 303 Storage Room	M	Floor Tile VAT 9" x 9"	2000/01/03/32	Confirmed	240	SF	0	SF	Tan			1	No	1/D
1	3	Classroom 303 Storage Room	N/A	Plaster Ceiling		NAD	240	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 303 Storage Room	N/A	Brick Wall		Non Suspect ACM	350	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 303 Greenhouse	N/A	Cement Floor		Non Suspect ACM	300	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 303 Greenhouse	N/A	Concrete Block Wall		Non Suspect ACM	900	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 303 Greenhouse	N/A	Concrete Ceiling		Non Suspect ACM	300	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 303 Greenhouse	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	60	LF	0	LF				N/A	N/A	N/A
1	3	Classroom 303 Greenhouse	N/A	Pipe Fitting Insulation		NAD	20	EA	0	EA				N/A	N/A	N/A
1	3	Classroom 303 Greenhouse	M	Transite Sink	2000/01/03/USA/NH/2340	Assumed	25	SF	0	SF				1	No	1/D
1	3	Classroom 303 Greenhouse	M	Sink Undercoat Mastic	2000/01/03/SYN/BB/2602	Assumed	6	SF	0	SF				1	No	1/D
1	3	Hallway Storage Closet between Classrooms 302 and 303	N/A	Cement Floor		Non Suspect ACM	100	SF	0	SF				N/A	N/A	N/A
1	3	Hallway Storage Closet between Classrooms 302 and 303	N/A	Concrete Block Wall		Non Suspect ACM	300	SF	0	SF				N/A	N/A	N/A
1	3	Hallway Storage Closet between Classrooms 302 and 303	N/A	Concrete Ceiling		Non Suspect ACM	100	SF	0	SF				N/A	N/A	N/A
1	3	Hallway Storage Closet between Classrooms 302 and 303	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	60	LF	0	LF				N/A	N/A	N/A
1	3	Hallway Storage Closet between Classrooms 302 and 303	N/A	Pipe Fitting Insulation		NAD	12	EA	0	EA				N/A	N/A	N/A
1	3	Classroom 304	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	20	LF	0	LF				N/A	N/A	N/A
1	3	Classroom 304	N/A	Pipe Fitting Insulation		NAD	6	EA	0	EA				N/A	N/A	N/A
1	3	Classroom 304	M	Floor Tile VAT 12" x 12"	2000/01/03/SS	Assumed	240	SF	0	SF	Grey			1	No	1/D
1	3	Classroom 304	N/A	Plaster Ceiling		NAD	240	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 304	N/A	Brick Wall		Non Suspect ACM	350	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 304	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	20	LF	0	LF				N/A	N/A	N/A
1	3	Classroom 304	N/A	Pipe Fitting Insulation		NAD	6	EA	0	EA				N/A	N/A	N/A
1	3	Office adjacent to Classroom 304	M	Floor Tile VAT 9" x 9"	2000/01/03/32	Confirmed	230	SF	0	SF	Multi			1	No	1/D
1	3	Office adjacent to Classroom 304	N/A	Plaster Ceiling		NAD	230	SF	0	SF				N/A	N/A	N/A
1	3	Office adjacent to Classroom 304	N/A	Brick Wall		Non Suspect ACM	250	SF	0	SF				N/A	N/A	N/A
1	3	Office adjacent to Classroom 304	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	40	LF	0	LF				N/A	N/A	N/A
1	3	Office adjacent to Classroom 304	N/A	Pipe Fitting Insulation		NAD	8	EA	0	EA				N/A	N/A	N/A
1	3	Girl's Restroom	N/A	Plaster Ceiling		NAD	308	SF	0	SF				N/A	N/A	N/A
1	3	Girl's Restroom	N/A	Cement Floor		Non Suspect ACM	308	SF	0	SF				N/A	N/A	N/A
1	3	Girl's Restroom	N/A	Brick Wall		Non Suspect ACM	350	SF	0	SF				N/A	N/A	N/A
1	3	Girl's Restroom	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	40	LF	0	LF				N/A	N/A	N/A

2000 South Phila HS 2015-2016 AHERA Three-Year Report.xls

School District of Philadelphia South Philadelphia High School 2021 South Broad Street, Philadelphia, PA 19148 ULCS#2000 Year Built: 1957		AHERA Three-Year Reinspection 2015-2016 Room by Room Location Log Report										Reinspection Date: October 29-November 13, 2015 Building Inspector: Norman Harrison Number: ACC-0915-6-011 Management Planner: Megan Vala Number: 740728				
E l e m e n t	F l o o r	On-Site Room Name	System Affected	Material Description	HID#	Confirmed/Assumed/NAD Non Suspect ACM	Amount of Material	(SF/LF/EA)	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic/ Crawl Space Ranking	Damage Potential (DP)	Newly Friable (NF)	Response Action (RA)
1	3	Girl's Restroom	N/A	Pipe Fitting Insulation		NAD	6	EA	0	EA				N/A	N/A	N/A
1	3	Classroom 305	N/A	Plaster Ceiling		NAD	960	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 305	M	Floor Tile VAT 12" x 12"	2000/01/03/SS	Assumed	960	SF	0	SF	Grey			1	No	1/D
1	3	Classroom 305	N/A	Brick Wall		Non Suspect ACM	750	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 305	M	Transite Sills	2000/01/03/USA/NH/2300	Assumed	15	SF	0	SF				1	No	1/D
1	3	Classroom 305	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	80	LF	0	LF				N/A	N/A	N/A
1	3	Classroom 305	N/A	Pipe Fitting Insulation		NAD	14	EA	0	EA				N/A	N/A	N/A
1	3	Office across from Classroom 305	M	Floor Tile VAT 9" x 9"	2000/01/03/32	Confirmed	200	SF	0	SF	Black			1	No	1/D
1	3	Office across from Classroom 305	N/A	Concrete Block Wall		Non Suspect ACM	600	SF	0	SF				N/A	N/A	N/A
1	3	Office across from Classroom 305	N/A	Concrete Ceiling		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A
1	3	Office across from Classroom 305	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	40	LF	0	LF				N/A	N/A	N/A
1	3	Office across from Classroom 305	N/A	Pipe Fitting Insulation		NAD	6	EA	0	EA				N/A	N/A	N/A
1	3	Office across from Classroom 305	M	Transite	2000/01/04/USA/NH/2300	Assumed	100	SF	0	SF		Lab Table Tops		1	No	1/D
1	3	Storage Room across from Classroom 305	M	Floor Tile VAT 9" x 9"	2000/01/03/32	Confirmed	64	SF	0	SF	Green			1	No	1/D
1	3	Storage Room across from Classroom 305	N/A	Concrete Block Wall		Non Suspect ACM	192	SF	0	SF				N/A	N/A	N/A
1	3	Storage Room across from Classroom 305	N/A	Concrete Ceiling		Non Suspect ACM	64	SF	0	SF				N/A	N/A	N/A
1	3	Office inside Office across from Classroom 305	M	Floor Tile VAT 9" x 9"	2000/01/03/32	Confirmed	64	SF	0	SF	Multi			1	No	1/D
1	3	Office inside Office across from Classroom 305	N/A	Concrete Block Wall		Non Suspect ACM	192	SF	0	SF				N/A	N/A	N/A
1	3	Office inside Office across from Classroom 305	N/A	Concrete Ceiling		Non Suspect ACM	64	SF	0	SF				N/A	N/A	N/A
1	3	Office inside Office across from Classroom 305	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	16	LF	0	LF				N/A	N/A	N/A
1	3	Office across from Classroom 306	M	Floor Tile VAT 9" x 9"	2000/01/03/32	Confirmed	200	SF	0	SF	Multi			1	No	1/D
1	3	Office across from Classroom 306	N/A	Concrete Block Wall		Non Suspect ACM	600	SF	0	SF				N/A	N/A	N/A
1	3	Office across from Classroom 306	N/A	Concrete Ceiling		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A
1	3	Office across from Classroom 306	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	50	LF	0	LF				N/A	N/A	N/A
1	3	Office across from Classroom 306	N/A	Pipe Fitting Insulation		NAD	6	EA	0	EA				N/A	N/A	N/A
1	3	Men's Lounge/Restroom Entrance across from Classroom 307	M	Floor Tile VAT 9" x 9"	2000/01/05/46	Confirmed	250	SF	0	SF	Green			1	No	1/D
1	3	Men's Lounge/Restroom Entrance across from Classroom 307	N/A	Concrete Block Wall		Non Suspect ACM	750	SF	0	SF				N/A	N/A	N/A
1	3	Men's Lounge/Restroom Entrance across from Classroom 307	N/A	Concrete Ceiling		Non Suspect ACM	250	SF	0	SF				N/A	N/A	N/A
1	3	Men's Lounge/Restroom Entrance across from Classroom 307	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	150	LF	0	LF				N/A	N/A	N/A
1	3	Men's Lounge/Restroom Entrance across from Classroom 307	N/A	Pipe Fitting Insulation		NAD	38	EA	1	EA				N/A	N/A	N/A
1	3	Men's Restroom across from Classroom 307	M	Floor Tile VAT 9" x 9"	2000/01/05/46	Confirmed	64	SF	0	SF	Green			1	No	1/D
1	3	Men's Restroom across from Classroom 307	N/A	Ceramic Tile Walls		Non Suspect ACM	96	SF	0	SF				N/A	N/A	N/A
1	3	Men's Restroom across from Classroom 307	N/A	Concrete Block Wall		Non Suspect ACM	192	SF	0	SF				N/A	N/A	N/A
1	3	Men's Restroom across from Classroom 307	N/A	Concrete Ceiling		Non Suspect ACM	64	SF	0	SF				N/A	N/A	N/A
1	3	Men's Restroom across from Classroom 307	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	40	LF	0	LF				N/A	N/A	N/A
1	3	Men's Restroom across from Classroom 307	N/A	Pipe Fitting Insulation		NAD	9	EA	1	EA				N/A	N/A	N/A
1	3	Classroom 306	N/A	Plaster Ceiling		NAD	960	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 306	M	Floor Tile VAT 12" x 12"	2000/01/03/SS	Assumed	960	SF	0	SF	Grey			1	No	1/D
1	3	Classroom 306	N/A	Brick Wall		Non Suspect ACM	1000	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 306	M	Transite Sills	2000/01/03/USA/NH/2300	Assumed	15	SF	0	SF				1	No	1/D
1	3	Classroom 306	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	60	LF	0	LF				N/A	N/A	N/A
1	3	Classroom 306	N/A	Pipe Fitting Insulation		NAD	15	EA	0	EA				N/A	N/A	N/A
1	3	Storage Room between Classrooms 306 and 307	M	Floor Tile VAT 9" x 9"	2000/01/03/32	Confirmed	200	SF	0	SF	Multi			1	No	1/D
1	3	Storage Room between Classrooms 306 and 307	N/A	Concrete Block Wall		Non Suspect ACM	600	SF	0	SF				N/A	N/A	N/A
1	3	Storage Room between Classrooms 306 and 307	N/A	Concrete Ceiling		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A
1	3	Storage Room between Classrooms 306 and 307	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	30	LF	0	LF				N/A	N/A	N/A
1	3	Storage Room between Classrooms 306 and 307	N/A	Pipe Fitting Insulation		NAD	2	EA	0	EA				N/A	N/A	N/A
1	3	Storage Room between Classrooms 306 and 307	M	Transite Sills	2000/01/04/USA/NH/2300	Assumed	5	SF	0	SF		Window Sills		1	No	1/D
1	3	Storage Room between Classrooms 306 and 307	M	Transite	2000/01/04/USA/NH/2300	Assumed	25	SF	0	SF		Lab Table Top and Sink		1	No	1/D
1	3	Classroom 307	N/A	Plaster Ceiling		NAD	960	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 307	M	Floor Tile VAT 12" x 12"	2000/01/03/SS	Assumed	960	SF	0	SF	Tan			1	No	1/D
1	3	Classroom 307	N/A	Brick Wall		Non Suspect ACM	1000	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 307	M	Transite Sills	2000/01/03/USA/NH/2300	Assumed	15	SF	0	SF				1	No	1/D
1	3	Classroom 307	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	60	LF	0	LF				N/A	N/A	N/A
1	3	Classroom 307	N/A	Pipe Fitting Insulation		NAD	8	EA	0	EA				N/A	N/A	N/A
1	3	Boy's Restroom	N/A	Concrete Ceiling		Non Suspect ACM	308	SF	0	SF				N/A	N/A	N/A
1	3	Boy's Restroom	N/A	Cement Floor		Non Suspect ACM	308	SF	0	SF				N/A	N/A	N/A
1	3	Boy's Restroom	N/A	Concrete Block Wall		Non Suspect ACM	350	SF	0	SF				N/A	N/A	N/A
1	3	Boy's Restroom	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	50	LF	0	LF				N/A	N/A	N/A
1	3	Boy's Restroom	N/A	Pipe Fitting Insulation		NAD	9	EA	0	EA				N/A	N/A	N/A
1	3	Hallway Storage Room across from IMC	N/A	Cement Floor		Non Suspect ACM	200	SF	0	SF		Access to Auditorium Attic		N/A	N/A	N/A
1	3	Hallway Storage Room across from IMC	N/A	Concrete Block Wall		Non Suspect ACM	600	SF	0	SF				N/A	N/A	N/A
1	3	Hallway Storage Room across from IMC	N/A	Concrete Ceiling		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A
1	3	Hallway Storage Room across from IMC	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	50	LF	0	LF				N/A	N/A	N/A
1	3	Hallway Storage Room across from IMC	N/A	Pipe Fitting Insulation		NAD	14	EA	0	EA				N/A	N/A	N/A
1	3	Hallway Storage Room across from IMC	N/A	Fire Doors		Non Suspect ACM	1	EA	0	EA		Metal Fire Door - Wood Interior		N/A	N/A	N/A
1	3	Stairwell # 4 next to IMC	M	Floor Tile VAT 9" x 9"	2000/01/05/46	Confirmed	120	SF	0	SF	Tan			1	No	1/D

2000 South Phila HS 2015-2016 AHERA Three-Year Report.xls

School District of Philadelphia South Philadelphia High School 2021 South Broad Street, Philadelphia, PA 19148 ULCS#2000 Year Built: 1957		AHERA Three-Year Reinspection 2015-2016 Room by Room Location Log Report										Reinspection Date: October 29-November 13, 2015 Building Inspector: Norman Harrison Number: ACC-0915-6-011 Management Planner: Megan Vala Number: 740728				
E l e m e n t	F l o o r	On-Site Room Name	System Affected	Material Description	HID#	Confirmed/Assumed/NAD Non Suspect ACM	Amount of Material	(SF/LF/EA)	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic/ Crawl Space Ranking	Damage Potential (DP)	Newly Friable (NF)	Response Action (RA)
1	3	Stairwell # 4 next to IMC	N/A	Cement Floor		Non Suspect ACM	80	SF	0	SF				N/A	N/A	N/A
1	3	Stairwell # 4 next to IMC	N/A	Concrete Block Wall		Non Suspect ACM	600	SF	0	SF				N/A	N/A	N/A
1	3	Stairwell # 4 next to IMC	N/A	Concrete Ceiling		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A
1	3	Stairwell # 4 next to IMC	T	Radiator Insulation	2000/01/03/SYN/BB/1600	Assumed	20	SF	0	SF				1	No	1/D
1	3	Classroom 309	N/A	Ceiling Tile 1' x 1'		NAD	984	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 309	M	Floor Tile VAT 9" x 9"	2000/01/03/32	Confirmed	984	SF	0	SF	Tan			1	No	1/D
1	3	Classroom 309	N/A	Brick Wall		Non Suspect ACM	700	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 309	M	Transite Sills	2000/01/03/USA/NH/2300	Assumed	15	SF	0	SF				1	No	1/D
1	3	Classroom 309	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	60	LF	0	LF				N/A	N/A	N/A
1	3	Classroom 309	N/A	Pipe Fitting Insulation		NAD	15	EA	0	EA				N/A	N/A	N/A
1	3	Classroom 309	N/A	Sheetrock Wall		Non Suspect ACM	300	SF	0	SF				N/A	N/A	N/A
1	3	Book Storage Room adjacent to Classroom 309	M	Floor Tile VAT 9" x 9"	2000/01/03/32	Confirmed	690	SF	0	SF	Green			1	No	1/D
1	3	Book Storage Room adjacent to Classroom 309	N/A	Plaster Ceiling		NAD	690	SF	0	SF				N/A	N/A	N/A
1	3	Book Storage Room adjacent to Classroom 309	N/A	Brick Wall		Non Suspect ACM	700	SF	0	SF				N/A	N/A	N/A
1	3	Book Storage Room adjacent to Classroom 309	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	20	LF	0	LF				N/A	N/A	N/A
1	3	Book Storage Room adjacent to Classroom 309	N/A	Pipe Fitting Insulation		NAD	6	EA	0	EA				N/A	N/A	N/A
1	3	IT MDF Closet inside Classroom 311A	N/A	Cement Floor		Non Suspect ACM	100	SF	0	SF				N/A	N/A	N/A
1	3	IT MDF Closet inside Classroom 311A	N/A	Concrete Block Wall		Non Suspect ACM	300	SF	0	SF				N/A	N/A	N/A
1	3	IT MDF Closet inside Classroom 311A	N/A	Concrete Ceiling		Non Suspect ACM	100	SF	0	SF				N/A	N/A	N/A
1	3	IT MDF Closet inside Classroom 311A	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	24	LF	0	LF				N/A	N/A	N/A
1	3	Classroom 311A	N/A	Plaster Ceiling		NAD	1200	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 311A	M	Floor Tile VAT 9" x 9"	2000/01/03/32	Confirmed	1200	SF	0	SF	Black			1	No	1/D
1	3	Classroom 311A	N/A	Brick Wall		Non Suspect ACM	1000	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 311A	M	Transite Sills	2000/01/03/USA/NH/2300	Assumed	15	SF	0	SF				1	No	1/D
1	3	Classroom 311A	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	20	LF	0	LF				N/A	N/A	N/A
1	3	Classroom 311A	N/A	Pipe Fitting Insulation		NAD	6	EA	0	EA				N/A	N/A	N/A
1	3	Classroom 311A	N/A	Sheetrock Wall		Non Suspect ACM	500	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 311A	M	Vibration Damper Cloth	2000/01/03/34	Assumed	5	SF	0	SF				1	No	1/D
1	3	Classroom 311B	N/A	Plaster Ceiling		NAD	1200	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 311B	M	Floor Tile VAT 9" x 9"	2000/01/03/32	Confirmed	1200	SF	0	SF	Multi			1	No	1/D
1	3	Classroom 311B	N/A	Brick Wall		Non Suspect ACM	1000	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 311B	M	Transite Sills	2000/01/03/USA/NH/2300	Assumed	15	SF	0	SF				1	No	1/D
1	3	Classroom 311B	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	20	LF	0	LF				N/A	N/A	N/A
1	3	Classroom 311B	N/A	Pipe Fitting Insulation		NAD	6	EA	0	EA				N/A	N/A	N/A
1	3	Classroom 311B	N/A	Sheetrock Wall		Non Suspect ACM	500	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 311B	M	Vibration Damper Cloth	2000/01/03/34	Assumed	5	SF	0	SF				1	No	1/D
1	3	Storage Room 311 Suite	N/A	Cement Floor		Non Suspect ACM	130	SF	0	SF				N/A	N/A	N/A
1	3	Storage Room 311 Suite	N/A	Plaster Ceiling		NAD	130	SF	0	SF				N/A	N/A	N/A
1	3	Storage Room 311 Suite	N/A	Plaster Walls		NAD	150	SF	0	SF				N/A	N/A	N/A
1	3	Storage Room 311 Suite	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	101	LF	0	LF				N/A	N/A	N/A
1	3	Storage Room 311 Suite	N/A	Pipe Fitting Insulation		NAD	9	EA	0	EA				N/A	N/A	N/A
1	3	Storage Room adjacent to Classroom 310	N/A	Plaster Ceiling		NAD	1200	SF	0	SF				N/A	N/A	N/A
1	3	Storage Room adjacent to Classroom 310	M	Floor Tile VAT 9" x 9"	2000/01/03/32	Confirmed	1200	SF	0	SF	Tan			1	No	1/D
1	3	Storage Room adjacent to Classroom 310	N/A	Brick Wall		Non Suspect ACM	1000	SF	0	SF				N/A	N/A	N/A
1	3	Office 312A	N/A	Concrete Ceiling		Non Suspect ACM	432	SF	0	SF				N/A	N/A	N/A
1	3	Office 312A	M	Floor Tile VAT 12" x 12"	2000/01/03/32	Assumed	432	SF	0	SF	Green			1	No	1/D
1	3	Office 312A	N/A	Concrete Block Wall		Non Suspect ACM	1296	SF	0	SF				N/A	N/A	N/A
1	3	Office 312A	N/A	Sheetrock Wall		Non Suspect ACM	240	SF	0	SF				N/A	N/A	N/A
1	3	Storage Room inside Office 312A	N/A	Cement Floor		Non Suspect ACM	150	SF	0	SF				N/A	N/A	N/A
1	3	Storage Room inside Office 312A	N/A	Concrete Block Wall		Non Suspect ACM	450	SF	0	SF				N/A	N/A	N/A
1	3	Storage Room inside Office 312A	N/A	Concrete Ceiling		Non Suspect ACM	150	SF	0	SF				N/A	N/A	N/A
1	3	Storage Room inside Office 312A	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	25	LF	0	LF				N/A	N/A	N/A
1	3	Storage Room inside Office 312A	N/A	Pipe Fitting Insulation		NAD	8	EA	0	EA				N/A	N/A	N/A
1	3	Storage Room next to Office 312A	X	X	X	X	X	X	X	X		No Access		X	X	X
1	3	Gym Office	N/A	Concrete Ceiling		Non Suspect ACM	252	SF	0	SF				N/A	N/A	N/A
1	3	Gym Office	M	Floor Tile VAT 9" x 9"	2000/01/03/32	Confirmed	252	SF	0	SF	Multi			1	No	1/D
1	3	Gym Office	N/A	Concrete Block Wall		Non Suspect ACM	756	SF	0	SF				N/A	N/A	N/A
1	3	Storage Room 312C	X	X	X	X	X	X	X	X		No Access		X	X	X
1	3	Pipe Chase in Storage Room 312 Suite	N/A	Concrete Ceiling		Non Suspect ACM	30	SF	0	SF		Are these the same pipe chase or are there 2? Same quantities?		N/A	N/A	N/A
1	3	Pipe Chase in Storage Room 312 Suite	N/A	Cement Floor		Non Suspect ACM	30	SF	0	SF		Are these the same pipe chase or are there 2? Same quantities?		N/A	N/A	N/A
1	3	Pipe Chase in Storage Room 312 Suite	N/A	Brick Wall		Non Suspect ACM	100	SF	0	SF		Are these the same pipe chase or are there 2? Same quantities?		N/A	N/A	N/A
1	3	Pipe Chase in Storage Room 312 Suite	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	101	LF	0	LF		Are these the same pipe chase or are there 2? Same quantities?		N/A	N/A	N/A
1	3	Pipe Chase in Storage Room 312 Suite	N/A	Pipe Fitting Insulation		NAD	101	EA	0	EA		Are these the same pipe chase or are there 2? Same quantities?		N/A	N/A	N/A
1	3	Pipe Chase in Storage Room 312 Suite	N/A	Cement Floor		Non Suspect ACM	30	SF	0	SF		Are these the same pipe chase or are there 2? Same quantities?		N/A	N/A	N/A
1	3	Pipe Chase in Storage Room 312 Suite	N/A	Brick Wall		Non Suspect ACM	100	SF	0	SF		Are these the same pipe chase or are there 2? Same quantities?		N/A	N/A	N/A

2000 South Phila HS 2015-2016 AHERA Three-Year Report.xls

School District of Philadelphia South Philadelphia High School 2021 South Broad Street, Philadelphia, PA 19148 ULCS#2000 Year Built: 1957			AHERA Three-Year Reinspection 2015-2016 Room by Room Location Log Report								Reinspection Date: October 29-November 13, 2015 Building Inspector: Norman Harrison Number: ACC-0915-6-011 Management Planner: Megan Vala Number: 740728						
Element	Floor	On-Site Room Name	System Affected	Material Description	HID#	Confirmed/Assumed/NAD Non Suspect ACM	Amount of Material	(SF/LF/EA)	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic/ Crawl Space Ranking	Damage Potential (DP)	Newly Friable (NF)	Response Action (RA)	
1	3	Pipe Chase in Storage Room 312 Suite	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	101	LF	0	LF		Are these the same pipe chase or are there 2? Same quantities? Are these the same pipe chase or are there 2? Same quantities?		N/A	N/A	N/A	
1	3	Pipe Chase in Storage Room 312 Suite	N/A	Pipe Fitting Insulation		NAD	101	EA	0	EA				N/A	N/A	N/A	
1	3	Culinary Classroom 313	M	Floor Tile VAT 12" x 12"	2000/01/03/SS	Assumed	420	SF	0	SF	Blue			1	No	1/D	
1	3	Culinary Classroom 313	M	Floor Tile VAT 12" x 12"	2000/01/03/SS	Assumed	420	SF	0	SF	White			1	No	1/D	
1	3	Culinary Classroom 313	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	840	SF	0	SF				N/A	N/A	N/A	
1	3	Culinary Classroom 313	N/A	Brick Wall		Non Suspect ACM	400	SF	0	SF				N/A	N/A	N/A	
1	3	Culinary Classroom 313	N/A	Sheetrock Wall		Non Suspect ACM	1000	SF	0	SF				N/A	N/A	N/A	
1	3	Culinary Classroom 313	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	50	LF	0	LF				N/A	N/A	N/A	
1	3	Culinary Classroom 313	N/A	Pipe Fitting Insulation		NAD	12	EA	0	EA				N/A	N/A	N/A	
1	3	Storage Room adjacent to Classroom 313	N/A	Concrete Ceiling		Non Suspect ACM	552	SF	0	SF				N/A	N/A	N/A	
1	3	Storage Room adjacent to Classroom 313	M	Floor Tile VAT 9" x 9"	2000/01/03/32	Confirmed	552	SF	0	SF	Green			1	No	1/D	
1	3	Storage Room adjacent to Classroom 313	N/A	Brick Wall		Non Suspect ACM	600	SF	0	SF				N/A	N/A	N/A	
1	3	Storage Room adjacent to Classroom 313	N/A	Concrete Ceiling		Non Suspect ACM	90	SF	0	SF				N/A	N/A	N/A	
1	3	Storage Room adjacent to Classroom 313	N/A	Cement Floor		Non Suspect ACM	90	SF	0	SF				N/A	N/A	N/A	
1	3	Storage Room adjacent to Classroom 313	N/A	Brick Wall		Non Suspect ACM	120	SF	0	SF				N/A	N/A	N/A	
1	3	Culinary Wing Hallway	M	Floor Tile VAT 9" x 9"	2000/01/03/32	Confirmed	320	SF	0	SF	Green			1	No	1/D	
1	3	Culinary Wing Hallway	N/A	Plaster Ceiling		NAD	320	SF	0	SF				N/A	N/A	N/A	
1	3	Culinary Wing Hallway	N/A	Concrete Block Wall		Non Suspect ACM	375	SF	0	SF				N/A	N/A	N/A	
1	3	Culinary Wing Hallway	N/A	Plaster Walls		NAD	125	SF	0	SF				N/A	N/A	N/A	
1	3	Culinary Wing Hallway	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	60	LF	0	LF				N/A	N/A	N/A	
1	3	Culinary Wing Hallway	N/A	Fiberglass Pipe Fitting Insulation		Non Suspect ACM	5	EA	0	EA				N/A	N/A	N/A	
1	3	Classroom 313D	M	Floor Tile VAT 9" x 9"	2000/01/03/32	Confirmed	627	SF	0	SF	Green			1	No	1/D	
1	3	Classroom 313D	N/A	Plaster Ceiling		NAD	627	SF	0	SF				N/A	N/A	N/A	
1	3	Classroom 313D	N/A	Brick Wall		Non Suspect ACM	750	SF	0	SF				N/A	N/A	N/A	
1	3	Classroom 313D	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	60	LF	0	LF				N/A	N/A	N/A	
1	3	Classroom 313D	N/A	Fiberglass Pipe Fitting Insulation		Non Suspect ACM	5	EA	0	EA				N/A	N/A	N/A	
1	3	Culinary Classroom 315	M	Floor Tile VAT 12" x 12"	2000/01/03/SS	Assumed	820	SF	0	SF	Blue			1	No	1/D	
1	3	Culinary Classroom 315	M	Floor Tile VAT 12" x 12"	2000/01/03/SS	Assumed	820	SF	0	SF	White			1	No	1/D	
1	3	Culinary Classroom 315	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	1640	SF	0	SF				N/A	N/A	N/A	
1	3	Culinary Classroom 315	N/A	Brick Wall		Non Suspect ACM	1000	SF	0	SF				N/A	N/A	N/A	
1	3	Culinary Classroom 315	N/A	Sheetrock Wall		Non Suspect ACM	1000	SF	0	SF				N/A	N/A	N/A	
1	3	Culinary Classroom 315	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	50	LF	0	LF				N/A	N/A	N/A	
1	3	Culinary Classroom 315	N/A	Pipe Fitting Insulation		NAD	12	EA	0	EA				N/A	N/A	N/A	
1	3	Classroom 315 Storage	N/A	Cement Floor		Non Suspect ACM	650	SF	0	SF				N/A	N/A	N/A	
1	3	Classroom 315 Storage	N/A	Plaster Ceiling		NAD	650	SF	0	SF				N/A	N/A	N/A	
1	3	Classroom 315 Storage	N/A	Brick Wall		Non Suspect ACM	650	SF	0	SF				N/A	N/A	N/A	
1	3	Smaller Restroom inside Culinary Classroom 315	N/A	Ceramic Tile Floors		Non Suspect ACM	32	SF	0	SF				N/A	N/A	N/A	
1	3	Smaller Restroom inside Culinary Classroom 315	N/A	Ceramic Tile Walls		Non Suspect ACM	48	SF	0	SF				N/A	N/A	N/A	
1	3	Smaller Restroom inside Culinary Classroom 315	N/A	Concrete Block Wall		Non Suspect ACM	96	SF	0	SF				N/A	N/A	N/A	
1	3	Smaller Restroom inside Culinary Classroom 315	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	32	SF	0	SF				N/A	N/A	N/A	
1	3	Larger Restroom inside Culinary Classroom 315 - Closer to Hallway	N/A	Ceramic Tile Floors		Non Suspect ACM	64	SF	0	SF				N/A	N/A	N/A	
1	3	Larger Restroom inside Culinary Classroom 315 - Closer to Hallway	N/A	Ceramic Tile Walls		Non Suspect ACM	96	SF	0	SF				N/A	N/A	N/A	
1	3	Larger Restroom inside Culinary Classroom 315 - Closer to Hallway	N/A	Concrete Block Wall		Non Suspect ACM	192	SF	0	SF				N/A	N/A	N/A	
1	3	Larger Restroom inside Culinary Classroom 315 - Closer to Hallway	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	64	SF	0	SF				N/A	N/A	N/A	
1	3	Culinary Dining Wing Hallway	M	Floor Tile VAT 12" x 12"	2000/01/03/SS	Assumed	72	SF	0	SF	Multi			1	No	1/D	
1	3	Culinary Dining Wing Hallway	M	Floor Tile VAT 12" x 12"	2000/01/03/SS	Assumed	72	SF	0	SF	Multi			1	No	1/D	
1	3	Culinary Dining Wing Hallway	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	144	SF	0	SF				N/A	N/A	N/A	
1	3	Culinary Dining Wing Hallway	N/A	Sheetrock Wall		Non Suspect ACM	250	SF	0	SF				N/A	N/A	N/A	
1	3	Classroom 316	N/A	Concrete Ceiling		Non Suspect ACM	768	SF	0	SF				N/A	N/A	N/A	
1	3	Classroom 316	N/A	Carpet		Non Suspect ACM	768	SF	0	SF				N/A	N/A	N/A	
1	3	Classroom 316	N/A	Brick Wall		Non Suspect ACM	1000	SF	0	SF				N/A	N/A	N/A	
1	3	Classroom 316	N/A	Fiberglass Pipe Fitting Insulation		Non Suspect ACM	20	LF	0	LF				N/A	N/A	N/A	
1	3	Classroom 316	N/A	Pipe Fitting Insulation		NAD	1	EA	0	EA				N/A	N/A	N/A	
1	3	IMC 308	N/A	Ceiling Tile 1' x 1'		NAD	768	SF	0	SF				N/A	N/A	N/A	
1	3	IMC 308	N/A	Carpet		Non Suspect ACM	768	SF	0	SF				N/A	N/A	N/A	
1	3	IMC 308	N/A	Brick Wall		Non Suspect ACM	1000	SF	0	SF				N/A	N/A	N/A	
1	3	IMC 308	N/A	Fiberglass Pipe Fitting Insulation		Non Suspect ACM	500	LF	0	LF				N/A	N/A	N/A	
1	3	IMC 308	N/A	Pipe Fitting Insulation		NAD	60	EA	0	EA				N/A	N/A	N/A	
1	3	IMC 308	M	Transite Sills	2000/01/03/USA/NH/2300	Assumed	40	SF	0	SF				1	No	1/D	
1	3	IMC Storage Room	M	Floor Tile VAT 9" x 9"	2000/01/03/32	Confirmed	150	SF	0	SF	Tan			1	No	1/D	
1	3	IMC Storage Room	N/A	Ceiling Tile 1' x 1'		NAD	150	SF	0	SF				N/A	N/A	N/A	
1	3	IMC Storage Room	N/A	Brick Wall		Non Suspect ACM	250	SF	0	SF				N/A	N/A	N/A	
1	3	IMC Storage Room	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	20	SF	0	SF				N/A	N/A	N/A	
1	3	IMC Storage Room	N/A	Pipe Fitting Insulation		NAD	8	EA	0	EA				N/A	N/A	N/A	
1	3	IMC Storage Room	M	Floor Tile VAT 9" x 9"	2000/01/03/32	Confirmed	150	SF	0	SF	Green			1	No	1/D	
1	3	IMC Storage Room	N/A	Concrete Ceiling		Non Suspect ACM	150	SF	0	SF				N/A	N/A	N/A	

2000 South Phila HS 2015-2016 AHERA Three-Year Report.xls

School District of Philadelphia South Philadelphia High School 2021 South Broad Street, Philadelphia, PA 19148 ULCS#2000 Year Built: 1957		AHERA Three-Year Reinspection 2015-2016 Room by Room Location Log Report										Reinspection Date: October 29-November 13, 2015 Building Inspector: Norman Harrison Number: ACC-0915-6-011 Management Planner: Megan Vala Number: 740728				
E l e m e n t	F l o o r	On-Site Room Name	System Affected	Material Description	HID#	Confirmed/Assumed/NAD Non Suspect ACM	Amount of Material	(SF/LF/EA)	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic/ Crawl Space Ranking	Damage Potential (DP)	Newly Friable (NF)	Response Action (RA)
1	3	IMC Storage Room	N/A	Brick Wall		Non Suspect ACM	250	SF	0	SF				N/A	N/A	N/A
1	3	IMC Hallway	M	Floor Tile VAT 9" x 9"	2000/01/03/32	Confirmed	150	SF	0	SF	Red			1	No	1/D
1	3	IMC Hallway	N/A	Ceiling Tile 1' x 1'		NAD	150	SF	0	SF				N/A	N/A	N/A
1	3	IMC Hallway	N/A	Concrete Block Wall		Non Suspect ACM	190	SF	0	SF				N/A	N/A	N/A
1	3	IMC Hallway	N/A	Plaster Walls		NAD	60	SF	0	SF				N/A	N/A	N/A
1	3	IMC Hallway	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	10	SF	0	SF				N/A	N/A	N/A
1	3	IMC Hallway	N/A	Pipe Fitting Insulation		NAD	2	EA	0	EA				N/A	N/A	N/A
1	3	IMC Office	M	Floor Tile VAT 9" x 9"	2000/01/03/32	Confirmed	150	SF	0	SF	Tan			1	No	1/D
1	3	IMC Office	N/A	Ceiling Tile 1' x 1'		NAD	150	SF	0	SF				N/A	N/A	N/A
1	3	IMC Office	N/A	Brick Wall		Non Suspect ACM	250	SF	0	SF				N/A	N/A	N/A
1	3	IMC Office	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	10	SF	0	SF				N/A	N/A	N/A
1	3	IMC Office	N/A	Pipe Fitting Insulation		NAD	2	EA	0	EA				N/A	N/A	N/A
1	3	IMC Office	M	Transite Sills	2000/01/03/USA/NH/2300	Assumed	5	SF	0	SF				1	No	1/D
1	3	IMC Media Room	M	Floor Tile VAT 9" x 9"	2000/01/03/32	Confirmed	320	SF	0	SF	Tan			1	No	1/D
1	3	IMC Media Room	N/A	Ceiling Tile 1' x 1'		NAD	320	SF	0	SF				N/A	N/A	N/A
1	3	IMC Media Room	N/A	Brick Wall		Non Suspect ACM	700	SF	0	SF				N/A	N/A	N/A
1	3	IMC Media Room	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	20	SF	0	SF				N/A	N/A	N/A
1	3	IMC Media Room	N/A	Pipe Fitting Insulation		NAD	5	EA	0	EA				N/A	N/A	N/A
1	3	IMC Storage Room next to IMC Office	X	X	X	X	X	X	X	X		No Access		X	X	X
1	3	IMC Corner Storage Room next to IMC Office	X	X	X	X	X	X	X	X		No Access		X	X	X
1	3	Stairwell adjacent to Classroom 304	M	Floor Tile VAT 12" x 12"	2000/01/03/SS	Assumed	50	SF	0	SF	Black			1	No	1/D
1	3	Stairwell adjacent to Classroom 304	N/A	Cement Floor		Non Suspect ACM	230	SF	0	SF				N/A	N/A	N/A
1	3	Stairwell adjacent to Classroom 304	N/A	Concrete Ceiling		Non Suspect ACM	280	SF	0	SF				N/A	N/A	N/A
1	3	Stairwell adjacent to Classroom 304	N/A	Brick Wall		Non Suspect ACM	300	SF	0	SF				N/A	N/A	N/A
1	3	Stairwell adjacent to Classroom 316	M	Floor Tile VAT 9" x 9"	2000/01/03/32	Confirmed	50	SF	0	SF	Grey			1	No	1/D
1	3	Stairwell adjacent to Classroom 316	N/A	Cement Floor		Non Suspect ACM	230	SF	0	SF				N/A	N/A	N/A
1	3	Stairwell adjacent to Classroom 316	N/A	Concrete Ceiling		Non Suspect ACM	280	SF	0	SF				N/A	N/A	N/A
1	3	Stairwell adjacent to Classroom 303	N/A	Brick Wall		Non Suspect ACM	300	SF	0	SF				N/A	N/A	N/A
1	3	Stairwell adjacent to Classroom 303	M	Floor Tile VAT 9" x 9"	2000/01/03/32	Confirmed	50	SF	0	SF	Black			1	No	1/D
1	3	Stairwell adjacent to Classroom 303	N/A	Cement Floor		Non Suspect ACM	230	SF	0	SF				N/A	N/A	N/A
1	3	Stairwell adjacent to Classroom 303	N/A	Concrete Ceiling		Non Suspect ACM	280	SF	0	SF				N/A	N/A	N/A
1	3	Stairwell adjacent to Classroom 303	N/A	Brick Wall		Non Suspect ACM	300	SF	0	SF				N/A	N/A	N/A
1	3	Stairwell adjacent to Classroom 305	M	Floor Tile VAT 9" x 9"	2000/01/03/32	Confirmed	50	SF	0	SF	Tan			1	No	1/D
1	3	Stairwell adjacent to Classroom 305	N/A	Cement Floor		Non Suspect ACM	230	SF	0	SF				N/A	N/A	N/A
1	3	Stairwell adjacent to Classroom 305	N/A	Concrete Ceiling		Non Suspect ACM	280	SF	0	SF				N/A	N/A	N/A
1	3	Stairwell adjacent to Classroom 305	N/A	Brick Wall		Non Suspect ACM	300	SF	0	SF				N/A	N/A	N/A
1	3	Stairwell adjacent to Classroom 300	M	Floor Tile VAT 12" x 12"	2000/01/03/SS	Assumed	50	SF	0	SF	Black			1	No	1/D
1	3	Stairwell adjacent to Classroom 300	N/A	Cement Floor		Non Suspect ACM	230	SF	0	SF				N/A	N/A	N/A
1	3	Stairwell adjacent to Classroom 300	N/A	Concrete Ceiling		Non Suspect ACM	280	SF	0	SF				N/A	N/A	N/A
1	3	Stairwell adjacent to Classroom 300	N/A	Brick Wall		Non Suspect ACM	300	SF	0	SF				N/A	N/A	N/A
1	3	Hallway from Classrooms 304 to 316	N/A	Ceiling Tile 1' x 1'		NAD	4176	SF	0	SF				N/A	N/A	N/A
1	3	Hallway from Classrooms 304 to 316	M	Floor Tile VAT 9" x 9"	2000/01/03/32	Confirmed	4176	SF	0	SF	Red			1	No	1/D
1	3	Hallway from Classrooms 304 to 316	N/A	Concrete Block Wall		Non Suspect ACM	1500	SF	0	SF				N/A	N/A	N/A
1	3	Hallway from Classrooms 304 to 316	N/A	Plaster Walls		NAD	500	SF	0	SF				N/A	N/A	N/A
1	3	Hallway from Classrooms 300 to 303	M	Floor Tile VAT 9" x 9"	2000/01/03/32	Confirmed	1332	SF	0	SF	Black			1	No	1/D
1	3	Hallway from Classrooms 300 to 303	N/A	Ceiling Tile 1' x 1'		NAD	1332	SF	0	SF				N/A	N/A	N/A
1	3	Hallway from Classrooms 300 to 303	N/A	Concrete Block Wall		Non Suspect ACM	750	SF	0	SF				N/A	N/A	N/A
1	3	Hallway from Classrooms 300 to 303	N/A	Plaster Walls		NAD	250	SF	0	SF				N/A	N/A	N/A
1	3	IMC Hallway	M	Floor Tile VAT 9" x 9"	2000/01/03/32	Confirmed	1314	SF	0	SF	Tan			1	No	1/D
1	3	IMC Hallway	N/A	Ceiling Tile 1' x 1'		NAD	1314	SF	0	SF				N/A	N/A	N/A
1	3	IMC Hallway	N/A	Concrete Block Wall		Non Suspect ACM	750	SF	0	SF				N/A	N/A	N/A
1	3	IMC Hallway	N/A	Plaster Walls		NAD	250	SF	0	SF				N/A	N/A	N/A
1	3	Hallway from Classrooms 311 to 315	M	Floor Tile VAT 9" x 9"	2000/01/03/32	Confirmed	1376	SF	0	SF	Tan			1	No	1/D
1	3	Hallway from Classrooms 311 to 315	N/A	Ceiling Tile 1' x 1'		NAD	332	SF	0	SF				N/A	N/A	N/A
1	3	Hallway from Classrooms 311 to 315	N/A	Concrete Block Wall		Non Suspect ACM	750	SF	0	SF				N/A	N/A	N/A
1	3	Hallway from Classrooms 311 to 315	N/A	Plaster Walls		NAD	250	SF	0	SF				N/A	N/A	N/A
1	2	Stairwell adjacent to Classroom 206	M	Floor Tile VAT 9" x 9"	2000/01/02/25	Confirmed	50	SF	0	SF	Black			1	No	1/D
1	2	Stairwell adjacent to Classroom 206	N/A	Cement Floor		Non Suspect ACM	230	SF	0	SF				N/A	N/A	N/A
1	2	Stairwell adjacent to Classroom 206	N/A	Concrete Ceiling		Non Suspect ACM	280	SF	0	SF				N/A	N/A	N/A
1	2	Stairwell adjacent to Classroom 206	N/A	Brick Wall		Non Suspect ACM	300	SF	0	SF				N/A	N/A	N/A
1	2	Stairwell adjacent to Classroom 220	M	Floor Tile VAT 9" x 9"	2000/01/02/25	Confirmed	50	SF	0	SF	Green			1	No	1/D
1	2	Stairwell adjacent to Classroom 220	N/A	Cement Floor		Non Suspect ACM	230	SF	0	SF				N/A	N/A	N/A
1	2	Stairwell adjacent to Classroom 220	N/A	Concrete Ceiling		Non Suspect ACM	280	SF	0	SF				N/A	N/A	N/A
1	2	Stairwell adjacent to Classroom 220	N/A	Brick Wall		Non Suspect ACM	300	SF	0	SF				N/A	N/A	N/A
1	2	Stairwell adjacent to Classroom 215	M	Floor Tile VAT 9" x 9"	2000/01/02/25	Confirmed	50	SF	0	SF	Black			1	No	1/D
1	2	Stairwell adjacent to Classroom 215	N/A	Cement Floor		Non Suspect ACM	230	SF	0	SF				N/A	N/A	N/A
1	2	Stairwell adjacent to Classroom 215	N/A	Concrete Ceiling		Non Suspect ACM	280	SF	0	SF				N/A	N/A	N/A
1	2	Stairwell adjacent to Classroom 215	N/A	Brick Wall		Non Suspect ACM	300	SF	0	SF				N/A	N/A	N/A
1	2	Stairwell adjacent to Classroom 212	M	Floor Tile VAT 9" x 9"	2000/01/02/25	Confirmed	50	SF	0	SF	Black			1	No	1/D
1	2	Stairwell adjacent to Classroom 212	N/A	Cement Floor		Non Suspect ACM	230	SF	0	SF				N/A	N/A	N/A
1	2	Stairwell adjacent to Classroom 212	N/A	Concrete Ceiling		Non Suspect ACM	280	SF	0	SF				N/A	N/A	N/A
1	2	Stairwell adjacent to Classroom 212	N/A	Brick Wall		Non Suspect ACM	300	SF	0	SF				N/A	N/A	N/A

2000 South Phila HS 2015-2016 AHERA Three-Year Report.xls

School District of Philadelphia South Philadelphia High School 2021 South Broad Street, Philadelphia, PA 19148 ULCS#2000 Year Built: 1957		AHERA Three-Year Reinspection 2015-2016 Room by Room Location Log Report										Reinspection Date: October 29-November 13, 2015 Building Inspector: Norman Harrison Number: ACC-0915-6-011 Management Planner: Megan Vala Number: 740728				
E l e m e n t	F l o o r	On-Site Room Name	System Affected	Material Description	HID#	Confirmed/Assumed/NAD Non Suspect ACM	Amount of Material	(SF/LF/EA)	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic/ Crawl Space Ranking	Damage Potential (DP)	Newly Friable (NF)	Response Action (RA)
1	2	Stairwell adjacent to Classroom 200	M	Floor Tile VAT 12" x 12"	2000/01/02/RR	Assumed	50	SF	0	SF	Black			1	No	1/D
1	2	Stairwell adjacent to Classroom 200	N/A	Cement Floor		Non Suspect ACM	230	SF	0	SF				N/A	N/A	N/A
1	2	Stairwell adjacent to Classroom 200	N/A	Concrete Ceiling		Non Suspect ACM	280	SF	0	SF				N/A	N/A	N/A
1	2	Stairwell adjacent to Classroom 200	N/A	Brick Wall		Non Suspect ACM	300	SF	0	SF				N/A	N/A	N/A
1	2	Hallway from Classrooms 206 to 220	N/A	Ceiling Tile 1' x 1'		NAD	4176	SF	0	SF				N/A	N/A	N/A
1	2	Hallway from Classrooms 206 to 220	M	Floor Tile VAT 9" x 9"	2000/01/02/25	Confirmed	4176	SF	0	SF	Red			1	No	1/D
1	2	Hallway from Classrooms 206 to 220	N/A	Concrete Block Wall		Non Suspect ACM	1500	SF	0	SF				N/A	N/A	N/A
1	2	Hallway from Classrooms 206 to 220	N/A	Plaster Walls		NAD	500	SF	0	SF				N/A	N/A	N/A
1	2	Hallway from Classrooms 200 to 205	M	Floor Tile VAT 9" x 9"	2000/01/02/25	Confirmed	1332	SF	0	SF	Black			1	No	1/D
1	2	Hallway from Classrooms 200 to 205	N/A	Ceiling Tile 1' x 1'		NAD	1332	SF	0	SF				N/A	N/A	N/A
1	2	Hallway from Classrooms 200 to 205	N/A	Concrete Block Wall		Non Suspect ACM	750	SF	0	SF				N/A	N/A	N/A
1	2	Hallway from Classrooms 200 to 205	N/A	Plaster Walls		NAD	250	SF	0	SF				N/A	N/A	N/A
1	2	Hallway from Classrooms 211 to 217	M	Floor Tile VAT 9" x 9"	2000/01/02/25	Confirmed	1314	SF	0	SF	Tan			1	No	1/D
1	2	Hallway from Classrooms 211 to 217	N/A	Ceiling Tile 1' x 1'		NAD	1314	SF	0	SF				N/A	N/A	N/A
1	2	Hallway from Classrooms 211 to 217	N/A	Concrete Block Wall		Non Suspect ACM	750	SF	0	SF				N/A	N/A	N/A
1	2	Hallway from Classrooms 211 to 217	N/A	Plaster Walls		NAD	250	SF	0	SF				N/A	N/A	N/A
1	2	Janitor's Closet across from Classroom 217A Graphic Arts	N/A	Cement Floor		Non Suspect ACM	30	SF	0	SF				N/A	N/A	N/A
1	2	Janitor's Closet across from Classroom 217A Graphic Arts	N/A	Concrete Block Wall		Non Suspect ACM	90	SF	0	SF				N/A	N/A	N/A
1	2	Janitor's Closet across from Classroom 217A Graphic Arts	N/A			Non Suspect ACM	30	SF	0	SF		Ceiling is Open to Auditorium Attic - what material is this?		N/A	N/A	N/A
1	2	Janitor's Closet across from Classroom 217A Graphic Arts	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	3	LF	0	LF				N/A	N/A	N/A
1	2	Janitor's Closet across from Classroom 217A Graphic Arts	N/A	Pipe Fitting Insulation		NAD	2	EA	0	EA				N/A	N/A	N/A
1	2	Hallway from Classrooms 212 to 213	M	Floor Tile VAT 9" x 9"	2000/01/02/25	Confirmed	1376	SF	0	SF	Tan			1	No	1/D
1	2	Hallway from Classrooms 212 to 213	N/A	Ceiling Tile 1' x 1'		NAD	332	SF	0	SF				N/A	N/A	N/A
1	2	Hallway from Classrooms 212 to 213	N/A	Concrete Block Wall		Non Suspect ACM	750	SF	0	SF				N/A	N/A	N/A
1	2	Hallway from Classrooms 212 to 213	N/A	Plaster Walls		NAD	250	SF	0	SF				N/A	N/A	N/A
1	2	Hallway from Classrooms 221 to 223	N/A	Ceiling Tile 1' x 1'		NAD	1000	SF	0	SF				N/A	N/A	N/A
1	2	Hallway from Classrooms 221 to 223	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	200	LF	0	LF				N/A	N/A	N/A
1	2	Hallway from Classrooms 221 to 223	N/A	Fiberglass Pipe Fitting Insulation		Non Suspect ACM	20	EA	0	EA				N/A	N/A	N/A
1	2	Hallway from Classrooms 221 to 223	M	Floor Tile VAT 12" x 12"	2000/01/02/RR	Assumed	1000	SF	0	SF	Tan			1	No	1/D
1	2	Daycare Room 200	N/A	Ceiling Tile 1' x 1'		NAD	690	SF	0	SF				N/A	N/A	N/A
1	2	Daycare Room 200	M	Floor Tile VAT 12" x 12"	2000/01/02/RR	Assumed	690	SF	0	SF	Grey			1	No	1/D
1	2	Daycare Room 200	N/A	Brick Wall		Non Suspect ACM	750	SF	0	SF				N/A	N/A	N/A
1	2	Daycare Room 200	M	Transite Sills	2000/01/02/USA/NH/2300	Assumed	15	SF	0	SF				1	No	1/D
1	2	Daycare Room 200	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	30	LF	0	LF				N/A	N/A	N/A
1	2	Daycare Room 200	N/A	Pipe Fitting Insulation		NAD	7	EA	0	EA				N/A	N/A	N/A
1	2	Daycare Room 200 Restroom	N/A	Plaster Ceiling		NAD	144	SF	0	SF				N/A	N/A	N/A
1	2	Daycare Room 200 Restroom	M	Floor Tile VAT 12" x 12"	2000/01/02/RR	Assumed	144	SF	0	SF	Grey			1	No	1/D
1	2	Daycare Room 200 Restroom	N/A	Brick Wall		Non Suspect ACM	400	SF	0	SF				N/A	N/A	N/A
1	2	Daycare Room 200 Restroom	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	10	LF	0	LF				N/A	N/A	N/A
1	2	Daycare Room 200 Restroom	N/A	Pipe Fitting Insulation		NAD	4	EA	0	EA				N/A	N/A	N/A
1	2	Daycare Room 201	N/A	Ceiling Tile 1' x 1'		NAD	1000	SF	0	SF				N/A	N/A	N/A
1	2	Daycare Room 201	M	Floor Tile VAT 12" x 12"	2000/01/02/RR	Assumed	1000	SF	0	SF	Grey			1	No	1/D
1	2	Daycare Room 201	N/A	Brick Wall		Non Suspect ACM	1500	SF	0	SF				N/A	N/A	N/A
1	2	Daycare Room 201	M	Transite Sills	2000/01/02/USA/NH/2300	Assumed	15	SF	0	SF				1	No	1/D
1	2	Daycare Room 201	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	30	LF	0	LF				N/A	N/A	N/A
1	2	Daycare Room 201	N/A	Pipe Fitting Insulation		NAD	8	EA	0	EA				N/A	N/A	N/A
1	2	Daycare Kitchen	M	Floor Tile VAT 12" x 12"	2000/01/02/RR	Assumed	50	SF	0	SF	Grey			1	No	1/D
1	2	Daycare Kitchen	N/A	Ceiling Tile 1' x 1'		NAD	50	SF	0	SF				N/A	N/A	N/A
1	2	Daycare Kitchen	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	10	LF	0	LF				N/A	N/A	N/A
1	2	Daycare Kitchen	N/A	Pipe Fitting Insulation		NAD	2	EA	0	EA				N/A	N/A	N/A
1	2	Daycare Room 201 Restroom next to Kitchen	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	50	SF	0	SF				N/A	N/A	N/A
1	2	Daycare Room 201 Restroom next to Kitchen	M	Floor Tile VAT 12" x 12"	2000/01/02/RR	Assumed	50	SF	0	SF	Grey			1	No	1/D
1	2	Daycare Room 201 Restroom next to Kitchen	N/A	Brick Wall		Non Suspect ACM	400	SF	0	SF				N/A	N/A	N/A
1	2	Daycare Room 201 Restroom next to Kitchen	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	10	LF	0	LF				N/A	N/A	N/A
1	2	Daycare Room 201 Restroom next to Kitchen	N/A	Pipe Fitting Insulation		NAD	2	EA	0	EA				N/A	N/A	N/A
1	2	Daycare Room 201 Restroom by Door	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	60	SF	0	SF				N/A	N/A	N/A
1	2	Daycare Room 201 Restroom by Door	M	Floor Tile VAT 12" x 12"	2000/01/02/RR	Assumed	60	SF	0	SF	Grey			1	No	1/D
1	2	Daycare Room 201 Restroom by Door	N/A	Brick Wall		Non Suspect ACM	400	SF	0	SF				N/A	N/A	N/A
1	2	Daycare Room 201 Restroom by Door	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	10	LF	0	LF				N/A	N/A	N/A
1	2	Daycare Room 201 Restroom by Door	N/A	Pipe Fitting Insulation		NAD	2	EA	0	EA				N/A	N/A	N/A
1	2	Head Start Office	N/A	Cement Floor		Non Suspect ACM	91	SF	0	SF				N/A	N/A	N/A
1	2	Head Start Office	N/A	Concrete Ceiling		Non Suspect ACM	91	SF	0	SF				N/A	N/A	N/A
1	2	Head Start Office	N/A	Brick Wall		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A
1	2	Head Start Office	N/A	Plaster Walls		NAD	200	SF	0	SF				N/A	N/A	N/A
1	2	Daycare Room 202	N/A	Plaster Ceiling		NAD	1000	SF	0	SF				N/A	N/A	N/A
1	2	Daycare Room 202	M	Floor Tile VAT 12" x 12"	2000/01/02/RR	Assumed	1000	SF	0	SF	Grey			1	No	1/D
1	2	Daycare Room 202	N/A	Brick Wall		Non Suspect ACM	1500	SF	0	SF				N/A	N/A	N/A

2000 South Phila HS 2015-2016 AHERA Three-Year Report.xls

		School District of Philadelphia South Philadelphia High School 2021 South Broad Street, Philadelphia, PA 19148 ULCS#2000 Year Built: 1957										AHERA Three-Year Reinspection 2015-2016 Room by Room Location Log Report										Reinspection Date: October 29-November 13, 2015 Building Inspector: Norman Harrison Number: ACC-0915-6-011 Management Planner: Megan Vala Number: 740728																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																							
E l e m e n t	F l o o r																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																												

2000 South Phila HS 2015-2016 AHERA Three-Year Report.xls

School District of Philadelphia South Philadelphia High School 2021 South Broad Street, Philadelphia, PA 19148 ULCS#2000 Year Built: 1957		AHERA Three-Year Reinspection 2015-2016 Room by Room Location Log Report										Reinspection Date: October 29-November 13, 2015 Building Inspector: Norman Harrison Number: ACC-0915-6-011 Management Planner: Megan Vala Number: 740728				
E l e m e n t	F l o o r	On-Site Room Name	System Affected	Material Description	HID#	Confirmed/Assumed/NAD Non Suspect ACM	Amount of Material	(SF/LF/EA)	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic/ Crawl Space Ranking	Damage Potential (DP)	Newly Friable (NF)	Response Action (RA)
1	2	Classroom 208	M	Floor Tile VAT 9" x 9"	2000/01/02/25	Confirmed	720	SF	0	SF	Red			1	No	1/D
1	2	Classroom 208	N/A	Brick Wall		Non Suspect ACM	1000	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 208	M	Transite Sills	2000/01/02/USA/NH/2300	Assumed	15	SF	0	SF				1	No	1/D
1	2	Classroom 208	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	60	EA	0	LF				N/A	N/A	N/A
1	2	Classroom 208	N/A	Pipe Fitting Insulation		NAD	6	EA	0	EA				N/A	N/A	N/A
1	2	Classroom 209	N/A	Plaster Ceiling		NAD	720	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 209	M	Floor Tile VAT 9" x 9"	2000/01/02/25	Confirmed	720	SF	0	SF	Red			1	No	1/D
1	2	Classroom 209	N/A	Brick Wall		Non Suspect ACM	1000	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 209	M	Transite Sills	2000/01/02/USA/NH/2300	Assumed	15	SF	0	SF				1	No	1/D
1	2	Classroom 209	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	200	LF	0	LF				N/A	N/A	N/A
1	2	Classroom 209	N/A	Pipe Fitting Insulation		NAD	15	EA	0	EA				N/A	N/A	N/A
1	2	Classroom 210	N/A	Plaster Ceiling		NAD	720	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 210	M	Floor Tile VAT 9" x 9"	2000/01/02/25	Confirmed	720	SF	0	SF	Red			1	No	1/D
1	2	Classroom 210	N/A	Brick Wall		Non Suspect ACM	1000	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 210	M	Transite Sills	2000/01/02/USA/NH/2300	Assumed	15	SF	0	SF				1	No	1/D
1	2	Classroom 210	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	200	LF	0	LF				N/A	N/A	N/A
1	2	Classroom 210	N/A	Pipe Fitting Insulation		NAD	20	EA	0	EA				N/A	N/A	N/A
1	2	Classroom 211	N/A	Plaster Ceiling		NAD	720	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 211	M	Floor Tile VAT 9" x 9"	2000/01/02/25	Confirmed	720	SF	0	SF	Green			1	No	1/D
1	2	Classroom 211	N/A	Brick Wall		Non Suspect ACM	1000	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 211	M	Transite Sills	2000/01/02/USA/NH/2300	Assumed	15	SF	0	SF				1	No	1/D
1	2	Classroom 211	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	120	LF	0	LF				N/A	N/A	N/A
1	2	Classroom 211	N/A	Pipe Fitting Insulation		NAD	25	EA	0	EA				N/A	N/A	N/A
1	2	Office adjacent to Girl's Restroom	M	Floor Tile VAT 9" x 9"	2000/01/02/25	Confirmed	200	SF	0	SF	Green			1	No	1/D
1	2	Office adjacent to Girl's Restroom	N/A	Concrete Block Wall		Non Suspect ACM	600	SF	0	SF				N/A	N/A	N/A
1	2	Office adjacent to Girl's Restroom	N/A	Concrete Ceiling		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A
1	2	Office adjacent to Girl's Restroom	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	10	LF	0	LF				N/A	N/A	N/A
1	2	Office adjacent to Girl's Restroom	N/A	Pipe Fitting Insulation		NAD	7	EA	0	EA				N/A	N/A	N/A
1	2	Office inside Office adjacent to Girl's Restroom	M	Floor Tile VAT 9" x 9"	2000/01/02/25	Confirmed	150	SF	0	SF	Green			1	No	1/D
1	2	Office inside Office adjacent to Girl's Restroom	N/A	Concrete Block Wall		Non Suspect ACM	450	SF	0	SF				N/A	N/A	N/A
1	2	Office inside Office adjacent to Girl's Restroom	N/A	Concrete Ceiling		Non Suspect ACM	150	SF	0	SF				N/A	N/A	N/A
1	2	Teacher's Lounge	M	Floor Tile VAT 9" x 9"	2000/01/02/25	Confirmed	276	SF	0	SF	Green			1	No	1/D
1	2	Teacher's Lounge	N/A	Plaster Ceiling		NAD	276	SF	0	SF				N/A	N/A	N/A
1	2	Teacher's Lounge	N/A	Brick Wall		Non Suspect ACM	700	SF	0	SF				N/A	N/A	N/A
1	2	Teacher's Lounge	N/A	Fiberglass Pipe Fitting Insulation		Non Suspect ACM	100	LF	0	SF				N/A	N/A	N/A
1	2	Teacher's Lounge Restroom	N/A	Pipe Fitting Insulation		NAD	20	EA	0	SF				N/A	N/A	N/A
1	2	Teacher's Lounge Restroom	M	Floor Tile VAT 9" x 9"	2000/01/02/25	Confirmed	276	SF	0	SF	Red			1	No	1/D
1	2	Teacher's Lounge Restroom	N/A	Plaster Ceiling		NAD	276	SF	0	SF				N/A	N/A	N/A
1	2	Teacher's Lounge Restroom	N/A	Brick Wall		Non Suspect ACM	700	SF	0	SF				N/A	N/A	N/A
1	2	Teacher's Lounge Restroom	N/A	Fiberglass Pipe Fitting Insulation		Non Suspect ACM	100	LF	0	SF				N/A	N/A	N/A
1	2	Teacher's Lounge Restroom	N/A	Pipe Fitting Insulation		NAD	20	EA	0	SF				N/A	N/A	N/A
1	2	Girl's Restroom	N/A	Cement Floor		Non Suspect ACM	80	SF	0	SF				N/A	N/A	N/A
1	2	Girl's Restroom	N/A	Plaster Ceiling		NAD	80	SF	0	SF				N/A	N/A	N/A
1	2	Girl's Restroom	N/A	Brick Wall		Non Suspect ACM	400	SF	0	SF				N/A	N/A	N/A
1	2	Girl's Restroom	N/A	Fiberglass Pipe Fitting Insulation		Non Suspect ACM	40	LF	0	SF				N/A	N/A	N/A
1	2	Girl's Restroom	N/A	Pipe Fitting Insulation		NAD	10	EA	0	SF				N/A	N/A	N/A
1	2	Men's Lounge/Restroom Entrance across from Classroom 217A Graphic Arts	M	Floor Tile VAT 9" x 9"	2000/01/05/46	Confirmed	250	SF	0	SF	Green			1	No	1/D
1	2	Men's Lounge/Restroom Entrance across from Classroom 217A Graphic Arts	N/A	Concrete Block Wall		Non Suspect ACM	750	SF	0	SF				N/A	N/A	N/A
1	2	Men's Lounge/Restroom Entrance across from Classroom 217A Graphic Arts	N/A	Concrete Ceiling		Non Suspect ACM	250	SF	0	SF				N/A	N/A	N/A
1	2	Men's Lounge/Restroom Entrance across from Classroom 217A Graphic Arts	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	60	LF	0	LF				N/A	N/A	N/A
1	2	Men's Lounge/Restroom Entrance across from Classroom 217A Graphic Arts	N/A	Pipe Fitting Insulation		NAD	17	EA	0	EA				N/A	N/A	N/A
1	2	Men's Restroom across from Classroom 217A Graphic Arts	M	Floor Tile VAT 9" x 9"	2000/01/05/46	Confirmed	64	SF	0	SF	Green			1	No	1/D
1	2	Men's Restroom across from Classroom 217A Graphic Arts	N/A	Ceramic Tile Walls		Non Suspect ACM	96	SF	0	SF				N/A	N/A	N/A
1	2	Men's Restroom across from Classroom 217A Graphic Arts	N/A	Concrete Block Wall		Non Suspect ACM	192	SF	0	SF				N/A	N/A	N/A
1	2	Men's Restroom across from Classroom 217A Graphic Arts	N/A	Concrete Ceiling		Non Suspect ACM	64	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 212	N/A	Plaster Ceiling		NAD	576	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 212	M	Floor Tile VAT 12" x 12"	2000/01/02/RR	Assumed	576	SF	0	SF	Tan			1	No	1/D
1	2	Classroom 212	N/A	Brick Wall		Non Suspect ACM	1000	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 212	M	Transite Sills	2000/01/02/USA/NH/2300	Assumed	15	SF	0	SF				1	No	1/D
1	2	Classroom 212	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	100	LF	0	LF				N/A	N/A	N/A
1	2	Classroom 212	N/A	Pipe Fitting Insulation		NAD	20	EA	0	EA				N/A	N/A	N/A
1	2	Classroom 213	N/A	Plaster Ceiling		NAD	700	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 213	M	Floor Tile VAT 12" x 12"	2000/01/02/RR	Assumed	700	SF	0	SF	Tan			1	No	1/D
1	2	Classroom 213	N/A	Brick Wall		Non Suspect ACM	1000	SF	0	SF				N/A	N/A	N/A

2000 South Phila HS 2015-2016 AHERA Three-Year Report.xls

School District of Philadelphia South Philadelphia High School 2021 South Broad Street, Philadelphia, PA 19148 ULCS#2000 Year Built: 1957		AHERA Three-Year Reinspection 2015-2016 Room by Room Location Log Report										Reinspection Date: October 29-November 13, 2015 Building Inspector: Norman Harrison Number: ACC-0915-6-011 Management Planner: Megan Vala Number: 740728				
E l e m e n t	F l o o r	On-Site Room Name	System Affected	Material Description	HID#	Confirmed/Assumed/NAD Non Suspect ACM	Amount of Material	(SF/LF/EA)	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic/ Crawl Space Ranking	Damage Potential (DP)	Newly Friable (NF)	Response Action (RA)
1	2	Classroom 213	M	Transite Sills	2000/01/02/USA/NH/2300	Assumed	15	SF	0	SF				1	No	1/D
1	2	Classroom 213	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	150	LF	0	LF				N/A	N/A	N/A
1	2	Classroom 213	N/A	Pipe Fitting Insulation		NAD	20	EA	0	EA				N/A	N/A	N/A
1	2	Classroom 214 Music	N/A	Ceiling Tile 1' x 1'		NAD	2193	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 214 Music	M	Floor Tile VAT 9" x 9"	2000/01/02/25	Confirmed	2193	SF	0	SF	Green			1	No	1/D
1	2	Classroom 214 Music	N/A	Brick Wall		Non Suspect ACM	4000	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 214 Music	M	Transite Sills	2000/01/02/USA/NH/2300	Assumed	40	SF	0	SF				1	No	1/D
1	2	Classroom 214 Music	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	250	LF	0	LF				N/A	N/A	N/A
1	2	Classroom 214 Music	N/A	Pipe Fitting Insulation		NAD	45	EA	0	EA				N/A	N/A	N/A
1	2	Maintenance Shop next to Classroom 214 Music	M	Floor Tile VAT 9" x 9"	2000/01/02/25	Confirmed	360	SF	0	SF	Grey			1	No	1/D
1	2	Maintenance Shop next to Classroom 214 Music	N/A	Concrete Block Wall		Non Suspect ACM	1080	SF	0	SF				N/A	N/A	N/A
1	2	Maintenance Shop next to Classroom 214 Music	N/A	Ceiling Tile 1' x 1'		NAD	360	SF	0	SF				N/A	N/A	N/A
1	2	Maintenance Shop next to Classroom 214 Music	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	20	LF	0	LF				N/A	N/A	N/A
1	2	Maintenance Shop next to Classroom 214 Music	N/A	Pipe Fitting Insulation		NAD	6	EA	0	EA				N/A	N/A	N/A
1	2	Maintenance Shop next to Classroom 214 Music	M	Transite Sills	2000/01/02/USA/NH/2300	Assumed	5	SF	0	SF		Window Sills		1	No	1/D
1	2	Music Storage Room next to Maintenance Shop next to Classroom 214 Music	X	X	X	X	X	X	X	X		No Access		X	X	X
1	2	Music Storage Room	N/A	Cement Floor		Non Suspect ACM	220	SF	0	SF				N/A	N/A	N/A
1	2	Music Storage Room	N/A	Plaster Ceiling		NAD	220	SF	0	SF				N/A	N/A	N/A
1	2	Music Storage Room	N/A	Brick Wall		Non Suspect ACM	400	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 215	N/A	Plaster Ceiling		NAD	667	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 215	M	Floor Tile VAT 9" x 9"	2000/01/02/25	Confirmed	667	SF	0	SF	Grey			1	No	1/D
1	2	Classroom 215	N/A	Brick Wall		Non Suspect ACM	1000	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 215	M	Transite Sills	2000/01/02/USA/NH/2300	Assumed	15	SF	0	SF				1	No	1/D
1	2	Classroom 215	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	30	LF	0	LF				N/A	N/A	N/A
1	2	Classroom 215	N/A	Pipe Fitting Insulation		NAD	15	EA	0	EA				N/A	N/A	N/A
1	2	Hallway Closet next to Stairwell # 5	X	X	X	X	X	X	X	X		No Access		X	X	X
1	2	Stairwell # 5 next to Classroom 217B	M	Floor Tile VAT 9" x 9"	2000/01/05/46	Confirmed	120	SF	0	SF	Tan			1	No	1/D
1	2	Stairwell # 5 next to Classroom 217B	N/A	Cement Floor		Non Suspect ACM	80	SF	0	SF				N/A	N/A	N/A
1	2	Stairwell # 5 next to Classroom 217B	N/A	Concrete Block Wall		Non Suspect ACM	600	SF	0	SF				N/A	N/A	N/A
1	2	Stairwell # 5 next to Classroom 217B	N/A	Concrete Ceiling		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A
1	2	Stairwell # 5 next to Classroom 217B	T	Radiator Insulation	2000/01/02/SYN/BB/1600	Assumed	20	SF	0	SF				1	No	1/D
1	2	Stairwell # 5 next to Classroom 217B	M	Transite Sills	2000/01/02/USA/NH/2300	Assumed	2	SF	0	SF		Fire Extinguisher Sill		1	No	1/D
1	2	Physical Education Suite	N/A	Plaster Ceiling		NAD	280	SF	0	SF				N/A	N/A	N/A
1	2	Physical Education Suite	M	Floor Tile VAT 9" x 9"	2000/01/02/25	Confirmed	280	SF	0	SF	Green			1	No	1/D
1	2	Physical Education Suite	N/A	Brick Wall		Non Suspect ACM	500	SF	0	SF				N/A	N/A	N/A
1	2	Physical Education Suite	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	15	LF	0	LF				N/A	N/A	N/A
1	2	Physical Education Suite	N/A	Pipe Fitting Insulation		NAD	2	EA	0	EA				N/A	N/A	N/A
1	2	Physical Education Suite	N/A	Ceiling Tile 1' x 1'		NAD	340	SF	0	SF				N/A	N/A	N/A
1	2	Physical Education Suite	M	Floor Tile VAT 9" x 9"	2000/01/02/25	Confirmed	340	SF	0	SF	Red			1	No	1/D
1	2	Physical Education Suite	N/A	Brick Wall		Non Suspect ACM	500	SF	0	SF				N/A	N/A	N/A
1	2	Physical Education Suite	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	15	LF	0	LF				N/A	N/A	N/A
1	2	Physical Education Suite	N/A	Pipe Fitting Insulation		NAD	2	EA	0	EA				N/A	N/A	N/A
1	2	Physical Education Suite	N/A	Plaster Ceiling		NAD	320	SF	0	SF				N/A	N/A	N/A
1	2	Physical Education Suite	M	Floor Tile VAT 9" x 9"	2000/01/02/25	Confirmed	320	SF	0	SF	Green			1	No	1/D
1	2	Physical Education Suite	N/A	Brick Wall		Non Suspect ACM	500	SF	0	SF				N/A	N/A	N/A
1	2	Physical Education Suite	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	20	LF	0	LF				N/A	N/A	N/A
1	2	Physical Education Suite	N/A	Pipe Fitting Insulation		NAD	1	EA	0	EA				N/A	N/A	N/A
1	2	Physical Education Suite Restroom	N/A	Plaster Ceiling		NAD	204	SF	0	SF				N/A	N/A	N/A
1	2	Physical Education Suite Restroom	M	Floor Tile VAT 9" x 9"	2000/01/02/25	Confirmed	204	SF	0	SF	Green			1	No	1/D
1	2	Physical Education Suite Restroom	N/A	Brick Wall		Non Suspect ACM	500	SF	0	SF				N/A	N/A	N/A
1	2	Physical Education Suite Restroom	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	15	LF	0	LF				N/A	N/A	N/A
1	2	Physical Education Suite Restroom	N/A	Pipe Fitting Insulation		NAD	2	EA	0	EA				N/A	N/A	N/A
1	2	Men's Coach Office Locker - Visitor	N/A	Plaster Ceiling		NAD	204	SF	0	SF				N/A	N/A	N/A
1	2	Men's Coach Office Locker - Visitor	M	Floor Tile VAT 9" x 9"	2000/01/02/25	Confirmed	204	SF	0	SF	Green			1	No	1/D
1	2	Men's Coach Office Locker - Visitor	N/A	Brick Wall		Non Suspect ACM	500	SF	0	SF				N/A	N/A	N/A
1	2	Men's Coach Office Locker - Visitor	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	15	LF	0	LF				N/A	N/A	N/A
1	2	Men's Coach Office Locker - Visitor	N/A	Pipe Fitting Insulation		NAD	2	EA	0	EA				N/A	N/A	N/A
1	2	Physical Education Suite Storage	N/A	Plaster Ceiling		NAD	21	SF	0	SF				N/A	N/A	N/A
1	2	Physical Education Suite Storage	M	Cement Floor		Non Suspect ACM	21	SF	0	SF				N/A	N/A	N/A
1	2	Physical Education Suite Storage	N/A	Brick Wall		Non Suspect ACM	100	SF	0	SF				N/A	N/A	N/A
1	2	Physical Education Suite Storage	N/A	Brick Wall		Non Suspect ACM	100	LF	0	LF				N/A	N/A	N/A
1	2	Physical Education Suite Storage	N/A	Cement Floor		Non Suspect ACM	25	EA	0	EA				N/A	N/A	N/A
1	2	Physical Education Suite Storage	N/A	Plaster Ceiling		NAD	25	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 217A Graphic Arts	N/A	Plaster Ceiling		NAD	1638	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 217A Graphic Arts	M	Floor Tile VAT 12" x 12"	2000/01/02/RR	Assumed	1638	SF	0	SF	Grey			1	No	1/D
1	2	Classroom 217A Graphic Arts	N/A	Brick Wall		Non Suspect ACM	2000	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 217A Graphic Arts	M	Transite Sills	2000/01/02/USA/NH/2300	Assumed	15	SF	0	SF				1	No	1/D
1	2	Classroom 217A Graphic Arts	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	60	EA	0	EA				N/A	N/A	N/A
1	2	Classroom 217A Graphic Arts	N/A	Pipe Fitting Insulation		NAD	6	EA	0	EA				N/A	N/A	N/A
1	2	Storage Room inside Classroom 217A Graphic Arts	N/A	Cement Floor		Non Suspect ACM	60	SF	0	SF				N/A	N/A	N/A
1	2	Storage Room inside Classroom 217A Graphic Arts	N/A	Concrete Block Wall		Non Suspect ACM	180	SF	0	SF				N/A	N/A	N/A

2000 South Phila HS 2015-2016 AHERA Three-Year Report.xls

School District of Philadelphia South Philadelphia High School 2021 South Broad Street, Philadelphia, PA 19148 ULCS#2000 Year Built: 1957		AHERA Three-Year Reinspection 2015-2016 Room by Room Location Log Report										Reinspection Date: October 29-November 13, 2015 Building Inspector: Norman Harrison Number: ACC-0915-6-011 Management Planner: Megan Vala Number: 740728				
E l e m e n t	F l o o r	On-Site Room Name	System Affected	Material Description	HID#	Confirmed/Assumed/NAD Non Suspect ACM	Amount of Material	(SF/LF/EA)	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic/ Crawl Space Ranking	Damage Potential (DP)	Newly Friable (NF)	Response Action (RA)
1	2	Storage Room inside Classroom 217A Graphic Arts	N/A	Concrete Ceiling		Non Suspect ACM	60	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 217B	N/A	Plaster Ceiling		NAD	800	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 217B	M	Floor Tile VAT 12" x 12"	2000/01/02/RR	Assumed	800	SF	0	SF	Tan			1	No	1/D
1	2	Classroom 217B	N/A	Brick Wall		Non Suspect ACM	2000	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 217B	M	Transite Sills	2000/01/02/USA/NH/2300	Assumed	15	SF	0	SF				1	No	1/D
1	2	Classroom 217B	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	125	EA	0	LF				N/A	N/A	N/A
1	2	Classroom 217B	N/A	Pipe Fitting Insulation		NAD	40	EA	0	EA				N/A	N/A	N/A
1	2	Storage Room inside Classroom 217B	N/A	Cement Floor		Non Suspect ACM	100	SF	0	SF				N/A	N/A	N/A
1	2	Storage Room inside Classroom 217B	N/A	Concrete Block Wall		Non Suspect ACM	300	SF	0	SF				N/A	N/A	N/A
1	2	Storage Room inside Classroom 217B	N/A	Concrete Ceiling		Non Suspect ACM	100	SF	0	SF				N/A	N/A	N/A
1	2	Storage Room inside Classroom 217B	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	30	LF	0	LF				N/A	N/A	N/A
1	2	Storage Room inside Classroom 217B	N/A	Pipe Fitting Insulation		NAD	6	EA	0	EA				N/A	N/A	N/A
1	2	Boy's Restroom	N/A	Plaster Ceiling		NAD	391	SF	0	SF				N/A	N/A	N/A
1	2	Boy's Restroom	N/A	Cement Floor		Non Suspect ACM	391	SF	0	SF	Red			N/A	N/A	N/A
1	2	Boy's Restroom	N/A	Brick Wall		Non Suspect ACM	400	SF	0	SF				N/A	N/A	N/A
1	2	Boy's Restroom	N/A	Ceramic Tile Walls		Non Suspect ACM	400	SF	0	SF				N/A	N/A	N/A
1	2	Boy's Restroom	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	10	LF	0	LF				N/A	N/A	N/A
1	2	Boy's Restroom	N/A	Pipe Fitting Insulation		NAD	4	EA	0	EA				N/A	N/A	N/A
1	2	Storage Room adjacent to Classroom 217A	N/A	Plaster Ceiling		NAD	125	SF	0	SF				N/A	N/A	N/A
1	2	Storage Room adjacent to Classroom 217A	N/A	Cement Floor		Non Suspect ACM	125	SF	0	SF				N/A	N/A	N/A
1	2	Storage Room adjacent to Classroom 217A	N/A	Brick Wall		Non Suspect ACM	400	SF	0	SF				N/A	N/A	N/A
1	2	Men's Coach Locker Room - Home	N/A	Plaster Ceiling		NAD	306	SF	0	SF				N/A	N/A	N/A
1	2	Men's Coach Locker Room - Home	M	Floor Tile VAT 9" x 9"	2000/01/02/25	Confirmed	306	SF	0	SF	Red			1	No	1/D
1	2	Men's Coach Locker Room - Home	N/A	Brick Wall		Non Suspect ACM	500	SF	0	SF				N/A	N/A	N/A
1	2	Men's Coach Locker Room - Home	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	20	LF	0	LF				N/A	N/A	N/A
1	2	Men's Coach Locker Room - Home	N/A	Pipe Fitting Insulation		NAD	5	EA	0	EA				N/A	N/A	N/A
1	2	Women's Coach Locker Room	N/A	Plaster Ceiling		NAD	340	SF	0	SF				N/A	N/A	N/A
1	2	Women's Coach Locker Room	M	Floor Tile VAT 9" x 9"	2000/01/02/25	Confirmed	340	SF	0	SF	Green			1	No	1/D
1	2	Women's Coach Locker Room	N/A	Brick Wall		Non Suspect ACM	500	SF	0	SF				N/A	N/A	N/A
1	2	Women's Coach Locker Room	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	25	LF	0	LF				N/A	N/A	N/A
1	2	Women's Coach Locker Room	N/A	Pipe Fitting Insulation		NAD	5	EA	0	EA				N/A	N/A	N/A
1	2	Athletic Director's Office	X	X	X	X	X	X	X	X		No Access		X	X	X
1	2	College Prep Room 219A	N/A	Plaster Ceiling		NAD	1060	SF	0	SF				N/A	N/A	N/A
1	2	College Prep Room 219A	M	Floor Tile VAT 12" x 12"	2000/01/02/RR	Assumed	1060	SF	0	SF	Blue	9" x 9" Floor Tile below		1	No	1/D
1	2	College Prep Room 219A	M	Floor Tile VAT 9" x 9"	2000/01/02/25	Confirmed	1060	SF	0	SF	Green			1	No	1/D
1	2	College Prep Room 219A	N/A	Brick Wall		Non Suspect ACM	1500	SF	0	SF				N/A	N/A	N/A
1	2	College Prep Room 219A	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	300	LF	0	LF				N/A	N/A	N/A
1	2	College Prep Room 219A	N/A	Pipe Fitting Insulation		NAD	35	EA	0	EA				N/A	N/A	N/A
1	2	Storage Room inside College Prep Room 219A	X	X	X	X	X	X	X	X		No Access		X	X	X
1	2	Storage Room inside College Prep Room 219A	N/A	Cement Floor		Non Suspect ACM	100	SF	0	SF				N/A	N/A	N/A
1	2	Storage Room inside College Prep Room 219A	N/A	Concrete Block Wall		Non Suspect ACM	300	SF	0	SF				N/A	N/A	N/A
1	2	Storage Room inside College Prep Room 219A	N/A	Concrete Ceiling		Non Suspect ACM	100	SF	0	SF				N/A	N/A	N/A
1	2	Storage Room inside College Prep Room 219A	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	30	LF	0	LF				N/A	N/A	N/A
1	2	Storage Room inside College Prep Room 219A	N/A	Pipe Fitting Insulation		NAD	6	EA	0	EA				N/A	N/A	N/A
1	2	Unmarked Classroom across from Classroom 221	M	Floor Tile VAT 12" x 12"	2000/01/02/RR	Assumed	1200	SF	0	SF	Blue			1	No	1/D
1	2	Unmarked Classroom across from Classroom 221	N/A	Concrete Block Wall		Non Suspect ACM	3250	SF	0	SF				N/A	N/A	N/A
1	2	Unmarked Classroom across from Classroom 221	N/A	Sheetrock Wall		Non Suspect ACM	350	SF	0	SF				N/A	N/A	N/A
1	2	Unmarked Classroom across from Classroom 221	N/A	Concrete Ceiling		Non Suspect ACM	1200	SF	0	SF				N/A	N/A	N/A
1	2	Unmarked Classroom across from Classroom 221	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	55	LF	0	LF				N/A	N/A	N/A
1	2	Unmarked Classroom across from Classroom 221	N/A	Pipe Fitting Insulation		NAD	12	EA	0	EA				N/A	N/A	N/A
1	2	Storage/IT MDF Room inside Unmarked Classroom across from Classroom 221	N/A	Cement Floor		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A
1	2	Storage/IT MDF Room inside Unmarked Classroom across from Classroom 221	N/A	Concrete Block Wall		Non Suspect ACM	600	SF	0	SF				N/A	N/A	N/A
1	2	Storage/IT MDF Room inside Unmarked Classroom across from Classroom 221	N/A	Concrete Ceiling		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A
1	2	Storage/IT MDF Room inside Unmarked Classroom across from Classroom 221	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	4	LF	0	LF				N/A	N/A	N/A
1	2	Storage/IT MDF Room inside Unmarked Classroom across from Classroom 221	N/A	Pipe Fitting Insulation		NAD	4	EA	0	EA				N/A	N/A	N/A
1	2	Janitor's Closet across from Women's Coach Locker Room	N/A	Cement Floor		Non Suspect ACM	9	SF	0	SF				N/A	N/A	N/A
1	2	Janitor's Closet across from Women's Coach Locker Room	N/A	Concrete Block Wall		Non Suspect ACM	50	SF	0	SF				N/A	N/A	N/A
1	2	Janitor's Closet across from Women's Coach Locker Room	N/A	Concrete Ceiling		Non Suspect ACM	9	SF	0	SF				N/A	N/A	N/A
1	2	Janitor's Closet across from Women's Coach Locker Room	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	22	LF	0	LF				N/A	N/A	N/A
1	2	Janitor's Closet across from Women's Coach Locker Room	N/A	Pipe Fitting Insulation		NAD	5	EA	0	EA				N/A	N/A	N/A
1	2	Classroom 220	N/A	Plaster Ceiling		NAD	667	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 220	M	Floor Tile VAT 9" x 9"	2000/01/02/25	Confirmed	667	SF	0	SF	Grey			1	No	1/D
1	2	Classroom 220	N/A	Brick Wall		Non Suspect ACM	1000	SF	0	SF				N/A	N/A	N/A

2000 South Phila HS 2015-2016 AHERA Three-Year Report.xls

School District of Philadelphia South Philadelphia High School 2021 South Broad Street, Philadelphia, PA 19148 ULCS#2000 Year Built: 1957		AHERA Three-Year Reinspection 2015-2016 Room by Room Location Log Report										Reinspection Date: October 29-November 13, 2015 Building Inspector: Norman Harrison Number: ACC-0915-6-011 Management Planner: Megan Vala Number: 740728				
E l e m e n t	F l o o r	On-Site Room Name	System Affected	Material Description	HID#	Confirmed/Assumed/NAD Non Suspect ACM	Amount of Material	(SF/LF/EA)	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic/ Crawl Space Ranking	Damage Potential (DP)	Newly Friable (NF)	Response Action (RA)
1	2	Classroom 220	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	150	LF	0	LF				N/A	N/A	N/A
1	2	Classroom 220	N/A	Pipe Fitting Insulation		NAD	25	EA	0	EA				N/A	N/A	N/A
1	2	Stairwell adjacent to Classroom 220	M	Floor Tile VAT 9" x 9"	2000/01/05/46	Confirmed	50	SF	0	SF	Grey			1	No	1/D
1	2	Stairwell adjacent to Classroom 220	N/A	Cement Floor		Non Suspect ACM	230	SF	0	SF				N/A	N/A	N/A
1	2	Stairwell adjacent to Classroom 220	N/A	Concrete Block Wall		Non Suspect ACM	300	SF	0	SF				N/A	N/A	N/A
1	2	Stairwell adjacent to Classroom 220	N/A	Concrete Ceiling		Non Suspect ACM	280	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 221	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	1984	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 221	N/A	Carpet		Non Suspect ACM	1984	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 221	N/A	Brick Wall		Non Suspect ACM	2000	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 221	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	40	LF	0	LF				N/A	N/A	N/A
1	2	Women's Restroom	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	176	SF	0	SF				N/A	N/A	N/A
1	2	Women's Restroom	N/A	Cement Floor		Non Suspect ACM	176	SF	0	SF				N/A	N/A	N/A
1	2	Women's Restroom	N/A	Brick Wall		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A
1	2	Women's Restroom	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	20	LF	0	LF				N/A	N/A	N/A
1	2	Men's Restroom	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A
1	2	Men's Restroom	N/A	Cement Floor		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A
1	2	Men's Restroom	N/A	Brick Wall		Non Suspect ACM	400	SF	0	SF				N/A	N/A	N/A
1	2	Men's Restroom	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	20	LF	0	LF				N/A	N/A	N/A
1	2	Classroom 221 Storage	N/A	Concrete Ceiling		Non Suspect ACM	40	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 221 Storage	N/A	Cement Floor		Non Suspect ACM	40	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 221 Storage	N/A	Brick Wall		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 221 Storage	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	50	LF	0	LF				N/A	N/A	N/A
1	2	Classroom 222	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	1736	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 222	N/A	Carpet		Non Suspect ACM	1736	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 222	N/A	Brick Wall		Non Suspect ACM	2000	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 222	M	Transite Sills	2000/01/02/USA/NH/2300	Assumed	15	SF	0	SF				1	No	1/D
1	2	Classroom 222	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	150	LF	0	LF				N/A	N/A	N/A
1	2	Classroom 222	N/A	Pipe Fitting Insulation		NAD	20	EA	0	EA				N/A	N/A	N/A
1	2	Girl's Restroom	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	144	SF	0	SF				N/A	N/A	N/A
1	2	Girl's Restroom	N/A	Cement Floor		Non Suspect ACM	144	SF	0	SF				N/A	N/A	N/A
1	2	Girl's Restroom	N/A	Brick Wall		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A
1	2	Girl's Restroom	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	100	LF	0	LF				N/A	N/A	N/A
1	2	Boy's Restroom	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	192	SF	0	SF				N/A	N/A	N/A
1	2	Boy's Restroom	N/A	Cement Floor		Non Suspect ACM	192	SF	0	SF				N/A	N/A	N/A
1	2	Boy's Restroom	N/A	Brick Wall		Non Suspect ACM	400	SF	0	SF				N/A	N/A	N/A
1	2	Boy's Restroom	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	10	LF	0	LF				N/A	N/A	N/A
1	2	Classroom 223	N/A	Plaster Ceiling		NAD	1550	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 223	N/A	Carpet		Non Suspect ACM	1550	SF	0	SF	Tan			N/A	N/A	N/A
1	2	Classroom 223	N/A	Brick Wall		Non Suspect ACM	1000	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 223	M	Transite Sills	2000/01/02/USA/NH/2300	Assumed	15	SF	0	SF				1	No	1/D
1	2	Classroom 223 Restroom	N/A	Cement Floor		Non Suspect ACM	160	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 223 Restroom	N/A	Concrete Ceiling		Non Suspect ACM	160	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 223 Restroom	N/A	Brick Wall		Non Suspect ACM	250	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 223 Restroom	N/A	Plaster Ceiling		NAD	700	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 223 Restroom	M	Floor Tile VAT 12" x 12"	2000/01/02/RR	Assumed	700	SF	0	SF	Tan			1	No	1/D
1	2	Classroom 223 Restroom	N/A	Brick Wall		Non Suspect ACM	1000	SF	0	SF				N/A	N/A	N/A
1	2	Storage Room inside Classroom 223	X	X	X	X	X	X	X	X		No Access		X	X	X
1	1	Roster Office	M	Floor Tile VAT 9" x 9"	2000/01/01/15	Confirmed	960	SF	0	SF	Multi			1	No	1/D
1	1	Roster Office	N/A	Plaster Ceiling		NAD	960	SF	0	SF				N/A	N/A	N/A
1	1	Roster Office	N/A	Brick Wall		Non Suspect ACM	2000	SF	0	SF				N/A	N/A	N/A
1	1	Roster Office	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	60	LF	0	LF				N/A	N/A	N/A
1	1	Roster Office	N/A	Pipe Fitting Insulation		NAD	25	EA	0	EA				N/A	N/A	N/A
1	1	Office #1 closest to Roster Office	M	Floor Tile VAT 12" x 12"	2000/01/01/PP	Assumed	720	SF	0	SF	Multi	Office Suite adjacent to roster Office. Office #1 in Suite is closest		1	No	1/D
1	1	Office #1 closest to Roster Office	N/A	Plaster Ceiling		NAD	720	SF	0	SF		to the Roster Office. Offices #2-#5 Are from left to right of the Roster Office.		N/A	N/A	N/A
1	1	Office #1 closest to Roster Office	N/A	Brick Wall		Non Suspect ACM	1000	SF	0	SF				N/A	N/A	N/A
1	1	Office #2	M	Floor Tile VAT 9" x 9"	2000/01/01/15	Confirmed	126	SF	0	SF	Multi			1	No	1/D
1	1	Office #2	N/A	Plaster Ceiling		NAD	126	SF	0	SF				N/A	N/A	N/A
1	1	Office #2	N/A	Brick Wall		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A
1	1	Office #3	M	Floor Tile VAT 9" x 9"	2000/01/01/15	Confirmed	110	SF	0	SF	Multi			1	No	1/D
1	1	Office #3	N/A	Plaster Ceiling		NAD	110	SF	0	SF				N/A	N/A	N/A
1	1	Office #3	N/A	Brick Wall		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A
1	1	Office #4	M	Floor Tile VAT 12" x 12"	2000/01/01/PP	Assumed	110	SF	0	SF	Multi			1	No	1/D
1	1	Office #4	N/A	Plaster Ceiling		NAD	110	SF	0	SF				N/A	N/A	N/A
1	1	Office #4	N/A	Brick Wall		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A
1	1	Office #4	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	10	LF	0	LF				N/A	N/A	N/A
1	1	Office #4	N/A	Pipe Fitting Insulation		NAD	2	EA	0	EA				N/A	N/A	N/A
1	1	Office #5	M	Floor Tile VAT 9" x 9"	2000/01/01/15	Confirmed	110	SF	0	SF	Multi			1	No	1/D
1	1	Office #5	N/A	Plaster Ceiling		NAD	110	SF	0	SF				N/A	N/A	N/A
1	1	Office #5	N/A	Brick Wall		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A
1	1	Office #5	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	10	LF	0	LF				N/A	N/A	N/A

2000 South Phila HS 2015-2016 AHERA Three-Year Report.xls

School District of Philadelphia South Philadelphia High School 2021 South Broad Street, Philadelphia, PA 19148 ULCS#2000 Year Built: 1957		AHERA Three-Year Reinspection 2015-2016 Room by Room Location Log Report										Reinspection Date: October 29-November 13, 2015 Building Inspector: Norman Harrison Number: ACC-0915-6-011 Management Planner: Megan Vala Number: 740728				
E l e m e n t	F l o o r	On-Site Room Name	System Affected	Material Description	HID#	Confirmed/Assumed/NAD Non Suspect ACM	Amount of Material	(SF/LF/EA)	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic/ Crawl Space Ranking	Damage Potential (DP)	Newly Friable (NF)	Response Action (RA)
1	1	Office #5	N/A	Pipe Fitting Insulation		NAD	2	EA	0	EA				N/A	N/A	N/A
1	1	Office #6	M	Floor Tile VAT 9" x 9"	2000/01/01/15	Confirmed	200	SF	0	SF	Multi			1	No	1/D
1	1	Office #6	N/A	Plaster Ceiling		NAD	200	SF	0	SF				N/A	N/A	N/A
1	1	Office #6	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	20	LF	0	LF				N/A	N/A	N/A
1	1	Office #6	N/A	Pipe Fitting Insulation		NAD	4	EA	0	LF				N/A	N/A	N/A
1	1	Office #6	M	Sheetrock Wall	2000/01/01/USA/NH/2100	Assumed	300	SF	0	EA				1	No	1/D
1	1	Office #1 (Main Hall)	M	Floor Tile VAT 9" x 9"	2000/01/01/15	Confirmed	140	SF	0	SF	Multi	Special Education Suite Offices are numbered left to right		1	No	1/D
1	1	Office #1 (Main Hall)	N/A	Plaster Ceiling		NAD	140	SF	0	SF				N/A	N/A	N/A
1	1	Office #1 (Main Hall)	N/A	Brick Wall		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A
1	1	Office #2 (Main Hall)	M	Floor Tile VAT 9" x 9"	2000/01/01/15	Confirmed	81	SF	0	SF	Multi			1	No	1/D
1	1	Office #2 (Main Hall)	N/A	Plaster Ceiling		NAD	81	SF	0	SF				N/A	N/A	N/A
1	1	Office #2 (Main Hall)	N/A	Brick Wall		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A
1	1	Office #3 (Main Hall)	M	Floor Tile VAT 12" x 12"	2000/01/01/PP	Assumed	72	SF	0	SF	Multi			1	No	1/D
1	1	Office #3 (Main Hall)	N/A	Plaster Ceiling		NAD	72	SF	0	SF				N/A	N/A	N/A
1	1	Office #3 (Main Hall)	N/A	Brick Wall		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A
1	1	Office #3 (Main Hall)	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	10	LF	0	LF				N/A	N/A	N/A
1	1	Office #3 (Main Hall)	N/A	Pipe Fitting Insulation		NAD	2	EA	0	EA				N/A	N/A	N/A
1	1	Office next to Main Entrance Vestibule	M	Floor Tile VAT 9" x 9"	2000/01/01/15	Confirmed	80	SF	0	SF	Multi			1	No	1/D
1	1	Office next to Main Entrance Vestibule	M	Floor Tile VAT 12" x 12"	2000/01/01/PP	Assumed	20	SF	0	SF	Black	Patch		1	No	1/D
1	1	Office next to Main Entrance Vestibule	N/A	Concrete Block Wall		Non Suspect ACM	100	SF	0	SF				N/A	N/A	N/A
1	1	Office next to Main Entrance Vestibule	N/A	Metal Walls		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A
1	1	Office next to Main Entrance Vestibule	N/A	Concrete Ceiling		Non Suspect ACM	100	SF	0	SF				N/A	N/A	N/A
1	1	Office #4 (Main Hall)	M	Floor Tile VAT 9" x 9"	2000/01/01/15	Confirmed	240	SF	0	SF	Multi			1	No	1/D
1	1	Office #4 (Main Hall)	N/A	Plaster Ceiling		NAD	240	SF	0	SF				N/A	N/A	N/A
1	1	Office #4 (Main Hall)	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	10	LF	0	LF				N/A	N/A	N/A
1	1	Office #4 (Main Hall)	N/A	Pipe Fitting Insulation		NAD	2	EA	0	LF				N/A	N/A	N/A
1	1	Office #4 (Main Hall)	M	Sheetrock Wall	2000/01/01/USA/NH/2100	Assumed	300	SF	0	EA				1	No	1/D
1	1	Office #1 (Connecting Hall)	M	Floor Tile VAT 9" x 9"	2000/01/01/15	Confirmed	620	SF	0	SF	Multi			1	No	1/D
1	1	Office #1 (Connecting Hall)	N/A	Ceiling Tile 1' x 1'		NAD	620	SF	0	SF				N/A	N/A	N/A
1	1	Office #1 (Connecting Hall)	N/A	Pipe Fitting Insulation		NAD	12	EA	0	LF				N/A	N/A	N/A
1	1	Office #2 (Connecting Hall)	X	X	X	X	X	X	X	X		No Access		X	X	X
1	1	Office #3 (Connecting Hall)	M	Floor Tile VAT 9" x 9"	2000/01/01/15	Confirmed	63	SF	0	SF	Multi			1	No	1/D
1	1	Office #3 (Connecting Hall)	N/A	Plaster Ceiling		NAD	63	SF	0	SF				N/A	N/A	N/A
1	1	Office #3 (Connecting Hall)	N/A	Plaster Walls		NAD	63	SF	0	SF				N/A	N/A	N/A
1	1	Office #4 (Connecting Hall)	X	X	X	X	X	X	X	X		No Access		X	X	X
1	1	Office #5 (Connecting Hall)	M	Floor Tile VAT 9" x 9"	2000/01/01/15	Confirmed	126	SF	0	SF	Red			1	No	1/D
1	1	Office #5 (Connecting Hall)	N/A	Ceiling Tile 1' x 1'		NAD	126	SF	0	SF				N/A	N/A	N/A
1	1	Office #5 (Connecting Hall)	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	30	LF	0	LF				N/A	N/A	N/A
1	1	Office #5 (Connecting Hall)	N/A	Pipe Fitting Insulation		NAD	6	EA	0	LF				N/A	N/A	N/A
1	1	Office #5 (Connecting Hall)	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	50	LF	0	LF				N/A	N/A	N/A
1	1	Office #6 (Connecting Hall)	M	Floor Tile VAT 9" x 9"	2000/01/01/15	Confirmed	81	SF	0	SF	Multi			1	No	1/D
1	1	Office #6 (Connecting Hall)	N/A	Plaster Ceiling		NAD	81	SF	0	SF				N/A	N/A	N/A
1	1	Office #6 (Connecting Hall)	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	60	LF	0	LF				N/A	N/A	N/A
1	1	Office #6 (Connecting Hall)	N/A	Pipe Fitting Insulation		NAD	12	EA	0	LF				N/A	N/A	N/A
1	1	Special Education Suite Main Hallway	M	Floor Tile VAT 9" x 9"	2000/01/01/15	Confirmed	95	SF	0	SF	Multi			1	No	1/D
1	1	Special Education Suite Main Hallway	N/A	Plaster Ceiling		NAD	95	SF	0	SF				N/A	N/A	N/A
1	1	Special Education Suite Main Hallway	N/A	Plaster Walls		NAD	200	SF	0	SF				N/A	N/A	N/A
1	1	Special Education Suite Connecting Hallway	M	Floor Tile VAT 9" x 9"	2000/01/01/15	Confirmed	120	SF	0	SF	Multi			1	No	1/D
1	1	Special Education Suite Connecting Hallway	N/A	Plaster Ceiling		NAD	120	SF	0	SF				N/A	N/A	N/A
1	1	Special Education Suite Connecting Hallway	N/A	Plaster Ceiling		NAD	300	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 105 Music	N/A	Ceiling Tile 1' x 1'		NAD	2604	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 105 Music	M	Floor Tile VAT 9" x 9"	2000/01/01/15	Confirmed	2604	SF	0	SF	Multi			1	No	1/D
1	1	Classroom 105 Music	N/A	Brick Wall		Non Suspect ACM	4000	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 105 Music	M	Transite Sills	2000/01/01/22	Assumed	40	SF	0	SF				1	No	1/D
1	1	Classroom 105 Music	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	100	LF	0	LF				N/A	N/A	N/A
1	1	Classroom 105 Music	N/A	Pipe Fitting Insulation		NAD	20	EA	0	EA				N/A	N/A	N/A
1	1	Girl's Restroom	N/A	Plaster Ceiling		NAD	391	SF	0	SF				N/A	N/A	N/A
1	1	Girl's Restroom	N/A	Cement Floor		Non Suspect ACM	391	SF	0	SF				N/A	N/A	N/A
1	1	Girl's Restroom	N/A	Brick Wall		Non Suspect ACM	400	SF	0	SF				N/A	N/A	N/A
1	1	Girl's Restroom	N/A	Ceramic Tile Walls		Non Suspect ACM	400	SF	0	SF				N/A	N/A	N/A
1	1	Girl's Restroom	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	40	LF	0	SF				N/A	N/A	N/A
1	1	Girl's Restroom	N/A	Pipe Fitting Insulation		NAD	6	EA	0	SF				N/A	N/A	N/A
1	1	Custodial Closet by Classroom 105	N/A	Cement Floor		Non Suspect ACM	50	SF	0	SF				N/A	N/A	N/A
1	1	Custodial Closet by Classroom 105	N/A	Concrete Ceiling		Non Suspect ACM	50	SF	0	SF				N/A	N/A	N/A
1	1	Custodial Closet by Classroom 105	N/A	Brick Wall		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A
1	1	Center Storage Room inside Classroom 105 Music	N/A	Cement Floor		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A
1	1	Center Storage Room inside Classroom 105 Music	N/A	Concrete Block Wall		Non Suspect ACM	600	SF	0	SF				N/A	N/A	N/A
1	1	Center Storage Room inside Classroom 105 Music	N/A	Concrete Ceiling		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A
1	1	Rear Storage Room inside Classroom 105 Music	M	Floor Tile VAT 9" x 9"	2000/01/01/15	Confirmed	150	SF	0	SF	Black			1	No	1/D
1	1	Rear Storage Room inside Classroom 105 Music	N/A	Concrete Block Wall		Non Suspect ACM	450	SF	0	SF				N/A	N/A	N/A
1	1	Rear Storage Room inside Classroom 105 Music	N/A	Concrete Ceiling		Non Suspect ACM	150	SF	0	SF				N/A	N/A	N/A

2000 South Phila HS 2015-2016 AHERA Three-Year Report.xls

School District of Philadelphia South Philadelphia High School 2021 South Broad Street, Philadelphia, PA 19148 ULCS#2000 Year Built: 1957		AHERA Three-Year Reinspection 2015-2016 Room by Room Location Log Report										Reinspection Date: October 29-November 13, 2015 Building Inspector: Norman Harrison Number: ACC-0915-6-011 Management Planner: Megan Vala Number: 740728				
E l e m e n t	F l o o r	On-Site Room Name	System Affected	Material Description	HID#	Confirmed/Assumed/NAD Non Suspect ACM	Amount of Material	(SF/LF/EA)	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic/ Crawl Space Ranking	Damage Potential (DP)	Newly Friable (NF)	Response Action (RA)
1	1	Rear Storage Room inside Classroom 105 Music	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	20	LF	0	SF				N/A	N/A	N/A
1	1	Rear Storage Room inside Classroom 105 Music	N/A	Pipe Fitting Insulation		NAD	7	EA	0	SF				N/A	N/A	N/A
1	1	Front Storage Room inside Classroom 105 Music	M	Floor Tile VAT 9" x 9"	2000/01/01/15	Confirmed	40	SF	0	SF	Green			1	No	1/D
1	1	Front Storage Room inside Classroom 105 Music	N/A	Concrete Block Wall		Non Suspect ACM	120	SF	0	SF				N/A	N/A	N/A
1	1	Front Storage Room inside Classroom 105 Music	N/A	Concrete Ceiling		Non Suspect ACM	40	SF	0	SF				N/A	N/A	N/A
1	1	Boy's Restroom	N/A	Plaster Ceiling		NAD	468	SF	0	SF				N/A	N/A	N/A
1	1	Boy's Restroom	N/A	Cement Floor		Non Suspect ACM	468	SF	0	SF				N/A	N/A	N/A
1	1	Boy's Restroom	N/A	Brick Wall		Non Suspect ACM	400	SF	0	SF				N/A	N/A	N/A
1	1	Boy's Restroom	N/A	Ceramic Tile Walls		Non Suspect ACM	400	SF	0	SF				N/A	N/A	N/A
1	1	Boy's Restroom	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	40	LF	0	LF				N/A	N/A	N/A
1	1	Boy's Restroom	N/A	Pipe Fitting Insulation		NAD	6	EA	0	EA				N/A	N/A	N/A
1	1	Stairwell # 5 next to Boy's Restroom	N/A	Cement Floor		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A
1	1	Stairwell # 5 next to Boy's Restroom	N/A	Concrete Block Wall		Non Suspect ACM	600	SF	0	SF				N/A	N/A	N/A
1	1	Stairwell # 5 next to Boy's Restroom	N/A	Concrete Ceiling		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A
1	1	Stairwell # 5 next to Boy's Restroom	T	Radiator Insulation	2000/01/01/SYN/BB/1600	Assumed	15	SF	0	SF				1	No	1/D
1	1	Hallway behind Stairwell # 5	M	Floor Tile VAT 9" x 9"	2000/01/01/15	Confirmed	800	SF	0	SF	Black			1	No	1/D
1	1	Hallway behind Stairwell # 5	N/A	Concrete Block Wall		Non Suspect ACM	2400	SF	0	SF				N/A	N/A	N/A
1	1	Hallway behind Stairwell # 5	N/A	Concrete Ceiling		Non Suspect ACM	250	SF	0	SF				N/A	N/A	N/A
1	1	Hallway behind Stairwell # 5	N/A	Ceiling Tile 1' x 1'		NAD	450	SF	0	SF				N/A	N/A	N/A
1	1	Hallway behind Stairwell # 5	M	Sheetrock Ceiling	2000/01/01/SYN/BB/2101	Assumed	150	SF	0	SF		Sheetrock Soffit		1	No	1/D
1	1	Hallway behind Stairwell # 5	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	90	LF	0	LF				N/A	N/A	N/A
1	1	Hallway behind Stairwell # 5	N/A	Pipe Fitting Insulation		NAD	18	EA	0	EA				N/A	N/A	N/A
1	1	Hallway behind Stairwell # 5	M	Transite Sills	2000/01/01/22	Assumed	2	SF	0	SF		Fire Extinguisher Sill		1	No	1/D
1	1	School Police Office	N/A	Concrete Ceiling		Non Suspect ACM	690	SF	0	SF				N/A	N/A	N/A
1	1	School Police Office	M	Floor Tile VAT 9" x 9"	2000/01/01/15	Confirmed	690	SF	0	SF	Multi			1	No	1/D
1	1	School Police Office	N/A	Brick Wall		Non Suspect ACM	1000	SF	0	SF				N/A	N/A	N/A
1	1	School Police Office	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	60	LF	0	LF				N/A	N/A	N/A
1	1	School Police Office	N/A	Pipe Fitting Insulation		NAD	15	EA	0	EA				N/A	N/A	N/A
1	1	Wood Shop Classroom	N/A	Cement Floor		Non Suspect ACM	1500	SF	0	SF				N/A	N/A	N/A
1	1	Wood Shop Classroom	N/A	Concrete Ceiling		Non Suspect ACM	1500	SF	0	SF				N/A	N/A	N/A
1	1	Wood Shop Classroom	N/A	Brick Wall		Non Suspect ACM	3000	SF	0	SF				N/A	N/A	N/A
1	1	Wood Shop Classroom	N/A	Plaster Ceiling		NAD	667	SF	0	SF				N/A	N/A	N/A
1	1	Wood Shop Classroom	M	Floor Tile VAT 12" x 12"	2000/01/01/PP	Assumed	667	SF	0	SF	Tan			1	No	1/D
1	1	Wood Shop Classroom	N/A	Brick Wall		Non Suspect ACM	1000	SF	0	SF				N/A	N/A	N/A
1	1	Wood Shop Classroom	N/A	Plaster Ceiling		NAD	667	SF	0	SF				N/A	N/A	N/A
1	1	Wood Shop Classroom	M	Floor Tile VAT 12" x 12"	2000/01/01/PP	Assumed	667	SF	0	SF	Tan			1	No	1/D
1	1	Wood Shop Classroom	N/A	Brick Wall		Non Suspect ACM	1000	SF	0	SF				N/A	N/A	N/A
1	1	Wood Shop Classroom	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	40	LF	0	LF				N/A	N/A	N/A
1	1	Wood Shop Classroom	N/A	Pipe Fitting Insulation		NAD	10	EA	0	EA				N/A	N/A	N/A
1	1	Classroom 220	N/A	Plaster Ceiling		NAD	667	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 220	M	Floor Tile VAT 12" x 12"	2000/01/01/PP	Assumed	667	SF	0	SF	Tan			1	No	1/D
1	1	Classroom 220	N/A	Brick Wall		Non Suspect ACM	1000	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 220	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	40	LF	0	LF				N/A	N/A	N/A
1	1	Classroom 220	N/A	Pipe Fitting Insulation		NAD	10	EA	0	EA				N/A	N/A	N/A
1	1	Classroom 220	N/A	Concrete Ceiling		Non Suspect ACM	667	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 220	M	Floor Tile VAT 12" x 12"	2000/01/01/PP	Assumed	667	SF	0	SF	Tan			1	No	1/D
1	1	Classroom 220	N/A	Brick Wall		Non Suspect ACM	1000	SF	0	SF				N/A	N/A	N/A
1	1	Stairwell # 9 behind 107 Wood Shop Classroom	N/A	Cement Floor		Non Suspect ACM	200	SF	0	SF		Stairwell Exits to the Exterior of Building on the 1st Floor		N/A	N/A	N/A
1	1	Stairwell # 9 behind 107 Wood Shop Classroom	N/A	Concrete Block Wall		Non Suspect ACM	600	SF	0	SF				N/A	N/A	N/A
1	1	Stairwell # 9 behind 107 Wood Shop Classroom	N/A	Concrete Ceiling		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 108	N/A	Concrete Ceiling		Non Suspect ACM	1800	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 108	M	Floor Tile VAT 12" x 12"	2000/01/01/PP	Assumed	1800	SF	0	SF	Grey			1	No	1/D
1	1	Classroom 108	N/A	Brick Wall		Non Suspect ACM	2000	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 108	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	150	LF	0	LF				N/A	N/A	N/A
1	1	Classroom 108	N/A	Pipe Fitting Insulation		NAD	25	EA	0	EA				N/A	N/A	N/A
1	1	Classroom 108	M	Vibration Damper Cloth	2000/01/01/18	Assumed	10	SF	0	SF				1	No	1/D
1	1	Classroom 108 IT PC Repair Shop	N/A	Concrete Ceiling		Non Suspect ACM	400	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 108 IT PC Repair Shop	M	Floor Tile VAT 12" x 12"	2000/01/01/PP	Assumed	400	SF	0	SF	Grey			1	No	1/D
1	1	Classroom 108 IT PC Repair Shop	N/A	Brick Wall		Non Suspect ACM	1000	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 108 IT PC Repair Shop	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	100	LF	0	LF				N/A	N/A	N/A
1	1	Classroom 108 IT PC Repair Shop	N/A	Pipe Fitting Insulation		NAD	25	EA	0	EA				N/A	N/A	N/A
1	1	Classroom 108 IT Closet	N/A	Concrete Ceiling		Non Suspect ACM	120	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 108 IT Closet	N/A	Cement Floor		Non Suspect ACM	120	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 108 IT Closet	N/A	Brick Wall		Non Suspect ACM	400	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 108 IT Closet	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	10	LF	0	LF				N/A	N/A	N/A
1	1	Classroom 108 IT Closet	N/A	Pipe Fitting Insulation		NAD	2	EA	0	EA				N/A	N/A	N/A
1	1	Classroom 108 IT Theory Classroom	N/A	Concrete Ceiling		Non Suspect ACM	80	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 108 IT Theory Classroom	N/A	Cement Floor		Non Suspect ACM	80	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 108 IT Theory Classroom	N/A	Brick Wall		Non Suspect ACM	400	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 108 IT Theory Classroom	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	10	LF	0	LF				N/A	N/A	N/A
1	1	Walk-In Safe next to Elevator # 3	X	X	X	X	X	X	X	X		No Access		X	X	X

2000 South Phila HS 2015-2016 AHERA Three-Year Report.xls

School District of Philadelphia South Philadelphia High School 2021 South Broad Street, Philadelphia, PA 19148 ULCS#2000 Year Built: 1957		AHERA Three-Year Reinspection 2015-2016 Room by Room Location Log Report										Reinspection Date: October 29-November 13, 2015 Building Inspector: Norman Harrison Number: ACC-0915-6-011 Management Planner: Megan Vala Number: 740728				
E l e m e n t	F l o o r	On-Site Room Name	System Affected	Material Description	HID#	Confirmed/Assumed/NAD Non Suspect ACM	Amount of Material	(SF/LF/EA)	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic/ Crawl Space Ranking	Damage Potential (DP)	Newly Friable (NF)	Response Action (RA)
1	1	Room next to Walk-In Safe next to Elevator # 3	X	X	X	X	X	X	X	X		No Access		X	X	X
1	1	Wrestling Room next to Gymnasium	N/A	Concrete Ceiling		Non Suspect ACM	638	SF	0	SF				N/A	N/A	N/A
1	1	Wrestling Room next to Gymnasium	N/A	Carpet		Non Suspect ACM	638	SF	0	SF		Carper over 9" x 9" Floor Tile		N/A	N/A	N/A
1	1	Wrestling Room next to Gymnasium	N/A	Concrete Block Wall		Non Suspect ACM	1000	SF	0	SF				N/A	N/A	N/A
1	1	Wrestling Room next to Gymnasium	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	24	LF	0	LF				N/A	N/A	N/A
1	1	Wrestling Room next to Gymnasium	N/A	Pipe Fitting Insulation		NAD	4	EA	0	EA				N/A	N/A	N/A
1	1	Stairwell # 6 adjacent to Wrestling Room next to Gymnasium	M	Floor Tile VAT 9" x 9"	2000/01/01/15	Confirmed	175	SF	0	SF	Multi			1	No	1/D
1	1	Stairwell # 6 adjacent to Wrestling Room next to Gymnasium	N/A	Cement Floor		Non Suspect ACM	25	SF	0	SF				N/A	N/A	N/A
1	1	Stairwell # 6 adjacent to Wrestling Room next to Gymnasium	N/A	Concrete Block Wall		Non Suspect ACM	600	SF	0	SF				N/A	N/A	N/A
1	1	Stairwell # 6 adjacent to Wrestling Room next to Gymnasium	N/A	Concrete Ceiling		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A
1	1	Stairwell # 6 adjacent to Wrestling Room next to Gymnasium	T	Radiator Insulation	2000/01/01/SYN/BB/1600	Assumed	30	SF	0	SF				1	No	1/D
1	1	Gymnasium	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	17,480	SF	0	SF				N/A	N/A	N/A
1	1	Gymnasium	N/A	Wood Floor		Non Suspect ACM	17,480	SF	0	SF				N/A	N/A	N/A
1	1	Gymnasium	N/A	Brick Wall		Non Suspect ACM	20,000	SF	0	SF				N/A	N/A	N/A
1	1	Gymnasium Storage	N/A	Concrete Ceiling		Non Suspect ACM	120	SF	0	SF				N/A	N/A	N/A
1	1	Gymnasium Storage	N/A	Cement Floor		Non Suspect ACM	120	SF	0	SF				N/A	N/A	N/A
1	1	Gymnasium Storage	N/A	Brick Wall		Non Suspect ACM	300	SF	0	SF				N/A	N/A	N/A
1	1	Gymnasium Storage	N/A	Metal Duct Work		Non Suspect ACM	150	SF	0	LF		Bare Metal ductwork no insulation		N/A	N/A	N/A
1	1	Gymnasium Mat Storage	N/A	Concrete Ceiling		Non Suspect ACM	330	SF	0	SF				N/A	N/A	N/A
1	1	Gymnasium Mat Storage	N/A	Cement Floor		Non Suspect ACM	330	SF	0	SF	Grey			N/A	N/A	N/A
1	1	Gymnasium Mat Storage	N/A	Brick Wall		Non Suspect ACM	600	SF	0	SF				N/A	N/A	N/A
1	1	Gymnasium Mat Storage	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	20	LF	0	LF				N/A	N/A	N/A
1	1	Gymnasium Mat Storage	N/A	Pipe Fitting Insulation		NAD	8	EA	0	EA				N/A	N/A	N/A
1	1	Gymnasium Foyer	N/A	Ceiling Tile 1' x 1'		NAD	360	SF	0	SF				N/A	N/A	N/A
1	1	Gymnasium Foyer	M	Floor Tile VAT 9" x 9"	2000/01/01/15	Confirmed	360	SF	0	SF	Multi			1	No	1/D
1	1	Gymnasium Foyer	N/A	Brick Wall		Non Suspect ACM	750	SF	0	SF				N/A	N/A	N/A
1	1	Gymnasium Foyer	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	40	LF	0	LF				N/A	N/A	N/A
1	1	Gymnasium Foyer	N/A	Pipe Fitting Insulation		NAD	8	EA	0	EA				N/A	N/A	N/A
1	1	Gymnasium Storage	N/A	Concrete Ceiling		Non Suspect ACM	120	SF	0	SF				N/A	N/A	N/A
1	1	Gymnasium Storage	M	Floor Tile VAT 12" x 12"	2000/01/01/PP	Assumed	120	SF	0	SF	Tan			1	No	1/D
1	1	Gymnasium Storage	N/A	Brick Wall		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A
1	1	Gymnasium Storage	N/A	Metal Duct Work		Non Suspect ACM	150	LF	0	LF		No insulation present		N/A	N/A	N/A
1	1	Gymnasium Foyer	N/A	Ceiling Tile 1' x 1'		NAD	360	SF	0	EA				N/A	N/A	N/A
1	1	Gymnasium Foyer	M	Floor Tile VAT 9" x 9"	2000/01/01/15	Confirmed	360	SF	0	SF	Multi			1	No	1/D
1	1	Gymnasium Foyer	N/A	Brick Wall		Non Suspect ACM	750	SF	0	SF				N/A	N/A	N/A
1	1	Gymnasium Foyer	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	40	LF	0	LF				N/A	N/A	N/A
1	1	Gymnasium Foyer	N/A	Pipe Fitting Insulation		NAD	8	EA	0	EA				N/A	N/A	N/A
1	1	Gymnasium Foyer to Broad Street Parking Lot - North End	M	Floor Tile VAT 9" x 9"	2000/01/01/15	Confirmed	450	SF	0	SF	Multi			1	No	1/D
1	1	Gymnasium Foyer to Broad Street Parking Lot - North End	N/A	Concrete Block Wall		Non Suspect ACM	1350	SF	0	SF				N/A	N/A	N/A
1	1	Gymnasium Foyer to Broad Street Parking Lot - North End	N/A	Ceiling Tile 1' x 1'		NAD	450	SF	0	SF				N/A	N/A	N/A
1	1	Gymnasium Foyer to Broad Street Parking Lot - North End	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	10	LF	0	LF				N/A	N/A	N/A
1	1	Storage Room inside Gymnasium Foyer to Broad Street Parking Lot - North End	M	Floor Tile VAT 9" x 9"	2000/01/01/15	Confirmed	32	SF	0	SF	Tan			1	No	1/D
1	1	Storage Room inside Gymnasium Foyer to Broad Street Parking Lot - North End	N/A	Concrete Block Wall		Non Suspect ACM	100	SF	0	SF				N/A	N/A	N/A
1	1	Storage Room inside Gymnasium Foyer to Broad Street Parking Lot - North End	N/A	Concrete Ceiling		Non Suspect ACM	32	SF	0	SF				N/A	N/A	N/A
1	1	Stairwell inside Gymnasium Foyer to Broad Street Parking Lot - North End	X	X	X	X	X	X	X	X		Partitioned Off		X	X	X
1	1	Girl's Restroom	N/A	Plaster Ceiling		NAD	198	SF	0	SF				N/A	N/A	N/A
1	1	Girl's Restroom	N/A	Cement Floor		Non Suspect ACM	198	SF	0	SF				N/A	N/A	N/A
1	1	Girl's Restroom	N/A	Brick Wall		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A
1	1	Girl's Restroom	N/A	Ceramic Tile Walls		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A
1	1	Girl's Restroom	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	40	LF	0	SF				N/A	N/A	N/A
1	1	Girl's Restroom	N/A	Pipe Fitting Insulation		NAD	6	EA	0	SF				N/A	N/A	N/A
1	1	Alumni Room	X	X	X	X	X	X	X	X		No Access		X	X	X
1	1	Gymnasium Foyer to Broad Street Parking Lot - South End	M	Floor Tile VAT 9" x 9"	2000/01/01/15	Confirmed	450	SF	0	SF	Multi			1	No	1/D
1	1	Gymnasium Foyer to Broad Street Parking Lot - South End	N/A	Concrete Block Wall		Non Suspect ACM	1350	SF	0	SF				N/A	N/A	N/A
1	1	Gymnasium Foyer to Broad Street Parking Lot - South End	N/A	Ceiling Tile 1' x 1'		NAD	450	SF	0	SF				N/A	N/A	N/A
1	1	Gymnasium Foyer to Broad Street Parking Lot - South End	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	10	LF	0	LF				N/A	N/A	N/A

2000 South Phila HS 2015-2016 AHERA Three-Year Report.xls

School District of Philadelphia South Philadelphia High School 2021 South Broad Street, Philadelphia, PA 19148 ULCS#2000 Year Built: 1957		AHERA Three-Year Reinspection 2015-2016 Room by Room Location Log Report										Reinspection Date: October 29-November 13, 2015 Building Inspector: Norman Harrison Number: ACC-0915-6-011 Management Planner: Megan Vala Number: 740728				
E l e m e n t	F l o o r	On-Site Room Name	System Affected	Material Description	HID#	Confirmed/Assumed/NAD Non Suspect ACM	Amount of Material	(SF/LF/EA)	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic/ Crawl Space Ranking	Damage Potential (DP)	Newly Friable (NF)	Response Action (RA)
1	1	Storage Room inside Gymnasium Foyer to Broad Street Parking Lot - South End	M	Floor Tile VAT 9" x 9"	2000/01/01/15	Confirmed	32	SF	0	SF	Tan			1	No	1/D
1	1	Storage Room inside Gymnasium Foyer to Broad Street Parking Lot - South End	N/A	Floor Tile VAT 9" x 9"	2000/01/01/15	Confirmed	100	SF	0	SF				N/A	N/A	N/A
1	1	Storage Room inside Gymnasium Foyer to Broad Street Parking Lot - South End	N/A	Floor Tile VAT 9" x 9"	2000/01/01/15	Confirmed	32	SF	0	SF				N/A	N/A	N/A
1	1	Stairwell inside Gymnasium Foyer to Broad Street Parking Lot - South End	X	X	X	X	X	X	X	X		Partitioned Off		X	X	X
1	1	Stairwell next to Hallway Gymnasium Foyer	X	X	X	X	X	X	X	X		No Access		X	X	X
1	1	Counselors Suite	M	Floor Tile VAT 9" x 9"	2000/01/01/15	Confirmed	476	SF	0	SF	Green			1	No	1/D
1	1	Counselors Suite	N/A	Plaster Ceiling		NAD	476	SF	0	SF				N/A	N/A	N/A
1	1	Counselors Suite	N/A	Brick Wall		Non Suspect ACM	1000	SF	0	SF				N/A	N/A	N/A
1	1	Counselors Suite	M	Sheetrock Wall	2000/01/01/SYNBB/2100	Assumed	200	SF	0	SF				1	No	1/D
1	1	Counselors Suite	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	40	LF	0	LF				N/A	N/A	N/A
1	1	Counselors Suite Hallway	M	Floor Tile VAT 9" x 9"	2000/01/01/15	Confirmed	192	SF	0	SF	Green			1	No	1/D
1	1	Counselors Suite Hallway	N/A	Plaster Ceiling		NAD	192	SF	0	SF				N/A	N/A	N/A
1	1	Counselors Suite Hallway	N/A	Concrete Block Wall		Non Suspect ACM	375	SF	0	SF				N/A	N/A	N/A
1	1	Counselors Suite Hallway	N/A	Plaster Walls		NAD	125	SF	0	SF				N/A	N/A	N/A
1	1	Counselors Suite Office A	M	Floor Tile VAT 9" x 9"	2000/01/01/15	Confirmed	192	SF	0	SF	Green			1	No	1/D
1	1	Counselors Suite Office A	N/A	Plaster Ceiling		NAD	192	SF	0	SF				N/A	N/A	N/A
1	1	Counselors Suite Office A	N/A	Brick Wall		Non Suspect ACM	500	SF	0	SF				N/A	N/A	N/A
1	1	Counselors Suite Office B	M	Floor Tile VAT 9" x 9"	2000/01/01/15	Confirmed	192	SF	0	SF	Green			1	No	1/D
1	1	Counselors Suite Office B	N/A	Plaster Ceiling		NAD	192	SF	0	SF				N/A	N/A	N/A
1	1	Counselors Suite Office B	N/A	Brick Wall		Non Suspect ACM	500	SF	0	SF				N/A	N/A	N/A
1	1	Counselors Suite Office C	M	Floor Tile VAT 9" x 9"	2000/01/01/15	Confirmed	192	SF	0	SF	Green			1	No	1/D
1	1	Counselors Suite Office C	N/A	Plaster Ceiling		NAD	192	SF	0	SF				N/A	N/A	N/A
1	1	Counselors Suite Office C	N/A	Brick Wall		Non Suspect ACM	500	SF	0	SF				N/A	N/A	N/A
1	1	Counselors Suite Office D	M	Floor Tile VAT 9" x 9"	2000/01/01/15	Confirmed	192	SF	0	SF	Green			1	No	1/D
1	1	Counselors Suite Office D	N/A	Plaster Ceiling		NAD	192	SF	0	SF				N/A	N/A	N/A
1	1	Counselors Suite Office D	N/A	Brick Wall		Non Suspect ACM	500	SF	0	SF				N/A	N/A	N/A
1	1	Counselors Suite Office E	M	Floor Tile VAT 9" x 9"	2000/01/01/15	Confirmed	192	SF	0	SF	Green			1	No	1/D
1	1	Counselors Suite Office E	N/A	Plaster Ceiling		NAD	192	SF	0	SF				N/A	N/A	N/A
1	1	Counselors Suite Office E	N/A	Brick Wall		Non Suspect ACM	500	SF	0	SF				N/A	N/A	N/A
1	1	Main Office	M	Floor Tile VAT 9" x 9"	2000/01/01/15	Confirmed	2346	SF	0	SF	Multi			1	No	1/D
1	1	Main Office	N/A	Plaster Ceiling		NAD	2346	SF	0	SF				N/A	N/A	N/A
1	1	Main Office	N/A	Brick Wall		Non Suspect ACM	3500	SF	0	SF				N/A	N/A	N/A
1	1	Main Office	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	60	LF	0	LF				N/A	N/A	N/A
1	1	Main Office	N/A	Pipe Fitting Insulation		NAD	25	EA	0	EA				N/A	N/A	N/A
1	1	Corner Roster Office inside Main Office	X	X	X	X	X	X	X	X		No Access		X	X	X
1	1	Middle Roster Office inside Main Office	M	Floor Tile VAT 9" x 9"	2000/01/01/15	Confirmed	225	SF	0	SF	Brown			1	No	1/D
1	1	Middle Roster Office inside Main Office	N/A	Concrete Block Wall		Non Suspect ACM	550	SF	0	SF				N/A	N/A	N/A
1	1	Middle Roster Office inside Main Office	M	Transite	2000/01/01/22	Assumed	125	SF	0	SF		Partition Wall		1	No	1/D
1	1	Middle Roster Office inside Main Office	M	Sheetrock Wall	2000/01/01/SYNBB/2100	Assumed	32	SF	0	SF				1	No	1/D
1	1	Middle Roster Office inside Main Office	N/A	Ceiling Tile 1' x 1'		NAD	225	SF	0	SF				N/A	N/A	N/A
1	1	Principal's Office inside Main Office	X	X	X	X	X	X	X	X		No Access		X	X	X
1	1	Room inside Principal's Office	X	X	X	X	X	X	X	X		No Access		X	X	X
1	1	Room inside Principal's Office	X	X	X	X	X	X	X	X		No Access		X	X	X
1	1	Vice Principal's Office - Left Office	X	X	X	X	X	X	X	X		No Access		X	X	X
1	1	Vice Principal's Office - Right Office	M	Floor Tile VAT 12" x 12"	2000/01/01/PP	Assumed	150	SF	0	SF				1	No	1/D
1	1	Vice Principal's Office - Right Office	N/A	Concrete Block Wall		Non Suspect ACM	450	SF	0	SF				N/A	N/A	N/A
1	1	Vice Principal's Office - Right Office	N/A	Concrete Ceiling		Non Suspect ACM	150	SF	0	SF				N/A	N/A	N/A
1	1	Vice Principal's Office - Right Office	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	20	LF	0	LF				N/A	N/A	N/A
1	1	Vice Principal's Office - Right Office	N/A	Pipe Fitting Insulation		NAD	4	EA	0	EA				N/A	N/A	N/A
1	1	Vice Principal's Office - Right Office	M	Transite Sills	2000/01/01/22	Assumed	3	SF	0	SF		Window Sills		1	No	1/D
1	1	Room inside Main Office next to Hallway to Nurse's Office	X	X	X	X	X	X	X	X		No Access		X	X	X
1	1	Staff Restroom next to Vice Principal's Office - Right Office	M	Floor Tile VAT 9" x 9"	2000/01/01/15	Confirmed	20	SF	0	SF	Brown			1	No	1/D
1	1	Staff Restroom next to Vice Principal's Office - Right Office	N/A	Ceramic Tile Walls		Non Suspect ACM	50	SF	0	SF				N/A	N/A	N/A
1	1	Staff Restroom next to Vice Principal's Office - Right Office	N/A	Concrete Block Wall		Non Suspect ACM	100	SF	0	SF				N/A	N/A	N/A
1	1	Staff Restroom next to Vice Principal's Office - Right Office	N/A	Concrete Ceiling		Non Suspect ACM	20	SF	0	SF				N/A	N/A	N/A
1	1	Staff Restroom next to Vice Principal's Office - Right Office	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	5	LF	0	LF				N/A	N/A	N/A
1	1	Staff Restroom next to Vice Principal's Office - Right Office	N/A	Pipe Fitting Insulation		NAD	2	EA	0	EA				N/A	N/A	N/A
1	1	Staff Lounge next to Nurse's Office	M	Floor Tile VAT 9" x 9"	2000/01/01/15	Confirmed	350	SF	0	SF	Multi			1	No	1/D
1	1	Staff Lounge next to Nurse's Office	N/A	Concrete Block Wall		Non Suspect ACM	1050	SF	0	SF				N/A	N/A	N/A
1	1	Staff Lounge next to Nurse's Office	N/A	Ceramic Tile Walls		Non Suspect ACM	36	SF	0	SF				N/A	N/A	N/A
1	1	Staff Lounge next to Nurse's Office	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	350	SF	0	SF				N/A	N/A	N/A
1	1	Staff Lounge next to Nurse's Office	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	20	LF	0	LF				N/A	N/A	N/A
1	1	Staff Lounge next to Nurse's Office	M	Transite Sills	2000/01/01/22	Assumed	5	SF	0	SF		Window Sills		1	No	1/D

2000 South Phila HS 2015-2016 AHERA Three-Year Report.xls

		School District of Philadelphia South Philadelphia High School 2021 South Broad Street, Philadelphia, PA 19148 ULCS#2000 Year Built: 1957	AHERA Three-Year Reinspection 2015-2016 Room by Room Location Log Report										Reinspection Date: October 29-November 13, 2015 Building Inspector: Norman Harrison Number: ACC-0915-6-011 Management Planner: Megan Vala Number: 740728				
E l e m e n t	F l o o r	On-Site Room Name	System Affected	Material Description	HID#	Confirmed/Assumed/NAD Non Suspect ACM	Amount of Material	(SF/LF/EA)	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic/ Crawl Space Ranking	Damage Potential (DP)	Newly Friable (NF)	Response Action (RA)	
1	1	Restroom inside Staff Lounge next to Nurse's Office	M	Floor Tile VAT 9" x 9"	2000/01/01/15	Confirmed	20	SF	0	SF	Multi			1	No	1/D	
1	1	Restroom inside Staff Lounge next to Nurse's Office	N/A	Concrete Block Wall		Non Suspect ACM	80	SF	0	SF				N/A	N/A	N/A	
1	1	Restroom inside Staff Lounge next to Nurse's Office	N/A	Concrete Ceiling		Non Suspect ACM	20	SF	0	SF				N/A	N/A	N/A	
1	1	Restroom inside Staff Lounge next to Nurse's Office	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	3	LF	0	LF				N/A	N/A	N/A	
1	1	Restroom inside Staff Lounge next to Nurse's Office	N/A	Pipe Fitting Insulation		NAD	2	EA	1	EA				N/A	N/A	N/A	
1	1	Restroom inside Staff Lounge next to Nurse's Office	M	Transite Sills	2000/01/01/22	Assumed	2	SF	0	SF		Window Sills		1	No	1/D	
1	1	Storage Room between Main and Nurse's Offices	N/A	Cement Floor		Non Suspect ACM	100	SF	0	SF				N/A	N/A	N/A	
1	1	Storage Room between Main and Nurse's Offices	N/A	Concrete Block Wall		Non Suspect ACM	300	SF	0	SF				N/A	N/A	N/A	
1	1	Storage Room between Main and Nurse's Offices	N/A	Concrete Ceiling		Non Suspect ACM	100	SF	0	SF				N/A	N/A	N/A	
1	1	Storage Room between Main and Nurse's Offices	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	20	LF	0	LF				N/A	N/A	N/A	
1	1	Storage Room between Main and Nurse's Offices	N/A	Pipe Fitting Insulation		NAD	4	EA	0	EA				N/A	N/A	N/A	
1	1	Staff Restroom between Main and Nurse's Offices	M	Floor Tile VAT 9" x 9"	2000/01/01/15	Confirmed	64	SF	0	SF	Black			1	No	1/D	
1	1	Staff Restroom between Main and Nurse's Offices	N/A	Concrete Block Wall		Non Suspect ACM	192	SF	0	SF				N/A	N/A	N/A	
1	1	Staff Restroom between Main and Nurse's Offices	N/A	Concrete Ceiling		Non Suspect ACM	64	SF	0	SF				N/A	N/A	N/A	
1	1	Staff Restroom between Main and Nurse's Offices	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	20	LF	0	LF				N/A	N/A	N/A	
1	1	Staff Restroom between Main and Nurse's Offices	N/A	Pipe Fitting Insulation		NAD	5	EA	0	EA				N/A	N/A	N/A	
1	1	Hallway between Main and Nurse's Offices	M	Floor Tile VAT 9" x 9"	2000/01/01/15	Confirmed	150	SF	0	SF	Multi			1	No	1/D	
1	1	Hallway between Main and Nurse's Offices	N/A	Concrete Block Wall		Non Suspect ACM	450	SF	0	SF				N/A	N/A	N/A	
1	1	Hallway between Main and Nurse's Offices	N/A	Concrete Ceiling		Non Suspect ACM	150	SF	0	SF				N/A	N/A	N/A	
1	1	Hallway between Main and Nurse's Offices	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	20	LF	0	LF				N/A	N/A	N/A	
1	1	Office between Main and Nurse's Offices	M	Floor Tile VAT 9" x 9"	2000/01/01/15	Confirmed	230	SF	0	SF	Multi			1	No	1/D	
1	1	Office between Main and Nurse's Offices	M	Floor Tile VAT 12" x 12"	2000/01/01/PP	Assumed	20	SF	0	SF	Black			1	No	1/D	
1	1	Office between Main and Nurse's Offices	N/A	Concrete Block Wall		Non Suspect ACM	750	SF	0	SF				N/A	N/A	N/A	
1	1	Office between Main and Nurse's Offices	N/A	Ceramic Tile Walls		Non Suspect ACM	24	SF	0	SF				N/A	N/A	N/A	
1	1	Office between Main and Nurse's Offices	N/A	Concrete Ceiling		Non Suspect ACM	250	SF	0	SF				N/A	N/A	N/A	
1	1	Office between Main and Nurse's Offices	M	Transite Sills	2000/01/01/22	Assumed	5	SF	0	SF		Window Sills		1	No	1/D	
1	1	Nurse's Office	M	Floor Tile VAT 9" x 9"	2000/01/01/15	Confirmed	540	SF	0	SF	Multi			1	No	1/D	
1	1	Nurse's Office	N/A	Plaster Ceiling		NAD	540	SF	0	SF				N/A	N/A	N/A	
1	1	Nurse's Office	N/A	Brick Wall		Non Suspect ACM	1000	SF	0	SF				N/A	N/A	N/A	
1	1	Nurse's Office	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	40	LF	0	LF				N/A	N/A	N/A	
1	1	Nurse's Office	N/A	Pipe Fitting Insulation		NAD	15	EA	0	EA				N/A	N/A	N/A	
1	1	Nurse's Office Restroom	M	Floor Tile VAT 9" x 9"	2000/01/01/15	Confirmed	540	SF	0	SF	Multi			1	No	1/D	
1	1	Nurse's Office Restroom	N/A	Plaster Ceiling		NAD	540	SF	0	SF				N/A	N/A	N/A	
1	1	Nurse's Office Restroom	N/A	Brick Wall		Non Suspect ACM	1000	SF	0	SF				N/A	N/A	N/A	
1	1	Nurse's Office Restroom	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	20	LF	0	LF				N/A	N/A	N/A	
1	1	Nurse's Office Restroom	N/A	Pipe Fitting Insulation		NAD	7	EA	0	EA				N/A	N/A	N/A	
1	1	Examination Room - Male adjacent to Restroom	M	Floor Tile VAT 9" x 9"	2000/01/01/15	Confirmed	260	SF	0	SF	Multi			1	No	1/D	
1	1	Examination Room - Male adjacent to Restroom	N/A	Plaster Ceiling		NAD	260	SF	0	SF				N/A	N/A	N/A	
1	1	Examination Room - Male adjacent to Restroom	N/A	Brick Wall		Non Suspect ACM	500	SF	0	SF				N/A	N/A	N/A	
1	1	Examination Room - Male adjacent to Restroom	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	20	LF	0	LF				N/A	N/A	N/A	
1	1	Examination Room - Male adjacent to Restroom	N/A	Pipe Fitting Insulation		NAD	3	EA	0	EA				N/A	N/A	N/A	
1	1	Nurse's Office Examination Room - Female	M	Floor Tile VAT 9" x 9"	2000/01/01/15	Confirmed	171	SF	0	SF	Red			1	No	1/D	
1	1	Nurse's Office Examination Room - Female	N/A	Plaster Ceiling		NAD	171	SF	0	SF				N/A	N/A	N/A	
1	1	Nurse's Office Examination Room - Female	N/A	Brick Wall		Non Suspect ACM	250	SF	0	SF				N/A	N/A	N/A	
1	1	Nurse's Office Examination Room - Female	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	20	LF	0	LF				N/A	N/A	N/A	
1	1	Nurse's Office Examination Room - Female	N/A	Pipe Fitting Insulation		NAD	3	EA	0	EA				N/A	N/A	N/A	
1	1	Nurse's Office Examination Room - Female	N/A	Ceramic Tile Walls		Non Suspect ACM	250	SF	0	SF				N/A	N/A	N/A	
1	1	Nurse's Office Storage Room	M	Floor Tile VAT 9" x 9"	2000/01/01/15	Confirmed	171	SF	0	SF	Red			1	No	1/D	
1	1	Nurse's Office Storage Room	N/A	Plaster Ceiling		NAD	171	SF	0	SF				N/A	N/A	N/A	
1	1	Nurse's Office Storage Room	N/A	Brick Wall		Non Suspect ACM	500	SF	0	SF				N/A	N/A	N/A	
1	1	Nurse's Office Storage Rom	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	20	LF	0	LF				N/A	N/A	N/A	
1	1	Nurse's Office Storage Room	N/A	Pipe Fitting Insulation		NAD	3	EA	0	EA				N/A	N/A	N/A	
1	1	Stairwell # 2 next to Nurse's Office Suite	M	Floor Tile VAT 9" x 9"	2000/01/05/46	Confirmed	120	SF	0	SF	Black			1	No	1/D	
1	1	Stairwell # 2 next to Nurse's Office Suite	N/A	Cement Floor		Non Suspect ACM	80	SF	0	SF				N/A	N/A	N/A	
1	1	Stairwell # 2 next to Nurse's Office Suite	N/A	Concrete Block Wall		Non Suspect ACM	600	SF	0	SF				N/A	N/A	N/A	
1	1	Stairwell # 2 next to Nurse's Office Suite	N/A	Concrete Ceiling		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A	
1	1	Stairwell # 2 next to Nurse's Office Suite	T	Radiator Insulation	2000/01/01/SYN/BB/1600	Assumed	35	SF	0	SF				1	No	1/D	
1	1	Loading Dock	N/A	Cement Floor		Non Suspect ACM	1456	SF	0	SF	Multi	Includes Hallway 116C		N/A	N/A	N/A	
1	1	Loading Dock	N/A	Concrete Ceiling		Non Suspect ACM	1456	SF	0	SF				N/A	N/A	N/A	
1	1	Loading Dock	N/A	Brick Wall		Non Suspect ACM	2500	SF	0	SF				N/A	N/A	N/A	
1	1	Loading Dock	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	300	LF	0	LF				N/A	N/A	N/A	
1	1	Loading Dock	N/A	Pipe Fitting Insulation		NAD	50	EA	0	EA				N/A	N/A	N/A	
1	1	Boy's Restroom	N/A	Plaster Ceiling		NAD	468	SF	0	SF				N/A	N/A	N/A	
1	1	Boy's Restroom	N/A	Cement Floor		Non Suspect ACM	468	SF	0	SF				N/A	N/A	N/A	
1	1	Boy's Restroom	N/A	Brick Wall		Non Suspect ACM	400	SF	0	SF				N/A	N/A	N/A	
1	1	Boy's Restroom	N/A	Ceramic Tile Walls		Non Suspect ACM	400	SF	0	SF				N/A	N/A	N/A	
1	1	Boy's Restroom	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	40	LF	0	LF				N/A	N/A	N/A	
1	1	Boy's Restroom	N/A	Pipe Fitting Insulation		NAD	6	EA	0	EA				N/A	N/A	N/A	
1	1	Girl's Restroom	N/A	Plaster Ceiling		NAD	198	SF	0	SF				N/A	N/A	N/A	
1	1	Girl's Restroom	N/A	Cement Floor		Non Suspect ACM	198	SF	0	SF				N/A	N/A	N/A	
1	1	Girl's Restroom	N/A	Brick Wall		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A	
1	1	Girl's Restroom	N/A	Ceramic Tile Walls		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A	

2000 South Phila HS 2015-2016 AHERA Three-Year Report.xls

School District of Philadelphia South Philadelphia High School 2021 South Broad Street, Philadelphia, PA 19148 ULCS#2000 Year Built: 1957		AHERA Three-Year Reinspection 2015-2016 Room by Room Location Log Report										Reinspection Date: October 29-November 13, 2015 Building Inspector: Norman Harrison Number: ACC-0915-6-011 Management Planner: Megan Vala Number: 740728				
E l e m e n t	F l o o r	On-Site Room Name	System Affected	Material Description	HID#	Confirmed/Assumed/NAD Non Suspect ACM	Amount of Material	(SF/LF/EA)	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic/ Crawl Space Ranking	Damage Potential (DP)	Newly Friable (NF)	Response Action (RA)
1	1	Girl's Restroom	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	40	LF	0	SF				N/A	N/A	N/A
1	1	Girl's Restroom	N/A	Pipe Fitting Insulation		NAD	6	EA	0	SF				N/A	N/A	N/A
1	1	Auditorium	M	Floor Tile VAT 9" x 9"	2000/01/01/15	Confirmed	3,600	SF	0	SF	Multi			1	No	1/D
1	1	Auditorium	N/A	Concrete Block Wall		Non Suspect ACM	10,800	SF	0	SF				N/A	N/A	N/A
1	1	Auditorium	N/A	Plaster Walls		NAD	1,000	SF	0	SF				N/A	N/A	N/A
1	1	Auditorium	S	Acoustical Plaster Ceiling	2000/01/01/SYN/BB/2101	Assumed	3,600	SF	0	SF		Not enough samples were collected/conflicting results (December 2009). All acoustical plaster ceilings in Auditorium remain Assumed. Needs to be assessed - arrangements will be made to have genie on site for additional sampling.		1	No	1/D
1	1	Auditorium	N/A	Plaster Ceiling	2000/01/01/USA/NH/1903	NAD	1,000	SF	0	SF		Smooth Plaster Ceiling above Orchestra Pit		N/A	N/A	N/A
1	1	School Store	N/A	Cement Floor		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A
1	1	School Store	N/A	Plaster Ceiling		NAD	200	SF	0	SF				N/A	N/A	N/A
1	1	School Store	N/A	Plaster Walls		NAD	400	SF	0	SF				N/A	N/A	N/A
1	1	Auditorium Stage	N/A	Wood Floor		Non Suspect ACM	1800	SF	0	SF				N/A	N/A	N/A
1	1	Auditorium Stage	N/A	Concrete Ceiling		Non Suspect ACM	1800	SF	0	SF		Textured?		N/A	N/A	N/A
1	1	Auditorium Stage	N/A	Concrete Block Wall		Non Suspect ACM	5400	SF	0	SF				N/A	N/A	N/A
1	1	Auditorium ADA Ramp - North	M	Floor Tile VAT 9" x 9"	2000/01/01/15	Confirmed	184	SF	0	SF	Black			1	No	1/D
1	1	Auditorium ADA Ramp - North	N/A	Plaster Ceiling		NAD	184	SF	0	SF				N/A	N/A	N/A
1	1	Auditorium ADA Ramp - North	N/A	Plaster Walls		NAD	350	SF	0	SF				N/A	N/A	N/A
1	1	Auditorium ADA Ramp - North	M	Floor Tile VAT 9" x 9"	2000/01/01/15	Confirmed	136	SF	0	SF	Black			1	No	1/D
1	1	Auditorium ADA Ramp - North	N/A	Plaster Ceiling		NAD	136	SF	0	SF				N/A	N/A	N/A
1	1	Auditorium ADA Ramp - North	N/A	Plaster Walls		NAD	350	SF	0	SF				N/A	N/A	N/A
1	1	Auditorium ADA Ramp - South	M	Floor Tile VAT 9" x 9"	2000/01/01/15	Confirmed	184	SF	0	SF	Black			1	No	1/D
1	1	Auditorium ADA Ramp - South	N/A	Plaster Ceiling		NAD	184	SF	0	SF				N/A	N/A	N/A
1	1	Auditorium ADA Ramp - South	N/A	Plaster Walls		NAD	350	SF	0	SF				N/A	N/A	N/A
1	1	Auditorium ADA Ramp - South	M	Floor Tile VAT 9" x 9"	2000/01/01/15	Confirmed	136	SF	0	SF	Black			1	No	1/D
1	1	Auditorium ADA Ramp - South	N/A	Plaster Ceiling		NAD	136	SF	0	SF				N/A	N/A	N/A
1	1	Auditorium ADA Ramp - South	N/A	Plaster Walls		NAD	350	SF	0	SF				N/A	N/A	N/A
1	1	Gymnasium Foyer	N/A	Ceiling Tile 1' x 1'		NAD	740	SF	0	SF				N/A	N/A	N/A
1	1	Gymnasium Foyer	M	Floor Tile VAT 9" x 9"	2000/01/01/15	Confirmed	740	SF	0	SF	Multi			1	No	1/D
1	1	Gymnasium Foyer	N/A	Brick Wall		Non Suspect ACM	1000	SF	0	SF				N/A	N/A	N/A
1	1	Gymnasium Foyer	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	50	LF	0	LF				N/A	N/A	N/A
1	1	Gymnasium Foyer	N/A	Pipe Fitting Insulation		NAD	10	EA	0	EA				N/A	N/A	N/A
1	1	South Elevator 1	M	Floor Tile VAT 12" x 12"	2000/01/01/PP	Assumed	120	SF	0	SF	Black			1	No	1/D
1	1	South Elevator 1	N/A	Metal Ceiling		Non Suspect ACM	120	SF	0	SF				N/A	N/A	N/A
1	1	South Elevator 1	N/A	Metal Walls		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A
1	1	South Elevator 2	M	Floor Tile VAT 12" x 12"	2000/01/01/PP	Assumed	120	SF	0	SF	Grey			1	No	1/D
1	1	South Elevator 2	N/A	Metal Ceiling		Non Suspect ACM	120	SF	0	SF				N/A	N/A	N/A
1	1	South Elevator 2	N/A	Metal Walls		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A
1	1	South Elevator 3	M	Floor Tile VAT 12" x 12"	2000/01/01/PP	Assumed	120	SF	0	SF	Grey			1	No	1/D
1	1	South Elevator 3	N/A	Metal Ceiling		Non Suspect ACM	120	SF	0	SF				N/A	N/A	N/A
1	1	South Elevator 3	N/A	Metal Walls		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A
1	1	Music Wing Hallway	N/A	Ceiling Tile 1' x 1'		NAD	1776	SF	0	SF				N/A	N/A	N/A
1	1	Music Wing Hallway	M	Floor Tile VAT 9" x 9"	2000/01/01/15	Confirmed	1776	SF	0	SF	Red			1	No	1/D
1	1	Music Wing Hallway	N/A	Concrete Block Wall		Non Suspect ACM	1500	SF	0	SF				N/A	N/A	N/A
1	1	Music Wing Hallway	N/A	Plaster Walls		NAD	500	SF	0	SF				N/A	N/A	N/A
1	1	Stairwell # 4 - Center Hall next to Auditorium Stage	M	Floor Tile VAT 9" x 9"	2000/01/05/46	Confirmed	120	SF	0	SF	Black			1	No	1/D
1	1	Stairwell # 4 - Center Hall next to Auditorium Stage	N/A	Cement Floor		Non Suspect ACM	80	SF	0	SF				N/A	N/A	N/A
1	1	Stairwell # 4 - Center Hall next to Auditorium Stage	N/A	Concrete Block Wall		Non Suspect ACM	600	SF	0	SF				N/A	N/A	N/A
1	1	Stairwell # 4 - Center Hall next to Auditorium Stage	N/A	Concrete Ceiling		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A
1	1	Stairwell # 4 - Center Hall next to Auditorium Stage	M	Transite Sills	2000/01/01/22	Assumed	2	SF	0	SF		Fire Extinguisher Sill		1	No	1/D
1	1	Main Office Hallway	M	Floor Tile VAT 9" x 9"	2000/01/01/15	Confirmed	1776	SF	0	SF	Black			1	No	1/D
1	1	Main Office Hallway	N/A	Ceiling Tile 1' x 1'		NAD	1776	SF	0	SF				N/A	N/A	N/A
1	1	Main Office Hallway	N/A	Concrete Block Wall		Non Suspect ACM	1500	SF	0	SF				N/A	N/A	N/A
1	1	Main Office Hallway	N/A	Plaster Walls		NAD	500	SF	0	SF				N/A	N/A	N/A
1	1	Auditorium Hallway	M	Floor Tile VAT 9" x 9"	2000/01/01/15	Confirmed	4176	SF	0	SF	Tan			1	No	1/D
1	1	Auditorium Hallway	N/A	Ceiling Tile 1' x 1'		NAD	4176	SF	0	SF				N/A	N/A	N/A
1	1	Auditorium Hallway	N/A	Concrete Block Wall		Non Suspect ACM	3750	SF	0	SF				N/A	N/A	N/A
1	1	Auditorium Hallway	N/A	Plaster Walls		NAD	1250	SF	0	SF				N/A	N/A	N/A
1	1	Hallway at Classroom 108	M	Floor Tile VAT 9" x 9"	2000/01/01/15	Confirmed	1044	SF	0	SF	Multi			1	No	1/D
1	1	Hallway at Classroom 108	M	Floor Tile VAT 12" x 12"	2000/01/01/PP	Assumed	120	SF	0	SF	Grey	At Lower Landing at Entrance to 107 Wood Shop Classroom		1	No	1/D
1	1	Hallway at Classroom 108	N/A	Ceiling Tile 1' x 1'		NAD	1044	SF	0	SF				N/A	N/A	N/A
1	1	Hallway at Classroom 108	N/A	Concrete Block Wall		Non Suspect ACM	1125	SF	0	SF				N/A	N/A	N/A
1	1	Hallway at Classroom 108	N/A	Plaster Walls		NAD	325	SF	0	SF				N/A	N/A	N/A
1	1	Hallway at Classroom 108	N/A	Fire Doors		Non Suspect ACM	1	EA	0	EA		Metal Fire Door - Wood Interior		N/A	N/A	N/A
1	1	Suite 113 Hallway	N/A	Ceiling Tile 1' x 1'		NAD	1776	SF	0	SF				N/A	N/A	N/A
1	1	Suite 113 Hallway	M	Floor Tile VAT 12" x 12"	2000/01/01/PP	Assumed	1776	SF	0	SF	Tan			1	No	1/D
1	1	Suite 113 Hallway	N/A	Concrete Block Wall		Non Suspect ACM	1500	SF	0	SF				N/A	N/A	N/A
1	1	Suite 113 Hallway	N/A	Plaster Walls		NAD	500	SF	0	SF				N/A	N/A	N/A
1	1	Stairwell adjacent to Roster Office 100	M	Floor Tile VAT 9" x 9"	2000/01/01/15	Confirmed	50	SF	0	SF	Black			1	No	1/D

2000 South Phila HS 2015-2016 AHERA Three-Year Report.xls

School District of Philadelphia South Philadelphia High School 2021 South Broad Street, Philadelphia, PA 19148 ULCS#2000 Year Built: 1957		AHERA Three-Year Reinspection 2015-2016 Room by Room Location Log Report										Reinspection Date: October 29-November 13, 2015 Building Inspector: Norman Harrison Number: ACC-0915-6-011 Management Planner: Megan Vala Number: 740728				
E l e m e n t	F l o o r	On-Site Room Name	System Affected	Material Description	HID#	Confirmed/Assumed/NAD Non Suspect ACM	Amount of Material	(SF/LF/EA)	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic/ Crawl Space Ranking	Damage Potential (DP)	Newly Friable (NF)	Response Action (RA)
1	1	Stairwell adjacent to Roster Office 100	N/A	Cement Floor		Non Suspect ACM	175	SF	0	SF				N/A	N/A	N/A
1	1	Stairwell adjacent to Roster Office 100	N/A	Concrete Ceiling		Non Suspect ACM	228	SF	0	SF				N/A	N/A	N/A
1	1	Stairwell adjacent to Roster Office 100	N/A	Brick Wall		Non Suspect ACM	300	SF	0	SF				N/A	N/A	N/A
1	B	Cafeteria Hallway	N/A	Ceiling Tile 1' x 1'		NAD	856	SF	0	SF				N/A	N/A	N/A
1	B	Cafeteria Hallway	M	Floor Tile VAT 9" x 9"	2000/01/0B/07	Confirmed	856	SF	0	SF	Red			1	No	1/D
1	B	Cafeteria Hallway	N/A	Concrete Block Wall		Non Suspect ACM	900	SF	0	SF				N/A	N/A	N/A
1	B	Cafeteria Hallway	N/A	Plaster Walls		NAD	300	SF	0	SF				N/A	N/A	N/A
1	B	Hallway to ROTC and Vocational Technical Wing	M	Floor Tile VAT 9" x 9"	2000/01/0B/07	Confirmed	2500	SF	0	SF	Red	Includes LOBBY		1	No	1/D
1	B	Hallway to ROTC and Vocational Technical Wing	M	Floor Tile VAT 12" x 12"	2000/01/0B/XX	Assumed	800	SF	0	SF	Black			1	No	1/D
1	B	Hallway to ROTC and Vocational Technical Wing	N/A	Ceiling Tile 1' x 1'		NAD	3300	SF	0	SF				N/A	N/A	N/A
1	B	Hallway to ROTC and Vocational Technical Wing	N/A	Concrete Block Wall		Non Suspect ACM	750	SF	0	SF				N/A	N/A	N/A
1	B	Hallway to ROTC and Vocational Technical Wing	N/A	Plaster Walls		NAD	250	SF	0	SF				N/A	N/A	N/A
1	B	ROTC Wing Hallway	M	Floor Tile VAT 12" x 12"	2000/01/0B/XX	Assumed	660	SF	0	SF	Tan			1	No	1/D
1	B	ROTC Wing Hallway	N/A	Ceiling Tile 1' x 1'		NAD	660	SF	0	SF				N/A	N/A	N/A
1	B	ROTC Wing Hallway	N/A	Concrete Block Wall		Non Suspect ACM	750	SF	0	SF				N/A	N/A	N/A
1	B	ROTC Wing Hallway	N/A	Plaster Walls		NAD	250	SF	0	SF				N/A	N/A	N/A
1	B	Boy's Visitor Locker Room Hallway	N/A	Cement Floor		Non Suspect ACM	216	SF	0	SF				N/A	N/A	N/A
1	B	Boy's Visitor Locker Room Hallway	N/A	Plaster Ceiling		NAD	216	SF	0	SF				N/A	N/A	N/A
1	B	Boy's Visitor Locker Room Hallway	N/A	Concrete Block Wall		Non Suspect ACM	375	SF	0	SF				N/A	N/A	N/A
1	B	Boy's Visitor Locker Room Hallway	N/A	Plaster Walls		NAD	125	SF	0	SF				N/A	N/A	N/A
1	B	Hallway to South Stairwell	N/A	Plaster Ceiling		NAD	105	SF	0	SF				N/A	N/A	N/A
1	B	Hallway to South Stairwell	N/A	Cement Floor		Non Suspect ACM	105	SF	0	SF	Tan			N/A	N/A	N/A
1	B	Hallway to South Stairwell	N/A	Concrete Block Wall		Non Suspect ACM	375	SF	0	SF				N/A	N/A	N/A
1	B	Hallway to South Stairwell	N/A	Plaster Walls		NAD	125	SF	0	SF				N/A	N/A	N/A
1	B	Girl's Visitor Locker Room Hallway	N/A	Plaster Ceiling		NAD	216	SF	0	SF				N/A	N/A	N/A
1	B	Girl's Visitor Locker Room Hallway	N/A	Cement Floor		Non Suspect ACM	216	SF	0	SF	Red			N/A	N/A	N/A
1	B	Girl's Visitor Locker Room Hallway	N/A	Concrete Block Wall		Non Suspect ACM	375	SF	0	SF				N/A	N/A	N/A
1	B	Girl's Visitor Locker Room Hallway	N/A	Plaster Walls		NAD	125	SF	0	SF				N/A	N/A	N/A
1	B	Hallway to North Stairwell	N/A	Cement Floor		Non Suspect ACM	100	SF	0	SF	Black			N/A	N/A	N/A
1	B	Hallway to North Stairwell	N/A	Plaster Ceiling		NAD	100	SF	0	SF				N/A	N/A	N/A
1	B	Hallway to North Stairwell	N/A	Concrete Block Wall		Non Suspect ACM	300	SF	0	SF				N/A	N/A	N/A
1	B	Hallway to North Stairwell	N/A	Plaster Walls		NAD	100	SF	0	SF				N/A	N/A	N/A
1	B	Stairwell adjacent to Cafeteria	N/A	Cement Floor		Non Suspect ACM	175	SF	0	SF				N/A	N/A	N/A
1	B	Stairwell adjacent to Cafeteria	N/A	Concrete Ceiling		Non Suspect ACM	228	SF	0	SF				N/A	N/A	N/A
1	B	Stairwell adjacent to Cafeteria	N/A	Brick Wall		Non Suspect ACM	300	SF	0	SF				N/A	N/A	N/A
1	B	Stairwell adjacent to Boiler Room	N/A	Cement Floor		Non Suspect ACM	175	SF	0	SF				N/A	N/A	N/A
1	B	Stairwell adjacent to Boiler Room	N/A	Concrete Ceiling		Non Suspect ACM	228	SF	0	SF				N/A	N/A	N/A
1	B	Stairwell adjacent to Boiler Room	N/A	Brick Wall		Non Suspect ACM	300	SF	0	SF				N/A	N/A	N/A
1	B	Stairwell adjacent to Girl's Locker Room	N/A	Cement Floor		Non Suspect ACM	175	SF	0	SF				N/A	N/A	N/A
1	B	Stairwell adjacent to Girl's Locker Room	N/A	Concrete Ceiling		Non Suspect ACM	228	SF	0	SF				N/A	N/A	N/A
1	B	Stairwell adjacent to Girl's Locker Room	N/A	Brick Wall		Non Suspect ACM	300	SF	0	SF				N/A	N/A	N/A
1	B	Stairwell adjacent to Classroom 004	N/A	Cement Floor		Non Suspect ACM	175	SF	0	SF				N/A	N/A	N/A
1	B	Stairwell adjacent to Classroom 004	N/A	Concrete Ceiling		Non Suspect ACM	228	SF	0	SF				N/A	N/A	N/A
1	B	Stairwell adjacent to Classroom 004	N/A	Brick Wall		Non Suspect ACM	300	SF	0	SF				N/A	N/A	N/A
1	B	Stairwell adjacent to Classroom 004	T	Radiator Insulation	2000/01/0B/USA/BB/1600	Assumed	15	SF	0	SF				1	No	1/D
1	B	Stairwell adjacent to Classroom 038	N/A	Cement Floor		Non Suspect ACM	175	SF	0	SF				N/A	N/A	N/A
1	B	Stairwell adjacent to Classroom 038	N/A	Concrete Ceiling		Non Suspect ACM	228	SF	0	SF				N/A	N/A	N/A
1	B	Stairwell adjacent to Classroom 038	N/A	Brick Wall		Non Suspect ACM	300	SF	0	SF				N/A	N/A	N/A
1	B	Basement South Stairwell	N/A	Cement Floor		Non Suspect ACM	175	SF	0	SF				N/A	N/A	N/A
1	B	Basement South Stairwell	N/A	Concrete Ceiling		Non Suspect ACM	228	SF	0	SF				N/A	N/A	N/A
1	B	Basement South Stairwell	N/A	Brick Wall		Non Suspect ACM	300	SF	0	SF				N/A	N/A	N/A
1	B	Basement North Stairwell	N/A	Cement Floor		Non Suspect ACM	175	SF	0	SF				N/A	N/A	N/A
1	B	Basement North Stairwell	N/A	Concrete Ceiling		Non Suspect ACM	228	SF	0	SF				N/A	N/A	N/A
1	B	Basement North Stairwell	N/A	Brick Wall		Non Suspect ACM	300	SF	0	SF				N/A	N/A	N/A
1	B	Classroom 001	N/A	Ceiling Tile 1' x 1'		NAD	1344	SF	0	SF				N/A	N/A	N/A
1	B	Classroom 001	M	Floor Tile VAT 12" x 12"	2000/01/0B/XX	Assumed	1344	SF	0	SF	Multi			1	No	1/D
1	B	Classroom 001	M	Sheetrock Wall	2000/01/0B/USA/NH/2100	Assumed	2000	SF	0	SF				1	No	1/D
1	B	Classroom 001	N/A	Fiberglass Pipe Fitting Insulation		Non Suspect ACM	300	LF	0	LF				N/A	N/A	N/A
1	B	Classroom 001	N/A	Pipe Fitting Insulation		NAD	50	EA	0	EA				N/A	N/A	N/A
1	B	Classroom 001 A Compressor Room	N/A	Concrete Ceiling		Non Suspect ACM	360	SF	0	SF				N/A	N/A	N/A
1	B	Classroom 001 A Compressor Room	M	Floor Tile VAT 12" x 12"	2000/01/0B/XX	Assumed	360	SF	0	SF	Tan			1	No	1/D
1	B	Classroom 001 A Compressor Room	M	Sheetrock Wall	2000/01/0B/USA/NH/2100	Assumed	600	SF	0	SF				1	No	1/D
1	B	Classroom 001 A Compressor Room	N/A	Fiberglass Pipe Fitting Insulation		Non Suspect ACM	20	LF	0	LF				N/A	N/A	N/A
1	B	Classroom 001 A Compressor Room	N/A	Pipe Fitting Insulation		NAD	6	EA	0	EA				N/A	N/A	N/A
1	B	Classroom 001 Boy's Restroom	N/A	Plaster Ceiling		NAD	100	SF	0	SF				N/A	N/A	N/A
1	B	Classroom 001 Boy's Restroom	M	Floor Tile VAT 12" x 12"	2000/01/0B/XX	Assumed	100	SF	0	SF	White			1	No	1/D
1	B	Classroom 001 Boy's Restroom	M	Sheetrock Wall	2000/01/0B/USA/NH/2100	Assumed	400	SF	0	SF				1	No	1/D
1	B	Classroom 001 Boy's Restroom	N/A	Fiberglass Pipe Fitting Insulation		Non Suspect ACM	10	LF	0	LF				N/A	N/A	N/A
1	B	Classroom 001 Boy's Restroom	N/A	Pipe Fitting Insulation		NAD	4	EA	0	EA				N/A	N/A	N/A
1	B	Classroom 001 Girl's Restroom	N/A	Plaster Ceiling		NAD	1344	SF	0	SF				N/A	N/A	N/A
1	B	Classroom 001 Girl's Restroom	M	Floor Tile VAT 12" x 12"	2000/01/0B/XX	Assumed	1344	SF	0	SF	Grey			1	No	1/D
1	B	Classroom 001 Girl's Restroom	M	Sheetrock Wall	2000/01/0B/USA/NH/2100	Assumed	2000	SF	0	SF				1	No	1/D

2000 South Phila HS 2015-2016 AHERA Three-Year Report.xls

School District of Philadelphia South Philadelphia High School 2021 South Broad Street, Philadelphia, PA 19148 ULCS#2000 Year Built: 1957		AHERA Three-Year Reinspection 2015-2016 Room by Room Location Log Report										Reinspection Date: October 29-November 13, 2015 Building Inspector: Norman Harrison Number: ACC-0915-6-011 Management Planner: Megan Vala Number: 740728				
E l e m e n t	F l o o r	On-Site Room Name	System Affected	Material Description	HID#	Confirmed/Assumed/NAD Non Suspect ACM	Amount of Material	(SF/LF/EA)	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic/ Crawl Space Ranking	Damage Potential (DP)	Newly Friable (NF)	Response Action (RA)
1	B	Classroom 001 Girl's Restroom	N/A	Fiberglass Pipe Fitting Insulation		Non Suspect ACM	300	LF	0	LF				N/A	N/A	N/A
1	B	Classroom 001 Girl's Restroom	N/A	Pipe Fitting Insulation		NAD	50	EA	0	EA				N/A	N/A	N/A
1	B	x	X	X	X	X	X	X	X	X		No Access - Need on site room name		X	X	X
1	B	x	X	X	X	X	X	X	X	X		No Access - Need on site room name		X	X	X
1	B	Classroom 004	N/A	Ceiling Tile 1' x 1'		NAD	3900	SF	0	SF				N/A	N/A	N/A
1	B	Classroom 004	M	Floor Tile VAT 12" x 12"	2000/01/0B/XX	Assumed	3900	SF	0	SF	Tan			1	No	1/D
1	B	Classroom 004	M	Sheetrock Wall	2000/01/0B/USA/NH/2100	Assumed	5000	SF	0	SF				1	No	1/D
1	B	Classroom 004	N/A	Fiberglass Pipe Fitting Insulation		Non Suspect ACM	40	LF	0	LF				N/A	N/A	N/A
1	B	Classroom 004	N/A	Pipe Fitting Insulation		NAD	10	EA	0	EA				N/A	N/A	N/A
1	B	Building Engineer's Storage Room	N/A	Concrete Ceiling		Non Suspect ACM	1344	SF	0	SF				N/A	N/A	N/A
1	B	Building Engineer's Storage Room	N/A	Cement Floor		Non Suspect ACM	1344	SF	0	SF				N/A	N/A	N/A
1	B	Building Engineer's Storage Room	N/A	Brick Wall		Non Suspect ACM	2000	SF	0	SF				N/A	N/A	N/A
1	B	Building Engineer's Storage Room	N/A	Fiberglass Pipe Fitting Insulation		Non Suspect ACM	300	LF	0	LF				N/A	N/A	N/A
1	B	Building Engineer's Storage Room	N/A	Pipe Fitting Insulation		NAD	50	EA	0	EA				N/A	N/A	N/A
1	B	Building Engineer's Office	N/A	Ceiling Tile 1' x 1'		NAD	1344	SF	0	SF				N/A	N/A	N/A
1	B	Building Engineer's Office	M	Floor Tile VAT 12" x 12"	2000/01/0B/XX	Assumed	1344	SF	0	SF	Tan			1	No	1/D
1	B	Building Engineer's Office	M	Sheetrock Wall	2000/01/0B/USA/NH/2100	Assumed	2000	SF	0	SF				1	No	1/D
1	B	Building Engineer's Office	N/A	Fiberglass Pipe Fitting Insulation		Non Suspect ACM	300	LF	0	LF				N/A	N/A	N/A
1	B	Building Engineer's Office	N/A	Pipe Fitting Insulation		NAD	50	EA	0	EA				N/A	N/A	N/A
1	B	Custodial Storage Room	N/A	Ceiling Tile 1' x 1'		NAD	1344	SF	0	SF				N/A	N/A	N/A
1	B	Custodial Storage Room	M	Floor Tile VAT 9" x 9"	2000/01/0B/07	Confirmed	1344	SF	0	SF	Tan			1	No	1/D
1	B	Custodial Storage Room	M	Sheetrock Wall	2000/01/0B/USA/NH/2100	Assumed	2000	SF	0	SF				1	No	1/D
1	B	Custodial Storage Room	N/A	Fiberglass Pipe Fitting Insulation		Non Suspect ACM	40	LF	0	LF				N/A	N/A	N/A
1	B	Custodial Storage Room	N/A	Pipe Fitting Insulation		NAD	10	EA	0	EA				N/A	N/A	N/A
1	B	Boiler Control Room	N/A	Concrete Ceiling		Non Suspect ACM	1344	SF	0	SF				N/A	N/A	N/A
1	B	Boiler Control Room	M	Floor Tile VAT 9" x 9"	2000/01/0B/07	Confirmed	1344	SF	0	SF	Red			1	No	1/D
1	B	Boiler Control Room	N/A	Brick Wall		Non Suspect ACM	2000	SF	0	SF				N/A	N/A	N/A
1	B	Center Hallway from Boiler Control Room to Stairwell # 4	M	Floor Tile VAT 9" x 9"	2000/01/0B/07	Confirmed	750	SF	0	SF	Multi			1	No	1/D
1	B	Center Hallway from Boiler Control Room to Stairwell # 4	N/A	Concrete Block Wall		Non Suspect ACM	2250	SF	0	SF				N/A	N/A	N/A
1	B	Center Hallway from Boiler Control Room to Stairwell # 4	N/A	Ceiling Tile 1' x 1'		NAD	750	SF	0	SF				N/A	N/A	N/A
1	B	Custodial Kitchen / Lounge	N/A	Concrete Ceiling		Non Suspect ACM	344	SF	0	SF				N/A	N/A	N/A
1	B	Custodial Kitchen / Lounge	M	Floor Tile VAT 9" x 9"	2000/01/0B/07	Confirmed	344	SF	0	SF	Multi			1	No	1/D
1	B	Custodial Kitchen / Lounge	N/A	Brick Wall		Non Suspect ACM	1000	SF	0	SF				N/A	N/A	N/A
1	B	Custodial Storage Room	N/A	Concrete Ceiling		Non Suspect ACM	1344	SF	0	SF				N/A	N/A	N/A
1	B	Custodial Storage Room	N/A	Cement Floor		Non Suspect ACM	1344	SF	0	SF				N/A	N/A	N/A
1	B	Custodial Storage Room	N/A	Brick Wall		Non Suspect ACM	2000	SF	0	SF				N/A	N/A	N/A
1	B	Custodial Staff Restroom	N/A	Concrete Ceiling		Non Suspect ACM	228	SF	0	SF				N/A	N/A	N/A
1	B	Custodial Staff Restroom	N/A	Cement Floor		Non Suspect ACM	228	SF	0	SF				N/A	N/A	N/A
1	B	Custodial Staff Restroom	N/A	Brick Wall		Non Suspect ACM	400	SF	0	SF				N/A	N/A	N/A
1	B	Basement Storage Room	N/A	Ceiling Tile 1' x 1'		NAD	1344	SF	0	SF				N/A	N/A	N/A
1	B	Basement Storage Room	M	Floor Tile VAT 12" x 12"	2000/01/0B/XX	Assumed	1344	SF	0	SF	Tan			1	No	1/D
1	B	Basement Storage Room	N/A	Cement Floor		Non Suspect ACM	1344	SF	0	SF				N/A	N/A	N/A
1	B	Basement Mechanical Room	N/A	Concrete Ceiling		Non Suspect ACM	170	SF	0	SF				N/A	N/A	N/A
1	B	Basement Mechanical Room	N/A	Brick Wall		Non Suspect ACM	1000	SF	0	SF				N/A	N/A	N/A
1	B	Basement Mechanical Room	N/A	Duct Work		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A
1	B	Basement Mechanical Room	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	10	SF	0	SF				N/A	N/A	N/A
1	B	Basement Mechanical Room	N/A	Fiberglass Pipe Fitting Insulation		Non Suspect ACM	6	SF	0	SF				N/A	N/A	N/A
1	B	Boy's Locker Room	N/A	Cement Floor		Non Suspect ACM	4000	SF	0	SF				N/A	N/A	N/A
1	B	Boy's Locker Room	N/A	Concrete Ceiling		Non Suspect ACM	4000	SF	0	SF				N/A	N/A	N/A
1	B	Boy's Locker Room	N/A	Brick Wall		Non Suspect ACM	5000	SF	0	SF				N/A	N/A	N/A
1	B	Boy's Locker Room	N/A	Ceramic Tile Walls		Non Suspect ACM	2500	SF	0	SF				N/A	N/A	N/A
1	B	Boy's Locker Room	N/A	Ceramic Tile Floors		Non Suspect ACM	347	SF	0	SF				N/A	N/A	N/A
1	B	Boy's Locker Room Storage	N/A	Concrete Ceiling		Non Suspect ACM	450	SF	0	SF				N/A	N/A	N/A
1	B	Boy's Locker Room Storage	N/A	Cement Floor		Non Suspect ACM	450	SF	0	SF				N/A	N/A	N/A
1	B	Boy's Locker Room Storage	N/A	Brick Wall		Non Suspect ACM	800	SF	0	SF				N/A	N/A	N/A
1	B	Boy's Shower	N/A	Cement Floor		Non Suspect ACM	4000	SF	0	SF				N/A	N/A	N/A
1	B	Boy's Shower	N/A	Concrete Ceiling		Non Suspect ACM	4000	SF	0	SF				N/A	N/A	N/A
1	B	Boy's Shower	N/A	Brick Wall		Non Suspect ACM	5000	SF	0	SF				N/A	N/A	N/A
1	B	Boy's Shower	N/A	Ceramic Tile Walls		Non Suspect ACM	2500	SF	0	SF				N/A	N/A	N/A
1	B	Boy's Shower	N/A	Ceramic Tile Floors		Non Suspect ACM	347	SF	0	SF				N/A	N/A	N/A
1	B	Boy's Locker Restroom	N/A	Cement Floor		Non Suspect ACM	300	SF	0	SF				N/A	N/A	N/A
1	B	Boy's Locker Restroom	N/A	Concrete Ceiling		Non Suspect ACM	550	SF	0	SF				N/A	N/A	N/A
1	B	Boy's Locker Restroom	N/A	Brick Wall		Non Suspect ACM	500	SF	0	SF				N/A	N/A	N/A
1	B	Boy's Locker Restroom	N/A	Ceramic Tile Walls		Non Suspect ACM	500	SF	0	SF				N/A	N/A	N/A
1	B	Boy's Locker Restroom	N/A	Ceramic Tile Floors		Non Suspect ACM	250	SF	0	SF				N/A	N/A	N/A
1	B	Boy's Locker Room Visitor	N/A	Cement Floor		Non Suspect ACM	300	SF	0	SF				N/A	N/A	N/A
1	B	Boy's Locker Room Visitor	N/A	Concrete Ceiling		Non Suspect ACM	540	SF	0	SF				N/A	N/A	N/A
1	B	Boy's Locker Room Visitor	N/A	Brick Wall		Non Suspect ACM	1000	SF	0	SF				N/A	N/A	N/A
1	B	Boy's Locker Room Visitor	N/A	Ceramic Tile Walls		Non Suspect ACM	1000	SF	0	SF				N/A	N/A	N/A
1	B	Boy's Locker Room Visitor	N/A	Ceramic Tile Floors		Non Suspect ACM	240	SF	0	SF				N/A	N/A	N/A
1	B	Boy's Locker Room Visitor	N/A	Cement Floor		Non Suspect ACM	300	SF	0	SF				N/A	N/A	N/A
1	B	Boy's Locker Room Visitor	N/A	Concrete Ceiling		Non Suspect ACM	540	SF	0	SF				N/A	N/A	N/A

2000 South Phila HS 2015-2016 AHERA Three-Year Report.xls

School District of Philadelphia South Philadelphia High School 2021 South Broad Street, Philadelphia, PA 19148 ULCS#2000 Year Built: 1957		AHERA Three-Year Reinspection 2015-2016 Room by Room Location Log Report										Reinspection Date: October 29-November 13, 2015 Building Inspector: Norman Harrison Number: ACC-0915-6-011 Management Planner: Megan Vala Number: 740728				
E l e m e n t	F l o o r	On-Site Room Name	System Affected	Material Description	HID#	Confirmed/Assumed/NAD Non Suspect ACM	Amount of Material	(SF/LF/EA)	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic/ Crawl Space Ranking	Damage Potential (DP)	Newly Friable (NF)	Response Action (RA)
1	B	Boy's Locker Room Visitor	N/A	Brick Wall		Non Suspect ACM	1000	SF	0	SF				N/A	N/A	N/A
1	B	Boy's Locker Room Visitor	N/A	Ceramic Tile Walls		Non Suspect ACM	1000	SF	0	SF				N/A	N/A	N/A
1	B	Boy's Locker Room Visitor	N/A	Ceramic Tile Floors		Non Suspect ACM	240	SF	0	SF				N/A	N/A	N/A
1	B	Boy's Shower Visitor	N/A	Cement Floor		Non Suspect ACM	4000	SF	0	SF				N/A	N/A	N/A
1	B	Boy's Shower Visitor	N/A	Concrete Ceiling		Non Suspect ACM	4000	SF	0	SF				N/A	N/A	N/A
1	B	Boy's Shower Visitor	N/A	Brick Wall		Non Suspect ACM	5000	SF	0	SF				N/A	N/A	N/A
1	B	Boy's Shower Visitor	N/A	Ceramic Tile Walls		Non Suspect ACM	2500	SF	0	SF				N/A	N/A	N/A
1	B	Boy's Shower Visitor	N/A	Ceramic Tile Floors		Non Suspect ACM	347	SF	0	SF				N/A	N/A	N/A
1	B	Boy's Shower Visitor	N/A	Cement Floor		Non Suspect ACM	4000	SF	0	SF				N/A	N/A	N/A
1	B	Boy's Shower Visitor	N/A	Concrete Ceiling		Non Suspect ACM	4000	SF	0	SF				N/A	N/A	N/A
1	B	Boy's Shower Visitor	N/A	Brick Wall		Non Suspect ACM	5000	SF	0	SF				N/A	N/A	N/A
1	B	Boy's Shower Visitor	N/A	Ceramic Tile Walls		Non Suspect ACM	2500	SF	0	SF				N/A	N/A	N/A
1	B	Boy's Shower Visitor	N/A	Ceramic Tile Floors		Non Suspect ACM	347	SF	0	SF				N/A	N/A	N/A
1	B	Boy's Locker Restroom Visitor	N/A	Cement Floor		Non Suspect ACM	300	SF	0	SF				N/A	N/A	N/A
1	B	Boy's Locker Restroom Visitor	N/A	Concrete Ceiling		Non Suspect ACM	550	SF	0	SF				N/A	N/A	N/A
1	B	Boy's Locker Restroom Visitor	N/A	Brick Wall		Non Suspect ACM	500	SF	0	SF				N/A	N/A	N/A
1	B	Boy's Locker Restroom Visitor	N/A	Ceramic Tile Walls		Non Suspect ACM	500	SF	0	SF				N/A	N/A	N/A
1	B	Boy's Locker Restroom Visitor	N/A	Ceramic Tile Floors		Non Suspect ACM	250	SF	0	SF				N/A	N/A	N/A
1	B	Boy's Locker Restroom Visitor	N/A	Cement Floor		Non Suspect ACM	300	SF	0	SF				N/A	N/A	N/A
1	B	Boy's Locker Restroom Visitor	N/A	Concrete Ceiling		Non Suspect ACM	550	SF	0	SF				N/A	N/A	N/A
1	B	Boy's Locker Restroom Visitor	N/A	Brick Wall		Non Suspect ACM	500	SF	0	SF				N/A	N/A	N/A
1	B	Boy's Locker Restroom Visitor	N/A	Ceramic Tile Walls		Non Suspect ACM	500	SF	0	SF				N/A	N/A	N/A
1	B	Boy's Locker Restroom Visitor	N/A	Ceramic Tile Floors		Non Suspect ACM	250	SF	0	SF				N/A	N/A	N/A
1	B	Girl's Locker Room	N/A	Cement Floor		Non Suspect ACM	4000	SF	0	SF				N/A	N/A	N/A
1	B	Girl's Locker Room	N/A	Concrete Ceiling		Non Suspect ACM	4000	SF	0	SF				N/A	N/A	N/A
1	B	Girl's Locker Room	N/A	Brick Wall		Non Suspect ACM	5000	SF	0	SF				N/A	N/A	N/A
1	B	Girl's Locker Room	N/A	Ceramic Tile Walls		Non Suspect ACM	2500	SF	0	SF				N/A	N/A	N/A
1	B	Girl's Locker Room	N/A	Ceramic Tile Floors		Non Suspect ACM	347	SF	0	SF				N/A	N/A	N/A
1	B	Girl's Shower	N/A	Cement Floor		Non Suspect ACM	4000	SF	0	SF				N/A	N/A	N/A
1	B	Girl's Shower	N/A	Concrete Ceiling		Non Suspect ACM	4000	SF	0	SF				N/A	N/A	N/A
1	B	Girl's Shower	N/A	Brick Wall		Non Suspect ACM	5000	SF	0	SF				N/A	N/A	N/A
1	B	Girl's Shower	N/A	Ceramic Tile Walls		Non Suspect ACM	2500	SF	0	SF				N/A	N/A	N/A
1	B	Girl's Shower	N/A	Ceramic Tile Floors		Non Suspect ACM	347	SF	0	SF				N/A	N/A	N/A
1	B	Girl's Locker Room Storage	N/A	Concrete Ceiling		Non Suspect ACM	450	SF	0	SF				N/A	N/A	N/A
1	B	Girl's Locker Room Storage	N/A	Cement Floor		Non Suspect ACM	450	SF	0	SF				N/A	N/A	N/A
1	B	Girl's Locker Room Storage	N/A	Brick Wall		Non Suspect ACM	800	SF	0	SF				N/A	N/A	N/A
1	B	Girl's Locker Restroom	N/A	Cement Floor		Non Suspect ACM	300	SF	0	SF				N/A	N/A	N/A
1	B	Girl's Locker Restroom	N/A	Concrete Ceiling		Non Suspect ACM	550	SF	0	SF				N/A	N/A	N/A
1	B	Girl's Locker Restroom	N/A	Brick Wall		Non Suspect ACM	500	SF	0	SF				N/A	N/A	N/A
1	B	Girl's Locker Restroom	N/A	Ceramic Tile Walls		Non Suspect ACM	500	SF	0	SF				N/A	N/A	N/A
1	B	Girl's Locker Restroom	N/A	Ceramic Tile Floors		Non Suspect ACM	250	SF	0	SF				N/A	N/A	N/A
1	B	Girl's Locker Room Visitor	N/A	Cement Floor		Non Suspect ACM	300	SF	0	SF				N/A	N/A	N/A
1	B	Girl's Locker Room Visitor	N/A	Concrete Ceiling		Non Suspect ACM	540	SF	0	SF				N/A	N/A	N/A
1	B	Girl's Locker Room Visitor	N/A	Brick Wall		Non Suspect ACM	1000	SF	0	SF				N/A	N/A	N/A
1	B	Girl's Locker Room Visitor	N/A	Ceramic Tile Walls		Non Suspect ACM	1000	SF	0	SF				N/A	N/A	N/A
1	B	Girl's Locker Room Visitor	N/A	Ceramic Tile Floors		Non Suspect ACM	240	SF	0	SF				N/A	N/A	N/A
1	B	Girl's Locker Room Visitor	N/A	Cement Floor		Non Suspect ACM	300	SF	0	SF				N/A	N/A	N/A
1	B	Girl's Locker Room Visitor	N/A	Concrete Ceiling		Non Suspect ACM	540	SF	0	SF				N/A	N/A	N/A
1	B	Girl's Locker Room Visitor	N/A	Brick Wall		Non Suspect ACM	1000	SF	0	SF				N/A	N/A	N/A
1	B	Girl's Locker Room Visitor	N/A	Ceramic Tile Walls		Non Suspect ACM	1000	SF	0	SF				N/A	N/A	N/A
1	B	Girl's Locker Room Visitor	N/A	Ceramic Tile Floors		Non Suspect ACM	240	SF	0	SF				N/A	N/A	N/A
1	B	Girl's Shower Visitor	N/A	Cement Floor		Non Suspect ACM	4000	SF	0	SF				N/A	N/A	N/A
1	B	Girl's Shower Visitor	N/A	Concrete Ceiling		Non Suspect ACM	4000	SF	0	SF				N/A	N/A	N/A
1	B	Girl's Shower Visitor	N/A	Brick Wall		Non Suspect ACM	5000	SF	0	SF				N/A	N/A	N/A
1	B	Girl's Shower Visitor	N/A	Ceramic Tile Walls		Non Suspect ACM	2500	SF	0	SF				N/A	N/A	N/A
1	B	Girl's Shower Visitor	N/A	Ceramic Tile Floors		Non Suspect ACM	347	SF	0	SF				N/A	N/A	N/A
1	B	Girl's Shower Visitor	N/A	Cement Floor		Non Suspect ACM	4000	SF	0	SF				N/A	N/A	N/A
1	B	Girl's Shower Visitor	N/A	Concrete Ceiling		Non Suspect ACM	4000	SF	0	SF				N/A	N/A	N/A
1	B	Girl's Shower Visitor	N/A	Brick Wall		Non Suspect ACM	5000	SF	0	SF				N/A	N/A	N/A
1	B	Girl's Shower Visitor	N/A	Ceramic Tile Walls		Non Suspect ACM	2500	SF	0	SF				N/A	N/A	N/A
1	B	Girl's Shower Visitor	N/A	Ceramic Tile Floors		Non Suspect ACM	347	SF	0	SF				N/A	N/A	N/A
1	B	Girl's Locker Restroom Visitor	N/A	Cement Floor		Non Suspect ACM	300	SF	0	SF				N/A	N/A	N/A
1	B	Girl's Locker Restroom Visitor	N/A	Concrete Ceiling		Non Suspect ACM	550	SF	0	SF				N/A	N/A	N/A
1	B	Girl's Locker Restroom Visitor	N/A	Brick Wall		Non Suspect ACM	500	SF	0	SF				N/A	N/A	N/A
1	B	Girl's Locker Restroom Visitor	N/A	Ceramic Tile Walls		Non Suspect ACM	500	SF	0	SF				N/A	N/A	N/A
1	B	Girl's Locker Restroom Visitor	N/A	Ceramic Tile Floors		Non Suspect ACM	250	SF	0	SF				N/A	N/A	N/A
1	B	Weight Room	N/A	Wood Floor		Non Suspect ACM	2870	SF	0	SF				N/A	N/A	N/A

2000 South Phila HS 2015-2016 AHERA Three-Year Report.xls

Element		Floor		School District of Philadelphia South Philadelphia High School 2021 South Broad Street, Philadelphia, PA 19148 ULCS#2000 Year Built: 1957		AHERA Three-Year Reinspection 2015-2016 Room by Room Location Log Report										Reinspection Date: October 29-November 13, 2015																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																	
																Building Inspector: Norman Harrison																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																	
																					Number: ACC-0915-6-011																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																												
					Management Planner: Megan Vala																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																												
					Number: 740728																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																																												

2000 South Phila HS 2015-2016 AHERA Three-Year Report.xls

School District of Philadelphia South Philadelphia High School 2021 South Broad Street, Philadelphia, PA 19148 ULCS#2000 Year Built: 1957		AHERA Three-Year Reinspection 2015-2016 Room by Room Location Log Report										Reinspection Date: October 29-November 13, 2015 Building Inspector: Norman Harrison Number: ACC-0915-6-011 Management Planner: Megan Vala Number: 740728				
E l e m e n t	F l o o r	On-Site Room Name	System Affected	Material Description	HID#	Confirmed/Assumed/NAD Non Suspect ACM	Amount of Material	(SF/LF/EA)	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic/ Crawl Space Ranking	Damage Potential (DP)	Newly Friable (NF)	Response Action (RA)
1	B	Right Restroom inside Computer Manufacturing Classroom	N/A	Ceiling Tile 1' x 1'		NAD	36	SF	0	SF				N/A	N/A	N/A
1	B	Right Restroom inside Computer Manufacturing Classroom	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	25	LF	0	LF				N/A	N/A	N/A
1	B	Right Restroom inside Computer Manufacturing Classroom	N/A	Pipe Fitting Insulation		NAD	10	EA	0	EA				N/A	N/A	N/A
1	B	Right Restroom inside Computer Manufacturing Classroom	M	Transite Sills	2000/01/0B/SYN/BB/2300	Assumed	5	SF	0	SF		Window Sills		1	No	1/D
1	B	Computer Lab Classroom	M	Floor Tile VAT 12" x 12"	2000/01/0B/XX	Assumed	700	SF	0	SF	Tan			1	No	1/D
1	B	Computer Lab Classroom	N/A	Concrete Block Wall		Non Suspect ACM	1050	SF	0	SF				N/A	N/A	N/A
1	B	Computer Lab Classroom	M	Sheetrock Wall	2000/01/0B/SYN/BB/2100	Assumed	1050	SF	0	SF				1	No	1/D
1	B	Computer Lab Classroom	N/A	Ceiling Tile 1' x 1'		NAD	700	SF	0	SF				N/A	N/A	N/A
1	B	Computer Lab Classroom	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	50	LF	0	LF				N/A	N/A	N/A
1	B	Computer Lab Classroom	N/A	Pipe Fitting Insulation		NAD	7	EA	0	EA				N/A	N/A	N/A
1	B	Computer Lab Classroom	M	Transite Sills	2000/01/0B/SYN/BB/2300	Assumed	20	SF	0	SF		Window Sills		1	No	1/D
1	B	Vocational Technical Classroom	M	Floor Tile VAT 9" x 9"	2000/01/0B/07	Confirmed	1600	SF	0	SF	Red			1	No	1/D
1	B	Vocational Technical Classroom	N/A	Concrete Block Wall		Non Suspect ACM	2500	SF	0	SF				N/A	N/A	N/A
1	B	Vocational Technical Classroom	M	Sheetrock Wall	2000/01/0B/SYN/BB/2100	Assumed	2500	SF	0	SF				1	No	1/D
1	B	Vocational Technical Classroom	N/A	Ceiling Tile 1' x 1'		NAD	1600	SF	0	SF				N/A	N/A	N/A
1	B	Vocational Technical Classroom	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	85	LF	0	LF				N/A	N/A	N/A
1	B	Vocational Technical Classroom	N/A	Pipe Fitting Insulation		NAD	18	EA	0	EA				N/A	N/A	N/A
1	B	Vocational Technical Classroom	M	Transite Sills	2000/01/0B/SYN/BB/2300	Assumed	35	SF	0	SF		Window Sills		1	No	1/D
1	B	Storage Room across from Vocational Technical Classroom	N/A	Cement Floor		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A
1	B	Storage Room across from Vocational Technical Classroom	N/A	Concrete Block Wall		Non Suspect ACM	600	SF	0	SF				N/A	N/A	N/A
1	B	Storage Room across from Vocational Technical Classroom	N/A	Concrete Ceiling		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A
1	B	x	X	X	X	X	X	X	X	X		No Access - Need on site room name		X	X	X
1	B	x	X	X	X	X	X	X	X	X		No Access - Need on site room name		X	X	X
1	B	x	X	X	X	X	X	X	X	X		No Access - Need on site room name		X	X	X
1	B	Storage Room next to Stairwell # 2	N/A	Cement Floor		Non Suspect ACM	100	SF	0	SF				N/A	N/A	N/A
1	B	Storage Room next to Stairwell # 2	N/A	Concrete Block Wall		Non Suspect ACM	300	SF	0	SF				N/A	N/A	N/A
1	B	Storage Room next to Stairwell # 2	N/A	Concrete Ceiling		Non Suspect ACM	100	SF	0	SF				N/A	N/A	N/A
1	B	Storage Room next to Stairwell # 2	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	40	LF	0	LF				N/A	N/A	N/A
1	B	Storage Room next to Stairwell # 2	N/A	Pipe Fitting Insulation		NAD	6	EA	0	EA				N/A	N/A	N/A
1	B	Storage Room next to Stairwell # 2	M	Vibration Dampener Cloth	2000/01/0B/12	Assumed	2	SF	0	SF				1	No	1/D
1	B	Stairwell # 2	M	Floor Tile VAT 9" x 9"	2000/01/0B/07	Confirmed	200	SF	0	SF	Black			1	No	1/D
1	B	Stairwell # 2	N/A	Concrete Block Wall		Non Suspect ACM	600	SF	0	SF				N/A	N/A	N/A
1	B	Stairwell # 2	N/A	Concrete Ceiling		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A
1	B	Stairwell # 2	M	Transite Sills	2000/01/0B/SYN/BB/2300	Assumed	2	SF	0	SF		Fire Extinguisher Sill		1	No	1/D
1	B	Boy's Restroom across from Cafeteria	N/A	Cement Floor		Non Suspect ACM	300	SF	0	SF				N/A	N/A	N/A
1	B	Boy's Restroom across from Cafeteria	N/A	Concrete Block Wall		Non Suspect ACM	900	SF	0	SF				N/A	N/A	N/A
1	B	Boy's Restroom across from Cafeteria	N/A	Concrete Ceiling		Non Suspect ACM	300	SF	0	SF				N/A	N/A	N/A
1	B	Boy's Restroom across from Cafeteria	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	35	LF	0	LF				N/A	N/A	N/A
1	B	Boy's Restroom across from Cafeteria	N/A	Pipe Fitting Insulation		NAD	2	EA	0	EA				N/A	N/A	N/A
1	B	Boy's Locker Room across from Cafeteria	N/A	Cement Floor		Non Suspect ACM	120	SF	0	SF				N/A	N/A	N/A
1	B	Boy's Locker Room across from Cafeteria	N/A	Concrete Block Wall		Non Suspect ACM	360	SF	0	SF				N/A	N/A	N/A
1	B	Boy's Locker Room across from Cafeteria	N/A	Concrete Ceiling		Non Suspect ACM	120	SF	0	SF				N/A	N/A	N/A
1	B	Girl's Locker Room across from Cafeteria	N/A	Cement Floor		Non Suspect ACM	120	SF	0	SF				N/A	N/A	N/A
1	B	Girl's Locker Room across from Cafeteria	N/A	Concrete Block Wall		Non Suspect ACM	360	SF	0	SF				N/A	N/A	N/A
1	B	Girl's Locker Room across from Cafeteria	N/A	Concrete Ceiling		Non Suspect ACM	120	SF	0	SF				N/A	N/A	N/A
1	B	Girl's Locker Room across from Cafeteria	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	40	LF	0	LF				N/A	N/A	N/A
1	B	Girl's Restroom between Locker Rooms across from Cafeteria	N/A	Cement Floor		Non Suspect ACM	300	SF	0	SF				N/A	N/A	N/A
1	B	Girl's Restroom between Locker Rooms across from Cafeteria	N/A	Concrete Block Wall		Non Suspect ACM	900	SF	0	SF				N/A	N/A	N/A
1	B	Girl's Restroom between Locker Rooms across from Cafeteria	N/A	Concrete Ceiling		Non Suspect ACM	300	SF	0	SF				N/A	N/A	N/A
1	B	Girl's Restroom next to Elevator # 2 across from Cafeteria	N/A	Cement Floor		Non Suspect ACM	300	SF	0	SF				N/A	N/A	N/A
1	B	Girl's Restroom next to Elevator # 2 across from Cafeteria	N/A	Concrete Block Wall		Non Suspect ACM	900	SF	0	SF				N/A	N/A	N/A
1	B	Girl's Restroom next to Elevator # 2 across from Cafeteria	N/A	Concrete Ceiling		Non Suspect ACM	300	SF	0	SF				N/A	N/A	N/A
1	B	Girl's Restroom next to Elevator # 2 across from Cafeteria	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	30	LF	0	LF				N/A	N/A	N/A
1	B	Girl's Restroom next to Elevator # 2 across from Cafeteria	N/A	Pipe Fitting Insulation		NAD	5	EA	0	EA				N/A	N/A	N/A
1	B	Building Engineer's Hideaway Office behind Elevator # 2	N/A	Cement Floor		Non Suspect ACM	150	SF	0	SF				N/A	N/A	N/A
1	B	Building Engineer's Hideaway Office behind Elevator # 2	N/A	Concrete Block Wall		Non Suspect ACM	450	SF	0	SF				N/A	N/A	N/A
1	B	Building Engineer's Hideaway Office behind Elevator # 2	N/A	Concrete Ceiling		Non Suspect ACM	150	SF	0	SF				N/A	N/A	N/A
1	B	Building Engineer's Hideaway Office behind Elevator # 2	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	50	LF	0	LF				N/A	N/A	N/A
1	B	Building Engineer's Hideaway Office behind Elevator # 2	N/A	Pipe Fitting Insulation		NAD	7	EA	0	EA				N/A	N/A	N/A
1	B	Cafeteria	M	Floor Tile VAT 12" x 12"	2000/01/0B/XX	Assumed	11,865	SF	0	SF	Multi	Beige 12x12 Tiles are Confirmed-sampled April 1994 - Beige, White, Green (BJB)		1	No	1/D
1	B	Cafeteria	S	Acoustical Plaster Ceiling	2000/01/0B/SYN/BB/2101	Assumed	6000	SF	0	SF		Textured Ceiling Treatment		1	No	1/D
1	B	Cafeteria	N/A	Ceiling Tile 1' x 1'		NAD	5865	SF	0	SF				N/A	N/A	N/A

2000 South Phila HS 2015-2016 AHERA Three-Year Report.xls

School District of Philadelphia South Philadelphia High School 2021 South Broad Street, Philadelphia, PA 19148 ULCS#2000 Year Built: 1957		AHERA Three-Year Reinspection 2015-2016 Room by Room Location Log Report										Reinspection Date: October 29-November 13, 2015 Building Inspector: Norman Harrison Number: ACC-0915-6-011 Management Planner: Megan Vala Number: 740728				
E l e m e n t	F l o o r	On-Site Room Name	System Affected	Material Description	HID#	Confirmed/Assumed/NAD Non Suspect ACM	Amount of Material	(SF/LF/EA)	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic/ Crawl Space Ranking	Damage Potential (DP)	Newly Friable (NF)	Response Action (RA)
1	B	Cafeteria	N/A	Brick Wall		Non Suspect ACM	10000	SF	0	SF				N/A	N/A	N/A
1	B	Nursing Program	M	Floor Tile VAT 9" x 9"	2000/01/0B/07	Confirmed	1100	SF	0	SF	Multi			1	No	1/D
1	B	Nursing Program	N/A	Ceiling Tile 1' x 1'		NAD	1100	SF	0	SF				N/A	N/A	N/A
1	B	Nursing Program	N/A	Brick Wall		Non Suspect ACM	2000	SF	0	SF				N/A	N/A	N/A
1	B	Nursing Program Restroom	M	Floor Tile VAT 9" x 9"	2000/01/0B/07	Confirmed	240	SF	0	SF	Multi			1	No	1/D
1	B	Nursing Program Restroom	N/A	Ceiling Tile 1' x 1'		NAD	240	SF	0	SF				N/A	N/A	N/A
1	B	Nursing Program Restroom	N/A	Brick Wall		Non Suspect ACM	400	SF	0	SF				N/A	N/A	N/A
1	B	Nursing Program Restroom	M	Floor Tile VAT 9" x 9"	2000/01/0B/07	Confirmed	150	SF	0	SF	Multi			1	No	1/D
1	B	Nursing Program Restroom	N/A	Ceiling Tile 1' x 1'		NAD	150	SF	0	SF				N/A	N/A	N/A
1	B	Nursing Program Restroom	N/A	Brick Wall		Non Suspect ACM	400	SF	0	SF				N/A	N/A	N/A
1	B	Kitchen	N/A	Ceramic Tile Floors		Non Suspect ACM	400	SF	0	SF				N/A	N/A	N/A
1	B	Kitchen	N/A	Concrete Ceiling		Non Suspect ACM	444	SF	0	SF				N/A	N/A	N/A
1	B	Kitchen	M	Floor Tile VAT 12" x 12"	2000/01/0B/XX	Assumed	44	SF	0	SF	Green			1	No	1/D
1	B	Kitchen	N/A	Ceramic Tile Walls		Non Suspect ACM	1000	SF	0	SF				N/A	N/A	N/A
1	B	Kitchen Office	M	Floor Tile VAT 12" x 12"	2000/01/0B/XX	Assumed	200	SF	0	SF	Tan			1	No	1/D
1	B	Kitchen Office	N/A	Concrete Block Wall		Non Suspect ACM	600	SF	0	SF				N/A	N/A	N/A
1	B	Kitchen Office	N/A	Concrete Ceiling		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A
1	B	Kitchen Office	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	16	LF	0	LF				N/A	N/A	N/A
1	B	Mechanical Room next to Kitchen Office	N/A	Cement Floor		Non Suspect ACM	40	SF	0	SF				N/A	N/A	N/A
1	B	Mechanical Room next to Kitchen Office	N/A	Concrete Block Wall		Non Suspect ACM	120	SF	0	SF				N/A	N/A	N/A
1	B	Mechanical Room next to Kitchen Office	N/A	Concrete Ceiling		Non Suspect ACM	40	SF	0	SF				N/A	N/A	N/A
1	B	Mechanical Room next to Kitchen Office	M	Vibration Damper Cloth	2000/01/0B/12	Assumed	1	SF	0	SF				1	No	1/D
1	B	Mechanical Room next to Kitchen Office	N/A	Neoprene Pipe Insulation		Non Suspect ACM	15	LF	0	LF				N/A	N/A	N/A
1	B	Kitchen Office Restroom	M	Floor Tile VAT 12" x 12"	2000/01/0B/XX	Assumed	100	SF	0	SF	Tan			1	No	1/D
1	B	Kitchen Office Restroom	N/A	Concrete Block Wall		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A
1	B	Kitchen Office Restroom	M	Sheetrock Wall	2000/01/0B/SYN/BB/2100	Assumed	100	SF	0	SF				1	No	1/D
1	B	Kitchen Office Restroom	N/A	Concrete Ceiling		Non Suspect ACM	100	SF	0	SF				N/A	N/A	N/A
1	B	Health Room Classroom	M	Floor Tile VAT 12" x 12"	2000/01/0B/XX	Assumed	1000	SF	0	SF	Tan			1	No	1/D
1	B	Health Room Classroom	N/A	Concrete Block Wall		Non Suspect ACM	3000	SF	0	SF				N/A	N/A	N/A
1	B	Health Room Classroom	M	Sheetrock Wall	2000/01/0B/SYN/BB/2100	Assumed	350	SF	0	SF				1	No	1/D
1	B	Health Room Classroom	N/A	Concrete Ceiling		Non Suspect ACM	1000	SF	0	SF				N/A	N/A	N/A
1	B	Health Room Classroom	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	4	LF	0	LF				N/A	N/A	N/A
1	B	Health Room Classroom	M	Transite Sills	2000/01/0B/SYN/BB/2300	Assumed	25	SF	0	SF		Window Sills		1	No	1/D
1	B	Health Room Classroom Restroom Entrance Vestibule	M	Floor Tile VAT 9" x 9"	2000/01/0B/07	Confirmed	80	SF	0	SF	Multi			1	No	1/D
1	B	Health Room Classroom Restroom Entrance Vestibule	N/A	Concrete Block Wall		Non Suspect ACM	240	SF	0	SF				N/A	N/A	N/A
1	B	Health Room Classroom Restroom Entrance Vestibule	N/A	Concrete Ceiling		Non Suspect ACM	80	SF	0	SF				N/A	N/A	N/A
1	B	Health Room Classroom Restroom	M	Floor Tile VAT 9" x 9"	2000/01/0B/07	Confirmed	25	SF	0	SF	Multi			1	No	1/D
1	B	Health Room Classroom Restroom	N/A	Concrete Block Wall		Non Suspect ACM	75	SF	0	SF				N/A	N/A	N/A
1	B	Health Room Classroom Restroom	N/A	Concrete Ceiling		Non Suspect ACM	25	SF	0	SF				N/A	N/A	N/A
1	B	Health Room Classroom Restroom	N/A	Ceramic Tile Walls		Non Suspect ACM	25	SF	0	SF				N/A	N/A	N/A
1	B	Janitor's Closet outside of Cafeteria	N/A	Cement Floor		Non Suspect ACM	20	SF	0	SF				N/A	N/A	N/A
1	B	Janitor's Closet outside of Cafeteria	N/A	Concrete Block Wall		Non Suspect ACM	80	SF	0	SF				N/A	N/A	N/A
1	B	Janitor's Closet outside of Cafeteria	N/A	Concrete Ceiling		Non Suspect ACM	20	SF	0	SF				N/A	N/A	N/A
1	B	Janitor's Closet outside of Cafeteria	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	20	LF	0	LF				N/A	N/A	N/A
1	B	Janitor's Closet outside of Cafeteria	N/A	Pipe Fitting Insulation		NAD	9	EA	0	EA				N/A	N/A	N/A
1	B	Storage Room next to Janitor's Closet outside of Cafeteria	N/A	Cement Floor		Non Suspect ACM	20	SF	0	SF				N/A	N/A	N/A
1	B	Storage Room next to Janitor's Closet outside of Cafeteria	N/A	Concrete Block Wall		Non Suspect ACM	80	SF	0	SF				N/A	N/A	N/A
1	B	Storage Room next to Janitor's Closet outside of Cafeteria	N/A	Concrete Ceiling		Non Suspect ACM	20	SF	0	SF				N/A	N/A	N/A
1	B	Storage Room next to Janitor's Closet outside of Cafeteria	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	20	LF	0	LF				N/A	N/A	N/A
1	B	Storage Room next to Janitor's Closet outside of Cafeteria	N/A	Pipe Fitting Insulation		NAD	6	EA	0	EA				N/A	N/A	N/A
1	B	Fan Room outside of Cafeteria	N/A	Cement Floor		Non Suspect ACM	100	SF	0	SF				N/A	N/A	N/A
1	B	Fan Room outside of Cafeteria	N/A	Concrete Block Wall		Non Suspect ACM	300	SF	0	SF				N/A	N/A	N/A
1	B	Fan Room outside of Cafeteria	N/A	Concrete Ceiling		Non Suspect ACM	100	SF	0	SF				N/A	N/A	N/A
1	B	Fan Room outside of Cafeteria	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	50	LF	0	LF				N/A	N/A	N/A
1	B	Fan Room outside of Cafeteria	N/A	Pipe Fitting Insulation		NAD	13	EA	0	EA				N/A	N/A	N/A
1	B	Fan Room outside of Cafeteria	N/A	Fiberglass Duct Insulation		Non Suspect ACM	60	SF	0	SF				N/A	N/A	N/A
1	B	Fan Room inside Cafeteria	N/A	Cement Floor		Non Suspect ACM	100	SF	0	SF				N/A	N/A	N/A
1	B	Fan Room inside Cafeteria	N/A	Concrete Block Wall		Non Suspect ACM	300	SF	0	SF				N/A	N/A	N/A
1	B	Fan Room inside Cafeteria	N/A	Concrete Ceiling		Non Suspect ACM	100	SF	0	SF				N/A	N/A	N/A
1	B	Fan Room inside Cafeteria	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	4	LF	0	LF				N/A	N/A	N/A
1	B	Fan Room inside Cafeteria	N/A	Pipe Fitting Insulation		NAD	3	EA	0	EA				N/A	N/A	N/A
1	B	Nursing Program Classroom	M	Floor Tile VAT 12" x 12"	2000/01/0B/XX	Assumed	1500	SF	0	SF	Tan			1	No	1/D
1	B	Nursing Program Classroom	N/A	Ceiling Tile 1' x 1'		NAD	1500	SF	0	SF				N/A	N/A	N/A
1	B	Nursing Program Classroom	N/A	Brick Wall		Non Suspect ACM	2500	SF	0	SF				N/A	N/A	N/A
1	B	Kitchen Cafeteria Office	N/A	Ceramic Tile Floors		Non Suspect ACM	150	SF	0	SF				N/A	N/A	N/A
1	B	Kitchen Cafeteria Office	N/A	Ceramic Tile Walls		Non Suspect ACM	400	SF	0	SF				N/A	N/A	N/A
1	B	Kitchen Cafeteria Office	N/A	Concrete Ceiling		Non Suspect ACM	150	SF	0	SF				N/A	N/A	N/A

2000 South Phila HS 2015-2016 AHERA Three-Year Report.xls

		School District of Philadelphia South Philadelphia High School 2021 South Broad Street, Philadelphia, PA 19148 ULCS#2000 Year Built: 1957	AHERA Three-Year Reinspection 2015-2016 Room by Room Location Log Report									Reinspection Date: October 29-November 13, 2015 Building Inspector: Norman Harrison Number: ACC-0915-6-011 Management Planner: Megan Vala Number: 740728				
E l e m e n t	F l o o r	On-Site Room Name	System Affected	Material Description	HID#	Confirmed/Assumed/NAD Non Suspect ACM	Amount of Material	(SF/LF/EA)	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic/ Crawl Space Ranking	Damage Potential (DP)	Newly Friable (NF)	Response Action (RA)
1	SB	Storage Room next to Boiler Room	N/A	Cement Floor		Non Suspect ACM	500	SF	0	SF				N/A	N/A	N/A
1	SB	Storage Room next to Boiler Room	N/A	Concrete Block Wall		Non Suspect ACM	1500	SF	0	SF				N/A	N/A	N/A
1	SB	Storage Room next to Boiler Room	N/A	Concrete Ceiling		Non Suspect ACM	500	SF	0	SF				N/A	N/A	N/A
1	SB	Storage Room next to Boiler Room	M	Fire Brick	2000/01/SB/SYN/BB/1610	Assumed	36	CF	0	CF		on skid - 3'x3'x4" high		1	No	1/D
1	SB	Tank Room	N/A	Cement Floor		Non Suspect ACM	5000	SF	0	SF				N/A	N/A	N/A
1	SB	Tank Room	N/A	Concrete Ceiling		Non Suspect ACM	1200	SF	0	SF				N/A	N/A	N/A
1	SB	Tank Room	N/A	Fiberglass Tank Insulation		Non Suspect ACM	250	SF	0	SF				N/A	N/A	N/A
1	SB	Tank Room	N/A	Brick Wall		Non Suspect ACM	2000	SF	0	SF				N/A	N/A	N/A
1	SB	Incinerator Room	N/A	Cement Floor		Non Suspect ACM	1200	SF	0	SF				N/A	N/A	N/A
1	SB	Incinerator Room	N/A	Concrete Ceiling		Non Suspect ACM	1200	SF	0	SF				N/A	N/A	N/A
1	SB	Incinerator Room	N/A	Brick Wall		Non Suspect ACM	2500	SF	0	SF				N/A	N/A	N/A
1	SB	Boiler Room	N/A	Cement Floor		Non Suspect ACM	6000	SF	0	SF				N/A	N/A	N/A
1	SB	Boiler Room	N/A	Concrete Ceiling		Non Suspect ACM	6000	SF	0	SF				N/A	N/A	N/A
1	SB	Boiler Room	N/A	Brick Wall		Non Suspect ACM	10000	SF	0	SF				N/A	N/A	N/A
1	SB	Boiler Room	N/A	Fiberglass Pipe Fitting Insulation		Non Suspect ACM	200	EA	0	EA				N/A	N/A	N/A
1	SB	Boiler Room	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	1000	LF	0	LF				N/A	N/A	N/A
1	SB	Boiler Room	N/A	Pipe Fitting Insulation		NAD	220	EA	0	EA				N/A	N/A	N/A
1	SB	Boiler Room	M	Brick Boilers	2000/01/SB/SYN/BB/1620	Assumed	2	EA	0	E		Offline; Obsolete		1	No	1/D
1	SB	Boiler Room	T	Sectional Boilers	2000/01/SB/SYN/BB/1621	Assumed	4	EA	0	E		H.B. Smith		1	No	1/D
1	SB	Boiler Room	M	Brick Incinerator	2000/01/SB/SYN/BB/1640	Assumed	1	EA	0	E		Offline; Obsolete		1	No	1/D
1	SB	Boiler Room	M	Transite Electrical Panel	2000/01/0B/SYN/BB/2350	Assumed	45	SF	0	SF		3 Panels - 15 SF Each		1	No	1/D
1	SB	Stairwell from Boiler Room up to 13th Street	N/A	Metal Grating Floors/Stairs		Non Suspect ACM	300	SF	0	SF				N/A	N/A	N/A
1	SB	Stairwell from Boiler Room up to 13th Street	N/A	Concrete Block Wall		Non Suspect ACM	900	SF	0	SF				N/A	N/A	N/A
1	SB	Stairwell from Boiler Room up to 13th Street	N/A	Concrete Ceiling		Non Suspect ACM	300	SF	0	SF				N/A	N/A	N/A
1	A	Auditorium Attic accessible on 3rd Floor Hallway	N/A	Pipe Fitting Insulation	X	NAD	X	X	X	X		Insulation in good condition. Sampled January 2010 approx. 11 SF VDC, ACPF @ boiler entrance panel	A	N/A	N/A	N/A
1	C	Crawlspace adjacent to Girl's Locker Room	X	X	X	X	X	X	X	X			C to B	x	x	x
1	PH	Penthouse accessible by Rooftop	X	Pipe Fitting Insulation	X	X	X	X	X	X		21 ACPF	B	x	x	x
1	A	Attic accessible by 3rd Floor Hallway	X	X	X	X	X	X	X	X		75 Hard Fittings/FG Piping	B	x	x	x
1	A	Attic accessible by 3rd Floor Storage Closet	X	X	X	X	X	X	X	X		Both CS & Attic have Water Leaks	E	x	x	x
1	C	Crawlspace under Basement adjacent to Ash Pit	X	X	X	X	X	X	X	X		H. Fittings, Saddle Mag, Visible Debris, FG Piping	D	x	x	x
1	C	Crawlspace under Basement adjacent to Boiler Room/Basement Hallway	X	X	X	X	X	X	X	X		Localized/Distributed Debris/Hard Fittings	D	x	x	x
1	C	Crawlspace under Basement adjacent to Boiler Room/Pump Area	X	X	X	X	X	X	X	X		Visible Localized Debris/Hard Fittings,	D	x	x	x
1	A	Attic adjacent to 3rd Floor Library	X	X	X	X	X	X	X	X		30 Hard Fittings	B	x	x	x

Section III Certificates

A. Management Planner/Building Inspector Certificates

Section III – A

Management Planner/Building Inspector Certificates

These charts indicate the Name, Course Date, Expiration Date and Corresponding Certificate Number of the Management Planner and Building Inspector of individuals that participated in the AHERA 3 Year Inspection and Management Plan process of 2015/2016.

Management Planner	Date Granted	Expiration Date	Certificate Number
Monique Causley	2/15/2015	2/16/2016	ACC-0215-8-010
Monique Causley	2/16/2016	2/17/2017	ACC-0216-8-001
Megan Vala	5/22/2015	6/22/2016	740728
Mary Anne Lerro	4/5/2016	4/5/2017	742327

Building Inspector	Date Granted	Expiration Date	Certificate Number
Scott Magee	8/15/2015	8/15/2016	70016699C
William Garrity	8/15/2015	8/15/2016	70016699A
Bernard Brunner	10/2/2015	8/2/2016	45397
Mary Anne Lerro	3/3/2015	3/3/2016	740092
Mary Anne Lerro	4/5/2016	4/5/2017	742322
James Madden	12/11/2014	12/11/2015	ACC-1214-6-010
James Madden	12/3/2015	12/3/2016	ACC-1215-6-018
Troy Ray	3/15/2015	3/19/2016	ACC-0355-6-011
Ananth Vinjamuri	9/29/2015	9/29/2016	374
Shelton Williams	9/29/2015	9/29/2016	375
Paul Davis	2/12/2015	2/12/2016	ACC-0215-6-015
Paul Davis	2/2/2016	2/2/2017	741836
Bernard Bryson	2/16/2015	2/16/2016	ACC-0125-6-031
Bernard Bryson	2/15/2016	2/15/2017	ACC-0216-6-005
Alexander Roman	9/18/2015	9/18/2016	EHSBIR-150619-008
Norm Harrison	9/2/2015	9/2/2016	ACC-0915-6-011
Kelly Mayberry	2/20/2015	2/20/2016	EHSBIR-150220-005
Kelly Mayberry	2/18/2016	2/18/2017	EHSBIR-160218-006
Andrew Hine	5/6/2015	5/6/2016	AI05042015-3
Maryellen Leotta	2/12/2015	2/12/2016	ACC-0215-6-024

Certificate of Completion

awarded to

Monique Causley

for successfully completing the prescribed course of study in

Pennsylvania Asbestos Management Planner Refresher Course

under TSCA Title II

presented by

ACCESS TRAINING SERVICES, INC.
7921 River Road, Pennsauken, NJ 08110
(856) 665-3449

2/16/15

Course Date

N/A

Exam Date

2/16/16

Expiration Date

Not Provided

Social Security Number

ACC-0215-8-010

Certificate Number

Mark K. Schlager
Training Director

Certificate of Completion

awarded to

Monique Causley

for successfully completing the prescribed course of study in

Pennsylvania Asbestos Management Planner Refresher Course

under TSCA Title II

presented by

**ACCESS TRAINING SERVICES, INC.
7921 River Road, Pennsauken, NJ 08110
(856) 665-3449**

2/15/16

Course Date

N/A

Exam Date

2/15/17

Expiration Date

Not Provided

Social Security Number

ACC-0216-8-001

Certificate Number

Mark K. Schlüger
Training Director

Certificate of Training

CRITERION LABORATORIES, INC.

HEREBY CERTIFIES THAT

Megan Vala

HAS SUCCESSFULLY COMPLETED A 16 HOUR COURSE ENTITLED

Asbestos Management Planner Initial

INCLUDING CLASSROOM INSTRUCTION

05/21/2015 to 05/22/2015


Exam passed on this 22nd day of May 2015 - Score - 94

Approved for AHERA Accreditation Under TSCA Title II

3370 Progress Drive, Suite J
Bensalem, PA 19020
(215) 244-1300 - Phone
(215) 244-4349 - Fax
www.criterionlabs.com

Course is conducted in English

DIRECTOR:


James A. Welte, CIH, President

Certificate of Training

CRITERION LABORATORIES, INC.

HEREBY CERTIFIES THAT

Mary Anne Lerro

HAS SUCCESSFULLY COMPLETED A 4 HOUR COURSE ENTITLED
Asbestos Management Planner Refresher

INCLUDING CLASSROOM INSTRUCTION

on this 5th day of April 2016

Approved for AHERA Accreditation Under TSCA Title II

3370 Progress Drive, Suite J
Bensalem, PA 19020
(215) 244-1300 - Phone
(215) 244-4349 - Fax
www.criterionlabs.com

Course is conducted in English

DIRECTOR:

James A. Welts
James A. Welts, CIH, President

EMSL ANALYTICAL, INC.

Certifies that

Scott Magee

has successfully completed the course of study for the

Asbestos Building Inspector Refresher Course for Accreditation under TSCA Title II

EMSL Certificate No. 70016699C

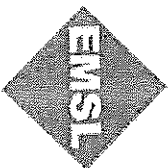
Approved by:

PA Dept. of Labor and Industry
Accreditation # 137

Course Date: 8/15/2015
Granted: 8/15/2015
Expiration Date: 8/15/2016

Sponsored by:

EMSL Analytical, Inc.
200 Route 130 North
Cinnaminson, NJ 08077
Phone: (800) 220-3675
Fax: (856) 786-5973
www.emsl.com



Michael P. Menz

Michael P. Menz, CIH
Training Director

Environmental, Mold, Bacteria, IAQ, Asbestos, Lead, Forensic and Materials Testing Since 1981

EMSL ANALYTICAL, INC.

Certifies that

William Garrity

has successfully completed the course of study for the

Asbestos Building Inspector Refresher Course

for Accreditation under TSCA Title II

EMSL Certificate No. 70016699A

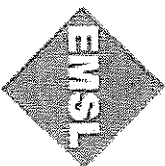
Approved by:

PA Dept. of Labor and Industry
Accreditation # 137

Course Date: 8/15/2015
Granted: 8/15/2015
Expiration Date: 8/15/2016

Sponsored by:

EMSL Analytical, Inc.
200 Route 130 North
Cinnaminson, NJ 08077
Phone: (800) 220-3675
Fax: (856) 786-5973
www.emsl.com



Michael P. Menz

Michael P. Menz, CIH
Training Director

Environmental, Mold, Bacteria, IAQ, Asbestos, Lead, Forensic and Materials Testing Since 1981

45397

National Asbestos & Environmental Training Institute

CERTIFICATE OF COMPLETION

AHERA/EPA Accredited Per 40 CFR Part 763
Asbestos Accreditation under TSCA Title II

This is to certify that

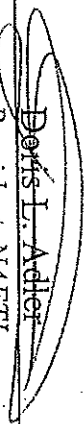
Bernard Brunner, Jr.

Successfully completed the course entitled

**1/2-Day New York State/EP A/AHERA Asbestos Building Inspector Annual Refresher on
October 2, 2015**

Examination Passed October 2, 2015

Expiration Date on October 2, 2016


Doris L. Adler
President, NAEETI

Per 10 NYCRR Part 73.2 (L) (1), DOH 2832 Certificate of Completion of Asbestos
Safety Training is the only official record of training for N.Y.S. students.

Language: English

ABIH 1/2 CM POINT

3321 Doris Avenue, Building B, Ocean, NJ 07712

Phone (732) 531-5571

Fax (732) 531-5956

www.naeti.com

Number 740092

Expiration Date:
03/03/2016

Certificate of Training

CRITERION LABORATORIES, INC.

HEREBY CERTIFIES THAT

Mary Anne Lerro

HAS SUCCESSFULLY COMPLETED A 4 HOUR COURSE ENTITLED

Asbestos Building Inspector Refresher

on this 3rd day of March 2015

Exam passed on this 3rd day of March 2015 - Score - 84

Approved for AHERA Accreditation Under TSCA Title II

3370 Progress Drive, Suite J
Bensalem, PA 19020
(215) 244-1300 - Phone
(215) 244-4349 - Fax
www.criterionlabs.com

Course is conducted in English

DIRECTOR:

James A. Welts

James A. Welts, CIH, President

Number 742322

Expiration Date:
04/05/2017

Certificate of Training

CRITERION LABORATORIES, INC.

HEREBY CERTIFIES THAT

Mary Anne Lerro

HAS SUCCESSFULLY COMPLETED A 4 HOUR COURSE ENTITLED

Asbestos Building Inspector Refresher

INCLUDING CLASSROOM INSTRUCTION

on this 5th day of April 2016

Exam passed on this 5th day of April 2016 - Score - 88

Approved for AHERA Accreditation Under TSCA Title II

3370 Progress Drive, Suite J
Bensalem, PA 19020
(215) 244-1300 - Phone
(215) 244-4349 - Fax
www.criterionlabs.com

Course is conducted in English

DIRECTOR:

James A. Wells

James A. Wells, CIH, President

Certificate of Completion

James Madden

for successfully completing the prescribed course of study in

Pennsylvania Asbestos Building Inspector Refresher Course

under TSCA Title II

presented by

ACCESS TRAINING SERVICES, INC.
7921 River Road, Pennsauken, NJ 08110
(856) 665-3449

12/11/14

Course Date

N/A

Exam Date

12/11/15


Expiration Date

Not Provided

Social Security Number

ACC-1214-6-010

Certificate Number


Mark K. Schlager
Training Director

Certificate of Completion

James Madden

for successfully completing the prescribed course of study in

Pennsylvania Asbestos Building Inspector Refresher Course

under TSCA Title II

presented by

ACCESS TRAINING SERVICES, INC.
7921 River Road, Pennsauken, NJ 08110
(856) 665-3449

12/3/15

Course Date

N/A

Exam Date

12/3/16

Expiration Date

Not Provided

Social Security Number

ACC-1215-6-018

Certificate Number

Mark K. Schlager
Training Director

Certificate of Completion

Troy A. Ray

for successfully completing the prescribed course of study in

Pennsylvania Asbestos Building Inspector Refresher Course

under TSCA Title II

presented by

**ACCESS TRAINING SERVICES, INC.
7921 River Road, Pennsauken, NJ 08110
(856) 665-3449**

3/19/15

Course Date

N/A

Exam Date

3/19/16

Expiration Date

Not Provided

Social Security Number

ACC-0355-6-011

Certificate Number

Mark K. Schlager
Training Director

CERTIFICATE NO 374

G&C Environmental Services, Inc. (#294)

2 Street Road, Newtown Square, Pennsylvania 19073

Telephone: (610) 993-9202 Facsimile: (610) 993-9232

Email: Training@gcenviro.com

www.GCenviro.com

This document certifies that Ananth K. Vinjamuri has successfully completed this

State of New York Department of Health Approved AHERA BUILDING INSPECTOR

REFRESHER COURSE, completed as required for asbestos accreditation under the Toxic

Substances Control Act, Title II. This course was held from 09/29/2015 to 09/29/2015.

The examination date was 09/29/2015. This certificate expires one year from the date of

successful completion of the examination 09/29/2016.

The official record of successful training completion is the New York State Department of Health certificate of asbestos safety training completion (DPH 2832).

Gail M. Conner
Training Director

Gail M. Conner

CERTIFICATE NO 375

G&C Environmental Services, Inc. (#294)

2 Street Road, Newtown Square, Pennsylvania 19073

Telephone: (610) 993-9202 Facsimile: (610) 993-9232

Email: Training@gcenviro.com

www.GCenviro.com

This document certifies that Shelton Williams has successfully completed this

State of New York Department of Health Approved AHERA BUILDING INSPECTOR

REFRESHER COURSE, completed as required for asbestos accreditation under the Toxic

Substances Control Act, Title II. This course was held from 09/29/2015 to 09/29/2015.

MM DD YR MM DD YR

The examination date was 09/29/2015. This certificate expires one year from the date of
successful completion of the examination 09/29/2016.

MM DD YR

MM DD YR

*The official record of successful training completion is the New York State Department of
Health certificate of asbestos safety training completion (DPH 2832).*

Gail M. Conner

Training Director

Gail M. Conner

Certificate of Completion

Paul M. Davis

for successfully completing the prescribed course of study in

Pennsylvania Asbestos Building Inspector Refresher Course

under TSCA Title II

presented by

ACCESS TRAINING SERVICES, INC.
7921 River Road, Pennsauken, NJ 08110
(856) 665-3449

2/12/15

Course Date

N/A

Exam Date

2/12/16

Expiration Date

Not Provided

Social Security Number

ACC-0215-6-015

Certificate Number

Mark K. Schlager
Training Director

Certificate of Training

CRITERION LABORATORIES, INC.

HEREBY CERTIFIES THAT

Paul M. Davis

HAS SUCCESSFULLY COMPLETED A 4 HOUR COURSE ENTITLED
Asbestos Building Inspector Refresher

INCLUDING CLASSROOM INSTRUCTION

on this 2nd day of February 2016

Exam passed on this 2nd day of February 2016 - Score - 92

Approved for AHERA Accreditation Under ISCA Title II

3370 Progress Drive, Suite J
Bensalem, PA 19020
(215) 244-1300 - Phone
(215) 244-4349 - Fax
www.criterionlabs.com

Course is conducted in English

DIRECTOR:

James A. Wells

James A. Wells, CIH, President

Certificate of Completion

Bernard J. Bryson

for successfully completing the prescribed course of study in

Pennsylvania Asbestos Building Inspector Refresher Course

under TSCA Title II

presented by

ACCESS TRAINING SERVICES, INC.
7921 River Road, Pennsauken, NJ 08110
(856) 665-3449

2/16/15
Course Date

N/A

Exam Date

2/16/16

Expiration Date

Not Provided

Social Security Number

ACC-0125-6-031

Certificate Number

Mark K. Schlager
Training Director

Certificate of Completion

Bernard J. Bryson

for successfully completing the prescribed course of study in

Pennsylvania Asbestos Building Inspector Refresher Course

under TSCA Title II

presented by

ACCESS TRAINING SERVICES, INC.
7921 River Road, Pennsauken, NJ 08110
(856) 665-3449

2/15/16

Course Date

N/A

Exam Date

2/15/17

Expiration Date

Not Provided

Social Security Number

ACC-0216-6-005

Certificate Number

Mark K. Schlager
Training Director

EHS TRAINING INSTITUTE, INC.

A Division of BATTI, Inc.

Certificate of Completion

AHERA Building Inspector

(Refresher)

Awarded To:

Alexander Roman

SS#:XXX-XX-1743

Who has completed this 4-hour course and examination,

EPA Approved under TSCA Title II

AHERA / ASHARA Rule

40 CFR Part 763.

EHS TRAINING INSTITUTE, INC.

A Division of BATTI, Inc.

Delaware Industrial Park • 6 Garfield Way

Newark, DE 19713-5817

(302) 737-3376 • Fax (302) 737-5764

Course Date: September 18, 2015

Date of Expiration: September 18, 201

Certification Number : EHSBIR 150619-008


Todd K. Zeisloff, Instructor


Neeraj K. Batta, President

Certificate of Completion

Norman Harrison

for successfully completing the prescribed course of study in

Pennsylvania Asbestos Building Inspector Refresher Course

under TSCA Title II

presented by

ACCESS TRAINING SERVICES, INC.
7921 River Road, Pennsauken, NJ 08109
(856) 665-3449

9/2/15

Course Date

N/A

Exam Date

9/2/16

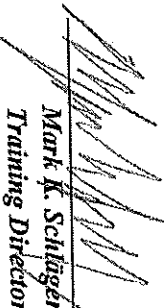
Expiration Date

Not Provided

Social Security Number

ACC-0915-6-011

Certificate Number


Mark A. Schlenger
Training Director

EHS TRAINING INSTITUTE, INC.
A Division of BATTI, Inc.

Certificate of Completion

AHERA Building Inspector

(Refresher)

Awarded To:

Kelly Mayberry

SS#:XXX-XX-1551

Who has completed this 4-hour course and examination,
EPA Approved under TSCA Title II
AHERA / ASHARA Rule
40 CFR Part 763.

EHS TRAINING INSTITUTE, INC.

A Division of BATTI, Inc.

Delaware Industrial Park • 6 Garfield Way

Newark, DE 19713-5817

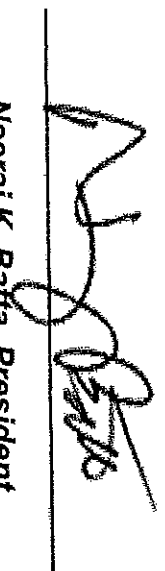
(302) 737-3376 • Fax (302) 737-5764

Course Date: February 20, 2015

Date of Expiration: February 20, 2016

Certification Number : EHSBIR 150220-005


Todd K. Zeisloft, Instructor


Neeraj K. Batta, President

EHS TRAINING INSTITUTE, INC.
A Division of BATTI, Inc.

Certificate of Completion

AHERA Building Inspector

(Refresher)

Awarded To:

Kelly Mayberry

SS#:XXX-XX-1551

Who has completed this 4-hour course and examination,

EPA Approved under TSCA Title II

AHERA / ASHARA Rule

40 CFR Part 763.

EHS TRAINING INSTITUTE, INC.

A Division of BATTI, Inc.

Delaware Industrial Park • 6 Garfield Way

Newark, DE 19713-5817

(302) 737-3376 • Fax (302) 737-5764

Course Date: February 18, 2016

Date of Expiration: February 18, 2017

Certification Number : EHSBIR 160218-006



Todd K. Zeisloft, Instructor



Neeraj K. Batta, President

AEROSOL MONITORING & ANALYSIS, INC.

This is to certify that
ANDREW HINE

*has met the attendance requirements and successfully completed
the course entitled*

3-DAY EPA AHERA INSPECTOR

For Accreditation Under TSCA Title II

05/04/2015 to 05/06/2015

Course Date

05/06/2015

Exam Date

5/6/2016

Expiration Date

STEVE SIERAGI

Principal Instructor

Steve Sieragi

A105042015-3

Certification No.

E. Rush Barnett

Course Director

E. Rush Barnett

1331 Ashton Road

P.O.Box 646

Hanover, MD 21076

P: 410-684-3327

F: 410-684-3724

www.amatraining.com

Certificate of Completion

Maryellen Leotta

for successfully completing the prescribed course of study in

Pennsylvania Asbestos Building Inspector Refresher Course

under TSCA Title II

presented by

ACCESS TRAINING SERVICES, INC.
7921 River Road, Pennsauken, NJ 08110
(856) 665-3449

2/12/15

Course Date

N/A

Exam Date

2/12/16

Expiration Date

Not Provided

Social Security Number

ACC-0215-6-024

Certificate Number

Mark K. Schlüger
Training Director

Asbestos Hazard Emergency Response Act (AHERA) Environmental Compliance Audit Cross Reference Table

In response to the AHERA Environmental Compliance Audit a Cross Reference Table has been prepared for inclusion into the Environmental Management Plan. The purpose of this Cross Reference Table is to link the following documents to the AHERA Management Plan.

Cross Reference Table	
3 Year Reinspection Report follows this Cross Reference Table documentation.	
Subject Matter	Location of Required Documents
Designated Person	Pages 1 - 3
Annual Notification	Pages 4 - 5
6 Month Periodic Surveillance Outline of Events	Page 6
3 Year Re-inspections Outline of Events	Page 7
Asbestos Management Program (operations and maintenance)	Pages 8 - 19
Asbestos Investigation Report (AIR)	Attachment 1 Letter Dated August 4, 2006
Training (included in the Asbestos Management Program)	<p>The original records are centralized at the School District's Environmental Library. Copies are maintained on staff and are required to be maintained in the latest Reinspection Report.</p> <p>2 hour awareness training records for all Building Engineers, Custodian Assistants and maintenance personnel</p> <p>40 hour worker/supervisor training records for the OEMS A-Team and various AST tradesmen.</p>
Response Actions (monthly mailings if applicable)	<p>The original documents are on file at the School District's Environmental Library.</p> <p>Copies of the original are mailed to the Schools Main Office for retention with the Management Plan documentation. These documents are typically kept separate from the management plan in an update binder due to the potential volume of response action reports.</p>

SCHOOL DISTRICT OF PHILADELPHIA

ASBESTOS DESIGNATED PERSON

Gerald F Junod
Office of Capital Programs
Environmental Management & Services
440 N Broad Street, 3rd Floor
Philadelphia, PA 19130
Telephone: 215 400 6738
Fax: 215 400 4751

Drexel University- Asbestos Building Inspector Course	January 9-11, 1989 24 Hours
Drexel University- Asbestos Management Planner Course	January 12-13, 1989 16 Hours
Criterion Laboratories, Inc. - Asbestos Management Planner Course	October 11-12, 2012 16 Hours

<u>Annual Building Inspector Refreshers</u>	1990 to Present
4 Hours	
Drexel University	
Criterion Laboratories, Inc	
Access Training Services, Inc.	

<u>Annual Building Management Planner Refreshers</u>	1990 to 1994
4 Hours	
Drexel University	
Criterion Laboratories, Inc	2013 to Present
4 Hours	

Environmental Manager, School District of Philadelphia

Manages the design and implementation of asbestos and lead projects for the Capital Improvement Program and other District Departments including Facilities & Operations and Information Technology. Ensures that asbestos abatement and lead remediation projects are expertly designed and executed in accordance with industry best management practice standards and regulations.

Manager, City of Philadelphia Asbestos Control Program

Served as the Asbestos Control Program Manager for the City of Philadelphia, Department of Public Health, Air Management Services, Asbestos Control Unit from August 1, 2003 through October 23, 2006.

Mid Atlantic Regional Environmental Consortium (MAREC)

Former member with attendance and participation commitments of all quarterly EPA Region III and yearly National Asbestos Regulatory Conferences sponsored by the EPA and the National Conference of State Legislators respectively as a representative for the City of Philadelphia Department of Public Health Air Management Services from 1994 through 2006.

Philadelphia Environmental Task Force

Former member of the Philadelphia Environmental Task force as a representative and point of contact for the City of Philadelphia Department of Public Health Air Management Services Asbestos Control Unit from 2002 through 2006.

Asbestos Instructor

Worked as the primary instructor for the initial and annual Asbestos Project Inspector training and licensing program as mandated by City of Philadelphia Department of Public Health Asbestos Control Regulations from August 1994 through October 2006.

Worked as a lead instructor with an Environmental Consulting Firm and approved by the US EPA for the initial and annual refresher training courses for various asbestos occupational disciplines such as the Building Inspector, Management Planner and Worker/Supervisor from 1991 through 1994.

I certify that the general, local agency responsibilities as stipulated in Section 763.84 will be met.

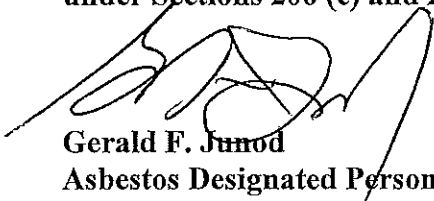


Gerald F. Junod
Asbestos Designated Person
Environmental Manager
Office of Environmental Management and Services

SCHOOL DISTRICT OF PHILADELPHIA

Accreditation Information Statement

All persons who inspect for Asbestos Containing Building Materials (ACBM) and who will design or carry out response actions with respect to assumed and confirmed ACBM, will be accredited by an EPA approved course and/or a State Contractors Accreditation Program under Sections 206 (c) and 206 (b) of Title II of the ACT.

A handwritten signature in black ink, appearing to read 'Gerald F. Junod', is written over the printed name and title.

**Gerald F. Junod
Asbestos Designated Person
Environmental Manager
Office of Environmental Management and Services**

SCHOOL DISTRICT OF PHILADELPHIA
OFFICE OF CAPITAL PROGRAMS
440 NORTH BROAD STREET, SUITE 373
PHILADELPHIA, PENNSYLVANIA 19130

OFFICE OF ENVIRONMENTAL MANAGEMENT AND SERVICES

PHONE (215)-400-4750

September 2015

TO: Principals
Building Administrators/Occupants
Parents/Guardians

FROM: Fran Burns
Chief Operating Officer

Francine Locke, M.S., Director
Office of Environmental Management and Services

SUBJECT: Annual EPA Notification Letter

Pursuant to the Federal Environmental Protection Agency (EPA) mandate, as required by 40 C.F.R. 763.84 (c)(d) of public access to environmental records, this letter is to acknowledge the availability of your facility's Asbestos Hazard Emergency Response Act (AHERA) Management Plan.

Each member of the school staff, parents/guardians, temporary workers and/or contractors, are required to receive a copy of the Notification Letter. At the direction of the Principal, a copy is to be posted on the bulletin boards and an appropriate amount of copies are to be generated for distribution.

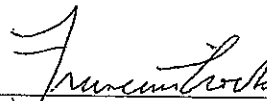
Note: The AHERA Three-Year Reinspection reports, in colored binders; White with Pink, Tan, Black, Red, Dark Blue, Green, Yellow and White, are Federal EPA mandated inspection documents. The School District of Philadelphia is subject to severe monetary penalties if the reports and associated paperwork are not available to the EPA and the public upon request.

It is incumbent on designated school personnel to gather and retain this data as it is delivered, in one location for future review. Acceptable locations include the Principal's Office or Main Office for the primary data. The Building Engineer should maintain any secondary or duplicate copies.

If you have any questions, please call 215-400-4750. Thank you for your cooperation.



Fran Burns
Chief Operating Officer



Francine Locke, M.S., Director
Office of Environmental Management
and Services

c: Danielle Floyd

AHERA-4
8/21/15



School District of Philadelphia
OFFICIAL NOTICE

PLEASE POST

September 2015

TO: Principals
Building Administrators
Building Engineers
Building Occupants
Parents/Guardians

FROM: Fran Burns
Chief Operating Officer

Francine Locke, M.S., Director
Office of Environmental Management and Services

SUBJECT: Annual Notification Letter: Asbestos Hazard Emergency Response Act

The Federal Register published on October 30, 1987, Subpart E, in Schools: Final Rule and Notice, 763.84 (c)(d) states that each local education agency shall ensure that workers and building occupants or guardians are to be informed at least once each school year about inspections, response actions and post-response action activities including re-inspections and periodic surveillance activities. The School District as the Local Education Agency (LEA), retains such reports that are available for public inspection in the Office of the Principal or Building Administrator.

The Principal or Building Administrator is required to do the following with this notification:

- 1) Post in a Public Place or Main Office
- 2) Inform Building Occupants
- 3) Send a copy of this notification to Parents or Guardians
- 4) Insert a copy into the latest AHERA Three-Year Reinspection report (white/pink binder) in your office or facility.

Handwritten signature of Fran Burns in black ink.

Fran Burns
Chief Operating Officer

Handwritten signature of Francine Locke in black ink.

Francine Locke, M.S., Director
Office of Environmental Management
and Services

c: Danielle Floyd

AHERA-4a
8/21/15

SCHOOL DISTRICT OF PHILADELPHIA
Education Center
440 North Broad Street
Philadelphia, Pennsylvania 19130

Office of Environmental Management and Services

215-400-4750

AHERA
Six Month Surveillance
Outline of Events

- Pursuant to the Federal Environmental Protection Agency (EPA) mandate, as required by 40 CFR 763.92(b), the following procedure is to be implemented. At least once every six (6) months after a Management Plan is in effect, each Local Education Agency (LEA) shall conduct a periodic surveillance in each building that it owns or leases that contains Asbestos Containing Building Materials (ACBM) or is assumed to contain ACBM.
- The first Bi-Annual Inspection starts in the Spring (March, April, May) and again in the Fall (October, November, December) of each year. The Building Engineer/Assistant should assist the Building Inspector with appropriate access to all areas including (Crawlspaces/Attics) and rooms in the facility. There is no action required of the Principal.
- The Building Inspector shall visually inspect all areas that are identified in the Management Plan as ACBM or assumed ACBM. The date of the surveillance is recorded, the inspectors name and any changes in the conditions of the materials.
- The Building Inspector shall make a copy of the inspection document and insert into the front of the latest Management Plan (AHERA Three Year Reinspection report). The original document is returned to the LEA's Environmental Library and filed.

SCHOOL DISTRICT OF PHILADELPHIA
Education Center
440 North Broad Street
Philadelphia, Pennsylvania 19130

Office of Environmental Management and Services

215-400-4750

AHERA
Three Year Reinspection
Outline of Events

- Pursuant to the Federal Environmental Protection Agency (EPA) mandate, as required by 40 CFR 763.85(b) the following procedure is to be implemented. At least once every three (3) years after a Management Plan is in effect, each Local Education Agency (LEA) shall conduct a reinspection of each building that it owns or leases that contains Asbestos Containing Building Material's (ACBM's) or is assumed to contain ACBM.
- Subsequent Three Year Re-inspections (2009, 2012, 2015, etc) shall start in the Fall (October, November, December, January). The Building Engineer/Assistant should assist the Building Inspector with appropriate access to all areas including (Crawlspaces/Attics) and rooms in the facility. There is no action required of the Principal.
- An accredited Building Inspector shall visually inspect and touch to determine friability, all areas that are identified in the Management Plan as ACBM or assumed ACBM. The date of the surveillance is recorded, the inspectors name and any changes in the conditions of the materials. The Building Inspectors state of accreditation and license number is required.
- After the inspection, the Building Inspector shall make a copy of the inspection documents and insert into the front of the latest Management Plan (AHERA Three Year Reinspection report). The original document is returned to the LEA's Environmental Library and filed.
- The Building Inspector shall return the reinspection data to the Management Planner to be assessed and determine appropriate response actions and a report issued (AHERA Three Year Reinspection report). One copy of the report is delivered to the schools Principal to be permanently retained with all previous environmental data. Another copy is retained in the LEA's Environmental Library.



School District of Philadelphia
Office of Environmental Management & Services
440 North Broad Street
Philadelphia, PA 19130
(215) 400-4750

**School District of Philadelphia
Asbestos Management Program**

TABLE OF CONTENTS

Definitions.....	Page 9
1. Introduction.....	Page 10
2. Summary of Asbestos Management Plan	
3. Asbestos Management Plan Execution.....	Page 11
a. General Execution	
4. Summary of Program Execution	
a. Asbestos Management Plan Execution	
5. Responsibilities	
a. OEMS	
b. Asbestos Worker/Supervisor “A-TEAM”.....	Page 12
c. Asbestos Designated Person	
d. Supervisor or Project Manager (Capital, Maintenance & Facilities)	
e. Employee Capital.....	Page 13
f. Employee Maintenance	
g. Employee Facilities and Custodial	
6. Requirements.....	Page 14
a. Employee Exposure Monitoring	
b. Employee Notification	
c. Observation of Monitoring	
d. Training Program	
e. Access of Information	
f. Record Keeping	
7. AHERA O&M Plan.....	Page 15
a. Controls	
8. O&M Response Actions.....	Page 16
a. Facility Maintenance Isolation of Area	
b. Unlikely Contact with ACM/PACM	
c. Accidental Disturbance of ACM/PACM	
d. Planned Disturbance of ACM/PACM	
e. Miscellaneous ACM/PACM.....	Page 17
f. Vinyl Asbestos Floor Tile	
g. Mastic/Adhesives	
h. Woven Vibration Dampers	
i. Other Work Practices	
j. Fiber Release Episodes	
9. References and Resources.....	Page 18

DEFINITIONS / ACRONYMS

ACM/PACM:	Asbestos Containing Material/Potential Asbestos Containing Material
AHERA:	Asbestos Hazard Emergency Response Act
AIR FORM:	Asbestos Inspection Report Form
Amended Water:	Water to which a surfactant (soap) has been added
AMP:	Asbestos Management Program/Asbestos Management Plan
Asbestos Designate Person:	Individual assigned by the district to oversee asbestos related issues.
Asbestos Regulated Area:	Location that is posted as an asbestos work area in which only approved and accredited personnel are permitted to enter
AST:	Asbestos Support Team involving approved and accredited school district tradespersons personnel that are school district person
A-TEAM:	School District of Philadelphia asbestos workers
CIP:	Capital Improvement Program
Consultant:	Asbestos consulting firm hired by the District
Demolition Directive:	Memorandum – August 4, 2006 from Patrick Henwood
EPA:	Environmental Protection Agency
In House Personnel:	School District of Philadelphia asbestos workers
LEA:	Local Education Agency
O&M:	Operations and Maintenance
OEMS:	Office of Environmental Management and Services
OSHA:	Occupational Safety and Health Administration
PEL:	Permissible Exposure Limit
PSD or SDP:	Philadelphia School District/School District of Philadelphia
PSIT:	Philadelphia School Improvement Team
STEL:	Short Term Exposure Limit

1. Introduction

The School District of Philadelphia, Asbestos Policy Statement:

“The School District of Philadelphia is dedicated to providing a safe and healthful work environment for its employees, students, faculty, contractors and visitors. In recognition of the potential health problems associated with asbestos, the School District of Philadelphia is committed to a comprehensive asbestos control program. This program is implemented and maintained through the School District of Philadelphia's Office of Environmental Management and Services (OEMS).”

OEMS has the responsibility of establishing procedures for asbestos abatement, asbestos inspection, air monitoring, renovation and demolition activities within all School District of Philadelphia owned or leased facilities.

These procedures are developed to ensure that:

- (1) People are not exposed to significant levels of asbestos fibers
- (2) Asbestos waste is handled and disposed of properly
- (3) Members of the School District of Philadelphia community have access to the Office of Environmental Management and Services for information, assistance, guidance, and interpretation regarding asbestos related matters.
- (4) Members of the School District of Philadelphia community have access to the Asbestos Management Plans as required and outlined in the US EPA AHERA regulations including annual written notification to all parents.
- (5) Compliance with all applicable Federal, State and Local Asbestos Regulations

Requirements outlined in this manual are mandatory in nature where the word “SHALL” is used and are advisory in nature where the word “SHOULD” is used.

2. Summary of Asbestos Management Program

The School District of Philadelphia's Asbestos Management Program was established to meet the requirements of Federal, State, and Local Regulations.

These regulations include, but are not limited to:

- US Environmental Protection Agency Asbestos Hazard Emergency Response Act (US EPA AHERA) and National Emissions Standard for Hazardous Air Pollutants subpart M, Part 61 (NESHAP);
- US Department of Labor, Occupational Safety and Health Administration (OSHA) General Industry Standard (29 CFR 1910.1001) and the OSHA Asbestos Standard for the Construction Industry (29 CFR 1926.1101);
- The Commonwealth of Pennsylvania, Department of Labor and Industry, Asbestos Occupations, Accreditation and Certification Act;
- The City of Philadelphia, Department of Public Health, Asbestos Control Regulations.

3. Asbestos Management Program Execution

a) General Execution

The Office of Environmental Management and Services (OEMS) develops, implements and manages safety and health programs for the School District of Philadelphia faculty, staff and students and assists with ensuring that all contractors comply with Federal, State and Local Environmental Regulations. The OEMS provides the oversight of School District of Philadelphia employees (Asbestos A-Team), environmental consultants, and asbestos abatement contractors for all projects within the School District of Philadelphia concerning Asbestos Containing Materials.

The control of safety and health hazards at the School District of Philadelphia is primarily through the implementation of engineering, work practice and administrative controls. Personal Protective Equipment (PPE) is used to supplement these controls or whenever the controls are not feasible or are in the process of being implemented. PPE is also recommended whenever exposures to chemical, physical or biological agents can be prevented or reduced by its use.

This written program establishes the procedures necessary to:

- 1) meet established standards and federal regulations for occupational exposure to asbestos fibers;
- 2) meet the requirements of the City of Philadelphia Asbestos Control Regulations which encompasses the disturbance and/or abatement of asbestos containing building materials;
- 3) provide the necessary health and safety protection to the School District of Philadelphia staff, faculty, students, contractors and visitors.

This program is strengthened by input and cooperation with the Philadelphia Federation of Teachers (PFT), Health and Welfare Fund.

4. Summary of Program Execution

a) Asbestos Management Program Execution

The Asbestos Management Program is administered by the Office of Environmental Management and Services (OEMS). OEMS provides the following services primarily through professional consultants:

- (1) exposure monitoring services;
- (2) building inspection/surveys (bulk sampling) for the identification of asbestos containing materials;
- (3) asbestos project design services;
- (4) asbestos abatement project and air monitoring services;
- (5) emergency response to fiber release episodes;
- (6) education/information;
- (7) medical monitoring;
- (8) training for School District of Philadelphia personnel

5. Responsibilities

a) Office of Environmental Management and Services

OEMS is responsible for performing the following functions:

- (1) Developing and administering of the Asbestos Management Program.
- (2) Providing asbestos-related services to all School District of Philadelphia departments.
- (3) Conducting required training of the Asbestos Management Program and working jointly with departments to schedule training.
- (4) Identifying and posting areas where labeling/signage are required.
- (5) Medical Monitoring of OEMS "A-TEAM" and other departments "AST" Asbestos Program staff.

- (6) Certification and training as required for OEMS “A-TEAM” and other departments “AST” Asbestos program staff.
- (7) Record keeping as outlined in Section 3.5 and all records as by required by US EPA AHERA regulations.

b) Asbestos Worker/Supervisor - “A-TEAM”

- (1) OEMS shall ensure that all “A-TEAM” workers/supervisors adhere to the following requirements:
 - a) Attend an initial Worker/Supervisor Asbestos Course;
 - b) Maintain the annual re-certification per EPA AHERA requirements and Commonwealth of Pennsylvania Asbestos Occupations, Accreditation and Certifications Act;
 - c) Undergo an annual Asbestos Medical Evaluation;
 - d) Undergo an annual Respirator Medical Clearance;
 - e) Undergo an annual Respirator Fit Testing.

c) Asbestos Designated Person

The Asbestos Designated Person is responsible for:

- (1) Assuring the health and safety of employees, students and visitors in the School District of Philadelphia facilities under his/her control.
- (2) Being kept informed of all areas under his or her jurisdiction where potential asbestos exposures exist and initiating protection programs that adhere to the Asbestos Management Program requirements of this manual.
- (3) Assuring that Asbestos Management Program requirements are adhered to by principal investigators, project managers, supervisors, or division heads, and School District of Philadelphia personnel under their supervision.
- (4) Ensuring that all employees within the Asbestos Management Program comply with (OSHA 1910.1001 (j) (7) (iv)) and the US EPA AHERA regulations by attending the required training.
- (5) Ensure the posting of:
 - a) Warning labels/signage
 - b) Commonwealth of Pennsylvania Asbestos Abatement and Demolition/Renovation Notification form
 - c) Asbestos Inspection Reports (AIR) form (where required)
 - d) Ensuring that Construction Projects follow the Demolition Directive procedures as outlined in the August 4, 2006 letter.

d) Supervisor or Project Manager (Capital, Maintenance and Facilities)

Each person in charge of a project, maintenance/repair, renovation/demolition, or other activity from the Departments of Capital, Maintenance, and/or Facilities, where asbestos containing material may be present is responsible for:

Identifying, with the assistance of OEMS, asbestos containing building materials prior to any disturbance of these materials. Various Federal (EPA and OSHA) and Local (City of Philadelphia Asbestos Control Regulations) require Asbestos Inspections prior to renovation/demolition activities. This shall be accomplished by always following the Asbestos Management Program Procedures as follows:

- (1) Ensure that the requirements of the Asbestos Management Program Procedures are followed by all personnel, trades, and contractors who are involved with the project;

- (2) Review of the required Asbestos Inspection Report (AIR) form (Attachment 1) and AHERA Management Plan documents prior to activities that may disturb any Asbestos Containing Materials;
- (3) Perform all project related duties as outlined in the Project Management Responsibilities;
- (4) Keep the department chairperson or director informed on any actions proposed or taken regarding the Asbestos Management Plan;
- (5) Ensuring that Construction Projects follow the Demolition Directive procedure outlined in the August 4, 2006 letter.

e) Employee – Capital

School District of Philadelphia Capital employees and/or consultants shall:

- (1) Ensure that no suspect or asbestos containing building materials are disturbed in the course of the projects they are performing or managing. This shall be accomplished by notifying their supervisor and OEMS by issuance of a work order permit (a.k.a PSIT Service Request Form) and verifying that the materials which may be disturbed are non-asbestos containing. If this information is not available or verification has not been made, these materials should not be disturbed.
- (2) Immediately notify OEMS and their supervisor in the event of a potential fiber release episode upon discovery of visible damage to asbestos containing materials.
- (3) Ensuring that Construction Projects follow the Demolition Directive procedures as outlined in the August 4, 2006 letter.

The types of projects represented as part of the Capital Improvement Program are as follows:

- (1) Complete Renovation of an existing building that addresses all facility component concerns and educational program needs;
- (2) Major Renovation of an existing building addressing significant facility component and educational improvements;
- (3) Addition to an existing building (either as an attachment or stand-alone structure) to accommodate needed program space;
- (4) Conversion of an existing facility to accommodate a change in educational program;
- (5) Facility Component Improvement of specific facility needs (i.e. electrical or HVAC system upgrades, ADA improvements, life safety improvements, exterior renovations, etc.)

f) Employee – Maintenance

School District of Philadelphia Maintenance employees shall:

- (1) Ensure that no suspect or asbestos containing building materials are disturbed in the course of their duties or work they are performing. This shall be accomplished by notifying their supervisor and OEMS by issuance of a work order permit and verifying that the materials which may be disturbed are non-asbestos containing. If this information is not available or verification has not been made, these materials should not be disturbed.
- (2) Immediately notify OEMS and their supervisor in the event of a potential fiber release episode or upon discovery of visible damage to asbestos containing materials.
- (3) All employees involved in maintenance activities shall attend required Asbestos Awareness training program within 60 days of employment.

g) Employee – Facilities & Custodial

School District of Philadelphia Facilities and Custodial employees shall:

- (1) Ensure that no suspect or asbestos containing building materials are disturbed in the course of their duties or work they are performing. This shall be accomplished by notifying their supervisor and OEMS by issuance of a work permit and verifying that the materials which may be disturbed are non-asbestos containing. If this information is not available or verification has not been made, these materials should not be disturbed;
- (2) Immediately notify OEMS and their supervisor in the event of a potential fiber release episode or upon discovery of visible damage to asbestos containing materials.
- (3) All employees involved in Facilities and Custodial activities shall attend require Asbestos Awareness training program within 60 days of employment.

6. Requirements

a) Employee Exposure Monitoring

When information indicates that an employee's exposure to asbestos fibers may equal or exceed an 8-hour time-weighted average of 0.1 f/cc * (per OSHA 1910.1001 & 1926.1101), OEMS shall develop and implement an asbestos exposure monitoring program. The sampling strategy shall be designed to identify employees by work task (job classification) that is exposed to asbestos fibers that exceed an 8-hour time-weighted average of 0.1 f/cc.

b) Employee Notification

OEMS shall notify in writing, each employee exposed to asbestos fibers at or above an 8-hour time weighted average of 0.1 f/cc.

c) Observation and Monitoring

OEMS shall provide employees or their representatives with an opportunity to observe any exposure measurements conducted.

d) Training Program

OEMS shall institute a training program which meets the requirements of AHERA for all employees who perform maintenance operations in a facility/school which contains asbestos containing materials or presumed asbestos containing materials and 1910.1001 (j), and the Commonwealth of Pennsylvania Department of Labor and Industry and the City of Philadelphia Asbestos Control Regulations. The affected departments shall ensure employee participation in this program. The OEMS "A-TEAM" and other departments "AST" Asbestos Program staff training shall be conducted annually for each employee as required by all Federal, State and Local for each asbestos discipline.

All Asbestos Awareness training as required by AHERA shall be performed within 60 days of employment and shall include:

- Health effects of asbestos
- Locations of ACM and PACM in the building/facility
- Recognition of CM and PACM damage and deterioration
- Requirements of the OSHA 1910.1001 standard relating to maintenance
- Proper response to fiber release episodes
- Procedure to be followed to isolate areas affected by fiber release

e) Access to Information

OEMS shall make available to affected employees or their representative's copies of the Occupational Safety and Health Administration (OSHA) General Industry Standard Part 1910.1001 and the department shall post a copy in the workplace.

f) Record Keeping

OEMS shall maintain an accurate record of all employee exposure measurements. OEMS and/or the School District of Philadelphia Human Resources Department shall maintain records of employee medical monitoring program. OEMS shall maintain all employee training records. All records shall be provided upon request to employees, former employees, representatives designated by the individual employee.

7. AHERA OPERATIONS AND MAINTENANCE PLAN

a) CONTROLS

i. Work Order System

Minimizing disruption of ACM/PACM during maintenance and renovation activities is the primary goal and task encountered by OEMS. Operations and maintenance employees and contractors should be warned to avoid conducting any maintenance work which may disturb ACM/PACM. Initiating a work order system, where all work orders or requests are channeled through the Office of Environmental Management and Services (OEMS), will be the method used to control and minimize disruption of ACM/PACM.

Any work performed by in-house personnel or contractors that could or will impact ACM/PACM shall be coordinated by OEMS. A completed Asbestos Inspection Report Form (Attachment 1) shall be issued to in-house personnel and/or all contractors whose work could impact ACM/PACM. This form should accompany each contract issued to an outside contractor and posted on the jobsite.

All work order requests for maintenance and renovation activities in areas where ACM/PACM is suspected or known to be present are to be submitted to OEMS prior to proceeding with work. OEMS is responsible for reviewing asbestos survey records for information about the presence of ACM/PACM in the area where the work is to be performed. OEMS should physically inspect the area to ensure existing records reflect actual conditions. If no asbestos is present, a work order is not necessary and the planned actions can proceed. If ACM/PACM is found to be present in the area, OEMS will sign the work order application and obtain an approved and accredited asbestos contractor or assign OEMS "A-TEAM" to abate the ACM/PACM.

ii. Regulated Areas

The owner will identify and regulate all areas where airborne concentrations of ACM/PACM exceed the Permissible Exposure Limit (PEL)* (Per OSHA determined to be 0.1 f/cc) and/or short term exposure limit (STEL) (Per OSHA determined to be 0.1 f/cc), or there is reasonable possibility that the (PEL) and/or (STEL) may be exceeded. All ACM/PACM removal activities involving thermal system insulation ACM/PACM (Class I), surfacing ACM/PACM (Class I), and miscellaneous ACM/PACM such as floor tile, roofing, and siding mastic, etc. (Class II), and repair and maintenance operations where thermal system insulation and surfacing ACM/PACM is likely to be disturbed (Class III) will be performed in accordance with federal, state, and local regulations. All asbestos abatement work and activities will be designed and managed as asbestos regulated areas. These areas will be demarcated and labeled.

iii. Warning Signs

Warning signs shall be displayed at all approaches to each asbestos regulated area. The asbestos abatement contractor will provide OSHA warning signs in all regulated areas during removal, repair, and other maintenance activities. OEMS will provide AIRs to all contractors who must inform all employees and supervisors working in locations contiguous to asbestos regulated areas of the potential hazards and work practices required.

iv. Warning Labels

Warning labels and/or signage shall be affixed to all raw materials, mixtures, scrap, waste, debris, and other products containing asbestos fibers, or to their containers. Generally, the asbestos abatement contractor or OEMS A-Team personnel will provide all warning labels for ACM/PACM containment.

8. O & M RESPONSE ACTIONS

The Asbestos Management Program general O&M procedures are outlined in this section. Additional requirements specific to asbestos abatement activities are included in the Project Design documents for all Asbestos Abatement Work. Regular cleaning, inspection, and reporting of ACM/PACM deterioration or other problems must be diligently practiced by all employees including custodial and maintenance personnel.

a) Facility Maintenance Isolation of Area Responsibilities

Maintenance personnel are often required to work in areas where ACM/PACM may potentially be disturbed. Most maintenance activities are conducted by in-house staff, outside contractors, or a combination.

Emergency fiber release episodes, such as pipe fitting or valve breaks, emergency boiler work, or mechanical equipment repair will be responded to by OEMS A-Team personnel or asbestos abatement contractor personnel. The owner's maintenance staff will: (1) isolate the emergency fiber release area; (2) post warning signs to prevent unauthorized access, and (3) notify their supervisor and OEMS. OEMS will ensure that the fiber release area remains isolated and is properly cleaned by and approved and accredited abatement contractor or by OEMS A-TEAM personnel.

b) Unlikely Contact with ACM/PACM

Maintenance activities or repairs which can be performed without contacting or disturbing the ACM/PACM require little more than normal care and good workmanship. For example, valves which are either uncovered or covered with non-asbestos insulation can be packed or repaired without disturbing asbestos insulation on nearby pipes. The major precaution is to ensure that maintenance and custodial personnel are familiar with procedures such as isolating the area, posting warning signs, and notifying OEMS in the event of any accidental ACM/PACM disturbance.

c) Accidental Disturbance of ACM/PACM

Maintenance and facilities personnel shall notify OEMS any time a fiber release is suspected. If friable ACM/PACM becomes airborne in the building,

d) Planned Disturbance of ACM/PACM

Maintenance activities that may impact ACM/PACM include access to a valve, flange, duct, or related system component.

Where asbestos-containing insulation must be removed to maintain or repair the thermal system, the ACM/PACM will imminently be disturbed. ACM/PACM removal work shall be conducted by OEMS A-Team personnel or an approved and accredited asbestos abatement contractor.

If friable ACM/PACM becomes airborne in the building, maintenance and facilities personnel shall secure the area and contact OEMS. OEMS shall respond accordingly.

e) Miscellaneous ACM/PACM

Miscellaneous types of ACM/PACM may include vinyl asbestos floor tiles, mastics/adhesives and woven vibration dampers. Disturbance of these materials should be avoided. Routine maintenance activities involving these materials should not pose a problem if handled properly. Questions on the proper removal and disposal of miscellaneous ACM/PACM should be directed to OEMS. OEMS will contact an approved and accredited asbestos abatement contractor or utilize OEMS A-TEAM personnel to assist with miscellaneous ACM/PACM clean-up activities.

f) Vinyl Asbestos Floor Tile

Asbestos-containing floor tiles in good condition are considered non-friable unless they are crushed, drilled, sawed, sanded or disturbed by any activity that breaks up the material. Routine maintenance of these materials should employ the use of non-abrasive buffers and wet cleaning technique. Broken or loose floor tiles should be removed and disposed of as asbestos waste by OEMS. Remaining debris should be vacuumed with a HEPA vacuum and the area wet mopped using amended water.

g) Mastics/Adhesives

Mastics and adhesives containing asbestos in good condition are considered non-friable and do not pose a potential health concern unless crushed, drilled, sawed, sanded, or otherwise abraded. Questions on the proper removal should be directed to OEMS.

h) Woven Vibration Dampers

Woven vibration dampers in good condition are considered non-friable and do not pose a potential health concern unless cut, crushed, drilled, sawed, sanded, or otherwise abraded. Questions on the proper removal should be directed to OEMS.

i) Other Work Practices

Any special work not included in this section should be addressed to OEMS for review prior to the initiation of work that may involve the disturbance of ACM/PACM.

j) Fiber Release Episodes

Facilities and maintenance staff should report to OEMS the presence of asbestos debris, water or physical damage to ACM/PACM, or any other evidence of possible fiber release. OEMS should have the OEMS A-Team personnel or an approved and accredited abatement contractor respond to the site to clean up debris and make repairs as soon as possible. OEMS will also contact a consultant to conduct air monitoring and prepare a report and submit at project completion to OEMS for each episode. OEMS will forward the reports for each site location AHERA Management Plan accordingly.

9. REFERENCES and RESOURCES

Applicable regulations for asbestos projects impacted by renovation, demolition, and maintenance activities.

- **Philadelphia Air Management Services – Asbestos Control Unit**
<http://www.phila.gov/health/units/ams/Asbestos/asbestos.html>
- **Pennsylvania Asbestos Occupations, Accreditation and Certification Act**
<http://www.dli.state.pa.us/landi/cwp/view.asp?a=185&q=56262&landiNav=>
- **United States Environmental Protection Agency Asbestos Home Page**
<http://www.epa.gov/asbestos/>
- **Occupational Safety and Health Administration (OSHA) Asbestos Home**
<http://www.osha.gov/SLTC/asbestos>