

SCHOOL DISTRICT OF PHILADELPHIA



Asbestos Hazard Emergency Response Act “AHERA”

THREE-YEAR RE-INSPECTION 2015-2016 and ASBESTOS MANAGEMENT PLAN for the

Overbrook High School

**ULCS# 4020
Building # B402001-11
5898 Lancaster Avenue
Philadelphia, Pennsylvania
19131**

Year Built: 1926

October 2015

Conducted by:

Accredited Environmental Technologies, Incorporated
Batta Environmental Associates, Incorporated
Criterion Laboratories, Incorporated
Environmental Testing Consultants, LLC
G & C Environmental Services, Incorporated
KEM Partners, Incorporated
Synertech, Inc.
TTI Environmental, Inc.
USA Environmental Management, Inc.
The Vertex Companies, Inc.

Management Plan Prepared by:
Criterion Labs, Inc. and Synertech Inc.

This report must remain in the Main Office as mandated by the US EPA AHERA Regulations.

AHERA THREE-YEAR REINSPECTION VOLUME IX

Table of Contents

Transmittal Letter

Executive Summary

- I. Summary list of Confirmed Asbestos Containing Building Materials
- II. Summary list of Assumed Asbestos Contain Building Materials
- III. Summary list of Non-Asbestos Containing Building Materials
- IV. Summary list of Non Suspect Asbestos Containing Building Materials
- V. Summary List of Auditorium DATA for this location
- VI. Summary list of Attic and/or Crawlspace DATA for this location
- VII. Summary list of Pipe Chase/Pipe Shaft DATA for this location

Section I Report of Re-Inspection

- A. Introduction
- B. Three-Year Re-inspection IX Overview
- C. Post- Management Plan Activities and Changes
 - C.1 - Sampling and Analysis
 - C.2 - New Floor Tile Sampling
 - C.3 - Abatement Activity
 - C.4 - Periodic (Six-Month) Surveillance (Damaged Materials)

Section II Re-Inspection Data

- A. Introduction
- B. Re-Inspection Key Definitions
- C. Room by Room Location Log Report

Section III Certificates

- A. Management Planner/Building Inspector Certificates

Section IV	Cross Reference Table	Page 1-8
	Asbestos Management Program	Page 9-19

SCHOOL DISTRICT OF PHILADELPHIA
EDUCATIONAL CENTER
440 NORTH BROAD STREET
PHILADELPHIA, PENNSYLVANIA 19130

OFFICE OF ENVIRONMENTAL MANAGEMENT AND SERVICES

PHONE (215)-400-4750

January 2016

TO: All Principals
All Building Administrators

FROM: Fran Burns
Chief Operating Officer

Francine Locke, M.S., Director
Office of Environmental Management and Services

SUBJECT: AHERA Three (3) Year Re-inspection IX report

In order to comply with the provisions of the Asbestos Hazard Emergency Response Act (AHERA) the attached report is submitted to you. The law requires that this report be kept in the Main/Principal's office. It cannot be removed from these locations. *If the school (program) is relocated to a different building, these environmental documents are to be safely retained for the next school/building occupants.* All asbestos reports must be available to the public and Federal EPA upon request.



Fran Burns
Chief Operation Officer

Francine Locke, M.S., Director
Office of Environmental Management
and Services

Executive Summary

This Asbestos Hazard Emergency Response Act (AHERA) Three-Year Re-inspection “Volume # IX” Management Plan at this location, has been completed and the report of re-inspection submitted to the School District of Philadelphia. The re-inspections in all School District of Philadelphia buildings of 2015-2016 were conducted and completed between October 5th, 2015 through March 30th, 2016 as a joint project by Accredited Environmental Technologies, Inc., Batta Environmental Associates, Inc., Criterion Laboratories, Inc., Environmental Testing Consultants, LLC, G & C Environmental Services, Inc., KEM Partners, Inc., Synertech, Inc., TTI Environmental, Inc., USA Environmental Management, Inc. and The Vertex Companies, Inc.

In general, the School District of Philadelphia Office of Environmental Management and Services conducts Environmental Impact Evaluations and provides Asbestos Inspection Reports prior to any renovation, demolition and/or maintenance activities. The AHERA report must be reviewed prior to any renovation, demolition and/or maintenance activities in order to avoid the unknowing disturbance to Asbestos Containing Building Materials identified within this location. In addition, prior to work activities above all drop ceilings this report should be reviewed to avoid potential disturbances to Asbestos Containing Materials. Refer to Section IV of the Cross Reference Table, for additional Asbestos Management Program information. Contact the Office of Environmental Management and Services to have an Environmental Impact Evaluation conducted prior to any renovation, demolition and/or maintenance activities within this facility.

The information contained in this report was obtained from the original Asbestos Management Plan for the school, from update reports on changes and activities since the completion of the 1st Management Plan for each location and from all prior inspections performed and documented in Volume # I through Volume VIII (dated respectively 1992, 1995, 1998, 2001, 2004, 2007, 2010 or 2013) (if applicable) - and by this Three-Year Re-inspection of this school. The re-inspection report/Management Plan of 2015-2016 were reviewed and prepared collectively by Management Planner Megan Vala, Mary Anne Lerro of Criterion Laboratories, Inc. and/or Monique Causley, of Synertech Inc.

The 2015-2016 inspection process included the addition of a comprehensive Room by Room Inventory of all Thermal (T), Surfacing (S) and Miscellaneous (M) Materials specific to each room of this facility. Inspections of each room's thermal, ceilings, walls, floors and miscellaneous items regardless of Asbestos Content are categorized on the Room by Room Location Log Report for this location. Rooms or areas of the facility that were not accessible at the time of the inspection are marked with an "X". The Room by Room Location Log Report is found in Section II C of this Management Plan.

All Presumed or Suspect Asbestos Containing Building Materials (ACBMs), listed in the following summary charts are categorized as Confirmed, Assumed, Non-Asbestos, and/or Non-Suspect (ACBMs) were identified in the original Management Plan, or in the Volume I through Volume VIII AHERA Three-Year Re-inspection reports, and were re-inspected as part of this project.

As mandated by the U S EPA AHERA regulations, periodic Six-Month inspections and Three-Year Re-inspections of this location will be performed and the Inspection Data in this report will be updated accordingly.

Please feel free to contact the School District of Philadelphia's Office of Environmental Management and Services (OEMS) regarding any comments, questions, or concerns regarding this report or any Environmental related topic. OEMS staff can be reached at (215) 400 4750, via fax at (215) 400 4751 or via e-mail at flocke@philasd.org and/or gfunod@philasd.org.

Additional information can be found on our website. Here is the link to the OEMS website.
<http://webgui.phila.k12.pa.us/offices/e/environmental>

I. Summary list of Confirmed Asbestos Containing Building Materials within this facility

These charts are to be used for a quick reference* in order to avoid the unknowing disturbance of Asbestos Containing Materials during any and all Operations, Maintenance, Renovation, and/or Demolition activities at this location. *These materials have been sampled and Laboratory Analysis has CONFIRMED the presence of Asbestos. Contact OEMS prior to the disturbance of any of the following materials.*

Confirmed Asbestos Containing Building Materials for this location

Floor Tile VAT 12" x 12"	Pipe Insulation 2-6 inch	Transite Sills
Floor Tile VAT 9" x 9"	Transite	Transite Sink
Pipe Fitting Insulation	Transite Closet	Transite Stalls
Pipe Insulation > 6 inch	Transite Electrical Panel	Transite Table Top

** Always refer to the Room by Room Logs for each specific material classification as the material classification findings may be different in various rooms throughout this facility.*

*** Some Materials may have multiple classifications (Confirmed, Assumed, NAD and Non Suspect) within this facility.*

II. Summary list of Assumed Asbestos Containing Building Materials within this facility

These charts are to be used for a quick reference* in order to avoid the unknowing disturbance of Asbestos Containing Materials during any and all Operations, Maintenance, Renovation, and/or Demolition activities at this location. These materials have not been sampled and should not be disturbed until verification of Asbestos Content. Contact OEMS for assessment and sampling prior to the disturbance of these materials.

Assumed Asbestos Containing Building Materials for this location

Blackboard Glue Dots	Plaster Ceiling	Transite Table Top
Fire Doors	Radiator Insulation	Transite Wall
Floor Tile VAT 12" x 12"	Sink Undercoat Mastic	Troweled on Ceiling
Heat Shield Insulation	Spline Ceiling Glue Dots	Troweled on Ceiling
Kiln	Tank Insulation	Unit Ventilator Insulation
Linoleum	Transite Closet	Vibration Damper Cloth
Pipe Fitting Insulation	Transite Electrical Panel	Wall Glue Dots
Pipe Insulation 2-6 inch	Transite Fume Hood	

* *Always refer to the Room by Room Logs for each specific material classification as the material classification findings may be different in various rooms throughout this facility.*

** *Some Materials may have multiple classifications (Confirmed, Assumed, NAD and Non Suspect) within this facility.*

III. Summary list of Non-Asbestos Containing Building Materials within this facility

These charts are to be used for a quick reference* in order to avoid the unknowing disturbance of Asbestos Containing Materials during any and all Operations, Maintenance, Renovation, and/or Demolition activities at this location. *These materials have been sampled and Laboratory Analysis has indicated NO Asbestos present or NO ASBESTOS DETECTED (NAD).*

Non- Asbestos Containing Building Materials for this location

Acoustical Plaster Walls	Fiberglass Ceiling Tile 2' x 4'	Plaster Walls
Ceiling Tile 1' x 1'	Fiberglass Pipe Insulation	Sheetrock Ceiling
Ceiling Tile 2' x 4'	Fireproofing	Sheetrock Wall
Concrete Ceiling	Pipe Fitting Insulation	
Decorative Plaster Ceiling	Plaster Ceiling	

* *Always refer to the Room by Room Logs for each specific material classification as the material classification findings may be different in various rooms throughout this facility.*

** *Some Materials may have multiple classifications (Confirmed, Assumed, NAD and Non Suspect) within this facility.*

IV. Summary list of Non-Suspect Asbestos Containing Building Materials within this facility

These charts are to be used for a quick reference* in order to avoid the unknowing disturbance of Asbestos Containing Materials during any and all Operations, Maintenance, Renovation, and/or Demolition activities at this location. These materials are not typically known to contain Asbestos.

Non-Suspect Asbestos Containing Building Materials for this location

Brick Wall	Fiberglass Ceiling Tile 2' x 2'	Sheetrock Ceiling
Carpet	Fiberglass Ceiling Tile 2' x 4'	Sheetrock Wall
Cement Floor	Fiberglass Pipe Insulation	Terracotta Block Wall
Ceramic Tile Floors	Marble Floor	Vinyl Walls
Ceramic Tile Walls	Marble Walls	Wood Floor
Concrete Block Wall	Metal Ceiling	Wood Paneling
Concrete Ceiling	Metal Ceiling Tile 2' x 2'	Wood Wall
Concrete Wall	Metal Walls	
Duct Work	Partition Room Dividers	

** Always refer to the Room by Room Logs for each specific material classification as the material classification findings may be different in various rooms throughout this facility.*

*** Some Materials may have multiple classifications (Confirmed, Assumed, NAD and Non Suspect) within this facility.*

V. Summary list of Auditorium DATA for this location

These charts are to be used for a quick reference of the Auditorium DATA within this facility. Sampling of the Auditorium Ceilings throughout the District is more difficult because of the various ceiling heights. As sampling occurs this information is updated on a case by case basis for each specific location and facility.

This is a list of known materials for this location's Auditorium

Auditorium		
Auditorium	Plaster Ceiling	Assumed
Auditorium	Decorative Plaster Ceiling	NAD
Auditorium	Plaster Walls	NAD
Auditorium	Wood Wall	Non Suspect ACM
Auditorium	Floor Tile VAT 12" x 12"	Assumed
Auditorium	Wood Floor	Non Suspect ACM
Auditorium	Radiator Insulation	Assumed
Auditorium Stage	Plaster Ceiling	Assumed
Auditorium Stage	Plaster Walls	NAD
Auditorium Stage	Wood Floor	Non Suspect ACM
Auditorium Balcony	Plaster Ceiling	NAD
Auditorium Balcony	Plaster Walls	NAD
Auditorium Balcony	Carpet	Non Suspect ACM
Auditorium Balcony	Wood Floor	Non Suspect ACM
Auditorium Balcony	Transite	Confirmed

** Always refer to the Room by Room Logs for each specific material classification as the material classification findings may be different in various rooms throughout this facility.*

*** Some Materials may have multiple classifications (Confirmed, Assumed, NAD and Non Suspect) within this facility.*

VI. Summary list of Attic and/or Crawlspace DATA for this location

These charts are to be used for a quick reference regarding the Attics and/or Crawlspaces inspection DATA within this facility. Contact OEMS prior to entering any attic or crawlspace within this facility and refer to the below chart and legend for Category Rank determination. The Data relative to these spaces is updated as conditions change regarding Abatement or Renovation activity on a case by case basis for each specific location and facility. In general, Crawlspaces are below the basement or 1st floor and Attics are above the floor space.

Category Rank Legend

"A" - No Asbestos Containing Materials - Sample Results indicate NO ACM on pipes, fittings, elbows, or equipment located within this functional space, and NO VISIBLE DEBRIS or DAMAGE observed at time of this inspection.
"B" - Asbestos Containing Materials Exist - Sample Results indicate ACM on pipes, fittings, elbows, or equipment located within this functional space, HOWEVER, NO VISIBLE DEBRIS or DAMAGE observed at time of this inspection.
"C" - Asbestos Containing Materials Exist - Sample Results indicate ACM on pipes, fittings, elbows, or equipment located within this functional space, and LOCALIZED VISIBLE DEBRIS or DAMAGE observed at time of this inspection.
"D" - Asbestos Containing Materials Exist - Sample Results indicate ACM on pipes, fittings, elbows, or equipment located within this functional space and DISTRIBUTED VISIBLE DEBRIS or SIGNIFICANT DAMAGE observed at time of this inspection.
"E" - No Bulk Sample Results Available SUSPECT ACM OBSERVED. Contact OEMS immediately for additional instructions.

Attic/Crawlspace	Access Area	Floor Surface	Category Rank	Comments
Crawl Space	Crawl Space/Auditorium	Concrete	A	Fiberglass PI, Hard Fittings
Attic	Fifth Floor Fan Room	Wire Lathe	A	Fiberglass PI, Hard Fittings
Attic	Fifth Floor "B" Stairwell	Wire Lathe	A	Fiberglass PI, Hard Fittings
Attic	Fifth Floor "A" Stairwell & Roof	Concrete	A	Fiberglass PI, Hard Fittings

VII. Summary list of Pipe Chase/Pipe Shaft DATA for this location

These charts are to be used for a quick reference regarding the information known about the Pipe Chases and/or Pipe Shafts inspection DATA within this facility. Contact OEMS prior to performing renovation activities any Pipe Chase and/or Pipe Shaft within this facility and refer to the below chart and legend for Asbestos Content of various materials identified within each space. The Data relative to these spaces is updated as conditions change regarding Inspection, Abatement and/or Renovation activity on a case by case basis for each specific location and facility. In general, Pipe Chases are horizontal spaces and Pipe Shafts are vertical spaces.

<i>Element</i>	<i>Floor</i>	<i>On Site Room Name</i>	<i>Material</i>	<i>Confirmed Assumed NAD/Non Suspect</i>	<i>Amount of Material</i>	<i>Amount of Damage</i>	<i>Comments</i>
1	1	Classroom 100 Pipe Shaft	Pipe Fitting Insulation	Confirmed	3 EA	0	
1	1	Classroom 100 Pipe Shaft	Fiberglass Pipe Insulation	Non Suspect ACM	2 LF	0	
1	1	Classroom 101 Closet Pipe Shaft	Pipe Insulation 2- 6 inch	Confirmed	12 LF	0	
1	1	Large Cafeteria Pipe Shaft	Pipe Insulation 2- 6 inch	Confirmed	12 LF	0	
1	1	Large Cafeteria Pipe Shaft	Pipe Insulation > 6 inch	Confirmed	12 LF	0	
1	1	Large Cafeteria Pipe Shaft	Fiberglass Pipe Insulation	Non Suspect ACM	12 LF	0	
1	1	Classroom 108 Pipe Chase	X	X	X	X	No Access
1	1	Stairwell C Pipe Chase	X	X	X	X	No Access
1	1	Stairwell D Pipe Chase	X	X	X	X	No Access
1	1	Classroom 119 Pipe Chase	X	X	X	X	No Access
2	1	Custodial Closet and Pipe Chase adjacent Girl's Restroom adjacent Gym	Pipe Fitting Insulation	Confirmed	30 EA	0	
2	1	Custodial Closet and Pipe Chase adjacent Girl's Restroom adjacent Gym	Fiberglass Pipe Insulation	Non Suspect ACM	100 LF	0	
1	2	Classroom 210 Pipe Chase	X	X	X	X	No Access
1	2	Stairwell C Pipe Chase at 2nd Floor	X	X	X	X	No Access
1	2	Stairwell D Pipe Chase at 2nd Floor	Pipe Fitting Insulation	NAD	9 EA	0	
1	2	Stairwell D Pipe Chase at 2nd Floor	Fiberglass Pipe Insulation	Non Suspect ACM	75 LF	0	
1	2	Office 218 Pipe Chase	X	X	X	X	No Access
1	2	Pipe Shaft outside Office 201	Pipe Insulation 2- 6 inch	Confirmed	12 LF	0	
1	2	Pipe Shaft in Hallway outside IMC	X	X	X	X	No Access
1	3	Classroom 328 Pipe Chase	Pipe Fitting Insulation	Confirmed	5 EA	0	

<i>Element</i>	<i>Floor</i>	<i>On Site Room Name</i>	<i>Material</i>	<i>Confirmed Assumed NAD/Non Suspect</i>	<i>Amount of Material</i>	<i>Amount of Damage</i>	<i>Comments</i>
1	3	Classroom 328 Pipe Chase	Fiberglass Pipe Insulation	Non Suspect ACM	40 LF	40	
1	3	Pipe Shaft in Hallway outside Classroom 321	Pipe Insulation 2-6 inch	Confirmed	13 LF	13	
1	3	Pipe Shaft in Hallway outside Classroom 321	Pipe Insulation > 6 inch	Confirmed	13 LF	13	
1	3	Pipe Shaft in Hallway outside Classroom 321	Fiberglass Pipe Insulation	Non Suspect ACM	26 LF	26	
1	3	Pipe Shaft in Hallway outside Classroom 305	Pipe Insulation 2-6 inch	Confirmed	13 LF	13	
1	3	Classroom 314 Pipe Chase	Pipe Fitting Insulation	Confirmed	1 EA	1	
1	3	Classroom 314 Pipe Chase	Pipe Insulation 2-6 inch	Confirmed	1 LF	1	
1	3	Classroom 314 Pipe Chase	Fiberglass Pipe Insulation	Non Suspect ACM	30 LF	30	
1	3	Stairwell C Pipe Chase at 3rd Floor	Pipe Fitting Insulation	Confirmed	8 EA	8	
1	3	Stairwell C Pipe Chase at 3rd Floor	Fiberglass Pipe Insulation	Non Suspect ACM	50 LF	50	
1	3	Stairwell D Pipe Chase at 3rd Floor	Pipe Fitting Insulation	Confirmed	3 EA	3	
1	3	Stairwell D Pipe Chase at 3rd Floor	Fiberglass Pipe Insulation	Non Suspect ACM	30 LF	30	
1	4	Pipe Shaft outside Classroom 405	Pipe Insulation 2-6 inch	Confirmed	12 LF	12	
1	4	Office 413 Pipe Chase	Pipe Fitting Insulation	NAD	3 EA	3	
1	4	Office 413 Pipe Chase	Fiberglass Pipe Insulation	Non Suspect ACM	50 LF	50	
1	4	Stairwell C Pipe Chase at 4th Floor	Pipe Fitting Insulation	NAD	6 EA	6	
1	4	Stairwell C Pipe Chase at 4th Floor	Fiberglass Pipe Insulation	Non Suspect ACM	50 LF	50	
1	4	Pipe Shaft in Hallway outside Classroom 419	Pipe Insulation 2-6 inch	Confirmed	15 LF	15	
1	4	Pipe Shaft in Hallway outside Classroom 419	Pipe Insulation > 6 inch	Confirmed	15 LF	15	
1	4	Pipe Shaft in Hallway outside Classroom 419	Fiberglass Pipe Insulation	Non Suspect ACM	30 LF	30	
1	4	Pipe Shaft in Hallway outside Classroom 419	Fiberglass Pipe Insulation	Non Suspect ACM	30	30	
1	4	Stairwell D Pipe Chase at 4th Floor	Pipe Fitting Insulation	NAD	3	0	
1	4	Stairwell D Pipe Chase at 4th Floor	Fiberglass Pipe Insulation	Non Suspect ACM	30	0	

<i>Element</i>	<i>Floor</i>	<i>On Site Room Name</i>	<i>Material</i>	<i>Confirmed Assumed NAD/Non Suspect</i>	<i>Amount of Material</i>	<i>Amount of Damage</i>	<i>Comments</i>
1	4	Office 424 Pipe Chase	Pipe Fitting Insulation	NAD	3 EA	0	
1	4	Office 424 Pipe Chase	Fiberglass Pipe Insulation	Non Suspect ACM	60 LF	0	
1	5	Boy's Restroom Pipe Chase	Fiberglass Pipe Insulation	Non Suspect ACM	25 LF	0	
1	5	Girl's Restroom Pipe Chase	X	X	X	X	No Access
2	B	Boy's Locker Room Custodial Closet and Pipe Chase	Pipe Fitting Insulation	Confirmed	20 EA	0	
2	B	Boy's Locker Room Custodial Closet and Pipe Chase	Fiberglass Pipe Insulation	Non Suspect ACM	100 LF	0	

Section I

Report of Re-Inspection

A. Introduction

B. Three-Year Re-Inspection IX Overview

C. Post-Management Plan Activities and Changes

C.1 Sampling and Analysis

C.2 New Floor Tile Sampling

C.3 Abatement Activity

C.4 Periodic Six-Month Surveillance (Damaged Materials)

Section I - A

Report of Re-inspection

Introduction

The Three-Year Re-inspection IX was performed to fulfill the requirements of 40 CFR Part 763 - the Asbestos Hazard Emergency Response Act (AHERA). As required by AHERA, each Local Education Agency (LEA) must re-inspect all known confirmed or assumed Asbestos Containing Building Material (ACBM) located in the LEA's facilities. This re-inspection is intended to update the original Asbestos Management Plan for the LEA's facilities.

Multiple Building Inspectors of several firms performed the 2015/2016 re-inspection. The re-inspection report/Management Plan of 2015-2016 were reviewed and prepared collectively by Management Planner Megan Vala, Mary Anne Lerro of Criterion Laboratories, Inc. and Monique Causley, of Synertech Inc.

All of the certificates can be found in Section III.

During the re-inspection of each School District of Philadelphia facility, all of the Management Plans for that facility were reviewed. Information from the conclusions section of that report is included in this report. Additionally, information on activities such as abatements, cleanings, sampling and inspections, which have taken place since the completion of the original Management Plan, were reviewed during the re-inspection. Information on those activities is included in this report.

As mandated by the U S EPA AHERA regulations, all future periodic Six-Month inspections and Three-Year Re-inspections of this location will be performed and the Inspection Data in this report will be updated accordingly.

Section I - B

Three-Year Re-inspection IX Overview

Each homogeneous area of Asbestos Containing Building Material (ACBM) listed in the original Management Plan or in the 1992, 1995, 1998, 2001, etc., Three-Year Re-inspection reports were inspected for the AHERA Three-Year Re-inspection Volume IX, and the information for that material verified. Any changes to a homogeneous area listed in the updates to the Management Plans were verified. Any area of suspected ACBM found in the course of the re-inspection, and not listed in the Management Plan or updates, were either assumed to contain asbestos or sampled and analyzed to determine their asbestos content. Any such new areas either assumed to contain asbestos or determined through analysis to contain asbestos were included in the report of the Three-Year Re-inspection. The results of the AHERA Three-Year Re-inspection IX are tabulated in the Room by Room log reports located in *Section II-C* of this report.

As previously noted, all future periodic Six-Month inspections and Three-Year Re-inspections of this location will be performed and the Inspection Data in this report will be updated accordingly.

Section I – C.1

Post Management Plan Activities/Changes

Information on activities affecting Asbestos Containing Building Materials (ACBMs) at this location is contained in updates to the Management Plan. These updates are kept on file by the School District of Philadelphia and were reviewed for this project. Updates to the Management Plan include the following: *Sampling and Analysis, New Tile Installation, Abatement Activity and Periodic Six-Month Surveillance Data.*

Sampling and Analysis

In the event Sampling occurs, data will be listed here.

Section I – C.2

Information on the installation of new floor tiles/renovation activities affecting Asbestos Containing Building Materials (ACBMs) at this location is contained in updates to the Management Plan. These updates are kept on file by the School District of Philadelphia and were reviewed for this project. Updates to the Management Plan include the following:

New Floor Tile Sampling

In the event that new tile is installed, the material must be tested prior to installation.

Section I – C.3

Information on the Asbestos Abatement and renovation activities affecting Asbestos Containing Building Materials (ACBMs) at this location is contained in updates to the Management Plan. These updates are kept on file by the School District of Philadelphia and were reviewed for this project. Updates to the Management Plan include the following:

Abatement Activity

<i>Date</i>	<i>Floor</i>	<i>Location</i>	<i>Material</i>	<i>Color</i>	<i>Removed or Encapsulated</i>	<i>Quantity</i>
10/15/2015	1	Element #1 South gym entrance, below stairs	Floor Tile 9" x 9"	Green	Removed	120 SF
10/15/2015	Basement	Girls locker room. Second area with entry on the right	Pipe Insulation >6 inches	N/A	Removed	2 LF
10/15/2015	2nd	Hallway. Pipe directly across from room 201	Pipe Insulation >6 inches	N/A	Removed	4 LF

Section I – C.4

Information on the AHERA inspection that noted damage to various Building Materials at this location is contained in updates to the Management Plan. These updates are kept on file by the School District of Philadelphia and were reviewed for this project. Work orders are created for Corrective Action responses and tracked for completion. Updates to the Management Plan include the following:

Periodic (Six-Month) Surveillance (Damaged Materials)

<i>Date</i>	<i>Element</i>	<i>Floor</i>	<i>On Site Room Name</i>	<i>Material</i>	<i>Amount of Material</i>	<i>Amount of Damage</i>
12/1/2016	1	1	Classroom 101	Floor Tile VAT 9" x 9"	1042 SF	10 SF
12/1/2016	1	1	Classroom 105	Floor Tile VAT 12" x 12"	905 SF	10 SF
12/1/2016	1	1	Classroom 107	Floor Tile VAT 9" x 9"	740 SF	1 SF
12/1/2016	1	1	Large Cafeteria	Floor Tile VAT 12" x 12"	4225 SF	28 SF
12/1/2016	1	1	Classroom 109A	Floor Tile VAT 12" x 12"	530 SF	2 SF
12/1/2016	1	1	Kitchen	Linoleum	1480 SF	25 SF
12/1/2016	1	1	Kitchen Restroom	Floor Tile VAT 12" x 12"	110 SF	16 SF
12/1/2016	1	1	Auditorium Stage	Plaster Ceiling	1500 SF	45 SF
12/1/2016	1	1	Old Girl's Large Locker Room	Pipe Insulation 2-6 inch	120 LF	1 LF
12/1/2016	1	1	Old Girl's Small Upper Locker Room	Pipe Fitting Insulation	8 EA	2 EA
12/1/2016	1	1	Old Boy's Large Locker Room	Pipe Fitting Insulation	21 EA	2 EA
12/1/2016	1	1	Old Boy's Large Locker Room	Pipe Insulation 2-6 inch	100 LF	3 LF
12/1/2016	1	1	Old Boy's Large Locker Room Restroom	Pipe Insulation 2-6 inch	9 LF	1 LF
12/1/2016	1	1	Old Boy's Small Upper Locker Room	Pipe Fitting Insulation	4 EA	1 EA
12/1/2016	1	1	Hallway to Side Entrance adjacent Blower Room 3	Troweled on Ceiling	200 SF	8 SF
12/1/2016	1	1	Hallway to Side Entrance adjacent Classrooms 100 & 121	Troweled on Ceiling	320 SF	2 SF
12/1/2016	2	1	Gym Office	Floor Tile VAT 9" x 9"	310 SF	10 SF
12/1/2016	1	2	Office 206 Special Education Suite Center Office	Floor Tile VAT 9" x 9"	120 SF	2 SF
12/1/2016	1	2	Classroom 210	Floor Tile VAT 9" x 9"	520 SF	1 SF
12/1/2016	1	2	Girl's Restroom	Linoleum	355 SF	50 SF
12/1/2016	1	2	Office in Storage Room 203A	Floor Tile VAT 9" x 9"	100 SF	1 SF
12/1/2016	1	2	Office 203C	Floor Tile VAT 9" x 9"	80 SF	1 SF
12/1/2016	1	2	Office 203D	Floor Tile VAT 9" x 9"	115 SF	8 SF
12/1/2016	1	2	Storage Room 203E	Floor Tile VAT 9" x 9"	80 SF	4 SF
12/1/2016	1	2	Office 203F Picture ID Room	Floor Tile VAT 9" x 9"	80 SF	1 SF

<i>Date</i>	<i>Element</i>	<i>Floor</i>	<i>On Site Room Name</i>	<i>Material</i>	<i>Amount of Material</i>	<i>Amount of Damage</i>
12/1/2016	1	2	Office 204, 2nd Office from Left	Floor Tile VAT 9" x 9"	115 SF	1 SF
12/1/2016	1	2	Office 204, Storage Room, 5th Room from Left	Floor Tile VAT 9" x 9"	100 SF	2 SF
12/1/2016	1	2	Office 201 Common Area	Floor Tile VAT 9" x 9"	170 SF	4 SF
12/1/2016	1	2	Assistant Principal's Office	Floor Tile VAT 9" x 9"	180 SF	2 SF
12/1/2016	1	2	Office 202 Roster Office	Floor Tile VAT 9" x 9"	480 SF	2 SF
12/1/2016	1	2	IMC Gated Room	Floor Tile VAT 9" x 9"	700 SF	15 SF
12/1/2016	1	3	Classroom 321	Pipe Insulation 2-6 inch	16 LF	2 LF
12/1/2016	1	3	Pipe Shaft in Hallway outside Classroom 305	Pipe Insulation 2-6 inch	13 LF	1 LF
12/1/2016	1	3	Classroom 314	Floor Tile VAT 9" x 9"	730 SF	15 SF
12/1/2016	1	3	Nurse's Office Small Restroom	Floor Tile VAT 9" x 9"	24 SF	1 SF
12/1/2016	1	3	Classroom 320	Pipe Insulation 2-6 inch	6 LF	1 LF
12/1/2016	1	3	Classroom 330	Floor Tile VAT 9" x 9"	755 SF	10 SF
12/1/2016	1	4	Classroom 403	Floor Tile VAT 12" x 12"	400 SF	2 SF
12/1/2016	1	4	Office 404	Floor Tile VAT 12" x 12"	805 SF	7 SF
12/1/2016	1	4	Mechanical Room inside Office 404	Floor Tile VAT 12" x 12"	435 SF	2 SF
12/1/2016	1	4	Classroom 410	Linoleum	600 SF	3 SF
12/1/2016	1	4	Classroom 412	Linoleum	624 SF	3 SF
12/1/2016	1	4	Boy's Restroom, Labeled Men's Restroom	Linoleum	355 SF	25 SF
12/1/2016	1	4	Classroom 415	Floor Tile VAT 12" x 12"	1145 SF	20 SF
12/1/2016	1	4	Pipe Shaft in Hallway outside Classroom 419	Pipe Insulation > 6 inch	15 LF	2 LF
12/1/2016	1	4	Girl's Restroom	Linoleum	355 SF	15 SF
12/1/2016	1	4	Office 424	Linoleum	225 SF	15 SF
12/1/2016	1	4	Classroom 426	Linoleum	624 SF	2 SF
12/1/2016	1	4	Office 429	Linoleum	225 SF	10 SF
12/1/2016	1	5	Classroom 500 Storage Room with Double Doors	Floor Tile VAT 12" x 12"	440 SF	3
12/1/2016	1	5	Closet inside Storage Room with Double Doors inside Classroom 500	Floor Tile VAT 9" x 9"	144 SF	10
12/1/2016	1	5	Classroom 512	Transite Table Top	140 SF	10
12/1/2016	1	5	5th floor Fan Room	Vibration Damper Cloth	15 SF	1
12/1/2016	1	B	Former Daycare Infants	Floor Tile VAT 12" x 12"	700 SF	28
12/1/2016	1	B	Former Daycare Office between Infants & Toddlers along Exterior Wall	Floor Tile VAT 12" x 12"	42 SF	1
12/1/2016	1	B	Fan Room Blower Room 4	Pipe Fitting Insulation	80 EA	1
12/1/2016	1	B	Fan Room Blower Room 4	Pipe Insulation 2-6 inch	345 LF	1
12/1/2016	1	B	Hallway to Blower Room 4	Floor Tile VAT 9" x 9"	360 SF	5
12/1/2016	1	B	Stairwell C Restroom, Visiting Team Locker Boy's	Floor Tile VAT 9" x 9"	200 SF	1

Section II

Re-Inspection Data

A. Introduction

B. Re-Inspection Key Definitions

C. Room by Room Location Log Report

Section II - A

Re-inspection Data

Introduction

The following information documents the Three-Year Re-inspection IX of the subject school/facility. The Homogeneous Area Reports were produced using the building inspector's field data on the facility. The key to the Homogeneous Area Report is outlined in the following pages of this report.

Section II - B
(page 1 of 4)

**SCHOOL DISTRICT OF PHILADELPHIA
AHERA THREE YEAR RE-INSPECTION IX**

ITEM	DEFINITION
ULCS#	Individual identification number assigned to each school within the School District of Philadelphia.
HOMOGENEOUS AREA ID#	Identification number assigned to each homogeneous area in a school/facility. Each section of the homogeneous area ID is significant. 1010/01/01/01 A B C D A. Is the ULCS# for the school. B. Designates the specific building/building area within the school. C. Designates the floor or level within the building/building area. D. Designates the homogeneous material within that floor or level. Note: Item D may be a number or a letter.
SYSTEM AFFECTED	Corresponds to the AHERA system for classifying materials. T : Thermal System S : Surfacing System M : Miscellaneous
ITEM AFFECTED	Is a description of the homogeneous material.
ORIGINAL INSPECTION DATA	This section contains the information found in the original Management Plan (1988-1989).
AMOUNT OF MATERIAL/ UNIT	Quantity of material, and measuring unit. Units include: Square Feet (SF) Each (EA) Linear Feet (LF) Cubic Feet (CF).

**SCHOOL DISTRICT OF PHILADELPHIA
AHERA THREE YEAR RE-INSPECTION IX**

RE-INSPECTION FORM KEY

ITEM	DEFINITION
CND Condition	Corresponds to AHERA condition rating for materials. 0 : No Damage 1 : Damage 2 : Significant Damage
DP Damage Potential	Corresponds to the AHERA material assessment system. 1 : Potential for Damage 2 : Potential for Significant Damage
ASMD Assumed Asbestos	This means that a material was not sampled for asbestos content during the original Management Plan inspection.
RA Response Action	This corresponds to the AHERA system of response action rating for materials. 1 : Establish O&M Program 2 : Repair and Establish O&M Program 3 : Enclose 4 : Encapsulate 5 : Remove 6 : Partial Removal and Establish O&M Program
CHANGES	This section describes changes to the homogeneous material in the twenty-four years since the original AHERA inspection. The abbreviations are defined below. RMVD : Removed ENCL : Enclosed ENCP : Encapsulated DMGD : Damaged SMPLD : Sampled MTRL : Material RPRD : Repaired N/L : None Located RPLCD : Replaced

**SCHOOL DISTRICT OF PHILADELPHIA
AHERA THREE-YEAR RE-INSPECTION IX**

RE-INSPECTION FORM KEY

ITEM	DEFINITION												
THREE YEAR RE-INSPECTION	<p>This section contains the information obtained from the Three-Year Re-inspection IX. With three exceptions, the information categories are identical in format and meaning to those found in the original inspection data section. The three exceptions are defined below.</p>												
DMGD AMT Amount Damaged	<p>This section gives the quantity of damaged material in a homogeneous area. The quantity is shown in the same format as the amount of material/unit section.</p>												
NF Newly Friable	<p>This section identifies materials in the original Management Plan which have since become friable.</p>												
RA Response Action	<p>This rating is based on the AHERA regulations, and is comparable to the RA rating found in the "Original Inspection Data" section. The following table details the response actions.</p> <table><tr><td>1.</td><td>Establish O&M Program</td></tr><tr><td>2.</td><td>Repair and Establish O&M Program</td></tr><tr><td>3.</td><td>Enclose</td></tr><tr><td>4.</td><td>Encapsulate</td></tr><tr><td>5.</td><td>Remove</td></tr><tr><td>6.</td><td>Partial Removal and Establish O&M Program</td></tr></table> <p>a. High Priority Response The homogeneous material has been scheduled for abatement or other response action.</p> <p>b. Medium Priority Response The homogeneous material will be scheduled for abatement or other response action as soon as the high priority responses have been addressed.</p> <p>c. Low Priority Response The homogeneous material will be scheduled for abatement or other response action as soon as the medium priority responses have been addressed.</p> <p>d. On-Going Response/Operations and Maintenance The homogeneous material does not require abatement or other response action at present, and should be included in the facility's on-going operations and maintenance program.</p>	1.	Establish O&M Program	2.	Repair and Establish O&M Program	3.	Enclose	4.	Encapsulate	5.	Remove	6.	Partial Removal and Establish O&M Program
1.	Establish O&M Program												
2.	Repair and Establish O&M Program												
3.	Enclose												
4.	Encapsulate												
5.	Remove												
6.	Partial Removal and Establish O&M Program												

**SCHOOL DISTRICT OF PHILADELPHIA
AHERA THREE-YEAR RE-INSPECTION IX**

RE-INSPECTION FORM KEY

The information presented in the changes section has been compiled from a variety of sources, including the Re-inspection and the following:

- * Quality Control/Quality Assurance Reports of asbestos abatement projects, prepared by consultants to the School District.
- * Permit and Notification Forms for asbestos abatement projects.
- * Periodic Surveillance Forms
- * Operations and Maintenance activities performed by School District personnel.
- * Verbal information from School District personnel.
- * Reports of sampling and analysis of suspected materials by both School District personnel and outside consultants.

**ROOM BY
ROOM
LOCATION LOG
REPORT**

This section gives information, including damage amount and location, for a specific homogeneous material on a room-by-room basis and follows the Re-inspection form.

NOTE: The disparate nature of the above sources of information prohibits the verification of much information within the scope of the AHERA Three-Year Re-inspection. Discrepancies and omissions may exist in this information, and therefore is included on an "as is" basis. The inspectors for the Three-Year Re-inspection IX evaluated homogeneous areas based on the materials current condition and location, as evidenced during the inspector's site visit.

Section II - C

Room by Room Location Log Report

These charts are to be used for a quick reference* in order to avoid the unknowing disturbance of Asbestos Containing Materials during any and all Operations, Maintenance, Renovation, and/or Demolition activities at this location.

NOTE:

*Contact OEMS prior to the disturbance of any of the materials that are listed as **Confirmed and/or Assumed**.*

The quantities listed for (NAD) non-asbestos containing materials and/or Non-Suspect Materials are only estimated and were not measured for the purpose of this report. Field verification of quantities for renovation purposes would be necessary.

4020 Overbrook HS 2015-2016 AHERA Three Year Report

School District of Philadelphia			AHERA Three-Year Reinspection 2015-2016										Reinspection Date: 10/21/2015											
Overbrook High School			Room by Room Location Log Report										Building Inspector: Bernard Brunner											
5898 Lancaster Avenue, Philadelphia, PA 19131													Certificate Number: 45397											
ULCS# 4020													Management Planner: M. Causley											
Year Built: 1926													Certificate Number: ACC-0215-8-010											
Element	Room	On Site Room Name	System Affected	Material Description	HID#	Confirmed	Assumed	NAD	Non Suspect ACM	Amount of Material	SF	LF	EA	Amount of Damage	SF	LF	EA	Color required for VAT	Comments/Description/Notes	Attic / Crawl Space Ranking	Damage Potential (DP)	Newly Friable (NF)	Response Action (RA)	
1	1	Classroom 100		Pipe Fitting Insulation	4020/01/01/24	Confirmed				1				0									1/D	
1	1	Classroom 100	N/A	Fiberglass Pipe Insulation		Non Suspect ACM				35				0								N/A	N/A	
1	1	Classroom 100	N/A	Ceiling Tile 2' x 4'		NAD				1060				0								N/A	N/A	
1	1	Classroom 100	N/A	Plaster Ceiling		NAD				1060				0								N/A	N/A	
1	1	Classroom 100	N/A	Plaster Walls		NAD				1635				5								N/A	N/A	
1	1	Classroom 100	N/A	Ceramic Tile Walls		Non Suspect ACM				785				0								N/A	N/A	
1	1	Classroom 100	M	Floor Tile VAT 12" x 12"	4020/01/01/QQ	Assumed				1060				0				Grey				1	No	
1	1	Classroom 100	N/A	Wood Floor		Non Suspect ACM				1060				0								N/A	N/A	
1	1	Classroom 100	M	Blackboard Glue Dots	4020/01/01/AET/BB/2600	Assumed				60				0								1	No	
1	1	Classroom 100 Left Storage Room furthest from Entrance	N/A	Ceiling Tile 2' x 4'		NAD				468				0								N/A	N/A	
1	1	Classroom 100 Left Storage Room furthest from Entrance	N/A	Plaster Ceiling		NAD				468				0								N/A	N/A	
1	1	Classroom 100 Left Storage Room furthest from Entrance	N/A	Plaster Walls		NAD				1060				10								N/A	N/A	
1	1	Classroom 100 Left Storage Room furthest from Entrance	N/A	Ceramic Tile Walls		Non Suspect ACM				280				0								N/A	N/A	
1	1	Classroom 100 Left Storage Room furthest from Entrance	N/A	Sheetrock Wall		NAD				65				0								N/A	N/A	
1	1	Classroom 100 Left Storage Room furthest from Entrance	M	Floor Tile VAT 12" x 12"	4020/01/01/QQ	Assumed				468				0				Grey				1	No	
1	1	Classroom 100 Left Storage Room furthest from Entrance	N/A	Wood Floor		Non Suspect ACM				468				0								N/A	N/A	
1	1	Classroom 100 Left Storage Room furthest from Entrance	M	Blackboard Glue Dots	4020/01/01/AET/BB/2600	Assumed				35				0								1	No	
1	1	Classroom 100 Left Storage Room closest to Entrance	N/A	Fiberglass Pipe Insulation		Non Suspect ACM				8				0								N/A	N/A	
1	1	Classroom 100 Left Storage Room closest to Entrance	N/A	Ceiling Tile 2' x 4'		NAD				324				0								N/A	N/A	
1	1	Classroom 100 Left Storage Room closest to Entrance	N/A	Fiberglass Ceiling Tile 2' x 4'		Non Suspect ACM				96				0								N/A	N/A	
1	1	Classroom 100 Left Storage Room closest to Entrance	N/A	Plaster Ceiling		NAD				420				0								N/A	N/A	
1	1	Classroom 100 Left Storage Room closest to Entrance	N/A	Plaster Walls		NAD				1010				10								N/A	N/A	
1	1	Classroom 100 Left Storage Room closest to Entrance	N/A	Sheetrock Wall		NAD				65				0								N/A	N/A	
1	1	Classroom 100 Left Storage Room closest to Entrance	M	Floor Tile VAT 12" x 12"	4020/01/01/QQ	Assumed				420				0				Grey				1	No	
1	1	Classroom 100 Left Storage Room closest to Entrance	N/A	Wood Floor		Non Suspect ACM				420				0								N/A	N/A	
1	1	Classroom 100 Right Storage Closet closest to Blackboard	N/A	Plaster Ceiling		NAD				65				0								N/A	N/A	
1	1	Classroom 100 Right Storage Closet closest to Blackboard	N/A	Plaster Walls		NAD				390				0								N/A	N/A	
1	1	Classroom 100 Right Storage Closet closest to Blackboard	N/A	Wood Floor		Non Suspect ACM				65				0								N/A	N/A	
1	1	Classroom 100 Right Storage Closet closest to Windows	N/A	Plaster Ceiling		NAD				145				0								N/A	N/A	
1	1	Classroom 100 Right Storage Closet closest to Windows	N/A	Plaster Walls		NAD				625				20								N/A	N/A	
1	1	Classroom 100 Right Storage Closet closest to Windows	N/A	Wood Floor		Non Suspect ACM				145				0								N/A	N/A	
1	1	Classroom 100 Pipe Shaft	T	Pipe Fitting Insulation	4020/01/01/24	Confirmed				3				0								1	No	
1	1	Classroom 100 Pipe Shaft	N/A	Fiberglass Pipe Insulation		Non Suspect ACM				2				0								N/A	N/A	
1	1	Classroom 101	N/A	Fiberglass Pipe Insulation		Non Suspect ACM				42				0								N/A	N/A	
1	1	Classroom 101	N/A	Ceiling Tile 2' x 4'		NAD				1060				0								N/A	N/A	
1	1	Classroom 101	N/A	Plaster Ceiling		NAD				1060				0								N/A	N/A	
1	1	Classroom 101	N/A	Plaster Walls		NAD				1635				0								N/A	N/A	
1	1	Classroom 101	M	Floor Tile VAT 9" x 9"	4020/01/01/20	Confirmed				1042				10				Tan	Cracked tiles			1	No	
1	1	Classroom 101	M	Floor Tile VAT 9" x 9"	4020/01/01/20	Confirmed				5				0				Blue				1	No	
1	1	Classroom 101	M	Floor Tile VAT 12" x 12"	4020/01/01/QQ	Assumed				13				0				Tan				1	No	
1	1	Classroom 101	N/A	Wood Floor		Non Suspect ACM				1060				0								N/A	N/A	
1	1	Classroom 101	M	Blackboard Glue Dots	4020/01/01/AET/BB/2600	Assumed				80				0								1	No	
1	1	Classroom 101 Closet	N/A	Fiberglass Pipe Insulation		Non Suspect ACM				32				0								N/A	N/A	
1	1	Classroom 101 Closet	N/A	Plaster Ceiling		NAD				195				0								N/A	N/A	
1	1	Classroom 101 Closet	N/A	Plaster Walls		NAD				770				350								N/A	N/A	
1	1	Classroom 101 Closet	N/A	Wood Floor		Non Suspect ACM				195				5								N/A	N/A	
1	1	Classroom 101 Closet Pipe Shaft	T	Pipe Insulation 2-6 inch	4020/01/01/18	Confirmed				12				0								1	No	
1	1	Women's Restroom near Main Entrance	T	Pipe Fitting Insulation	4020/01/01/24	Confirmed				4				0					Restroom is not currently being used.				1	No
1	1	Women's Restroom near Main Entrance	N/A	Fiberglass Pipe Insulation		Non Suspect ACM				60				0					Restroom is not currently being used.				N/A	N/A
1	1	Women's Restroom near Main Entrance	N/A	Plaster Ceiling		NAD				240				0					Restroom is not currently being used.				N/A	N/A
1	1	Women's Restroom near Main Entrance	N/A	Plaster Walls		NAD				385				0					Restroom is not currently being used.				N/A	N/A
1	1	Women's Restroom near Main Entrance	N/A	Marble Walls		Non Suspect ACM				100				0					Restroom is not currently being used.				N/A	N/A
1	1	Women's Restroom near Main Entrance	N/A	Wood Floor		Non Suspect ACM				240				0					Restroom is not currently being used.				N/A	N/A
1	1	Women's Restroom near Main Entrance	M	Vibration Damper Cloth	4020/01/01/25	Assumed				2				0					Restroom is not currently being used.				1	No
1	1	Custodial Storage Room near Main Entrance	N/A	Plaster Ceiling		NAD				240				0								N/A	N/A	
1	1	Custodial Storage Room near Main Entrance	N/A	Plaster Walls		NAD				385				0								N/A	N/A	
1	1	Custodial Storage Room near Main Entrance	N/A	Wood Floor		Non Suspect ACM				120				0								N/A	N/A	
1	1	Custodial Storage Room near Main Entrance	N/A	Cement Floor		Non Suspect ACM				120				0								N/A	N/A	
1	1	Classroom 102	N/A	Plaster Ceiling		NAD				720				0								N/A	N/A	
1	1	Classroom 102	N/A	Plaster Walls		NAD				650				2								N/A	N/A	
1	1	Classroom 102	N/A	Sheetrock Wall		NAD				290				0								N/A	N/A	
1	1	Classroom 102	N/A	Brick Wall		Non Suspect ACM				360				0								N/A	N/A	
1	1	Classroom 102	N/A	Cement Floor		Non Suspect ACM				720				0								N/A	N/A	
1	1	Classroom 102	M	Blackboard Glue Dots	4020/01/01/AET/BB/2600	Assumed				40				0								1	No	
1	1	Classroom 102	M	Transite Electrical Panel	4020/01/01/AET/BB/2350	Assumed				20				0								1	No	
1	1	Classroom 103	T	Pipe Fitting Insulation	4020/01/01/24	Confirmed				14				0								1	No	
1	1	Classroom 103	N/A	Fiberglass Pipe Insulation		Non Suspect ACM				92				0								N/A	N/A	
1	1	Classroom 103	N/A	Plaster Ceiling		NAD				720				0								N/A	N/A	
1	1	Classroom 103	N/A	Plaster Walls		NAD				85				0								N/A	N/A	
1	1	Classroom 103	N/A	Sheetrock Wall		NAD				290				0								N/A	N/A	
1	1	Classroom 103	N/A	Brick Wall		Non Suspect ACM				925				0								N/A	N/A	
1	1	Classroom 103	N/A	Cement Floor		Non Suspect ACM				720				0								N/A	N/A	
1	1	Classroom 103	M	Blackboard Glue Dots	4020/01/01/AET/BB/2600	Assumed				40				0								1	No	
1	1	Classroom 103	N/A	Plaster Ceiling		NAD				60				0								N/A	N/A	
1	1	Classroom 103	N/A	Brick Wall		Non Suspect ACM				360				0								N/A	N/A	
1	1	Classroom 103	N/A	Wood Floor		Non Suspect ACM				60				0								N/A	N/A	
1	1	Classroom 103	N/A	Plaster Ceiling		NAD				300				20								N/A	N/A	
1	1	Classroom 103	N/A	Plaster Ceiling		NAD				300				20								N/A	N/A	
1	1	Classroom 103	N/A	Plaster Ceiling		NAD				300				20								N/A	N/A	
1	1	Classroom 103	N/A	Plaster Ceiling		NAD				300				20								N/A	N/A	
1	1	Classroom 103	N/A	Plaster Ceiling		NAD				300				20								N/A	N/A	
1	1	Classroom 103	N/A	Plaster Ceiling		NAD				300				20								N/A	N/A	
1	1	Classroom 103	N/A	Plaster Ceiling		NAD				300				20								N/A	N/A	
1	1	Classroom 103	N/A	Plaster Ceiling		NAD				300				20								N/A	N/A	
1	1	Classroom 103	N/A	Plaster Ceiling		NAD				300				20								N/A	N/A	
1	1	Classroom 103	N/A	Plaster Ceiling		NAD				300				20								N/A	N/A	
1	1	Classroom 103	N/A	Plaster Ceiling		NAD				300				20								N/A	N/A	
1																								

4020 Overbrook HS 2015-2016 AHERA Three Year Report

School District of Philadelphia Overbrook High School 5898 Lancaster Avenue, Philadelphia, PA 19131 ULCS# 4020 Year Built: 1926			AHERA Three-Year Reinspection 2015-2016 Room by Room Location Log Report										Reinspection Date: 10/21/2015 Building Inspector: Bernard Brunner Certificate Number: 45397 Management Planner: M. Causley Certificate Number: ACC-0215-8-010							
E l e m e n t	F l o o r	On Site Room Name	System Affected	Material Description	HID#	Confirmed Assumed NAD Non Suspect ACM	Amount of Material	SF LF EA	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic / Crawl Space Ranking	Damage Potential (DP)	Newly Friable (NF)	Response Action (RA)				
1	1	Data Center between Classrooms 103 & 104	N/A	Brick Wall		Non Suspect ACM	840	SF	0	SF				N/A	N/A	N/A				
1	1	Data Center between Classrooms 103 & 104	N/A	Cement Floor		Non Suspect ACM	300	SF	0	SF				N/A	N/A	N/A				
1	1	Vestibule at Entrance to Classrooms 104 & 105	T	Pipe Fitting Insulation	4020/01/01/24	Confirmed	3	EA	0	EA				1	No	1/D				
1	1	Vestibule at Entrance to Classrooms 104 & 105	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	34	LF	1	LF				N/A	N/A	N/A				
1	1	Vestibule at Entrance to Classrooms 104 & 105	N/A	Plaster Ceiling		NAD	50	SF	0	SF				N/A	N/A	N/A				
1	1	Vestibule at Entrance to Classrooms 104 & 105	N/A	Sheetrock Wall		NAD	245	SF	0	SF				N/A	N/A	N/A				
1	1	Vestibule at Entrance to Classrooms 104 & 105	N/A	Brick Wall		Non Suspect ACM	50	SF	0	SF				N/A	N/A	N/A				
1	1	Vestibule at Entrance to Classrooms 104 & 105	M	Floor Tile VAT 12" x 12"	4020/01/01/QQ	Assumed	50	SF	0	SF	Tan			1	No	1/D				
1	1	Vestibule at Entrance to Classrooms 104 & 105	N/A	Cement Floor		Non Suspect ACM	50	SF	0	SF				N/A	N/A	N/A				
1	1	Classroom 104	T	Pipe Fitting Insulation	4020/01/01/24	Confirmed	2	EA	0	EA				1	No	1/D				
1	1	Classroom 104	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	2	LF	0	LF				N/A	N/A	N/A				
1	1	Classroom 104	N/A	Plaster Ceiling		NAD	650	SF	0	SF				N/A	N/A	N/A				
1	1	Classroom 104	N/A	Sheetrock Wall		NAD	400	SF	0	SF				N/A	N/A	N/A				
1	1	Classroom 104	N/A	Brick Wall		Non Suspect ACM	830	SF	0	SF				N/A	N/A	N/A				
1	1	Classroom 104	M	Floor Tile VAT 12" x 12"	4020/01/01/QQ	Assumed	650	SF	0	SF	Tan			1	No	1/D				
1	1	Classroom 104	N/A	Cement Floor		Non Suspect ACM	650	SF	0	SF				N/A	N/A	N/A				
1	1	Classroom 104	M	Blackboard Glue Dots	4020/01/01/AET/BB/2600	Assumed	75	SF	0	SF				1	No	1/D				
1	1	Classroom 105	T	Pipe Fitting Insulation	4020/01/01/24	Confirmed	2	EA	0	EA				1	No	1/D				
1	1	Classroom 105	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	23	LF	0	LF				N/A	N/A	N/A				
1	1	Classroom 105	N/A	Plaster Ceiling		NAD	905	SF	5	SF				N/A	N/A	N/A				
1	1	Classroom 105	N/A	Sheetrock Wall		NAD	290	SF	0	SF				N/A	N/A	N/A				
1	1	Classroom 105	N/A	Brick Wall		Non Suspect ACM	1010	SF	0	SF				N/A	N/A	N/A				
1	1	Classroom 105	M	Floor Tile VAT 12" x 12"	4020/01/01/QQ	Assumed	905	SF	10	SF	Tan			1	No	6/C				
1	1	Classroom 105	N/A	Cement Floor		Non Suspect ACM	905	SF	1	SF				N/A	N/A	N/A				
1	1	Classroom 105	M	Blackboard Glue Dots	4020/01/01/AET/BB/2600	Assumed	65	SF	0	SF				1	No	1/D				
1	1	Classroom 105	M	Transite Electrical Panel	4020/01/01/AET/BB/2350	Assumed	30	SF	0	SF				1	No	1/D				
1	1	Classroom 105 Closet	X	X		X	X	X	X	X	X	No Access - No Key for Padlock		X	X	X				
1	1	Men's Restroom	T	Pipe Fitting Insulation	4020/01/01/24	Confirmed	4	EA	0	EA				1	No	1/D				
1	1	Men's Restroom	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	52	LF	3	LF				N/A	N/A	N/A				
1	1	Men's Restroom	N/A	Plaster Ceiling		NAD	288	SF	2	SF				N/A	N/A	N/A				
1	1	Men's Restroom	N/A	Plaster Walls		NAD	865	SF	0	SF				N/A	N/A	N/A				
1	1	Men's Restroom	N/A	Marble Walls		Non Suspect ACM	100	SF	0	SF				N/A	N/A	N/A				
1	1	Men's Restroom	N/A	Cement Floor		Non Suspect ACM	288	SF	0	SF				N/A	N/A	N/A				
1	1	Men's Restroom	M	Vibration Damper Cloth	4020/01/01/25	Assumed	2	SF	0	SF				1	No	1/D				
1	1	Faculty Room adjacent to Men's Restroom	N/A	Plaster Ceiling		NAD	288	SF	0	SF				N/A	N/A	N/A				
1	1	Faculty Room adjacent to Men's Restroom	N/A	Plaster Walls		NAD	865	SF	0	SF				N/A	N/A	N/A				
1	1	Faculty Room adjacent to Men's Restroom	N/A	Wood Floor		Non Suspect ACM	288	SF	0	SF				N/A	N/A	N/A				
1	1	Faculty Room adjacent to Men's Restroom	M	Blackboard Glue Dots	4020/01/01/AET/BB/2600	Assumed	105	SF	0	SF				1	No	1/D				
1	1	Classroom 107	N/A	Ceiling Tile 2' x 4'		NAD	740	SF	0	SF				N/A	N/A	N/A				
1	1	Classroom 107	N/A	Plaster Ceiling		NAD	740	SF	0	SF				N/A	N/A	N/A				
1	1	Classroom 107	N/A	Plaster Walls		NAD	420	SF	0	SF				N/A	N/A	N/A				
1	1	Classroom 107	N/A	Sheetrock Wall		NAD	290	SF	0	SF				N/A	N/A	N/A				
1	1	Classroom 107	N/A	Concrete Block Wall		Non Suspect ACM	290	SF	0	SF				N/A	N/A	N/A				
1	1	Classroom 107	N/A	Brick Wall		Non Suspect ACM	300	SF	0	SF				N/A	N/A	N/A				
1	1	Classroom 107	M	Floor Tile VAT 9" x 9"	4020/01/01/20	Confirmed	740	SF	1	SF	Green			1	No	6/C				
1	1	Classroom 107	N/A	Cement Floor		Non Suspect ACM	740	SF	0	SF				N/A	N/A	N/A				
1	1	Classroom 107	M	Blackboard Glue Dots	4020/01/01/AET/BB/2600	Assumed	100	SF	0	SF				1	No	1/D				
1	1	Large Cafeteria	N/A	Ceiling Tile 1' x 1'		NAD	4225	SF	0	SF				N/A	N/A	N/A				
1	1	Large Cafeteria	N/A	Fiberglass Ceiling Tile 2' x 2'		Non Suspect ACM	3750	SF	0	SF				N/A	N/A	N/A				
1	1	Large Cafeteria	N/A	Plaster Ceiling		NAD	4225	SF	0	SF				N/A	N/A	N/A				
1	1	Large Cafeteria	N/A	Sheetrock Ceiling		NAD	475	SF	25	SF				N/A	N/A	N/A				
1	1	Large Cafeteria	N/A	Brick Wall		Non Suspect ACM	3900	SF	0	SF				N/A	N/A	N/A				
1	1	Large Cafeteria	N/A	Sheetrock Wall		NAD	3900	SF	10	SF				N/A	N/A	N/A				
1	1	Large Cafeteria	N/A	Ceramic Tile Walls		Non Suspect ACM	1660	SF	10	SF				N/A	N/A	N/A				
1	1	Large Cafeteria	N/A	Vinyl Walls		Non Suspect ACM	130	SF	0	SF				N/A	N/A	N/A				
1	1	Large Cafeteria	M	Floor Tile VAT 12" x 12"	4020/01/01/QQ	Assumed	4225	SF	28	SF	Multi			1	No	6/C				
1	1	Large Cafeteria	N/A	Cement Floor		Non Suspect ACM	4225	SF	0	SF				N/A	N/A	N/A				
1	1	Large Cafeteria	M	Spline Ceiling Glue Dots	4020/01/01/AET/BB/2603	Assumed	4225	SF	0	SF				1	No	1/D				
1	1	Large Cafeteria Pipe Shaft	T	Pipe Insulation 2-6 inch	4020/01/01/18	Confirmed	12	LF	0	LF				1	No	1/D				
1	1	Large Cafeteria Pipe Shaft	T	Pipe Insulation > 6 inch	4020/01/1/PS/HH	Confirmed	12	LF	0	LF				1	No	1/D				
1	1	Storage Room between Elevator and Office 105/105A/Old Boy's Locker Room	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	12	LF	0	LF				N/A	N/A	N/A				
1	1	Storage Room between Elevator and Office 105/105A/Old Boy's Locker Room	N/A	Plaster Ceiling		NAD	240	SF	50	SF				N/A	N/A	N/A				
1	1	Storage Room between Elevator and Office 105/105A/Old Boy's Locker Room	N/A	Plaster Walls		NAD	820	SF	50	SF				N/A	N/A	N/A				
1	1	Storage Room between Elevator and Office 105/105A/Old Boy's Locker Room	N/A	Wood Floor		Non Suspect ACM	240	SF	0	SF				N/A	N/A	N/A				
1	1	Office 105/105A/Old Boy's Locker Room	N/A	Fiberglass Ceiling Tile 2' x 4'		Non Suspect ACM	220	SF	0	SF		Space is labeled 3 different ways: Paper taped to the door calls it Room 105, Painted on the wall next to the door is 105A, Painted on one of the wooden doors is Boy's Locker Room		N/A	N/A	N/A				
1	1	Office 105/105A/Old Boy's Locker Room	N/A	Plaster Ceiling		NAD	220	SF	0	SF		Space is labeled 3 different ways: Paper taped to the door calls it Room 105, Painted on the wall next to the door is 105A, Painted on one of the wooden doors is Boy's Locker Room		N/A	N/A	N/A				
1	1	Office 105/105A/Old Boy's Locker Room	N/A	Plaster Walls		NAD	295	SF	0	SF		Space is labeled 3 different ways: Paper taped to the door calls it Room 105, Painted on the wall next to the door is 105A, Painted on one of the wooden doors is Boy's Locker Room		N/A	N/A	N/A				
1	1	Office 105/105A/Old Boy's Locker Room	N/A	Brick Wall		Non Suspect ACM	210	SF	0	SF		Space is labeled 3 different ways: Paper taped to the door calls it Room 105, Painted on the wall next to the door is 105A, Painted on one of the wooden doors is Boy's Locker Room		N/A	N/A	N/A				

4020 Overbrook HS 2015-2016 AHERA Three Year Report

School District of Philadelphia Overbrook High School 5898 Lancaster Avenue, Philadelphia, PA 19131 ULCS# 4020 Year Built: 1926		AHERA Three-Year Reinspection 2015-2016 Room by Room Location Log Report										Reinspection Date: 10/21/2015 Building Inspector: Bernard Brunner Certificate Number: 45397 Management Planner: M. Causley Certificate Number: ACC-0215-8-010				
E l e m e n t	F l o o r	On Site Room Name	System Affected	Material Description	HID#	Confirmed Assumed NAD Non Suspect ACM	Amount of Material	SF LF EA	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic / Crawl Space Ranking	Damage Potential (DP)	Newly Friable (NF)	Response Action (RA)
1	1	Office 105/105A/Old Boy's Locker Room	N/A	Concrete Block Wall		Non Suspect ACM	290	SF	0	SF		Space is labeled 3 different ways: Paper taped to the door calls it Room 105, Painted on the wall next to the door is 105A, Painted on one of the wooden doors is Boy's Locker Room		N/A	N/A	N/A
1	1	Office 105/105A/Old Boy's Locker Room	M	Floor Tile VAT 9" x 9"	4020/01/01/20	Confirmed	220	SF	0	SF	Green	Space is labeled 3 different ways: Paper taped to the door calls it Room 105, Painted on the wall next to the door is 105A, Painted on one of the wooden doors is Boy's Locker Room		1	No	1/D
1	1	Office 105/105A/Old Boy's Locker Room	N/A	Cement Floor		Non Suspect ACM	220	SF	0	SF		Space is labeled 3 different ways: Paper taped to the door calls it Room 105, Painted on the wall next to the door is 105A, Painted on one of the wooden doors is Boy's Locker Room		N/A	N/A	N/A
1	1	Classroom 108	N/A	Fiberglass Ceiling Tile 2' x 4'		Non Suspect ACM	720	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 108	N/A	Plaster Ceiling		NAD	720	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 108	N/A	Plaster Walls		NAD	590	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 108	N/A	Brick Wall		Non Suspect ACM	410	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 108	N/A	Sheetrock Wall		NAD	290	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 108	M	Floor Tile VAT 12" x 12"	4020/01/01/QQ	Assumed	720	SF	0	LF	Grey			1	No	1/D
1	1	Classroom 108	M	Cement Floor		Non Suspect ACM	720	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 108	M	Blackboard Glue Dots	4020/01/01/AET/BB/2600	Assumed	50	SF	0	SF				1	No	1/D
1	1	Classroom 108 Pipe Chase	X	X		X	X	X	X	X	X	No Access - Access Panel Blocked by Cabinet		X	X	X
1	1	Classroom 106 on Left	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	4	LF	0	SF				N/A	N/A	N/A
1	1	Classroom 106 on Left	N/A	Plaster Ceiling		NAD	585	SF	5	SF				N/A	N/A	N/A
1	1	Classroom 106 on Left	N/A	Brick Wall		Non Suspect ACM	900	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 106 on Left	N/A	Sheetrock Wall		NAD	300	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 106 on Left	M	Floor Tile VAT 12" x 12"	4020/01/01/QQ	Assumed	585	SF	0	LF	Tan			1	No	1/D
1	1	Classroom 106 on Left	N/A	Cement Floor		Non Suspect ACM	585	SF	0	SF	Tan			N/A	N/A	N/A
1	1	Classroom 106 on Left	M	Blackboard Glue Dots	4020/01/01/AET/BB/2600	Assumed	110	SF	0	SF				1	No	1/D
1	1	Classroom 106 on Right	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	16	LF	0	SF				N/A	N/A	N/A
1	1	Classroom 106 on Right	N/A	Plaster Ceiling		NAD	460	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 106 on Right	N/A	Brick Wall		Non Suspect ACM	875	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 106 on Right	N/A	Sheetrock Wall		NAD	445	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 106 on Right	M	Floor Tile VAT 12" x 12"	4020/01/01/QQ	Assumed	460	SF	0	SF	Tan			1	No	1/D
1	1	Classroom 106 on Right	N/A	Wood Floor		Non Suspect ACM	225	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 106 on Right	N/A	Cement Floor		Non Suspect ACM	235	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 106 on Right	M	Blackboard Glue Dots	4020/01/01/AET/BB/2600	Assumed	60	SF	0	SF				1	No	1/D
1	1	Vestibule at Entrance to Classroom 106 on Left & Right	N/A	Plaster Ceiling		NAD	56	SF	0	SF				N/A	N/A	N/A
1	1	Vestibule at Entrance to Classroom 106 on Left & Right	N/A	Sheetrock Wall		NAD	160	SF	0	SF				N/A	N/A	N/A
1	1	Vestibule at Entrance to Classroom 106 on Left & Right	N/A	Brick Wall		Non Suspect ACM	50	SF	2	SF				N/A	N/A	N/A
1	1	Vestibule at Entrance to Classroom 106 on Left & Right	M	Floor Tile VAT 12" x 12"	4020/01/01/QQ	Assumed	56	SF	0	SF	Tan			1	No	1/D
1	1	Vestibule at Entrance to Classroom 106 on Left & Right	N/A	Cement Floor		Non Suspect ACM	56	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 106 on Right Closet	N/A	Plaster Ceiling		NAD	54	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 106 on Right Closet	N/A	Plaster Walls		NAD	65	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 106 on Right Closet	N/A	Brick Wall		Non Suspect ACM	300	SF	0	LF				N/A	N/A	N/A
1	1	Classroom 106 on Right Closet	M	Floor Tile VAT 12" x 12"	4020/01/01/QQ	Assumed	54	SF	0	SF	Tan			1	No	1/D
1	1	Classroom 106 on Right Closet	N/A	Wood Floor		Non Suspect ACM	54	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 109A	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	24	LF	0	SF				N/A	N/A	N/A
1	1	Classroom 109A	N/A	Fiberglass Ceiling Tile 2' x 4'		Non Suspect ACM	530	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 109A	N/A	Plaster Ceiling		NAD	530	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 109A	N/A	Brick Wall		Non Suspect ACM	590	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 109A	N/A	Sheetrock Wall		NAD	400	SF	0	LF				N/A	N/A	N/A
1	1	Classroom 109A	M	Floor Tile VAT 12" x 12"	4020/01/01/QQ	Assumed	530	SF	2	SF	Tan			1	No	6/C
1	1	Classroom 109A	N/A	Cement Floor		Non Suspect ACM	530	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 109B	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	20	LF	0	SF				N/A	N/A	N/A
1	1	Classroom 109B	N/A	Fiberglass Ceiling Tile 2' x 4'		Non Suspect ACM	455	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 109B	N/A	Plaster Ceiling		NAD	455	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 109B	N/A	Brick Wall		Non Suspect ACM	590	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 109B	N/A	Sheetrock Wall		NAD	470	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 109B	M	Floor Tile VAT 12" x 12"	4020/01/01/QQ	Assumed	455	SF	0	SF	Tan			1	No	1/D
1	1	Classroom 109B	N/A	Cement Floor		Non Suspect ACM	455	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 109A Closet	N/A	Plaster Ceiling		NAD	60	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 109A Closet	N/A	Brick Wall		Non Suspect ACM	390	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 109A Closet	N/A	Wood Wall		Non Suspect ACM	125	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 109A Closet	N/A	Wood Floor		Non Suspect ACM	60	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 109A Office	N/A	Fiberglass Ceiling Tile 2' x 4'		Non Suspect ACM	210	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 109A Office	N/A	Plaster Ceiling		NAD	210	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 109A Office	N/A	Brick Wall		Non Suspect ACM	620	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 109A Office	N/A	Sheetrock Wall		NAD	70	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 109A Office	M	Floor Tile VAT 12" x 12"	4020/01/01/QQ	Assumed	210	SF	0	SF	Tan			1	No	1/D
1	1	Classroom 109A Office	N/A	Wood Floor		Non Suspect ACM	210	SF	0	SF				N/A	N/A	N/A
1	1	Vestibule at Entrance to Classrooms 109A & 109B	N/A	Fiberglass Ceiling Tile 2' x 4'		Non Suspect ACM	85	SF	0	SF				N/A	N/A	N/A
1	1	Vestibule at Entrance to Classrooms 109A & 109B	N/A	Plaster Ceiling		NAD	85	SF	0	SF				N/A	N/A	N/A
1	1	Vestibule at Entrance to Classrooms 109A & 109B	N/A	Brick Wall		Non Suspect ACM	170	SF	0	SF				N/A	N/A	N/A
1	1	Vestibule at Entrance to Classrooms 109A & 109B	N/A	Sheetrock Wall		NAD	290	SF	0	SF				N/A	N/A	N/A
1	1	Vestibule at Entrance to Classrooms 109A & 109B	M	Floor Tile VAT 12" x 12"	4020/01/01/QQ	Assumed	85	SF	0	SF	Tan			1	No	1/D
1	1	Vestibule at Entrance to Classrooms 109A & 109B	N/A	Cement Floor		Non Suspect ACM	85	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 110 Office	N/A	Plaster Ceiling		NAD	180	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 110 Office	N/A	Plaster Walls		NAD	325	SF	5	SF				N/A	N/A	N/A
1	1	Classroom 110 Office	N/A	Wood Wall		Non Suspect ACM	145	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 110 Office	N/A	Wood Floor		Non Suspect ACM	180	SF	0	SF				N/A	N/A	N/A
1	1	Vestibule outside Classroom 110 & Classroom 110 Office	N/A	Plaster Ceiling		NAD	80	SF	0	SF				N/A	N/A	N/A

4020 Overbrook HS 2015-2016 AHERA Three Year Report

School District of Philadelphia Overbrook High School 5898 Lancaster Avenue, Philadelphia, PA 19131 ULCS# 4020 Year Built: 1926			AHERA Three-Year Reinspection 2015-2016 Room by Room Location Log Report										Reinspection Date: 10/21/2015 Building Inspector: Bernard Brunner Certificate Number: 45397 Management Planner: M. Causley Certificate Number: ACC-0215-8-010			
Element	Floor	On Site Room Name	System Affected	Material Description	HID#	Confirmed Assumed NAD Non Suspect ACM	Amount of Material	SF LF EA	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic / Crawl Space Ranking	Damage Potential (DP)	Newly Friable (NF)	Response Action (RA)
1	1	Vestibule outside Classroom 110 & Classroom 110 Office	N/A	Plaster Walls		NAD	220	SF	0	SF				N/A	N/A	N/A
1	1	Vestibule outside Classroom 110 & Classroom 110 Office	N/A	Wood Wall		Non Suspect ACM	255	SF	0	SF				N/A	N/A	N/A
1	1	Vestibule outside Classroom 110 & Classroom 110 Office	N/A	Wood Floor		Non Suspect ACM	80	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 110	N/A	Plaster Ceiling		NAD	675	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 110	N/A	Brick Wall		Non Suspect ACM	1240	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 110	M	Floor Tile VAT 12" x 12"	4020/01/01/QQ	Assumed	625	SF	0	SF	Grey			1	No	1/D
1	1	Classroom 110	N/A	Cement Floor		Non Suspect ACM	675	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 110	M	Blackboard Glue Dots	4020/01/01/AET/BB/2600	Assumed	60	SF	0	SF				1	No	1/D
1	1	Small Cafeteria	N/A	Ceiling Tile 1' x 1'		NAD	3145	SF	0	SF		Above Ceiling Tile		N/A	N/A	N/A
1	1	Small Cafeteria	N/A	Fiberglass Ceiling Tile 2' x 2'		Non Suspect ACM	2810	SF	0	SF		Ceiling Tile Fiberglass 2x2		N/A	N/A	N/A
1	1	Small Cafeteria	N/A	Plaster Ceiling		NAD	3145	SF	0	SF				N/A	N/A	N/A
1	1	Small Cafeteria	N/A	Sheetrock Ceiling		NAD	335	SF	0	SF				N/A	N/A	N/A
1	1	Small Cafeteria	N/A	Brick Wall		Non Suspect ACM	3000	SF	0	SF				N/A	N/A	N/A
1	1	Small Cafeteria	N/A	Sheetrock Wall		NAD	3000	SF	0	SF				N/A	N/A	N/A
1	1	Small Cafeteria	N/A	Ceramic Tile Walls		Non Suspect ACM	1285	SF	0	SF				N/A	N/A	N/A
1	1	Small Cafeteria	N/A	Vinyl Walls		Non Suspect ACM	220	SF	0	SF				N/A	N/A	N/A
1	1	Small Cafeteria	M	Floor Tile VAT 12" x 12"	4020/01/01/QQ	Assumed	3145	SF	0	SF	Multi			1	No	1/D
1	1	Small Cafeteria	N/A	Cement Floor		Non Suspect ACM	3145	SF	0	SF				N/A	N/A	N/A
1	1	Small Cafeteria	M	Spine Ceiling Glue Dots	4020/01/01/AET/BB/2603	Assumed	3145	SF	0	SF				1	No	1/D
1	1	Kitchen	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	25	LF	5	LF				N/A	N/A	N/A
1	1	Kitchen	N/A	Metal Ceiling Tile 2' x 2'		Non Suspect ACM	1500	SF	0	SF		There appears to be fiberglass laying on top of the metal tiles.		N/A	N/A	N/A
1	1	Kitchen	N/A	Plaster Ceiling		NAD	1645	SF	0	SF				N/A	N/A	N/A
1	1	Kitchen	N/A	Sheetrock Ceiling		NAD	145	SF	0	SF				N/A	N/A	N/A
1	1	Kitchen	N/A	Brick Wall		Non Suspect ACM	2100	SF	0	SF				N/A	N/A	N/A
1	1	Kitchen	N/A	Sheetrock Wall		NAD	2100	SF	0	SF				N/A	N/A	N/A
1	1	Kitchen	N/A	Ceramic Tile Walls		Non Suspect ACM	2100	SF	0	SF				N/A	N/A	N/A
1	1	Kitchen	N/A	Cement Floor		Non Suspect ACM	1645	SF	0	SF				N/A	N/A	N/A
1	1	Kitchen	M	Linoleum	4020/01/01/OO	Assumed	1480	SF	25	SF				1	No	6/C
1	1	Kitchen Office	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	2	LF	0	LF				N/A	N/A	N/A
1	1	Kitchen Office	N/A	Fiberglass Ceiling Tile 2' x 2'		Non Suspect ACM	110	SF	0	SF				N/A	N/A	N/A
1	1	Kitchen Office	N/A	Plaster Ceiling		NAD	110	SF	0	SF				N/A	N/A	N/A
1	1	Kitchen Office	N/A	Sheetrock Wall		NAD	500	SF	0	SF				N/A	N/A	N/A
1	1	Kitchen Office	N/A	Brick Wall		Non Suspect ACM	135	SF	0	SF				N/A	N/A	N/A
1	1	Kitchen Office	M	Floor Tile VAT 12" x 12"	4020/01/01/QQ	Assumed	110	SF	0	SF	Pink			1	No	1/D
1	1	Kitchen Office	N/A	Wood Floor		Non Suspect ACM	100	SF	0	SF				N/A	N/A	N/A
1	1	Kitchen Restroom	N/A	Fiberglass Ceiling Tile 2' x 2'		Non Suspect ACM	80	SF	0	SF				N/A	N/A	N/A
1	1	Kitchen Restroom	N/A	Plaster Ceiling		NAD	110	SF	0	SF				N/A	N/A	N/A
1	1	Kitchen Restroom	N/A	Sheetrock Wall		NAD	500	SF	0	SF				N/A	N/A	N/A
1	1	Kitchen Restroom	N/A	Brick Wall		Non Suspect ACM	135	SF	0	SF				N/A	N/A	N/A
1	1	Kitchen Restroom	M	Floor Tile VAT 12" x 12"	4020/01/01/QQ	Assumed	110	SF	16	SF	Blue			1	No	6/C
1	1	Kitchen Restroom	N/A	Wood Floor		Non Suspect ACM	110	SF	37	SF				N/A	N/A	N/A
1	1	Kitchen Storage Room closest to Large Cafeteria	N/A	Plaster Ceiling		NAD	180	SF	0	SF				N/A	N/A	N/A
1	1	Kitchen Storage Room closest to Large Cafeteria	N/A	Brick Wall		Non Suspect ACM	700	SF	0	SF				N/A	N/A	N/A
1	1	Kitchen Storage Room closest to Large Cafeteria	N/A	Cement Floor		Non Suspect ACM	180	SF	0	SF				N/A	N/A	N/A
1	1	Kitchen Storage Room closest to Large Cafeteria	M	Linoleum	4020/01/01/OO	Assumed	180	SF	0	SF				1	No	1/D
1	1	Kitchen Storage Room closest to Small Cafeteria	N/A	Plaster Ceiling		NAD	85	SF	0	SF				N/A	N/A	N/A
1	1	Kitchen Storage Room closest to Small Cafeteria	N/A	Plaster Walls		NAD	555	SF	0	SF				N/A	N/A	N/A
1	1	Kitchen Storage Room closest to Small Cafeteria	N/A	Cement Floor		Non Suspect ACM	85	SF	0	SF				N/A	N/A	N/A
1	1	Stairwell from Kitchen to Boiler Room	T	Pipe Fitting Insulation	4020/01/01/24	Confirmed	4	EA	0	EA				1	No	1/D
1	1	Stairwell from Kitchen to Boiler Room	T	Pipe Insulation 2-6 inch	4020/01/01/18	Confirmed	25	LF	0	LF				1	No	1/D
1	1	Stairwell from Kitchen to Boiler Room	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	8	LF	0	SF				N/A	N/A	N/A
1	1	Stairwell from Kitchen to Boiler Room	N/A	Plaster Ceiling		NAD	375	SF	0	SF				N/A	N/A	N/A
1	1	Stairwell from Kitchen to Boiler Room	N/A	Plaster Walls		NAD	445	SF	0	SF				N/A	N/A	N/A
1	1	Stairwell from Kitchen to Boiler Room	N/A	Brick Wall		Non Suspect ACM	445	SF	0	SF				N/A	N/A	N/A
1	1	Stairwell from Kitchen to Boiler Room	N/A	Cement Floor		Non Suspect ACM	375	SF	0	SF				N/A	N/A	N/A
1	1	Stairwell from Kitchen to Hallway outside Boiler Room	T	Pipe Fitting Insulation	4020/01/01/24	Confirmed	4	EA	0	EA				1	No	1/D
1	1	Stairwell from Kitchen to Hallway outside Boiler Room	T	Pipe Insulation 2-6 inch	4020/01/01/18	Confirmed	1	LF	0	LF				1	No	1/D
1	1	Stairwell from Kitchen to Hallway outside Boiler Room	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	23	LF	0	LF				N/A	N/A	N/A
1	1	Stairwell from Kitchen to Hallway outside Boiler Room	N/A	Plaster Ceiling		NAD	375	SF	0	SF				N/A	N/A	N/A
1	1	Stairwell from Kitchen to Hallway outside Boiler Room	N/A	Brick Wall		Non Suspect ACM	890	SF	0	SF				N/A	N/A	N/A
1	1	Stairwell from Kitchen to Hallway outside Boiler Room	N/A	Cement Floor		Non Suspect ACM	375	SF	0	SF				N/A	N/A	N/A
1	1	Boy's Restroom	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	34	LF	2	LF				N/A	N/A	N/A
1	1	Boy's Restroom	N/A	Plaster Ceiling		NAD	480	SF	20	SF				N/A	N/A	N/A
1	1	Boy's Restroom	N/A	Plaster Walls		NAD	1065	SF	0	LF				N/A	N/A	N/A
1	1	Boy's Restroom	N/A	Brick Wall		Non Suspect ACM	180	SF	0	SF				N/A	N/A	N/A
1	1	Boy's Restroom	N/A	Marble Walls		Non Suspect ACM	135	SF	0	SF		On wall behind toilets. Material is heavily painted. Based on observations of similar material on other floors the material is marble.		N/A	N/A	N/A
1	1	Boy's Restroom	N/A	Cement Floor		Non Suspect ACM	480	SF	0	SF				N/A	N/A	N/A
1	1	Custodial Closet adjacent to Boy's Restroom	X	X		X	X	X	X	X	X	No Access - No Key		X	X	X
1	1	Stairwell C Pipe Chase	X	X		X	X	X	X	X	X	No Access		X	X	X
1	1	Blower Room 3, Fan Room near Large Cafeteria	T	Pipe Fitting Insulation	4020/01/01/24	Confirmed	7	EA	0	EA				1	No	1/D
1	1	Blower Room 3, Fan Room near Large Cafeteria	N/A	Fiberglass Pipe Insulation		NAD	350	LF	0	LF				N/A	N/A	N/A
1	1	Blower Room 3, Fan Room near Large Cafeteria	M	Vibration Damper Cloth	4020/01/01/25	Assumed	25	SF	0	SF				1	No	1/D
1	1	Classroom 117	N/A	Plaster Ceiling		NAD	505	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 117	N/A	Plaster Walls		NAD	505	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 117	N/A	Sheetrock Wall		NAD	580	SF	1	SF				N/A	N/A	N/A
1	1	Classroom 117	N/A	Wood Floor		Non Suspect ACM	505	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 117	M	Blackboard Glue Dots	4020/01/01/AET/BB/2600	Assumed	60	SF	0	SF				1	No	1/D

4020 Overbrook HS 2015-2016 AHERA Three Year Report

School District of Philadelphia			AHERA Three-Year Reinspection 2015-2016										Reinspection Date: 10/21/2015			
Overbrook High School			Room by Room Location Log Report										Building Inspector: Bernard Brunner			
5898 Lancaster Avenue, Philadelphia, PA 19131													Certificate Number: 45397			
ULCS# 4020													Management Planner: M. Causley			
Year Built: 1926													Certificate Number: ACC-0215-8-010			
Element	Room	On Site Room Name	System Affected	Material Description	HID#	Confirmed Assumed NAD Non Suspect ACM	Amount of Material	SF LF EA	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic / Crawl Space Ranking	Damage Potential (DP)	Newly Friable (NF)	Response Action (RA)
1	1	Classroom 118	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	18	LF	1	LF				N/A	N/A	N/A
1	1	Classroom 118	N/A	Plaster Ceiling		NAD	624	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 118	N/A	Plaster Walls		NAD	915	SF	2	SF				N/A	N/A	N/A
1	1	Classroom 118	N/A	Sheetrock Wall		NAD	375	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 118	N/A	Wood Floor		Non Suspect ACM	624	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 118	M	Blackboard Glue Dots	4020/01/01/AET/BB/2600	Assumed	50	SF	0	SF				1	No	1/D
1	1	Vestibule at Entrance To Classrooms 117 & 118	N/A	Plaster Ceiling		NAD	30	SF	0	SF				N/A	N/A	N/A
1	1	Vestibule at Entrance To Classrooms 117 & 118	N/A	Sheetrock Wall		NAD	200	SF	0	SF				N/A	N/A	N/A
1	1	Vestibule at Entrance To Classrooms 117 & 118	N/A	Wood Floor		Non Suspect ACM	30	SF	0	SF				N/A	N/A	N/A
1	1	Office 120 School Police Common Area	N/A	Ceiling Tile 2' x 4'		NAD	210	SF	0	SF				N/A	N/A	N/A
1	1	Office 120 School Police Common Area	N/A	Plaster Ceiling		NAD	210	SF	0	SF				N/A	N/A	N/A
1	1	Office 120 School Police Common Area	N/A	Plaster Walls		NAD	425	SF	0	SF				N/A	N/A	N/A
1	1	Office 120 School Police Common Area	N/A	Sheetrock Wall		NAD	145	SF	0	SF				N/A	N/A	N/A
1	1	Office 120 School Police Common Area	N/A	Brick Wall		Non Suspect ACM	45	SF	0	SF				N/A	N/A	N/A
1	1	Office 120 School Police Common Area	M	Floor Tile VAT 9" x 9"	4020/01/01/20	Confirmed	210	SF	0	SF	Tan			1	No	1/D
1	1	Office 120 School Police Common Area	N/A	Cement Floor		Non Suspect ACM	210	SF	0	SF				N/A	N/A	N/A
1	1	Office 120A School Police Office 1st Office from Left	N/A	Ceiling Tile 2' x 4'		NAD	100	SF	0	SF				N/A	N/A	N/A
1	1	Office 120A School Police Office 1st Office from Left	N/A	Plaster Ceiling		NAD	100	SF	0	SF				N/A	N/A	N/A
1	1	Office 120A School Police Office 1st Office from Left	N/A	Plaster Walls		NAD	380	SF	0	SF				N/A	N/A	N/A
1	1	Office 120A School Police Office 1st Office from Left	N/A	Brick Wall		Non Suspect ACM	100	SF	0	SF				N/A	N/A	N/A
1	1	Office 120A School Police Office 1st Office from Left	M	Floor Tile VAT 9" x 9"	4020/01/01/20	Confirmed	100	SF	0	SF	Tan			1	No	1/D
1	1	Office 120A School Police Office 1st Office from Left	N/A	Cement Floor		Non Suspect ACM	100	SF	0	SF				N/A	N/A	N/A
1	1	Office 120B School Police Office 2nd Office From Left	N/A	Ceiling Tile 2' x 4'		NAD	160	SF	0	SF				N/A	N/A	N/A
1	1	Office 120B School Police Office 2nd Office From Left	N/A	Plaster Ceiling		NAD	160	SF	0	SF				N/A	N/A	N/A
1	1	Office 120B School Police Office 2nd Office From Left	N/A	Plaster Walls		NAD	495	SF	15	SF				N/A	N/A	N/A
1	1	Office 120B School Police Office 2nd Office From Left	N/A	Brick Wall		Non Suspect ACM	130	SF	0	SF				N/A	N/A	N/A
1	1	Office 120B School Police Office 2nd Office From Left	M	Floor Tile VAT 9" x 9"	4020/01/01/20	Confirmed	160	SF	0	SF	Tan			1	No	1/D
1	1	Office 120B School Police Office 2nd Office From Left	N/A	Cement Floor		Non Suspect ACM	160	SF	0	SF				N/A	N/A	N/A
1	1	Office 120C School Police Video Monitoring Room 3rd Office from Left	N/A	Ceiling Tile 2' x 4'		NAD	170	SF	0	SF				N/A	N/A	N/A
1	1	Office 120C School Police Video Monitoring Room 3rd Office from Left	N/A	Plaster Ceiling		NAD	170	SF	0	SF				N/A	N/A	N/A
1	1	Office 120C School Police Video Monitoring Room 3rd Office from Left	N/A	Plaster Walls		NAD	555	SF	0	SF				N/A	N/A	N/A
1	1	Office 120C School Police Video Monitoring Room 3rd Office from Left	N/A	Brick Wall		Non Suspect ACM	70	SF	0	SF				N/A	N/A	N/A
1	1	Office 120C School Police Video Monitoring Room 3rd Office from Left	M	Floor Tile VAT 9" x 9"	4020/01/01/20	Confirmed	170	SF	0	SF	Tan			1	No	1/D
1	1	Office 120C School Police Video Monitoring Room 3rd Office from Left	N/A	Cement Floor		Non Suspect ACM	170	SF	0	SF				N/A	N/A	N/A
1	1	Office 120D School Police Office 4th Office from Left	N/A	Ceiling Tile 2' x 4'		NAD	170	SF	0	SF				N/A	N/A	N/A
1	1	Office 120D School Police Office 4th Office from Left	N/A	Plaster Ceiling		NAD	170	SF	0	SF				N/A	N/A	N/A
1	1	Office 120D School Police Office 4th Office from Left	N/A	Plaster Walls		NAD	555	SF	5	SF				N/A	N/A	N/A
1	1	Office 120D School Police Office 4th Office from Left	N/A	Brick Wall		Non Suspect ACM	70	SF	0	SF				N/A	N/A	N/A
1	1	Office 120D School Police Office 4th Office from Left	M	Floor Tile VAT 9" x 9"	4020/01/01/20	Confirmed	170	SF	0	SF	Tan			1	No	1/D
1	1	Office 120D School Police Office 4th Office from Left	N/A	Cement Floor		Non Suspect ACM	170	SF	0	SF				N/A	N/A	N/A
1	1	Office 120E School Police Office 5th Office from Left	N/A	Ceiling Tile 2' x 4'		NAD	160	SF	0	SF				N/A	N/A	N/A
1	1	Office 120E School Police Office 5th Office from Left	N/A	Plaster Ceiling		NAD	160	SF	0	SF				N/A	N/A	N/A
1	1	Office 120E School Police Office 5th Office from Left	N/A	Plaster Walls		NAD	365	SF	0	SF				N/A	N/A	N/A
1	1	Office 120E School Police Office 5th Office from Left	N/A	Sheetrock Wall		NAD	170	SF	0	SF				N/A	N/A	N/A
1	1	Office 120E School Police Office 5th Office from Left	N/A	Brick Wall		Non Suspect ACM	70	SF	0	SF				N/A	N/A	N/A
1	1	Office 120E School Police Office 5th Office from Left	M	Floor Tile VAT 9" x 9"	4020/01/01/20	Confirmed	160	SF	0	SF	Tan			1	No	1/D
1	1	Office 120E School Police Office 5th Office from Left	N/A	Cement Floor		Non Suspect ACM	160	SF	0	SF				N/A	N/A	N/A
1	1	Storage Room between Elevator and Office 120	X	X		X	X	X	X	X	X	No Access - No Key for Padlock		X	X	X
1	1	Girl's Restroom	T	Pipe Fitting Insulation	4020/01/01/24	Confirmed	2	EA	0	EA				1	No	1/D
1	1	Girl's Restroom	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	44	LF	0	LF				N/A	N/A	N/A
1	1	Girl's Restroom	N/A	Plaster Ceiling		NAD	480	SF	10	SF				N/A	N/A	N/A
1	1	Girl's Restroom	N/A	Plaster Walls		NAD	1245	SF	0	SF				N/A	N/A	N/A
1	1	Girl's Restroom	N/A	Ceramic Tile Walls		Non Suspect ACM	625	SF	0	SF				N/A	N/A	N/A
1	1	Girl's Restroom	N/A	Ceramic Tile Floors		Non Suspect ACM	480	SF	0	SF				N/A	N/A	N/A
1	1	Custodial Closet adjacent 1st Floor Girl's Room	X	X		X	X	X	X	X	X	No Access - No Key		X	X	X
1	1	Stairwell D Pipe Chase	X	X		X	X	X	X	X	X	No Access		X	X	X
1	1	Classroom 121	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	20	LF	0	LF				N/A	N/A	N/A
1	1	Classroom 121	N/A	Plaster Ceiling		NAD	1056	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 121	N/A	Plaster Walls		NAD	1635	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 121	N/A	Wood Floor		Non Suspect ACM	1056	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 121	M	Blackboard Glue Dots	4020/01/01/AET/BB/2600	Assumed	110	SF	0	SF				1	No	1/D
1	1	Auditorium	S	Plaster Ceiling	4020/01/01/A6	Assumed	8400	SF	0	SF				1	No	1/D
1	1	Auditorium	N/A	Decorative Plaster Ceiling		NAD	8400	SF	0	SF				N/A	N/A	N/A
1	1	Auditorium	N/A	Plaster Walls		NAD	14200	SF	20	SF				N/A	N/A	N/A
1	1	Auditorium	N/A	Wood Wall		Non Suspect ACM	2400	SF	0	SF				N/A	N/A	N/A
1	1	Auditorium	M	Floor Tile VAT 12" x 12"	4020/01/01/QQ	Assumed	1075	SF	0	SF	Green			1	No	1/D
1	1	Auditorium	M	Floor Tile VAT 12" x 12"	4020/01/01/QQ	Assumed	125	SF	0	SF	Grey			1	No	1/D
1	1	Auditorium	N/A	Wood Floor		Non Suspect ACM	8400	SF	0	SF				N/A	N/A	N/A
The Building Engineer says that there are radiators recessed into the walls behind large wood panels. The panels are too heavy to open for inspection. Based on the observed presence of radiator insulation in the main lobby, it is assumed that radiator insulation is present in the Auditorium as well.														1	No	1/D
1	1	Auditorium	T	Radiator Insulation	4020/01/01/AET/BB/1600	Assumed	1120	SF	0	SF				N/A	N/A	N/A
1	1	Auditorium Stage	S	Plaster Ceiling	4020/01/01/A6	Assumed	1500	SF	45	SF				N/A	N/A	N/A

4020 Overbrook HS 2015-2016 AHERA Three Year Report

School District of Philadelphia			AHERA Three-Year Reinspection 2015-2016										Reinspection Date: 10/21/2015									
Overbrook High School			Room by Room Location Log Report										Building Inspector: Bernard Brunner									
5898 Lancaster Avenue, Philadelphia, PA 19131													Certificate Number: 45397									
ULCS# 4020													Management Planner: M. Causley									
Year Built: 1926													Certificate Number: ACC-0215-8-010									
Element	Floor	On Site Room Name	System Affected	Material Description	HID#	Confirmed	Assumed	NAD	Amount of Material	SF	LF	EA	Amount of Damage	SF	LF	EA	Color required for VAT	Comments/Description/Notes	Attic / Crawl Space Ranking	Damage Potential (DP)	Newly Friable (NF)	Response Action (RA)
1	1	Auditorium Stage	N/A	Plaster Walls		NAD			3200	SF			75	SF							N/A	N/A
1	1	Auditorium Stage	N/A	Wood Floor		Non Suspect ACM			1500	SF			0	SF							N/A	N/A
1	1	Room Below Auditorium Stage	X	X		X			X	X	X	X	X	X	X	X	X	No Access - No Key. It is possible that this may be the same space as 115C		X	X	X
1	1	Room down stairs at Left of Stage	X	X		X			X	X	X	X	X	X	X	X	X	No Access - No Key. It is possible that this may be the same space as 115B		X	X	X
1	1	Classroom 119	N/A	Ceiling Tile 2' x 4'		NAD			500	SF			0	SF							N/A	N/A
1	1	Classroom 119	N/A	Fiberglass Ceiling Tile 2' x 4'		Non Suspect ACM			255	SF			0	SF							N/A	N/A
1	1	Classroom 119	N/A	Plaster Ceiling		NAD			755	SF			10	SF							N/A	N/A
1	1	Classroom 119	N/A	Plaster Walls		NAD			880	SF			60	SF							N/A	N/A
1	1	Classroom 119	N/A	Brick Wall		Non Suspect ACM			420	SF			0	SF							N/A	N/A
1	1	Classroom 119	M	Floor Tile VAT 9" x 9"	4020/01/01/20	Confirmed			735	SF			0	SF			Tan				1	No
1	1	Classroom 119	M	Floor Tile VAT 12" x 12"	4020/01/01/QQ	Assumed			20	SF			0	SF			Grey				1	No
1	1	Classroom 119	N/A	Cement Floor		Non Suspect ACM			755	SF			0	SF							N/A	N/A
1	1	Classroom 119	M	Blackboard Glue Dots	4020/01/01/AET/BB/2600	Assumed			40	SF			0	SF							1	No
1	1	Classroom 119 Pipe Chase	X	X		X			X	X	X	X	X	X	X	X	X	No Access - Access Panel Blocked by Stored Materials		X	X	X
1	1	School Police Storage across from Blower Room 3	N/A	Plaster Ceiling		NAD			195	SF			0	SF							N/A	N/A
1	1	School Police Storage across from Blower Room 3	N/A	Plaster Walls		NAD			480	SF			10	SF							N/A	N/A
1	1	School Police Storage across from Blower Room 3	N/A	Sheetrock Wall		NAD			290	SF			0	SF							N/A	N/A
1	1	School Police Storage across from Blower Room 3	N/A	Wood Floor		Non Suspect ACM			195	SF			0	SF							N/A	N/A
1	1	Storage Closet between Classroom 100 & Side Entrance	X	X		X			X	X	X	X	X	X	X	X	X			X	X	X
1	1	Vestibule at Entrance to two Storage Rooms adjacent to Classroom 100	N/A	Plaster Ceiling		NAD			75	SF			0	SF							N/A	N/A
1	1	Vestibule at Entrance to two Storage Rooms adjacent to Classroom 100	N/A	Plaster Walls		NAD			410	SF			0	SF							N/A	N/A
1	1	Vestibule at Entrance to two Storage Rooms adjacent to Classroom 100	M	Floor Tile VAT 12" x 12"	4020/01/01/QQ	Assumed			75	SF			0	SF			White				1	No
1	1	Vestibule at Entrance to two Storage Rooms adjacent to Classroom 100	N/A	Wood Floor		Non Suspect ACM			75	SF			0	SF							N/A	N/A
1	1	Ticket Booth near ROTC area	N/A	Plaster Ceiling		NAD			45	SF			0	SF							N/A	N/A
1	1	Ticket Booth near ROTC area	N/A	Plaster Walls		NAD			120	SF			0	SF							N/A	N/A
1	1	Ticket Booth near ROTC area	N/A	Cement Floor		Non Suspect ACM			45	SF			0	SF							N/A	N/A
1	1	Stairwell to ROTC Area	T	Pipe Insulation 2-6 inch	4020/01/01/18	Confirmed			10	LF			0	SF							1	No
1	1	Stairwell to ROTC Area	N/A	Plaster Ceiling		NAD			360	SF			0	SF							N/A	N/A
1	1	Stairwell to ROTC Area	N/A	Plaster Walls		NAD			1010	SF			0	SF							N/A	N/A
1	1	Stairwell to ROTC Area	N/A	Cement Floor		Non Suspect ACM			360	SF			0	SF							N/A	N/A
1	1	Stairwell to Old Girl's Locker Room	T	Pipe Fitting Insulation	4020/01/01/24	Confirmed			2	EA			0	EA							1	No
1	1	Stairwell to Old Girl's Locker Room	T	Pipe Insulation 2-6 inch	4020/01/01/18	Confirmed			15	LF			0	LF							1	No
1	1	Stairwell to Old Girl's Locker Room	N/A	Plaster Ceiling		NAD			375	SF			60	SF							N/A	N/A
1	1	Stairwell to Old Girl's Locker Room	N/A	Brick Wall		Non Suspect ACM			890	SF			0	SF							N/A	N/A
1	1	Stairwell to Old Girl's Locker Room	N/A	Cement Floor		Non Suspect ACM			375	SF			0	SF							N/A	N/A
1	1	Old Girl's Large Locker Room	T	Pipe Fitting Insulation	4020/01/01/24	Confirmed			23	EA			0	EA				DDC written up			1	Yes
1	1	Old Girl's Large Locker Room	T	Pipe Insulation 2-6 inch	4020/01/01/18	Confirmed			120	LF			1	LF							1	Yes
1	1	Old Girl's Large Locker Room	N/A	Plaster Ceiling		NAD			1225	SF			20	SF							N/A	N/A
1	1	Old Girl's Large Locker Room	N/A	Brick Wall		Non Suspect ACM			1400	SF			0	SF							N/A	N/A
1	1	Old Girl's Large Locker Room	N/A	Cement Floor		Non Suspect ACM			1225	SF			0	SF							N/A	N/A
1	1	Old Girl's Large Locker Room Showers	T	Pipe Fitting Insulation	4020/01/01/24	Confirmed			2	EA			0	EA							1	No
1	1	Old Girl's Large Locker Room Showers	T	Pipe Insulation 2-6 inch	4020/01/01/18	Confirmed			44	LF			0	LF				Insulation is covered with metal. Unable to determine if insulation is asbestos or fiberglass.			1	No
1	1	Old Girl's Large Locker Room Showers	N/A	Plaster Ceiling		NAD			225	SF			0	SF							N/A	N/A
1	1	Old Girl's Large Locker Room Showers	N/A	Brick Wall		Non Suspect ACM			680	SF			0	SF							N/A	N/A
1	1	Old Girl's Large Locker Room Showers	N/A	Cement Floor		Non Suspect ACM			225	SF			0	SF							N/A	N/A
1	1	Old Girl's Large Locker Room Restroom	T	Pipe Fitting Insulation	4020/01/01/24	Confirmed			7	EA			0	EA							1	No
1	1	Old Girl's Large Locker Room Restroom	T	Pipe Insulation 2-6 inch	4020/01/01/18	Confirmed			10	LF			0	LF							1	No
1	1	Old Girl's Large Locker Room Restroom	N/A	Fiberglass Pipe Insulation		Non Suspect ACM			40	LF			0	LF							N/A	N/A
1	1	Old Girl's Large Locker Room Restroom	N/A	Plaster Ceiling		NAD			80	SF			0	SF							N/A	N/A
1	1	Old Girl's Large Locker Room Restroom	N/A	Brick Wall		Non Suspect ACM			460	SF			0	SF							N/A	N/A
1	1	Old Girl's Large Locker Room Restroom	N/A	Cement Floor		Non Suspect ACM			80	SF			0	SF							N/A	N/A
1	1	Old Girl's Large Locker Room Closet	N/A	Plaster Ceiling		NAD			25	SF			0	SF							N/A	N/A
1	1	Old Girl's Large Locker Room Closet	N/A	Brick Wall		Non Suspect ACM			200	SF			0	SF							N/A	N/A
1	1	Old Girl's Large Locker Room Closet	N/A	Cement Floor		Non Suspect ACM			25	SF			0	SF							N/A	N/A
1	1	Old Girl's Small Upper Locker Room	T	Pipe Fitting Insulation	4020/01/01/24	Confirmed			8	EA			2	EA				DDC written up			1	Yes
1	1	Old Girl's Small Upper Locker Room	T	Pipe Insulation 2-6 inch	4020/01/01/18	Confirmed			55	LF			0	LF							1	No
1	1	Old Girl's Small Upper Locker Room	N/A	Plaster Ceiling		NAD			500	SF			0	SF							N/A	N/A
1	1	Old Girl's Small Upper Locker Room	N/A	Brick Wall		Non Suspect ACM			740	SF			0	SF							N/A	N/A
1	1	Old Girl's Small Upper Locker Room	N/A	Cement Floor		Non Suspect ACM			500	SF			0	SF							N/A	N/A
1	1	Ticket Booth near Cheerleading Gym	X	X		X			X	X	X	X	X	X	X	X	X	No Access - No Key		X	X	X
1	1	Stairwell to Cheerleading Gym	N/A	Plaster Ceiling		NAD			360	SF			0	SF							N/A	N/A
1	1	Stairwell to Cheerleading Gym	N/A	Plaster Walls		NAD			1010	SF			0	SF							N/A	N/A
1	1	Stairwell to Cheerleading Gym	N/A	Cement Floor		Non Suspect ACM			360	SF			0	SF							N/A	N/A
1	1	Stairwell to Old Boy's Locker Room	T	Pipe Fitting Insulation	4020/01/01/24	Confirmed			2	EA			0	EA							1	No
1	1	Stairwell to Old Boy's Locker Room	T	Pipe Insulation 2-6 inch	4020/01/01/18	Confirmed			15	LF			0	LF							1	No
1	1	Stairwell to Old Boy's Locker Room	N/A	Plaster Ceiling		NAD			375	SF			50	SF							N/A	N/A
1	1	Stairwell to Old Boy's Locker Room	N/A	Plaster Walls		NAD			890	SF			0	SF							N/A	N/A
1	1	Stairwell to Old Boy's Locker Room	N/A	Cement Floor		Non Suspect ACM			375	SF			0	SF							N/A	N/A
1	1	Old Boy's Large Locker Room	T	Pipe Fitting Insulation	4020/01/01/24	Confirmed			21	EA			2	EA				DDC written up			1	Yes
1	1	Old Boy's Large Locker Room	T	Pipe Insulation 2-6 inch	4020/01/01/18	Confirmed			100	LF			3	LF				DDC written up			1	Yes
1	1	Old Boy's Large Locker Room	N/A	Fiberglass Pipe Insulation		Non Suspect ACM			21	LF			2	LF							N/A	N/A
1	1	Old Boy's Large Locker Room	N/A	Plaster Ceiling		NAD			1225	SF			20	SF							N/A	N/A
1	1	Old Boy's Large Locker Room	N/A	Brick Wall		Non Suspect ACM			1400	SF			0	SF							N/A	N/A

4020 Overbrook HS 2015-2016 AHERA Three Year Report

School District of Philadelphia Overbrook High School 5898 Lancaster Avenue, Philadelphia, PA 19131 ULCS# 4020 Year Built: 1926		AHERA Three-Year Reinspection 2015-2016 Room by Room Location Log Report										Reinspection Date: 10/21/2015 Building Inspector: Bernard Brunner Certificate Number: 45397 Management Planner: M. Causley Certificate Number: ACC-0215-8-010				
Element	Room	On Site Room Name	System Affected	Material Description	HID#	Confirmed Assumed NAD Non Suspect ACM	Amount of Material	SF LF EA	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic / Crawl Space Ranking	Damage Potential (DP)	Newly Friable (NF)	Response Action (RA)
1	1	Old Boy's Large Locker Room	N/A	Cement Floor		Non Suspect ACM	1225	SF	0	SF				N/A	N/A	N/A
1	1	Old Boy's Large Locker Room Showers	T	Pipe Fitting Insulation	4020/01/01/24	Confirmed	1	EA	0	EA				1	No	1/D
1	1	Old Boy's Large Locker Room Showers	T	Pipe Insulation 2-6 inch	4020/01/01/18	Confirmed	24	LF	0	LF		Insulation is covered with metal. Unable to determine if insulation is asbestos or fiberglass.		1	No	1/D
1	1	Old Boy's Large Locker Room Showers	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	13	LF	0	LF				N/A	N/A	N/A
1	1	Old Boy's Large Locker Room Showers	N/A	Concrete Ceiling		Non Suspect ACM	225	SF	0	SF				N/A	N/A	N/A
1	1	Old Boy's Large Locker Room Showers	N/A	Brick Wall		Non Suspect ACM	680	SF	0	SF				N/A	N/A	N/A
1	1	Old Boy's Large Locker Room Showers	N/A	Cement Floor		Non Suspect ACM	225	SF	0	SF				N/A	N/A	N/A
1	1	Old Boy's Large Locker Room Restroom	T	Pipe Fitting Insulation	4020/01/01/24	Confirmed	8	EA	0	EA				1	No	1/D
1	1	Old Boy's Large Locker Room Restroom	T	Pipe Insulation 2-6 inch	4020/01/01/18	Confirmed	9	LF	1	LF		DDC written up		1	Yes	2/B
1	1	Old Boy's Large Locker Room Restroom	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	28	LF	2	LF				N/A	N/A	N/A
1	1	Old Boy's Large Locker Room Restroom	N/A	Plaster Ceiling		NAD	80	SF	0	SF				N/A	N/A	N/A
1	1	Old Boy's Large Locker Room Restroom	N/A	Brick Wall		Non Suspect ACM	460	SF	0	SF				N/A	N/A	N/A
1	1	Old Boy's Large Locker Room Restroom	N/A	Cement Floor		Non Suspect ACM	80	SF	0	SF				N/A	N/A	N/A
1	1	Old Boy's Large Locker Room Closet	N/A	Plaster Ceiling		NAD	25	SF	25	SF				N/A	N/A	N/A
1	1	Old Boy's Large Locker Room Closet	N/A	Brick Wall		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A
1	1	Old Boy's Large Locker Room Closet	N/A	Cement Floor		Non Suspect ACM	25	SF	0	SF				N/A	N/A	N/A
1	1	Old Boy's Small Upper Locker Room	T	Pipe Fitting Insulation	4020/01/01/24	Confirmed	4	EA	1	EA		DDC written up		1	Yes	2/B
1	1	Old Boy's Small Upper Locker Room	T	Pipe Insulation 2-6 inch	4020/01/01/18	Confirmed	27	LF	0	LF				1	No	1/D
1	1	Old Boy's Small Upper Locker Room	N/A	Plaster Ceiling		NAD	500	SF	25	SF				N/A	N/A	N/A
1	1	Old Boy's Small Upper Locker Room	N/A	Brick Wall		Non Suspect ACM	740	SF	0	SF				N/A	N/A	N/A
1	1	Old Boy's Small Upper Locker Room	N/A	Cement Floor		Non Suspect ACM	500	SF	0	SF				N/A	N/A	N/A
1	1	Stairwell C	T	Pipe Insulation 2-6 inch	4020/01/01/18	Confirmed	6	LF	0	LF				1	No	1/D
1	1	Stairwell C	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	9	LF	0	LF				N/A	N/A	N/A
1	1	Stairwell C	N/A	Plaster Ceiling		NAD	375	SF	0	SF				N/A	N/A	N/A
1	1	Stairwell C	N/A	Plaster Walls		NAD	900	SF	100	SF				N/A	N/A	N/A
1	1	Stairwell C	N/A	Brick Wall		Non Suspect ACM	250	SF	0	SF				N/A	N/A	N/A
1	1	Stairwell C	N/A	Cement Floor		Non Suspect ACM	375	SF	0	SF				N/A	N/A	N/A
1	1	Fire Tower adjacent Office 110	N/A	Plaster Ceiling		NAD	600	SF	600	SF				N/A	N/A	N/A
1	1	Fire Tower adjacent Office 110	N/A	Brick Wall		Non Suspect ACM	1200	SF	0	SF				N/A	N/A	N/A
1	1	Fire Tower adjacent Office 110	N/A	Cement Floor		Non Suspect ACM	600	SF	0	SF				N/A	N/A	N/A
1	1	Hallway outside Small Cafeteria	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	63	LF	0	LF				N/A	N/A	N/A
1	1	Hallway outside Small Cafeteria	N/A	Ceiling Tile 1' x 1'		NAD	1560	SF	15	SF		Glued 1'x1' ceiling tile		N/A	N/A	N/A
1	1	Hallway outside Small Cafeteria	N/A	Plaster Ceiling		NAD	1560	SF	20	SF				N/A	N/A	N/A
1	1	Hallway outside Small Cafeteria	N/A	Plaster Walls		NAD	2600	SF	0	SF				N/A	N/A	N/A
1	1	Hallway outside Small Cafeteria	N/A	Marble Walls		Non Suspect ACM	1300	SF	0	SF				N/A	N/A	N/A
1	1	Hallway outside Small Cafeteria	N/A	Cement Floor		Non Suspect ACM	1560	SF	0	SF				N/A	N/A	N/A
1	1	Hallway outside Small Cafeteria	M	Splice Ceiling Glue Dots	4020/01/01/AET/BB/2603	Assumed	1560	SF	0	SF				1	No	1/D
1	1	Hallway outside Large Cafeteria	T	Pipe Fitting Insulation	4020/01/01/24	Confirmed	1	EA	0	EA				1	No	1/D
1	1	Hallway outside Large Cafeteria	T	Pipe Insulation 2-6 inch	4020/01/01/18	Confirmed	25	LF	0	LF				1	No	1/D
1	1	Hallway outside Large Cafeteria	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	60	LF	0	LF				N/A	N/A	N/A
1	1	Hallway outside Large Cafeteria	N/A	Ceiling Tile 1' x 1'		NAD	1320	SF	0	SF		Glued 1'x1' Ceiling Tile		N/A	N/A	N/A
1	1	Hallway outside Large Cafeteria	N/A	Plaster Ceiling		NAD	2250	SF	0	SF				N/A	N/A	N/A
1	1	Hallway outside Large Cafeteria	N/A	Plaster Walls		NAD	3600	SF	0	SF				N/A	N/A	N/A
1	1	Hallway outside Large Cafeteria	N/A	Marble Walls		Non Suspect ACM	1500	SF	0	SF				N/A	N/A	N/A
1	1	Hallway outside Large Cafeteria	N/A	Cement Floor		Non Suspect ACM	2250	SF	0	SF				N/A	N/A	N/A
1	1	Hallway outside Large Cafeteria	M	Splice Ceiling Glue Dots	4020/01/01/AET/BB/2603	Assumed	1320	SF	0	SF				1	No	1/D
1	1	Fire Tower adjacent Large Cafeteria	N/A	Plaster Ceiling		NAD	600	SF	600	SF				N/A	N/A	N/A
1	1	Fire Tower adjacent Large Cafeteria	N/A	Brick Wall		Non Suspect ACM	1200	SF	0	SF				N/A	N/A	N/A
1	1	Fire Tower adjacent Large Cafeteria	N/A	Cement Floor		Non Suspect ACM	600	SF	0	SF				N/A	N/A	N/A
1	1	Stairwell D	T	Pipe Insulation 2-6 inch	4020/01/01/18	Confirmed	5	LF	0	LF				1	No	1/D
1	1	Stairwell D	N/A	Plaster Ceiling		NAD	375	SF	0	SF				N/A	N/A	N/A
1	1	Stairwell D	N/A	Plaster Walls		NAD	900	SF	50	SF				N/A	N/A	N/A
1	1	Stairwell D	N/A	Brick Wall		Non Suspect ACM	250	SF	0	SF				N/A	N/A	N/A
1	1	Stairwell D	N/A	Cement Floor		Non Suspect ACM	375	SF	0	SF				N/A	N/A	N/A
1	1	Hallway to Side Entrance adjacent Blower Room 3	N/A	Ceiling Tile 1' x 1'		NAD	120	SF	0	SF		Glued 1x1 Ceiling Tile		N/A	N/A	N/A
1	1	Hallway to Side Entrance adjacent Blower Room 3	N/A	Plaster Ceiling		NAD	120	SF	0	SF				N/A	N/A	N/A
1	1	Hallway to Side Entrance adjacent Blower Room 3	N/A	Plaster Walls		NAD	770	SF	5	SF				N/A	N/A	N/A
1	1	Hallway to Side Entrance adjacent Blower Room 3	N/A	Marble Walls		Non Suspect ACM	290	SF	0	SF				N/A	N/A	N/A
1	1	Hallway to Side Entrance adjacent Blower Room 3	N/A	Cement Floor		Non Suspect ACM	320	SF	0	SF				N/A	N/A	N/A
1	1	Hallway to Side Entrance adjacent Blower Room 3	M	Splice Ceiling Glue Dots	4020/01/01/AET/BB/2603	Assumed	120	SF	0	SF				1	No	1/D
1	1	Hallway to Side Entrance adjacent Blower Room 3	M	Troweled on Ceiling	4020/01/01/A2	Assumed	200	SF	8	SF				1	No	6/C
1	1	Hallway outside Classrooms 117-121	T	Pipe Fitting Insulation	4020/01/01/24	Confirmed	1	EA	0	EA				1	No	1/D
1	1	Hallway outside Classrooms 117-121	T	Pipe Insulation 2-6 inch	4020/01/01/18	Confirmed	41	LF	0	LF				1	No	1/D
1	1	Hallway outside Classrooms 117-121	N/A	Ceiling Tile 1' x 1'		NAD	1935	SF	0	SF		Glued 1x1 Ceiling Tile		N/A	N/A	N/A
1	1	Hallway outside Classrooms 117-121	N/A	Plaster Ceiling		NAD	2080	SF	0	SF				N/A	N/A	N/A
1	1	Hallway outside Classrooms 117-121	N/A	Plaster Walls		NAD	4440	SF	10	SF				N/A	N/A	N/A
1	1	Hallway outside Classrooms 117-121	N/A	Marble Walls		Non Suspect ACM	1760	SF	0	SF				N/A	N/A	N/A
1	1	Hallway outside Classrooms 117-121	N/A	Cement Floor		Non Suspect ACM	2080	SF	0	SF				N/A	N/A	N/A
1	1	Hallway outside Classrooms 117-121	M	Splice Ceiling Glue Dots	4020/01/01/AET/BB/2603	Assumed	1935	SF	0	SF				1	No	1/D
1	1	Hallway to Side Entrance adjacent Classrooms 100 & 121	T	Pipe Fitting Insulation	4020/01/01/24	Confirmed	3	EA	0	EA				1	No	1/D
1	1	Hallway to Side Entrance adjacent Classrooms 100 & 121	T	Pipe Insulation 2-6 inch	4020/01/01/18	Confirmed	5	LF	0	LF				1	No	1/D
1	1	Hallway to Side Entrance adjacent Classrooms 100 & 121	N/A	Plaster Walls		NAD	770	SF	0	SF				N/A	N/A	N/A
1	1	Hallway to Side Entrance adjacent Classrooms 100 & 121	N/A	Marble Walls		Non Suspect ACM	290	SF	0	SF				N/A	N/A	N/A
1	1	Hallway to Side Entrance adjacent Classrooms 100 & 121	N/A	Cement Floor		Non Suspect ACM	320	SF	0	SF				N/A	N/A	N/A
1	1	Hallway to Side Entrance adjacent Classrooms 100 & 121	M	Troweled on Ceiling	4020/01/01/A2	Assumed	320	SF	2	SF		Material is on ceiling		1	No	6/C
1	1	Stairwell A	N/A	Plaster Ceiling		NAD	375	SF	10	SF				N/A	N/A	N/A
1	1	Stairwell A	N/A	Plaster Walls		NAD	900	SF	0	SF				N/A	N/A	N/A

4020 Overbrook HS 2015-2016 AHERA Three Year Report

School District of Philadelphia Overbrook High School 5898 Lancaster Avenue, Philadelphia, PA 19131 ULCS# 4020 Year Built: 1926			AHERA Three-Year Reinspection 2015-2016 Room by Room Location Log Report										Reinspection Date: 10/21/2015 Building Inspector: Bernard Brunner Certificate Number: 45397 Management Planner: M. Causley Certificate Number: ACC-0215-8-010			
Element	Room	On Site Room Name	System Affected	Material Description	HID#	Confirmed Assumed NAD Non Suspect ACM	Amount of Material	SF LF EA	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic / Crawl Space Ranking	Damage Potential (DP)	Newly Friable (NF)	Response Action (RA)
1	1	Stairwell A	N/A	Marble Walls		Non Suspect ACM	250	SF	0	SF				N/A	N/A	N/A
1	1	Stairwell A	N/A	Cement Floor		Non Suspect ACM	375	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 121 Closet	T	Pipe Fitting Insulation	4020/01/01/24	Confirmed	10	EA	0	EA				1	No	1/D
1	1	Classroom 121 Closet	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	70	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 121 Closet	N/A	Plaster Ceiling		NAD	240	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 121 Closet	N/A	Plaster Walls		NAD	820	SF	10	SF				N/A	N/A	N/A
1	1	Classroom 121 Closet	N/A	Wood Floor		Non Suspect ACM	240	SF	0	SF				N/A	N/A	N/A
1	1	Hallway outside Classrooms 100-101	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	12	LF	0	LF				N/A	N/A	N/A
1	1	Hallway outside Classrooms 100-101	N/A	Plaster Ceiling		NAD	1020	SF	0	SF				N/A	N/A	N/A
1	1	Hallway outside Classrooms 100-101	N/A	Plaster Walls		NAD	2185	SF	0	SF				N/A	N/A	N/A
1	1	Hallway outside Classrooms 100-101	N/A	Marble Walls		Non Suspect ACM	850	SF	0	SF				N/A	N/A	N/A
1	1	Hallway outside Classrooms 100-101	N/A	Cement Floor		Non Suspect ACM	1020	SF	0	SF				N/A	N/A	N/A
1	1	Marble Hallway	N/A	Plaster Walls		NAD	1600	SF	0	SF				N/A	N/A	N/A
1	1	Marble Hallway	N/A	Marble Walls		Non Suspect ACM	730	SF	0	SF				N/A	N/A	N/A
1	1	Marble Hallway	N/A	Marble Floor		Non Suspect ACM	1025	SF	0	SF				N/A	N/A	N/A
1	1	Marble Hallway	M	Troweled on Ceiling	4020/01/01/A2	Assumed	1025	SF	0	SF				1	No	1/D
1	1	Main Lobby	N/A	Plaster Walls		NAD	1000	SF	0	SF				N/A	N/A	N/A
1	1	Main Lobby	N/A	Marble Walls		Non Suspect ACM	600	SF	0	SF				N/A	N/A	N/A
1	1	Main Lobby	N/A	Marble Floor		Non Suspect ACM	1000	SF	0	SF				N/A	N/A	N/A
1	1	Main Lobby	M	Troweled on Ceiling	4020/01/01/A2	Assumed	1500	SF	0	SF				1	No	1/D
1	1	Main Lobby	T	Radiator Insulation	4020/01/01/AET/BB/1600	Assumed	235	SF	0	SF		Recessed in walls		1	No	1/D
1	1	Hallway outside Classrooms 102-104	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	48	LF	0	LF				N/A	N/A	N/A
1	1	Hallway outside Classrooms 102-104	N/A	Plaster Ceiling		NAD	1020	SF	0	SF				N/A	N/A	N/A
1	1	Hallway outside Classrooms 102-104	N/A	Plaster Walls		NAD	2185	SF	0	SF				N/A	N/A	N/A
1	1	Hallway outside Classrooms 102-104	N/A	Marble Walls		Non Suspect ACM	850	SF	0	SF				N/A	N/A	N/A
1	1	Hallway outside Classrooms 102-104	N/A	Cement Floor		Non Suspect ACM	1020	SF	0	SF				N/A	N/A	N/A
1	1	Stairwell B	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	23	LF	0	LF				N/A	N/A	N/A
1	1	Stairwell B	N/A	Plaster Ceiling		NAD	375	SF	0	SF				N/A	N/A	N/A
1	1	Stairwell B	N/A	Plaster Walls		NAD	900	SF	0	SF				N/A	N/A	N/A
1	1	Stairwell B	N/A	Brick Wall		Non Suspect ACM	250	SF	0	SF				N/A	N/A	N/A
1	1	Stairwell B	N/A	Concrete Block Wall		Non Suspect ACM	75	SF	0	SF				N/A	N/A	N/A
1	1	Stairwell B	N/A	Cement Floor		Non Suspect ACM	375	SF	0	SF				N/A	N/A	N/A
1	1	Hallway outside Classrooms 105-110	N/A	Ceiling Tile 1' x 1'		NAD	1640	SF	0	SF		Glued 1'x1' Ceiling Tile		N/A	N/A	N/A
1	1	Hallway outside Classrooms 105-110	N/A	Plaster Ceiling		NAD	1800	SF	0	SF				N/A	N/A	N/A
1	1	Hallway outside Classrooms 105-110	N/A	Plaster Walls		NAD	3600	SF	20	SF				N/A	N/A	N/A
1	1	Hallway outside Classrooms 105-110	N/A	Marble Walls		Non Suspect ACM	1500	SF	0	SF				N/A	N/A	N/A
1	1	Hallway outside Classrooms 105-110	N/A	Cement Floor		Non Suspect ACM	1800	SF	0	SF				N/A	N/A	N/A
1	1	Hallway outside Classrooms 105-110	M	Spline Ceiling Glue Dots	4020/01/01/AET/BB/2603	Assumed	1640	SF	0	SF				1	No	1/D
1	1	Elevator adjacent Stairwell B	N/A	Metal Ceiling		Non Suspect ACM	40	SF	0	SF				N/A	N/A	N/A
1	1	Elevator adjacent Stairwell B	N/A	Metal Walls		Non Suspect ACM	185	SF	0	SF				N/A	N/A	N/A
1	1	Elevator adjacent Stairwell B	M	Floor Tile VAT 12" x 12"	4020/01/01/QQ	Assumed	40	SF	0	SF	Tan			1	No	1/D
1	1	Elevator adjacent Stairwell B	N/A	Cement Floor		Non Suspect ACM	40	SF	0	SF				N/A	N/A	N/A
1	1	Elevator adjacent Stairwell A	X	X		X	X	X	X	X	X	No Access - Elevator is not operational and the entrance is sealed at each floor.		X	X	X
1	1	Throughout Elements 1 & 2	M	Fire Doors	4020/01/00/DD	Assumed	x	x	x	x				X	X	X
2	1	Gym over Boy's Locker Room	T	Pipe Fitting Insulation	4020/02/01/08	Confirmed	4	EA	0	EA				1	No	1/D
2	1	Gym over Boy's Locker Room	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	6	LF	1	LF				N/A	N/A	N/A
2	1	Gym over Boy's Locker Room	N/A	Concrete Ceiling		Non Suspect ACM	5670	SF	0	SF				N/A	N/A	N/A
2	1	Gym over Boy's Locker Room	N/A	Concrete Block Wall		Non Suspect ACM	5185	SF	0	SF				N/A	N/A	N/A
2	1	Gym over Boy's Locker Room	N/A	Wood Floor		Non Suspect ACM	5670	SF	0	SF				N/A	N/A	N/A
2	1	Gym over Girl's Locker Room	T	Pipe Fitting Insulation	4020/02/01/08	Confirmed	9	EA	0	EA				1	No	1/D
2	1	Gym over Girl's Locker Room	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	35	LF	0	LF				N/A	N/A	N/A
2	1	Gym over Girl's Locker Room	N/A	Concrete Ceiling		Non Suspect ACM	5670	SF	0	SF				N/A	N/A	N/A
2	1	Gym over Girl's Locker Room	N/A	Concrete Block Wall		Non Suspect ACM	5185	SF	0	SF				N/A	N/A	N/A
2	1	Gym over Girl's Locker Room	N/A	Wood Floor		Non Suspect ACM	5670	SF	0	SF				N/A	N/A	N/A
2	1	Athletic Director's Office	N/A	Concrete Ceiling		Non Suspect ACM	320	SF	0	SF				N/A	N/A	N/A
2	1	Athletic Director's Office	N/A	Concrete Block Wall		Non Suspect ACM	550	SF	0	SF	Green			N/A	N/A	N/A
2	1	Athletic Director's Office	M	Floor Tile VAT 9" x 9"	4020/02/01/07	Confirmed	320	SF	0	SF	Green			1	No	1/D
2	1	Athletic Director's Office	N/A	Cement Floor		Non Suspect ACM	320	SF	0	SF				N/A	N/A	N/A
2	1	Athletic Director's Office Storage Room	N/A	Concrete Ceiling		Non Suspect ACM	110	SF	0	SF				N/A	N/A	N/A
2	1	Athletic Director's Office Storage Room	N/A	Concrete Block Wall		Non Suspect ACM	420	SF	0	SF				N/A	N/A	N/A
2	1	Athletic Director's Office Storage Room	M	Floor Tile VAT 12" x 12"	4020/02/01/A8	Assumed	110	SF	0	SF	Tan			1	No	1/D
2	1	Athletic Director's Office Storage Room	N/A	Cement Floor		Non Suspect ACM	110	SF	0	SF				N/A	N/A	N/A
2	1	Athletic Director's Office Restroom	N/A	Concrete Ceiling		Non Suspect ACM	140	SF	0	SF				N/A	N/A	N/A
2	1	Athletic Director's Office Restroom	N/A	Concrete Block Wall		Non Suspect ACM	480	SF	0	SF				N/A	N/A	N/A
2	1	Athletic Director's Office Restroom	M	Transite Stalls	4020/02/01/CC	Confirmed	25	SF	0	SF				1	No	1/D
2	1	Athletic Director's Office Restroom	M	Floor Tile VAT 9" x 9"	4020/02/01/07	Confirmed	140	SF	0	SF	Green			1	No	1/D
2	1	Athletic Director's Office Restroom	N/A	Cement Floor		Non Suspect ACM	140	SF	0	SF				N/A	N/A	N/A
2	1	Athletic Director's Office Closet	N/A	Concrete Ceiling		Non Suspect ACM	12	SF	0	SF				N/A	N/A	N/A

4020 Overbrook HS 2015-2016 AHERA Three Year Report

School District of Philadelphia			AHERA Three-Year Reinspection 2015-2016 Room by Room Location Log Report										Reinspection Date: 10/21/2015 Building Inspector: Bernard Brunner Certificate Number: 45397 Management Planner: M. Causley Certificate Number: ACC-0215-8-010				Attic / Crawl Space Ranking	Damage Potential (DP)	Newly Friable (NF)	Response Action (RA)
Overbrook High School 5898 Lancaster Avenue, Philadelphia, PA 19131 ULCS# 4020 Year Built: 1926			System Affected	Material Description	HID#	Confirmed Assumed NAD Non Suspect ACM	Amount of Material	SF LF EA	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes								
Element	Room	On Site Room Name																		
2	1	Athletic Director's Office Closet	N/A	Concrete Block Wall		Non Suspect ACM	120	SF	0	SF						N/A	N/A	N/A		
2	1	Athletic Director's Office Closet	M	Floor Tile VAT 9" x 9"	4020/02/01/07	Confirmed	12	SF	0	SF	Green					1	No	1/D		
2	1	Athletic Director's Office Closet	N/A	Cement Floor		Non Suspect ACM	12	SF	0	SF						N/A	N/A	N/A		
2	1	Storage Room adjacent Athletic Director's Office	T	Pipe Fitting Insulation	4020/02/01/08	Confirmed	9	EA	0	EA						1	No	1/D		
2	1	Storage Room adjacent Athletic Director's Office	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	50	LF	0	LF						N/A	N/A	N/A		
2	1	Storage Room adjacent Athletic Director's Office	N/A	Concrete Ceiling		Non Suspect ACM	600	SF	0	SF						N/A	N/A	N/A		
2	1	Storage Room adjacent Athletic Director's Office	N/A	Concrete Block Wall		Non Suspect ACM	1000	SF	0	SF						N/A	N/A	N/A		
2	1	Storage Room adjacent Athletic Director's Office	N/A	Cement Floor		Non Suspect ACM	600	SF	0	SF						N/A	N/A	N/A		
2	1	Storage Room adjacent Gym Office	T	Pipe Fitting Insulation	4020/02/01/08	Confirmed	4	EA	0	EA						1	No	1/D		
2	1	Storage Room adjacent Gym Office	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	27	LF	0	LF						N/A	N/A	N/A		
2	1	Storage Room adjacent Gym Office	N/A	Concrete Ceiling		Non Suspect ACM	240	SF	0	SF						N/A	N/A	N/A		
2	1	Storage Room adjacent Gym Office	N/A	Concrete Block Wall		Non Suspect ACM	640	SF	0	SF						N/A	N/A	N/A		
2	1	Storage Room adjacent Gym Office	N/A	Cement Floor		Non Suspect ACM	240	SF	0	SF						N/A	N/A	N/A		
2	1	Gym Office	N/A	Concrete Ceiling		Non Suspect ACM	310	SF	0	SF						N/A	N/A	N/A		
2	1	Gym Office	N/A	Concrete Block Wall		Non Suspect ACM	700	SF	0	SF						N/A	N/A	N/A		
2	1	Gym Office	M	Floor Tile VAT 9" x 9"	4020/02/01/07	Confirmed	310	SF	10	SF	Green					1	No	6/C		
2	1	Gym Office	N/A	Cement Floor		Non Suspect ACM	310	SF	0	SF						N/A	N/A	N/A		
2	1	Gym Office Restroom	N/A	Concrete Ceiling		Non Suspect ACM	110	SF	0	SF						N/A	N/A	N/A		
2	1	Gym Office Restroom	N/A	Concrete Block Wall		Non Suspect ACM	480	SF	0	SF						N/A	N/A	N/A		
2	1	Gym Office Restroom	M	Transite Stalls	4020/02/01/CC	Confirmed	10	SF	0	SF						1	No	1/D		
2	1	Gym Office Restroom	M	Floor Tile VAT 9" x 9"	4020/02/01/07	Confirmed	110	SF	0	SF	Green					1	No	1/D		
2	1	Gym Office Restroom	N/A	Cement Floor		Non Suspect ACM	110	SF	0	SF						N/A	N/A	N/A		
2	1	Girl's Restroom adjacent Gym	T	Pipe Fitting Insulation	4020/02/01/08	Confirmed	9	EA	0	EA						1	No	1/D		
2	1	Girl's Restroom adjacent Gym	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	13	LF	0	LF						N/A	N/A	N/A		
2	1	Girl's Restroom adjacent Gym	N/A	Concrete Ceiling		Non Suspect ACM	185	SF	0	SF						N/A	N/A	N/A		
2	1	Girl's Restroom adjacent Gym	N/A	Concrete Block Wall		Non Suspect ACM	540	SF	0	SF						N/A	N/A	N/A		
2	1	Girl's Restroom adjacent Gym	M	Transite Sills	4020/02/01/CC	Confirmed	5	SF	0	SF						1	No	1/D		
2	1	Girl's Restroom adjacent Gym	M	Transite Stalls	4020/02/01/CC	Confirmed	90	SF	0	SF						1	No	1/D		
2	1	Girl's Restroom adjacent Gym	N/A	Cement Floor		Non Suspect ACM	185	SF	0	SF						N/A	N/A	N/A		
2	1	Custodial Closet and Pipe Chase adjacent Girl's Restroom adjacent Gym	T	Pipe Fitting Insulation	4020/02/01/08	Confirmed	30	EA	0	EA						1	No	1/D		
2	1	Custodial Closet and Pipe Chase adjacent Girl's Restroom adjacent Gym	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	100	LF	0	LF						N/A	N/A	N/A		
2	1	Stairwell to Oxford Street Entrance	T	Pipe Fitting Insulation	4020/02/01/08	Confirmed	21	EA	0	EA						1	No	1/D		
2	1	Stairwell to Oxford Street Entrance	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	70	LF	0	LF						N/A	N/A	N/A		
2	1	Stairwell to Oxford Street Entrance	N/A	Concrete Ceiling		Non Suspect ACM	360	SF	0	SF						N/A	N/A	N/A		
2	1	Stairwell to Oxford Street Entrance	N/A	Brick Wall		Non Suspect ACM	720	SF	0	SF						N/A	N/A	N/A		
2	1	Stairwell to Oxford Street Entrance	M	Transite Sills	4020/02/01/CC	Confirmed	20	SF	0	SF						1	No	1/D		
2	1	Stairwell to Oxford Street Entrance	N/A	Cement Floor		Non Suspect ACM	360	SF	0	SF		120 square feet of exposed black mastic				N/A	N/A	N/A		
2	1	Halfway outside Restrooms adjacent Gym	N/A	Concrete Ceiling		Non Suspect ACM	1600	SF	0	SF						N/A	N/A	N/A		
2	1	Halfway outside Restrooms adjacent Gym	N/A	Concrete Block Wall		Non Suspect ACM	1350	SF	0	SF						N/A	N/A	N/A		
2	1	Halfway outside Restrooms adjacent Gym	M	Transite Sills	4020/02/01/CC	Confirmed	66	SF	0	SF						1	No	1/D		
2	1	Halfway outside Restrooms adjacent Gym	M	Floor Tile VAT 12" x 12"	4020/02/01/A8	Assumed	1310	SF	0	SF	Grey					1	No	1/D		
2	1	Halfway outside Restrooms adjacent Gym	M	Floor Tile VAT 12" x 12"	4020/02/01/A8	Assumed	290	SF	0	SF	Black					1	No	1/D		
2	1	Halfway outside Restrooms adjacent Gym	N/A	Cement Floor		Non Suspect ACM	1600	SF	0	SF						N/A	N/A	N/A		
2	1	Boy's Room adjacent Gym	X	X		X	X	X	X	X	X	No Access - No Key				N/A	X	X		
2	1	Halfway outside Gym Offices	N/A	Concrete Ceiling		Non Suspect ACM	1390	SF	0	SF						N/A	N/A	N/A		
2	1	Halfway outside Gym Offices	N/A	Concrete Block Wall		Non Suspect ACM	1900	SF	0	SF						N/A	N/A	N/A		
2	1	Halfway outside Gym Offices	M	Transite Sills	4020/02/01/CC	Confirmed	116	SF	0	SF						1	No	1/D		
2	1	Halfway outside Gym Offices	M	Floor Tile VAT 12" x 12"	4020/02/01/A8	Assumed	1012	SF	0	SF	Grey					1	No	1/D		
2	1	Halfway outside Gym Offices	M	Floor Tile VAT 12" x 12"	4020/02/01/A8	Assumed	378	SF	0	SF	Black					1	No	1/D		
2	1	Halfway outside Gym Offices	N/A	Cement Floor		Non Suspect ACM	1390	SF	0	SF						N/A	N/A	N/A		
2	1	Custodial Closet adjacent Athletic Director's Office	T	Pipe Fitting Insulation	4020/02/01/08	Confirmed	2	EA	0	EA						1	No	1/D		
2	1	Custodial Closet adjacent Athletic Director's Office	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	26	LF	0	LF						N/A	N/A	N/A		
2	1	Stairwell to Weight Room	X	X		X	X	X	X	X	X	No Access - No Key				X	X	X		
2	1	Halfway Stairs	T	Pipe Fitting Insulation	4020/02/01/08	Confirmed	7	EA	0	EA						1	No	1/D		
2	1	Stairs from Hallway Connector to Hallway outside Gym Offices Active Hallway	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	49	LF	0	LF						N/A	N/A	N/A		
2	1	Stairs from Hallway Connector to Hallway outside Gym Offices Active Hallway	N/A	Concrete Ceiling		Non Suspect ACM	120	SF	0	SF						N/A	N/A	N/A		
2	1	Stairs from Hallway Connector to Hallway outside Gym Offices Active Hallway	N/A	Concrete Block Wall		Non Suspect ACM	200	SF	0	SF						N/A	N/A	N/A		
2	1	Stairs from Hallway Connector to Hallway outside Gym Offices Active Hallway	M	Transite Sills	4020/02/01/CC	Confirmed	19	SF	0	SF						1	No	1/D		
2	1	Stairs from Hallway Connector to Hallway outside Gym Offices Active Hallway	M	Floor Tile VAT 12" x 12"	4020/02/01/A8	Assumed	14	SF	0	SF	Grey					1	No	1/D		
2	1	Stairs from Hallway Connector to Hallway outside Gym Offices Active Hallway	M	Floor Tile VAT 12" x 12"	4020/02/01/A8	Assumed	14	SF	0	SF	Black					1	No	1/D		
2	1	Stairs from Hallway Connector to Hallway outside Gym Offices Active Hallway	N/A	Cement Floor		Non Suspect ACM	120	SF	0	SF						N/A	N/A	N/A		
2	1	Hallway Connector from Element 1 to Element 2 Active Hallway	T	Pipe Fitting Insulation	4020/02/01/08	Confirmed	17	EA	0	EA						1	No	1/D		
2	1	Hallway Connector from Element 1 to Element 2 Active Hallway	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	88	LF	0	LF						N/A	N/A	N/A		
2	1	Hallway Connector from Element 1 to Element 2 Active Hallway	N/A	Concrete Ceiling		Non Suspect ACM	440	SF	0	SF						N/A	N/A	N/A		
2	1	Hallway Connector from Element 1 to Element 2 Active Hallway	N/A	Concrete Block Wall		Non Suspect ACM	215	SF	0	SF						N/A	N/A	N/A		
2	1	Hallway Connector from Element 1 to Element 2 Active Hallway	M	Transite Sills	4020/02/01/CC	Confirmed	43	SF	0	SF						1	No	1/D		

4020 Overbrook HS 2015-2016 AHERA Three Year Report

School District of Philadelphia		AHERA Three-Year Reinspection 2015-2016 Room by Room Location Log Report										Reinspection Date: 10/21/2015 Building Inspector: Bernard Brunner Certificate Number: 45397 Management Planner: M. Causley Certificate Number: ACC-0215-8-010									
Overbrook High School 5898 Lancaster Avenue, Philadelphia, PA 19131 ULCS# 4020 Year Built: 1926																					
Element	Floor																	Attic / Crawl Space Ranking	Damage Potential (DP)	Newly Friable (NF)	Response Action (RA)
		On Site Room Name	System Affected	Material Description	HID#	Confirmed Assumed NAD Non Suspect ACM	Amount of Material	SF LF EA	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes									
2	1	Hallway Connector from Element 1 to Element 2 Active Hallway	M	Floor Tile VAT 12" x 12"	4020/02/01/A8	Assumed	440	SF	0	SF	Tan				1	No	1/D				
2	1	Hallway Connector from Element 1 to Element 2 Active Hallway	N/A	Cement Floor		Non Suspect ACM	440	SF	0	SF					N/A	N/A	N/A				
2	1	Stairs from Hallway Connector to Hallway outside Gym Offices Inactive Hallway	T	Pipe Fitting Insulation	4020/02/01/08	Confirmed	8	EA	0	EA					1	No	1/D				
2	1	Stairs from Hallway Connector to Hallway outside Gym Offices Inactive Hallway	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	47	LF	0	LF					N/A	N/A	N/A				
2	1	Stairs from Hallway Connector to Hallway outside Gym Offices Inactive Hallway	N/A	Concrete Ceiling		Non Suspect ACM	120	SF	0	SF					N/A	N/A	N/A				
2	1	Stairs from Hallway Connector to Hallway outside Gym Offices Inactive Hallway	N/A	Concrete Block Wall		Non Suspect ACM	200	SF	0	SF					N/A	N/A	N/A				
2	1	Stairs from Hallway Connector to Hallway outside Gym Offices Inactive Hallway	M	Transite Sills	4020/02/01/CC	Confirmed	19	SF	0	SF					1	No	1/D				
2	1	Stairs from Hallway Connector to Hallway outside Gym Offices Inactive Hallway	M	Floor Tile VAT 12" x 12"	4020/02/01/A8	Assumed	14	SF	0	SF	Grey				1	No	1/D				
2	1	Stairs from Hallway Connector to Hallway outside Gym Offices Inactive Hallway	M	Floor Tile VAT 12" x 12"	4020/02/01/A8	Assumed	14	SF	0	SF	Black				1	No	1/D				
2	1	Stairs from Hallway Connector to Hallway outside Gym Offices Inactive Hallway	N/A	Cement Floor		Non Suspect ACM	120	SF	0	SF					N/A	N/A	N/A				
2	1	Hallway Connector from Element 1 to Element 2 Inactive Hallway	N/A	Concrete Ceiling		Non Suspect ACM	440	SF	0	SF					N/A	N/A	N/A				
2	1	Hallway Connector from Element 1 to Element 2 Inactive Hallway	N/A	Concrete Block Wall		Non Suspect ACM	215	SF	0	SF					N/A	N/A	N/A				
2	1	Hallway Connector from Element 1 to Element 2 Inactive Hallway	M	Transite Sills	4020/02/01/CC	Confirmed	49	SF	0	SF					1	No	1/D				
2	1	Hallway Connector from Element 1 to Element 2 Inactive Hallway	M	Floor Tile VAT 12" x 12"	4020/02/01/A8	Assumed	440	SF	0	SF	Tan				1	No	1/D				
2	1	Hallway Connector from Element 1 to Element 2 Inactive Hallway	N/A	Cement Floor		Non Suspect ACM	440	SF	0	SF					N/A	N/A	N/A				
1	2	Classroom 205	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	26	LF	0	LF					N/A	N/A	N/A				
1	2	Classroom 205	N/A	Plaster Ceiling		NAD	720	SF	5	SF					N/A	N/A	N/A				
1	2	Classroom 205	N/A	Plaster Walls		NAD	1010	SF	40	SF					N/A	N/A	N/A				
1	2	Classroom 205	N/A	Sheetrock Wall		NAD	290	SF	0	SF					N/A	N/A	N/A				
1	2	Classroom 205	N/A	Wood Floor		Non Suspect ACM	720	SF	0	SF					N/A	N/A	N/A				
1	2	Classroom 205	M	Blackboard Glue Dots	4020/01/02/AET/BB/2600	Assumed	150	SF	0	SF					1	No	1/D				
1	2	Storage Room between Elevator and Office 206	N/A	Concrete Ceiling		NAD	240	SF	0	SF					N/A	N/A	N/A				
1	2	Storage Room between Elevator and Office 206	N/A	Plaster Walls		NAD	820	SF	0	SF					N/A	N/A	N/A				
1	2	Storage Room between Elevator and Office 206	N/A	Wood Floor		Non Suspect ACM	240	SF	0	SF					N/A	N/A	N/A				
1	2	Office 206 Special Education Suite Common Area	N/A	Fiberglass Ceiling Tile 2' x 4'		Non Suspect ACM	420	SF	0	SF					N/A	N/A	N/A				
1	2	Office 206 Special Education Suite Common Area	N/A	Plaster Ceiling		NAD	420	SF	0	SF					N/A	N/A	N/A				
1	2	Office 206 Special Education Suite Common Area	N/A	Plaster Walls		NAD	310	SF	0	SF					N/A	N/A	N/A				
1	2	Office 206 Special Education Suite Common Area	N/A	Brick Wall		Non Suspect ACM	220	SF	0	SF					N/A	N/A	N/A				
1	2	Office 206 Special Education Suite Common Area	N/A	Sheetrock Wall		NAD	170	SF	0	SF					N/A	N/A	N/A				
1	2	Office 206 Special Education Suite Common Area	N/A	Metal Walls		Non Suspect ACM	240	SF	0	SF					N/A	N/A	N/A				
1	2	Office 206 Special Education Suite Common Area	M	Floor Tile VAT 9" x 9"	4020/01/02/33	Confirmed	402	SF	0	SF	Blue				1	No	1/D				
1	2	Office 206 Special Education Suite Common Area	M	Floor Tile VAT 12" x 12"	4020/01/02/RR	Assumed	18	SF	0	SF	Green				1	No	1/D				
1	2	Office 206 Special Education Suite Copy Room	N/A	Cement Floor		Non Suspect ACM	420	SF	0	SF					N/A	N/A	N/A				
1	2	Office 206 Special Education Suite Copy Room	N/A	Fiberglass Ceiling Tile 2' x 4'		Non Suspect ACM	120	SF	0	SF					N/A	N/A	N/A				
1	2	Office 206 Special Education Suite Copy Room	N/A	Plaster Ceiling		NAD	120	SF	0	SF					N/A	N/A	N/A				
1	2	Office 206 Special Education Suite Copy Room	N/A	Plaster Walls		NAD	155	SF	0	SF					N/A	N/A	N/A				
1	2	Office 206 Special Education Suite Copy Room	N/A	Brick Wall		Non Suspect ACM	110	SF	0	SF					N/A	N/A	N/A				
1	2	Office 206 Special Education Suite Copy Room	N/A	Metal Walls		Non Suspect ACM	180	SF	0	SF					N/A	N/A	N/A				
1	2	Office 206 Special Education Suite Copy Room	M	Floor Tile VAT 9" x 9"	4020/01/02/33	Confirmed	120	SF	0	SF	Blue				1	No	1/D				
1	2	Office 206 Special Education Suite Copy Room	N/A	Cement Floor		Non Suspect ACM	120	SF	0	SF					N/A	N/A	N/A				
1	2	Office 206 Special Education Suite Center Office	N/A	Fiberglass Ceiling Tile 2' x 4'		Non Suspect ACM	120	SF	0	SF					N/A	N/A	N/A				
1	2	Office 206 Special Education Suite Center Office	N/A	Plaster Ceiling		NAD	120	SF	0	SF					N/A	N/A	N/A				
1	2	Office 206 Special Education Suite Center Office	N/A	Plaster Walls		NAD	85	SF	0	SF					N/A	N/A	N/A				
1	2	Office 206 Special Education Suite Center Office	N/A	Brick Wall		Non Suspect ACM	60	SF	0	SF					N/A	N/A	N/A				
1	2	Office 206 Special Education Suite Center Office	N/A	Metal Walls		Non Suspect ACM	315	SF	0	SF					N/A	N/A	N/A				
1	2	Office 206 Special Education Suite Center Office	M	Floor Tile VAT 9" x 9"	4020/01/02/33	Confirmed	120	SF	2	SF	Blue				1	No	6/C				
1	2	Office 206 Special Education Suite Center Office	N/A	Cement Floor		Non Suspect ACM	120	SF	0	SF					N/A	N/A	N/A				
1	2	Office 206 Special Education Suite Left Office School Psychologist	N/A	Fiberglass Ceiling Tile 2' x 4'		Non Suspect ACM	120	SF	0	SF					N/A	N/A	N/A				
1	2	Office 206 Special Education Suite Left Office School Psychologist	N/A	Plaster Ceiling		NAD	120	SF	0	SF					N/A	N/A	N/A				
1	2	Office 206 Special Education Suite Left Office School Psychologist	N/A	Plaster Walls		NAD	70	SF	0	SF					N/A	N/A	N/A				
1	2	Office 206 Special Education Suite Left Office School Psychologist	N/A	Brick Wall		Non Suspect ACM	50	SF	0	SF					N/A	N/A	N/A				
1	2	Office 206 Special Education Suite Left Office School Psychologist	N/A	Metal Walls		Non Suspect ACM	180	SF	0	SF					N/A	N/A	N/A				
1	2	Office 206 Special Education Suite Left Office School Psychologist	N/A	Sheetrock Wall		NAD	145	SF	0	SF					N/A	N/A	N/A				
1	2	Office 206 Special Education Suite Left Office School Psychologist	M	Floor Tile VAT 9" x 9"	4020/01/02/33	Confirmed	120	SF	0	SF	Blue				1	No	1/D				
1	2	Office 206 Special Education Suite Left Office School Psychologist	N/A	Cement Floor		Non Suspect ACM	120	SF	0	SF					N/A	N/A	N/A				
1	2	Office 206 Special Education Suite Large Left Office	N/A	Fiberglass Ceiling Tile 2' x 4'		Non Suspect ACM	240	SF	0	SF					N/A	N/A	N/A				
1	2	Office 206 Special Education Suite Large Left Office	N/A	Plaster Ceiling		NAD	240	SF	0	SF					N/A	N/A	N/A				
1	2	Office 206 Special Education Suite Large Left Office	N/A	Plaster Walls		NAD	140	SF	0	SF					N/A	N/A	N/A				

4020 Overbrook HS 2015-2016 AHERA Three Year Report

School District of Philadelphia Overbrook High School 5898 Lancaster Avenue, Philadelphia, PA 19131 ULCS# 4020 Year Built: 1926			AHERA Three-Year Reinspection 2015-2016 Room by Room Location Log Report										Reinspection Date: 10/21/2015 Building Inspector: Bernard Brunner Certificate Number: 45397 Management Planner: M. Causley Certificate Number: ACC-0215-8-010								
Element	Room	On Site Room Name	System Affected	Material Description	HID#	Confirmed Assumed NAD Non Suspect ACM	Amount of Material	SF LF EA	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic / Crawl Space Ranking	Damage Potential (DP)	Newly Friable (NF)	Response Action (RA)					
1	2	Office 206 Special Education Suite Large Left Office	N/A	Brick Wall		Non Suspect ACM	100	SF	0	SF				N/A	N/A	N/A					
1	2	Office 206 Special Education Suite Large Left Office	N/A	Sheetrock Wall		NAD	290	SF	0	SF				N/A	N/A	N/A					
1	2	Office 206 Special Education Suite Large Left Office	M	Transite Wall	4020/01/02/AET/BB/2380	Assumed	290	SF	0	SF		Wall appears to have a thin layer of transite over top of a fiberboard center		1	No	1/D					
1	2	Office 206 Special Education Suite Large Left Office	M	Floor Tile VAT 9" x 9"	4020/01/02/33	Confirmed	231	SF	0	SF	Blue			1	No	1/D					
1	2	Office 206 Special Education Suite Large Left Office	M	Floor Tile VAT 12" x 12"	4020/01/02/RR	Assumed	9	SF	0	SF	Green			1	No	1/D					
1	2	Office 206 Special Education Suite Large Left Office	N/A	Cement Floor		Non Suspect ACM	240	SF	0	SF				N/A	N/A	N/A					
1	2	Classroom 207	T	Pipe Insulation 2-6 inch	4020/01/02/34	Confirmed	6	LF	0	LF				1	No	1/D					
1	2	Classroom 207	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	4	LF	4	LF				N/A	N/A	N/A					
1	2	Classroom 207	N/A	Plaster Ceiling		NAD	720	SF	0	SF				N/A	N/A	N/A					
1	2	Classroom 207	N/A	Plaster Walls		NAD	1010	SF	25	SF				N/A	N/A	N/A					
1	2	Classroom 207	N/A	Sheetrock Wall		NAD	290	SF	0	SF				N/A	N/A	N/A					
1	2	Classroom 207	N/A	Wood Floor		Non Suspect ACM	720	SF	0	SF				N/A	N/A	N/A					
1	2	Classroom 207	M	Blackboard Glue Dots	4020/01/02/AET/BB/2600	Assumed	195	SF	0	SF				1	No	1/D					
1	2	Office 208	T	Pipe Insulation 2-6 inch	4020/01/02/34	Confirmed	12	LF	0	LF				1	No	1/D					
1	2	Office 208	N/A	Plaster Ceiling		NAD	384	SF	0	SF				N/A	N/A	N/A					
1	2	Office 208	N/A	Plaster Walls		NAD	960	SF	0	SF				N/A	N/A	N/A					
1	2	Office 208	N/A	Wood Floor		Non Suspect ACM	384	SF	0	SF				N/A	N/A	N/A					
1	2	Office 209	N/A	Pipe Fitting Insulation		NAD	7	EA	0	EA				N/A	N/A	N/A					
1	2	Office 209	T	Pipe Insulation 2-6 inch	4020/01/02/34	Confirmed	12	LF	0	LF				1	No	1/D					
1	2	Office 209	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	81	LF	0	LF				N/A	N/A	N/A					
1	2	Office 209	N/A	Plaster Ceiling		NAD	384	SF	5	SF				N/A	N/A	N/A					
1	2	Office 209	N/A	Plaster Walls		NAD	960	SF	0	SF				N/A	N/A	N/A					
1	2	Office 209	N/A	Wood Floor		Non Suspect ACM	384	SF	0	SF				N/A	N/A	N/A					
1	2	Room between Office 206 and Classroom 210	X	X		X	X	X	X	X	X	No Access - No Key		X	X	X					
1	2	Classroom 210	N/A	Fiberglass Ceiling Tile 2' x 4'		Non Suspect ACM	520	SF	0	SF				N/A	N/A	N/A					
1	2	Classroom 210	N/A	Plaster Ceiling		NAD	520	SF	0	SF				N/A	N/A	N/A					
1	2	Classroom 210	N/A	Plaster Walls		NAD	465	SF	0	SF				N/A	N/A	N/A					
1	2	Classroom 210	N/A	Brick Wall		Non Suspect ACM	330	SF	0	SF				N/A	N/A	N/A					
1	2	Classroom 210	M	Transite Wall	4020/01/02/AET/BB/2380	Assumed	315	SF	0	SF		Wall appears to have a thin layer of transite over top of a fiberboard center		1	No	1/D					
1	2	Classroom 210	M	Floor Tile VAT 9" x 9"	4020/01/02/33	Confirmed	520	SF	1	SF	Blue			1	No	6/C					
1	2	Classroom 210	N/A	Cement Floor		Non Suspect ACM	520	SF	0	SF				N/A	N/A	N/A					
1	2	Classroom 210	M	Blackboard Glue Dots	4020/01/02/AET/BB/2600	Assumed	80	SF	0	SF				1	No	1/D					
1	2	Classroom 210 Pipe Chase	X	X		X	X	X	X	X	X	No Access - Access Panel Blocked by Desk		X	X	X					
1	2	Classroom 211	T	Pipe Insulation 2-6 inch	4020/01/02/34	Confirmed	6	LF	0	LF				1	No	1/D					
1	2	Classroom 211	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	85	LF	0	LF				N/A	N/A	N/A					
1	2	Classroom 211	N/A	Plaster Ceiling		NAD	720	SF	10	SF				N/A	N/A	N/A					
1	2	Classroom 211	N/A	Plaster Walls		NAD	1300	SF	20	SF				N/A	N/A	N/A					
1	2	Classroom 211	N/A	Wood Floor		Non Suspect ACM	720	SF	0	SF				N/A	N/A	N/A					
1	2	Classroom 211	M	Blackboard Glue Dots	4020/01/02/AET/BB/2600	Assumed	300	SF	0	SF				1	No	1/D					
1	2	Boy's Restroom	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	39	LF	1	LF				N/A	N/A	N/A					
1	2	Boy's Restroom	N/A	Plaster Ceiling		NAD	355	SF	0	SF				N/A	N/A	N/A					
1	2	Boy's Restroom	N/A	Plaster Walls		NAD	1065	SF	0	SF				N/A	N/A	N/A					
1	2	Boy's Restroom	N/A	Marble Walls		Non Suspect ACM	135	SF	0	SF				N/A	N/A	N/A					
1	2	Boy's Restroom	N/A	Brick Wall		Non Suspect ACM	180	SF	0	SF				N/A	N/A	N/A					
1	2	Boy's Restroom	N/A	Cement Floor		Non Suspect ACM	355	SF	0	SF				N/A	N/A	N/A					
1	2	Custodial Closet adjacent to Boy's Restroom	N/A	Pipe Fitting Insulation		NAD	2	EA	0	EA				N/A	N/A	N/A					
1	2	Custodial Closet adjacent to Boy's Restroom	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	38	LF	0	LF				N/A	N/A	N/A					
1	2	Stairwell C Pipe Chase at 2nd Floor	X	X		X	X	X	X	X	X	No Access		X	X	X					
1	2	Classroom 212	T	Pipe Insulation 2-6 inch	4020/01/02/34	Confirmed	6	LF	0	LF				1	No	1/D					
1	2	Classroom 212	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	6	LF	0	LF				N/A	N/A	N/A					
1	2	Classroom 212	N/A	Plaster Ceiling		NAD	720	SF	5	SF				N/A	N/A	N/A					
1	2	Classroom 212	N/A	Plaster Walls		NAD	1300	SF	10	SF				N/A	N/A	N/A					
1	2	Classroom 212	N/A	Wood Floor		Non Suspect ACM	720	SF	0	SF				N/A	N/A	N/A					
1	2	Classroom 212	M	Blackboard Glue Dots	4020/01/02/AET/BB/2600	Assumed	270	SF	0	SF				1	No	1/D					
1	2	Classroom 213	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	30	LF	0	LF				N/A	N/A	N/A					
1	2	Classroom 213	N/A	Plaster Ceiling		NAD	1056	SF	25	SF				N/A	N/A	N/A					
1	2	Classroom 213	N/A	Plaster Walls		NAD	1635	SF	20	SF				N/A	N/A	N/A					
1	2	Classroom 213	N/A	Wood Floor		Non Suspect ACM	1056	SF	0	SF				N/A	N/A	N/A					
1	2	Classroom 213	M	Blackboard Glue Dots	4020/01/02/AET/BB/2600	Assumed	270	SF	0	SF				1	No	1/D					
1	2	Classroom 214	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	12	LF	0	LF				N/A	N/A	N/A					
1	2	Classroom 214	N/A	Plaster Ceiling		NAD	768	SF	0	SF				N/A	N/A	N/A					
1	2	Classroom 214	N/A	Plaster Walls		NAD	1345	SF	5	SF				N/A	N/A	N/A					
1	2	Classroom 214	N/A	Wood Floor		Non Suspect ACM	768	SF	0	SF				N/A	N/A	N/A					
1	2	Classroom 214	M	Blackboard Glue Dots	4020/01/02/AET/BB/2600	Assumed	255	SF	0	SF				1	No	1/D					
1	2	IMC	T	Pipe Insulation 2-6 inch	4020/01/02/34	Confirmed	6	LF	0	LF				1	No	1/D					
1	2	IMC	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	110	LF	0	LF				N/A	N/A	N/A					
1	2	IMC	N/A	Ceiling Tile 2' x 4'		NAD	3460	SF	0	SF				N/A	N/A	N/A					
1	2	IMC	N/A	Plaster Ceiling		NAD	3460	SF	0	SF				N/A	N/A	N/A					
1	2	IMC	N/A	Plaster Walls		NAD	2305	SF	0	SF				N/A	N/A	N/A					
1	2	IMC	N/A	Brick Wall		Non Suspect ACM	1730	SF	0	SF				N/A	N/A	N/A					
1	2	IMC	M	Floor Tile VAT 9" x 9"	4020/01/02/33	Confirmed	3460	SF	0	SF	Tan	Below Carpet		1	No	1/D					
1	2	IMC	N/A	Carpet		Non Suspect ACM	3460	SF	0	SF		Over 9x9 Floor Tile		N/A	N/A	N/A					
1	2	IMC	N/A	Wood Floor		Non Suspect ACM	3460	SF	0	SF				N/A	N/A	N/A					
1	2	Classroom 216	N/A	Pipe Fitting Insulation		NAD	2	EA	0	EA				N/A	N/A	N/A					
1	2	Classroom 216	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	251	LF	9	LF				N/A	N/A	N/A					
1	2	Classroom 216	N/A	Plaster Ceiling		NAD	1056	SF	20	SF				N/A	N/A	N/A					
1	2	Classroom 216	N/A	Plaster Walls		NAD	1345	SF	0	SF				N/A	N/A	N/A					

4020 Overbrook HS 2015-2016 AHERA Three Year Report

School District of Philadelphia		AHERA Three-Year Reinspection 2015-2016 Room by Room Location Log Report										Reinspection Date: 10/21/2015 Building Inspector: Bernard Brunner Certificate Number: 45397 Management Planner: M. Causley Certificate Number: ACC-0215-8-010								
Overbrook High School 5898 Lancaster Avenue, Philadelphia, PA 19131 ULCS# 4020 Year Built: 1926																				
Element	Floor											Attic / Crawl Space Ranking	Damage Potential (DP)	Newly Friable (NF)	Response Action (RA)					
		On Site Room Name	System Affected	Material Description	HID#	Confirmed	Assumed	NAD	Amount of Material	SF	LF					EA	Amount of Damage	SF	LF	EA
1	2	Classroom 216	N/A	Partition Room Dividers		Non Suspect ACM	290	SF	1	SF										
1	2	Classroom 216	N/A	Wood Floor		Non Suspect ACM	1056	SF	0	SF								N/A	N/A	N/A
1	2	Classroom 216	M	Blackboard Glue Dots	4020/01/02/AET/BB/2600	Assumed	40	SF	0	SF								1	No	1/D
1	2	Classroom 216 Closet closest to Window Wall	T	Pipe Insulation 2-6 inch	4020/01/02/34	Confirmed	4	LF	0	LF								1	No	1/D
1	2	Classroom 216 Closet closest to Window Wall	N/A	Plaster Ceiling		NAD	36	SF	0	SF								N/A	N/A	N/A
1	2	Classroom 216 Closet closest to Window Wall	N/A	Plaster Walls		NAD	220	SF	1	SF								N/A	N/A	N/A
1	2	Classroom 216 Closet closest to Window Wall	N/A	Wood Floor		Non Suspect ACM	36	SF	0	SF								N/A	N/A	N/A
1	2	Classroom 216 Closet closest to Teacher's Desk	N/A	Plaster Ceiling		NAD	36	SF	0	SF								N/A	N/A	N/A
1	2	Classroom 216 Closet closest to Teacher's Desk	N/A	Plaster Walls		NAD	220	SF	0	SF								N/A	N/A	N/A
1	2	Classroom 216 Closet closest to Teacher's Desk	N/A	Wood Floor		Non Suspect ACM	36	SF	0	SF								N/A	N/A	N/A
1	2	Classroom 217	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	4	LF	4	LF								N/A	N/A	N/A
1	2	Classroom 217	N/A	Plaster Ceiling		NAD	720	SF	0	SF								N/A	N/A	N/A
1	2	Classroom 217	N/A	Plaster Walls		NAD	1010	SF	0	SF								N/A	N/A	N/A
1	2	Classroom 217	N/A	Partition Room Dividers		Non Suspect ACM	290	SF	0	SF								N/A	N/A	N/A
1	2	Classroom 217	N/A	Wood Floor		Non Suspect ACM	720	SF	0	SF								N/A	N/A	N/A
1	2	Classroom 217	M	Blackboard Glue Dots	4020/01/02/AET/BB/2600	Assumed	150	SF	0	SF								1	No	1/D
1	2	Girl's Restroom	N/A	Pipe Fitting Insulation		NAD	2	EA	0	EA								N/A	N/A	N/A
1	2	Girl's Restroom	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	54	LF	0	LF								N/A	N/A	N/A
1	2	Girl's Restroom	N/A	Plaster Ceiling		NAD	355	SF	40	SF								N/A	N/A	N/A
1	2	Girl's Restroom	N/A	Plaster Walls		NAD	535	SF	15	SF								N/A	N/A	N/A
1	2	Girl's Restroom	N/A	Brick Wall		Non Suspect ACM	535	SF	0	SF								N/A	N/A	N/A
1	2	Girl's Restroom	N/A	Marble Walls		Non Suspect ACM	135	SF	0	SF								N/A	N/A	N/A
1	2	Girl's Restroom	N/A	Cement Floor		Non Suspect ACM	355	SF	0	SF								N/A	N/A	N/A
1	2	Girl's Restroom	M	Linoleum	4020/01/02/AET/BB/2200	Assumed	355	SF	50	SF			Linoleum has been painted over					1	No	6/C
1	2	Custodial Closet adjacent to Girl's Restroom	N/A	Pipe Fitting Insulation		NAD	2	EA	0	EA								N/A	N/A	N/A
1	2	Custodial Closet adjacent to Girl's Restroom	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	38	LF	0	LF								N/A	N/A	N/A
1	2	Stairwell D Pipe Chase at 2nd Floor	N/A	Pipe Fitting Insulation		NAD	9	EA	0	EA								N/A	N/A	N/A
1	2	Stairwell D Pipe Chase at 2nd Floor	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	75	LF	0	LF								N/A	N/A	N/A
1	2	Office 218 Educational Talent Search University of Pennsylvania Office	T	Pipe Insulation 2-6 inch	4020/01/02/34	Confirmed	6	LF	0	LF								1	No	1/D
1	2	Office 218 Educational Talent Search University of Pennsylvania Office	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	3	LF	0	LF								N/A	N/A	N/A
1	2	Office 218 Educational Talent Search University of Pennsylvania Office	N/A	Ceiling Tile 2' x 4'		NAD	755	SF	0	SF								N/A	N/A	N/A
1	2	Office 218 Educational Talent Search University of Pennsylvania Office	N/A	Plaster Ceiling		NAD	755	SF	0	SF								N/A	N/A	N/A
1	2	Office 218 Educational Talent Search University of Pennsylvania Office	N/A	Plaster Walls		NAD	590	SF	0	SF								N/A	N/A	N/A
1	2	Office 218 Educational Talent Search University of Pennsylvania Office	N/A	Brick Wall		Non Suspect ACM	420	SF	0	SF								N/A	N/A	N/A
1	2	Office 218 Educational Talent Search University of Pennsylvania Office	N/A	Concrete Block Wall		Non Suspect ACM	315	SF	0	SF								N/A	N/A	N/A
1	2	Office 218 Educational Talent Search University of Pennsylvania Office	M	Floor Tile VAT 12" x 12"	4020/01/02/RR	Assumed	755	SF	0	SF	Tan							1	No	1/D
1	2	Office 218 Educational Talent Search University of Pennsylvania Office	N/A	Cement Floor		Non Suspect ACM	755	SF	0	SF								N/A	N/A	N/A
1	2	Office 218 Educational Talent Search University of Pennsylvania Office	M	Sink Undercoat Mastic	4020/01/02/AET/BB/2602	Assumed	5	SF	0	SF		Gray						1	No	1/D
1	2	Office 218 Pipe Chase	X	X		X	X	X	X	X	X	No Access - Access Panel Blocked by Desk						X	X	X
1	2	Classroom 219	N/A	Pipe Fitting Insulation		NAD	14	EA	0	EA								N/A	N/A	N/A
1	2	Classroom 219	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	93	LF	0	LF								N/A	N/A	N/A
1	2	Classroom 219	N/A	Plaster Ceiling		NAD	720	SF	0	SF								N/A	N/A	N/A
1	2	Classroom 219	N/A	Plaster Walls		NAD	1300	SF	0	SF								N/A	N/A	N/A
1	2	Classroom 219	N/A	Wood Floor		Non Suspect ACM	720	SF	5	SF								N/A	N/A	N/A
1	2	Classroom 219	M	Blackboard Glue Dots	4020/01/02/AET/BB/2600	Assumed	260	SF	0	SF								1	No	1/D
1	2	Storage Room 220	N/A	Ceiling Tile 2' x 4'		NAD	225	SF	0	SF								N/A	N/A	N/A
1	2	Storage Room 220	N/A	Plaster Ceiling		NAD	225	SF	0	SF								N/A	N/A	N/A
1	2	Storage Room 220	N/A	Plaster Walls		NAD	555	SF	0	SF								N/A	N/A	N/A
1	2	Storage Room 220	N/A	Sheetrock Wall		NAD	170	SF	0	SF								N/A	N/A	N/A
1	2	Storage Room 220	N/A	Wood Floor		Non Suspect ACM	225	SF	0	SF								N/A	N/A	N/A
1	2	Storage Room 220 Rear Office	N/A	Ceiling Tile 2' x 4'		NAD	115	SF	0	SF			Door locked - no access. Inspection performed through window. Unable to view bottom of riser in corner.					N/A	N/A	N/A
1	2	Storage Room 220 Rear Office	N/A	Plaster Ceiling		NAD	115	SF	0	SF			Door locked - no access. Inspection performed through window. Unable to view bottom of riser in corner.					N/A	N/A	N/A
1	2	Storage Room 220 Rear Office	N/A	Plaster Walls		NAD	360	SF	0	SF			Door locked - no access. Inspection performed through window. Unable to view bottom of riser in corner.					N/A	N/A	N/A
1	2	Storage Room 220 Rear Office	N/A	Sheetrock Wall		NAD	170	SF	0	SF			Door locked - no access. Inspection performed through window. Unable to view bottom of riser in corner.					N/A	N/A	N/A
1	2	Storage Room 220 Rear Office	N/A	Wood Floor		Non Suspect ACM	115	SF	0	SF			Door locked - no access. Inspection performed through window. Unable to view bottom of riser in corner.					N/A	N/A	N/A
1	2	Office 221	N/A	Fiberglass Ceiling Tile 2' x 4'		Non Suspect ACM	240	SF	0	SF								N/A	N/A	N/A
1	2	Office 221	N/A	Plaster Ceiling		NAD	240	SF	0	SF								N/A	N/A	N/A
1	2	Office 221	N/A	Plaster Walls		NAD	625	SF	0	SF								N/A	N/A	N/A
1	2	Office 221	N/A	Wood Floor		Non Suspect ACM	240	SF	0	SF								N/A	N/A	N/A
1	2	Classroom 222	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	22	LF	0	LF								N/A	N/A	N/A
1	2	Classroom 222	N/A	Fiberglass Ceiling Tile 2' x 4'		Non Suspect ACM	970	SF	0	SF								N/A	N/A	N/A
1	2	Classroom 222	N/A	Plaster Ceiling		NAD	970	SF	0	SF								N/A	N/A	N/A
1	2	Classroom 222	N/A	Plaster Walls		NAD	835	SF	0	SF								N/A	N/A	N/A
1	2	Classroom 222	N/A	Brick Wall		Non Suspect ACM	510	SF	0	SF								N/A	N/A	N/A
1	2	Classroom 222	N/A	Concrete Block Wall		Non Suspect ACM	290	SF	0	SF								N/A	N/A	N/A

4020 Overbrook HS 2015-2016 AHERA Three Year Report

School District of Philadelphia			AHERA Three-Year Reinspection 2015-2016										Reinspection Date: 10/21/2015				
Overbrook High School			Room by Room Location Log Report										Building Inspector: Bernard Brunner				
5898 Lancaster Avenue, Philadelphia, PA 19131													Certificate Number: 45397				
ULCS# 4020													Management Planner: M. Causley				
Year Built: 1926													Certificate Number: ACC-0215-8-010				
Element	Room	On Site Room Name	System Affected	Material Description	HID#	Confirmed Assumed NAD Non Suspect ACM	Amount of Material	SF LF EA	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic / Crawl Space Ranking	Damage Potential (DP)	Newly Friable (NF)	Response Action (RA)	
1	2	Classroom 222	M	Floor Tile VAT 9" x 9"	4020/01/02/33	Confirmed	970	SF	0	SF	Green	Below 12 x 12 Floor Tile		1	No	1/D	
1	2	Classroom 222	M	Floor Tile VAT 12" x 12"	4020/01/02/RR	Assumed	970	SF	0	SF	Tan	Over 9 x 9 Floor Tile		1	No	1/D	
1	2	Classroom 222	N/A	Cement Floor		Non Suspect ACM	970	SF	0	SF				N/A	N/A	N/A	
1	2	Classroom 222	M	Blackboard Glue Dots	4020/01/02/AET/BB/2600	Assumed	80	SF	0	SF				1	No	1/D	
1	2	Classroom 222	M	Transite Electrical Panel	4020/01/02/AET/BB/2350	Assumed	20	SF	0	SF				1	No	1/D	
1	2	Storage Room adjacent Classroom 222	N/A	Plaster Ceiling		NAD	240	SF	10	SF				N/A	N/A	N/A	
1	2	Storage Room adjacent Classroom 222	N/A	Plaster Walls		NAD	820	SF	0	SF				N/A	N/A	N/A	
1	2	Storage Room adjacent Classroom 222	N/A	Wood Floor		Non Suspect ACM	240	SF	0	SF				N/A	N/A	N/A	
1	2	Classroom 223	N/A	Pipe Fitting Insulation		NAD	2	EA	0	EA				N/A	N/A	N/A	
1	2	Classroom 223	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	185	LF	10	LF				N/A	N/A	N/A	
1	2	Classroom 223	N/A	Plaster Ceiling		NAD	720	SF	10	SF				N/A	N/A	N/A	
1	2	Classroom 223	N/A	Plaster Walls		NAD	1300	SF	0	SF				N/A	N/A	N/A	
1	2	Classroom 223	N/A	Wood Floor		Non Suspect ACM	720	SF	0	SF				N/A	N/A	N/A	
1	2	Classroom 223	M	Blackboard Glue Dots	4020/01/02/AET/BB/2600	Assumed	260	SF	0	SF				1	No	1/D	
1	2	Classroom 224	N/A	Pipe Fitting Insulation		NAD	9	EA	0	EA				N/A	N/A	N/A	
1	2	Classroom 224	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	120	LF	5	LF				N/A	N/A	N/A	
1	2	Classroom 224	N/A	Plaster Ceiling		NAD	720	SF	0	SF				N/A	N/A	N/A	
1	2	Classroom 224	N/A	Plaster Walls		NAD	1300	SF	0	SF				N/A	N/A	N/A	
1	2	Classroom 224	N/A	Wood Floor		Non Suspect ACM	720	SF	0	SF				N/A	N/A	N/A	
1	2	Classroom 224	M	Blackboard Glue Dots	4020/01/02/AET/BB/2600	Assumed	260	SF	0	SF				1	No	1/D	
1	2	Classroom 225	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	111	LF	0	LF				N/A	N/A	N/A	
1	2	Classroom 225	N/A	Plaster Ceiling		NAD	730	SF	0	SF				N/A	N/A	N/A	
1	2	Classroom 225	N/A	Plaster Walls		NAD	1300	SF	0	SF				N/A	N/A	N/A	
1	2	Classroom 225	M	Floor Tile VAT 12" x 12"	4020/01/02/RR	Assumed	730	SF	0	SF	Brown			1	No	1/D	
1	2	Classroom 225	N/A	Wood Floor		Non Suspect ACM	730	SF	0	SF		3 inch built up wood floor		N/A	N/A	N/A	
1	2	Classroom 225	M	Blackboard Glue Dots	4020/01/02/AET/BB/2600	Assumed	180	SF	0	SF				1	No	1/D	
1	2	Women's Restroom Lounge Area	N/A	Fiberglass Ceiling Tile 2' x 4'		Non Suspect ACM	325	SF	0	SF				N/A	N/A	N/A	
1	2	Women's Restroom Lounge Area	N/A	Plaster Ceiling		NAD	325	SF	0	SF				N/A	N/A	N/A	
1	2	Women's Restroom Lounge Area	N/A	Plaster Walls		NAD	940	SF	0	SF				N/A	N/A	N/A	
1	2	Women's Restroom Lounge Area	N/A	Wood Floor		Non Suspect ACM	325	SF	0	SF				N/A	N/A	N/A	
1	2	Women's Restroom	N/A	Pipe Fitting Insulation		NAD	9	EA	0	EA				N/A	N/A	N/A	
1	2	Women's Restroom	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	57	LF	0	LF				N/A	N/A	N/A	
1	2	Women's Restroom	N/A	Plaster Ceiling		NAD	115	SF	2	SF				N/A	N/A	N/A	
1	2	Women's Restroom	N/A	Plaster Walls		NAD	555	SF	0	SF				N/A	N/A	N/A	
1	2	Women's Restroom	N/A	Marble Walls		Non Suspect ACM	135	SF	0	SF				N/A	N/A	N/A	
1	2	Women's Restroom	N/A	Cement Floor		Non Suspect ACM	115	SF	0	SF				N/A	N/A	N/A	
1	2	Closet between Classrooms 224 & 225	X	X		X	X	X	X	X	X	No Access - No Key		X	X	X	
1	2	Vestibule at Entrance to Classroom 225	N/A	Plaster Ceiling		NAD	50	SF	50	SF				N/A	N/A	N/A	
1	2	Vestibule at Entrance to Classroom 225	N/A	Plaster Walls		NAD	340	SF	25	SF				N/A	N/A	N/A	
1	2	Vestibule at Entrance to Classroom 225	N/A	Wood Floor		Non Suspect ACM	50	SF	1	SF				N/A	N/A	N/A	
1	2	Main Office	N/A	Ceiling Tile 2' x 4'		NAD	1145	SF	0	SF				N/A	N/A	N/A	
1	2	Main Office	N/A	Plaster Ceiling		NAD	1145	SF	0	SF				N/A	N/A	N/A	
1	2	Main Office	N/A	Plaster Walls		NAD	1685	SF	0	SF				N/A	N/A	N/A	
1	2	Main Office	N/A	Wood Paneling		Non Suspect ACM	315	SF	0	SF		Over plaster wall		N/A	N/A	N/A	
1	2	Main Office	M	Floor Tile VAT 12" x 12"	4020/01/02/RR	Assumed	1145	SF	0	SF	Tan			1	No	1/D	
1	2	Main Office	N/A	Wood Floor		Non Suspect ACM	1145	SF	0	SF				N/A	N/A	N/A	
1	2	Main Office Supply Room	N/A	Pipe Fitting Insulation		NAD	2	EA	0	EA				N/A	N/A	N/A	
1	2	Main Office Supply Room	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	20	LF	0	LF				N/A	N/A	N/A	
1	2	Main Office Supply Room	N/A	Plaster Ceiling		NAD	290	SF	2	SF				N/A	N/A	N/A	
1	2	Main Office Supply Room	N/A	Plaster Walls		NAD	820	SF	20	SF				N/A	N/A	N/A	
1	2	Main Office Supply Room	N/A	Wood Floor		Non Suspect ACM	290	SF	0	SF				N/A	N/A	N/A	
1	2	Principal's Conference Room	N/A	Ceiling Tile 2' x 4'		NAD	290	SF	0	SF				N/A	N/A	N/A	
1	2	Principal's Conference Room	N/A	Plaster Ceiling		NAD	290	SF	0	SF				N/A	N/A	N/A	
1	2	Principal's Conference Room	N/A	Plaster Walls		NAD	600	SF	0	SF				N/A	N/A	N/A	
1	2	Principal's Conference Room	N/A	Partition Room Dividers		Non Suspect ACM	220	SF	0	SF		Partition to Principal's Office open		N/A	N/A	N/A	
1	2	Principal's Conference Room	M	Floor Tile VAT 12" x 12"	4020/01/02/RR	Assumed	290	SF	0	SF	Tan			1	No	1/D	
1	2	Principal's Conference Room	N/A	Wood Floor		Non Suspect ACM	290	SF	0	SF				N/A	N/A	N/A	
1	2	Principal's Conference Room Closet	N/A	Ceiling Tile 2' x 4'		NAD	72	SF	0	SF				N/A	N/A	N/A	
1	2	Principal's Conference Room Closet	N/A	Plaster Ceiling		NAD	72	SF	0	SF				N/A	N/A	N/A	
1	2	Principal's Conference Room Closet	N/A	Plaster Walls		NAD	435	SF	0	SF				N/A	N/A	N/A	
1	2	Principal's Conference Room Closet	M	Floor Tile VAT 12" x 12"	4020/01/02/RR	Assumed	72	SF	0	SF	Tan			1	No	1/D	
1	2	Principal's Conference Room Closet	N/A	Wood Floor		Non Suspect ACM	72	SF	0	SF				N/A	N/A	N/A	
1	2	Principal's Conference Room Closet	T	Heat Shield Insulation	4020/01/02/AET/BB/1600	Assumed	1	SF	0	SF				1	No	1/D	
1	2	Principal's Conference Room Restroom	N/A	Ceiling Tile 2' x 4'		NAD	30	SF	0	SF				N/A	N/A	N/A	
1	2	Principal's Conference Room Restroom	N/A	Plaster Ceiling		NAD	30	SF	0	SF				N/A	N/A	N/A	
1	2	Principal's Conference Room Restroom	N/A	Plaster Walls		NAD	265	SF	0	SF				N/A	N/A	N/A	
1	2	Principal's Conference Room Restroom	M	Floor Tile VAT 12" x 12"	4020/01/02/RR	Assumed	30	SF	0	SF	Tan			1	No	1/D	
1	2	Principal's Conference Room Restroom	N/A	Wood Floor		Non Suspect ACM	30	SF	0	SF				N/A	N/A	N/A	
1	2	Principal's Office	N/A	Ceiling Tile 2' x 4'		NAD	315	SF	0	SF				N/A	N/A	N/A	
1	2	Principal's Office	N/A	Plaster Ceiling		NAD	315	SF	0	SF				N/A	N/A	N/A	
1	2	Principal's Office	N/A	Plaster Walls		NAD	600	SF	0	SF				N/A	N/A	N/A	
1	2	Principal's Office	M	Floor Tile VAT 12" x 12"	4020/01/02/RR	Assumed	315	SF	0	SF	Tan			1	No	1/D	
1	2	Principal's Office	N/A	Wood Floor		Non Suspect ACM	315	SF	0	SF				N/A	N/A	N/A	
1	2	Principal's Office	M	Blackboard Glue Dots	4020/01/02/AET/BB/2600	Assumed	80	SF	0	SF				1	No	1/D	
1	2	Office 203 Common Area	N/A	Ceiling Tile 2' x 4'		NAD	240	SF	0	SF				N/A	N/A	N/A	
1	2	Office 203 Common Area	N/A	Plaster Ceiling		NAD	240	SF	0	SF				N/A	N/A	N/A	
1	2	Office 203 Common Area	N/A	Plaster Walls		NAD	745	SF	0	SF				N/A	N/A	N/A	

4020 Overbrook HS 2015-2016 AHERA Three Year Report

School District of Philadelphia Overbrook High School 5898 Lancaster Avenue, Philadelphia, PA 19131 ULCS# 4020 Year Built: 1926		AHERA Three-Year Reinspection 2015-2016 Room by Room Location Log Report										Reinspection Date: 10/21/2015 Building Inspector: Bernard Brunner Certificate Number: 45397 Management Planner: M. Causley Certificate Number: ACC-0215-8-010				
E l e m e n t	F l o o r	On Site Room Name	System Affected	Material Description	HID#	Confirmed Assumed NAD Non Suspect ACM	Amount of Material	SF LF EA	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic / Crawl Space Ranking	Damage Potential (DP)	Newly Friable (NF)	Response Action (RA)
1	2	Office 203 Common Area	M	Floor Tile VAT 9" x 9"	4020/01/02/33	Confirmed	240	SF	0	SF	Tan			1	No	1/D
1	2	Office 203 Common Area	N/A	Wood Floor		Non Suspect ACM	240	SF	0	SF				N/A	N/A	N/A
1	2	Storage Room 203A	N/A	Ceiling Tile 2' x 4'		NAD	140	SF	0	SF				N/A	N/A	N/A
1	2	Storage Room 203A	N/A	Plaster Ceiling		NAD	140	SF	0	SF				N/A	N/A	N/A
1	2	Storage Room 203A	N/A	Plaster Walls		NAD	580	SF	0	SF				N/A	N/A	N/A
1	2	Storage Room 203A	M	Floor Tile VAT 9" x 9"	4020/01/02/33	Confirmed	140	SF	0	SF	Tan			1	No	1/D
1	2	Storage Room 203A	N/A	Wood Floor		Non Suspect ACM	140	SF	0	SF				N/A	N/A	N/A
1	2	Office in Storage Room 203A	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	10	LF	0	LF				N/A	N/A	N/A
1	2	Office in Storage Room 203A	N/A	Ceiling Tile 2' x 4'		NAD	100	SF	0	SF				N/A	N/A	N/A
1	2	Office in Storage Room 203A	N/A	Plaster Ceiling		NAD	100	SF	0	SF				N/A	N/A	N/A
1	2	Office in Storage Room 203A	N/A	Plaster Walls		NAD	480	SF	0	SF				N/A	N/A	N/A
1	2	Office in Storage Room 203A	M	Floor Tile VAT 9" x 9"	4020/01/02/33	Confirmed	100	SF	1	SF	Tan			1	No	6/C
1	2	Office in Storage Room 203A	N/A	Wood Floor		Non Suspect ACM	100	SF	0	SF				N/A	N/A	N/A
1	2	Office 203B	N/A	Ceiling Tile 2' x 4'		NAD	80	SF	0	SF				N/A	N/A	N/A
1	2	Office 203B	N/A	Plaster Ceiling		NAD	80	SF	0	SF				N/A	N/A	N/A
1	2	Office 203B	N/A	Plaster Walls		NAD	435	SF	10	SF				N/A	N/A	N/A
1	2	Office 203B	M	Floor Tile VAT 9" x 9"	4020/01/02/33	Confirmed	80	SF	0	SF	Tan			1	No	1/D
1	2	Office 203B	N/A	Wood Floor		Non Suspect ACM	80	SF	0	SF				N/A	N/A	N/A
1	2	Office 203C	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	3	LF	0	LF				N/A	N/A	N/A
1	2	Office 203C	N/A	Fiberglass Ceiling Tile 2' x 4'		Non Suspect ACM	80	SF	0	SF				N/A	N/A	N/A
1	2	Office 203C	N/A	Plaster Ceiling		NAD	80	SF	0	SF				N/A	N/A	N/A
1	2	Office 203C	N/A	Plaster Walls		NAD	435	SF	0	SF				N/A	N/A	N/A
1	2	Office 203C	M	Floor Tile VAT 9" x 9"	4020/01/02/33	Confirmed	80	SF	1	SF	Tan	Office door scrapes tile floor		1	No	6/C
1	2	Office 203C	N/A	Wood Floor		Non Suspect ACM	80	SF	0	SF				N/A	N/A	N/A
1	2	Office 203D	N/A	Fiberglass Ceiling Tile 2' x 4'		Non Suspect ACM	115	SF	0	SF				N/A	N/A	N/A
1	2	Office 203D	N/A	Plaster Ceiling		NAD	115	SF	0	SF				N/A	N/A	N/A
1	2	Office 203D	N/A	Plaster Walls		NAD	505	SF	5	SF				N/A	N/A	N/A
1	2	Office 203D	M	Floor Tile VAT 9" x 9"	4020/01/02/33	Confirmed	115	SF	8	SF	Tan			1	No	6/C
1	2	Office 203D	N/A	Wood Floor		Non Suspect ACM	115	SF	0	SF				N/A	N/A	N/A
1	2	Storage Room 203E	N/A	Fiberglass Ceiling Tile 2' x 4'		Non Suspect ACM	80	SF	0	SF				N/A	N/A	N/A
1	2	Storage Room 203E	N/A	Plaster Ceiling		NAD	80	SF	0	SF				N/A	N/A	N/A
1	2	Storage Room 203E	N/A	Plaster Walls		NAD	435	SF	0	SF				N/A	N/A	N/A
1	2	Storage Room 203E	M	Floor Tile VAT 9" x 9"	4020/01/02/33	Confirmed	80	SF	4	SF	Tan			1	No	6/C
1	2	Storage Room 203E	N/A	Wood Floor		Non Suspect ACM	80	SF	0	SF				N/A	N/A	N/A
1	2	Office 203F Picture ID Room	N/A	Fiberglass Ceiling Tile 2' x 4'		Non Suspect ACM	80	SF	0	SF				N/A	N/A	N/A
1	2	Office 203F Picture ID Room	N/A	Plaster Ceiling		NAD	80	SF	0	SF				N/A	N/A	N/A
1	2	Office 203F Picture ID Room	N/A	Plaster Walls		NAD	435	SF	0	SF				N/A	N/A	N/A
1	2	Office 203F Picture ID Room	M	Floor Tile VAT 9" x 9"	4020/01/02/33	Confirmed	80	SF	1	SF	Tan			1	No	6/C
1	2	Office 203F Picture ID Room	N/A	Wood Floor		Non Suspect ACM	80	SF	0	SF				N/A	N/A	N/A
1	2	Office 204, Common Area	N/A	Ceiling Tile 2' x 4'		NAD	420	SF	0	SF				N/A	N/A	N/A
1	2	Office 204, Common Area	N/A	Plaster Ceiling		NAD	420	SF	0	SF				N/A	N/A	N/A
1	2	Office 204, Common Area	N/A	Plaster Walls		NAD	1010	SF	0	SF				N/A	N/A	N/A
1	2	Office 204, Common Area	M	Floor Tile VAT 9" x 9"	4020/01/02/33	Confirmed	407	SF	0	SF	Tan			1	No	1/D
1	2	Office 204, Common Area	M	Floor Tile VAT 12" x 12"	4020/01/02/RR	Assumed	13	SF	0	SF	Tan			1	No	1/D
1	2	Office 204, Common Area	N/A	Wood Floor		Non Suspect ACM	420	SF	0	SF				N/A	N/A	N/A
1	2	Office 204, Common Area	M	Wall Glue Dots	4020/01/02/AET/BB/2610	Assumed	5	SF	0	SF				1	No	1/D
1	2	Office 204, 1st Office from Left	N/A	Ceiling Tile 2' x 4'		NAD	100	SF	0	SF				N/A	N/A	N/A
1	2	Office 204, 1st Office from Left	N/A	Plaster Ceiling		NAD	100	SF	0	SF				N/A	N/A	N/A
1	2	Office 204, 1st Office from Left	N/A	Plaster Walls		NAD	480	SF	0	SF				N/A	N/A	N/A
1	2	Office 204, 1st Office from Left	M	Floor Tile VAT 9" x 9"	4020/01/02/33	Confirmed	100	SF	0	SF	Tan			1	No	1/D
1	2	Office 204, 1st Office from Left	N/A	Wood Floor		Non Suspect ACM	100	SF	0	SF				N/A	N/A	N/A
1	2	Office 204, 2nd Office from Left	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	6	LF	0	LF				N/A	N/A	N/A
1	2	Office 204, 2nd Office from Left	N/A	Ceiling Tile 2' x 4'		NAD	115	SF	0	SF				N/A	N/A	N/A
1	2	Office 204, 2nd Office from Left	N/A	Plaster Ceiling		NAD	115	SF	0	SF				N/A	N/A	N/A
1	2	Office 204, 2nd Office from Left	N/A	Plaster Walls		NAD	530	SF	10	SF				N/A	N/A	N/A
1	2	Office 204, 2nd Office from Left	M	Floor Tile VAT 9" x 9"	4020/01/02/33	Confirmed	115	SF	1	SF	Tan			1	No	6/C
1	2	Office 204, 2nd Office from Left	N/A	Wood Floor		Non Suspect ACM	115	SF	0	SF				N/A	N/A	N/A
1	2	Office 204, 3rd Office from Left	T	Pipe Insulation 2-6 inch	4020/01/02/34	Confirmed	5	LF	0	LF				1	No	1/D
1	2	Office 204, 3rd Office from Left	N/A	Ceiling Tile 2' x 4'		NAD	100	SF	0	SF				N/A	N/A	N/A
1	2	Office 204, 3rd Office from Left	N/A	Plaster Ceiling		NAD	100	SF	0	SF				N/A	N/A	N/A
1	2	Office 204, 3rd Office from Left	N/A	Plaster Walls		NAD	480	SF	0	SF				N/A	N/A	N/A
1	2	Office 204, 3rd Office from Left	M	Floor Tile VAT 9" x 9"	4020/01/02/33	Confirmed	100	SF	0	SF	Tan			1	No	1/D
1	2	Office 204, 3rd Office from Left	N/A	Wood Floor		Non Suspect ACM	100	SF	0	SF				N/A	N/A	N/A
1	2	Office 204, 4th Office from Left	T	Pipe Insulation 2-6 inch	4020/01/02/34	Confirmed	5	LF	0	LF				1	No	1/D
1	2	Office 204, 4th Office from Left	N/A	Ceiling Tile 2' x 4'		NAD	100	SF	4	SF				N/A	N/A	N/A
1	2	Office 204, 4th Office from Left	N/A	Plaster Ceiling		NAD	100	SF	0	SF				N/A	N/A	N/A
1	2	Office 204, 4th Office from Left	N/A	Plaster Walls		NAD	480	SF	0	SF				N/A	N/A	N/A
1	2	Office 204, 4th Office from Left	M	Floor Tile VAT 9" x 9"	4020/01/02/33	Confirmed	100	SF	0	SF	Tan			1	No	1/D
1	2	Office 204, 4th Office from Left	N/A	Wood Floor		Non Suspect ACM	100	SF	0	SF				N/A	N/A	N/A
1	2	Office 204, Storage Room, 5th Room from Left	T	Pipe Insulation 2-6 inch	4020/01/02/34	Confirmed	6	LF	0	LF				1	No	1/D
1	2	Office 204, Storage Room, 5th Room from Left	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	12	LF	0	LF				N/A	N/A	N/A
1	2	Office 204, Storage Room, 5th Room from Left	N/A	Ceiling Tile 2' x 4'		NAD	100	SF	0	SF				N/A	N/A	N/A
1	2	Office 204, Storage Room, 5th Room from Left	N/A	Plaster Ceiling		NAD	100	SF	0	SF				N/A	N/A	N/A
1	2	Office 204, Storage Room, 5th Room from Left	N/A	Plaster Walls		NAD	480	SF	0	SF				N/A	N/A	N/A
1	2	Office 204, Storage Room, 5th Room from Left	M	Floor Tile VAT 9" x 9"	4020/01/02/33	Confirmed	100	SF	2	SF	Tan			1	No	6/C
1	2	Office 204, Storage Room, 5th Room from Left	N/A	Wood Floor		Non Suspect ACM	100	SF	0	SF				N/A	N/A	N/A
1	2	Hallway outside Classroom 225-Principal's Office	T	Pipe Insulation 2-6 inch	4020/01/02/34	Confirmed	18	LF	0	LF				1	No	1/D

4020 Overbrook HS 2015-2016 AHERA Three Year Report

School District of Philadelphia			AHERA Three-Year Reinspection 2015-2016 Room by Room Location Log Report										Reinspection Date: 10/21/2015 Building Inspector: Bernard Brunner Certificate Number: 45397 Management Planner: M. Causley Certificate Number: ACC-0215-8-010						
Overbrook High School 5898 Lancaster Avenue, Philadelphia, PA 19131 ULCS# 4020 Year Built: 1926																			
Element	Floor	On Site Room Name	System Affected	Material Description	HID#	Confirmed Assumed NAD Non Suspect ACM	Amount of Material	SF LF EA	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic / Crawl Space Ranking	Damage Potential (DP)	Newly Friable (NF)	Response Action (RA)			
1	2	Hallway outside Classroom 225-Principal's Office	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	40	LF	0	LF				N/A	N/A	N/A			
1	2	Hallway outside Classroom 225-Principal's Office	N/A	Plaster Ceiling		NAD	960	SF	12	SF				N/A	N/A	N/A			
1	2	Hallway outside Classroom 225-Principal's Office	N/A	Plaster Walls		NAD	2065	SF	0	SF				N/A	N/A	N/A			
1	2	Hallway outside Classroom 225-Principal's Office	N/A	Marble Walls		Non Suspect ACM	860	SF	0	SF				N/A	N/A	N/A			
1	2	Hallway outside Classroom 225-Principal's Office	N/A	Cement Floor		Non Suspect ACM	960	SF	0	SF				N/A	N/A	N/A			
1	2	Marble Hallway	N/A	Plaster Walls		NAD	1600	SF	0	SF				N/A	N/A	N/A			
1	2	Marble Hallway	N/A	Marble Walls		Non Suspect ACM	730	SF	0	SF				N/A	N/A	N/A			
1	2	Marble Hallway	N/A	Marble Floor		Non Suspect ACM	1025	SF	0	SF				N/A	N/A	N/A			
1	2	Marble Hallway	M	Troweled on Ceiling	4020/01/02/A3	Assumed	1025	SF	0	SF				1	No	1/D			
1	2	Stairwell adjacent Principal's Office down to Main Entrance	N/A	Plaster Walls		NAD	1100	SF	0	SF				N/A	N/A	N/A			
1	2	Stairwell adjacent Principal's Office down to Main Entrance	N/A	Marble Walls		Non Suspect ACM	450	SF	0	SF				N/A	N/A	N/A			
1	2	Stairwell adjacent Principal's Office down to Main Entrance	N/A	Marble Floor		Non Suspect ACM	480	SF	0	SF				N/A	N/A	N/A			
1	2	Stairwell adjacent Principal's Office down to Main Entrance	M	Troweled on Ceiling	4020/01/02/A3	Assumed	480	SF	0	SF				1	No	1/D			
1	2	Stairwell adjacent Principal's Office down to Main Entrance	T	Radiator Insulation	4020/01/02/AET/BB/1600	Assumed	50	SF	0	SF		Recessed in Wall at Bottom of Stairs		1	No	1/D			
1	2	Entrance	N/A	Plaster Walls		NAD	1100	SF	0	SF				N/A	N/A	N/A			
1	2	Stairwell adjacent Assistant Principal's Office down to Main Entrance	N/A	Marble Walls		Non Suspect ACM	450	SF	0	SF				N/A	N/A	N/A			
1	2	Stairwell adjacent Assistant Principal's Office down to Main Entrance	N/A	Marble Floor		Non Suspect ACM	480	SF	0	SF				N/A	N/A	N/A			
1	2	Stairwell adjacent Assistant Principal's Office down to Main Entrance	M	Troweled on Ceiling	4020/01/02/A3	Assumed	480	SF	0	SF				1	No	1/D			
1	2	Stairwell adjacent Assistant Principal's Office down to Main Entrance	T	Radiator Insulation	4020/01/02/AET/BB/1600	Assumed	50	SF	0	SF		Recessed in Wall at Bottom of Stairs		1	No	1/D			
1	2	Hallway outside Offices 201-203	T	Pipe Insulation 2-6 inch	4020/01/02/34	Confirmed	6	LF	0	LF				1	No	1/D			
1	2	Hallway outside Offices 201-203	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	50	LF	0	LF				N/A	N/A	N/A			
1	2	Hallway outside Offices 201-203	N/A	Plaster Ceiling		NAD	960	SF	5	SF				N/A	N/A	N/A			
1	2	Hallway outside Offices 201-203	N/A	Plaster Walls		NAD	2065	SF	0	SF				N/A	N/A	N/A			
1	2	Hallway outside Offices 201-203	N/A	Marble Walls		Non Suspect ACM	860	SF	0	SF				N/A	N/A	N/A			
1	2	Hallway outside Offices 201-203	N/A	Cement Floor		Non Suspect ACM	960	SF	0	SF				N/A	N/A	N/A			
1	2	Stairwell B	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	18	LF	0	LF				N/A	N/A	N/A			
1	2	Stairwell B	N/A	Plaster Ceiling		NAD	375	SF	0	SF				N/A	N/A	N/A			
1	2	Stairwell B	N/A	Plaster Walls		NAD	900	SF	0	SF				N/A	N/A	N/A			
1	2	Stairwell B	N/A	Brick Wall		Non Suspect ACM	250	SF	0	SF				N/A	N/A	N/A			
1	2	Stairwell B	N/A	Cement Floor		Non Suspect ACM	375	SF	0	SF				N/A	N/A	N/A			
1	2	Hallway outside Office 204-Classroom 212	N/A	Plaster Ceiling		NAD	1800	SF	100	SF				N/A	N/A	N/A			
1	2	Hallway outside Office 204-Classroom 212	N/A	Plaster Walls		NAD	3600	SF	0	SF				N/A	N/A	N/A			
1	2	Hallway outside Office 204-Classroom 212	N/A	Marble Walls		Non Suspect ACM	1500	SF	0	SF				N/A	N/A	N/A			
1	2	Hallway outside Office 204-Classroom 212	N/A	Cement Floor		Non Suspect ACM	1800	SF	0	SF				N/A	N/A	N/A			
1	2	Stairwell C	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	20	LF	0	LF				N/A	N/A	N/A			
1	2	Stairwell C	N/A	Plaster Ceiling		NAD	375	SF	0	SF				N/A	N/A	N/A			
1	2	Stairwell C	N/A	Plaster Walls		NAD	900	SF	10	SF				N/A	N/A	N/A			
1	2	Stairwell C	N/A	Brick Wall		Non Suspect ACM	250	SF	0	SF				N/A	N/A	N/A			
1	2	Stairwell C	N/A	Cement Floor		Non Suspect ACM	375	SF	0	SF				N/A	N/A	N/A			
1	2	Fire Tower adjacent Classroom 213	N/A	Plaster Ceiling		NAD	375	SF	375	SF				N/A	N/A	N/A			
1	2	Fire Tower adjacent Classroom 213	N/A	Brick Wall		Non Suspect ACM	1150	SF	0	SF				N/A	N/A	N/A			
1	2	Fire Tower adjacent Classroom 213	N/A	Cement Floor		Non Suspect ACM	375	SF	0	SF				N/A	N/A	N/A			
1	2	Hallway outside Classroom 213-IMC	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	145	LF	0	LF				N/A	N/A	N/A			
1	2	Hallway outside Classroom 213-IMC	N/A	Plaster Ceiling		NAD	1560	SF	0	SF				N/A	N/A	N/A			
1	2	Hallway outside Classroom 213-IMC	N/A	Plaster Walls		NAD	2600	SF	0	SF				N/A	N/A	N/A			
1	2	Hallway outside Classroom 213-IMC	N/A	Marble Walls		Non Suspect ACM	1300	SF	0	SF				N/A	N/A	N/A			
1	2	Hallway outside Classroom 213-IMC	N/A	Cement Floor		Non Suspect ACM	1560	SF	0	SF				N/A	N/A	N/A			
1	2	Stairwell across from Classroom 214	N/A	Plaster Ceiling		NAD	300	SF	0	SF		Stairwell walled off - Access from 2nd and 4th Floors only		N/A	N/A	N/A			
1	2	Stairwell across from Classroom 214	N/A	Plaster Walls		NAD	960	SF	0	SF		Stairwell walled off - Access from 2nd and 4th Floors only		N/A	N/A	N/A			
1	2	Stairwell across from Classroom 214	N/A	Cement Floor		Non Suspect ACM	300	SF	0	SF		Stairwell walled off - Access from 2nd and 4th Floors only		N/A	N/A	N/A			
1	2	Stairwell across from Classroom 214 Closet	N/A	Plaster Ceiling		NAD	40	SF	0	SF				N/A	N/A	N/A			
1	2	Stairwell across from Classroom 214 Closet	N/A	Plaster Walls		NAD	200	SF	0	SF				N/A	N/A	N/A			
1	2	Stairwell across from Classroom 214 Closet	N/A	Cement Floor		Non Suspect ACM	40	SF	0	SF				N/A	N/A	N/A			
1	2	Stairwell across from Classroom 214 Storage Room	X	X		X	X	X	X	X	X	No Access - No Key		X	X	X			
1	2	Hallway outside IMC-Fire Tower	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	80	LF	0	LF				N/A	N/A	N/A			
1	2	Hallway outside IMC-Fire Tower	N/A	Plaster Ceiling		NAD	1560	SF	0	SF				N/A	N/A	N/A			
1	2	Hallway outside IMC-Fire Tower	N/A	Plaster Walls		NAD	2600	SF	0	SF				N/A	N/A	N/A			
1	2	Hallway outside IMC-Fire Tower	N/A	Marble Walls		Non Suspect ACM	1300	SF	0	SF				N/A	N/A	N/A			
1	2	Hallway outside IMC-Fire Tower	N/A	Cement Floor		Non Suspect ACM	1560	SF	0	SF				N/A	N/A	N/A			
1	2	Stairwell across from IMC	N/A	Plaster Ceiling		NAD	300	SF	0	SF		Stairwell walled off - Access from 2nd and 4th Floors only		N/A	N/A	N/A			
1	2	Stairwell across from IMC	N/A	Plaster Walls		NAD	960	SF	0	SF		Stairwell walled off - Access from 2nd and 4th Floors only		N/A	N/A	N/A			
1	2	Stairwell across from IMC	N/A	Cement Floor		Non Suspect ACM	300	SF	0	SF		Stairwell walled off - Access from 2nd and 4th Floors only		N/A	N/A	N/A			
1	2	Stairwell across from IMC Closet	X	X		X	X	X	X	X	X	No Access - Door Blocked by Stored Materials		X	X	X			
1	2	Stairwell across from IMC Storage Room	X	X		X	X	X	X	X	X	No Access - Door Blocked by Stored Materials		X	X	X			
1	2	Fire Tower adjacent Classroom 216	N/A	Plaster Ceiling		NAD	375	SF	375	SF				N/A	N/A	N/A			
1	2	Fire Tower adjacent Classroom 216	N/A	Brick Wall		Non Suspect ACM	1150	SF	0	SF				N/A	N/A	N/A			
1	2	Fire Tower adjacent Classroom 216	N/A	Cement Floor		Non Suspect ACM	375	SF	0	SF				N/A	N/A	N/A			
1	2	Stairwell D	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	14	LF	0	LF				N/A	N/A	N/A			
1	2	Stairwell D	N/A	Plaster Ceiling		NAD	375	SF	10	SF				N/A	N/A	N/A			
1	2	Stairwell D	N/A	Plaster Walls		NAD	900	SF	50	SF				N/A	N/A	N/A			
1	2	Stairwell D	N/A	Brick Wall		Non Suspect ACM	250	SF	0	SF				N/A	N/A	N/A			
1	2	Stairwell D	N/A	Cement Floor		Non Suspect ACM	375	SF	0	SF				N/A	N/A	N/A			
1	2	Hallway outside Classrooms 216-224	N/A	Plaster Ceiling		NAD	1800	SF	0	SF				N/A	N/A	N/A			

4020 Overbrook HS 2015-2016 AHERA Three Year Report

School District of Philadelphia				AHERA Three-Year Reinspection 2015-2016										Reinspection Date: 10/21/2015								
Overbrook High School				Room by Room Location Log Report										Building Inspector: Bernard Brunner								
5898 Lancaster Avenue, Philadelphia, PA 19131														Certificate Number: 45397								
ULCS# 4020														Management Planner: M. Causley								
Year Built: 1926														Certificate Number: ACC-0215-8-010								
Element	Room	On Site Room Name	System Affected	Material Description	HID#	Confirmed	Assumed	NAD	Amount of Material	SF	LF	EA	Amount of Damage	SF	LF	EA	Color required for VAT	Comments/Description/Notes	Attic / Crawl Space Ranking	Damage Potential (DP)	Newly Friable (NF)	Response Action (RA)
1	2	Hallway outside Classrooms 216-224	N/A	Plaster Walls		NAD			3600	SF			0	SF						N/A	N/A	N/A
1	2	Hallway outside Classrooms 216-224	N/A	Marble Walls		Non Suspect ACM			1500	SF			0	SF						N/A	N/A	N/A
1	2	Hallway outside Classrooms 216-224	N/A	Cement Floor		Non Suspect ACM			1800	SF			0	SF						N/A	N/A	N/A
1	2	Stairwell A	N/A	Fiberglass Pipe Insulation		Non Suspect ACM			24	LF			0	LF						N/A	N/A	N/A
1	2	Stairwell A	N/A	Plaster Ceiling		NAD			375	SF			10	SF						N/A	N/A	N/A
1	2	Stairwell A	N/A	Plaster Walls		NAD			900	SF			0	SF						N/A	N/A	N/A
1	2	Stairwell A	N/A	Brick Wall		Non Suspect ACM			250	SF			0	SF						N/A	N/A	N/A
1	2	Stairwell A	N/A	Cement Floor		Non Suspect ACM			375	SF			0	SF						N/A	N/A	N/A
1	2	Office 221 Rear Office	N/A	Fiberglass Ceiling Tile 2' x 4'		Non Suspect ACM			120	SF			0	SF						N/A	N/A	N/A
1	2	Office 221 Rear Office	N/A	Plaster Ceiling		NAD			120	SF			0	SF						N/A	N/A	N/A
1	2	Office 221 Rear Office	N/A	Plaster Walls		NAD			530	SF			0	SF						N/A	N/A	N/A
1	2	Office 221 Rear Office	N/A	Wood Floor		Non Suspect ACM			120	SF			0	SF						N/A	N/A	N/A
1	2	Office 201 Common Area	N/A	Ceiling Tile 2' x 4'		NAD			154	SF			0	SF						N/A	N/A	N/A
1	2	Office 201 Common Area	N/A	Fiberglass Ceiling Tile 2' x 4'		Non Suspect ACM			16	SF			0	SF						N/A	N/A	N/A
1	2	Office 201 Common Area	N/A	Plaster Ceiling		NAD			170	SF			0	SF						N/A	N/A	N/A
1	2	Office 201 Common Area	N/A	Plaster Walls		NAD			570	SF			0	SF						N/A	N/A	N/A
1	2	Office 201 Common Area	N/A	Sheetrock Wall		NAD			220	SF			0	SF						N/A	N/A	N/A
1	2	Office 201 Common Area	M	Floor Tile VAT 9" x 9"	4020/01/02/33	Confirmed			170	SF			4	SF			Tan			1	No	6/C
1	2	Office 201 Common Area	N/A	Wood Floor		Non Suspect ACM			170	SF			0	SF						N/A	N/A	N/A
1	2	Office 201A	N/A	Ceiling Tile 2' x 4'		NAD			70	SF			0	SF				The space name of "A" is written on wall in pencil		N/A	N/A	N/A
1	2	Office 201A	N/A	Plaster Ceiling		NAD			70	SF			0	SF				The space name of "A" is written on wall in pencil		N/A	N/A	N/A
1	2	Office 201A	N/A	Plaster Walls		NAD			445	SF			0	SF				The space name of "A" is written on wall in pencil		N/A	N/A	N/A
1	2	Office 201A	M	Floor Tile VAT 9" x 9"	4020/01/02/33	Confirmed			70	SF			0	SF			Tan	The space name of "A" is written on wall in pencil		1	No	1/D
1	2	Office 201A	N/A	Wood Floor		Non Suspect ACM			70	SF			0	SF				The space name of "A" is written on wall in pencil		N/A	N/A	N/A
1	2	Assistant Principal's Office	N/A	Fiberglass Ceiling Tile 2' x 4'		Non Suspect ACM			180	SF			0	SF				The space name of "B" is written on wall in pencil in the common area of Office 201, however the entrance actually used for this space is in the main hallway		N/A	N/A	N/A
1	2	Assistant Principal's Office	N/A	Plaster Ceiling		NAD			180	SF			1	SF				The space name of "B" is written on wall in pencil in the common area of Office 201, however the entrance actually used for this space is in the main hallway		N/A	N/A	N/A
1	2	Assistant Principal's Office	N/A	Plaster Walls		NAD			1130	SF			0	SF				The space name of "B" is written on wall in pencil in the common area of Office 201, however the entrance actually used for this space is in the main hallway		N/A	N/A	N/A
1	2	Assistant Principal's Office	M	Floor Tile VAT 9" x 9"	4020/01/02/33	Confirmed			180	SF			2	SF			Tan	The space name of "B" is written on wall in pencil in the common area of Office 201, however the entrance actually used for this space is in the main hallway		1	No	6/C
1	2	Assistant Principal's Office	N/A	Wood Floor		Non Suspect ACM			180	SF			0	SF				The space name of "B" is written on wall in pencil in the common area of Office 201, however the entrance actually used for this space is in the main hallway		N/A	N/A	N/A
1	2	Office 201C Counselor's Office	T	Pipe Insulation 2-6 inch	4020/01/02/34	Confirmed			25	LF			0	LF				The space name of "C" is written on wall in pencil. More likely above ceiling tile		1	No	1/D
1	2	Office 201C Counselor's Office	N/A	Ceiling Tile 2' x 4'		NAD			200	SF			0	SF				The space name of "C" is written on wall in pencil		N/A	N/A	N/A
1	2	Office 201C Counselor's Office	N/A	Plaster Ceiling		NAD			200	SF			8	SF				The space name of "C" is written on wall in pencil		N/A	N/A	N/A
1	2	Office 201C Counselor's Office	N/A	Plaster Walls		NAD			540	SF			2	SF				The space name of "C" is written on wall in pencil		N/A	N/A	N/A
1	2	Office 201C Counselor's Office	M	Floor Tile VAT 9" x 9"	4020/01/02/33	Confirmed			185	SF			0	SF			Tan	The space name of "C" is written on wall in pencil		1	No	1/D
1	2	Office 201C Counselor's Office	M	Floor Tile VAT 12" x 12"	4020/01/02/RR	Assumed			15	SF			0	SF			White	The space name of "C" is written on wall in pencil		1	No	1/D
1	2	Office 201C Counselor's Office	N/A	Wood Floor		Non Suspect ACM			200	SF			0	SF				The space name of "C" is written on wall in pencil		N/A	N/A	N/A
1	2	Office 201D	N/A	Ceiling Tile 2' x 4'		NAD			80	SF			0	SF				The space name of "D" is written on wall in pencil		N/A	N/A	N/A
1	2	Office 201D	N/A	Plaster Ceiling		NAD			80	SF			0	SF				The space name of "D" is written on wall in pencil		N/A	N/A	N/A
1	2	Office 201D	N/A	Plaster Walls		NAD			290	SF			0	SF				The space name of "D" is written on wall in pencil		N/A	N/A	N/A
1	2	Office 201D	M	Floor Tile VAT 9" x 9"	4020/01/02/33	Confirmed			80	SF			0	SF			Tan	The space name of "D" is written on wall in pencil		1	No	1/D
1	2	Office 201D	N/A	Wood Floor		Non Suspect ACM			80	SF			0	SF				The space name of "D" is written on wall in pencil		N/A	N/A	N/A
1	2	Storage Room 201E	N/A	Pipe Fitting Insulation		NAD			1	EA			0	EA				The space name of "E" is written on wall in pencil		N/A	N/A	N/A
1	2	Storage Room 201E	T	Pipe Insulation 2-6 inch	4020/01/02/34	Confirmed			15	LF			0	LF				The space name of "E" is written on wall in pencil		1	No	1/D
1	2	Storage Room 201E	N/A	Ceiling Tile 2' x 4'		NAD			60	SF			0	SF				The space name of "E" is written on wall in pencil		N/A	N/A	N/A
1	2	Storage Room 201E	N/A	Plaster Ceiling		NAD			60	SF			6	SF				The space name of "E" is written on wall in pencil		N/A	N/A	N/A
1	2	Storage Room 201E	N/A	Plaster Walls		NAD			285	SF			0	SF				The space name of "E" is written on wall in pencil		N/A	N/A	N/A
1	2	Storage Room 201E	M	Floor Tile VAT 9" x 9"	4020/01/02/33	Confirmed			60	SF			0	SF			Tan	The space name of "E" is written on wall in pencil		1	No	1/D
1	2	Storage Room 201E	N/A	Wood Floor		Non Suspect ACM			60	SF			0	SF				The space name of "E" is written on wall in pencil		N/A	N/A	N/A
1	2	Office 201 Data Center	N/A	Ceiling Tile 2' x 4'		NAD			45	SF			0	SF						N/A	N/A	N/A
1	2	Office 201 Data Center	N/A	Plaster Ceiling		NAD			45	SF			0	SF						N/A	N/A	N/A
1	2	Office 201 Data Center	N/A	Plaster Walls		NAD			170	SF			0	SF						N/A	N/A	N/A
1	2	Office 201 Data Center	N/A	Sheetrock Wall		NAD			150	SF			0	SF						N/A	N/A	N/A
1	2	Office 201 Data Center	M	Floor Tile VAT 9" x 9"	4020/01/02/33	Confirmed			5	SF			0	SF			Tan			1	No	1/D
1	2	Office 201 Data Center	N/A	Wood Floor		Non Suspect ACM			45	SF			0	SF				40 SF Black mastic exposed on wood floor		N/A	N/A	N/A
1	2	Closet adjacent Entrance to Office 201	N/A	Plaster Ceiling		NAD			12	SF			0	SF						N/A	N/A	N/A
1	2	Closet adjacent Entrance to Office 201	N/A	Plaster Walls		NAD			48	SF			0	SF						N/A	N/A	N/A
1	2	Closet adjacent Entrance to Office 201	N/A	Sheetrock Wall		NAD			72	SF			0	SF						N/A	N/A	N/A
1	2	Closet adjacent Entrance to Office 201	N/A	Wood Floor		Non Suspect ACM			12	SF			0	SF						N/A	N/A	N/A
1	2	Closet adjacent Entrance to Office 201	M	Linoleum	4020/01/02/AET/BB/2200	Assumed			12	SF			0	SF						1	No	1/D
1	2	Pipe Shaft outside Office 201	T	Pipe Insulation 2-6 inch	4020/01/02/34	Confirmed			12	LF			0	LF						1	No	1/D
1	2	Office 202 Roster Office	T	Pipe Insulation 2-6 inch	4020/01/02/34	Confirmed			10	LF			0	LF						1	No	1/D
1	2	Office 202 Roster Office	N/A	Ceiling Tile 2' x 4'		NAD			480	SF			0	SF						N/A	N/A	N/A
1	2	Office 202 Roster Office	N/A	Plaster Ceiling		NAD			480	SF			0	SF						N/A	N/A	N/A
1	2	Office 202 Roster Office	N/A	Plaster Walls		NAD			1060	SF			0	SF						N/A	N/A	N/A
1	2	Office 202 Roster Office	M	Floor Tile VAT 9" x 9"	4020/01/02/33	Confirmed			480	SF			2	SF			Tan			1	No	6/C
1	2	Office 202 Roster Office	N/A	Wood Floor		Non Suspect ACM			480	SF			0	SF						N/A	N/A	N/A
1	2	IMC Gated Room	T	Pipe Insulation 2-6 inch	4020/01/02/34	Confirmed			6	LF			0	LF				No Access - Padlock on gate. Inspection from windows only		1	No	1/D
1	2	IMC Gated Room	N/A	Ceiling Tile 2' x 4'		NAD			700	SF			12	SF				No Access - Padlock on gate. Inspection from windows only		N/A	N/A	N/A

4020 Overbrook HS 2015-2016 AHERA Three Year Report

School District of Philadelphia Overbrook High School 5898 Lancaster Avenue, Philadelphia, PA 19131 ULCS# 4020 Year Built: 1926			AHERA Three-Year Reinspection 2015-2016 Room by Room Location Log Report										Reinspection Date: 10/21/2015 Building Inspector: Bernard Brunner Certificate Number: 45397 Management Planner: M. Causley Certificate Number: ACC-0215-8-010			
Element	Floor	On Site Room Name	System Affected	Material Description	HID#	Confirmed Assumed NAD Non Suspect ACM	Amount of Material	SF LF EA	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic / Crawl Space Ranking	Damage Potential (DP)	Newly Friable (NF)	Response Action (RA)
1	2	IMC Gated Room	N/A	Plaster Ceiling		NAD	700	SF	0	SF		No Access - Padlock on gate. Inspection from windows only		N/A	N/A	N/A
1	2	IMC Gated Room	N/A	Plaster Walls		NAD	1275	SF	0	SF		No Access - Padlock on gate. Inspection from windows only		N/A	N/A	N/A
1	2	IMC Gated Room	M	Floor Tile VAT 9" x 9"	4020/01/02/33	Confirmed	700	SF	15	SF	Tan	No Access - Padlock on gate. Inspection from windows only. Tiles cracked		1	No	6/C
1	2	IMC Gated Room	N/A	Wood Floor		Non Suspect ACM	700	SF	0	SF		No Access - Padlock on gate. Inspection from windows only		N/A	N/A	N/A
1	2	IMC Gated Room	M	Sink Undercoat Mastic	4020/01/02/AET/BB/2602	Assumed	4	SF	0	SF		No Access - Padlock on gate. Inspection from windows only		1	No	1/D
1	2	Storage Room in Hallway Bumpout outside IMC	N/A	Plaster Ceiling		NAD	15	SF	0	SF				N/A	N/A	N/A
1	2	Storage Room in Hallway Bumpout outside IMC	N/A	Plaster Walls		NAD	160	SF	0	SF				N/A	N/A	N/A
1	2	Storage Room in Hallway Bumpout outside IMC	N/A	Cement Floor		Non Suspect ACM	15	SF	0	SF				N/A	N/A	N/A
1	2	Pipe Shaft in Hallway outside IMC	X	X		X	X	X	X	X	X	No Access - Access Panel Glued Shut		X	X	X
1	3	Women's Restroom Lounge Area	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	6	LF	0	LF				N/A	N/A	N/A
1	3	Women's Restroom Lounge Area	N/A	Ceiling Tile 2' x 4'		NAD	130	SF	0	SF				N/A	N/A	N/A
1	3	Women's Restroom Lounge Area	N/A	Fiberglass Ceiling Tile 2' x 4'		Non Suspect ACM	130	SF	0	SF				N/A	N/A	N/A
1	3	Women's Restroom Lounge Area	N/A	Plaster Ceiling		NAD	260	SF	0	SF				N/A	N/A	N/A
1	3	Women's Restroom Lounge Area	N/A	Plaster Walls		NAD	900	SF	20	SF				N/A	N/A	N/A
1	3	Women's Restroom Lounge Area	N/A	Wood Floor		Non Suspect ACM	260	SF	0	SF				N/A	N/A	N/A
1	3	Toilet Area in Women's Restroom	T	Pipe Fitting Insulation	4020/01/03/48	Confirmed	3	EA	0	EA				1	No	1/D
1	3	Toilet Area in Women's Restroom	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	45	LF	0	LF				N/A	N/A	N/A
1	3	Toilet Area in Women's Restroom	N/A	Plaster Ceiling		NAD	55	SF	55	SF				N/A	N/A	N/A
1	3	Toilet Area in Women's Restroom	N/A	Plaster Walls		NAD	360	SF	180	SF				N/A	N/A	N/A
1	3	Toilet Area in Women's Restroom	N/A	Marble Walls		Non Suspect ACM	80	SF	0	SF				N/A	N/A	N/A
1	3	Toilet Area in Women's Restroom	N/A	Cement Floor		Non Suspect ACM	55	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 316	T	Pipe Insulation 2-6 inch	4020/01/03/37	Confirmed	10	LF	0	LF		More likely above ceiling tile		1	No	1/D
1	3	Classroom 316	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	12	LF	6	LF				N/A	N/A	N/A
1	3	Classroom 316	N/A	Fiberglass Ceiling Tile 2' x 4'		Non Suspect ACM	720	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 316	N/A	Plaster Ceiling		NAD	720	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 316	N/A	Plaster Walls		NAD	1300	SF	10	SF				N/A	N/A	N/A
1	3	Classroom 316	N/A	Wood Floor		Non Suspect ACM	720	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 316	M	Blackboard Glue Dots	4020/01/03/AET/BB/2600	Assumed	260	SF	0	SF				1	No	1/D
1	3	Classroom 317	T	Pipe Insulation 2-6 inch	4020/01/03/37	Confirmed	7	LF	0	LF				1	No	1/D
1	3	Classroom 317	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	16	LF	0	LF				N/A	N/A	N/A
1	3	Classroom 317	N/A	Plaster Ceiling		NAD	1118	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 317	N/A	Plaster Walls		NAD	1660	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 317	N/A	Wood Floor		Non Suspect ACM	1118	SF	1	SF				N/A	N/A	N/A
1	3	Classroom 317	M	Blackboard Glue Dots	4020/01/03/AET/BB/2600	Assumed	270	SF	0	SF				1	No	1/D
1	3	Office 322	N/A	Plaster Ceiling		NAD	576	SF	0	SF				N/A	N/A	N/A
1	3	Office 322	N/A	Plaster Walls		NAD	1155	SF	0	SF				N/A	N/A	N/A
1	3	Office 322	N/A	Wood Floor		Non Suspect ACM	576	SF	0	SF				N/A	N/A	N/A
1	3	Office 322	M	Blackboard Glue Dots	4020/01/03/AET/BB/2600	Assumed	150	SF	0	SF				1	No	1/D
1	3	Counselor's Office 323	T	Pipe Fitting Insulation	4020/01/03/48	Confirmed	6	EA	0	EA				1	No	1/D
1	3	Counselor's Office 323	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	20	LF	0	LF				N/A	N/A	N/A
1	3	Counselor's Office 323	N/A	Plaster Ceiling		NAD	576	SF	0	SF				N/A	N/A	N/A
1	3	Counselor's Office 323	N/A	Plaster Walls		NAD	1155	SF	0	SF				N/A	N/A	N/A
1	3	Counselor's Office 323	N/A	Wood Floor		Non Suspect ACM	576	SF	0	SF				N/A	N/A	N/A
1	3	Counselor's Office 323	M	Blackboard Glue Dots	4020/01/03/AET/BB/2600	Assumed	180	SF	0	SF				1	No	1/D
1	3	Classroom 328	T	Pipe Fitting Insulation	4020/01/03/48	Confirmed	2	EA	0	EA		More Likely Above Ceiling Tile		1	No	1/D
1	3	Classroom 328	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	36	LF	0	LF				N/A	N/A	N/A
1	3	Classroom 328	N/A	Fiberglass Ceiling Tile 2' x 4'		Non Suspect ACM	755	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 328	N/A	Plaster Ceiling		NAD	755	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 328	N/A	Plaster Walls		NAD	590	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 328	N/A	Brick Wall		Non Suspect ACM	420	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 328	N/A	Concrete Block Wall		Non Suspect ACM	315	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 328	M	Floor Tile VAT 12" x 12"	4020/01/03/AET/BB/2004	Assumed	755	SF	0	SF	Grey			1	No	1/D
1	3	Classroom 328	N/A	Wood Floor		Non Suspect ACM	755	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 328	M	Blackboard Glue Dots	4020/01/03/AET/BB/2600	Assumed	200	SF	0	SF				1	No	1/D
1	3	Classroom 328 Pipe Chase	T	Pipe Fitting Insulation	4020/01/03/48	Confirmed	5	EA	0	EA				1	No	1/D
1	3	Classroom 328 Pipe Chase	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	40	LF	1	LF				N/A	N/A	N/A
1	3	Classroom 326	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	5	LF	0	LF				N/A	N/A	N/A
1	3	Classroom 326	N/A	Plaster Ceiling		NAD	720	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 326	N/A	Plaster Walls		NAD	1300	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 326	N/A	Wood Floor		Non Suspect ACM	720	SF	5	SF				N/A	N/A	N/A
1	3	Classroom 326	M	Blackboard Glue Dots	4020/01/03/AET/BB/2600	Assumed	145	SF	0	SF				1	No	1/D
1	3	Office 327 Science Book Room Science Office Hallway	N/A	Plaster Ceiling		NAD	120	SF	0	SF				N/A	N/A	N/A
1	3	Office 327 Science Book Room Science Office Hallway	N/A	Plaster Walls		NAD	720	SF	0	SF				N/A	N/A	N/A
1	3	Office 327 Science Book Room Science Office Hallway	N/A	Wood Floor		Non Suspect ACM	120	SF	0	SF				N/A	N/A	N/A
1	3	Office 327 Science Office Room on Right	N/A	Plaster Ceiling		NAD	260	SF	5	SF				N/A	N/A	N/A
1	3	Office 327 Science Office Room on Right	N/A	Plaster Walls		NAD	745	SF	0	SF				N/A	N/A	N/A
1	3	Office 327 Science Office Room on Right	N/A	Wood Floor		Non Suspect ACM	260	SF	0	SF				N/A	N/A	N/A
1	3	Office 327 Science Office Closet on Right	N/A	Plaster Ceiling		NAD	20	SF	0	SF				N/A	N/A	N/A
1	3	Office 327 Science Office Closet on Right	N/A	Plaster Walls		NAD	220	SF	0	SF				N/A	N/A	N/A
1	3	Office 327 Science Office Closet on Right	N/A	Wood Floor		Non Suspect ACM	20	SF	0	SF				N/A	N/A	N/A
1	3	Office 327 Science Office Closet on Left	N/A	Plaster Ceiling		NAD	60	LF	15	LF				N/A	N/A	N/A
1	3	Office 327 Science Office Closet on Left	N/A	Plaster Walls		NAD	385	SF	0	SF				N/A	N/A	N/A
1	3	Office 327 Science Office Closet on Left	N/A	Wood Floor		Non Suspect ACM	60	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 329	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	15	LF	9	LF				N/A	N/A	N/A
1	3	Classroom 329	N/A	Plaster Ceiling		NAD	672	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 329	N/A	Plaster Walls		NAD	1250	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 329	M	Transite Table Top	4020/01/03/47	Confirmed	25	SF	0	SF		Lab Table Tops		1	No	1/D

4020 Overbrook HS 2015-2016 AHERA Three Year Report

School District of Philadelphia Overbrook High School 5898 Lancaster Avenue, Philadelphia, PA 19131 ULCS# 4020 Year Built: 1926		AHERA Three-Year Reinspection 2015-2016 Room by Room Location Log Report										Reinspection Date: 10/21/2015 Building Inspector: Bernard Brunner Certificate Number: 45397 Management Planner: M. Causley Certificate Number: ACC-0215-8-010				
Element	Floor	On Site Room Name	System Affected	Material Description	HID#	Confirmed Assumed NAD Non Suspect ACM	Amount of Material	SF LF EA	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic / Crawl Space Ranking	Damage Potential (DP)	Newly Friable (NF)	Response Action (RA)
1	3	Classroom 329	N/A	Wood Floor		Non Suspect ACM	672	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 302	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	6	LF	0	LF				N/A	N/A	N/A
1	3	Classroom 302	N/A	Plaster Ceiling		NAD	720	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 302	N/A	Plaster Walls		NAD	1300	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 302	N/A	Wood Floor		Non Suspect ACM	720	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 302	M	Blackboard Glue Dots	4020/01/03/AET/BB/2600	Assumed	255	SF	0	SF				1	No	1/D
1	3	Classroom 306	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	23	LF	5	LF				N/A	N/A	N/A
1	3	Classroom 306	N/A	Plaster Ceiling		NAD	744	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 306	N/A	Plaster Walls		NAD	1320	SF	25	SF				N/A	N/A	N/A
1	3	Classroom 306	N/A	Wood Floor		Non Suspect ACM	744	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 306	M	Blackboard Glue Dots	4020/01/03/AET/BB/2600	Assumed	285	SF	0	SF				1	No	1/D
1	3	Classroom 321	T	Pipe Fitting Insulation	4020/01/03/48	Confirmed	3	LF	0	LF				1	No	1/D
1	3	Classroom 321	N/A	Pipe Insulation 2-6 inch	4020/01/03/37	Confirmed	16	LF	2	LF		DDC written up		1	Yes	2/B
1	3	Classroom 321	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	12	LF	2	LF				N/A	N/A	N/A
1	3	Classroom 321	N/A	Plaster Ceiling		NAD	720	SF	15	SF				N/A	N/A	N/A
1	3	Classroom 321	N/A	Plaster Walls		NAD	1300	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 321	M	Transite Table Top	4020/01/03/47	Confirmed	25	SF	0	SF		Lab Table Tops		1	No	1/D
1	3	Classroom 321	N/A	Wood Floor		Non Suspect ACM	720	SF	10	SF				N/A	N/A	N/A
1	3	Classroom 321	M	Blackboard Glue Dots	4020/01/03/AET/BB/2600	Assumed	20	SF	0	SF				1	No	1/D
1	3	Pipe Shaft in Hallway outside Classroom 321	T	Pipe Insulation 2-6 inch	4020/01/03/37	Confirmed	13	LF	0	LF				1	No	1/D
1	3	Pipe Shaft in Hallway outside Classroom 321	T	Pipe Insulation > 6 inch	4020/01/03/38	Confirmed	13	LF	0	LF				1	No	1/D
1	3	Pipe Shaft in Hallway outside Classroom 321	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	26	LF	0	LF				N/A	N/A	N/A
1	3	Men's Staff Restroom Lounge Area	T	Pipe Fitting Insulation	4020/01/03/48	Confirmed	2	EA	0	EA		More Likely Above Ceiling Tile		1	No	1/D
1	3	Men's Staff Restroom Lounge Area	N/A	Pipe Insulation 2-6 inch	4020/01/03/37	Confirmed	6	LF	0	LF				1	No	1/D
1	3	Men's Staff Restroom Lounge Area	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	25	LF	0	LF				N/A	N/A	N/A
1	3	Men's Staff Restroom Lounge Area	N/A	Fiberglass Ceiling Tile 2' x 4'		Non Suspect ACM	260	SF	0	SF				N/A	N/A	N/A
1	3	Men's Staff Restroom Lounge Area	N/A	Plaster Ceiling		NAD	260	SF	0	SF				N/A	N/A	N/A
1	3	Men's Staff Restroom Lounge Area	N/A	Plaster Walls		NAD	900	SF	10	SF				N/A	N/A	N/A
1	3	Men's Staff Restroom Lounge Area	N/A	Wood Floor		Non Suspect ACM	260	SF	2	SF				N/A	N/A	N/A
1	3	Toilet Area in Men's Staff Restroom	T	Pipe Fitting Insulation	4020/01/03/48	Confirmed	1	EA	0	EA				1	No	1/D
1	3	Toilet Area in Men's Staff Restroom	T	Pipe Insulation 2-6 inch	4020/01/03/37	Confirmed	6	LF	0	LF				1	No	1/D
1	3	Toilet Area in Men's Staff Restroom	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	3	LF	0	LF				N/A	N/A	N/A
1	3	Toilet Area in Men's Staff Restroom	N/A	Plaster Ceiling		NAD	55	SF	0	SF				N/A	N/A	N/A
1	3	Toilet Area in Men's Staff Restroom	N/A	Plaster Walls		NAD	360	SF	10	SF				N/A	N/A	N/A
1	3	Toilet Area in Men's Staff Restroom	N/A	Cement Floor		Non Suspect ACM	55	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 311	T	Pipe Insulation 2-6 inch	4020/01/03/37	Confirmed	6	LF	0	LF				1	No	1/D
1	3	Classroom 311	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	18	LF	6	LF				N/A	N/A	N/A
1	3	Classroom 311	N/A	Plaster Ceiling		NAD	720	SF	5	SF				N/A	N/A	N/A
1	3	Classroom 311	N/A	Plaster Walls		NAD	1300	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 311	N/A	Wood Floor		Non Suspect ACM	720	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 311	M	Blackboard Glue Dots	4020/01/03/AET/BB/2600	Assumed	210	SF	0	SF				1	No	1/D
1	3	Office 310	N/A	Fiberglass Ceiling Tile 2' x 4'		Non Suspect ACM	140	SF	0	SF				N/A	N/A	N/A
1	3	Office 310	N/A	Plaster Ceiling		NAD	140	SF	0	SF				N/A	N/A	N/A
1	3	Office 310	N/A	Plaster Walls		NAD	120	SF	0	SF				N/A	N/A	N/A
1	3	Office 310	N/A	Brick Wall		Non Suspect ACM	70	SF	0	SF				N/A	N/A	N/A
1	3	Office 310	N/A	Sheetrock Wall		NAD	120	SF	0	SF				N/A	N/A	N/A
1	3	Office 310	N/A	Concrete Block Wall		Non Suspect ACM	170	SF	0	SF				N/A	N/A	N/A
1	3	Office 310	M	Floor Tile VAT 9" x 9"	4020/01/03/41	Confirmed	140	SF	0	SF		Green		1	No	1/D
1	3	Office 310	N/A	Cement Floor		Non Suspect ACM	140	SF	0	SF				N/A	N/A	N/A
1	3	Office 327 Science Book Room Room on Left	N/A	Plaster Ceiling		NAD	260	SF	0	SF				N/A	N/A	N/A
1	3	Office 327 Science Book Room Room on Left	N/A	Plaster Walls		NAD	745	SF	0	SF				N/A	N/A	N/A
1	3	Office 327 Science Book Room Room on Left	N/A	Wood Floor		Non Suspect ACM	260	SF	0	SF				N/A	N/A	N/A
1	3	Office 327 Science Book Room Closet	N/A	Plaster Ceiling		NAD	20	SF	0	SF				N/A	N/A	N/A
1	3	Office 327 Science Book Room Closet	N/A	Plaster Walls		NAD	220	SF	0	SF				N/A	N/A	N/A
1	3	Office 327 Science Book Room Closet	N/A	Wood Floor		Non Suspect ACM	20	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 300	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	9	LF	2	LF				N/A	N/A	N/A
1	3	Classroom 300	N/A	Plaster Ceiling		NAD	720	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 300	N/A	Plaster Walls		NAD	1300	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 300	N/A	Wood Floor		Non Suspect ACM	720	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 300	M	Blackboard Glue Dots	4020/01/03/AET/BB/2600	Assumed	285	SF	0	SF				1	No	1/D
1	3	Classroom 301	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	17	LF	0	LF				N/A	N/A	N/A
1	3	Classroom 301	N/A	Plaster Ceiling		NAD	720	SF	5	SF				N/A	N/A	N/A
1	3	Classroom 301	N/A	Plaster Walls		NAD	1300	SF	20	SF				N/A	N/A	N/A
1	3	Classroom 301	N/A	Wood Floor		Non Suspect ACM	720	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 301	M	Blackboard Glue Dots	4020/01/03/AET/BB/2600	Assumed	285	SF	0	SF				1	No	1/D
1	3	Classroom 303	N/A	Plaster Ceiling		NAD	960	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 303	N/A	Plaster Walls		NAD	1540	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 303	N/A	Wood Floor		Non Suspect ACM	960	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 303	M	Blackboard Glue Dots	4020/01/03/AET/BB/2600	Assumed	120	SF	0	SF				1	No	1/D
1	3	Classroom 304	N/A	Plaster Ceiling		NAD	960	SF	20	SF				N/A	N/A	N/A
1	3	Classroom 304	N/A	Plaster Walls		NAD	1540	SF	30	SF				N/A	N/A	N/A
1	3	Classroom 304	N/A	Wood Floor		Non Suspect ACM	960	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 304	M	Blackboard Glue Dots	4020/01/03/AET/BB/2600	Assumed	225	SF	0	SF				1	No	1/D
1	3	Auditorium Projection Room across from Classroom 304	N/A	Plaster Ceiling		NAD	100	SF	0	SF				N/A	N/A	N/A
1	3	Auditorium Projection Room across from Classroom 304	N/A	Plaster Walls		NAD	320	SF	0	SF				N/A	N/A	N/A
1	3	Auditorium Projection Room across from Classroom 304	N/A	Cement Floor		Non Suspect ACM	100	SF	0	SF				N/A	N/A	N/A
1	3	Auditorium Balcony	N/A	Plaster Ceiling		NAD	4750	SF	50	SF				N/A	N/A	N/A

4020 Overbrook HS 2015-2016 AHERA Three Year Report

School District of Philadelphia Overbrook High School 5898 Lancaster Avenue, Philadelphia, PA 19131 ULCS# 4020 Year Built: 1926		AHERA Three-Year Reinspection 2015-2016 Room by Room Location Log Report										Reinspection Date: 10/21/2015 Building Inspector: Bernard Brunner Certificate Number: 45397 Management Planner: M. Causley Certificate Number: ACC-0215-8-010				Attic / Crawl Space Ranking	Damage Potential (DP)	Newly Friable (NF)	Response Action (RA)
Element	Room	On Site Room Name	System Affected	Material Description	HID#	Confirmed Assumed NAD Non Suspect ACM	Amount of Material	SF LF EA	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes							
1	3	Auditorium Balcony	N/A	Plaster Walls		NAD	3120	SF	0	SF							N/A	N/A	N/A
1	3	Auditorium Balcony	N/A	Carpet		Non Suspect ACM	4750	SF	0	SF							N/A	N/A	N/A
1	3	Auditorium Balcony	N/A	Wood Floor		Non Suspect ACM	4750	SF	0	SF							N/A	N/A	N/A
1	3	Auditorium Balcony	M	Transite	4020/01/03/47	Confirmed	60	SF	0	SF		Transite floor around Spotlight					1	No	1/D
1	3	Classroom 305	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	16	LF	6	LF							N/A	N/A	N/A
1	3	Classroom 305	N/A	Plaster Ceiling		NAD	744	SF	0	SF							N/A	N/A	N/A
1	3	Classroom 305	N/A	Plaster Walls		NAD	1320	SF	10	SF							N/A	N/A	N/A
1	3	Classroom 305	N/A	Wood Floor		Non Suspect ACM	744	SF	0	SF							N/A	N/A	N/A
1	3	Classroom 305	M	Blackboard Glue Dots	4020/01/03/AET/BB/2600	Assumed	150	SF	0	SF							1	No	1/D
1	3	Pipe Shaft in Hallway outside Classroom 305	T	Pipe Insulation 2-6 inch	4020/01/03/37	Confirmed	13	LF	1	LF		DDC written up					1	Yes	2/B
1	3	Classroom 307	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	18	LF	1	LF							N/A	N/A	N/A
1	3	Classroom 307	N/A	Plaster Ceiling		NAD	744	SF	0	SF							N/A	N/A	N/A
1	3	Classroom 307	N/A	Plaster Walls		NAD	1320	SF	20	SF							N/A	N/A	N/A
1	3	Classroom 307	N/A	Wood Floor		Non Suspect ACM	744	SF	0	SF							N/A	N/A	N/A
1	3	Classroom 307	M	Blackboard Glue Dots	4020/01/03/AET/BB/2600	Assumed	285	SF	0	SF							1	No	1/D
1	3	Classroom 308	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	40	LF	0	LF							N/A	N/A	N/A
1	3	Classroom 308	N/A	Plaster Ceiling		NAD	1118	SF	10	SF							N/A	N/A	N/A
1	3	Classroom 308	N/A	Plaster Walls		NAD	1660	SF	0	SF							N/A	N/A	N/A
1	3	Classroom 308	N/A	Wood Floor		Non Suspect ACM	1118	SF	0	SF							N/A	N/A	N/A
1	3	Classroom 308	M	Blackboard Glue Dots	4020/01/03/AET/BB/2600	Assumed	225	SF	0	SF							1	No	1/D
1	3	Classroom 309	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	18	LF	1	LF							N/A	N/A	N/A
1	3	Classroom 309	N/A	Plaster Ceiling		NAD	720	SF	0	SF							N/A	N/A	N/A
1	3	Classroom 309	N/A	Plaster Walls		NAD	1300	SF	10	SF							N/A	N/A	N/A
1	3	Classroom 309	N/A	Wood Floor		Non Suspect ACM	720	SF	0	SF							N/A	N/A	N/A
1	3	Classroom 309	M	Blackboard Glue Dots	4020/01/03/AET/BB/2600	Assumed	290	SF	0	SF							1	No	1/D
1	3	Door between Stainwell and Office 310	X	X		X	X	X	X	X		X	No Access - No Key				X	X	X
1	3	Office 310 Storage Room	N/A	Fiberglass Ceiling Tile 2' x 4'		Non Suspect ACM	100	SF	0	SF							N/A	N/A	N/A
1	3	Office 310 Storage Room	N/A	Plaster Ceiling		NAD	100	SF	0	SF							N/A	N/A	N/A
1	3	Office 310 Storage Room	N/A	Plaster Walls		NAD	140	SF	0	SF							N/A	N/A	N/A
1	3	Office 310 Storage Room	N/A	Brick Wall		Non Suspect ACM	100	SF	0	SF							N/A	N/A	N/A
1	3	Office 310 Storage Room	N/A	Concrete Block Wall		Non Suspect ACM	120	SF	0	SF							N/A	N/A	N/A
1	3	Office 310 Storage Room	N/A	Sheetrock Wall		NAD	120	SF	0	SF							N/A	N/A	N/A
1	3	Office 310 Storage Room	M	Floor Tile VAT 9" x 9"	4020/01/03/41	Confirmed	100	SF	0	SF		Green					1	No	1/D
1	3	Office 310 Storage Room	N/A	Cement Floor		Non Suspect ACM	100	SF	0	SF							N/A	N/A	N/A
1	3	Classroom 312	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	33	LF	2	LF							N/A	N/A	N/A
1	3	Classroom 312	N/A	Fiberglass Ceiling Tile 2' x 4'		Non Suspect ACM	780	SF	0	SF							N/A	N/A	N/A
1	3	Classroom 312	N/A	Plaster Ceiling		NAD	780	SF	0	SF							N/A	N/A	N/A
1	3	Classroom 312	N/A	Plaster Walls		NAD	420	SF	0	SF							N/A	N/A	N/A
1	3	Classroom 312	N/A	Concrete Block Wall		Non Suspect ACM	625	SF	0	SF							N/A	N/A	N/A
1	3	Classroom 312	N/A	Brick Wall		Non Suspect ACM	300	SF	0	SF							N/A	N/A	N/A
1	3	Classroom 312	M	Floor Tile VAT 9" x 9"	4020/01/03/41	Confirmed	780	SF	0	SF		Green					1	No	1/D
1	3	Classroom 312	N/A	Cement Floor		Non Suspect ACM	780	SF	0	SF							N/A	N/A	N/A
1	3	Classroom 312	M	Blackboard Glue Dots	4020/01/03/AET/BB/2600	Assumed	80	SF	0	SF							1	No	1/D
1	3	Office 313 Teacher's Rest Room	T	Pipe Fitting Insulation	4020/01/03/48	Confirmed	3	EA	0	EA		Teacher's Rest Room is Painted on the Door as 2 Separate Words					1	No	1/D
1	3	Office 313 Teacher's Restroom	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	42	LF	0	LF		Teacher's Rest Room is Painted on the Door as 2 Separate Words					N/A	N/A	N/A
1	3	Office 313 Teacher's Restroom	N/A	Plaster Ceiling		NAD	672	SF	0	SF		Teacher's Rest Room is Painted on the Door as 2 Separate Words					N/A	N/A	N/A
1	3	Office 313 Teacher's Restroom	N/A	Plaster Walls		NAD	1250	SF	5	SF		Teacher's Rest Room is Painted on the Door as 2 Separate Words					N/A	N/A	N/A
1	3	Office 313 Teacher's Restroom	N/A	Wood Floor		Non Suspect ACM	672	SF	0	SF		Teacher's Rest Room is Painted on the Door as 2 Separate Words					N/A	N/A	N/A
1	3	Office 313 Teacher's Restroom	M	Blackboard Glue Dots	4020/01/03/AET/BB/2600	Assumed	90	SF	0	SF		Teacher's Rest Room is Painted on the Door as 2 Separate Words					1	No	1/D
1	3	Classroom 314	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	20	LF	2	LF							N/A	N/A	N/A
1	3	Classroom 314	N/A	Fiberglass Ceiling Tile 2' x 4'		Non Suspect ACM	730	SF	0	SF							N/A	N/A	N/A
1	3	Classroom 314	N/A	Plaster Walls		NAD	575	SF	0	SF							N/A	N/A	N/A
1	3	Classroom 314	N/A	Brick Wall		Non Suspect ACM	410	SF	0	SF							N/A	N/A	N/A
1	3	Classroom 314	N/A	Concrete Block Wall		Non Suspect ACM	315	SF	0	SF							N/A	N/A	N/A
1	3	Classroom 314	M	Floor Tile VAT 9" x 9"	4020/01/03/41	Confirmed	730	SF	15	SF		Green					1	No	6/C
1	3	Classroom 314	N/A	Cement Floor		Non Suspect ACM	730	SF	0	SF							N/A	N/A	N/A
1	3	Classroom 314	M	Blackboard Glue Dots	4020/01/03/AET/BB/2600	Assumed	90	SF	0	SF							1	No	1/D
1	3	Classroom 314 Pipe Chase	T	Pipe Fitting Insulation	4020/01/03/48	Confirmed	1	EA	0	EA		The access panel is boarded up in Classroom 314. There is also an access panel in the 3rd Floor Boy's Restroom					1	No	1/D
1	3	Classroom 314 Pipe Chase	T	Pipe Insulation 2-6 inch	4020/01/03/37	Confirmed	1	LF	0	LF		The access panel is boarded up in Classroom 314. There is also an access panel in the 3rd Floor Boy's Restroom					1	No	1/D
1	3	Classroom 314 Pipe Chase	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	30	LF	0	LF		The access panel is boarded up in Classroom 314. There is also an access panel in the 3rd Floor Boy's Restroom					N/A	N/A	N/A
1	3	Nurse's Office	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	21	LF	0	LF							N/A	N/A	N/A
1	3	Nurse's Office	N/A	Ceiling Tile 2' x 4'		NAD	480	SF	0	SF							N/A	N/A	N/A
1	3	Nurse's Office	N/A	Plaster Ceiling		NAD	480	SF	0	SF							N/A	N/A	N/A
1	3	Nurse's Office	N/A	Plaster Walls		NAD	1060	SF	0	SF							N/A	N/A	N/A
1	3	Nurse's Office	M	Floor Tile VAT 9" x 9"	4020/01/03/41	Confirmed	374	SF	0	SF		Tan					1	No	1/D
1	3	Nurse's Office	M	Floor Tile VAT 12" x 12"	4020/01/03/AET/BB/2001	Assumed	106	SF	0	SF		Blue					1	No	1/D
1	3	Nurse's Office	N/A	Wood Floor		Non Suspect ACM	480	SF	0	SF							N/A	N/A	N/A
1	3	Nurse's Office	M	Blackboard Glue Dots	4020/01/03/AET/BB/2600	Assumed	90	SF	0	SF							1	No	1/D
1	3	Nurse's Office Right Patient Area	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	3	LF	0	LF							N/A	N/A	N/A
1	3	Nurse's Office Right Patient Area	N/A	Ceiling Tile 2' x 4'		NAD	200	SF	0	SF							N/A	N/A	N/A
1	3	Nurse's Office Right Patient Area	N/A	Plaster Ceiling		NAD	200	SF	0	SF							N/A	N/A	N/A
1	3	Nurse's Office Right Patient Area	N/A	Plaster Walls		NAD	720	SF	2	SF							N/A	N/A	N/A
1	3	Nurse's Office Right Patient Area	M	Floor Tile VAT 9" x 9"	4020/01/03/41	Confirmed	198	SF	0	SF		Tan					1	No	1/D
1	3	Nurse's Office Right Patient Area	M	Floor Tile VAT 12" x 12"	4020/01/03/AET/BB/2001	Assumed	4	SF	0	SF		Blue					1	No	1/D
1	3	Nurse's Office Right Patient Area	N/A	Wood Floor		Non Suspect ACM	200	SF	0	SF							N/A	N/A	N/A

4020 Overbrook HS 2015-2016 AHERA Three Year Report

School District of Philadelphia			AHERA Three-Year Reinspection 2015-2016										Reinspection Date: 10/21/2015						
Overbrook High School			Room by Room Location Log Report										Building Inspector: Bernard Brunner						
5898 Lancaster Avenue, Philadelphia, PA 19131													Certificate Number: 45397						
ULCS# 4020													Management Planner: M. Causley						
Year Built: 1926													Certificate Number: ACC-0215-8-010						
Element	Floor	Room	On Site Room Name	System Affected	Material Description	HID#	Confirmed Assumed NAD Non Suspect ACM	Amount of Material	SF LF EA	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic / Crawl Space Ranking	Damage Potential (DP)	Newly Friable (NF)	Response Action (RA)		
1	3	Nurse's Office Large Restroom	N/A	Ceiling Tile 2' x 4'		NAD	40	SF	0	SF					N/A	N/A	N/A		
1	3	Nurse's Office Large Restroom	N/A	Plaster Ceiling		NAD	40	SF	0	SF					N/A	N/A	N/A		
1	3	Nurse's Office Large Restroom	N/A	Plaster Walls		NAD	290	SF	1	SF					N/A	N/A	N/A		
1	3	Nurse's Office Large Restroom	M	Floor Tile VAT 9" x 9"	4020/01/03/41	Confirmed	8	SF	0	SF	Tan				1	No	1/D		
1	3	Nurse's Office Large Restroom	M	Floor Tile VAT 12" x 12"	4020/01/03/AET/BB/2001	Assumed	32	SF	0	SF	Blue				1	No	1/D		
1	3	Nurse's Office Large Restroom	N/A	Wood Floor		Non Suspect ACM	40	SF	0	SF					N/A	N/A	N/A		
1	3	Nurse's Office Closet	N/A	Ceiling Tile 2' x 4'		NAD	24	SF	0	SF					N/A	N/A	N/A		
1	3	Nurse's Office Closet	N/A	Plaster Ceiling		NAD	24	SF	0	SF					N/A	N/A	N/A		
1	3	Nurse's Office Closet	N/A	Plaster Walls		NAD	240	SF	0	SF					N/A	N/A	N/A		
1	3	Nurse's Office Closet	M	Floor Tile VAT 9" x 9"	4020/01/03/41	Confirmed	24	SF	0	SF	Tan				1	No	1/D		
1	3	Nurse's Office Closet	N/A	Wood Floor		Non Suspect ACM	24	SF	0	SF					N/A	N/A	N/A		
1	3	Nurse's Office Hallway	N/A	Ceiling Tile 2' x 4'		NAD	24	SF	0	SF					N/A	N/A	N/A		
1	3	Nurse's Office Hallway	N/A	Plaster Ceiling		NAD	24	SF	0	SF					N/A	N/A	N/A		
1	3	Nurse's Office Hallway	N/A	Plaster Walls		NAD	100	SF	0	SF					N/A	N/A	N/A		
1	3	Nurse's Office Hallway	M	Floor Tile VAT 9" x 9"	4020/01/03/41	Confirmed	24	SF	0	SF	Tan				1	No	1/D		
1	3	Nurse's Office Hallway	N/A	Wood Floor		Non Suspect ACM	24	SF	0	SF					N/A	N/A	N/A		
1	3	Nurse's Office Small Restroom	N/A	Ceiling Tile 2' x 4'		NAD	24	SF	0	SF					N/A	N/A	N/A		
1	3	Nurse's Office Small Restroom	N/A	Plaster Ceiling		NAD	24	SF	0	SF					N/A	N/A	N/A		
1	3	Nurse's Office Small Restroom	N/A	Plaster Walls		NAD	240	SF	0	SF					N/A	N/A	N/A		
1	3	Nurse's Office Small Restroom	N/A	Marble Walls		Non Suspect ACM	85	SF	0	SF					N/A	N/A	N/A		
1	3	Nurse's Office Small Restroom	M	Floor Tile VAT 9" x 9"	4020/01/03/41	Confirmed	24	SF	1	SF	Tan				1	No	6/C		
1	3	Nurse's Office Small Restroom	N/A	Wood Floor		Non Suspect ACM	24	SF	0	SF					N/A	N/A	N/A		
1	3	Nurse's Office Left Patient Area	N/A	Ceiling Tile 2' x 4'		NAD	175	SF	0	SF					N/A	N/A	N/A		
1	3	Nurse's Office Left Patient Area	N/A	Plaster Ceiling		NAD	175	SF	0	SF					N/A	N/A	N/A		
1	3	Nurse's Office Left Patient Area	N/A	Plaster Walls		NAD	720	SF	5	SF					N/A	N/A	N/A		
1	3	Nurse's Office Left Patient Area	M	Floor Tile VAT 9" x 9"	4020/01/03/41	Confirmed	175	SF	0	SF	Tan				1	No	1/D		
1	3	Nurse's Office Left Patient Area	N/A	Wood Floor		Non Suspect ACM	175	SF	0	SF					N/A	N/A	N/A		
1	3	Nurse's Office Left Patient Area	T	Heat Shield Insulation	4020/01/03/AET/BB/1600	Assumed	1	SF	0	SF					1	No	1/D		
1	3	Boy's Restroom	T	Pipe Fitting Insulation	4020/01/03/48	Confirmed	3	EA	0	SF					1	No	1/D		
1	3	Boy's Restroom	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	73	LF	1	LF					N/A	N/A	N/A		
1	3	Boy's Restroom	N/A	Plaster Ceiling		NAD	120	SF	0	SF					N/A	N/A	N/A		
1	3	Boy's Restroom	N/A	Concrete Ceiling		Non Suspect ACM	360	SF	0	SF					N/A	N/A	N/A		
1	3	Boy's Restroom	N/A	Plaster Walls		NAD	900	SF	0	SF					N/A	N/A	N/A		
1	3	Boy's Restroom	N/A	Brick Wall		Non Suspect ACM	160	SF	0	SF					N/A	N/A	N/A		
1	3	Boy's Restroom	N/A	Marble Walls		Non Suspect ACM	135	SF	0	SF		On wall behind toilets. Material is heavily painted. Based on observations of similar material on other floors the material is marble.			N/A	N/A	N/A		
1	3	Boy's Restroom	N/A	Cement Floor		Non Suspect ACM	480	SF	0	SF					N/A	N/A	N/A		
1	3	Custodial Closet adjacent Boy's Restroom	T	Pipe Fitting Insulation	4020/01/03/48	Confirmed	1	EA	0	EA					1	No	1/D		
1	3	Custodial Closet adjacent Boy's Restroom	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	38	LF	0	LF					N/A	N/A	N/A		
1	3	Stairwell C Pipe Chase at 3rd Floor	T	Pipe Fitting Insulation	4020/01/03/48	Confirmed	8	EA	0	EA					1	No	1/D		
1	3	Stairwell C Pipe Chase at 3rd Floor	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	50	LF	20	LF					N/A	N/A	N/A		
1	3	Classroom 318	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	18	LF	4	LF					N/A	N/A	N/A		
1	3	Classroom 318	N/A	Plaster Ceiling		NAD	720	SF	0	SF					N/A	N/A	N/A		
1	3	Classroom 318	N/A	Plaster Walls		NAD	1300	SF	0	SF					N/A	N/A	N/A		
1	3	Classroom 318	N/A	Wood Floor		Non Suspect ACM	720	SF	0	SF					N/A	N/A	N/A		
1	3	Classroom 318	M	Blackboard Glue Dots	4020/01/03/AET/BB/2600	Assumed	255	SF	0	SF					1	No	1/D		
1	3	Classroom 319	T	Pipe Insulation 2-6 inch	4020/01/03/37	Confirmed	6	LF	0	LF					1	No	1/D		
1	3	Classroom 319	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	15	LF	4	LF					N/A	N/A	N/A		
1	3	Classroom 319	N/A	Plaster Ceiling		NAD	720	SF	0	SF					N/A	N/A	N/A		
1	3	Classroom 319	N/A	Plaster Walls		NAD	1300	SF	0	SF					N/A	N/A	N/A		
1	3	Classroom 319	N/A	Wood Floor		Non Suspect ACM	720	SF	2	SF					N/A	N/A	N/A		
1	3	Classroom 319	M	Blackboard Glue Dots	4020/01/03/AET/BB/2600	Assumed	270	SF	0	SF					1	No	1/D		
1	3	Classroom 320	T	Pipe Insulation 2-6 inch	4020/01/03/37	Confirmed	6	LF	1	LF		DDC written up			1	Yes	2/B		
1	3	Classroom 320	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	15	LF	2	LF					N/A	N/A	N/A		
1	3	Classroom 320	N/A	Plaster Ceiling		NAD	720	SF	0	SF					N/A	N/A	N/A		
1	3	Classroom 320	N/A	Plaster Walls		NAD	1300	SF	5	SF					N/A	N/A	N/A		
1	3	Classroom 320	N/A	Wood Floor		Non Suspect ACM	720	SF	0	SF					N/A	N/A	N/A		
1	3	Classroom 320	M	Blackboard Glue Dots	4020/01/03/AET/BB/2600	Assumed	210	SF	0	SF					1	No	1/D		
1	3	Storage Room between Classrooms 320 & 321	N/A	Plaster Ceiling		NAD	260	SF	0	SF					N/A	N/A	N/A		
1	3	Storage Room between Classrooms 320 & 321	N/A	Plaster Walls		NAD	745	SF	0	SF					N/A	N/A	N/A		
1	3	Storage Room between Classrooms 320 & 321	M	Transite Sink	4020/01/03/47	Confirmed	8	SF	0	SF					1	No	1/D		
1	3	Storage Room between Classrooms 320 & 321	N/A	Wood Floor		Non Suspect ACM	260	SF	1	SF					N/A	N/A	N/A		
1	3	Classroom 324	T	Pipe Fitting Insulation	4020/01/03/48	Confirmed	4	EA	0	EA					1	No	1/D		
1	3	Classroom 324	T	Pipe Insulation 2-6 inch	4020/01/03/37	Confirmed	18	LF	0	LF					1	No	1/D		
1	3	Classroom 324	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	13	LF	0	LF					N/A	N/A	N/A		
1	3	Classroom 324	N/A	Plaster Ceiling		NAD	816	SF	0	SF					N/A	N/A	N/A		
1	3	Classroom 324	N/A	Plaster Walls		NAD	1395	SF	0	SF					N/A	N/A	N/A		
1	3	Classroom 324	M	Transite Table Top	4020/01/03/47	Confirmed	180	SF	0	SF		Lab Table Tops and Glassware Holders			1	No	1/D		
1	3	Classroom 324	N/A	Wood Floor		Non Suspect ACM	816	SF	0	SF					N/A	N/A	N/A		
1	3	Classroom 325	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	9	LF	0	LF					N/A	N/A	N/A		
1	3	Classroom 325	N/A	Plaster Ceiling		NAD	1118	SF	0	SF					N/A	N/A	N/A		
1	3	Classroom 325	N/A	Plaster Walls		NAD	1660	SF	0	SF					N/A	N/A	N/A		
1	3	Classroom 325	M	Transite Table Top	4020/01/03/47	Confirmed	175	SF	0	SF		Lab Table Tops and Glassware Holders			1	No	1/D		
1	3	Classroom 325	N/A	Wood Floor		Non Suspect ACM	1118	SF	1	SF					N/A	N/A	N/A		
1	3	Girl's Restroom	T	Pipe Fitting Insulation	4020/01/03/48	Confirmed	1	EA	0	EA					1	No	1/D		
1	3	Girl's Restroom	T	Pipe Insulation 2-6 inch	4020/01/03/37	Confirmed	12	LF	0	LF					1	No	1/D		
1	3	Girl's Restroom	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	16	LF	0	LF					N/A	N/A	N/A		
1	3	Girl's Restroom	N/A	Plaster Ceiling		NAD	480	SF	20	SF					N/A	N/A	N/A		

4020 Overbrook HS 2015-2016 AHERA Three Year Report

School District of Philadelphia Overbrook High School 5898 Lancaster Avenue, Philadelphia, PA 19131 ULCS# 4020 Year Built: 1926		AHERA Three-Year Reinspection 2015-2016 Room by Room Location Log Report										Reinspection Date: 10/21/2015 Building Inspector: Bernard Brunner Certificate Number: 45397 Management Planner: M. Causley Certificate Number: ACC-0215-8-010				
Element	Room	On Site Room Name	System Affected	Material Description	HID#	Confirmed Assumed NAD Non Suspect ACM	Amount of Material	SF LF EA	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic / Crawl Space Ranking	Damage Potential (DP)	Newly Friable (NF)	Response Action (RA)
1	3	Girl's Restroom	N/A	Plaster Walls		NAD	450	SF	30	SF				N/A	N/A	N/A
1	3	Girl's Restroom	N/A	Brick Wall		Non Suspect ACM	450	SF	0	SF				N/A	N/A	N/A
1	3	Girl's Restroom	N/A	Marble Walls		Non Suspect ACM	135	SF	0	SF		On wall behind toilets. Material is heavily painted. Based on observations of similar material on other floors the material is marble.		N/A	N/A	N/A
1	3	Girl's Restroom	N/A	Cement Floor		Non Suspect ACM	480	SF	0	SF				N/A	N/A	N/A
1	3	Stairwell D Pipe Chase at 3rd Floor	T	Pipe Fitting Insulation	4020/01/03/48	Confirmed	3	EA	0	EA				1	No	1/D
1	3	Stairwell D Pipe Chase at 3rd Floor	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	30	LF	0	LF				N/A	N/A	N/A
1	3	Custodial Closet adjacent Girl's Room Labeled Storage	T	Pipe Fitting Insulation	4020/01/03/48	Confirmed	5	EA	0	EA				1	No	1/D
1	3	Custodial Closet adjacent Girl's Room Labeled Storage	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	38	LF	0	LF				N/A	N/A	N/A
1	3	Classroom 330	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	42	LF	0	LF				N/A	N/A	N/A
1	3	Classroom 330	N/A	Ceiling Tile 2' x 4'		NAD	755	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 330	N/A	Plaster Ceiling		NAD	755	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 330	N/A	Plaster Walls		NAD	410	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 330	N/A	Brick Wall		Non Suspect ACM	290	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 330	N/A	Concrete Block Wall		Non Suspect ACM	625	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 330	M	Floor Tile VAT 9" x 9"	4020/01/03/41	Confirmed	755	SF	10	SF	Tan			1	No	6/C
1	3	Classroom 330	N/A	Wood Floor		Non Suspect ACM	755	SF	5	SF				N/A	N/A	N/A
1	3	Classroom 330	M	Blackboard Glue Dots	4020/01/03/AET/BB/2600	Assumed	200	SF	0	SF				1	No	1/D
1	3	Storage Room 331	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	3	LF	0	LF				N/A	N/A	N/A
1	3	Storage Room 331	N/A	Fiberglass Ceiling Tile 2' x 4'		Non Suspect ACM	250	SF	0	SF				N/A	N/A	N/A
1	3	Storage Room 331	N/A	Plaster Ceiling		NAD	250	SF	0	SF				N/A	N/A	N/A
1	3	Storage Room 331	N/A	Plaster Walls		NAD	315	SF	0	SF				N/A	N/A	N/A
1	3	Storage Room 331	N/A	Brick Wall		Non Suspect ACM	225	SF	0	SF				N/A	N/A	N/A
1	3	Storage Room 331	N/A	Concrete Block Wall		Non Suspect ACM	300	SF	0	SF				N/A	N/A	N/A
1	3	Storage Room 331	M	Floor Tile VAT 9" x 9"	4020/01/03/41	Confirmed	250	SF	0	SF	Tan			1	No	1/D
1	3	Storage Room 331	N/A	Cement Floor		Non Suspect ACM	250	SF	0	SF				N/A	N/A	N/A
1	3	Chemical Storage adjacent Storage Room 331	T	Pipe Fitting Insulation	4020/01/03/48	Confirmed	2	EA	0	EA				1	No	1/D
1	3	Chemical Storage adjacent Storage Room 331	T	Pipe Insulation 2-6 inch	4020/01/03/37	Confirmed	16	LF	0	LF				1	No	1/D
1	3	Chemical Storage adjacent Storage Room 331	N/A	Plaster Ceiling		NAD	120	SF	25	SF				N/A	N/A	N/A
1	3	Chemical Storage adjacent Storage Room 331	N/A	Plaster Walls		NAD	700	SF	0	SF				N/A	N/A	N/A
1	3	Chemical Storage adjacent Storage Room 331	M	Transite Closet	4020/01/03/47	Confirmed	12	SF	0	SF		Panel Above Door		1	No	1/D
1	3	Chemical Storage adjacent Storage Room 331	N/A	Wood Floor		Non Suspect ACM	120	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 332	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	23	LF	0	LF				N/A	N/A	N/A
1	3	Classroom 332	N/A	Plaster Ceiling		NAD	720	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 332	N/A	Plaster Walls		NAD	1300	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 332	M	Transite Table Top	4020/01/03/47	Confirmed	240	SF	0	SF		Lab Table Tops and Glassware Holders		1	No	1/D
1	3	Classroom 332	N/A	Wood Floor		Non Suspect ACM	720	SF	5	SF				N/A	N/A	N/A
1	3	Classroom 333	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	18	LF	2	LF				N/A	N/A	N/A
1	3	Classroom 333	N/A	Plaster Ceiling		NAD	720	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 333	N/A	Plaster Walls		NAD	1010	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 333	N/A	Partition Room Dividers		Non Suspect ACM	290	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 333	M	Transite Table Top	4020/01/03/47	Confirmed	215	SF	0	SF		Lab Table Tops and Glassware Holders		1	No	1/D
1	3	Classroom 333	N/A	Wood Floor		Non Suspect ACM	720	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 334	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	18	LF	1	LF				N/A	N/A	N/A
1	3	Classroom 334	N/A	Plaster Ceiling		NAD	1118	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 334	N/A	Plaster Walls		NAD	1370	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 334	N/A	Partition Room Dividers		Non Suspect ACM	290	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 334	M	Transite Table Top	4020/01/03/47	Confirmed	195	SF	0	SF		Lab Table Tops and Glassware Holders		1	No	1/D
1	3	Classroom 334	N/A	Wood Floor		Non Suspect ACM	1118	SF	0	SF				N/A	N/A	N/A
1	3	Hallway outside Classrooms 300-307	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	52	LF	0	LF				N/A	N/A	N/A
1	3	Hallway outside Classrooms 300-307	N/A	Plaster Ceiling		NAD	3000	SF	0	SF				N/A	N/A	N/A
1	3	Hallway outside Classrooms 300-307	N/A	Plaster Walls		NAD	6000	SF	30	SF				N/A	N/A	N/A
1	3	Hallway outside Classrooms 300-307	N/A	Marble Walls		Non Suspect ACM	2500	SF	0	SF				N/A	N/A	N/A
1	3	Hallway outside Classrooms 300-307	N/A	Cement Floor		Non Suspect ACM	3000	SF	0	SF				N/A	N/A	N/A
1	3	Hallway outside Classrooms 300-307	M	Transite Electrical Panel	4020/01/03/47	Confirmed	10	SF	0	SF				1	No	1/D
1	3	Stairwell B	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	17	LF	0	LF				N/A	N/A	N/A
1	3	Stairwell B	N/A	Plaster Ceiling		NAD	375	SF	0	SF				N/A	N/A	N/A
1	3	Stairwell B	N/A	Plaster Walls		NAD	900	SF	0	SF				N/A	N/A	N/A
1	3	Stairwell B	N/A	Brick Wall		Non Suspect ACM	250	SF	0	SF				N/A	N/A	N/A
1	3	Stairwell B	N/A	Cement Floor		Non Suspect ACM	375	SF	0	SF				N/A	N/A	N/A
1	3	Hallway outside Classrooms 308-316	N/A	Plaster Ceiling		NAD	1800	SF	0	SF				N/A	N/A	N/A
1	3	Hallway outside Classrooms 308-316	N/A	Plaster Walls		NAD	3600	SF	0	SF				N/A	N/A	N/A
1	3	Hallway outside Classrooms 308-316	N/A	Marble Walls		Non Suspect ACM	1500	SF	0	SF				N/A	N/A	N/A
1	3	Hallway outside Classrooms 308-316	N/A	Cement Floor		Non Suspect ACM	1800	SF	0	SF				N/A	N/A	N/A
1	3	Stairwell C	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	17	LF	0	LF				N/A	N/A	N/A
1	3	Stairwell C	N/A	Plaster Ceiling		NAD	375	SF	0	SF				N/A	N/A	N/A
1	3	Stairwell C	N/A	Plaster Walls		NAD	900	SF	0	SF				N/A	N/A	N/A
1	3	Stairwell C	N/A	Brick Wall		Non Suspect ACM	250	SF	0	SF				N/A	N/A	N/A
1	3	Stairwell C	N/A	Cement Floor		Non Suspect ACM	375	SF	0	SF				N/A	N/A	N/A
1	3	Fire Tower adjacent Classroom 317	N/A	Concrete Ceiling		Non Suspect ACM	375	SF	0	SF				N/A	N/A	N/A
1	3	Fire Tower adjacent Classroom 317	N/A	Brick Wall		Non Suspect ACM	1150	SF	0	SF				N/A	N/A	N/A
1	3	Fire Tower adjacent Classroom 317	N/A	Cement Floor		Non Suspect ACM	375	SF	0	SF				N/A	N/A	N/A
1	3	Storage Room between Classrooms 320 & 321 Left Closet	N/A	Plaster Ceiling		NAD	20	SF	0	SF				N/A	N/A	N/A
1	3	Storage Room between Classrooms 320 & 321 Left Closet	N/A	Plaster Walls		NAD	220	SF	5	SF				N/A	N/A	N/A
1	3	Storage Room between Classrooms 320 & 321 Left Closet	N/A	Wood Floor		Non Suspect ACM	20	SF	0	SF				N/A	N/A	N/A
1	3	Storage Room between Classrooms 320 & 321 Right Closet	X	X		X	X	X	X	X	X	No Access - No Key		X	X	X
1	3	Hallway between Classrooms 320 & 321	T	Pipe Fitting Insulation	4020/01/03/48	Confirmed	2	EA	0	EA				1	No	1/D

4020 Overbrook HS 2015-2016 AHERA Three Year Report

School District of Philadelphia Overbrook High School 5898 Lancaster Avenue, Philadelphia, PA 19131 ULCS# 4020 Year Built: 1926			AHERA Three-Year Reinspection 2015-2016 Room by Room Location Log Report										Reinspection Date: 10/21/2015 Building Inspector: Bernard Brunner Certificate Number: 45397 Management Planner: M. Causley Certificate Number: ACC-0215-8-010			
Element	Floor	On Site Room Name	System Affected	Material Description	HID#	Confirmed Assumed NAD Non Suspect ACM	Amount of Material	SF LF EA	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic / Crawl Space Ranking	Damage Potential (DP)	Newly Friable (NF)	Response Action (RA)
1	3	Hallway between Classrooms 320 & 321 outside Storage Room	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	2	LF	0	LF				N/A	N/A	N/A
1	3	Hallway between Classrooms 320 & 321 outside Storage Room	N/A	Plaster Ceiling		NAD	65	SF	0	SF				N/A	N/A	N/A
1	3	Hallway between Classrooms 320 & 321 outside Storage Room	N/A	Plaster Walls		NAD	385	SF	0	SF				N/A	N/A	N/A
1	3	Hallway between Classrooms 320 & 321 outside Storage Room	N/A	Wood Floor		Non Suspect ACM	65	SF	0	SF				N/A	N/A	N/A
1	3	Chemical Storage adjacent Storage Room 331 Rear Storage Room	T	Pipe Fitting Insulation	4020/01/03/48	Confirmed	7	EA	0	EA				1	No	1/D
1	3	Chemical Storage adjacent Storage Room 331 Rear Storage Room	T	Pipe Insulation 2-6 inch	4020/01/03/37	Confirmed	27	LF	0	LF				1	No	1/D
1	3	Chemical Storage adjacent Storage Room 331 Rear Storage Room	N/A	Plaster Ceiling		NAD	100	SF	25	SF				N/A	N/A	N/A
1	3	Chemical Storage adjacent Storage Room 331 Rear Storage Room	N/A	Plaster Walls		NAD	480	SF	0	SF				N/A	N/A	N/A
1	3	Chemical Storage adjacent Storage Room 331 Rear Storage Room	N/A	Wood Floor		Non Suspect ACM	100	SF	0	SF				N/A	N/A	N/A
1	3	Hallway outside Classrooms 318-320	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	74	LF	2	LF				N/A	N/A	N/A
1	3	Hallway outside Classrooms 318-320	N/A	Plaster Ceiling		NAD	1560	SF	0	SF				N/A	N/A	N/A
1	3	Hallway outside Classrooms 318-320	N/A	Plaster Walls		NAD	2600	SF	0	SF				N/A	N/A	N/A
1	3	Hallway outside Classrooms 318-320	N/A	Marble Walls		Non Suspect ACM	1300	SF	0	SF				N/A	N/A	N/A
1	3	Hallway outside Classrooms 318-320	N/A	Cement Floor		Non Suspect ACM	1560	SF	0	SF				N/A	N/A	N/A
1	3	Stairwell across from Classroom 319	N/A	Plaster Ceiling		NAD	360	SF	0	SF		Stairwell access is sealed at this floor. Access to this area can is from either the 4th or 2nd floors		N/A	N/A	N/A
1	3	Stairwell across from Classroom 319	N/A	Plaster Walls		NAD	1010	SF	0	SF		Stairwell access is sealed at this floor. Access to this area can is from either the 4th or 2nd floors		N/A	N/A	N/A
1	3	Stairwell across from Classroom 319	N/A	Cement Floor		Non Suspect ACM	360	SF	0	SF		Stairwell access is sealed at this floor. Access to this area can is from either the 4th or 2nd floors		N/A	N/A	N/A
1	3	First Storage Room inside Stairwell across from Classroom 319	T	Pipe Insulation 2-6 inch	4020/01/03/37	Confirmed	36	LF	0	LF				1	No	1/D
1	3	First Storage Room inside Stairwell across from Classroom 319	N/A	Plaster Ceiling		NAD	50	SF	0	SF				N/A	N/A	N/A
1	3	First Storage Room inside Stairwell across from Classroom 319	N/A	Plaster Walls		NAD	200	SF	0	SF				N/A	N/A	N/A
1	3	First Storage Room inside Stairwell across from Classroom 319	N/A	Cement Floor		Non Suspect ACM	50	SF	0	SF				N/A	N/A	N/A
1	3	Storage Room behind First Storage Room inside Stairwell across from Classroom 319	N/A	Plaster Ceiling		NAD	200	SF	50	SF				N/A	N/A	N/A
1	3	Storage Room behind First Storage Room inside Stairwell across from Classroom 319	N/A	Plaster Walls		NAD	800	SF	20	SF				N/A	N/A	N/A
1	3	Storage Room behind First Storage Room inside Stairwell across from Classroom 319	N/A	Cement Floor		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A
1	3	Hallway outside Classrooms 321-324	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	54	LF	0	LF				N/A	N/A	N/A
1	3	Hallway outside Classrooms 321-324	N/A	Plaster Ceiling		NAD	1560	SF	0	SF				N/A	N/A	N/A
1	3	Hallway outside Classrooms 321-324	N/A	Plaster Walls		NAD	2600	SF	0	SF				N/A	N/A	N/A
1	3	Hallway outside Classrooms 321-324	N/A	Marble Walls		Non Suspect ACM	1300	SF	0	SF				N/A	N/A	N/A
1	3	Hallway outside Classrooms 321-324	N/A	Cement Floor		Non Suspect ACM	1560	SF	0	SF				N/A	N/A	N/A
1	3	Hallway outside Classrooms 321-324	M	Transite Electrical Panel	4020/01/03/47	Confirmed	15	SF	0	SF				1	No	1/D
1	3	Stairwell across from Classroom 323	N/A	Plaster Ceiling		NAD	360	SF	0	SF		Stairwell access is sealed at this floor. Access to this area can is from either the 4th or 2nd floors		N/A	N/A	N/A
1	3	Stairwell across from Classroom 323	N/A	Plaster Walls		NAD	1010	SF	0	SF		Stairwell access is sealed at this floor. Access to this area can is from either the 4th or 2nd floors		N/A	N/A	N/A
1	3	Stairwell across from Classroom 323	N/A	Cement Floor		Non Suspect ACM	360	SF	0	SF		Stairwell access is sealed at this floor. Access to this area can is from either the 4th or 2nd floors		N/A	N/A	N/A
1	3	First Storage Room inside Stairwell across from Classroom 323	T	Pipe Insulation 2-6 inch	4020/01/03/37	Confirmed	36	LF	0	LF				1	No	1/D
1	3	First Storage Room inside Stairwell across from Classroom 323	N/A	Plaster Ceiling		NAD	50	SF	0	SF				N/A	N/A	N/A
1	3	First Storage Room inside Stairwell across from Classroom 323	N/A	Plaster Walls		NAD	200	SF	0	SF				N/A	N/A	N/A
1	3	First Storage Room inside Stairwell across from Classroom 323	N/A	Cement Floor		Non Suspect ACM	50	SF	0	SF				N/A	N/A	N/A
1	3	Storage Room behind First Storage Room inside Stairwell across from Classroom 323	N/A	Plaster Ceiling		NAD	200	SF	0	SF				N/A	N/A	N/A
1	3	Storage Room behind First Storage Room inside Stairwell across from Classroom 323	N/A	Plaster Walls		NAD	800	SF	400	SF				N/A	N/A	N/A
1	3	Storage Room behind First Storage Room inside Stairwell across from Classroom 323	N/A	Cement Floor		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A
1	3	Fire Tower adjacent Classroom 325	N/A	Plaster Ceiling		NAD	375	SF	150	SF				N/A	N/A	N/A
1	3	Fire Tower adjacent Classroom 325	N/A	Brick Wall		Non Suspect ACM	1150	SF	0	SF				N/A	N/A	N/A
1	3	Fire Tower adjacent Classroom 325	N/A	Cement Floor		Non Suspect ACM	375	SF	0	SF				N/A	N/A	N/A
1	3	Stairwell D	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	13	LF	0	LF				N/A	N/A	N/A
1	3	Stairwell D	N/A	Plaster Ceiling		NAD	375	SF	0	SF				N/A	N/A	N/A
1	3	Stairwell D	N/A	Plaster Walls		NAD	900	SF	0	SF				N/A	N/A	N/A
1	3	Stairwell D	N/A	Brick Wall		Non Suspect ACM	250	SF	0	SF				N/A	N/A	N/A
1	3	Stairwell D	N/A	Cement Floor		Non Suspect ACM	375	SF	0	SF				N/A	N/A	N/A
1	3	Hallway outside Classrooms 325-334	N/A	Plaster Ceiling		NAD	1800	SF	0	SF				N/A	N/A	N/A
1	3	Hallway outside Classrooms 325-334	N/A	Plaster Walls		NAD	3600	SF	0	SF				N/A	N/A	N/A
1	3	Hallway outside Classrooms 325-334	N/A	Marble Walls		Non Suspect ACM	1500	SF	0	SF				N/A	N/A	N/A
1	3	Hallway outside Classrooms 325-334	N/A	Cement Floor		Non Suspect ACM	1800	SF	0	SF				N/A	N/A	N/A
1	3	Hallway outside Classrooms 325-334	M	Transite Electrical Panel	4020/01/03/47	Confirmed	15	SF	0	SF				1	No	1/D
1	3	Stairwell A	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	13	LF	0	LF				N/A	N/A	N/A

4020 Overbrook HS 2015-2016 AHERA Three Year Report

School District of Philadelphia			AHERA Three-Year Reinspection 2015-2016										Reinspection Date: 10/21/2015			
Overbrook High School			Room by Room Location Log Report										Building Inspector: Bernard Brunner			
5898 Lancaster Avenue, Philadelphia, PA 19131													Certificate Number: 45397			
ULCS# 4020													Management Planner: M. Causley			
Year Built: 1926													Certificate Number: ACC-0215-8-010			
Element	Floor	On Site Room Name	System Affected	Material Description	HID#	Confirmed Assumed NAD Non Suspect ACM	Amount of Material	SF LF EA	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic / Crawl Space Ranking	Damage Potential (DP)	Newly Friable (NF)	Response Action (RA)
1	3	Stairwell A	N/A	Plaster Ceiling		NAD	375	SF	0	SF				N/A	N/A	N/A
1	3	Stairwell A	N/A	Plaster Walls		NAD	900	SF	0	SF				N/A	N/A	N/A
1	3	Stairwell A	N/A	Brick Wall		Non Suspect ACM	250	SF	0	SF				N/A	N/A	N/A
1	3	Stairwell A	N/A	Cement Floor		Non Suspect ACM	375	SF	0	SF				N/A	N/A	N/A
1	4	Classroom 400	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	6	LF	0	LF		Vacant floor		N/A	N/A	N/A
1	4	Classroom 400	N/A	Plaster Ceiling		NAD	720	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	4	Classroom 400	N/A	Plaster Walls		NAD	1300	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	4	Classroom 400	N/A	Wood Floor		Non Suspect ACM	720	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	4	Classroom 400	M	Blackboard Glue Dots	4020/01/04/AET/BB/2600	Assumed	260	SF	0	SF		Vacant floor		1	No	1/D
1	4	Classroom 401	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	6	LF	0	LF		Vacant floor		N/A	N/A	N/A
1	4	Classroom 401	N/A	Plaster Ceiling		NAD	720	SF	120	SF		Vacant floor, Water Damage		N/A	N/A	N/A
1	4	Classroom 401	N/A	Plaster Walls		NAD	1300	SF	50	SF		Vacant floor, Water Damage		N/A	N/A	N/A
1	4	Classroom 401	N/A	Wood Floor		Non Suspect ACM	720	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	4	Classroom 401	M	Blackboard Glue Dots	4020/01/04/AET/BB/2600	Assumed	260	SF	0	SF		Vacant floor		1	No	1/D
1	4	Classroom 402	N/A	Pipe Fitting Insulation		NAD	2	EA	0	EA		Vacant floor		N/A	N/A	N/A
1	4	Classroom 402	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	3	LF	0	LF		Vacant floor		N/A	N/A	N/A
1	4	Classroom 402	N/A	Plaster Ceiling		NAD	744	SF	5	SF		Vacant floor		N/A	N/A	N/A
1	4	Classroom 402	N/A	Plaster Walls		NAD	1320	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	4	Classroom 402	N/A	Wood Floor		Non Suspect ACM	744	SF	5	SF		Vacant floor		N/A	N/A	N/A
1	4	Classroom 402	M	Blackboard Glue Dots	4020/01/04/AET/BB/2600	Assumed	220	SF	0	SF		Vacant floor		1	No	1/D
1	4	Classroom 403	N/A	Fiberglass Ceiling Tile 2' x 4'		Non Suspect ACM	400	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	4	Classroom 403	N/A	Plaster Ceiling		NAD	400	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	4	Classroom 403	N/A	Plaster Walls		NAD	480	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	4	Classroom 403	N/A	Sheetrock Wall		NAD	480	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	4	Classroom 403	M	Floor Tile VAT 12" x 12"	4020/01/04/TT	Assumed	400	SF	2	SF	Brown	Vacant floor		1	No	6/C
1	4	Classroom 403	N/A	Wood Floor		Non Suspect ACM	400	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	4	Classroom 403	M	Blackboard Glue Dots	4020/01/04/AET/BB/2600	Assumed	30	SF	0	SF		Vacant floor		1	No	1/D
1	4	Office 404	N/A	Pipe Fitting Insulation		NAD	2	EA	0	EA		Vacant floor		N/A	N/A	N/A
1	4	Office 404	T	Pipe Insulation 2-6 inch	4020/01/04/51	Confirmed	4	LF	0	LF		Vacant floor, aircell visible above ceiling tile around 1 pipe penetration		1	No	1/D
1	4	Office 404	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	15	LF	0	LF		Vacant floor		N/A	N/A	N/A
1	4	Office 404	N/A	Ceiling Tile 2' x 4'		NAD	805	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	4	Office 404	N/A	Plaster Ceiling		NAD	805	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	4	Office 404	N/A	Plaster Walls		NAD	725	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	4	Office 404	N/A	Sheetrock Wall		NAD	1260	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	4	Office 404	M	Floor Tile VAT 12" x 12"	4020/01/04/TT	Assumed	805	SF	7	SF	Brown	Vacant floor		1	No	6/C
1	4	Office 404	N/A	Wood Floor		Non Suspect ACM	805	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	4	Office 404	M	Blackboard Glue Dots	4020/01/04/AET/BB/2600	Assumed	70	SF	0	SF		Vacant floor		1	No	1/D
1	4	Small Office inside Office 404	T	Pipe Insulation 2-6 inch	4020/01/04/51	Confirmed	12	LF	0	LF		Vacant floor, more likely above ceiling tile		1	No	1/D
1	4	Small Office inside Office 404	N/A	Ceiling Tile 2' x 4'		NAD	200	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	4	Small Office inside Office 404	N/A	Plaster Ceiling		NAD	200	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	4	Small Office inside Office 404	N/A	Plaster Walls		NAD	360	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	4	Small Office inside Office 404	N/A	Sheetrock Wall		NAD	360	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	4	Small Office inside Office 404	M	Floor Tile VAT 12" x 12"	4020/01/04/TT	Assumed	200	SF	0	SF	Brown	Vacant floor		1	No	1/D
1	4	Small Office inside Office 404	N/A	Wood Floor		Non Suspect ACM	200	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	4	Mechanical Room inside Office 404	N/A	Pipe Fitting Insulation		NAD	14	EA	0	EA		Vacant floor		N/A	N/A	N/A
1	4	Mechanical Room inside Office 404	T	Pipe Insulation 2-6 inch	4020/01/04/51	Confirmed	17	LF	0	LF		Vacant floor		1	No	1/D
1	4	Mechanical Room inside Office 404	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	140	LF	0	LF		Vacant floor		N/A	N/A	N/A
1	4	Mechanical Room inside Office 404	N/A	Ceiling Tile 2' x 4'		NAD	435	SF	24	SF		Vacant floor		N/A	N/A	N/A
1	4	Mechanical Room inside Office 404	N/A	Plaster Ceiling		NAD	435	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	4	Mechanical Room inside Office 404	N/A	Plaster Walls		NAD	520	SF	25	SF		Vacant floor		N/A	N/A	N/A
1	4	Mechanical Room inside Office 404	N/A	Sheetrock Wall		NAD	520	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	4	Mechanical Room inside Office 404	M	Floor Tile VAT 12" x 12"	4020/01/04/TT	Assumed	435	SF	2	SF	Brown	Vacant floor		1	No	6/C
1	4	Mechanical Room inside Office 404	N/A	Wood Floor		Non Suspect ACM	435	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	4	Classroom 405	N/A	Pipe Fitting Insulation		NAD	7	EA	0	EA		Vacant floor		N/A	N/A	N/A
1	4	Classroom 405	T	Pipe Insulation 2-6 inch	4020/01/04/51	Confirmed	12	LF	0	LF		Vacant floor		1	No	1/D
1	4	Classroom 405	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	41	LF	1	LF		Vacant floor		N/A	N/A	N/A
1	4	Classroom 405	N/A	Plaster Ceiling		NAD	1080	SF	50	SF		Vacant floor		N/A	N/A	N/A
1	4	Classroom 405	N/A	Plaster Walls		NAD	1660	SF	20	SF		Vacant floor		N/A	N/A	N/A
1	4	Classroom 405	M	Transite Closet	4020/01/04/AET/BB/2360	Assumed	30	SF	0	SF		Vacant floor, Wall Panel by Sink		1	No	1/D
1	4	Classroom 405	M	Transite Table Top	4020/01/04/AET/BB/2330	Assumed	33	SF	0	SF		Vacant floor, Lab Table Tops		1	No	1/D
1	4	Classroom 405	N/A	Cement Floor		Non Suspect ACM	1080	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	4	Classroom 405	M	Linoleum	4020/01/04/57	Assumed	1080	SF	0	SF		Vacant floor		1	No	1/D
1	4	Pipe Shaft outside Classroom 405	T	Pipe Insulation 2-6 inch	4020/01/04/51	Confirmed	12	LF	0	LF		Vacant floor		1	No	1/D
1	4	Classroom 406	N/A	Plaster Ceiling		NAD	1056	SF	2	SF		Vacant floor		N/A	N/A	N/A
1	4	Classroom 406	N/A	Plaster Walls		NAD	1635	SF	15	SF		Vacant floor		N/A	N/A	N/A
1	4	Classroom 406	N/A	Wood Floor		Non Suspect ACM	1056	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	4	Classroom 406	M	Blackboard Glue Dots	4020/01/04/AET/BB/2600	Assumed	155	SF	0	SF		Vacant floor		1	No	1/D
1	4	Men's Restroom Lounge Area	N/A	Pipe Fitting Insulation		NAD	2	LF	0	LF		Vacant floor		N/A	N/A	N/A
1	4	Men's Restroom Lounge Area	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	12	LF	0	LF		Vacant floor		N/A	N/A	N/A
1	4	Men's Restroom Lounge Area	N/A	Ceiling Tile 2' x 4'		NAD	260	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	4	Men's Restroom Lounge Area	N/A	Plaster Ceiling		NAD	260	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	4	Men's Restroom Lounge Area	N/A	Plaster Walls		NAD	900	SF	1	SF		Vacant floor		N/A	N/A	N/A
1	4	Men's Restroom Lounge Area	M	Floor Tile VAT 12" x 12"	4020/01/04/TT	Assumed	260	SF	0	SF	Green	Vacant floor		1	No	1/D
1	4	Men's Restroom Lounge Area	N/A	Wood Floor		Non Suspect ACM	260	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	4	Toilets Area in Men's Restroom	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	24	LF	0	LF		Vacant floor		N/A	N/A	N/A
1	4	Toilets Area in Men's Restroom	N/A	Plaster Ceiling		NAD	55	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	4	Toilets Area in Men's Restroom	N/A	Plaster Walls		NAD	360	SF	10	SF		Vacant floor		N/A	N/A	N/A

4020 Overbrook HS 2015-2016 AHERA Three Year Report

School District of Philadelphia Overbrook High School 5898 Lancaster Avenue, Philadelphia, PA 19131 ULCS# 4020 Year Built: 1926			AHERA Three-Year Reinspection 2015-2016 Room by Room Location Log Report										Reinspection Date: 10/21/2015 Building Inspector: Bernard Brunner Certificate Number: 45397 Management Planner: M. Causley Certificate Number: ACC-0215-8-010											
Element	Floor	On Site Room Name	System Affected	Material Description	HID#	Confirmed	Assumed	NAD	Non Suspect ACM	Amount of Material	SF	LF	EA	Amount of Damage	SF	LF	EA	Color required for VAT		Comments/Description/Notes	Attic / Crawl Space Ranking	Damage Potential (DP)	Newly Friable (NF)	Response Action (RA)
1	4	Toilets Area in Men's Restroom	N/A	Cement Floor					Non Suspect ACM	55	SF			0	SF					Vacant floor		N/A	N/A	N/A
1	4	Classroom 407	T	Pipe Insulation 2-6 inch	4020/01/04/51				Confirmed	12	LF			0	LF					Vacant floor		1	No	1/D
1	4	Classroom 407	N/A	Fiberglass Pipe Insulation					Non Suspect ACM	12	LF			0	LF					Vacant floor		N/A	N/A	N/A
1	4	Classroom 407	N/A	Plaster Ceiling					NAD	1222	SF			15	SF					Vacant floor		N/A	N/A	N/A
1	4	Classroom 407	N/A	Plaster Walls					NAD	1750	SF			50	SF					Vacant floor		N/A	N/A	N/A
1	4	Classroom 407	N/A	Wood Floor					Non Suspect ACM	1222	SF			0	SF					Vacant floor		N/A	N/A	N/A
1	4	Classroom 407	M	Blackboard Glue Dots	4020/01/04/AET/BB/2600				Assumed	50	SF			0	SF					Vacant floor		1	No	1/D
1	4	Door between Elevator and Office 408	N/A	Plaster Ceiling					NAD	90	SF			0	SF					Vacant floor		N/A	N/A	N/A
1	4	Door between Elevator and Office 408	N/A	Plaster Walls					NAD	500	SF			0	SF					Vacant floor		N/A	N/A	N/A
1	4	Door between Elevator and Office 408	N/A	Wood Floor					Non Suspect ACM	90	SF			0	SF					Vacant floor		N/A	N/A	N/A
1	4	Photographic Dark Room inside Door between Elevator and Office 408	N/A	Plaster Ceiling					NAD	45	SF			0	SF					Vacant floor		N/A	N/A	N/A
1	4	Photographic Dark Room inside Door between Elevator and Office 408	N/A	Plaster Walls					NAD	280	SF			40	SF					Vacant floor		N/A	N/A	N/A
1	4	Photographic Dark Room inside Door between Elevator and Office 408	N/A	Wood Floor					Non Suspect ACM	45	SF			0	SF					Vacant floor		N/A	N/A	N/A
1	4	Storage Room to Right inside Door between Elevator and Office 408	T	Pipe Insulation 2-6 inch	4020/01/04/51				Confirmed	6	LF			0	LF					Vacant floor		1	No	1/D
1	4	Storage Room to Right inside Door between Elevator and Office 408	N/A	Plaster Ceiling					NAD	120	SF			10	SF					Vacant floor		N/A	N/A	N/A
1	4	Storage Room to Right inside Door between Elevator and Office 408	N/A	Plaster Walls					NAD	555	SF			10	SF					Vacant floor		N/A	N/A	N/A
1	4	Storage Room to Right inside Door between Elevator and Office 408	M	Transite Fume Hood	4020/01/04/AET/BB/2370				Assumed	9	SF			0	SF					Vacant floor. Part of a Disconnected Fume hood		1	No	1/D
1	4	Storage Room to Right inside Door between Elevator and Office 408	N/A	Wood Floor					Non Suspect ACM	120	SF			0	SF					Vacant floor		N/A	N/A	N/A
1	4	Storage Room to Right inside Door between Elevator and Office 408	M	Vibration Damper Cloth	4020/01/04/AET/BB/2601				Assumed	4	SF			0	SF					Vacant floor		1	No	1/D
1	4	Storage Room to Right inside Door between Elevator and Office 408	M	Kiln	4020/01/04/AET/BB/1650				Assumed	90	SF			0	SF					Vacant floor. Uncertain what these machines are - possibly kilns or autoclaves. Suspect insulation inside each machine.		1	No	1/D
1	4	Office 408	N/A	Fiberglass Ceiling Tile 2' x 4'					Non Suspect ACM	225	SF			0	SF					Vacant floor		N/A	N/A	N/A
1	4	Office 408	N/A	Plaster Ceiling					NAD	225	SF			0	SF					Vacant floor		N/A	N/A	N/A
1	4	Office 408	N/A	Plaster Walls					NAD	560	SF			15	SF					Vacant floor		N/A	N/A	N/A
1	4	Office 408	N/A	Brick Wall					Non Suspect ACM	260	SF			0	SF					Vacant floor		N/A	N/A	N/A
1	4	Office 408	N/A	Cement Floor					Non Suspect ACM	225	SF			0	SF					Vacant floor		N/A	N/A	N/A
1	4	Office 408	M	Blackboard Glue Dots	4020/01/04/AET/BB/2600				Assumed	60	SF			0	SF					Vacant floor		1	No	1/D
1	4	Office 408	M	Linoleum	4020/01/04/57				Assumed	225	SF			0	SF					Vacant floor		1	No	1/D
1	4	Classroom 409	N/A	Fiberglass Pipe Insulation					Non Suspect ACM	30	LF			9	LF					Vacant floor		N/A	N/A	N/A
1	4	Classroom 409	N/A	Plaster Ceiling					NAD	1224	SF			5	SF					Vacant floor		N/A	N/A	N/A
1	4	Classroom 409	N/A	Plaster Walls					NAD	1800	SF			10	SF					Vacant floor		N/A	N/A	N/A
1	4	Classroom 409	N/A	Wood Floor					Non Suspect ACM	1224	SF			0	SF					Vacant floor		N/A	N/A	N/A
1	4	Classroom 409	M	Blackboard Glue Dots	4020/01/04/AET/BB/2600				Assumed	200	SF			0	SF					Vacant floor		1	No	1/D
1	4	Classroom 410	N/A	Fiberglass Pipe Insulation					Non Suspect ACM	6	LF			0	LF					Vacant floor		N/A	N/A	N/A
1	4	Classroom 410	N/A	Plaster Ceiling					NAD	600	SF			0	SF					Vacant floor		N/A	N/A	N/A
1	4	Classroom 410	N/A	Plaster Walls					NAD	890	SF			25	SF					Vacant floor		N/A	N/A	N/A
1	4	Classroom 410	N/A	Brick Wall					Non Suspect ACM	290	SF			0	SF					Vacant floor		N/A	N/A	N/A
1	4	Classroom 410	N/A	Cement Floor					Non Suspect ACM	600	SF			0	SF					Vacant floor		N/A	N/A	N/A
1	4	Classroom 410	M	Linoleum	4020/01/04/57				Assumed	600	SF			3	SF					Vacant floor		1	No	6/C
1	4	Office 411 Business Vocational Education Office	T	Pipe Insulation 2-6 inch	4020/01/04/51				Confirmed	6	LF			0	LF					Vacant floor		1	No	1/D
1	4	Office 411 Business Vocational Education Office	N/A	Plaster Ceiling					NAD	336	SF			0	SF					Vacant floor		N/A	N/A	N/A
1	4	Office 411 Business Vocational Education Office	N/A	Plaster Walls					NAD	915	SF			20	SF					Vacant floor		N/A	N/A	N/A
1	4	Office 411 Business Vocational Education Office	N/A	Wood Floor					Non Suspect ACM	336	SF			0	SF					Vacant floor		N/A	N/A	N/A
1	4	Office 411 Business Vocational Education Office Storage Room	T	Pipe Insulation 2-6 inch	4020/01/04/51				Confirmed	6	LF			0	LF					Vacant floor. Due to stored materials cannot determine if the 2nd riser has any insulation		1	No	1/D
1	4	Office 411 Business Vocational Education Office Storage Room	N/A	Plaster Ceiling					NAD	300	SF			0	SF					Vacant floor		N/A	N/A	N/A
1	4	Office 411 Business Vocational Education Office Storage Room	N/A	Plaster Walls					NAD	840	SF			0	SF					Vacant floor		N/A	N/A	N/A
1	4	Office 411 Business Vocational Education Office Storage Room	N/A	Wood Floor					Non Suspect ACM	300	SF			0	SF					Vacant floor		N/A	N/A	N/A
1	4	Classroom 412	T	Pipe Insulation 2-6 inch	4020/01/04/51				Confirmed	6	LF			0	LF					Vacant floor		1	No	1/D
1	4	Classroom 412	N/A	Plaster Ceiling					NAD	624	SF			0	SF					Vacant floor		N/A	N/A	N/A
1	4	Classroom 412	N/A	Plaster Walls					NAD	900	SF			15	SF					Vacant floor		N/A	N/A	N/A
1	4	Classroom 412	N/A	Brick Wall					Non Suspect ACM	300	SF			0	SF					Vacant floor		N/A	N/A	N/A
1	4	Classroom 412	N/A	Cement Floor					Non Suspect ACM	624	SF			0	SF					Vacant floor		N/A	N/A	N/A
1	4	Classroom 412	M	Blackboard Glue Dots	4020/01/04/AET/BB/2600				Assumed	220	SF			0	SF					Vacant floor		1	No	1/D
1	4	Classroom 412	M	Linoleum	4020/01/04/57				Assumed	624	SF			3	SF					Vacant floor		1	No	6/C
1	4	Office 413	T	Pipe Insulation 2-6 inch	4020/01/04/51				Confirmed	6	LF			0	LF					Vacant floor		1	No	1/D
1	4	Office 413	N/A	Fiberglass Ceiling Tile 2' x 4'					Non Suspect ACM	225	SF			0	SF					Vacant floor		N/A	N/A	N/A
1	4	Office 413	N/A	Plaster Ceiling					NAD	225	SF			0	SF					Vacant floor		N/A	N/A	N/A
1	4	Office 413	N/A	Plaster Walls					NAD	560	SF			0	SF					Vacant floor		N/A	N/A	N/A
1	4	Office 413	N/A	Brick Wall					Non Suspect ACM	260	SF			0	SF					Vacant floor		N/A	N/A	N/A
1	4	Office 413	M	Floor Tile VAT 9" x 9"	4020/01/04/56				Confirmed	225	SF			0	SF			Green		Vacant floor		1	No	1/D
1	4	Office 413	N/A	Cement Floor					Non Suspect ACM	225	SF			0	SF					Vacant floor		N/A	N/A	N/A
1	4	Office 413	M	Blackboard Glue Dots	4020/01/04/AET/BB/2600				Assumed	60	SF			0	SF					Vacant floor		1	No	1/D
1	4	Office 413 Pipe Chase	N/A	Pipe Fitting Insulation					NAD	3	EA			0	EA					Vacant floor. There is also an access panel to this pipe chase inside the 4th Floor Boy's Restroom		N/A	N/A	N/A
1	4	Office 413 Pipe Chase	N/A	Fiberglass Pipe Insulation					Non Suspect ACM	50	LF			0	LF					Vacant floor. There is also an access panel to this pipe chase inside the 4th Floor Boy's Restroom		N/A	N/A	N/A
1	4	Bo's Restroom, Labeled Men's Restroom	T	Pipe Insulation 2-6 inch	4020/01/04/51				Confirmed	14	LF			0	LF					Vacant floor		1	No	1/D

4020 Overbrook HS 2015-2016 AHERA Three Year Report

School District of Philadelphia		AHERA Three-Year Reinspection 2015-2016 Room by Room Location Log Report										Reinspection Date: 10/21/2015 Building Inspector: Bernard Brunner Certificate Number: 45397 Management Planner: M. Causley Certificate Number: ACC-0215-8-010				Attic / Crawl Space Ranking	Damage Potential (DP)	Newly Friable (NF)	Response Action (RA)
Overbrook High School 5898 Lancaster Avenue, Philadelphia, PA 19131 ULCS# 4020 Year Built: 1926		System Affected	Material Description	HID#	Confirmed Assumed NAD Non Suspect ACM	Amount of Material	SF LF EA	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes								
E l e m e n t	F l o o r	On Site Room Name																	
1	4	Boy's Restroom, Labeled Men's Restroom	N/A	Fiberglass Pipe Insulation	Non Suspect ACM	5	SF	0	SF		Vacant floor						N/A	N/A	N/A
1	4	Boy's Restroom, Labeled Men's Restroom	N/A	Plaster Ceiling	NAD	355	SF	0	SF		Vacant floor						N/A	N/A	N/A
1	4	Boy's Restroom, Labeled Men's Restroom	N/A	Plaster Walls	NAD	1065	SF	0	SF		Vacant floor						N/A	N/A	N/A
1	4	Boy's Restroom, Labeled Men's Restroom	N/A	Marble Walls	Non Suspect ACM	135	SF	0	SF		Vacant floor						N/A	N/A	N/A
1	4	Boy's Restroom, Labeled Men's Restroom	N/A	Cement Floor	Non Suspect ACM	355	SF	0	SF		Vacant floor						N/A	N/A	N/A
1	4	Boy's Restroom, Labeled Men's Restroom	M	Linoleum	Assumed	355	SF	25	SF		Vacant floor, Painted over						1	No	6/C
1	4	Custodial Closet adjacent to Boy's Restroom	N/A	Pipe Fitting Insulation	NAD	3	EA	0	EA		Vacant floor						N/A	N/A	N/A
1	4	Custodial Closet adjacent to Boy's Restroom	N/A	Fiberglass Pipe Insulation	Non Suspect ACM	40	LF	1	LF		Vacant floor						N/A	N/A	N/A
1	4	Stairwell C Pipe Chase at 4th Floor	N/A	Pipe Fitting Insulation	NAD	6	EA	1	EA		Vacant floor						N/A	N/A	N/A
1	4	Stairwell C Pipe Chase at 4th Floor	N/A	Fiberglass Pipe Insulation	Non Suspect ACM	50	LF	1	LF		Vacant floor						N/A	N/A	N/A
1	4	Classroom 414	T	Pipe Insulation 2-6 inch	Confirmed	11	LF	0	LF		Vacant floor						1	No	1/D
1	4	Classroom 414	N/A	Plaster Ceiling	NAD	1248	SF	0	SF		Vacant floor						N/A	N/A	N/A
1	4	Classroom 414	N/A	Plaster Walls	NAD	1825	SF	5	SF		Vacant floor						N/A	N/A	N/A
1	4	Classroom 414	N/A	Wood Floor	Non Suspect ACM	1248	SF	0	SF		Vacant floor						N/A	N/A	N/A
1	4	Classroom 414	M	Blackboard Glue Dots	Assumed	155	SF	0	SF		Vacant floor						1	No	1/D
1	4	Classroom 414 Dark Room	N/A	Plaster Ceiling	NAD	230	SF	5	SF		Vacant floor						N/A	N/A	N/A
1	4	Classroom 414 Dark Room	N/A	Plaster Walls	NAD	750	SF	0	SF		Vacant floor						N/A	N/A	N/A
1	4	Classroom 414 Dark Room	M	Floor Tile VAT 9" x 9"	Confirmed	130	SF	0	SF		Tan	Vacant floor					1	No	1/D
1	4	Classroom 414 Dark Room	N/A	Wood Floor	Non Suspect ACM	230	SF	0	SF		Vacant floor						N/A	N/A	N/A
1	4	Classroom 415	N/A	Fiberglass Pipe Insulation	Non Suspect ACM	12	LF	0	LF		Vacant floor						N/A	N/A	N/A
1	4	Classroom 415	N/A	Ceiling Tile 2' x 4'	NAD	1145	SF	16	SF		Vacant floor						N/A	N/A	N/A
1	4	Classroom 415	N/A	Plaster Ceiling	NAD	1145	SF	0	SF		Vacant floor						N/A	N/A	N/A
1	4	Classroom 415	N/A	Plaster Walls	NAD	1680	SF	0	SF		Vacant floor						N/A	N/A	N/A
1	4	Classroom 415	M	Floor Tile VAT 12" x 12"	Assumed	1145	SF	20	SF		Tan	Vacant floor					1	No	6/C
1	4	Classroom 415	N/A	Wood Floor	Non Suspect ACM	1145	SF	0	SF		Vacant floor						N/A	N/A	N/A
1	4	Classroom 415	M	Blackboard Glue Dots	Assumed	25	SF	0	SF		Vacant floor						1	No	1/D
1	4	Classroom 416	N/A	Fiberglass Pipe Insulation	Non Suspect ACM	6	LF	0	LF		Vacant floor						N/A	N/A	N/A
1	4	Classroom 416	N/A	Plaster Ceiling	NAD	672	SF	0	SF		Vacant floor						N/A	N/A	N/A
1	4	Classroom 416	N/A	Plaster Walls	NAD	1250	SF	0	SF		Vacant floor						N/A	N/A	N/A
1	4	Classroom 416	N/A	Wood Floor	Non Suspect ACM	672	SF	0	SF		Vacant floor						N/A	N/A	N/A
1	4	Classroom 416	M	Blackboard Glue Dots	Assumed	70	SF	0	SF		Vacant floor						1	No	1/D
1	4	Classroom 417	N/A	Plaster Ceiling	NAD	720	SF	0	SF		Vacant floor						N/A	N/A	N/A
1	4	Classroom 417	N/A	Plaster Walls	NAD	1300	SF	0	SF		Vacant floor						N/A	N/A	N/A
1	4	Classroom 417	N/A	Wood Floor	Non Suspect ACM	720	SF	0	SF		Vacant floor						N/A	N/A	N/A
1	4	Classroom 417	M	Blackboard Glue Dots	Assumed	305	SF	0	SF		Vacant floor						1	No	1/D
1	4	Classroom 418	N/A	Fiberglass Pipe Insulation	Non Suspect ACM	16	LF	0	LF		Vacant floor						N/A	N/A	N/A
1	4	Classroom 418	N/A	Plaster Ceiling	NAD	912	SF	2	SF		Vacant floor						N/A	N/A	N/A
1	4	Classroom 418	N/A	Plaster Walls	NAD	1490	SF	15	SF		Vacant floor						N/A	N/A	N/A
1	4	Classroom 418	N/A	Wood Floor	Non Suspect ACM	912	SF	0	SF		Vacant floor						N/A	N/A	N/A
1	4	Classroom 418	M	Blackboard Glue Dots	Assumed	170	SF	0	SF		Vacant floor						1	No	1/D
1	4	Classroom 419	T	Pipe Insulation 2-6 inch	Confirmed	12	LF	0	LF		Vacant floor						1	No	1/D
1	4	Classroom 419	N/A	Fiberglass Pipe Insulation	Non Suspect ACM	24	LF	0	LF		Vacant floor						N/A	N/A	N/A
1	4	Classroom 419	N/A	Plaster Ceiling	NAD	864	SF	180	SF		Vacant floor						N/A	N/A	N/A
1	4	Classroom 419	N/A	Plaster Walls	NAD	1440	SF	0	SF		Vacant floor						N/A	N/A	N/A
1	4	Classroom 419	N/A	Wood Floor	Non Suspect ACM	864	SF	2	SF		Vacant floor						N/A	N/A	N/A
1	4	Classroom 419	M	Blackboard Glue Dots	Assumed	110	SF	0	SF		Vacant floor						1	No	1/D
1	4	Pipe Shaft in Hallway outside Classroom 419	T	Pipe Insulation 2-6 inch	Confirmed	15	LF	0	LF		Vacant floor						1	No	1/D
1	4	Pipe Shaft in Hallway outside Classroom 419	T	Pipe Insulation > 6 inch	Confirmed	15	LF	2	LF		Vacant floor DDC written up						1	Yes	2/B
1	4	Pipe Shaft in Hallway outside Classroom 419	N/A	Fiberglass Pipe Insulation	Non Suspect ACM	30	LF	5	LF		Vacant floor						N/A	N/A	N/A
1	4	Classroom 420	T	Pipe Insulation 2-6 inch	Confirmed	12	LF	0	LF		Vacant floor						1	No	1/D
1	4	Classroom 420	N/A	Plaster Ceiling	NAD	792	SF	0	SF		Vacant floor						N/A	N/A	N/A
1	4	Classroom 420	N/A	Plaster Walls	NAD	1370	SF	2	SF		Vacant floor						N/A	N/A	N/A
1	4	Classroom 420	N/A	Wood Floor	Non Suspect ACM	792	SF	0	SF		Vacant floor						N/A	N/A	N/A
1	4	Classroom 420	M	Blackboard Glue Dots	Assumed	165	SF	0	SF		Vacant floor						1	No	1/D
1	4	Classroom 421	N/A	Fiberglass Pipe Insulation	Non Suspect ACM	6	LF	0	LF		Vacant floor						N/A	N/A	N/A
1	4	Classroom 421	N/A	Plaster Ceiling	NAD	792	SF	5	SF		Vacant floor						N/A	N/A	N/A
1	4	Classroom 421	N/A	Plaster Walls	NAD	1370	SF	2	SF		Vacant floor						N/A	N/A	N/A
1	4	Classroom 421	N/A	Wood Floor	Non Suspect ACM	792	SF	0	SF		Vacant floor						N/A	N/A	N/A
1	4	Classroom 421	M	Blackboard Glue Dots	Assumed	210	SF	0	SF		Vacant floor						1	No	1/D
1	4	Classroom 422	N/A	Fiberglass Pipe Insulation	Non Suspect ACM	12	LF	0	LF		Vacant floor						N/A	N/A	N/A
1	4	Classroom 422	N/A	Plaster Ceiling	NAD	1056	SF	0	SF		Vacant floor						N/A	N/A	N/A
1	4	Classroom 422	N/A	Plaster Walls	NAD	1635	SF	10	SF		Vacant floor						N/A	N/A	N/A
1	4	Classroom 422	N/A	Wood Floor	Non Suspect ACM	1056	SF	0	SF		Vacant floor						N/A	N/A	N/A
1	4	Classroom 422	M	Blackboard Glue Dots	Assumed	195	SF	0	SF		Vacant floor						1	No	1/D
1	4	Office 423	T	Pipe Insulation 2-6 inch	Confirmed	6	LF	0	LF		Vacant floor						1	No	1/D
1	4	Office 423	N/A	Fiberglass Pipe Insulation	Non Suspect ACM	11	LF	1	LF		Vacant floor						N/A	N/A	N/A
1	4	Office 423	N/A	Plaster Ceiling	NAD	210	SF	0	SF		Vacant floor						N/A	N/A	N/A
1	4	Office 423	N/A	Plaster Walls	NAD	615	SF	0	SF		Vacant floor						N/A	N/A	N/A
1	4	Office 423	M	Floor Tile VAT 12" x 12"	Assumed	210	SF	0	SF		Tan	Vacant floor					1	No	1/D
1	4	Office 423	N/A	Wood Floor	Non Suspect ACM	210	SF	0	SF		Vacant floor						N/A	N/A	N/A
1	4	Office 423 Left Closet	N/A	Plaster Ceiling	NAD	15	SF	0	SF		Vacant floor						N/A	N/A	N/A
1	4	Office 423 Left Closet	N/A	Plaster Walls	NAD	120	SF	0	SF		Vacant floor						N/A	N/A	N/A
1	4	Office 423 Left Closet	M	Floor Tile VAT 12" x 12"	Assumed	15	SF	0	SF		Tan	Vacant floor					1	No	1/D
1	4	Office 423 Left Closet	N/A	Wood Floor	Non Suspect ACM	15	SF	0	SF		Vacant floor						N/A	N/A	N/A
1	4	Office 423 Right Closet	N/A	Plaster Ceiling	NAD	15	SF	0	SF		Vacant floor						N/A	N/A	N/A
1	4	Office 423 Right Closet	N/A	Plaster Walls	NAD	120	SF	0	SF		Vacant floor						N/A	N/A	N/A
1	4	Office 423 Right Closet	M	Floor Tile VAT 12" x 12"	Assumed	15	SF	0	SF		Tan	Vacant floor					1	No	1/D

4020 Overbrook HS 2015-2016 AHERA Three Year Report

School District of Philadelphia Overbrook High School 5898 Lancaster Avenue, Philadelphia, PA 19131 ULCS# 4020 Year Built: 1926		AHERA Three-Year Reinspection 2015-2016 Room by Room Location Log Report										Reinspection Date: 10/21/2015 Building Inspector: Bernard Brunner Certificate Number: 45397 Management Planner: M. Causley Certificate Number: ACC-0215-8-010				Attic / Crawl Space Ranking	Damage Potential (DP)	Newly Friable (NF)	Response Action (RA)
Element	Room	On Site Room Name	System Affected	Material Description	HID#	Confirmed Assumed NAD Non Suspect ACM	Amount of Material	SF LF EA	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes							
1	4	Office 423 Right Closet	N/A	Wood Floor		Non Suspect ACM	15	SF	0	SF		Vacant floor				N/A	N/A	N/A	N/A
1	4	Office 423 Hallway	N/A	Plaster Ceiling		NAD	60	SF	0	SF		Vacant floor				N/A	N/A	N/A	N/A
1	4	Office 423 Hallway	N/A	Plaster Walls		NAD	315	SF	0	SF		Vacant floor				N/A	N/A	N/A	N/A
1	4	Office 423 Hallway	M	Floor Tile VAT 12" x 12"	4020/01/04/TT	Assumed	60	SF	0	SF	Tan	Vacant floor				1	No	1/D	
1	4	Office 423 Hallway	N/A	Wood Floor		Non Suspect ACM	60	SF	0	SF		Vacant floor				N/A	N/A	N/A	N/A
1	4	Girl's Restroom	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	40	LF	0	LF		Vacant floor				N/A	N/A	N/A	N/A
1	4	Girl's Restroom	N/A	Plaster Ceiling		NAD	355	SF	0	SF		Vacant floor				N/A	N/A	N/A	N/A
1	4	Girl's Restroom	N/A	Plaster Walls		NAD	1065	SF	0	SF		Vacant floor				N/A	N/A	N/A	N/A
1	4	Girl's Restroom	N/A	Marble Walls		Non Suspect ACM	135	SF	0	SF		Vacant floor, On wall behind toilets. Material is heavily painted. Based on observations of similar material on other floors the material is marble.				N/A	N/A	N/A	N/A
1	4	Girl's Restroom	N/A	Cement Floor		Non Suspect ACM	355	SF	0	SF		Vacant floor				N/A	N/A	N/A	N/A
1	4	Girl's Restroom	M	Linoleum	4020/01/04/57	Assumed	355	SF	15	SF		Vacant floor				1	No	6/C	
1	4	Custodial Closet adjacent to Girl's Restroom	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	36	LF	0	LF		Vacant floor				N/A	N/A	N/A	N/A
1	4	Stairwell D Pipe Chase at 4th Floor	N/A	Pipe Fitting Insulation		NAD	3	EA	0	EA		Vacant floor				N/A	N/A	N/A	N/A
1	4	Stairwell D Pipe Chase at 4th Floor	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	30	LF	0	LF		Vacant floor				N/A	N/A	N/A	N/A
1	4	Office 424	N/A	Fiberglass Ceiling Tile 2' x 4'		Non Suspect ACM	225	SF	0	SF		Vacant floor				N/A	N/A	N/A	N/A
1	4	Office 424	N/A	Plaster Ceiling		NAD	225	SF	0	SF		Vacant floor				N/A	N/A	N/A	N/A
1	4	Office 424	N/A	Plaster Walls		NAD	560	SF	5	SF		Vacant floor				N/A	N/A	N/A	N/A
1	4	Office 424	N/A	Brick Wall		Non Suspect ACM	260	SF	0	SF		Vacant floor				N/A	N/A	N/A	N/A
1	4	Office 424	N/A	Cement Floor		Non Suspect ACM	225	SF	0	SF		Vacant floor				N/A	N/A	N/A	N/A
1	4	Office 424	M	Blackboard Glue Dots	4020/01/04/AET/BB/2600	Assumed	60	SF	0	SF		Vacant floor				1	No	1/D	
1	4	Office 424	M	Linoleum	4020/01/04/57	Assumed	225	SF	15	SF		Vacant floor				1	No	6/C	
1	4	Office 424 Pipe Chase	N/A	Pipe Fitting Insulation		NAD	3	EA	0	EA		Vacant floor				N/A	N/A	N/A	N/A
1	4	Office 424 Pipe Chase	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	60	LF	0	LF		Vacant floor				N/A	N/A	N/A	N/A
1	4	Classroom 425	T	Pipe Insulation 2-6 inch	4020/01/04/51	Confirmed	6	LF	0	LF		Vacant floor. Gate is padlocked. Visual inspection from door only.				1	No	1/D	
1	4	Classroom 425	N/A	Plaster Ceiling		NAD	936	SF	0	SF		Vacant floor. Gate is padlocked. Visual inspection from door only.				N/A	N/A	N/A	N/A
1	4	Classroom 425	N/A	Plaster Walls		NAD	1440	SF	0	SF		Vacant floor. Gate is padlocked. Visual inspection from door only.				N/A	N/A	N/A	N/A
1	4	Classroom 425	N/A	Wood Floor		Non Suspect ACM	936	SF	0	SF		Vacant floor. Gate is padlocked. Visual inspection from door only.				N/A	N/A	N/A	N/A
1	4	Classroom 425	M	Blackboard Glue Dots	4020/01/04/AET/BB/2600	Assumed	210	SF	0	SF		Vacant floor. Gate is padlocked. Visual inspection from door only.				1	No	1/D	
1	4	Classroom 426	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	3	LF	0	LF		Vacant floor				N/A	N/A	N/A	N/A
1	4	Classroom 426	N/A	Fiberglass Ceiling Tile 2' x 4'		Non Suspect ACM	624	SF	0	SF		Vacant floor				N/A	N/A	N/A	N/A
1	4	Classroom 426	N/A	Plaster Ceiling		NAD	624	SF	0	SF		Vacant floor				N/A	N/A	N/A	N/A
1	4	Classroom 426	N/A	Plaster Walls		NAD	900	SF	2	SF		Vacant floor				N/A	N/A	N/A	N/A
1	4	Classroom 426	N/A	Brick Wall		Non Suspect ACM	300	SF	0	SF		Vacant floor				N/A	N/A	N/A	N/A
1	4	Classroom 426	N/A	Cement Floor		Non Suspect ACM	624	SF	0	SF		Vacant floor				N/A	N/A	N/A	N/A
1	4	Classroom 426	M	Blackboard Glue Dots	4020/01/04/AET/BB/2600	Assumed	210	SF	0	SF		Vacant floor				1	No	1/D	
1	4	Classroom 426	M	Linoleum	4020/01/04/57	Assumed	624	SF	2	SF		Vacant floor				1	No	6/C	
1	4	Classroom 427	T	Pipe Insulation 2-6 inch	4020/01/04/51	Confirmed	6	LF	0	LF		Vacant floor				1	No	1/D	
1	4	Classroom 427	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	24	LF	0	LF		Vacant floor				N/A	N/A	N/A	N/A
1	4	Classroom 427	N/A	Plaster Ceiling		NAD	1056	SF	150	SF		Vacant floor				N/A	N/A	N/A	N/A
1	4	Classroom 427	N/A	Plaster Walls		NAD	1635	SF	0	SF		Vacant floor				N/A	N/A	N/A	N/A
1	4	Classroom 427	N/A	Wood Floor		Non Suspect ACM	1056	SF	0	SF		Vacant floor				N/A	N/A	N/A	N/A
1	4	Classroom 427	M	Blackboard Glue Dots	4020/01/04/AET/BB/2600	Assumed	195	SF	0	SF		Vacant floor				1	No	1/D	
1	4	Doorway Labeled 428 Right Office	N/A	Ceiling Tile 2' x 4'		NAD	300	SF	0	SF		Vacant floor				N/A	N/A	N/A	N/A
1	4	Doorway Labeled 428 Right Office	N/A	Plaster Ceiling		NAD	300	SF	0	SF		Vacant floor				N/A	N/A	N/A	N/A
1	4	Doorway Labeled 428 Right Office	N/A	Plaster Walls		NAD	435	SF	0	SF		Vacant floor				N/A	N/A	N/A	N/A
1	4	Doorway Labeled 428 Right Office	N/A	Brick Wall		Non Suspect ACM	120	SF	0	SF		Vacant floor				N/A	N/A	N/A	N/A
1	4	Doorway Labeled 428 Right Office	N/A	Sheetrock Wall		NAD	315	SF	0	SF		Vacant floor				N/A	N/A	N/A	N/A
1	4	Doorway Labeled 428 Right Office	N/A	Cement Floor		Non Suspect ACM	300	SF	0	SF		Vacant floor				N/A	N/A	N/A	N/A
1	4	Doorway Labeled 428 Right Office	M	Linoleum	4020/01/04/57	Assumed	300	SF	0	SF		Vacant floor				1	No	1/D	
1	4	Doorway Labeled 428 Left Office	X	X		X	X	X	X	X	X	Vacant floor. No Access - No Key				X	X	X	X
1	4	Office 429	N/A	Ceiling Tile 2' x 4'		NAD	225	SF	0	SF		Vacant floor				N/A	N/A	N/A	N/A
1	4	Office 429	N/A	Plaster Ceiling		NAD	225	SF	0	SF		Vacant floor				N/A	N/A	N/A	N/A
1	4	Office 429	N/A	Plaster Walls		NAD	560	SF	0	SF		Vacant floor				N/A	N/A	N/A	N/A
1	4	Office 429	N/A	Brick Wall		Non Suspect ACM	260	SF	0	SF		Vacant floor				N/A	N/A	N/A	N/A
1	4	Office 429	N/A	Cement Floor		Non Suspect ACM	225	SF	0	SF		Vacant floor				N/A	N/A	N/A	N/A
1	4	Office 429	M	Linoleum	4020/01/04/57	Assumed	225	SF	10	SF		Vacant floor				1	No	6/C	
1	4	Storage Room adjacent Office 429	X	X		X	X	X	X	X	X	Vacant floor. No Access - No Key				X	X	X	X
1	4	Classroom 430	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	18	LF	0	LF		Vacant floor				N/A	N/A	N/A	N/A
1	4	Classroom 430	N/A	Plaster Ceiling		NAD	912	SF	0	SF		Vacant floor				N/A	N/A	N/A	N/A
1	4	Classroom 430	N/A	Plaster Walls		NAD	1490	SF	0	SF		Vacant floor				N/A	N/A	N/A	N/A
1	4	Classroom 430	N/A	Wood Floor		Non Suspect ACM	912	SF	0	SF		Vacant floor				N/A	N/A	N/A	N/A
1	4	Classroom 430	M	Blackboard Glue Dots	4020/01/04/AET/BB/2600	Assumed	180	SF	0	SF		Vacant floor				1	No	1/D	
1	4	Classroom 431	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	36	LF	0	LF		Vacant floor				N/A	N/A	N/A	N/A
1	4	Classroom 431	N/A	Plaster Ceiling		NAD	1118	SF	50	SF		Vacant floor				N/A	N/A	N/A	N/A
1	4	Classroom 431	N/A	Plaster Walls		NAD	1660	SF	0	SF		Vacant floor				N/A	N/A	N/A	N/A
1	4	Classroom 431	N/A	Carpet		Non Suspect ACM	1118	SF	0	SF		Vacant floor				N/A	N/A	N/A	N/A
1	4	Classroom 431	N/A	Wood Floor		Non Suspect ACM	1118	SF	0	SF		Vacant floor				N/A	N/A	N/A	N/A
1	4	Classroom 431	M	Blackboard Glue Dots	4020/01/04/AET/BB/2600	Assumed	155	SF	0	SF		Vacant floor				1	No	1/D	
1	4	Classroom 431	T	Pipe Insulation 2-6 inch	4020/01/04/51	Confirmed	6	LF	0	LF		Vacant floor				1	No	1/D	
1	4	Women's Restroom Lounge Area	N/A	Ceiling Tile 2' x 4'		NAD	260	SF	0	SF		Vacant floor				N/A	N/A	N/A	N/A
1	4	Women's Restroom Lounge Area	N/A	Plaster Ceiling		NAD	260	SF	0	SF		Vacant floor				N/A	N/A	N/A	N/A
1	4	Women's Restroom Lounge Area	N/A	Plaster Walls		NAD	900	SF	0	SF		Vacant floor				N/A	N/A	N/A	N/A
1	4	Women's Restroom Lounge Area	N/A	Wood Floor		Non Suspect ACM	260	SF	0	SF		Vacant floor				N/A	N/A	N/A	N/A
1	4	Toilet Area in Women's Restroom	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	36	LF	0	LF		Vacant floor				N/A	N/A	N/A	N/A
1	4	Toilet Area in Women's Restroom	N/A	Plaster Ceiling		NAD	55	SF	0	SF		Vacant floor				N/A	N/A	N/A	N/A
1	4	Toilet Area in Women's Restroom	N/A	Plaster Walls		NAD	360	SF	10	SF		Vacant floor				N/A	N/A	N/A	N/A
1	4	Toilet Area in Women's Restroom	N/A	Cement Floor		Non Suspect ACM	55	SF	0	SF		Vacant floor				N/A	N/A	N/A	N/A

4020 Overbrook HS 2015-2016 AHERA Three Year Report

School District of Philadelphia Overbrook High School 5898 Lancaster Avenue, Philadelphia, PA 19131 ULCS# 4020 Year Built: 1926				AHERA Three-Year Reinspection 2015-2016 Room by Room Location Log Report										Reinspection Date: 10/21/2015 Building Inspector: Bernard Brunner Certificate Number: 45397 Management Planner: M. Causley Certificate Number: ACC-0215-8-010			
Element	Floor	On Site Room Name	System Affected	Material Description	HID#	Confirmed Assumed NAD Non Suspect ACM	Amount of Material	SF LF EA	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic / Crawl Space Ranking	Damage Potential (DP)	Newly Friable (NF)	Response Action (RA)	
1	4	Hallway Outside Classrooms 400-407	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	100	LF	10	LF		Vacant floor		N/A	N/A	N/A	
1	4	Hallway Outside Classrooms 400-407	N/A	Plaster Ceiling		NAD	3000	SF	0	SF		Vacant floor		N/A	N/A	N/A	
1	4	Hallway Outside Classrooms 400-407	N/A	Plaster Walls		NAD	6290	SF	0	SF		Vacant floor		N/A	N/A	N/A	
1	4	Hallway Outside Classrooms 400-407	N/A	Marble Walls		Non Suspect ACM	1250	SF	0	SF		Vacant floor		N/A	N/A	N/A	
1	4	Hallway Outside Classrooms 400-407	N/A	Cement Floor		Non Suspect ACM	3000	SF	0	SF		Vacant floor		N/A	N/A	N/A	
1	4	Storage Room across From Classroom 403	N/A	Plaster Ceiling		NAD	90	SF	0	SF		Vacant floor		N/A	N/A	N/A	
1	4	Storage Room across From Classroom 403	N/A	Plaster Walls		NAD	300	SF	0	SF		Vacant floor		N/A	N/A	N/A	
1	4	Storage Room across From Classroom 403	N/A	Cement Floor		Non Suspect ACM	90	SF	0	SF		Vacant floor		N/A	N/A	N/A	
1	4	Stairwell B	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	13	LF	0	LF		Vacant floor		N/A	N/A	N/A	
1	4	Stairwell B	N/A	Metal Ceiling		Non Suspect ACM	375	SF	0	SF		Vacant floor		N/A	N/A	N/A	
1	4	Stairwell B	N/A	Plaster Walls		NAD	900	SF	0	SF		Vacant floor		N/A	N/A	N/A	
1	4	Stairwell B	N/A	Brick Wall		Non Suspect ACM	250	SF	0	SF		Vacant floor		N/A	N/A	N/A	
1	4	Stairwell B	N/A	Sheetrock Wall		NAD	90	SF	0	SF		Vacant floor		N/A	N/A	N/A	
1	4	Stairwell B	N/A	Cement Floor		Non Suspect ACM	375	SF	0	SF		Vacant floor		N/A	N/A	N/A	
1	4	Hallway Outside Classrooms 409-414	N/A	Plaster Ceiling		NAD	1800	SF	0	SF		Vacant floor		N/A	N/A	N/A	
1	4	Hallway Outside Classrooms 409-414	N/A	Plaster Walls		NAD	3600	SF	0	SF		Vacant floor		N/A	N/A	N/A	
1	4	Hallway Outside Classrooms 409-414	N/A	Marble Walls		Non Suspect ACM	1500	SF	0	SF		Vacant floor		N/A	N/A	N/A	
1	4	Hallway Outside Classrooms 409-414	N/A	Cement Floor		Non Suspect ACM	1800	SF	0	SF		Vacant floor		N/A	N/A	N/A	
1	4	Hallway Outside Classrooms 409-414	M	Transite Electrical Panel	4020/01/04/AET/BB/2350	Assumed	10	SF	0	SF		Vacant floor		1	No	1/D	
1	4	Stairwell C	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	7	LF	0	LF		Vacant floor		N/A	N/A	N/A	
1	4	Stairwell C	N/A	Metal Ceiling		Non Suspect ACM	375	SF	0	SF		Vacant floor		N/A	N/A	N/A	
1	4	Stairwell C	N/A	Plaster Walls		NAD	900	SF	0	SF		Vacant floor		N/A	N/A	N/A	
1	4	Stairwell C	N/A	Brick Wall		Non Suspect ACM	250	SF	0	SF		Vacant floor		N/A	N/A	N/A	
1	4	Stairwell C	N/A	Sheetrock Wall		NAD	90	SF	0	SF		Vacant floor		N/A	N/A	N/A	
1	4	Stairwell C	N/A	Cement Floor		Non Suspect ACM	375	SF	0	SF		Vacant floor		N/A	N/A	N/A	
1	4	Fire Tower adjacent Classroom 415	N/A	Plaster Ceiling		NAD	375	SF	0	SF		Vacant floor		N/A	N/A	N/A	
1	4	Fire Tower adjacent Classroom 415	N/A	Brick Wall		Non Suspect ACM	1250	SF	0	SF		Vacant floor		N/A	N/A	N/A	
1	4	Fire Tower adjacent Classroom 415	N/A	Cement Floor		Non Suspect ACM	375	SF	0	SF		Vacant floor		N/A	N/A	N/A	
1	4	Hallway Outside Classrooms 416-419	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	57	LF	0	LF		Vacant floor		N/A	N/A	N/A	
1	4	Hallway Outside Classrooms 416-419	N/A	Plaster Ceiling		NAD	1560	SF	20	SF		Vacant floor		N/A	N/A	N/A	
1	4	Hallway Outside Classrooms 416-419	N/A	Plaster Walls		NAD	2600	SF	10	SF		Vacant floor		N/A	N/A	N/A	
1	4	Hallway Outside Classrooms 416-419	N/A	Marble Walls		Non Suspect ACM	1300	SF	0	SF		Vacant floor		N/A	N/A	N/A	
1	4	Hallway Outside Classrooms 416-419	N/A	Cement Floor		Non Suspect ACM	1560	SF	0	SF		Vacant floor		N/A	N/A	N/A	
1	4	Stairwell across From Classroom 418	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	6	LF	0	LF		Vacant floor		N/A	N/A	N/A	
1	4	Stairwell across From Classroom 418	N/A	Plaster Ceiling		NAD	480	SF	0	SF		Vacant floor		N/A	N/A	N/A	
1	4	Stairwell across From Classroom 418	N/A	Plaster Walls		NAD	1250	SF	0	SF		Vacant floor		N/A	N/A	N/A	
1	4	Stairwell across From Classroom 418	N/A	Cement Floor		Non Suspect ACM	480	SF	0	SF		Vacant floor		N/A	N/A	N/A	
1	4	Storage Room Inside Stairwell across From Classroom 418	N/A	Pipe Fitting Insulation		NAD	6	EA	0	EA		Vacant floor		N/A	N/A	N/A	
1	4	Storage Room Inside Stairwell across From Classroom 418	T	Pipe Insulation 2-6 inch	4020/01/04/51	Confirmed	13	LF	0	LF		Vacant floor		1	No	1/D	
1	4	Storage Room Inside Stairwell across From Classroom 418	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	24	LF	0	LF		Vacant floor		N/A	N/A	N/A	
1	4	Storage Room Inside Stairwell across From Classroom 418	N/A	Plaster Ceiling		NAD	265	SF	20	SF		Vacant floor		N/A	N/A	N/A	
1	4	Storage Room Inside Stairwell across From Classroom 418	N/A	Plaster Walls		NAD	265	SF	0	SF		Vacant floor		N/A	N/A	N/A	
1	4	Storage Room Inside Stairwell across From Classroom 418	N/A	Cement Floor		Non Suspect ACM	265	SF	0	SF		Vacant floor		N/A	N/A	N/A	
1	4	Stairwell across From Classroom 419	N/A	Plaster Ceiling		NAD	480	SF	0	SF		Vacant floor		N/A	N/A	N/A	
1	4	Stairwell across From Classroom 419	N/A	Plaster Walls		NAD	1250	SF	0	SF		Vacant floor		N/A	N/A	N/A	
1	4	Stairwell across From Classroom 419	N/A	Cement Floor		Non Suspect ACM	480	SF	0	SF		Vacant floor		N/A	N/A	N/A	
1	4	Hallway Outside Classrooms 419-421	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	25	LF	4	LF		Vacant floor		N/A	N/A	N/A	
1	4	Hallway Outside Classrooms 419-421	N/A	Plaster Ceiling		NAD	1560	SF	150	SF		Vacant floor		N/A	N/A	N/A	
1	4	Hallway Outside Classrooms 419-421	N/A	Plaster Walls		NAD	2600	SF	0	SF		Vacant floor		N/A	N/A	N/A	
1	4	Hallway Outside Classrooms 419-421	N/A	Marble Walls		Non Suspect ACM	1300	SF	0	SF		Vacant floor		N/A	N/A	N/A	
1	4	Hallway Outside Classrooms 419-421	N/A	Cement Floor		Non Suspect ACM	1560	SF	0	SF		Vacant floor		N/A	N/A	N/A	
1	4	Fire Tower adjacent Classroom 422	N/A	Plaster Ceiling		NAD	375	SF	0	SF		Vacant floor		N/A	N/A	N/A	
1	4	Fire Tower adjacent Classroom 422	N/A	Brick Wall		Non Suspect ACM	1250	SF	0	SF		Vacant floor		N/A	N/A	N/A	
1	4	Fire Tower adjacent Classroom 422	N/A	Cement Floor		Non Suspect ACM	375	SF	0	SF		Vacant floor		N/A	N/A	N/A	
1	4	Stairwell D	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	6	LF	0	LF		Vacant floor		N/A	N/A	N/A	
1	4	Stairwell D	N/A	Metal Ceiling		Non Suspect ACM	375	SF	0	SF		Vacant floor		N/A	N/A	N/A	
1	4	Stairwell D	N/A	Plaster Walls		NAD	900	SF	0	SF		Vacant floor		N/A	N/A	N/A	
1	4	Stairwell D	N/A	Brick Wall		Non Suspect ACM	250	SF	0	SF		Vacant floor		N/A	N/A	N/A	
1	4	Stairwell D	N/A	Cement Floor		Non Suspect ACM	375	SF	0	SF		Vacant floor		N/A	N/A	N/A	
1	4	Hallway Outside Classrooms 422-430	N/A	Plaster Ceiling		NAD	1800	SF	0	SF		Vacant floor		N/A	N/A	N/A	
1	4	Hallway Outside Classrooms 422-430	N/A	Plaster Walls		NAD	3600	SF	0	SF		Vacant floor		N/A	N/A	N/A	
1	4	Hallway Outside Classrooms 422-430	N/A	Marble Walls		Non Suspect ACM	1500	SF	0	SF		Vacant floor		N/A	N/A	N/A	
1	4	Hallway Outside Classrooms 422-430	N/A	Cement Floor		Non Suspect ACM	1800	SF	0	SF		Vacant floor		N/A	N/A	N/A	
1	4	Hallway Outside Classrooms 422-430	M	Transite Electrical Panel	4020/01/04/AET/BB/2350	Assumed	10	SF	0	SF		Vacant floor		1	No	1/D	
1	4	Stairwell A	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	8	LF	0	LF		Vacant floor		N/A	N/A	N/A	
1	4	Stairwell A	N/A	Metal Ceiling		Non Suspect ACM	375	SF	0	SF		Vacant floor		N/A	N/A	N/A	
1	4	Stairwell A	N/A	Plaster Walls		NAD	900	SF	0	SF		Vacant floor		N/A	N/A	N/A	
1	4	Stairwell A	N/A	Brick Wall		Non Suspect ACM	250	SF	0	SF		Vacant floor		N/A	N/A	N/A	
1	4	Stairwell A	N/A	Cement Floor		Non Suspect ACM	375	SF	0	SF		Vacant floor		N/A	N/A	N/A	
1	5	Classroom 500	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	3	LF	0	LF		Vacant floor		N/A	N/A	N/A	
1	5	Classroom 500	N/A	Ceiling Tile 2' x 4'		NAD	1015	SF	4	SF		Vacant floor. Water Damage		N/A	N/A	N/A	
1	5	Classroom 500	N/A	Metal Ceiling		Non Suspect ACM	1015	SF	0	SF		Vacant floor		N/A	N/A	N/A	
1	5	Classroom 500	N/A	Plaster Walls		NAD	1360	SF	10	SF		Vacant floor		N/A	N/A	N/A	
1	5	Classroom 500	N/A	Sheetrock Wall		Non Suspect ACM	1360	SF	0	SF		Vacant floor		N/A	N/A	N/A	
1	5	Classroom 500	M	Floor Tile VAT 9" x 9"	4020/01/05/63	Confirmed	1035	SF	0	SF	Tan	Vacant floor		1	No	1/D	
1	5	Classroom 500	N/A	Cement Floor		Non Suspect ACM	1035	SF	0	SF		Vacant floor		N/A	N/A	N/A	
1	5	Classroom 500	N/A	Fireproofing		NAD	1015	SF	0	SF		Vacant floor		N/A	N/A	N/A	

4020 Overbrook HS 2015-2016 AHERA Three Year Report

School District of Philadelphia			AHERA Three-Year Reinspection 2015-2016										Reinspection Date: 10/21/2015							
Overbrook High School			Room by Room Location Log Report										Building Inspector: Bernard Brunner							
5898 Lancaster Avenue, Philadelphia, PA 19131													Certificate Number: 45397							
ULCS# 4020													Management Planner: M. Causley							
Year Built: 1926													Certificate Number: ACC-0215-8-010							
Element	Room	On Site Room Name	System Affected	Material Description	HID#	Confirmed Assumed NAD Non Suspect ACM	Amount of Material	SF LF EA	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic / Crawl Space Ranking	Damage Potential (DP)	Newly Friable (NF)	Response Action (RA)				
1	5	Classroom 500	M	Blackboard Glue Dots	4020/01/05/AET/BB/2600	Assumed	185	SF	0	SF		Vacant floor		1	No	1/D				
1	5	Classroom 500	M	Sink Undercoat Mastic	4020/01/05/AET/BB/2602	Assumed	80	SF	0	SF		Vacant floor. Black		1	No	1/D				
1	5	Classroom 500	M	Kiln	4020/01/05/AET/BB/1650	Assumed	45	SF	0	SF		Vacant floor		1	No	1/D				
1	5	Classroom 500	T	Unit Ventilator Insulation	4020/01/05/64	Assumed	15	SF	0	SF		Vacant floor. Insulation is not visible but is assumed to be inside the unit.		1	No	1/D				
1	5	x	X	X		X	X	X	X	X	X	Vacant floor. No Access- no key		X	X	X				
1	5	x	X	X		X	X	X	X	X	X	Vacant floor. No Access- no key		X	X	X				
1	5	Classroom 500 Storage Room with Double Doors	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	3	LF	0	LF		Vacant floor		N/A	N/A	N/A				
1	5	Classroom 500 Storage Room with Double Doors	N/A	Ceiling Tile 2' x 4'		NAD	420	SF	0	SF		Vacant floor		N/A	N/A	N/A				
1	5	Classroom 500 Storage Room with Double Doors	N/A	Metal Ceiling		Non Suspect ACM	420	SF	0	SF		Vacant floor		N/A	N/A	N/A				
1	5	Classroom 500 Storage Room with Double Doors	N/A	Plaster Walls		NAD	790	SF	0	SF		Vacant floor		N/A	N/A	N/A				
1	5	Classroom 500 Storage Room with Double Doors	N/A	Sheetrock Wall		Non Suspect ACM	790	SF	0	SF		Vacant floor		N/A	N/A	N/A				
1	5	Classroom 500 Storage Room with Double Doors	M	Floor Tile VAT 12" x 12"	4020/01/05/UU	Assumed	440	SF	3	SF	White	Vacant floor		1	No	6/C				
1	5	Classroom 500 Storage Room with Double Doors	N/A	Cement Floor		Non Suspect ACM	440	SF	0	SF		Vacant floor		N/A	N/A	N/A				
1	5	Classroom 500 Storage Room with Double Doors	N/A	Fireproofing		NAD	420	SF	0	SF		Vacant floor		N/A	N/A	N/A				
1	5	Closet inside Storage Room with Double Doors inside Classroom 500	N/A	Ceiling Tile 2' x 4'		NAD	144	SF	16	SF		Vacant floor		N/A	N/A	N/A				
1	5	Closet inside Storage Room with Double Doors inside Classroom 500	N/A	Metal Ceiling		Non Suspect ACM	144	SF	0	SF		Vacant floor		N/A	N/A	N/A				
1	5	Closet inside Storage Room with Double Doors inside Classroom 500	N/A	Plaster Walls		NAD	520	SF	40	SF		Vacant floor		N/A	N/A	N/A				
1	5	Classroom 500, Storage Room with Double Doors, Closet	N/A	Sheetrock Wall		Non Suspect ACM	520	SF	0	SF		Vacant floor		N/A	N/A	N/A				
1	5	Closet inside Storage Room with Double Doors inside Classroom 500	M	Floor Tile VAT 9" x 9"	4020/01/05/63	Confirmed	144	SF	10	SF	Tan	Vacant floor. Tile is loose from roof drain leak.		1	No	6/C				
1	5	Closet inside Storage Room with Double Doors inside Classroom 500	N/A	Cement Floor		Non Suspect ACM	144	SF	0	SF		Vacant floor		N/A	N/A	N/A				
1	5	Closet inside Storage Room with Double Doors inside Classroom 500	N/A	Fireproofing		NAD	144	SF	0	SF		Vacant floor		N/A	N/A	N/A				
1	5	Classroom 501	N/A	Ceiling Tile 2' x 4'		NAD	550	SF	0	SF		Vacant floor		N/A	N/A	N/A				
1	5	Classroom 501	N/A	Metal Ceiling		Non Suspect ACM	550	SF	0	SF		Vacant floor		N/A	N/A	N/A				
1	5	Classroom 501	N/A	Plaster Walls		NAD	1240	SF	0	SF		Vacant floor		N/A	N/A	N/A				
1	5	Classroom 501	N/A	Sheetrock Wall		Non Suspect ACM	1240	SF	0	SF		Vacant floor		N/A	N/A	N/A				
1	5	Classroom 501	M	Floor Tile VAT 9" x 9"	4020/01/05/63	Confirmed	570	SF	0	SF	Tan	Vacant floor		1	No	1/D				
1	5	Classroom 501	N/A	Cement Floor		Non Suspect ACM	570	SF	0	SF		Vacant floor		N/A	N/A	N/A				
1	5	Classroom 501	N/A	Fireproofing		NAD	550	SF	0	SF		Vacant floor		N/A	N/A	N/A				
1	5	Classroom 501	M	Blackboard Glue Dots	4020/01/05/AET/BB/2600	Assumed	70	SF	0	SF		Vacant floor		1	No	1/D				
1	5	Classroom 501	T	Unit Ventilator Insulation	4020/01/05/64	Assumed	15	SF	0	SF		Vacant floor. Insulation is not visible but is assumed to be inside the unit.		1	No	1/D				
1	5	Women's Restroom	N/A	Ceiling Tile 2' x 4'		NAD	65	SF	0	SF		Vacant floor		N/A	N/A	N/A				
1	5	Women's Restroom	N/A	Plaster Ceiling		NAD	65	SF	0	SF		Vacant floor		N/A	N/A	N/A				
1	5	Women's Restroom	N/A	Sheetrock Ceiling		Non Suspect ACM	65	SF	0	SF		Vacant floor		N/A	N/A	N/A				
1	5	Women's Restroom	N/A	Metal Ceiling		Non Suspect ACM	130	SF	0	SF		Vacant floor		N/A	N/A	N/A				
1	5	Women's Restroom	N/A	Plaster Walls		NAD	480	SF	0	SF		Vacant floor		N/A	N/A	N/A				
1	5	Women's Restroom	N/A	Sheetrock Wall		Non Suspect ACM	480	SF	0	SF		Vacant floor		N/A	N/A	N/A				
1	5	Women's Restroom	M	Floor Tile VAT 9" x 9"	4020/01/05/63	Confirmed	65	SF	0	SF	Tan	Vacant floor		1	No	1/D				
1	5	Women's Restroom	N/A	Cement Floor		Non Suspect ACM	130	SF	0	SF		Vacant floor		N/A	N/A	N/A				
1	5	Women's Restroom	M	Linoleum	4020/01/05/AET/BB/2200	Assumed	65	SF	0	SF		Vacant floor		1	No	1/D				
1	5	Women's Restroom	T	Heat Shield Insulation	4020/01/05/AET/BB/1600	Assumed	1	SF	0	SF		Vacant floor		1	No	1/D				
1	5	Classroom 502	N/A	Plaster Ceiling		NAD	1292	SF	35	SF		Vacant floor. Water Damage		N/A	N/A	N/A				
1	5	Classroom 502	N/A	Plaster Walls		NAD	2160	SF	30	SF		Vacant floor		N/A	N/A	N/A				
1	5	Classroom 502	M	Floor Tile VAT 12" x 12"	4020/01/05/UU	Assumed	1292	SF	0	SF	Tan	Vacant floor		1	No	1/D				
1	5	Classroom 502	N/A	Wood Floor		Non Suspect ACM	1292	SF	0	SF		Vacant floor		N/A	N/A	N/A				
1	5	Classroom 502	M	Blackboard Glue Dots	4020/01/05/AET/BB/2600	Assumed	120	SF	0	SF		Vacant floor		1	No	1/D				
1	5	Classroom 502, Closet to Left of Blackboard	T	Pipe Insulation 2-6 inch	4020/01/05/68	Confirmed	6	LF	0	LF		Vacant floor		1	No	1/D				
1	5	Classroom 502, Closet to Left of Blackboard	N/A	Plaster Ceiling		NAD	144	SF	20	SF		Vacant floor. Water Damage		N/A	N/A	N/A				
1	5	Classroom 502, Closet to Left of Blackboard	N/A	Plaster Walls		NAD	580	SF	50	SF		Vacant floor. Water Damage		N/A	N/A	N/A				
1	5	Classroom 502, Closet to Left of Blackboard	N/A	Wood Floor		Non Suspect ACM	144	SF	2	SF		Vacant floor		N/A	N/A	N/A				
1	5	Classroom 502, Closet to Right of Blackboard	X	X		X	X	X	X	X	X	No Inspection Due to Heavy Amount of Bird Droppings		X	X	X				
1	5	Classroom 502, Closet at Top of Risers	X	X		X	X	X	X	X	X	No Inspection Due to Heavy Amount of Bird Droppings		X	X	X				
1	5	Classroom 502, Closet near Entrance at bottom of Risers	N/A	Plaster Ceiling		NAD	35	SF	0	SF		Vacant floor		N/A	N/A	N/A				
1	5	Classroom 502, Closet near Entrance at bottom of Risers	N/A	Plaster Walls		NAD	220	SF	0	SF		Vacant floor		N/A	N/A	N/A				
1	5	Classroom 502, Closet near Entrance at bottom of Risers	N/A	Wood Floor		Non Suspect ACM	35	SF	0	SF		Vacant floor		N/A	N/A	N/A				
1	5	Hallway outside Classroom 502, Janitorial Room Storage	N/A	Plaster Ceiling		NAD	40	SF	15	SF		Vacant floor		N/A	N/A	N/A				
1	5	Hallway outside Classroom 502, Janitorial Room Storage	N/A	Plaster Walls		NAD	250	SF	15	SF		Vacant floor		N/A	N/A	N/A				
1	5	Hallway outside Classroom 502, Janitorial Room Storage	N/A	Cement Floor		Non Suspect ACM	40	SF	0	SF		Vacant floor		N/A	N/A	N/A				
1	5	Director's Room	T	Pipe Insulation 2-6 inch	4020/01/05/68	Confirmed	13	LF	0	LF		Vacant floor		1	No	1/D				
1	5	Director's Room	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	24	LF	0	LF		Vacant floor		N/A	N/A	N/A				
1	5	Director's Room	N/A	Plaster Ceiling		NAD	145	SF	30	SF		Vacant floor		N/A	N/A	N/A				
1	5	Director's Room	N/A	Plaster Walls		NAD	580	SF	15	SF		Vacant floor		N/A	N/A	N/A				
1	5	Director's Room	N/A	Wood Floor		Non Suspect ACM	145	SF	0	SF		Vacant floor		N/A	N/A	N/A				
1	5	Classroom 504	N/A	Ceiling Tile 2' x 4'		NAD	660	SF	0	SF		Vacant floor		N/A	N/A	N/A				
1	5	Classroom 504	N/A	Metal Ceiling		Non Suspect ACM	660	SF	0	SF		Vacant floor		N/A	N/A	N/A				
1	5	Classroom 504	N/A	Plaster Walls		NAD	1040	SF	0	SF		Vacant floor		N/A	N/A	N/A				
1	5	Classroom 504	N/A	Sheetrock Wall		Non Suspect ACM	1040	SF	0	SF		Vacant floor		N/A	N/A	N/A				
1	5	Classroom 504	M	Floor Tile VAT 9" x 9"	4020/01/05/63	Confirmed	680	SF	0	SF	Tan	Vacant floor		1	No	1/D				
1	5	Classroom 504	N/A	Cement Floor		Non Suspect ACM	680	SF	0	SF		Vacant floor		N/A	N/A	N/A				
1	5	Classroom 504	N/A	Fireproofing		NAD	660	SF	0	SF		Vacant floor		N/A	N/A	N/A				
1	5	Classroom 504	M	Blackboard Glue Dots	4020/01/05/AET/BB/2600	Assumed	185	SF	0	SF		Vacant floor		1	No	1/D				
1	5	Classroom 504	T	Unit Ventilator Insulation	4020/01/05/64	Assumed	10	SF	0	SF		Vacant floor. Insulation is not visible but is assumed to be inside the unit.		1	No	1/D				
1	5	Men's Restroom	N/A	Ceiling Tile 2' x 4'		NAD	65	SF	0	SF		Vacant floor		N/A	N/A	N/A				

4020 Overbrook HS 2015-2016 AHERA Three Year Report

School District of Philadelphia Overbrook High School 5898 Lancaster Avenue, Philadelphia, PA 19131 ULCS# 4020 Year Built: 1926		AHERA Three-Year Reinspection 2015-2016 Room by Room Location Log Report										Reinspection Date: 10/21/2015 Building Inspector: Bernard Brunner Certificate Number: 45397 Management Planner: M. Causley Certificate Number: ACC-0215-8-010							
		Element	Room	On Site Room Name	System Affected	Material Description	HID#	Confirmed Assumed NAD Non Suspect ACM	Amount of Material	SF LF EA	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic / Crawl Space Ranking	Damage Potential (DP)	Newly Friable (NF)	Response Action (RA)	
1	5	Men's Restroom	N/A	Plaster Ceiling		NAD	65	SF	5	SF			Vacant floor		N/A	N/A	N/A		
1	5	Men's Restroom	N/A	Sheetrock Ceiling		Non Suspect ACM	65	SF	5	SF			Vacant floor		N/A	N/A	N/A		
1	5	Men's Restroom	N/A	Metal Ceiling		Non Suspect ACM	130	SF	0	SF			Vacant floor		N/A	N/A	N/A		
1	5	Men's Restroom	N/A	Plaster Walls		NAD	480	SF	0	SF			Vacant floor		N/A	N/A	N/A		
1	5	Men's Restroom	N/A	Sheetrock Wall		Non Suspect ACM	480	SF	0	SF			Vacant floor		N/A	N/A	N/A		
1	5	Men's Restroom	M	Floor Tile VAT 9" x 9"	4020/01/05/63	Confirmed	65	SF	0	SF	Tan		Vacant floor		1	No	1/D		
1	5	Men's Restroom	N/A	Cement Floor		Non Suspect ACM	130	SF	0	SF			Vacant floor		N/A	N/A	N/A		
1	5	Men's Restroom	N/A	Fireproofing		NAD	130	SF	0	SF			Vacant floor		N/A	N/A	N/A		
1	5	Men's Restroom	M	Linoleum	4020/01/05/AET/BB/2200	Assumed	65	SF	0	SF			Vacant floor		1	No	1/D		
1	5	Men's Restroom	T	Heat Shield Insulation	4020/01/05/AET/BB/1600	Assumed	1	SF	0	SF			Vacant floor		1	No	1/D		
1	5	Practice Room adjacent to Classroom 504	N/A	Ceiling Tile 2' x 4'		NAD	64	SF	8	SF			Vacant floor		N/A	N/A	N/A		
1	5	Practice Room adjacent to Classroom 504	N/A	Metal Ceiling		Non Suspect ACM	64	SF	0	SF			Vacant floor		N/A	N/A	N/A		
1	5	Practice Room adjacent to Classroom 504	N/A	Plaster Walls		NAD	300	SF	60	SF			Vacant floor		N/A	N/A	N/A		
1	5	Practice Room adjacent to Classroom 504	N/A	Sheetrock Wall		Non Suspect ACM	300	SF	60	SF			Vacant floor		N/A	N/A	N/A		
1	5	Practice Room adjacent to Classroom 504	M	Floor Tile VAT 9" x 9"	4020/01/05/63	Confirmed	64	SF	0	SF	Tan		Vacant floor		1	No	1/D		
1	5	Practice Room adjacent to Classroom 504	N/A	Cement Floor		Non Suspect ACM	64	SF	0	SF			Vacant floor		N/A	N/A	N/A		
1	5	Practice Room adjacent to Classroom 504	N/A	Fireproofing		NAD	64	SF	0	SF			Vacant floor		N/A	N/A	N/A		
1	5	Classroom 505	N/A	Ceiling Tile 2' x 4'		NAD	1364	SF	0	SF			Vacant floor		N/A	N/A	N/A		
1	5	Classroom 505	N/A	Metal Ceiling		Non Suspect ACM	1364	SF	0	SF			Vacant floor		N/A	N/A	N/A		
1	5	Classroom 505	N/A	Plaster Walls		NAD	1680	SF	0	SF			Vacant floor		N/A	N/A	N/A		
1	5	Classroom 505	N/A	Sheetrock Wall		Non Suspect ACM	1680	SF	0	SF			Vacant floor		N/A	N/A	N/A		
1	5	Classroom 505	M	Floor Tile VAT 9" x 9"	4020/01/05/63	Confirmed	1394	SF	0	SF	Tan		Vacant floor		1	No	1/D		
1	5	Classroom 505	N/A	Cement Floor		Non Suspect ACM	1394	SF	0	SF			Vacant floor		N/A	N/A	N/A		
1	5	Classroom 505	N/A	Fireproofing		NAD	1364	SF	0	SF			Vacant floor		N/A	N/A	N/A		
1	5	Classroom 505	M	Blackboard Glue Dots	4020/01/05/AET/BB/2600	Assumed	180	SF	0	SF			Vacant floor		1	No	1/D		
1	5	Classroom 505	T	Unit Ventilator Insulation	4020/01/05/64	Assumed	30	SF	0	SF			Vacant floor. Insulation is not visible but is assumed to be inside the unit.		1	No	1/D		
1	5	Small Practice Room near Classroom 505 Entrance closest to Classroom 504	N/A	Ceiling Tile 2' x 4'		NAD	64	SF	0	SF			Vacant floor		N/A	N/A	N/A		
1	5	Small Practice Room near Classroom 505 Entrance closest to Classroom 504	N/A	Metal Ceiling		Non Suspect ACM	64	SF	0	SF			Vacant floor		N/A	N/A	N/A		
1	5	Small Practice Room near Classroom 505 Entrance closest to Classroom 504	N/A	Plaster Walls		NAD	300	SF	30	SF			Vacant floor		N/A	N/A	N/A		
1	5	Small Practice Room near Classroom 505 Entrance closest to Classroom 504	N/A	Sheetrock Wall		Non Suspect ACM	300	SF	30	SF			Vacant floor		N/A	N/A	N/A		
1	5	Small Practice Room near Classroom 505 Entrance closest to Classroom 504	M	Floor Tile VAT 9" x 9"	4020/01/05/63	Confirmed	64	SF	0	SF	Tan		Vacant floor		1	No	1/D		
1	5	Small Practice Room near Classroom 505 Entrance closest to Classroom 504	N/A	Cement Floor		Non Suspect ACM	64	SF	0	SF			Vacant floor		N/A	N/A	N/A		
1	5	Small Practice Room near Classroom 505 Entrance closest to Classroom 504	N/A	Fireproofing		NAD	64	SF	0	SF			Vacant floor		N/A	N/A	N/A		
1	5	Large Practice Room near Classroom 505 Entrance closest to Classroom 504	N/A	Ceiling Tile 2' x 4'		NAD	160	SF	0	SF			Vacant floor		N/A	N/A	N/A		
1	5	Large Practice Room near Classroom 505 Entrance closest to Classroom 504	N/A	Metal Ceiling		Non Suspect ACM	160	SF	0	SF			Vacant floor		N/A	N/A	N/A		
1	5	Large Practice Room near Classroom 505 Entrance closest to Classroom 504	N/A	Plaster Walls		NAD	560	SF	0	SF			Vacant floor		N/A	N/A	N/A		
1	5	Large Practice Room near Classroom 505 Entrance closest to Classroom 504	N/A	Sheetrock Wall		Non Suspect ACM	560	SF	0	SF			Vacant floor		N/A	N/A	N/A		
1	5	Large Practice Room near Classroom 505 Entrance closest to Classroom 504	M	Floor Tile VAT 9" x 9"	4020/01/05/63	Confirmed	160	SF	0	SF	Tan		Vacant floor		1	No	1/D		
1	5	Large Practice Room near Classroom 505 Entrance closest to Classroom 504	N/A	Cement Floor		Non Suspect ACM	160	SF	0	SF			Vacant floor		N/A	N/A	N/A		
1	5	Large Practice Room near Classroom 505 Entrance closest to Classroom 504	N/A	Fireproofing		NAD	160	SF	0	SF			Vacant floor		N/A	N/A	N/A		
1	5	Large Practice Room near Classroom 505 Entrance closest to Classroom 504	M	Blackboard Glue Dots	4020/01/05/AET/BB/2600	Assumed	80	SF	0	SF			Vacant floor		1	No	1/D		
1	5	Practice Room in Hallway outside Classroom 505	N/A	Metal Ceiling		Non Suspect ACM	64	SF	0	SF			Vacant floor		N/A	N/A	N/A		
1	5	Practice Room in Hallway outside Classroom 505	N/A	Plaster Walls		NAD	300	SF	0	SF			Vacant floor		N/A	N/A	N/A		
1	5	Practice Room in Hallway outside Classroom 505	N/A	Sheetrock Wall		Non Suspect ACM	300	SF	0	SF			Vacant floor		N/A	N/A	N/A		
1	5	Practice Room in Hallway outside Classroom 505	M	Floor Tile VAT 9" x 9"	4020/01/05/63	Confirmed	64	SF	0	SF	Tan		Vacant floor		1	No	1/D		
1	5	Practice Room in Hallway outside Classroom 505	N/A	Cement Floor		Non Suspect ACM	64	SF	0	SF			Vacant floor		N/A	N/A	N/A		
1	5	Practice Room in Hallway outside Classroom 505	N/A	Fireproofing		NAD	64	SF	0	SF			Vacant floor		N/A	N/A	N/A		
1	5	Left Practice Room outside Classroom 505 Entrance closest to Classroom 506	N/A	Ceiling Tile 2' x 4'		NAD	64	SF	24	SF			Vacant floor		N/A	N/A	N/A		
1	5	Left Practice Room outside Classroom 505 Entrance closest to Classroom 506	N/A	Metal Ceiling		Non Suspect ACM	64	SF	0	SF			Vacant floor		N/A	N/A	N/A		
1	5	Left Practice Room outside Classroom 505 Entrance closest to Classroom 506	N/A	Plaster Walls		NAD	300	SF	0	SF			Vacant floor		N/A	N/A	N/A		
1	5	Left Practice Room outside Classroom 505 Entrance closest to Classroom 506	N/A	Sheetrock Wall		Non Suspect ACM	300	SF	0	SF			Vacant floor		N/A	N/A	N/A		
1	5	Left Practice Room outside Classroom 505 Entrance closest to Classroom 506	M	Floor Tile VAT 9" x 9"	4020/01/05/63	Confirmed	64	SF	0	SF	Tan		Vacant floor		1	No	1/D		
1	5	Left Practice Room outside Classroom 505 Entrance closest to Classroom 506	N/A	Cement Floor		Non Suspect ACM	64	SF	0	SF			Vacant floor		N/A	N/A	N/A		
1	5	Left Practice Room outside Classroom 505 Entrance closest to Classroom 506	N/A	Fireproofing		NAD	64	SF	10	SF			Vacant floor		N/A	N/A	N/A		
1	5	Right Practice Room outside Classroom 505 Entrance closest to Classroom 506	N/A	Ceiling Tile 2' x 4'		NAD	64	SF	0	SF			Vacant floor		N/A	N/A	N/A		
1	5	Right Practice Room outside Classroom 505 Entrance closest to Classroom 506	N/A	Metal Ceiling		Non Suspect ACM	64	SF	0	SF			Vacant floor		N/A	N/A	N/A		
1	5	Right Practice Room outside Classroom 505 Entrance closest to Classroom 506	N/A	Plaster Walls		NAD	300	SF	0	SF			Vacant floor		N/A	N/A	N/A		

4020 Overbrook HS 2015-2016 AHERA Three Year Report

School District of Philadelphia Overbrook High School 5898 Lancaster Avenue, Philadelphia, PA 19131 ULCS# 4020 Year Built: 1926			AHERA Three-Year Reinspection 2015-2016 Room by Room Location Log Report										Reinspection Date: 10/21/2015 Building Inspector: Bernard Brunner Certificate Number: 45397 Management Planner: M. Causley Certificate Number: ACC-0215-8-010			
E l e m e n t	F l o o r	On Site Room Name	System Affected	Material Description	HID#	Confirmed Assumed NAD Non Suspect ACM	Amount of Material	SF LF EA	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic / Crawl Space Ranking	Damage Potential (DP)	Newly Friable (NF)	Response Action (RA)
1	5	Right Practice Room outside Classroom 505 Entrance closest to Classroom 506	N/A	Sheetrock Wall		Non Suspect ACM	300	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5	Right Practice Room outside Classroom 505 Entrance closest to Classroom 506	M	Floor Tile VAT 9" x 9"	4020/01/05/63	Confirmed	64	SF	0	SF	Tan	Vacant floor		1	No	1/D
1	5	Right Practice Room outside Classroom 505 Entrance closest to Classroom 506	N/A	Cement Floor		Non Suspect ACM	64	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5	Right Practice Room outside Classroom 505 Entrance closest to Classroom 506	N/A	Fireproofing		NAD	64	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5	Classroom 506	N/A	Ceiling Tile 2' x 4'		NAD	836	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5	Classroom 506	N/A	Metal Ceiling		Non Suspect ACM	836	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5	Classroom 506	N/A	Plaster Walls		NAD	980	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5	Classroom 506	N/A	Sheetrock Wall		Non Suspect ACM	980	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5	Classroom 506	N/A	Partition Room Dividers		Non Suspect ACM	220	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5	Classroom 506	M	Floor Tile VAT 9" x 9"	4020/01/05/63	Confirmed	856	SF	0	SF	Tan	Vacant floor		1	No	1/D
1	5	Classroom 506	N/A	Cement Floor		Non Suspect ACM	856	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5	Classroom 506	N/A	Fireproofing		NAD	836	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5	Classroom 506	M	Blackboard Glue Dots	4020/01/05/AET/BB/2600	Assumed	200	SF	0	SF		Vacant floor		1	No	1/D
1	5	Classroom 506	T	Unit Ventilator Insulation	4020/01/05/64	Assumed	15	SF	0	SF		Vacant floor. Insulation is not visible but is assumed to be inside the unit.		1	No	1/D
1	5	Classroom 507	N/A	Ceiling Tile 2' x 4'		NAD	445	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5	Classroom 507	N/A	Metal Ceiling		Non Suspect ACM	445	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5	Classroom 507	N/A	Plaster Walls		NAD	630	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5	Classroom 507	N/A	Sheetrock Wall		Non Suspect ACM	840	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5	Classroom 507	M	Floor Tile VAT 9" x 9"	4020/01/05/63	Confirmed	465	SF	0	SF	Tan	Vacant floor. Below Carpet		1	No	1/D
1	5	Classroom 507	N/A	Carpet		Non Suspect ACM	465	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5	Classroom 507	N/A	Cement Floor		Non Suspect ACM	465	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5	Classroom 507	N/A	Fireproofing		NAD	445	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5	Classroom 507	M	Blackboard Glue Dots	4020/01/05/AET/BB/2600	Assumed	45	SF	0	SF		Vacant floor		1	No	1/D
1	5	Classroom 507	T	Unit Ventilator Insulation	4020/01/05/64	Assumed	15	SF	0	SF		Vacant floor. Insulation is not visible but is assumed to be inside the unit.		1	No	1/D
1	5	Classroom 508	N/A	Ceiling Tile 2' x 4'		NAD	836	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5	Classroom 508	N/A	Metal Ceiling		Non Suspect ACM	836	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5	Classroom 508	N/A	Plaster Walls		NAD	760	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5	Classroom 508	N/A	Sheetrock Wall		Non Suspect ACM	760	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5	Classroom 508	N/A	Partition Room Dividers		Non Suspect ACM	440	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5	Classroom 508	M	Floor Tile VAT 9" x 9"	4020/01/05/63	Confirmed	856	SF	0	SF	Tan	Vacant floor		1	No	1/D
1	5	Classroom 508	N/A	Cement Floor		Non Suspect ACM	856	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5	Classroom 508	N/A	Fireproofing		NAD	836	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5	Classroom 508	M	Blackboard Glue Dots	4020/01/05/AET/BB/2600	Assumed	110	SF	0	SF		Vacant floor		1	No	1/D
1	5	Classroom 508	T	Unit Ventilator Insulation	4020/01/05/64	Assumed	15	SF	0	SF		Vacant floor. Insulation is not visible but is assumed to be inside the unit.		1	No	1/D
1	5	Classroom 509	X	X		X	X	X	X	X	X	Vacant Floor, No Access - Cabinet in Front of Entrance		X	X	X
1	5	Classroom 510	N/A	Ceiling Tile 2' x 4'		NAD	836	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5	Classroom 510	N/A	Metal Ceiling		Non Suspect ACM	836	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5	Classroom 510	N/A	Plaster Walls		NAD	760	SF	10	SF		Vacant floor		N/A	N/A	N/A
1	5	Classroom 510	N/A	Partition Room Dividers		Non Suspect ACM	440	SF	0	SF		Vacant floor, Partition to Classroom 511 Open		N/A	N/A	N/A
1	5	Classroom 510	N/A	Sheetrock Wall		Non Suspect ACM	760	SF	10	SF		Vacant floor		N/A	N/A	N/A
1	5	Classroom 510	M	Floor Tile VAT 9" x 9"	4020/01/05/63	Confirmed	856	SF	0	SF	Tan	Vacant floor		1	No	1/D
1	5	Classroom 510	N/A	Cement Floor		Non Suspect ACM	856	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5	Classroom 510	N/A	Fireproofing		NAD	836	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5	Classroom 510	M	Blackboard Glue Dots	4020/01/05/AET/BB/2600	Assumed	90	SF	0	SF		Vacant floor		1	No	1/D
1	5	Classroom 510	T	Unit Ventilator Insulation	4020/01/05/64	Assumed	15	SF	0	SF		Vacant floor. Insulation is not visible but is assumed to be inside the unit.		1	No	1/D
1	5	Classroom 511	N/A	Ceiling Tile 2' x 4'		NAD	836	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5	Classroom 511	N/A	Metal Ceiling		Non Suspect ACM	836	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5	Classroom 511	N/A	Plaster Walls		NAD	980	SF	10	SF		Vacant floor		N/A	N/A	N/A
1	5	Classroom 511	N/A	Sheetrock Wall		Non Suspect ACM	980	SF	10	SF		Vacant floor		N/A	N/A	N/A
1	5	Classroom 511	N/A	Partition Room Dividers		Non Suspect ACM	220	SF	0	SF		Vacant floor, Partition to 510 Open		N/A	N/A	N/A
1	5	Classroom 511	M	Floor Tile VAT 9" x 9"	4020/01/05/63	Confirmed	856	SF	0	SF	Tan	Vacant floor		1	No	1/D
1	5	Classroom 511	N/A	Cement Floor		Non Suspect ACM	856	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5	Classroom 511	N/A	Fireproofing		NAD	836	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5	Classroom 511	M	Blackboard Glue Dots	4020/01/05/AET/BB/2600	Assumed	180	SF	0	SF		Vacant floor		1	No	1/D
1	5	Classroom 511	T	Unit Ventilator Insulation	4020/01/05/64	Assumed	15	SF	0	SF		Vacant floor. Insulation is not visible but is assumed to be inside the unit.		1	No	1/D
1	5	Boy's Restroom	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	3	LF	0	LF		Vacant floor		N/A	N/A	N/A
1	5	Boy's Restroom	N/A	Plaster Ceiling		NAD	475	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5	Boy's Restroom	N/A	Sheetrock Ceiling		Non Suspect ACM	475	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5	Boy's Restroom	N/A	Metal Ceiling		Non Suspect ACM	475	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5	Boy's Restroom	N/A	Plaster Walls		NAD	880	SF	3	SF		Vacant floor		N/A	N/A	N/A
1	5	Boy's Restroom	N/A	Sheetrock Wall		Non Suspect ACM	880	SF	3	SF		Vacant floor		N/A	N/A	N/A
1	5	Boy's Restroom	N/A	Cement Floor		Non Suspect ACM	475	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5	Boy's Restroom	N/A	Fireproofing		NAD	475	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5	Boy's Restroom	M	Linoleum	4020/01/05/AET/BB/2200	Assumed	475	SF	0	SF		Vacant floor		1	No	1/D
1	5	Boy's Restroom Pipe Chase	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	25	LF	0	SF		Vacant floor		N/A	N/A	N/A
1	5	Custodial Closet adjacent to Boy's Restroom	X	X		X	X	X	X	X	X	Vacant floor. No Access - No Key		X	X	X
1	5	Classroom 512	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	28	LF	0	LF		Vacant floor		N/A	N/A	N/A
1	5	Classroom 512	N/A	Plaster Ceiling		NAD	1104	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5	Classroom 512	N/A	Plaster Walls		NAD	1680	SF	5	SF		Vacant floor		N/A	N/A	N/A
1	5	Classroom 512	M	Transite Table Top	4020/01/05/66	Confirmed	140	SF	10	SF		Vacant floor. Lab Table Tops and Glassware Holders		1	No	6/C
1	5	Classroom 512	N/A	Wood Floor		Non Suspect ACM	1104	SF	30	SF		Vacant floor		N/A	N/A	N/A
1	5	Classroom 512	M	Blackboard Glue Dots	4020/01/05/AET/BB/2600	Assumed	50	SF	0	SF		Vacant floor		1	No	1/D
1	5	Prep Room between Classrooms 512 and 514	N/A	Plaster Ceiling		NAD	285	SF	10	SF		Vacant floor		N/A	N/A	N/A
1	5	Prep Room between Classrooms 512 and 514	N/A	Plaster Walls		NAD	820	SF	0	SF		Vacant floor		N/A	N/A	N/A

4020 Overbrook HS 2015-2016 AHERA Three Year Report

School District of Philadelphia			AHERA Three-Year Reinspection 2015-2016										Reinspection Date: 10/21/2015				
Overbrook High School			Room by Room Location Log Report										Building Inspector: Bernard Brunner				
5898 Lancaster Avenue, Philadelphia, PA 19131													Certificate Number: 45397				
ULCS# 4020													Management Planner: M. Causley				
Year Built: 1926													Certificate Number: ACC-0215-8-010				
Element	Floor	Room	On Site Room Name	System Affected	Material Description	HID#	Confirmed Assumed NAD Non Suspect ACM	Amount of Material	SF LF EA	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic / Crawl Space Ranking	Damage Potential (DP)	Newly Friable (NF)	Response Action (RA)
1	5		Prep Room between Classrooms 512 and 514	M	Transite Table Top	4020/01/05/66	Confirmed	120	SF	0	SF		Vacant floor. Lab Table Tops and Glassware Holders		1	No	1/D
1	5		Prep Room between Classrooms 512 and 514	N/A	Wood Floor		Non Suspect ACM	285	SF	35	SF		Vacant floor		N/A	N/A	N/A
1	5		Storage Room Connected to Prep Room between Classrooms 512 and 514	N/A	Plaster Ceiling		NAD	105	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5		Storage Room Connected to Prep Room between Classrooms 512 and 514	N/A	Plaster Walls		NAD	530	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5		Storage Room Connected to Prep Room between Classrooms 512 and 514	N/A	Wood Floor		Non Suspect ACM	105	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5		Classroom 513	T	Pipe Fitting Insulation	4020/01/05/70	Confirmed	4	EA	0	EA		Vacant floor		1	No	1/D
1	5		Classroom 513	T	Pipe Insulation 2-6 inch	4020/01/05/68	Confirmed	12	LF	0	LF		Vacant floor		1	No	1/D
1	5		Classroom 513	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	16	LF	0	LF		Vacant floor		N/A	N/A	N/A
1	5		Classroom 513	N/A	Plaster Ceiling		NAD	1128	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5		Classroom 513	N/A	Plaster Walls		NAD	1700	SF	25	SF		Vacant floor		N/A	N/A	N/A
1	5		Classroom 513	M	Transite Table Top	4020/01/05/66	Confirmed	135	SF	0	SF		Vacant floor. Lab Table Tops and Glassware Holders		1	No	1/D
1	5		Classroom 513	N/A	Wood Floor		Non Suspect ACM	1128	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5		Classroom 513	M	Blackboard Glue Dots	4020/01/05/AET/BB/2600	Assumed	50	SF	0	SF		Vacant floor		1	No	1/D
1	5		Storage Room Connected to Classroom 513, Prep Room between Classrooms 513 and 515, and Classroom 515	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	100	LF	0	LF		Vacant floor		N/A	N/A	N/A
1	5		Storage Room Connected to Classroom 513, Prep Room between Classrooms 513 and 515, and Classroom 515	N/A	Metal Ceiling		Non Suspect ACM	540	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5		Storage Room Connected to Classroom 513, Prep Room between Classrooms 513 and 515, and Classroom 515	N/A	Concrete Block Wall		Non Suspect ACM	970	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5		Storage Room Connected to Classroom 513, Prep Room between Classrooms 513 and 515, and Classroom 515	N/A	Cement Floor		Non Suspect ACM	540	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5		Prep Room between Classrooms 513 and 515	N/A	Plaster Ceiling		NAD	210	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5		Prep Room between Classrooms 513 and 515	N/A	Plaster Walls		NAD	590	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5		Prep Room between Classrooms 513 and 515	M	Transite Table Top	4020/01/05/66	Confirmed	70	SF	0	SF		Vacant floor. Lab Table Tops and Glassware Holders		1	No	1/D
1	5		Prep Room between Classrooms 513 and 515	N/A	Wood Floor		Non Suspect ACM	210	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5		Storage Room Connected to Prep Room between Classrooms 513 and 515	X	X		X	X	X	X	X	X	Vacant floor. No Access - No Key		X	X	X
1	5		Classroom 514	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	16	LF	0	LF		Vacant floor		N/A	N/A	N/A
1	5		Classroom 514	N/A	Plaster Ceiling		NAD	1104	SF	1	SF		Vacant floor		N/A	N/A	N/A
1	5		Classroom 514	N/A	Plaster Walls		NAD	1680	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5		Classroom 514	M	Transite Table Top	4020/01/05/66	Confirmed	170	SF	0	SF		Vacant floor. Lab Table Tops and Glassware Holders		1	No	1/D
1	5		Classroom 514	N/A	Wood Floor		Non Suspect ACM	1104	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5		Classroom 514	M	Blackboard Glue Dots	4020/01/05/AET/BB/2600	Assumed	50	SF	0	SF		Vacant floor		1	No	1/D
1	5		Classroom 515	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	16	LF	0	SF		Vacant floor		N/A	N/A	N/A
1	5		Classroom 515	N/A	Plaster Ceiling		NAD	1080	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5		Classroom 515	N/A	Plaster Walls		NAD	1660	SF	70	SF		Vacant floor. Water Damage		N/A	N/A	N/A
1	5		Classroom 515	M	Transite Table Top	4020/01/05/66	Confirmed	190	SF	0	SF		Vacant floor. Lab Table Tops and Glassware Holders		1	No	1/D
1	5		Classroom 515	N/A	Wood Floor		Non Suspect ACM	1080	SF	5	SF		Vacant floor		N/A	N/A	N/A
1	5		Classroom 515	M	Blackboard Glue Dots	4020/01/05/AET/BB/2600	Assumed	50	SF	0	SF		Vacant floor		1	No	1/D
1	5		Classroom 516	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	8	LF	0	LF		Vacant floor		N/A	N/A	N/A
1	5		Classroom 516	N/A	Plaster Ceiling		NAD	528	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5		Classroom 516	N/A	Plaster Walls		NAD	1100	SF	60	SF		Vacant floor. Water Damage.		N/A	N/A	N/A
1	5		Classroom 516	N/A	Wood Floor		Non Suspect ACM	528	SF	0	SF		Vacant floor.		N/A	N/A	N/A
1	5		Classroom 516	M	Blackboard Glue Dots	4020/01/05/AET/BB/2600	Assumed	60	SF	0	SF		Vacant floor.		1	No	1/D
1	5		Practice Room across from Classroom 516	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	25	LF	0	LF		Vacant floor		N/A	N/A	N/A
1	5		Practice Room across from Classroom 516	N/A	Plaster Ceiling		NAD	335	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5		Practice Room across from Classroom 516	N/A	Plaster Walls		NAD	1000	SF	25	SF		Vacant floor		N/A	N/A	N/A
1	5		Practice Room across from Classroom 516	N/A	Wood Floor		Non Suspect ACM	335	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5		Classroom 517	N/A	Ceiling Tile 2' x 4'		NAD	836	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5		Classroom 517	N/A	Metal Ceiling		Non Suspect ACM	836	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5		Classroom 517	N/A	Plaster Walls		NAD	980	SF	1	SF		Vacant floor		N/A	N/A	N/A
1	5		Classroom 517	N/A	Sheetrock Wall		Non Suspect ACM	980	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5		Classroom 517	N/A	Partition Room Dividers		Non Suspect ACM	220	SF	0	SF		Vacant Floor, Partitian to 518 Open		N/A	N/A	N/A
1	5		Classroom 517	M	Floor Tile VAT 9" x 9"	4020/01/05/63	Confirmed	856	SF	0	SF	Tan	Vacant floor		1	No	1/D
1	5		Classroom 517	N/A	Cement Floor		Non Suspect ACM	856	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5		Classroom 517	N/A	Fireproofing		NAD	836	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5		Classroom 517	M	Blackboard Glue Dots	4020/01/05/AET/BB/2600	Assumed	200	SF	0	SF		Vacant floor		1	No	1/D
1	5		Classroom 517	T	Unit Ventilator Insulation	4020/01/05/64	Assumed	15	SF	0	SF		Vacant floor. Insulation is not visible but is assumed to be inside the unit.		1	No	1/D
1	5		Classroom 518	N/A	Ceiling Tile 2' x 4'		NAD	836	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5		Classroom 518	N/A	Metal Ceiling		Non Suspect ACM	836	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5		Classroom 518	N/A	Plaster Walls		NAD	760	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5		Classroom 518	N/A	Sheetrock Wall		Non Suspect ACM	760	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5		Classroom 518	N/A	Partition Room Dividers		Non Suspect ACM	440	SF	0	SF		Vacant floor, Partitian to 517 and 520 Open		N/A	N/A	N/A
1	5		Classroom 518	M	Floor Tile VAT 9" x 9"	4020/01/05/63	Confirmed	856	SF	0	SF	Tan	Vacant floor		1	No	1/D
1	5		Classroom 518	N/A	Cement Floor		Non Suspect ACM	856	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5		Classroom 518	N/A	Fireproofing		NAD	836	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5		Classroom 518	M	Blackboard Glue Dots	4020/01/05/AET/BB/2600	Assumed	90	SF	0	SF		Vacant floor		1	No	1/D
1	5		Classroom 518	T	Unit Ventilator Insulation	4020/01/05/64	Assumed	15	SF	0	SF		Vacant floor. Insulation is not visible but is assumed to be inside the unit.		1	No	1/D
1	5		Girl's Restroom	N/A	Plaster Ceiling		NAD	494	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5		Girl's Restroom	N/A	Sheetrock Ceiling		Non Suspect ACM	494	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5		Girl's Restroom	N/A	Metal Ceiling		Non Suspect ACM	494	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5		Girl's Restroom	N/A	Plaster Walls		NAD	880	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5		Girl's Restroom	N/A	Sheetrock Wall		Non Suspect ACM	880	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5		Girl's Restroom	N/A	Cement Floor		Non Suspect ACM	494	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5		Girl's Restroom	N/A	Fireproofing		NAD	494	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5		Girl's Restroom	M	Linoleum	4020/01/05/AET/BB/2200	Assumed	494	SF	0	SF		Vacant floor		1	No	1/D

4020 Overbrook HS 2015-2016 AHERA Three Year Report

School District of Philadelphia			AHERA Three-Year Reinspection 2015-2016										Reinspection Date: 10/21/2015			
Overbrook High School			Room by Room Location Log Report										Building Inspector: Bernard Brunner			
5898 Lancaster Avenue, Philadelphia, PA 19131													Certificate Number: 45397			
ULCS# 4020													Management Planner: M. Causley			
Year Built: 1926													Certificate Number: ACC-0215-8-010			
E l e m e n t	F l o o r	On Site Room Name	System Affected	Material Description	HID#	Confirmed Assumed NAD Non Suspect ACM	Amount of Material	SF LF EA	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic / Crawl Space Ranking	Damage Potential (DP)	Newly Friable (NF)	Response Action (RA)
1	5	Girl's Restroom	T	Heat Shield Insulation	4020/01/05/AET/BB/1600	Assumed	1	SF	0	SF		Vacant floor		1	No	1/D
1	5	Girl's Restroom Pipe Chase	X	X		X	X	X	X	X	X	Vacant floor. No Access - Door Painted Shut		X	X	X
1	5	Custodial Closet adjacent to Girl's Restroom	M	Linoleum	4020/01/05/AET/BB/2200	Assumed	20	SF	0	SF		Vacant floor		1	No	1/D
1	5	Classroom 519	N/A	Ceiling Tile 2' x 4'		NAD	814	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5	Classroom 519	N/A	Metal Ceiling		Non Suspect ACM	814	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5	Classroom 519	N/A	Plaster Walls		NAD	960	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5	Classroom 519	N/A	Sheetrock Wall		Non Suspect ACM	960	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5	Classroom 519	N/A	Partition Room Dividers		Non Suspect ACM	220	SF	0	SF		Vacant floor, Partition to 521 Open		N/A	N/A	N/A
1	5	Classroom 519	M	Floor Tile VAT 9" x 9"	4020/01/05/63	Confirmed	834	SF	0	SF	Tan	Vacant floor		1	No	1/D
1	5	Classroom 519	N/A	Cement Floor		Non Suspect ACM	834	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5	Classroom 519	N/A	Fireproofing		NAD	814	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5	Classroom 519	M	Blackboard Glue Dots	4020/01/05/AET/BB/2600	Assumed	200	SF	0	SF		Vacant floor		1	No	1/D
1	5	Classroom 519	T	Unit Ventilator Insulation	4020/01/05/64	Assumed	15	SF	0	SF		Vacant floor. Insulation is not visible but is assumed to be inside the unit.		1	No	1/D
1	5	Classroom 520	N/A	Ceiling Tile 2' x 4'		NAD	836	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5	Classroom 520	N/A	Metal Ceiling		Non Suspect ACM	836	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5	Classroom 520	N/A	Plaster Walls		NAD	760	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5	Classroom 520	N/A	Sheetrock Wall		Non Suspect ACM	760	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5	Classroom 520	N/A	Partition Room Dividers		Non Suspect ACM	440	SF	0	SF		Vacant floor, Partition to 518 and 522 Open		N/A	N/A	N/A
1	5	Classroom 520	M	Floor Tile VAT 9" x 9"	4020/01/05/63	Confirmed	856	SF	0	SF	Tan	Vacant floor		1	No	1/D
1	5	Classroom 520	N/A	Cement Floor		Non Suspect ACM	856	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5	Classroom 520	N/A	Fireproofing		NAD	836	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5	Classroom 520	M	Blackboard Glue Dots	4020/01/05/AET/BB/2600	Assumed	110	SF	0	SF		Vacant floor		1	No	1/D
1	5	Classroom 520	T	Unit Ventilator Insulation	4020/01/05/64	Assumed	15	SF	0	SF		Vacant floor. Insulation is not visible but is assumed to be inside the unit.		1	No	1/D
1	5	Classroom 521	N/A	Ceiling Tile 2' x 4'		NAD	814	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5	Classroom 521	N/A	Metal Ceiling		Non Suspect ACM	814	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5	Classroom 521	N/A	Plaster Walls		NAD	960	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5	Classroom 521	N/A	Sheetrock Wall		Non Suspect ACM	960	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5	Classroom 521	N/A	Partition Room Dividers		Non Suspect ACM	220	SF	0	SF		Vacant floor, Partition to 519 Open		N/A	N/A	N/A
1	5	Classroom 521	M	Floor Tile VAT 9" x 9"	4020/01/05/63	Confirmed	834	SF	0	SF	Tan	Vacant floor		1	No	1/D
1	5	Classroom 521	N/A	Cement Floor		Non Suspect ACM	834	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5	Classroom 521	N/A	Fireproofing		NAD	814	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5	Classroom 521	M	Blackboard Glue Dots	4020/01/05/AET/BB/2600	Assumed	200	SF	0	SF		Vacant floor		1	No	1/D
1	5	Classroom 521	T	Unit Ventilator Insulation	4020/01/05/64	Assumed	15	SF	0	SF		Vacant floor. Insulation is not visible but is assumed to be inside the unit.		1	No	1/D
1	5	Classroom 522	N/A	Ceiling Tile 2' x 4'		NAD	836	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5	Classroom 522	N/A	Metal Ceiling		Non Suspect ACM	836	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5	Classroom 522	N/A	Plaster Walls		NAD	980	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5	Classroom 522	N/A	Sheetrock Wall		Non Suspect ACM	980	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5	Classroom 522	N/A	Partition Room Dividers		Non Suspect ACM	220	SF	0	SF		Vacant floor, Partition to 520 open		N/A	N/A	N/A
1	5	Classroom 522	M	Floor Tile VAT 9" x 9"	4020/01/05/63	Confirmed	856	SF	0	SF	Tan	Vacant floor		1	No	1/D
1	5	Classroom 522	N/A	Cement Floor		Non Suspect ACM	856	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5	Classroom 522	N/A	Fireproofing		NAD	836	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5	Classroom 522	M	Blackboard Glue Dots	4020/01/05/AET/BB/2600	Assumed	220	SF	0	SF		Vacant floor		1	No	1/D
1	5	Classroom 522	T	Unit Ventilator Insulation	4020/01/05/64	Assumed	15	SF	0	SF		Vacant floor. Insulation is not visible but is assumed to be inside the unit.		1	No	1/D
1	5	Stairwell near Classroom 517	N/A	Plaster Ceiling		NAD	375	SF	1	SF		Vacant floor		N/A	N/A	N/A
1	5	Stairwell near Classroom 517	N/A	Sheetrock Ceiling		Non Suspect ACM	375	SF	1	SF		Vacant floor		N/A	N/A	N/A
1	5	Stairwell near Classroom 517	N/A	Metal Ceiling		Non Suspect ACM	375	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5	Stairwell near Classroom 517	N/A	Plaster Walls		NAD	960	SF	50	SF		Vacant floor		N/A	N/A	N/A
1	5	Stairwell near Classroom 517	N/A	Sheetrock Wall		Non Suspect ACM	960	SF	10	SF		Vacant floor		N/A	N/A	N/A
1	5	Stairwell near Classroom 517	N/A	Cement Floor		Non Suspect ACM	375	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5	Stairwell near Classroom 517	N/A	Fireproofing		NAD	375	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5	Halfway between Classroom 517 and Stairwell	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	3	LF	0	LF		Vacant floor		N/A	N/A	N/A
1	5	Halfway between Classroom 517 and Stairwell	N/A	Ceiling Tile 2' x 4'		NAD	444	SF	1	SF		Vacant floor		N/A	N/A	N/A
1	5	Halfway between Classroom 517 and Stairwell	N/A	Metal Ceiling		Non Suspect ACM	444	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5	Halfway between Classroom 517 and Stairwell	N/A	Plaster Walls		NAD	980	SF	10	SF		Vacant floor		N/A	N/A	N/A
1	5	Halfway between Classroom 517 and Stairwell	N/A	Sheetrock Wall		Non Suspect ACM	980	SF	10	SF		Vacant floor		N/A	N/A	N/A
1	5	Halfway between Classroom 517 and Stairwell	M	Floor Tile VAT 9" x 9"	4020/01/05/63	Confirmed	444	SF	0	SF	Brown	Vacant floor		1	No	1/D
1	5	Halfway between Classroom 517 and Stairwell	N/A	Cement Floor		Non Suspect ACM	444	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5	Halfway between Classroom 517 and Stairwell	N/A	Fireproofing		NAD	444	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5	Halfway outside Classrooms 517-522	N/A	Ceiling Tile 2' x 4'		NAD	1470	SF	50	SF		Vacant floor		N/A	N/A	N/A
1	5	Halfway outside Classrooms 517-522	N/A	Metal Ceiling		Non Suspect ACM	1470	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5	Halfway outside Classrooms 517-522	N/A	Plaster Walls		NAD	2760	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5	Halfway outside Classrooms 517-522	N/A	Sheetrock Wall		Non Suspect ACM	2760	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5	Halfway outside Classrooms 517-522	M	Floor Tile VAT 9" x 9"	4020/01/05/63	Confirmed	1470	SF	0	SF	Brown	Vacant floor		1	No	1/D
1	5	Halfway outside Classrooms 517-522	N/A	Cement Floor		Non Suspect ACM	1470	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5	Halfway outside Classrooms 517-522	N/A	Fireproofing		NAD	1470	SF	35	SF		Vacant floor		N/A	N/A	N/A
1	5	Stairwell near Classroom 500	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	6	LF	0	LF		Vacant floor		N/A	N/A	N/A
1	5	Stairwell near Classroom 500	N/A	Plaster Ceiling		NAD	375	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5	Stairwell near Classroom 500	N/A	Sheetrock Ceiling		Non Suspect ACM	375	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5	Stairwell near Classroom 500	N/A	Metal Ceiling		Non Suspect ACM	375	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5	Stairwell near Classroom 500	N/A	Plaster Walls		NAD	960	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5	Stairwell near Classroom 500	N/A	Sheetrock Wall		Non Suspect ACM	960	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5	Stairwell near Classroom 500	M	Floor Tile VAT 9" x 9"	4020/01/05/63	Confirmed	150	SF	0	SF	Brown	Vacant floor		1	No	1/D
1	5	Stairwell near Classroom 500	N/A	Cement Floor		Non Suspect ACM	375	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5	Stairwell near Classroom 500	N/A	Fireproofing		NAD	375	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5	Storage Room in Stairwell near Classroom 500	N/A	Ceiling Tile 2' x 4'		NAD	100	SF	25	SF		Vacant floor		N/A	N/A	N/A
1	5	Storage Room in Stairwell near Classroom 500	N/A	Metal Ceiling		Non Suspect ACM	100	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5	Storage Room in Stairwell near Classroom 500	N/A	Plaster Walls		NAD	400	SF	0	SF		Vacant floor		N/A	N/A	N/A

4020 Overbrook HS 2015-2016 AHERA Three Year Report

School District of Philadelphia			AHERA Three-Year Reinspection 2015-2016										Reinspection Date: 10/21/2015			
Overbrook High School			Room by Room Location Log Report										Building Inspector: Bernard Brunner			
5898 Lancaster Avenue, Philadelphia, PA 19131													Certificate Number: 45397			
ULCS# 4020													Management Planner: M. Causley			
Year Built: 1926													Certificate Number: ACC-0215-8-010			
Element	Floor	On Site Room Name	System Affected	Material Description	HID#	Confirmed Assumed NAD Non Suspect ACM	Amount of Material	SF LF EA	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic / Crawl Space Ranking	Damage Potential (DP)	Newly Friable (NF)	Response Action (RA)
1	5	Storage Room in Stairwell near Classroom 500	N/A	Sheetrock Wall		Non Suspect ACM	400	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5	Storage Room in Stairwell near Classroom 500	N/A	Cement Floor		Non Suspect ACM	100	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5	Storage Room in Stairwell near Classroom 500	T	Heat Shield Insulation	4020/01/05/AET/BB/1600	Assumed	2	SF	0	SF		Vacant floor		1	No	1/D
1	5	Hallway outside Classrooms 500-501	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	6	LF	2	LF		Vacant floor		N/A	N/A	N/A
1	5	Hallway outside Classrooms 500-501	N/A	Ceiling Tile 2' x 4'		NAD	755	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5	Hallway outside Classrooms 500-501	N/A	Plaster Walls		NAD	2000	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5	Hallway outside Classrooms 500-501	N/A	Sheetrock Wall		Non Suspect ACM	2000	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5	Hallway outside Classrooms 500-501	M	Floor Tile VAT 9" x 9"	4020/01/05/63	Confirmed	755	SF	0	SF	Brown	Vacant floor		1	No	1/D
1	5	Hallway outside Classrooms 500-501	N/A	Cement Floor		Non Suspect ACM	755	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5	Hallway outside Classrooms 500-501	N/A	Fireproofing		NAD	755	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5	Half Door by Stairs in Hallway near Classroom 501	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	20	LF	0	LF		Vacant floor		N/A	N/A	N/A
1	5	Half Door by Stairs in Hallway near Classroom 501	N/A	Metal Ceiling		Non Suspect ACM	90	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5	Half Door by Stairs in Hallway near Classroom 501	N/A	Plaster Walls		NAD	95	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5	Half Door by Stairs in Hallway near Classroom 501	N/A	Terraotta Block Wall		Non Suspect ACM	95	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5	Half Door by Stairs in Hallway near Classroom 501	N/A	Cement Floor		Non Suspect ACM	90	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5	Half Door by Stairs in Hallway near Classroom 501	N/A	Fireproofing		NAD	90	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5	Hallway outside Classroom 502	N/A	Plaster Ceiling		NAD	630	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5	Hallway outside Classroom 502	N/A	Plaster Walls		NAD	2160	SF	5	SF		Vacant floor		N/A	N/A	N/A
1	5	Hallway outside Classroom 502	N/A	Cement Floor		Non Suspect ACM	630	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5	Hallway outside Classrooms 512-516	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	44	LF	8	LF		Vacant floor		N/A	N/A	N/A
1	5	Hallway outside Classrooms 512-516	N/A	Plaster Ceiling		NAD	1730	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5	Hallway outside Classrooms 512-516	N/A	Plaster Walls		NAD	3700	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5	Hallway outside Classrooms 512-516	N/A	Cement Floor		Non Suspect ACM	1730	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5	Hallway outside Classrooms 512-516	M	Transite Electrical Panel	4020/01/05/66	Confirmed	5	SF	0	SF		Vacant floor		1	No	1/D
1	5	Stairwell adjacent Classroom 512	N/A	Plaster Ceiling		NAD	90	SF	10	SF		Vacant floor. Stairwell Walled Over. Access From 4th Floor Only		N/A	N/A	N/A
1	5	Stairwell adjacent Classroom 512	N/A	Plaster Walls		NAD	675	SF	0	SF		Vacant floor. Stairwell Walled Over. Access From 4th Floor Only		N/A	N/A	N/A
1	5	Stairwell adjacent Classroom 512	N/A	Marble Walls		Non Suspect ACM	55	SF	0	SF		Vacant floor. Stairwell Walled Over. Access From 4th Floor Only		N/A	N/A	N/A
1	5	Stairwell adjacent Classroom 512	N/A	Sheetrock Wall		Non Suspect ACM	75	SF	0	SF		Vacant floor. Stairwell Walled Over. Access From 4th Floor Only		N/A	N/A	N/A
1	5	Stairwell adjacent Classroom 512	N/A	Cement Floor		Non Suspect ACM	90	SF	0	SF		Vacant floor. Stairwell Walled Over. Access From 4th Floor Only		N/A	N/A	N/A
1	5	Stairwell near Classroom 516	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	6	LF	0	LF		Vacant floor		N/A	N/A	N/A
1	5	Stairwell near Classroom 516	N/A	Plaster Ceiling		NAD	240	SF	50	SF		Vacant floor		N/A	N/A	N/A
1	5	Stairwell near Classroom 516	N/A	Plaster Walls		NAD	1020	SF	25	SF		Vacant floor		N/A	N/A	N/A
1	5	Stairwell near Classroom 516	N/A	Cement Floor		Non Suspect ACM	240	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5	Half Door by Stairs in Hallway near Room 504	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	20	LF	0	LF		Vacant floor		N/A	N/A	N/A
1	5	Half Door by Stairs in Hallway near Classroom 504	N/A	Metal Ceiling		Non Suspect ACM	90	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5	Half Door by Stairs in Hallway near Classroom 504	N/A	Plaster Walls		NAD	95	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5	Half Door by Stairs in Hallway near Classroom 504	N/A	Brick Wall		Non Suspect ACM	95	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5	Half Door by Stairs in Hallway near Classroom 504	N/A	Cement Floor		Non Suspect ACM	90	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5	Hallway outside Classrooms 504-505	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	3	LF	0	LF		Vacant floor		N/A	N/A	N/A
1	5	Hallway outside Classrooms 504-505	N/A	Ceiling Tile 2' x 4'		NAD	720	SF	25	SF		Vacant floor		N/A	N/A	N/A
1	5	Hallway outside Classrooms 504-505	N/A	Metal Ceiling		Non Suspect ACM	720	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5	Hallway outside Classrooms 504-505	N/A	Plaster Walls		NAD	1700	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5	Hallway outside Classrooms 504-505	N/A	Sheetrock Wall		Non Suspect ACM	1700	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5	Hallway outside Classrooms 504-505	M	Floor Tile VAT 9" x 9"	4020/01/05/63	Confirmed	720	SF	0	SF	Brown	Vacant floor		1	No	1/D
1	5	Hallway outside Classrooms 504-505	N/A	Cement Floor		Non Suspect ACM	720	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5	Hallway outside Classrooms 504-505	N/A	Fireproofing		NAD	720	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5	Stairwell near Classroom 505	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	6	LF	0	LF		Vacant floor		N/A	N/A	N/A
1	5	Stairwell near Classroom 505	N/A	Plaster Ceiling		NAD	375	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5	Stairwell near Classroom 505	N/A	Sheetrock Ceiling		Non Suspect ACM	375	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5	Stairwell near Classroom 505	N/A	Metal Ceiling		Non Suspect ACM	375	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5	Stairwell near Classroom 505	N/A	Plaster Walls		NAD	960	SF	5	SF		Vacant floor		N/A	N/A	N/A
1	5	Stairwell near Classroom 505	N/A	Sheetrock Wall		Non Suspect ACM	960	SF	5	SF		Vacant floor		N/A	N/A	N/A
1	5	Stairwell near Classroom 505	M	Floor Tile VAT 9" x 9"	4020/01/05/63	Confirmed	150	SF	0	SF	Brown	Vacant floor		1	No	1/D
1	5	Stairwell near Classroom 505	N/A	Cement Floor		Non Suspect ACM	375	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5	Stairwell near Classroom 505	N/A	Fireproofing		NAD	375	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5	Storage Room in Stairwell near Classroom 505	N/A	Ceiling Tile 2' x 4'		NAD	100	SF	8	SF		Vacant floor		N/A	N/A	N/A
1	5	Storage Room in Stairwell near Classroom 505	N/A	Metal Ceiling		Non Suspect ACM	100	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5	Storage Room in Stairwell near Classroom 505	N/A	Acoustical Plaster Walls		NAD	330	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5	Storage Room in Stairwell near Classroom 505	N/A	Concrete Block Wall		Non Suspect ACM	90	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5	Storage Room in Stairwell near Classroom 505	N/A	Sheetrock Wall		Non Suspect ACM	330	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5	Storage Room in Stairwell near Classroom 505	N/A	Cement Floor		Non Suspect ACM	100	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5	Storage Room in Stairwell near Classroom 505	T	Heat Shield Insulation	4020/01/05/AET/BB/1600	Assumed	1	SF	0	SF		Vacant floor		1	No	1/D
1	5	Hallway outside Classrooms 506-511	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	6	LF	0	LF		Vacant floor		N/A	N/A	N/A
1	5	Hallway outside Classrooms 506-511	N/A	Ceiling Tile 2' x 4'		NAD	1660	SF	50	SF		Vacant floor		N/A	N/A	N/A
1	5	Hallway outside Classrooms 506-511	N/A	Metal Ceiling		Non Suspect ACM	1660	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5	Hallway outside Classrooms 506-511	N/A	Plaster Walls		NAD	3360	SF	10	SF		Vacant floor		N/A	N/A	N/A
1	5	Hallway outside Classrooms 506-511	N/A	Sheetrock Wall		Non Suspect ACM	3360	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5	Hallway outside Classrooms 506-511	M	Floor Tile VAT 9" x 9"	4020/01/05/63	Confirmed	1660	SF	0	SF	Brown	Vacant floor		1	No	1/D
1	5	Hallway outside Classrooms 506-511	N/A	Cement Floor		Non Suspect ACM	1660	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5	Hallway outside Classrooms 506-511	N/A	Fireproofing		NAD	1660	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5	Hallway From Classroom 511 to Stairwell near Classroom 511	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	51	LF	12	LF		Vacant floor		N/A	N/A	N/A
1	5	Hallway From Classroom 511 to Stairwell near Classroom 511	N/A	Ceiling Tile 2' x 4'		NAD	504	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5	Hallway From Classroom 511 to Stairwell near Classroom 511	N/A	Plaster Walls		NAD	960	SF	40	SF		Vacant floor		N/A	N/A	N/A
1	5	Hallway From Classroom 511 to Stairwell near Classroom 511	N/A	Sheetrock Wall		Non Suspect ACM	960	SF	0	SF		Vacant floor		N/A	N/A	N/A

4020 Overbrook HS 2015-2016 AHERA Three Year Report

School District of Philadelphia			AHERA Three-Year Reinspection 2015-2016										Reinspection Date: 10/21/2015			
Overbrook High School			Room by Room Location Log Report										Building Inspector: Bernard Brunner			
5898 Lancaster Avenue, Philadelphia, PA 19131													Certificate Number: 45397			
ULCS# 4020													Management Planner: M. Causley			
Year Built: 1926													Certificate Number: ACC-0215-8-010			
Element	Floor	On Site Room Name	System Affected	Material Description	HID#	Confirmed Assumed NAD Non Suspect ACM	Amount of Material	SF LF EA	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic / Crawl Space Ranking	Damage Potential (DP)	Newly Friable (NF)	Response Action (RA)
1	5	Halfway From Classroom 511 to Stairwell near Classroom 511	M	Floor Tile VAT 9" x 9"	4020/01/05/63	Confirmed	504	SF	0	SF	Brown	Vacant floor		1	No	1/D
1	5	Halfway From Classroom 511 to Stairwell near Classroom 511	N/A	Cement Floor		Non Suspect ACM	504	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5	Halfway From Classroom 511 to Stairwell near Classroom 511	N/A	Fireproofing		NAD	504	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5	Fire Tower near Classroom 511	X	X		X	X	X	X	X	X	Vacant Floor. No visible access from this floor, however access may be gained from the 4th Floor		X	X	X
1	5	Stairwell near Classroom 511	N/A	Plaster Ceiling		NAD	375	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5	Stairwell near Classroom 511	N/A	Sheetrock Ceiling		Non Suspect ACM	375	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5	Stairwell near Classroom 511	N/A	Metal Ceiling		Non Suspect ACM	375	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5	Stairwell near Classroom 511	N/A	Plaster Walls		NAD	960	SF	25	SF		Vacant floor		N/A	N/A	N/A
1	5	Stairwell near Classroom 511	N/A	Sheetrock Wall		Non Suspect ACM	960	SF	25	SF		Vacant floor		N/A	N/A	N/A
1	5	Stairwell near Classroom 511	N/A	Cement Floor		Non Suspect ACM	375	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5	Stairwell near Classroom 511	N/A	Fireproofing		NAD	375	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5	Halfway leading from Fan Room towards Classroom 511	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	45	LF	4	LF		Vacant floor		N/A	N/A	N/A
1	5	Halfway leading from Fan Room towards Classroom 511	N/A	Plaster Ceiling		NAD	555	SF	30	SF		Vacant floor		N/A	N/A	N/A
1	5	Halfway leading from Fan Room towards Classroom 511	N/A	Plaster Walls		NAD	1020	SF	180	SF		Vacant floor		N/A	N/A	N/A
1	5	Halfway leading from Fan Room towards Classroom 511	N/A	Cement Floor		Non Suspect ACM	555	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	5	5th floor Fan Room	M	Vibration Damper Cloth	4020/01/05/65	Assumed	15	SF	1	SF		Vacant floor		1	No	6/C
1	5	Greenhouse	X	X		X	X	X	X	X	X	Greenhouse has been removed. Area is now just an exterior roof.		X	X	X
1	B	ROTC Gym	T	Pipe Fitting Insulation	4020/01/0B/13	Confirmed	2	EA	0	EA				1	No	1/D
1	B	ROTC Gym	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	60	LF	0	LF				N/A	N/A	N/A
1	B	ROTC Gym	N/A	Concrete Ceiling		Non Suspect ACM	1625	SF	0	SF				N/A	N/A	N/A
1	B	ROTC Gym	N/A	Metal Ceiling		Non Suspect ACM	1625	SF	0	SF				N/A	N/A	N/A
1	B	ROTC Gym	N/A	Brick Wall		Non Suspect ACM	6340	SF	0	SF				N/A	N/A	N/A
1	B	ROTC Gym	N/A	Sheetrock Wall		Non Suspect ACM	450	SF	0	SF				N/A	N/A	N/A
1	B	ROTC Gym	M	Floor Tile VAT 12" x 12"	4020/01/0B/A1	Assumed	3250	SF	0	SF	Grey			1	No	1/D
1	B	ROTC Gym	N/A	Cement Floor		Non Suspect ACM	3250	SF	0	SF				N/A	N/A	N/A
1	B	ROTC Gym	M	Vibration Damper Cloth	4020/01/0B/12	Assumed	12	SF	0	SF				1	No	1/D
1	B	ROTC Uniform Supply Room	N/A	Concrete Ceiling		Non Suspect ACM	1050	SF	0	SF				N/A	N/A	N/A
1	B	ROTC Uniform Supply Room	N/A	Brick Wall		Non Suspect ACM	540	SF	0	SF				N/A	N/A	N/A
1	B	ROTC Uniform Supply Room	N/A	Sheetrock Wall		Non Suspect ACM	370	SF	0	SF				N/A	N/A	N/A
1	B	ROTC Uniform Supply Room	N/A	Cement Floor		Non Suspect ACM	1050	SF	0	SF				N/A	N/A	N/A
1	B	ROTC Rifle Storage Room	N/A	Plaster Ceiling		NAD	130	SF	0	SF				N/A	N/A	N/A
1	B	ROTC Rifle Storage Room	N/A	Concrete Ceiling		Non Suspect ACM	130	SF	0	SF		Access to this space is through the ROTC Uniform Supply Room only		N/A	N/A	N/A
1	B	ROTC Rifle Storage Room	N/A	Plaster Walls		NAD	555	SF	20	SF		Access to this space is through the ROTC Uniform Supply Room only		N/A	N/A	N/A
1	B	ROTC Rifle Storage Room	N/A	Brick Wall		Non Suspect ACM	260	SF	0	SF		Access to this space is through the ROTC Uniform Supply Room only		N/A	N/A	N/A
1	B	ROTC Rifle Storage Room	N/A	Cement Floor		Non Suspect ACM	260	SF	0	SF		Access to this space is through the ROTC Uniform Supply Room only		N/A	N/A	N/A
1	B	ROTC Field Equipment Storage Room	N/A	Plaster Ceiling		NAD	120	SF	0	SF		Access to this space is through the ROTC Uniform Supply Room and ROTC Rifle Storage Room only		N/A	N/A	N/A
1	B	ROTC Field Equipment Storage Room	N/A	Plaster Walls		NAD	520	SF	0	SF		Access to this space is through the ROTC Uniform Supply Room and ROTC Rifle Storage Room only		N/A	N/A	N/A
1	B	ROTC Field Equipment Storage Room	N/A	Cement Floor		Non Suspect ACM	120	SF	0	SF		Access to this space is through the ROTC Uniform Supply Room and ROTC Rifle Storage Room only		N/A	N/A	N/A
1	B	ROTC Command Center	T	Pipe Fitting Insulation	4020/01/0B/13	Confirmed	4	EA	0	EA				1	No	1/D
1	B	ROTC Command Center	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	25	LF	0	LF				N/A	N/A	N/A
1	B	ROTC Command Center	N/A	Concrete Ceiling		Non Suspect ACM	440	SF	0	SF				N/A	N/A	N/A
1	B	ROTC Command Center	N/A	Plaster Walls		NAD	420	SF	0	SF				N/A	N/A	N/A
1	B	ROTC Command Center	N/A	Wood Wall		Non Suspect ACM	85	SF	0	SF				N/A	N/A	N/A
1	B	ROTC Command Center	N/A	Brick Wall		Non Suspect ACM	115	SF	0	SF				N/A	N/A	N/A
1	B	ROTC Command Center	M	Floor Tile VAT 12" x 12"	4020/01/0B/A1	Assumed	440	SF	0	SF	White			1	No	1/D
1	B	ROTC Command Center	N/A	Cement Floor		Non Suspect ACM	440	SF	0	SF				N/A	N/A	N/A
1	B	ROTC Classroom 111A	N/A	Fiberglass Ceiling Tile 2' x 4'		Non Suspect ACM	1010	SF	0	LF				N/A	N/A	N/A
1	B	ROTC Classroom 111A	N/A	Plaster Ceiling		NAD	1010	SF	0	SF				N/A	N/A	N/A
1	B	ROTC Classroom 111A	N/A	Sheetrock Wall		Non Suspect ACM	600	SF	0	SF				N/A	N/A	N/A
1	B	ROTC Classroom 111A	N/A	Brick Wall		Non Suspect ACM	850	SF	0	SF				N/A	N/A	N/A
1	B	ROTC Classroom 111A	M	Floor Tile VAT 12" x 12"	4020/01/0B/A1	Assumed	1010	SF	0	SF	Grey			1	No	1/D
1	B	ROTC Classroom 111A	N/A	Cement Floor		Non Suspect ACM	1010	SF	0	SF				N/A	N/A	N/A
1	B	ROTC Classroom 111A Closet	N/A	Fiberglass Ceiling Tile 2' x 4'		Non Suspect ACM	115	SF	0	SF				N/A	N/A	N/A
1	B	ROTC Classroom 111A Closet	N/A	Plaster Ceiling		NAD	115	SF	0	SF				N/A	N/A	N/A
1	B	ROTC Classroom 111A Closet	N/A	Plaster Walls		NAD	220	SF	0	SF				N/A	N/A	N/A
1	B	ROTC Classroom 111A Closet	N/A	Sheetrock Wall		Non Suspect ACM	220	SF	0	SF				N/A	N/A	N/A
1	B	ROTC Classroom 111A Closet	M	Floor Tile VAT 12" x 12"	4020/01/0B/A1	Assumed	115	SF	0	SF	Tan			1	No	1/D
1	B	ROTC Classroom 111A Closet	N/A	Cement Floor		Non Suspect ACM	115	SF	0	SF				N/A	N/A	N/A
1	B	Office 1 SG Worley	N/A	Fiberglass Ceiling Tile 2' x 4'		Non Suspect ACM	1120	SF	0	SF				N/A	N/A	N/A
1	B	Office 1 SG Worley	N/A	Plaster Ceiling		NAD	1120	SF	0	SF				N/A	N/A	N/A
1	B	Office 1 SG Worley	N/A	Sheetrock Wall		Non Suspect ACM	480	SF	0	SF				N/A	N/A	N/A
1	B	Office 1 SG Worley	N/A	Brick Wall		Non Suspect ACM	1105	SF	0	SF				N/A	N/A	N/A
1	B	Office 1 SG Worley	M	Floor Tile VAT 12" x 12"	4020/01/0B/A1	Assumed	1120	SF	0	SF	Grey			1	No	1/D
1	B	Office 1 SG Worley	N/A	Cement Floor		Non Suspect ACM	1120	SF	0	SF				N/A	N/A	N/A
1	B	Office 1 SG Worley Restroom	T	Pipe Fitting Insulation	4020/01/0B/13	Confirmed	13	EA	0	EA				1	No	1/D
1	B	Office 1 SG Worley Restroom	T	Pipe Insulation 2-6 inch	4020/01/0B/04	Confirmed	12	LF	0	LF				1	No	1/D
1	B	Office 1 SG Worley Restroom	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	38	LF	0	LF				N/A	N/A	N/A
1	B	Office 1 SG Worley Restroom	N/A	Plaster Ceiling		NAD	155	SF	0	SF				N/A	N/A	N/A
1	B	Office 1 SG Worley Restroom	N/A	Plaster Walls		NAD	400	SF	20	SF				N/A	N/A	N/A
1	B	Office 1 SG Worley Restroom	M	Floor Tile VAT 12" x 12"	4020/01/0B/A1	Assumed	155	SF	0	SF	Grey			1	No	1/D
1	B	Office 1 SG Worley Restroom	N/A	Cement Floor		Non Suspect ACM	155	SF	0	SF				N/A	N/A	N/A
1	B	Office 1 SG Worley Restroom Closet	N/A	Plaster Ceiling		NAD	35	SF	0	SF				N/A	N/A	N/A

4020 Overbrook HS 2015-2016 AHERA Three Year Report

School District of Philadelphia Overbrook High School 5898 Lancaster Avenue, Philadelphia, PA 19131 ULCS# 4020 Year Built: 1926			AHERA Three-Year Reinspection 2015-2016 Room by Room Location Log Report										Reinspection Date: 10/21/2015 Building Inspector: Bernard Brunner Certificate Number: 45397 Management Planner: M. Causley Certificate Number: ACC-0215-8-010							
Element	Floor	On Site Room Name	System Affected	Material Description	HID#	Confirmed Assumed NAD Non Suspect ACM	Amount of Material	SF LF EA	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic / Crawl Space Ranking	Damage Potential (DP)	Newly Friable (NF)	Response Action (RA)				
1	B	Office 1 SG Worley Restroom Closet	N/A	Concrete Ceiling		Non Suspect ACM	35	SF	0	SF				N/A	N/A	N/A				
1	B	Office 1 SG Worley Restroom Closet	N/A	Plaster Walls		NAD	275	SF	0	SF				N/A	N/A	N/A				
1	B	Office 1 SG Worley Restroom Closet	N/A	Wood Floor		Non Suspect ACM	70	SF	0	SF				N/A	N/A	N/A				
1	B	Vestibule at Entrance to ROTC Classroom 111A & Office 1 SG Worley	N/A	Fiberglass Ceiling Tile 2' x 4'		Non Suspect ACM	90	SF	0	SF				N/A	N/A	N/A				
1	B	Vestibule at Entrance to ROTC Classroom 111A & Office 1 SG Worley	N/A	Plaster Ceiling		NAD	90	SF	0	SF				N/A	N/A	N/A				
1	B	Vestibule at Entrance to ROTC Classroom 111A & Office 1 SG Worley	N/A	Sheetrock Wall		Non Suspect ACM	265	SF	0	SF				N/A	N/A	N/A				
1	B	Vestibule at Entrance to ROTC Classroom 111A & Office 1 SG Worley	N/A	Brick Wall		Non Suspect ACM	145	SF	0	SF				N/A	N/A	N/A				
1	B	Vestibule at Entrance to ROTC Classroom 111A & Office 1 SG Worley	M	Floor Tile VAT 12" x 12"	4020/01/0B/A1	Assumed	90	SF	0	SF	Grey			1	No	1/D				
1	B	Vestibule at Entrance to ROTC Classroom 111A & Office 1 SG Worley	N/A	Cement Floor		Non Suspect ACM	90	SF	0	SF				N/A	N/A	N/A				
1	B	ROTC Locker Room	T	Pipe Fitting Insulation	4020/01/0B/13	Confirmed	4	EA	0	EA				1	No	1/D				
1	B	ROTC Locker Room	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	21	LF	0	LF				N/A	N/A	N/A				
1	B	ROTC Locker Room	N/A	Concrete Ceiling		Non Suspect ACM	280	SF	0	SF				N/A	N/A	N/A				
1	B	ROTC Locker Room	N/A	Brick Wall		Non Suspect ACM	550	SF	0	SF				N/A	N/A	N/A				
1	B	ROTC Locker Room	N/A	Cement Floor		Non Suspect ACM	280	SF	0	SF				N/A	N/A	N/A				
1	B	ROTC Locker Room	T	Heat Shield Insulation	4020/01/0B/AET/BB/1600	Assumed	3	SF	0	SF				1	No	1/D				
1	B	ROTC Restroom	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	46	LF	0	LF				N/A	N/A	N/A				
1	B	ROTC Restroom	N/A	Concrete Ceiling		Non Suspect ACM	130	SF	0	SF				N/A	N/A	N/A				
1	B	ROTC Restroom	N/A	Brick Wall		Non Suspect ACM	435	SF	0	SF				N/A	N/A	N/A				
1	B	ROTC Restroom	N/A	Marble Walls		Non Suspect ACM	135	SF	0	SF				N/A	N/A	N/A				
1	B	ROTC Restroom	N/A	Cement Floor		Non Suspect ACM	130	SF	0	SF				N/A	N/A	N/A				
1	B	ROTC Restroom	T	Heat Shield Insulation	4020/01/0B/AET/BB/1600	Assumed	1	SF	0	SF				1	No	1/D				
1	B	Hallway outside ROTC Gym - ROTC Restroom	T	Pipe Fitting Insulation	4020/01/0B/13	Confirmed	4	EA	0	EA				1	No	1/D				
1	B	Hallway outside ROTC Gym - ROTC Restroom	T	Pipe Insulation 2-6 inch	4020/01/0B/04	Confirmed	12	LF	0	LF				1	No	1/D				
1	B	Hallway outside ROTC Gym - ROTC Restroom	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	6	SF	0	SF				N/A	N/A	N/A				
1	B	Hallway outside ROTC Gym - ROTC Restroom	N/A	Plaster Ceiling		NAD	350	SF	0	SF				N/A	N/A	N/A				
1	B	Hallway outside ROTC Gym - ROTC Restroom	N/A	Concrete Ceiling		Non Suspect ACM	350	SF	0	SF				N/A	N/A	N/A				
1	B	Hallway outside ROTC Gym - ROTC Restroom	N/A	Brick Wall		Non Suspect ACM	1220	SF	0	SF				N/A	N/A	N/A				
1	B	Hallway outside ROTC Gym - ROTC Restroom	N/A	Cement Floor		Non Suspect ACM	700	SF	0	SF				N/A	N/A	N/A				
1	B	Boiler Room	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	500	LF	30	SF				N/A	N/A	N/A				
1	B	Left Tank Room	X	X		X	X	X	X	X	X	No suspect ACM		X	X	X				
1	B	Right Tank Room	X	X		X	X	X	X	X	X	No suspect ACM		X	X	X				
1	B	Mechanical Room below Electrical Room	X	X		X	X	X	X	X	X	No suspect ACM		X	X	X				
1	B	Stairwell from Kitchen to Boiler Room Restroom for Female Cafeteria Staff	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	80	LF	0	LF				N/A	N/A	N/A				
1	B	Stairwell from Kitchen to Boiler Room Restroom for Female Cafeteria Staff	N/A	Concrete Ceiling		Non Suspect ACM	120	SF	0	SF				N/A	N/A	N/A				
1	B	Stairwell from Kitchen to Boiler Room Restroom for Female Cafeteria Staff	N/A	Brick Wall		Non Suspect ACM	355	SF	0	SF				N/A	N/A	N/A				
1	B	Stairwell from Kitchen to Boiler Room Restroom for Female Cafeteria Staff	M	Floor Tile VAT 12" x 12"	4020/01/0B/A1	Assumed	120	SF	0	SF	Unknown			1	No	1/D				
1	B	Stairwell from Kitchen to Boiler Room Restroom for Female Cafeteria Staff	N/A	Cement Floor		Non Suspect ACM	120	SF	0	SF				N/A	N/A	N/A				
1	B	Electrical Room	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	25	LF	0	LF				N/A	N/A	N/A				
1	B	Fan Room Blower Room 2	M	Vibration Damper Cloth	4020/01/0B/12	Assumed	25	SF	0	SF				1	No	1/D				
1	B	Building Engineer's Office Common Area	T	Pipe Fitting Insulation	4020/01/0B/13	Confirmed	10	EA	0	EA				1	No	1/D				
1	B	Building Engineer's Office Common Area	T	Pipe Insulation > 6 inch	4020/01/0B/03	Confirmed	22	LF	0	LF				1	No	1/D				
1	B	Building Engineer's Office Common Area	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	90	LF	0	LF				N/A	N/A	N/A				
1	B	Building Engineer's Office Common Area	N/A	Concrete Ceiling		Non Suspect ACM	500	SF	0	SF				N/A	N/A	N/A				
1	B	Building Engineer's Office Common Area	N/A	Wood Wall		Non Suspect ACM	180	SF	0	SF				N/A	N/A	N/A				
1	B	Building Engineer's Office Common Area	N/A	Metal Walls		Non Suspect ACM	225	SF	0	SF				N/A	N/A	N/A				
1	B	Building Engineer's Office Common Area	N/A	Sheetrock Wall		Non Suspect ACM	185	SF	0	SF				N/A	N/A	N/A				
1	B	Building Engineer's Office Common Area	N/A	Brick Wall		Non Suspect ACM	660	SF	0	SF				N/A	N/A	N/A				
1	B	Building Engineer's Office Common Area	N/A	Cement Floor		Non Suspect ACM	500	SF	0	SF				N/A	N/A	N/A				
1	B	Building Engineer's Office Common Area	M	Linoleum	4020/01/0B/AET/BB/2200	Assumed	15	SF	0	SF		Located on countertop		1	No	1/D				
1	B	Building Engineer's Office	N/A	Concrete Ceiling		Non Suspect ACM	195	SF	0	SF				N/A	N/A	N/A				
1	B	Building Engineer's Office	N/A	Metal Walls		Non Suspect ACM	225	SF	0	SF				N/A	N/A	N/A				
1	B	Building Engineer's Office	N/A	Brick Wall		Non Suspect ACM	420	SF	0	SF				N/A	N/A	N/A				
1	B	Building Engineer's Office	N/A	Cement Floor		Non Suspect ACM	195	SF	0	SF				N/A	N/A	N/A				
1	B	Building Engineer's Office Area Conference Room/Break Room	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	54	LF	0	LF				N/A	N/A	N/A				
1	B	Building Engineer's Office Area Conference Room/Break Room	N/A	Concrete Ceiling		Non Suspect ACM	375	SF	0	SF				N/A	N/A	N/A				
1	B	Building Engineer's Office Area Conference Room/Break Room	N/A	Wood Wall		Non Suspect ACM	320	SF	0	SF				N/A	N/A	N/A				
1	B	Building Engineer's Office Area Conference Room/Break Room	N/A	Brick Wall		Non Suspect ACM	600	SF	0	SF				N/A	N/A	N/A				
1	B	Building Engineer's Office Area Conference Room/Break Room	N/A	Cement Floor		Non Suspect ACM	375	SF	0	SF				N/A	N/A	N/A				
1	B	Building Engineer's Office Area Storage Room	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	14	LF	0	LF				N/A	N/A	N/A				
1	B	Building Engineer's Office Area Storage Room	N/A	Concrete Ceiling		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A				
1	B	Building Engineer's Office Area Storage Room	N/A	Wood Wall		Non Suspect ACM	265	SF	0	SF				N/A	N/A	N/A				
1	B	Building Engineer's Office Area Storage Room	N/A	Brick Wall		Non Suspect ACM	495	SF	0	SF				N/A	N/A	N/A				
1	B	Building Engineer's Office Area Storage Room	N/A	Cement Floor		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A				
1	B	Building Engineer's Office Area 2nd Office	T	Pipe Insulation > 6 inch	4020/01/0B/03	Confirmed	26	LF	0	LF				1	No	1/D				

4020 Overbrook HS 2015-2016 AHERA Three Year Report

School District of Philadelphia			AHERA Three-Year Reinspection 2015-2016										Reinspection Date: 10/21/2015			
Overbrook High School			Room by Room Location Log Report										Building Inspector: Bernard Brunner			
5898 Lancaster Avenue, Philadelphia, PA 19131													Certificate Number: 45397			
ULCS# 4020													Management Planner: M. Causley			
Year Built: 1926													Certificate Number: ACC-0215-8-010			
E l e m e n t	F l o o r	On Site Room Name	System Affected	Material Description	HID#	Confirmed Assumed NAD Non Suspect ACM	Amount of Material	SF LF EA	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic / Crawl Space Ranking	Damage Potential (DP)	Newly Friable (NF)	Response Action (RA)
1	B	Building Engineer's Office Area 2nd Office	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	23	LF	0	LF				N/A	N/A	N/A
1	B	Building Engineer's Office Area 2nd Office	N/A	Concrete Ceiling		Non Suspect ACM	145	SF	0	SF				N/A	N/A	N/A
1	B	Building Engineer's Office Area 2nd Office	N/A	Sheetrock Wall		Non Suspect ACM	185	SF	0	SF				N/A	N/A	N/A
1	B	Building Engineer's Office Area 2nd Office	N/A	Brick Wall		Non Suspect ACM	390	SF	0	SF				N/A	N/A	N/A
1	B	Building Engineer's Office Area 2nd Office	N/A	Cement Floor		Non Suspect ACM	145	SF	0	SF				N/A	N/A	N/A
1	B	Refrigeration Room adjacent Electrical & Fan Rooms	T	Pipe Fitting Insulation	4020/01/0B/13	Confirmed	48	EA	0	EA				1	No	1/D
1	B	Refrigeration Room adjacent Electrical & Fan Rooms	T	Pipe Insulation 2-6 inch	4020/01/0B/04	Confirmed	99	LF	0	LF				1	No	1/D
1	B	Refrigeration Room adjacent Electrical & Fan Rooms	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	100	LF	0	LF				N/A	N/A	N/A
1	B	Refrigeration Room adjacent Electrical & Fan Rooms	N/A	Concrete Ceiling		Non Suspect ACM	625	SF	0	SF				N/A	N/A	N/A
1	B	Refrigeration Room adjacent Electrical & Fan Rooms	N/A	Brick Wall		Non Suspect ACM	1500	SF	0	SF				N/A	N/A	N/A
1	B	Refrigeration Room adjacent Electrical & Fan Rooms	N/A	Cement Floor		Non Suspect ACM	625	SF	0	SF				N/A	N/A	N/A
1	B	Janitorial Supply Storage Room off Hallway outside Boiler Room	N/A	Plaster Ceiling		NAD	220	SF	30	SF				N/A	N/A	N/A
1	B	Janitorial Supply Storage Room off Hallway outside Boiler Room	N/A	Brick Wall		Non Suspect ACM	685	SF	0	SF				N/A	N/A	N/A
1	B	Janitorial Supply Storage Room off Hallway outside Boiler Room	N/A	Cement Floor		Non Suspect ACM	220	SF	1	SF				N/A	N/A	N/A
1	B	Common Area outside Janitorial Supply Storage Room, Building Engineer's Storage Room, & Elevator Mechanical Room off Hallway outside Boiler Room	N/A	Concrete Ceiling		Non Suspect ACM	75	SF	0	SF				N/A	N/A	N/A
1	B	Common Area outside Janitorial Supply Storage Room, Building Engineer's Storage Room, & Elevator Mechanical Room off Hallway outside Boiler Room	N/A	Brick Wall		Non Suspect ACM	240	SF	0	SF				N/A	N/A	N/A
1	B	Common Area outside Janitorial Supply Storage Room, Building Engineer's Storage Room, & Elevator Mechanical Room off Hallway outside Boiler Room	N/A	Cement Floor		Non Suspect ACM	75	SF	0	SF				N/A	N/A	N/A
1	B	Building Engineer's Storage Room off Hallway outside Boiler Room	N/A	Concrete Ceiling		Non Suspect ACM	250	SF	0	SF				N/A	N/A	N/A
1	B	Building Engineer's Storage Room off Hallway outside Boiler Room	N/A	Brick Wall		Non Suspect ACM	340	SF	0	SF				N/A	N/A	N/A
1	B	Building Engineer's Storage Room off Hallway outside Boiler Room	N/A	Concrete Wall		Non Suspect ACM	195	SF	0	SF				N/A	N/A	N/A
1	B	Building Engineer's Storage Room off Hallway outside Boiler Room	N/A	Cement Floor		Non Suspect ACM	250	SF	0	SF				N/A	N/A	N/A
1	B	Elevator Mechanical Room off Hallway outside Boiler Room	M	Transite Electrical Panel	4020/01/0B/AET/BB/2350	Assumed	15	SF	0	SF		Transite panel associated with Elevator		1	No	1/D
1	B	Stairwell from Kitchen to Hallway outside Boiler Room Old Walk-in Refrigerator Room	T	Pipe Fitting Insulation	4020/01/0B/13	Confirmed	4	EA	0	EA				1	No	1/D
1	B	Stairwell from Kitchen to Hallway outside Boiler Room Old Walk-in Refrigerator Room	T	Pipe Insulation 2-6 inch	4020/01/0B/04	Confirmed	31	LF	0	LF				1	No	1/D
1	B	Stairwell from Kitchen to Hallway outside Boiler Room Old Walk-in Refrigerator Room	N/A	Concrete Ceiling		Non Suspect ACM	90	SF	0	SF				N/A	N/A	N/A
1	B	Stairwell from Kitchen to Hallway outside Boiler Room Old Walk-in Refrigerator Room	N/A	Brick Wall		Non Suspect ACM	365	SF	0	SF				N/A	N/A	N/A
1	B	Walk-in Refrigerator Room	N/A	Cement Floor		Non Suspect ACM	90	SF	0	SF				N/A	N/A	N/A
1	B	Former Daycare Infants	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	106	LF	0	LF				N/A	N/A	N/A
1	B	Former Daycare Infants	N/A	Fiberglass Ceiling Tile 2' x 4'		NAD	840	SF	0	SF				N/A	N/A	N/A
1	B	Former Daycare Infants	N/A	Concrete Ceiling		Non Suspect ACM	840	SF	0	SF				N/A	N/A	N/A
1	B	Former Daycare Infants	N/A	Sheetrock Wall		Non Suspect ACM	810	SF	0	SF				N/A	N/A	N/A
1	B	Former Daycare Infants	N/A	Brick Wall		Non Suspect ACM	1230	SF	0	SF				N/A	N/A	N/A
1	B	Former Daycare Infants	M	Floor Tile VAT 12" x 12"	4020/01/0B/A1	Assumed	700	SF	28	SF	Orange			1	No	6/C
1	B	Former Daycare Infants	M	Floor Tile VAT 12" x 12"	4020/01/0B/A1	Assumed	115	SF	0	SF	Tan			1	No	1/D
1	B	Former Daycare Infants	N/A	Cement Floor		Non Suspect ACM	815	SF	0	SF				N/A	N/A	N/A
1	B	Former Daycare Infants	N/A	Carpet		Non Suspect ACM	360	SF	0	SF		Carpet over 12 x 12 Floor Tile		N/A	N/A	N/A
1	B	Former Daycare Exterior Entrance Vestibule	N/A	Sheetrock Ceiling		Non Suspect ACM	25	SF	0	SF				N/A	N/A	N/A
1	B	Former Daycare Exterior Entrance Vestibule	N/A	Sheetrock Wall		Non Suspect ACM	105	SF	0	SF				N/A	N/A	N/A
1	B	Former Daycare Exterior Entrance Vestibule	M	Floor Tile VAT 12" x 12"	4020/01/0B/A1	Assumed	18	SF	0	SF	Orange			1	No	1/D
1	B	Former Daycare Exterior Entrance Vestibule	M	Floor Tile VAT 12" x 12"	4020/01/0B/A1	Assumed	7	SF	0	SF	Tan			1	No	1/D
1	B	Former Daycare Exterior Entrance Vestibule	N/A	Cement Floor		Non Suspect ACM	25	SF	0	SF				N/A	N/A	N/A
1	B	Former Daycare Hallway outside Infants, Restroom, & Kitchen	N/A	Fiberglass Ceiling Tile 2' x 4'		Non Suspect ACM	275	SF	0	SF				N/A	N/A	N/A
1	B	Former Daycare Hallway outside Infants, Restroom, & Kitchen	N/A	Concrete Ceiling		Non Suspect ACM	275	SF	0	SF				N/A	N/A	N/A
1	B	Former Daycare Hallway outside Infants, Restroom, & Kitchen	N/A	Sheetrock Wall		Non Suspect ACM	915	SF	0	SF				N/A	N/A	N/A
1	B	Former Daycare Hallway outside Infants, Restroom, & Kitchen	N/A	Brick Wall		Non Suspect ACM	285	SF	0	SF				N/A	N/A	N/A
1	B	Former Daycare Hallway outside Infants, Restroom, & Kitchen	M	Floor Tile VAT 12" x 12"	4020/01/0B/A1	Assumed	238	SF	0	SF	Orange			1	No	1/D
1	B	Former Daycare Hallway outside Infants, Restroom, & Kitchen	M	Floor Tile VAT 12" x 12"	4020/01/0B/A1	Assumed	37	SF	0	SF	Tan			1	No	1/D
1	B	Former Daycare Hallway outside Infants, Restroom, & Kitchen	N/A	Cement Floor		Non Suspect ACM	275	SF	0	SF				N/A	N/A	N/A
1	B	Former Daycare Hallway outside Infants, Restroom, & Kitchen	M	Transite Electrical Panel	4020/01/0B/AET/BB/2350	Assumed	20	SF	0	SF				1	No	1/D
1	B	Former Daycare Restroom	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	60	LF	0	LF				N/A	N/A	N/A
1	B	Former Daycare Restroom	N/A	Fiberglass Ceiling Tile 2' x 4'		Non Suspect ACM	65	SF	0	SF				N/A	N/A	N/A
1	B	Former Daycare Restroom	N/A	Concrete Ceiling		Non Suspect ACM	65	SF	0	SF				N/A	N/A	N/A
1	B	Former Daycare Restroom	N/A	Sheetrock Wall		Non Suspect ACM	240	SF	0	SF				N/A	N/A	N/A
1	B	Former Daycare Restroom	N/A	Brick Wall		Non Suspect ACM	240	SF	0	SF				N/A	N/A	N/A
1	B	Former Daycare Restroom	M	Floor Tile VAT 12" x 12"	4020/01/0B/A1	Assumed	65	SF	0	SF	Tan			1	No	1/D
1	B	Former Daycare Restroom	N/A	Cement Floor		Non Suspect ACM	65	SF	0	SF				N/A	N/A	N/A

4020 Overbrook HS 2015-2016 AHERA Three Year Report

School District of Philadelphia Overbrook High School 5898 Lancaster Avenue, Philadelphia, PA 19131 ULCS# 4020 Year Built: 1926			AHERA Three-Year Reinspection 2015-2016 Room by Room Location Log Report										Reinspection Date: 10/21/2015 Building Inspector: Bernard Brunner Certificate Number: 45397 Management Planner: M. Causley Certificate Number: ACC-0215-8-010							
E l e m e n t	F l o o r	On Site Room Name	System Affected	Material Description	HID#	Confirmed Assumed NAD Non Suspect ACM	Amount of Material	SF LF EA	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic / Crawl Space Ranking	Damage Potential (DP)	Newly Friable (NF)	Response Action (RA)				
1	B	Former Daycare Kitchen	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	22	LF	0	LF				N/A	N/A	N/A				
1	B	Former Daycare Kitchen	N/A	Fiberglass Ceiling Tile 2' x 4'		Non Suspect ACM	130	SF	0	SF				N/A	N/A	N/A				
1	B	Former Daycare Kitchen	N/A	Concrete Ceiling		Non Suspect ACM	130	SF	0	SF				N/A	N/A	N/A				
1	B	Former Daycare Kitchen	N/A	Sheetrock Wall		Non Suspect ACM	480	SF	0	SF				N/A	N/A	N/A				
1	B	Former Daycare Kitchen	N/A	Brick Wall		Non Suspect ACM	210	SF	0	SF				N/A	N/A	N/A				
1	B	Former Daycare Kitchen	M	Floor Tile VAT 12" x 12"	4020/01/08/A1	Assumed	130	SF	0	SF	Tan			1	No	1/D				
1	B	Former Daycare Kitchen	N/A	Cement Floor		Non Suspect ACM	130	SF	0	SF				N/A	N/A	N/A				
1	B	Former Daycare Office adjacent to Kitchen	N/A	Fiberglass Ceiling Tile 2' x 4'		Non Suspect ACM	155	SF	0	SF				N/A	N/A	N/A				
1	B	Former Daycare Office adjacent to Kitchen	N/A	Concrete Ceiling		Non Suspect ACM	155	SF	0	SF				N/A	N/A	N/A				
1	B	Former Daycare Office adjacent to Kitchen	N/A	Sheetrock Wall		Non Suspect ACM	390	SF	0	SF				N/A	N/A	N/A				
1	B	Former Daycare Office adjacent to Kitchen	N/A	Brick Wall		Non Suspect ACM	390	SF	0	SF				N/A	N/A	N/A				
1	B	Former Daycare Office adjacent to Kitchen	M	Floor Tile VAT 12" x 12"	4020/01/08/A1	Assumed	128	SF	0	SF	Orange			1	No	1/D				
1	B	Former Daycare Office adjacent to Kitchen	M	Floor Tile VAT 12" x 12"	4020/01/08/A1	Assumed	27	SF	0	SF	Tan			1	No	1/D				
1	B	Former Daycare Office adjacent to Kitchen	N/A	Cement Floor		Non Suspect ACM	155	SF	0	SF				N/A	N/A	N/A				
1	B	Former Daycare Office between Infants & Toddlers along Exterior Wall	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	23	LF	0	LF				N/A	N/A	N/A				
1	B	Former Daycare Office between Infants & Toddlers along Exterior Wall	N/A	Fiberglass Ceiling Tile 2' x 4'		Non Suspect ACM	210	SF	0	SF				N/A	N/A	N/A				
1	B	Former Daycare Office between Infants & Toddlers along Exterior Wall	N/A	Concrete Ceiling		Non Suspect ACM	210	SF	0	SF				N/A	N/A	N/A				
1	B	Former Daycare Office between Infants & Toddlers along Exterior Wall	N/A	Sheetrock Wall		Non Suspect ACM	435	SF	0	SF				N/A	N/A	N/A				
1	B	Former Daycare Office between Infants & Toddlers along Exterior Wall	N/A	Brick Wall		Non Suspect ACM	435	SF	0	SF				N/A	N/A	N/A				
1	B	Former Daycare Office between Infants & Toddlers along Exterior Wall	M	Floor Tile VAT 12" x 12"	4020/01/08/A1	Assumed	168	SF	0	SF	Orange			1	No	1/D				
1	B	Former Daycare Office between Infants & Toddlers along Exterior Wall	M	Floor Tile VAT 12" x 12"	4020/01/08/A1	Assumed	42	SF	1	SF	Tan			1	No	6/C				
1	B	Former Daycare Office between Infants & Toddlers along Exterior Wall	N/A	Cement Floor		Non Suspect ACM	210	SF	0	SF				N/A	N/A	N/A				
1	B	Former Daycare Office between Infants & Toddlers along Interior Wall	N/A	Fiberglass Ceiling Tile 2' x 4'		Non Suspect ACM	195	SF	0	SF				N/A	N/A	N/A				
1	B	Former Daycare Office between Infants & Toddlers along Interior Wall	N/A	Concrete Ceiling		Non Suspect ACM	195	SF	0	SF				N/A	N/A	N/A				
1	B	Former Daycare Office between Infants & Toddlers along Interior Wall	N/A	Sheetrock Wall		Non Suspect ACM	420	SF	0	SF				N/A	N/A	N/A				
1	B	Former Daycare Office between Infants & Toddlers along Interior Wall	N/A	Brick Wall		Non Suspect ACM	420	SF	0	SF				N/A	N/A	N/A				
1	B	Former Daycare Office between Infants & Toddlers along Interior Wall	M	Floor Tile VAT 12" x 12"	4020/01/08/A1	Assumed	141	SF	0	SF	Orange			1	No	1/D				
1	B	Former Daycare Office between Infants & Toddlers along Interior Wall	M	Floor Tile VAT 12" x 12"	4020/01/08/A1	Assumed	54	SF	0	SF	Tan			1	No	1/D				
1	B	Former Daycare Office between Infants & Toddlers along Interior Wall	N/A	Cement Floor		Non Suspect ACM	195	SF	0	SF				N/A	N/A	N/A				
1	B	Former Daycare Toddlers	T	Pipe Fitting Insulation	4020/01/08/13	Confirmed	2	EA	0	EA				1	No	1/D				
1	B	Former Daycare Toddlers	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	84	LF	0	LF				N/A	N/A	N/A				
1	B	Former Daycare Toddlers	N/A	Fiberglass Ceiling Tile 2' x 4'		Non Suspect ACM	1200	SF	0	SF				N/A	N/A	N/A				
1	B	Former Daycare Toddlers	N/A	Concrete Ceiling		Non Suspect ACM	1200	SF	0	SF				N/A	N/A	N/A				
1	B	Former Daycare Toddlers	N/A	Brick Wall		Non Suspect ACM	2160	SF	65	SF				N/A	N/A	N/A				
1	B	Former Daycare Toddlers	M	Floor Tile VAT 12" x 12"	4020/01/08/A1	Assumed	1200	SF	0	SF	Tan			1	No	1/D				
1	B	Former Daycare Toddlers	N/A	Cement Floor		Non Suspect ACM	1200	SF	0	SF				N/A	N/A	N/A				
1	B	Former Daycare Toddlers	N/A	Carpet		Non Suspect ACM	400	SF	0	SF		Carpet over 12 x 12 Floor Tile		N/A	N/A	N/A				
1	B	Former Daycare Toddlers Closet	N/A	Concrete Ceiling		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A				
1	B	Former Daycare Toddlers Closet	N/A	Concrete Block Wall		Non Suspect ACM	420	SF	0	SF				N/A	N/A	N/A				
1	B	Former Daycare Toddlers Closet	N/A	Brick Wall		Non Suspect ACM	420	SF	210	SF				N/A	N/A	N/A				
1	B	Former Daycare Toddlers Closet	N/A	Cement Floor		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A				
1	B	Former Daycare Toddlers Restroom	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	85	LF	0	LF				N/A	N/A	N/A				
1	B	Former Daycare Toddlers Restroom	N/A	Fiberglass Ceiling Tile 2' x 4'		Non Suspect ACM	90	SF	0	SF				N/A	N/A	N/A				
1	B	Former Daycare Toddlers Restroom	N/A	Concrete Ceiling		Non Suspect ACM	90	SF	0	SF				N/A	N/A	N/A				
1	B	Former Daycare Toddlers Restroom	N/A	Brick Wall		Non Suspect ACM	195	SF	0	SF				N/A	N/A	N/A				
1	B	Former Daycare Toddlers Restroom	N/A	Concrete Block Wall		Non Suspect ACM	315	SF	0	SF				N/A	N/A	N/A				
1	B	Former Daycare Toddlers Restroom	N/A	Cement Floor		Non Suspect ACM	90	SF	0	SF				N/A	N/A	N/A				
1	B	Cheerleading Gym	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	40	LF	0	LF				N/A	N/A	N/A				
1	B	Cheerleading Gym	N/A	Concrete Ceiling		Non Suspect ACM	1625	SF	0	SF				N/A	N/A	N/A				
1	B	Cheerleading Gym	N/A	Metal Ceiling		Non Suspect ACM	1625	SF	0	SF				N/A	N/A	N/A				
1	B	Cheerleading Gym	N/A	Brick Wall		Non Suspect ACM	6490	SF	0	SF				N/A	N/A	N/A				
1	B	Cheerleading Gym	N/A	Concrete Block Wall		Non Suspect ACM	180	SF	0	SF				N/A	N/A	N/A				
1	B	Cheerleading Gym	N/A	Wood Wall		Non Suspect ACM	120	SF	0	SF				N/A	N/A	N/A				
1	B	Cheerleading Gym	M	Floor Tile VAT 12" x 12"	4020/01/08/A1	Assumed	2074	SF	0	SF	Grey			1	No	1/D				
1	B	Cheerleading Gym	M	Floor Tile VAT 12" x 12"	4020/01/08/A1	Assumed	1211	SF	0	SF	Black			1	No	1/D				
1	B	Cheerleading Gym	M	Floor Tile VAT 12" x 12"	4020/01/08/A1	Confirmed	2	SF	0	SF	Green	Tiles been painted over. 105 SF confirmed black mastic has also been painted over.		1	No	1/D				
1	B	Cheerleading Gym	N/A	Cement Floor		Non Suspect ACM	3390	SF	0	SF				N/A	N/A	N/A				
1	B	Cheerleading Gym	M	Vibration Damper Cloth	4020/01/08/12	Assumed	12	SF	0	SF				1	No	1/D				
1	B	Cheerleading Gym Storage Room with Door	N/A	Concrete Ceiling		Non Suspect ACM	505	SF	0	SF				N/A	N/A	N/A				
1	B	Cheerleading Gym Storage Room with Door	N/A	Brick Wall		Non Suspect ACM	415	SF	0	SF				N/A	N/A	N/A				
1	B	Cheerleading Gym Storage Room with Door	N/A	Concrete Block Wall		Non Suspect ACM	325	SF	0	SF				N/A	N/A	N/A				
1	B	Cheerleading Gym Storage Room with Door	M	Floor Tile VAT 12" x 12"	4020/01/08/A1	Assumed	505	SF	0	SF	Tan			1	No	1/D				
1	B	Cheerleading Gym Storage Room with Door	N/A	Cement Floor		Non Suspect ACM	505	SF	0	SF				N/A	N/A	N/A				

4020 Overbrook HS 2015-2016 AHERA Three Year Report

School District of Philadelphia		AHERA Three-Year Reinspection 2015-2016 Room by Room Location Log Report										Reinspection Date: 10/21/2015 Building Inspector: Bernard Brunner Certificate Number: 45397 Management Planner: M. Causley Certificate Number: ACC-0215-8-010										
Overbrook High School 5898 Lancaster Avenue, Philadelphia, PA 19131 ULCS# 4020 Year Built: 1926																						
Element	Floor											Attic / Crawl Space Ranking	Damage Potential (DP)	Newly Friable (NF)	Response Action (RA)							
		On Site Room Name	System Affected	Material Description	HID#	Confirmed	Assumed	NAD	Non Suspect ACM	Amount of Material	SF					LF	EA	Amount of Damage	SF	LF	EA	Color required for VAT
1	B	Cheerleading Gym Storage Room with Gate	X	X			X		X	X	X	X	X					No Access - No Combination for Lock. It appears that there is exposed asbestos containing Black Mastic in this space.		X	X	X
1	B	Storage Room adjacent Blower Room 4	X	X			X		X	X	X	X	X					No Access - No Keys for Padlocks		X	X	X
1	B	Hallway to Blower Room 4 Office	N/A		Fiberglass Pipe Insulation			Non Suspect ACM	25	LF	0	LF								N/A	N/A	N/A
1	B	Hallway to Blower Room 4 Office	N/A		Concrete Ceiling			Non Suspect ACM	110	SF	0	SF								N/A	N/A	N/A
1	B	Hallway to Blower Room 4 Office	N/A		Sheetrock Wall			Non Suspect ACM	360	SF	0	SF								N/A	N/A	N/A
1	B	Hallway to Blower Room 4 Office	N/A		Brick Wall			Non Suspect ACM	225	SF	0	SF								N/A	N/A	N/A
1	B	Hallway to Blower Room 4 Office	M		Blackboard Glue Dots	4020/01/0B/AET/BB/2600		Assumed	90	SF	0	SF								1	No	1/D
1	B	Hallway to Blower Room 4 Office	N/A		Cement Floor			Non Suspect ACM	110	SF	0	SF								N/A	N/A	N/A
1	B	Fan Room Blower Room 4	T		Pipe Fitting Insulation	4020/01/0B/13		Confirmed	80	EA	1	EA						DDC written up		1	Yes	2/B
1	B	Fan Room Blower Room 4	T		Pipe Insulation 2-6 inch	4020/01/0B/04		Confirmed	345	LF	1	LF						DDC written up		1	Yes	2/B
1	B	Fan Room Blower Room 4	T		Pipe Insulation > 6 inch	4020/01/0B/03		Confirmed	22	LF	0	LF								1	No	1/D
1	B	Fan Room Blower Room 4	N/A		Fiberglass Pipe Insulation			Non Suspect ACM	150	LF	0	LF								N/A	N/A	N/A
1	B	Fan Room Blower Room 4	M		Vibration Damper Cloth	4020/01/0B/12		Assumed	25	SF	0	SF								1	No	1/D
1	B	Hallway to Blower Room 4	T		Pipe Fitting Insulation	4020/01/0B/13		Confirmed	44	EA	0	EA								1	No	1/D
1	B	Hallway to Blower Room 4	T		Pipe Insulation 2-6 inch	4020/01/0B/04		Confirmed	305	LF	0	LF								1	No	1/D
1	B	Hallway to Blower Room 4	N/A		Fiberglass Pipe Insulation			Non Suspect ACM	50	SF	0	SF								N/A	N/A	N/A
1	B	Hallway to Blower Room 4	N/A		Concrete Ceiling			Non Suspect ACM	1165	SF	0	SF								N/A	N/A	N/A
1	B	Hallway to Blower Room 4	M		Floor Tile VAT 9" x 9"	4020/01/0B/14		Confirmed	360	SF	5	SF	Tan							1	No	6/C
1	B	Hallway to Blower Room 4	N/A		Cement Floor			Non Suspect ACM	1165	SF	0	SF								N/A	N/A	N/A
1	B	Hallway to Blower Room 4	M		Blackboard Glue Dots	4020/01/0B/AET/BB/2600		Assumed	75	SF	0	SF								1	No	1/D
1	B	Break Room in Stairwell from Boiler Room to Electrical Room	T		Pipe Fitting Insulation	4020/01/0B/13		Confirmed	2	EA	0	EA								1	No	1/D
1	B	Break Room in Stairwell from Boiler Room to Electrical Room	T		Pipe Insulation 2-6 inch	4020/01/0B/04		Confirmed	18	LF	0	LF								1	No	1/D
1	B	Break Room in Stairwell from Boiler Room to Electrical Room	N/A		Fiberglass Pipe Insulation			Non Suspect ACM	27	LF	0	LF								N/A	N/A	N/A
1	B	Break Room in Stairwell from Boiler Room to Electrical Room	N/A		Concrete Ceiling			Non Suspect ACM	180	SF	0	SF								N/A	N/A	N/A
1	B	Break Room in Stairwell from Boiler Room to Electrical Room	N/A		Brick Wall			Non Suspect ACM	650	SF	0	SF								N/A	N/A	N/A
1	B	Break Room in Stairwell from Boiler Room to Electrical Room	N/A		Cement Floor			Non Suspect ACM	180	SF	0	SF								N/A	N/A	N/A
1	B	1st Storage Room on Right in Hallway from Stairwell C to Cheerleading Gym	T		Pipe Fitting Insulation	4020/01/0B/13		Confirmed	18	EA	0	EA								1	No	1/D
1	B	1st Storage Room on Right in Hallway from Stairwell C to Cheerleading Gym	N/A		Fiberglass Pipe Insulation			Non Suspect ACM	85	LF	0	LF								N/A	N/A	N/A
1	B	1st Storage Room on Right in Hallway from Stairwell C to Cheerleading Gym	N/A		Concrete Ceiling			Non Suspect ACM	324	SF	0	SF								N/A	N/A	N/A
1	B	1st Storage Room on Right in Hallway from Stairwell C to Cheerleading Gym	N/A		Brick Wall			Non Suspect ACM	650	SF	0	SF								N/A	N/A	N/A
1	B	1st Storage Room on Right in Hallway from Stairwell C to Cheerleading Gym	N/A		Marble Walls			Non Suspect ACM	100	SF	0	SF								N/A	N/A	N/A
1	B	1st Storage Room on Right in Hallway from Stairwell C to Cheerleading Gym	N/A		Cement Floor			Non Suspect ACM	324	SF	0	SF								N/A	N/A	N/A
1	B	2nd Storage Room on Right in Hallway from Stairwell C to Cheerleading Gym	X		X			X	X	X	X	X	X					No Access - No Key		X	X	X
1	B	Storage Room on Left in Hallway from Stairwell C to Cheerleading Gym	N/A		Plaster Ceiling			NAD	130	SF	130	SF								N/A	N/A	N/A
1	B	Storage Room on Left in Hallway from Stairwell C to Cheerleading Gym	N/A		Plaster Walls			NAD	555	SF	200	SF								N/A	N/A	N/A
1	B	Storage Room on Left in Hallway from Stairwell C to Cheerleading Gym	M		Floor Tile VAT 12" x 12"	4020/01/0B/A1		Confirmed	130	SF	0	SF	Green							1	No	1/D
1	B	Storage Room on Left in Hallway from Stairwell C to Cheerleading Gym	N/A		Cement Floor			Non Suspect ACM	130	SF	0	SF								N/A	N/A	N/A
1	B	3rd Storage Room on Right with Gate in Hallway from Stairwell C to Cheerleading Gym	N/A		Concrete Ceiling			Non Suspect ACM	285	SF	0	SF								N/A	N/A	N/A
1	B	3rd Storage Room on Right with Gate in Hallway from Stairwell C to Cheerleading Gym	N/A		Plaster Walls			NAD	540	SF	0	SF								N/A	N/A	N/A
1	B	3rd Storage Room on Right with Gate in Hallway from Stairwell C to Cheerleading Gym	N/A		Marble Walls			Non Suspect ACM	210	SF	0	SF								N/A	N/A	N/A
1	B	3rd Storage Room on Right with Gate in Hallway from Stairwell C to Cheerleading Gym	N/A		Wood Floor			Non Suspect ACM	235	SF	0	SF								N/A	N/A	N/A
1	B	3rd Storage Room on Right with Gate in Hallway from Stairwell C to Cheerleading Gym	N/A		Cement Floor			Non Suspect ACM	50	SF	0	SF								N/A	N/A	N/A
1	B	Hallway from Stairwell C to Cheerleading Gym	T		Pipe Fitting Insulation	4020/01/0B/13		Confirmed	4	EA	0	EA								1	No	1/D
1	B	Hallway from Stairwell C to Cheerleading Gym	T		Pipe Insulation 2-6 inch	4020/01/0B/04		Confirmed	38	LF	0	LF								1	No	1/D
1	B	Hallway from Stairwell C to Cheerleading Gym	N/A		Fiberglass Pipe Insulation			Non Suspect ACM	12	LF	0	LF								N/A	N/A	N/A
1	B	Hallway from Stairwell C to Cheerleading Gym	N/A		Plaster Ceiling			NAD	350	SF	100	SF								N/A	N/A	N/A
1	B	Hallway from Stairwell C to Cheerleading Gym	N/A		Concrete Ceiling			Non Suspect ACM	350	SF	0	SF								N/A	N/A	N/A
1	B	Hallway from Stairwell C to Cheerleading Gym	N/A		Brick Wall			Non Suspect ACM	1220	SF	0	SF								N/A	N/A	N/A
1	B	Hallway from Stairwell C to Cheerleading Gym	N/A		Cement Floor			Non Suspect ACM	700	SF	0	SF								N/A	N/A	N/A
1	B	Gym adjacent Cheerleading Gym	M		Floor Tile VAT 12" x 12"	4020/01/0B/A1		Confirmed	x	X	X	X						No Access - Gym is reportedly sealed due to mold issues. A limited inspection was performed thru a window. More ACM or suspect ACM is likely present.		X	X	X
1	B	Storage Room between Classrooms 10 & 11	T		Pipe Fitting Insulation	4020/01/0B/13		Confirmed	10	EA	0	EA								1	No	1/D
1	B	Storage Room between Classrooms 10 & 11	N/A		Fiberglass Pipe Insulation			Non Suspect ACM	30	LF	0	LF								N/A	N/A	N/A
1	B	Storage Room between Classrooms 10 & 11	N/A		Concrete Ceiling			Non Suspect ACM	210	SF	0	SF								N/A	N/A	N/A
1	B	Storage Room between Classrooms 10 & 11	N/A		Brick Wall			Non Suspect ACM	315	SF	0	SF								N/A	N/A	N/A
1	B	Storage Room between Classrooms 10 & 11	N/A		Cement Floor			Non Suspect ACM	210	SF	0	SF								N/A	N/A	N/A
1	B	Shop Classroom 11	T		Pipe Fitting Insulation	4020/01/0B/13		Confirmed	21	EA	0	EA								1	No	1/D
1	B	Shop Classroom 11	N/A		Fiberglass Pipe Insulation			Non Suspect ACM	275	LF	0	LF								N/A	N/A	N/A
1	B	Shop Classroom 11	N/A		Concrete Ceiling			Non Suspect ACM	1405	SF	0	SF								N/A	N/A	N/A
1	B	Shop Classroom 11	N/A		Brick Wall			Non Suspect ACM	2400	SF	0	SF								N/A	N/A	N/A
1	B	Shop Classroom 11	M		Floor Tile VAT 12" x 12"	4020/01/0B/A1		Assumed	1405	SF	0	SF	Grey							1	No	1/D
1	B	Shop Classroom 11	N/A		Cement Floor			Non Suspect ACM	1405	SF	0	SF								N/A	N/A	N/A
1	B	Shop Classroom 11	M		Transite Electrical Panel	4020/01/0B/AET/BB/2350		Assumed	20	SF	0	SF								1	No	1/D

4020 Overbrook HS 2015-2016 AHERA Three Year Report

School District of Philadelphia			AHERA Three-Year Reinspection 2015-2016										Reinspection Date: 10/21/2015								
Overbrook High School			Room by Room Location Log Report										Building Inspector: Bernard Brunner								
5898 Lancaster Avenue, Philadelphia, PA 19131													Certificate Number: 45397								
ULCS# 4020													Management Planner: M. Causley								
Year Built: 1926													Certificate Number: ACC-0215-8-010								
Element	Floor	Room	On Site Room Name	System Affected	Material Description	HID#	Confirmed Assumed NAD Non Suspect ACM	Amount of Material	SF	LF	EA	Amount of Damage	SF	LF	EA	Color required for VAT	Comments/Description/Notes	Attic / Crawl Space Ranking	Damage Potential (DP)	Newly Friable (NF)	Response Action (RA)
1	B		Shop Classroom 11 Closet	X	X		Confirmed	X	X		X	X	X		X	X	No Access - No Key For Padlock		X	X	X
1	B		Classroom 10	T	Pipe Fitting Insulation	4020/01/0B/13	X	23	EA	0	EA								1	No	1/D
1	B		Classroom 10	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	145	LF	1	LF								N/A	N/A	N/A
1	B		Classroom 10	N/A	Concrete Ceiling		Non Suspect ACM	1030	SF	0	SF								N/A	N/A	N/A
1	B		Classroom 10	N/A	Brick Wall		Non Suspect ACM	1950	SF	0	SF								N/A	N/A	N/A
1	B		Classroom 10	M	Floor Tile VAT 9" x 9"	4020/01/0B/14	Confirmed	1030	SF	0	SF				Brown		Below 12 x 12 Floor Tile		1	No	1/D
1	B		Classroom 10	M	Floor Tile VAT 12" x 12"	4020/01/0B/A1	Assumed	1030	SF	0	SF				Grey		Over 9 x 9 Floor Tile		1	No	1/D
1	B		Classroom 10	N/A	Cement Floor		Non Suspect ACM	1030	SF	0	SF								N/A	N/A	N/A
1	B		Classroom 10	M	Blackboard Glue Dots	4020/01/0B/AET/BB/2600	Assumed	90	SF	0	SF								1	No	1/D
1	B		Classroom 10 Closet	X	X		X	X	X	X	X	X	X	X	X	X	No Access, No Key		X	X	X
1	B		Hallway outside Building Engineer's Office Area	T	Pipe Fitting Insulation	4020/01/0B/13	Confirmed	21	EA	0	EA								1	No	1/D
1	B		Hallway outside Building Engineer's Office Area	T	Pipe Insulation 2-6 inch	4020/01/0B/04	Confirmed	65	LF	0	LF								1	No	1/D
1	B		Hallway outside Building Engineer's Office Area	T	Pipe Insulation > 6 inch	4020/01/0B/03	Confirmed	27	LF	0	LF								1	No	1/D
1	B		Hallway outside Building Engineer's Office Area	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	200	LF	0	LF								N/A	N/A	N/A
1	B		Hallway outside Building Engineer's Office Area	N/A	Concrete Ceiling		Non Suspect ACM	1350	SF	0	SF								N/A	N/A	N/A
1	B		Hallway outside Building Engineer's Office Area	N/A	Brick Wall		Non Suspect ACM	2720	SF	0	SF								N/A	N/A	N/A
1	B		Hallway outside Building Engineer's Office Area	N/A	Cement Floor		Non Suspect ACM	1350	SF	0	SF								N/A	N/A	N/A
1	B		Stairwell C Restroom, Visiting Team Locker Boy's	T	Pipe Fitting Insulation	4020/01/0B/13	Confirmed	11	EA	0	EA								1	No	1/D
1	B		Stairwell C Restroom, Visiting Team Locker Boy's	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	57	LF	0	LF								N/A	N/A	N/A
1	B		Stairwell C Restroom, Visiting Team Locker Boy's	N/A	Concrete Ceiling		Non Suspect ACM	240	SF	0	SF								N/A	N/A	N/A
1	B		Stairwell C Restroom, Visiting Team Locker Boy's	N/A	Brick Wall		Non Suspect ACM	720	SF	0	SF								N/A	N/A	N/A
1	B		Stairwell C Restroom, Visiting Team Locker Boy's	N/A	Marble Walls		Non Suspect ACM	150	SF	0	SF								N/A	N/A	N/A
1	B		Stairwell C Restroom, Visiting Team Locker Boy's	M	Floor Tile VAT 9" x 9"	4020/01/0B/14	Confirmed	200	SF	1	SF				Tan				1	No	6/C
1	B		Stairwell C Restroom, Visiting Team Locker Boy's	N/A	Cement Floor		Non Suspect ACM	240	SF	0	SF								N/A	N/A	N/A
1	B		Hallway outside Classrooms 10 & 11	N/A	Concrete Ceiling		Non Suspect ACM	1590	SF	0	SF								N/A	N/A	N/A
1	B		Hallway outside Classrooms 10 & 11	N/A	Plaster Walls		NAD	1590	SF	0	SF								N/A	N/A	N/A
1	B		Hallway outside Classrooms 10 & 11	N/A	Brick Wall		Non Suspect ACM	1590	SF	0	SF								N/A	N/A	N/A
1	B		Hallway outside Classrooms 10 & 11	N/A	Cement Floor		Non Suspect ACM	1590	SF	0	SF								N/A	N/A	N/A
1	B		Fan Room Blower Room 1 adjacent Hallway to Element 2	T	Pipe Fitting Insulation	4020/01/0B/13	Confirmed	29	EA	0	EA								1	No	1/D
1	B		Fan Room Blower Room 1 adjacent Hallway to Element 2	T	Pipe Insulation 2-6 inch	4020/01/0B/04	Confirmed	170	LF	0	LF								1	No	1/D
1	B		Fan Room Blower Room 1 adjacent Hallway to Element 2	T	Pipe Insulation > 6 inch	4020/01/0B/03	Confirmed	16	LF	0	LF								1	No	1/D
1	B		Fan Room Blower Room 1 adjacent Hallway to Element 2	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	155	LF	0	LF								N/A	N/A	N/A
1	B		Fan Room Blower Room 1 adjacent Hallway to Element 2	M	Vibration Damper Cloth	4020/01/0B/12	Assumed	25	SF	0	SF								1	No	1/D
1	B		Hallway outside Blower Room 1	N/A	Plaster Walls		NAD	795	SF	0	SF								N/A	N/A	N/A
1	B		Hallway outside Blower Room 1	N/A	Marble Walls		Non Suspect ACM	330	SF	0	SF								N/A	N/A	N/A
1	B		Hallway outside Blower Room 1	N/A	Cement Floor		Non Suspect ACM	325	SF	0	SF								N/A	N/A	N/A
1	B		Hallway outside Blower Room 1	M	Troweled on Ceiling	4020/01/0B/A4	Assumed	325	SF	0	SF								1	No	1/D
1	B		Stairwell B Closet	N/A	Plaster Ceiling		NAD	60	SF	0	SF								N/A	N/A	N/A
1	B		Stairwell B Closet	N/A	Plaster Walls		NAD	180	SF	0	SF								N/A	N/A	N/A
1	B		Stairwell B Closet	N/A	Cement Floor		Non Suspect ACM	60	SF	0	SF								N/A	N/A	N/A
1	B		Hallway to Element 2 Connector Inactive	T	Pipe Insulation 2-6 inch	4020/01/0B/04	Confirmed	20	LF	0	LF								1	No	1/D
1	B		Hallway to Element 2 Connector Inactive	N/A	Plaster Walls		NAD	795	SF	0	SF								N/A	N/A	N/A
1	B		Hallway to Element 2 Connector Inactive	N/A	Marble Walls		Non Suspect ACM	330	SF	0	SF								N/A	N/A	N/A
1	B		Hallway to Element 2 Connector Inactive	N/A	Cement Floor		Non Suspect ACM	325	SF	0	SF								N/A	N/A	N/A
1	B		Hallway to Element 2 Connector Inactive	M	Troweled on Ceiling	4020/01/0B/A4	Assumed	325	SF	0	SF								1	No	1/D
2	B		Stairwell to Boy's Locker Room	T	Pipe Fitting Insulation	4020/02/0B/80	Confirmed	7	EA	0	EA								1	No	1/D
2	B		Stairwell to Boy's Locker Room	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	44	LF	0	LF								N/A	N/A	N/A
2	B		Stairwell to Boy's Locker Room	N/A	Concrete Ceiling		Non Suspect ACM	320	SF	0	SF								N/A	N/A	N/A
2	B		Stairwell to Boy's Locker Room	N/A	Concrete Block Wall		Non Suspect ACM	1440	SF	0	SF								N/A	N/A	N/A
2	B		Stairwell to Boy's Locker Room	N/A	Cement Floor		Non Suspect ACM	320	SF	0	SF								N/A	N/A	N/A
2	B		Girl's Locker Room	T	Pipe Fitting Insulation	4020/02/0B/80	Confirmed	134	EA	0	EA								1	No	1/D
2	B		Girl's Locker Room	N/A	Fiberglass Pipe Insulation		NAD	600	SF	0	SF								N/A	N/A	N/A
2	B		Girl's Locker Room	N/A	Concrete Ceiling		Non Suspect ACM	4500	SF	0	SF								N/A	N/A	N/A
2	B		Girl's Locker Room	N/A	Concrete Block Wall		Non Suspect ACM	3360	SF	0	SF								N/A	N/A	N/A
2	B		Girl's Locker Room	N/A	Cement Floor		Non Suspect ACM	4500	SF	0	SF								N/A	N/A	N/A
2	B		Girl's Locker Room	M	Vibration Damper Cloth	4020/02/0B/15	Assumed	50	SF	0	SF								1	No	1/D
2	B		Girl's Locker Room Varsity Room	T	Pipe Fitting Insulation	4020/02/0B/80	Confirmed	43	EA	0	EA								1	No	1/D
2	B		Girl's Locker Room Varsity Room	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	100	LF	0	LF								N/A	N/A	N/A
2	B		Girl's Locker Room Varsity Room	N/A	Concrete Ceiling		Non Suspect ACM	420	SF	0	SF								N/A	N/A	N/A
2	B		Girl's Locker Room Varsity Room	N/A	Concrete Block Wall		Non Suspect ACM	985	SF	0	SF								N/A	N/A	N/A
2	B		Girl's Locker Room Varsity Room	N/A	Cement Floor		Non Suspect ACM	420	SF	0	SF								N/A	N/A	N/A
2	B		Girl's Locker Room Visitor's Locker Room	T	Pipe Fitting Insulation	4020/02/0B/80	Confirmed	77	EA	0	EA								1	No	1/D
2	B		Girl's Locker Room Visitor's Locker Room	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	150	LF	0	LF								N/A	N/A	N/A
2	B		Girl's Locker Room Visitor's Locker Room	N/A	Concrete Ceiling		Non Suspect ACM	240	SF	0	SF								N/A	N/A	N/A
2	B		Girl's Locker Room Visitor's Locker Room	N/A	Concrete Block Wall		Non Suspect ACM	770	SF	0	SF								N/A	N/A	N/A
2	B		Girl's Locker Room Visitor's Locker Room	N/A	Cement Floor		Non Suspect ACM	240	SF	0	SF								N/A	N/A	N/A
2	B		Equipment Room outside Boy's Locker Room	T	Pipe Fitting Insulation	4020/02/0B/80	Confirmed	53	EA	0	EA								1	No	1/D
2	B		Equipment Room outside Boy's Locker Room	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	150	LF	0	LF								N/A	N/A	N/A
2	B		Equipment Room outside Boy's Locker Room	N/A	Concrete Ceiling		Non Suspect ACM	445	SF	0	SF								N/A	N/A	N/A
2	B		Equipment Room outside Boy's Locker Room	N/A	Concrete Block Wall		Non Suspect ACM	1010	SF	0	SF								N/A	N/A	N/A
2	B		Equipment Room outside Boy's Locker Room	N/A	Cement Floor		Non Suspect ACM	445	SF	0	SF								N/A	N/A	N/A
2	B		Boy's Locker Room Small Locker Room to Left of Entrance	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	72	LF	0	LF								N/A	N/A	N/A
2	B		Boy's Locker Room Small Locker Room to Left of Entrance	N/A	Concrete Ceiling		Non Suspect ACM	480	SF	0	SF								N/A	N/A	N/A
2	B		Boy's Locker Room Small Locker Room to Left of Entrance	N/A	Concrete Block Wall		Non Suspect ACM	1105	SF	0	SF								N/A	N/A	N/A
2	B		Boy's Locker Room Small Locker Room to Left of Entrance	N/A	Cement Floor		Non Suspect ACM	480	SF	0	SF								N/A	N/A	N/A
2	B		Boy's Locker Room	T	Pipe Fitting Insulation	4020/02/0B/80	Confirmed	103	EA	0	EA								1	No	1/D
2	B		Boy's Locker Room	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	600	LF	0	LF								N/A	N/A	N/A

4020 Overbrook HS 2015-2016 AHERA Three Year Report

School District of Philadelphia Overbrook High School 5898 Lancaster Avenue, Philadelphia, PA 19131 ULCS# 4020 Year Built: 1926			AHERA Three-Year Reinspection 2015-2016 Room by Room Location Log Report										Reinspection Date: 10/21/2015 Building Inspector: Bernard Brunner Certificate Number: 45397 Management Planner: M. Causley Certificate Number: ACC-0215-8-010								
Element	Floor	On Site Room Name	System Affected	Material Description	HID#	Confirmed Assumed NAD Non Suspect ACM	Amount of Material	SF LF EA	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic / Crawl Space Ranking	Damage Potential (DP)	Newly Friable (NF)	Response Action (RA)					
2	B	Boy's Locker Room	N/A	Concrete Ceiling		Non Suspect ACM	5250	SF	0	SF							N/A	N/A	N/A		
2	B	Boy's Locker Room	N/A	Concrete Block Wall		Non Suspect ACM	3480	SF	0	SF							N/A	N/A	N/A		
2	B	Boy's Locker Room	M	Transite Sills	4020/02/08/17	Confirmed	51	SF	0	SF							1	No	1/D		
2	B	Boy's Locker Room	N/A	Cement Floor		Non Suspect ACM	5250	SF	0	SF							N/A	N/A	N/A		
2	B	Boy's Locker Room	M	Vibration Damper Cloth	4020/02/08/15	Assumed	20	SF	0	SF							1	No	1/D		
2	B	Boy's Locker Room Medium Locker Room to Right of Entrance	T	Pipe Fitting Insulation	4020/02/08/80	Confirmed	52	EA	0	EA							1	No	1/D		
2	B	Boy's Locker Room Medium Locker Room to Right of Entrance	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	250	LF	0	LF							N/A	N/A	N/A		
2	B	Boy's Locker Room Medium Locker Room to Right of Entrance	N/A	Concrete Ceiling		Non Suspect ACM	650	SF	0	SF							N/A	N/A	N/A		
2	B	Boy's Locker Room Medium Locker Room to Right of Entrance	N/A	Concrete Block Wall		Non Suspect ACM	1300	SF	0	SF							N/A	N/A	N/A		
2	B	Boy's Locker Room Medium Locker Room to Right of Entrance	N/A	Cement Floor		Non Suspect ACM	650	SF	0	SF							N/A	N/A	N/A		
2	B	Boy's Locker Room Medium Locker Room to Right of Entrance	M	Vibration Damper Cloth	4020/02/08/15	Assumed	20	SF	0	SF							1	No	1/D		
2	B	Boy's Locker Room Medium Locker Room to Right of Entrance Storage Room	T	Pipe Fitting Insulation	4020/02/08/80	Confirmed	1	EA	0	EA							1	No	1/D		
2	B	Boy's Locker Room Medium Locker Room to Right of Entrance Storage Room	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	12	LF	0	LF							N/A	N/A	N/A		
2	B	Boy's Locker Room Medium Locker Room to Right of Entrance Storage Room	N/A	Concrete Ceiling		Non Suspect ACM	80	SF	0	SF							N/A	N/A	N/A		
2	B	Boy's Locker Room Medium Locker Room to Right of Entrance Storage Room	N/A	Concrete Block Wall		Non Suspect ACM	435	SF	0	SF							N/A	N/A	N/A		
2	B	Boy's Locker Room Medium Locker Room to Right of Entrance Storage Room	N/A	Cement Floor		Non Suspect ACM	80	SF	0	SF							N/A	N/A	N/A		
2	B	Boy's Locker Room Corner Equipment Room	T	Pipe Fitting Insulation	4020/02/08/80	Confirmed	9	EA	0	EA							1	No	1/D		
2	B	Boy's Locker Room Corner Equipment Room	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	45	LF	0	LF							N/A	N/A	N/A		
2	B	Boy's Locker Room Corner Equipment Room	N/A	Concrete Ceiling		Non Suspect ACM	325	SF	0	SF							N/A	N/A	N/A		
2	B	Boy's Locker Room Corner Equipment Room	N/A	Concrete Block Wall		Non Suspect ACM	865	SF	0	SF							N/A	N/A	N/A		
2	B	Boy's Locker Room Corner Equipment Room	N/A	Cement Floor		Non Suspect ACM	325	SF	0	SF							N/A	N/A	N/A		
2	B	Boy's Locker Room Showers	T	Pipe Fitting Insulation	4020/02/08/80	Confirmed	9	EA	0	EA							1	No	1/D		
2	B	Boy's Locker Room Showers	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	60	LF	0	LF							N/A	N/A	N/A		
2	B	Boy's Locker Room Showers	N/A	Concrete Ceiling		Non Suspect ACM	1000	SF	0	SF							N/A	N/A	N/A		
2	B	Boy's Locker Room Showers	N/A	Concrete Block Wall		Non Suspect ACM	1680	SF	0	SF							N/A	N/A	N/A		
2	B	Boy's Locker Room Showers	N/A	Cement Floor		Non Suspect ACM	1000	SF	0	SF							N/A	N/A	N/A		
2	B	Boy's Locker Room Showers Closet	X	X		X	X	X	X	X	X	No access door bolted shut					X	X	X		
2	B	Boy's Locker Room Restroom	T	Pipe Fitting Insulation	4020/02/08/80	Confirmed	11	EA	0	EA							1	No	1/D		
2	B	Boy's Locker Room Restroom	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	70	LF	0	LF							N/A	N/A	N/A		
2	B	Boy's Locker Room Restroom	N/A	Concrete Ceiling		Non Suspect ACM	200	SF	0	SF							N/A	N/A	N/A		
2	B	Boy's Locker Room Restroom	N/A	Concrete Block Wall		Non Suspect ACM	720	SF	0	SF							N/A	N/A	N/A		
2	B	Boy's Locker Room Restroom	N/A	Cement Floor		Non Suspect ACM	200	SF	0	SF							N/A	N/A	N/A		
2	B	Boy's Locker Room Custodial Closet and Pipe Chase	T	Pipe Fitting Insulation	4020/02/08/80	Confirmed	20	EA	0	EA							1	No	1/D		
2	B	Boy's Locker Room Custodial Closet and Pipe Chase	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	100	LF	0	LF							N/A	N/A	N/A		
2	B	Stairwell to Girl's Locker Room	T	Pipe Fitting Insulation	4020/02/08/80	Confirmed	4	EA	0	EA							1	No	1/D		
2	B	Stairwell to Girl's Locker Room	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	10	LF	0	LF							N/A	N/A	N/A		
2	B	Stairwell to Girl's Locker Room	N/A	Concrete Ceiling		Non Suspect ACM	320	SF	0	SF							N/A	N/A	N/A		
2	B	Stairwell to Girl's Locker Room	N/A	Concrete Block Wall		Non Suspect ACM	1440	SF	0	SF							N/A	N/A	N/A		
2	B	Stairwell to Girl's Locker Room	M	Transite Sills	4020/02/08/17	Confirmed	3	SF	0	SF							1	No	1/D		
2	B	Stairwell to Girl's Locker Room	N/A	Cement Floor		Non Suspect ACM	320	SF	0	SF							N/A	N/A	N/A		
2	B	Girl's Locker Room Showers	T	Pipe Fitting Insulation	4020/02/08/80	Confirmed	17	EA	0	EA							1	No	1/D		
2	B	Girl's Locker Room Showers	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	100	LF	0	LF							N/A	N/A	N/A		
2	B	Girl's Locker Room Showers	N/A	Concrete Ceiling		Non Suspect ACM	768	SF	0	SF							N/A	N/A	N/A		
2	B	Girl's Locker Room Showers	N/A	Concrete Block Wall		Non Suspect ACM	1540	SF	0	SF							N/A	N/A	N/A		
2	B	Girl's Locker Room Showers	N/A	Cement Floor		Non Suspect ACM	768	SF	0	SF							N/A	N/A	N/A		
2	B	Girl's Locker Room Showers Closet	N/A	Concrete Ceiling		Non Suspect ACM	20	SF	0	SF							N/A	N/A	N/A		
2	B	Girl's Locker Room Showers Closet	N/A	Concrete Block Wall		Non Suspect ACM	220	SF	0	SF							N/A	N/A	N/A		
2	B	Girl's Locker Room Showers Closet	N/A	Cement Floor		Non Suspect ACM	20	SF	0	SF							N/A	N/A	N/A		
2	B	Girl's Locker Room Restroom	T	Pipe Fitting Insulation	4020/02/08/80	Confirmed	2	EA	0	EA							1	No	1/D		
2	B	Girl's Locker Room Restroom	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	20	LF	0	LF							N/A	N/A	N/A		
2	B	Girl's Locker Room Restroom	N/A	Concrete Ceiling		Non Suspect ACM	187	SF	0	SF							N/A	N/A	N/A		
2	B	Girl's Locker Room Restroom	N/A	Concrete Block Wall		Non Suspect ACM	675	SF	0	SF							N/A	N/A	N/A		
2	B	Girl's Locker Room Restroom	N/A	Cement Floor		Non Suspect ACM	187	SF	0	SF							N/A	N/A	N/A		
2	B	Girl's Locker Room Custodial Closet	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	12	LF	0	LF							N/A	N/A	N/A		
2	B	Girl's Locker Room Custodial Closet	N/A	Duct Work		Non Suspect ACM	25	SF	0	SF							N/A	N/A	N/A		
2	B	Weight Room	X	X		X	X	X	X	X	X	No Access - No Key. On the floorplan there are only 2 spaces numbered in this area. However there are also 4 unnumbered spaces that may be additional spaces that need surveyed.					X	X	X		
2	B	Weight Room	X	X		X	X	X	X	X	X	No Access - No Key. On the floorplan there are only 2 spaces numbered in this area. However there are also 4 unnumbered spaces that may be additional spaces that need surveyed.					X	X	X		
2	B	Tank Room adjacent Stairwell to Boy's Locker Room	T	Pipe Fitting Insulation	4020/02/08/80	Confirmed	5	EA	0	EA							1	No	1/D		
2	B	Tank Room adjacent Stairwell to Boy's Locker Room	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	200	LF	0	LF							N/A	N/A	N/A		
2	B	Tank Room adjacent Stairwell to Boy's Locker Room	T	Tank Insulation	4020/02/08/AET/BB/0800	Assumed	320	SF	0	SF							1	No	1/D		
2	B	Tank Room adjacent Stairwell to Boy's Locker Room	M	Transite Electrical Panel	4020/02/08/17	Confirmed	60	SF	0	SF							1	No	1/D		
1	SB	Former Auto Shop Storage Area adjacent Large Shop	T	Pipe Fitting Insulation	4020/01/SB/A5	Assumed	16	EA	0	EA							1	No	1/D		
1	SB	Former Auto Shop Storage Area adjacent Large Shop	T	Pipe Insulation 2-6 inch	4020/01/SB/EE	Assumed	47	LF	0	LF							1	No	1/D		
1	SB	Former Auto Shop Storage Area adjacent Large Shop	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	135	LF	0	LF							N/A	N/A	N/A		
1	SB	Former Auto Shop Storage Area adjacent Large Shop	N/A	Concrete Ceiling		Non Suspect ACM	1055	SF	0	SF							N/A	N/A	N/A		

4020 Overbrook HS 2015-2016 AHERA Three Year Report

School District of Philadelphia			AHERA Three-Year Reinspection 2015-2016										Reinspection Date: 10/21/2015			
Overbrook High School			Room by Room Location Log Report										Building Inspector: Bernard Brunner			
5898 Lancaster Avenue, Philadelphia, PA 19131													Certificate Number: 45397			
ULCS# 4020													Management Planner: M. Causley			
Year Built: 1926													Certificate Number: ACC-0215-8-010			
Element	Floor	On Site Room Name	System Affected	Material Description	HID#	Confirmed Assumed NAD Non Suspect ACM	Amount of Material	SF LF EA	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic / Crawl Space Ranking	Damage Potential (DP)	Newly Friable (NF)	Response Action (RA)
1	SB	Former Auto Shop Storage Area adjacent Large Shop	N/A	Brick Wall		Non Suspect ACM	1260	SF	0	SF				N/A	N/A	N/A
1	SB	Former Auto Shop Storage Area adjacent Large Shop	N/A	Wood Wall		Non Suspect ACM	325	SF	0	SF				N/A	N/A	N/A
1	SB	Former Auto Shop Storage Area adjacent Large Shop	N/A	Cement Floor		Non Suspect ACM	1055	SF	0	SF				N/A	N/A	N/A
1	SB	Stairwell from Basement to Former Large Auto Shop	T	Pipe Fitting Insulation	4020/01/SB/A5	Assumed	1	EA	0	EA				1	No	1/D
1	SB	Stairwell from Basement to Former Large Auto Shop	T	Pipe Insulation 2-6 inch	4020/01/SB/EE	Assumed	6	LF	0	LF				1	No	1/D
1	SB	Stairwell from Basement to Former Large Auto Shop	N/A	Plaster Ceiling		NAD	195	SF	0	SF				N/A	N/A	N/A
1	SB	Stairwell from Basement to Former Large Auto Shop	N/A	Brick Wall		Non Suspect ACM	1340	SF	10	SF				N/A	N/A	N/A
1	SB	Stairwell from Basement to Former Large Auto Shop	N/A	Cement Floor		Non Suspect ACM	195	SF	0	SF				N/A	N/A	N/A
1	SB	Former Large Auto Shop	T	Pipe Fitting Insulation	4020/01/SB/A5	Assumed	28	EA	0	EA				1	No	1/D
1	SB	Former Large Auto Shop	T	Pipe Insulation 2-6 inch	4020/01/SB/EE	Assumed	95	LF	0	LF				1	No	1/D
1	SB	Former Large Auto Shop	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	200	LF	0	LF				N/A	N/A	N/A
1	SB	Former Large Auto Shop	N/A	Concrete Ceiling		Non Suspect ACM	2160	SF	0	SF				N/A	N/A	N/A
1	SB	Former Large Auto Shop	N/A	Brick Wall		Non Suspect ACM	1155	SF	0	SF				N/A	N/A	N/A
1	SB	Former Large Auto Shop	N/A	Wood Wall		Non Suspect ACM	325	SF	0	SF				N/A	N/A	N/A
1	SB	Former Large Auto Shop	N/A	Concrete Block Wall		Non Suspect ACM	290	SF	0	SF				N/A	N/A	N/A
1	SB	Former Large Auto Shop	N/A	Cement Floor		Non Suspect ACM	2160	SF	0	SF				N/A	N/A	N/A
1	SB	Former Large Auto Shop	M	Transite Electrical Panel	4020/01/SB/AET/BB/2350	Assumed	20	SF	0	SF				1	No	1/D
1	SB	Small Room between Former Large and Small Auto Shops	T	Pipe Fitting Insulation	4020/01/SB/A5	Assumed	5	EA	0	EA				1	No	1/D
1	SB	Small Room between Former Large and Small Auto Shops	T	Pipe Insulation 2-6 inch	4020/01/SB/EE	Assumed	13	LF	0	LF				1	No	1/D
1	SB	Small Room between Former Large and Small Auto Shops	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	45	SF	0	SF				N/A	N/A	N/A
1	SB	Small Room between Former Large and Small Auto Shops	N/A	Concrete Ceiling		Non Suspect ACM	365	SF	0	SF				N/A	N/A	N/A
1	SB	Small Room between Former Large and Small Auto Shops	N/A	Brick Wall		Non Suspect ACM	315	SF	0	SF				N/A	N/A	N/A
1	SB	Small Room between Former Large and Small Auto Shops	N/A	Concrete Block Wall		Non Suspect ACM	675	SF	0	SF				N/A	N/A	N/A
1	SB	Small Room between Former Large and Small Auto Shops	N/A	Cement Floor		Non Suspect ACM	365	SF	0	SF				N/A	N/A	N/A
1	SB	Former Small Auto Shop	T	Pipe Fitting Insulation	4020/01/SB/A5	Assumed	22	EA	0	EA				1	No	1/D
1	SB	Former Small Auto Shop	T	Pipe Insulation 2-6 inch	4020/01/SB/EE	Assumed	121	LF	0	LF				1	No	1/D
1	SB	Former Small Auto Shop	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	135	SF	0	SF				N/A	N/A	N/A
1	SB	Former Small Auto Shop	N/A	Concrete Ceiling		Non Suspect ACM	1765	SF	0	SF				N/A	N/A	N/A
1	SB	Former Small Auto Shop	N/A	Wood Wall		Non Suspect ACM	290	SF	0	SF				N/A	N/A	N/A
1	SB	Former Small Auto Shop	N/A	Brick Wall		Non Suspect ACM	1500	SF	0	SF				N/A	N/A	N/A
1	SB	Former Small Auto Shop	N/A	Concrete Block Wall		Non Suspect ACM	340	SF	0	SF				N/A	N/A	N/A
1	SB	Former Small Auto Shop	N/A	Cement Floor		Non Suspect ACM	1765	SF	0	SF				N/A	N/A	N/A
1	SB	Former Paint Shop	T	Pipe Fitting Insulation	4020/01/SB/A5	Assumed	2	EA	0	EA				1	No	1/D
1	SB	Former Paint Shop	T	Pipe Insulation 2-6 inch	4020/01/SB/EE	Assumed	50	LF	0	LF				1	No	1/D
1	SB	Former Paint Shop	N/A	Concrete Ceiling		Non Suspect ACM	800	SF	0	SF				N/A	N/A	N/A
1	SB	Former Paint Shop	N/A	Wood Wall		Non Suspect ACM	290	SF	0	SF				N/A	N/A	N/A
1	SB	Former Paint Shop	N/A	Brick Wall		Non Suspect ACM	1200	SF	0	SF				N/A	N/A	N/A
1	SB	Former Paint Shop	N/A	Cement Floor		Non Suspect ACM	800	SF	0	SF				N/A	N/A	N/A
1	SB	Stairwell from Basement to Former Small Auto Shop	T	Pipe Fitting Insulation	4020/01/SB/A5	Assumed	3	EA	0	EA				1	No	1/D
1	SB	Stairwell from Basement to Former Small Auto Shop	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	25	SF	0	SF				N/A	N/A	N/A
1	SB	Stairwell from Basement to Former Small Auto Shop	N/A	Plaster Ceiling		NAD	195	SF	50	SF				N/A	N/A	N/A
1	SB	Stairwell from Basement to Former Small Auto Shop	N/A	Brick Wall		Non Suspect ACM	1340	SF	0	SF				N/A	N/A	N/A
1	SB	Stairwell from Basement to Former Small Auto Shop	N/A	Cement Floor		Non Suspect ACM	195	SF	0	SF				N/A	N/A	N/A
1	5	Practice Room in Hallway outside Classroom 505	N/A	Ceiling Tile 2' x 4'		NAD	64	SF	0	SF		Vacant floor		N/A	N/A	N/A
1	C	Crawlspace/Auditorium	X	X		X	X	X	X	X	X	Fiberglass Pipe Insulation and Hard Fittings	A	X	X	X
1	A	Attic/Fifth Floor Fan Room	X	X		X	X	X	X	X	X	Fiberglass Pipe Insulation and Hard Fittings	A	X	X	X
1	A	Attic/Fifth Floor "B" Stairwell	X	X		X	X	X	X	X	X	Fiberglass Pipe Insulation and Hard Fittings	A	X	X	X
1	A	Attic/Fifth Floor "A" Stairwell & Roof	X	X		X	X	X	X	X	X	Fiberglass Pipe Insulation and Hard Fittings	A	X	X	X

Section III Certificates

A. Management Planner/Building Inspector Certificates

Section III – A

Management Planner/Building Inspector Certificates

These charts indicate the Name, Course Date, Expiration Date and Corresponding Certificate Number of the Management Planner and Building Inspector of individuals that participated in the AHERA 3 Year Inspection and Management Plan process of 2015/2016.

Management Planner	Date Granted	Expiration Date	Certificate Number
Monique Causley	2/15/2015	2/16/2016	ACC-0215-8-010
Monique Causley	2/16/2016	2/17/2017	ACC-0216-8-001
Megan Vala	5/22/2015	6/22/2016	740728
Mary Anne Lerro	4/5/2016	4/5/2017	742327

Building Inspector	Date Granted	Expiration Date	Certificate Number
Scott Magee	8/15/2015	8/15/2016	70016699C
William Garrity	8/15/2015	8/15/2016	70016699A
Bernard Brunner	10/2/2015	8/2/2016	45397
Mary Anne Lerro	3/3/2015	3/3/2016	740092
Mary Anne Lerro	4/5/2016	4/5/2017	742322
James Madden	12/11/2014	12/11/2015	ACC-1214-6-010
James Madden	12/3/2015	12/3/2016	ACC-1215-6-018
Troy Ray	3/15/2015	3/19/2016	ACC-0355-6-011
Ananth Vinjamuri	9/29/2015	9/29/2016	374
Shelton Williams	9/29/2015	9/29/2016	375
Paul Davis	2/12/2015	2/12/2016	ACC-0215-6-015
Paul Davis	2/2/2016	2/2/2017	741836
Bernard Bryson	2/16/2015	2/16/2016	ACC-0125-6-031
Bernard Bryson	2/15/2016	2/15/2017	ACC-0216-6-005
Alexander Roman	9/18/2015	9/18/2016	EHSBIR-150619-008
Norm Harrison	9/2/2015	9/2/2016	ACC-0915-6-011
Kelly Mayberry	2/20/2015	2/20/2016	EHSBIR-150220-005
Kelly Mayberry	2/18/2016	2/18/2017	EHSBIR-160218-006
Andrew Hine	5/6/2015	5/6/2016	AI05042015-3
Maryellen Leotta	2/12/2015	2/12/2016	ACC-0215-6-024

Certificate of Completion

awarded to

Monique Causley

for successfully completing the prescribed course of study in

Pennsylvania Asbestos Management Planner Refresher Course

under TSCA Title II

presented by

ACCESS TRAINING SERVICES, INC.
7921 River Road, Pennsauken, NJ 08110
(856) 665-3449

2/16/15

Course Date

N/A

Exam Date

2/16/16

Expiration Date

Not Provided

Social Security Number

ACC-0215-8-010

Certificate Number

Mark K. Schlüger
Training Director

Certificate of Completion

awarded to

Monique Causley

for successfully completing the prescribed course of study in

Pennsylvania Asbestos Management Planner Refresher Course

under TSCA Title II

presented by

**ACCESS TRAINING SERVICES, INC.
7921 River Road, Pennsauken, NJ 08110
(856) 665-3449**

2/15/16

Course Date

N/A

Exam Date

2/15/17

Expiration Date

Not Provided

Social Security Number

ACC-0216-8-001

Certificate Number

Mark K. Schlüger
Training Director

Certificate of Training

CRITERION LABORATORIES, INC.

HEREBY CERTIFIES THAT

Megan Vala

HAS SUCCESSFULLY COMPLETED A 16 HOUR COURSE ENTITLED

Asbestos Management Planner Initial

INCLUDING CLASSROOM INSTRUCTION

05/21/2015 to 05/22/2015


Exam passed on this 22nd day of May 2015 - Score - 94

Approved for AHERA Accreditation Under TSCA Title II

3370 Progress Drive, Suite J
Bensalem, PA 19020
(215) 244-1300 - Phone
(215) 244-4349 - Fax
www.criterionlabs.com

Course is conducted in English

DIRECTOR:

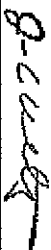

James A. Welts, CIH, President

Certificate of Training

CRITERION LABORATORIES, INC.

HEREBY CERTIFIES THAT

Mary Anne Lerro

HAS SUCCESSFULLY COMPLETED A 4 HOUR COURSE ENTITLED

Asbestos Management Planner Refresher

INCLUDING CLASSROOM INSTRUCTION


on this 5th day of April 2016

Approved for AHERA Accreditation Under TSCA Title II

3370 Progress Drive, Suite J
Bensalem, PA 19020
(215) 244-1300 - Phone
(215) 244-4349 - Fax
www.criterionlabs.com

Course is conducted in English

DIRECTOR:

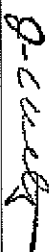

James A. Welts, CIH, President

EMSL ANALYTICAL, INC.

Certifies that

Scott Magee

has successfully completed the course of study for the

Asbestos Building Inspector Refresher Course

for Accreditation under TSCA Title II

EMSL Certificate No. 70016699C


Approved by:

PA Dept. of Labor and Industry
Accreditation # 137

Course Date: 8/15/2015
Granted: 8/15/2015
Expiration Date: 8/15/2016

Sponsored by:

EMSL Analytical, Inc.
200 Route 130 North
Cinnaminson, NJ 08077
Phone: (800) 220-3675
Fax: (856) 786-5973
www.emsl.com

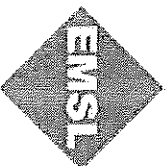

Michael P. Menz

Michael P. Menz, CIH
Training Director

Environmental, Mold, Bacteria, IAQ, Asbestos, Lead, Forensic and Materials Testing Since 1981

EMSL ANALYTICAL, INC.

Certifies that

William Garrity

has successfully completed the course of study for the

Asbestos Building Inspector Refresher Course

for Accreditation under TSCA Title II

EMSL Certificate No. 70016699A


Approved by:

PA Dept. of Labor and Industry
Accreditation # 137

Course Date: 8/15/2015
Granted: 8/15/2015
Expiration Date: 8/15/2016

Sponsored by:

EMSL Analytical, Inc.
200 Route 130 North
Cinnaminson, NJ 08077
Phone: (800) 220-3675
Fax: (856) 786-5973
www.emsl.com

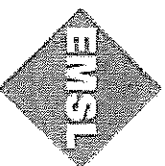

Michael P. Menz

Michael P. Menz, CIH
Training Director

Environmental, Mold, Bacteria, IAQ, Asbestos, Lead, Forensic and Materials Testing Since 1981

45397

National Asbestos & Environmental Training Institute

CERTIFICATE OF COMPLETION

AHERA/EPA Accredited Per 40 CFR Part 763
Asbestos Accreditation under TSCA Title II

This is to certify that


Bernard Brunner, Jr.

Successfully completed the course entitled

**1/2-Day New York State/EPA/AHERA Asbestos Building Inspector Annual Refresher on
October 2, 2015**

Examination Passed October 2, 2015

Expiration Date on October 2, 2016

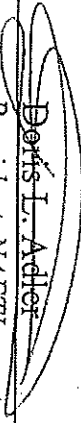
Doris L. Adler
President, NAEETI

Per 10 NYCRR Part 73.2 (L) (1), DOH 2832 Certificate of Completion of Asbestos
Safety Training is the only official record of training for N.Y.S. students.

Language: English

ABIH 1/2 CM POINT

3321 Doris Avenue, Building B, Ocean, NJ 07712

Phone (732) 531-5571

Fax (732) 531-5956

www.naeti.com

Number 740092

Expiration Date:
03/03/2016

Certificate of Training

CRITERION LABORATORIES, INC.

HEREBY CERTIFIES THAT

Mary Anne Lerro

HAS SUCCESSFULLY COMPLETED A 4 HOUR COURSE ENTITLED

Asbestos Building Inspector Refresher

on this 3rd day of March 2015

Exam passed on this 3rd day of March 2015 - Score - 84

Approved for AHERA Accreditation Under TSCA Title II

3370 Progress Drive, Suite J
Bensalem, PA 19020
(215) 244-1300 - Phone
(215) 244-4349 - Fax
www.criterionlabs.com

Course is conducted in English

DIRECTOR:

James A. Weltz
James A. Weltz, CIH, President

Certificate of Training

CRITERION LABORATORIES, INC.

HEREBY CERTIFIES THAT

Mary Anne Lerro

HAS SUCCESSFULLY COMPLETED A 4 HOUR COURSE ENTITLED

Asbestos Building Inspector Refresher

INCLUDING CLASSROOM INSTRUCTION

on this 5th day of April 2016


Exam passed on this 5th day of April 2016 - Score - 88

Approved for AHERA Accreditation Under TSCA Title II

3370 Progress Drive, Suite J
Bensalem, PA 19020
(215) 244-1300 - Phone
(215) 244-4349 - Fax
www.criterionlabs.com

Course is conducted in English

DIRECTOR:



James A. Welts, CIH, President

Certificate of Completion

James Madden

for successfully completing the prescribed course of study in

Pennsylvania Asbestos Building Inspector Refresher Course

under TSCA Title II

presented by
ACCESS TRAINING SERVICES, INC.
7921 River Road, Pennsauken, NJ 08110
(856) 665-3449

12/11/14

Course Date

N/A

Exam Date

12/11/15

Expiration Date

Not Provided

Social Security Number

ACC-1214-6-010

Certificate Number

Mark K. Schlüger
Training Director

Certificate of Completion

James Madden

for successfully completing the prescribed course of study in

Pennsylvania Asbestos Building Inspector Refresher Course

under TSCA Title II

presented by

ACCESS TRAINING SERVICES, INC.
7921 River Road, Pennsauken, NJ 08110
(856) 665-3449

12/3/15

Course Date

N/A

Exam Date

12/3/16

Expiration Date

Not Provided

Social Security Number

ACC-1215-6-018

Certificate Number

Mark K. Schlüger
Training Director

Certificate of Completion

Troy A. Ray

for successfully completing the prescribed course of study in

Pennsylvania Asbestos Building Inspector Refresher Course

under TSCA Title II

presented by

**ACCESS TRAINING SERVICES, INC.
7921 River Road, Pennsauken, NJ 08110
(856) 665-3449**

3/19/15

Course Date

N/A

Exam Date

3/19/16

Expiration Date

Not Provided

Social Security Number

ACC-0355-6-011

Certificate Number

Mark K. Schlager
Training Director

CERTIFICATE NO 374

G&C Environmental Services, Inc. (#294)
2 Street Road, Newtown Square, Pennsylvania 19073
Telephone: (610) 993-9202 Facsimile: (610) 993-9232
Email: Training@gcenviro.com
www.GCenviro.com

This document certifies that Ananth K. Vinjamuri has successfully completed this
State of New York Department of Health Approved AHERA BUILDING INSPECTOR

REFRESHER COURSE, completed as required for asbestos accreditation under the Toxic

Substances Control Act, Title II. This course was held from 09/29/2015 to 09/29/2015.
MM DD YR MM DD YR

The examination date was 09/29/2015. This certificate expires one year from the date of
MM DD YR MM DD YR
successful completion of the examination 09/29/2016.
MM DD YR

*The official record of successful training completion is the New York State Department of
Health certificate of asbestos safety training completion (DPH 2832).*

Gail M. Conner
Training Director

Gail M. Conner

CERTIFICATE NO 375

G&C Environmental Services, Inc. (#294)
2 Street Road, Newtown Square, Pennsylvania 19073
Telephone: (610) 993-9202 Facsimile: (610) 993-9232
Email: Training@gcenviro.com
www.GCenviro.com

This document certifies that Shelton Williams has successfully completed this
State of New York Department of Health Approved AHERA BUILDING INSPECTOR

REFRESHER COURSE, completed as required for asbestos accreditation under the Toxic

Substances Control Act, Title II. This course was held from 09/29/2015 to 09/29/2015.
MM DD YR MM DD YR

The examination date was 09/29/2015. This certificate expires one year from the date of
MM DD YR MM DD YR
successful completion of the examination 09/29/2016.
MM DD YR

*The official record of successful training completion is the New York State Department of
Health certificate of asbestos safety training completion (DPH 2832).*

Gail M. Conner
Training Director

Gail M. Conner

Certificate of Completion

Paul M. Davis

for successfully completing the prescribed course of study in

Pennsylvania Asbestos Building Inspector Refresher Course

under TSCA Title II

presented by

ACCESS TRAINING SERVICES, INC.
7921 River Road, Pennsauken, NJ 08110
(856) 665-3449

2/12/15

Course Date

N/A

Exam Date

2/12/16

Expiration Date

Not Provided

Social Security Number

ACC-0215-6-015

Certificate Number

Mark K. Schlüger
Training Director

Certificate of Training

CRITERION LABORATORIES, INC.

HEREBY CERTIFIES THAT

Paul M. Davis

HAS SUCCESSFULLY COMPLETED A 4 HOUR COURSE ENTITLED

Asbestos Building Inspector Refresher

INCLUDING CLASSROOM INSTRUCTION

on this 2nd day of February 2016

Exam passed on this 2nd day of February 2016 - Score - 92

Approved for AHERA Accreditation Under TSCA Title II

3370 Progress Drive, Suite J
Bensalem, PA 19020
(215) 244-1300 - Phone
(215) 244-4349 - Fax
www.criterionlabs.com

Course is conducted in English

DIRECTOR:

James A. Welch

James A. Welch, CIH, President

Certificate of Completion

Bernard J. Bryson


for successfully completing the prescribed course of study in

Pennsylvania Asbestos Building Inspector Refresher Course

under TSCA Title II

presented by

ACCESS TRAINING SERVICES, INC.
7921 River Road, Pennsauken, NJ 08110
(856) 665-3449

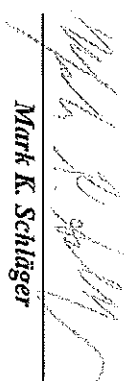2/16/15	N/A	2/16/16
<i>Course Date</i>	<i>Exam Date</i>	<i>Expiration Date</i>
Not Provided	ACC-0125-6-031	
<i>Social Security Number</i>	<i>Certificate Number</i>	Mark K. Schlager <i>Training Director</i>

Certificate of Completion

Bernard J. Bryson

for successfully completing the prescribed course of study in

Pennsylvania Asbestos Building Inspector Refresher Course

under TSCA Title II

presented by

ACCESS TRAINING SERVICES, INC.
7921 River Road, Pennsauken, NJ 08110
(856) 665-3449

2/15/16

Course Date

N/A

Exam Date

2/15/17

Expiration Date

Not Provided

Social Security Number

ACC-0216-6-005

Certificate Number

Mark K. Schlager
Training Director

EHS TRAINING INSTITUTE, INC.
A Division of BATTI, Inc.

Certificate of Completion

AHERA Building Inspector

(Refresher)

Awarded To:

Alexander Roman

SS#:XXX-XX-1743
Who has completed this 4-hour course and examination,
EPA Approved under TSCA Title II
AHERA / ASHARA Rule
40 CFR Part 763.

EHS TRAINING INSTITUTE, INC.

A Division of BATTI, Inc.

Delaware Industrial Park • 6 Garfield Way

Newark, DE 19713-5817

(302) 737-3376 • Fax (302) 737-5764

Course Date: September 18, 2015

Date of Expiration: September 18, 201

Certification Number : EHSBIR 150619-008


Todd K. Zeisloff, Instructor


Neeraj K. Batta, President

Certificate of Completion

Norman Harrison

for successfully completing the prescribed course of study in

Pennsylvania Asbestos Building Inspector Refresher Course

under TSCA Title II

presented by

**ACCESS TRAINING SERVICES, INC.
7921 River Road, Pennsauken, NJ 08109
(856) 665-3449**

9/2/15

Course Date

N/A

Exam Date

9/2/16


Expiration Date

Not Provided

Social Security Number

ACC-0915-6-011

Certificate Number


Mark K. Schlager
Training Director

EHS TRAINING INSTITUTE, INC.
A Division of BATTI, Inc.

Certificate of Completion

AHERA Building Inspector

(Refresher)

Awarded To:

Kelly Mayberry

SS#:XXX-XX-1551

Who has completed this 4-hour course and examination,

EPA Approved under TSCA Title II

AHERA / ASHARA Rule

40 CFR Part 763.

EHS TRAINING INSTITUTE, INC.

A Division of BATTI, Inc.

Delaware Industrial Park • 6 Garfield Way

Newark, DE 19713-5817

(302) 737-3376 • Fax (302) 737-5764

Course Date: February 20, 2015

Date of Expiration: February 20, 2016

Certification Number : EHSBIR 150220-005

Todd K. Zeislott
Todd K. Zeislott, Instructor

Neeraj K. Batta
Neeraj K. Batta, President

EHS TRAINING INSTITUTE, INC.

A Division of BATTI, Inc.

Certificate of Completion

AHERA Building Inspector

(Refresher)

Awarded To:

Kelly Mayberry

SS#:XXX-XX-1551

Who has completed this 4-hour course and examination,

EPA Approved under TSCA Title II

AHERA / ASHARA Rule

40 CFR Part 763.

EHS TRAINING INSTITUTE, INC.

A Division of BATTI, Inc.

Delaware Industrial Park • 6 Garfield Way

Newark, DE 19713-5817

(302) 737-3376 • Fax (302) 737-5764

Course Date: February 18, 2016

Date of Expiration: February 18, 2017

Certification Number : EHSBIR 160218-006

Todd K. Zeisloff, Instructor

Neeraj K. Batta, President

AEROSOL MONITORING & ANALYSIS, INC.

This is to certify that
ANDREW HINE

has met the attendance requirements and successfully completed

the course entitled

3-DAY EPA AHERA INSPECTOR

For Accreditation Under TSCA Title II

05/04/2015 to 05/06/2015

Course Date

05/06/2015

Exam Date

5/6/2016

Expiration Date

STEVE SIERACKI

Principal Instructor

Steve Sieracki

A105042015-3

Certification No.

E. Rush Barnett

Course Director

E. Rush Barnett

1331 Ashton Road

P.O.Box 646

Hanover, MD 21076

P: 410-684-3327

F: 410-684-3724

www.amatraining.com

Certificate of Completion

Maryellen Leotta

for successfully completing the prescribed course of study in

Pennsylvania Asbestos Building Inspector Refresher Course

under TSCA Title II

presented by

ACCESS TRAINING SERVICES, INC.
7921 River Road, Pennsauken, NJ 08110
(856) 665-3449

2/12/15

Course Date

N/A

Exam Date

2/12/16

Expiration Date

Not Provided

Social Security Number

ACC-0215-6-024

Certificate Number

Mark K. Schlager
Training Director

Section IV

Cross Reference Table

Asbestos Hazard Emergency Response Act (AHERA) Environmental Compliance Audit Cross Reference Table

In response to the AHERA Environmental Compliance Audit a Cross Reference Table has been prepared for inclusion into the Environmental Management Plan. The purpose of this Cross Reference Table is to link the following documents to the AHERA Management Plan.

Cross Reference Table	
3 Year Reinspection Report follows this Cross Reference Table documentation.	
Subject Matter	Location of Required Documents
Designated Person	Pages 1 - 3
Annual Notification	Pages 4 - 5
6 Month Periodic Surveillance Outline of Events	Page 6
3 Year Re-inspections Outline of Events	Page 7
Asbestos Management Program (operations and maintenance)	Pages 8 - 19
Asbestos Investigation Report (AIR)	Attachment 1 Letter Dated August 4, 2006
Training (included in the Asbestos Management Program)	<p>The original records are centralized at the School District's Environmental Library. Copies are maintained on staff and are required to be maintained in the latest Reinspection Report.</p> <p>2 hour awareness training records for all Building Engineers, Custodian Assistants and maintenance personnel</p> <p>40 hour worker/supervisor training records for the OEMS A-Team and various AST tradesmen.</p>
Response Actions (monthly mailings if applicable)	The original documents are on file at the School District's Environmental Library.
	Copies of the original are mailed to the Schools Main Office for retention with the Management Plan documentation. These documents are typically kept separate from the management plan in an update binder due to the potential volume of response action reports.

SCHOOL DISTRICT OF PHILADELPHIA

ASBESTOS DESIGNATED PERSON

Gerald F Junod
Office of Capital Programs
Environmental Management & Services
440 N Broad Street, 3rd Floor
Philadelphia, PA 19130
Telephone: 215 400 6738
Fax: 215 400 4751

Drexel University- Asbestos Building Inspector Course	January 9-11, 1989 24 Hours
Drexel University- Asbestos Management Planner Course	January 12-13, 1989 16 Hours
Criterion Laboratories, Inc. - Asbestos Management Planner Course	October 11-12, 2012 16 Hours

<u>Annual Building Inspector Refreshers</u> 4 Hours Drexel University Criterion Laboratories, Inc Access Training Services, Inc.	1990 to Present
---	------------------------

<u>Annual Building Management Planner Refreshers</u> 4 Hours Drexel University Criterion Laboratories, Inc 4 Hours	1990 to 1994 2013 to Present
---	---

Environmental Manager, School District of Philadelphia

Manages the design and implementation of asbestos and lead projects for the Capital Improvement Program and other District Departments including Facilities & Operations and Information Technology. Ensures that asbestos abatement and lead remediation projects are expertly designed and executed in accordance with industry best management practice standards and regulations.

Manager, City of Philadelphia Asbestos Control Program

Served as the Asbestos Control Program Manager for the City of Philadelphia, Department of Public Health, Air Management Services, Asbestos Control Unit from August 1, 2003 through October 23, 2006.

Mid Atlantic Regional Environmental Consortium (MAREC)

Former member with attendance and participation commitments of all quarterly EPA Region III and yearly National Asbestos Regulatory Conferences sponsored by the EPA and the National Conference of State Legislators respectively as a representative for the City of Philadelphia Department of Public Health Air Management Services from 1994 through 2006.

Philadelphia Environmental Task Force

Former member of the Philadelphia Environmental Task force as a representative and point of contact for the City of Philadelphia Department of Public Health Air Management Services Asbestos Control Unit from 2002 through 2006.

Asbestos Instructor

Worked as the primary instructor for the initial and annual Asbestos Project Inspector training and licensing program as mandated by City of Philadelphia Department of Public Health Asbestos Control Regulations from August 1994 through October 2006.

Worked as a lead instructor with an Environmental Consulting Firm and approved by the US EPA for the initial and annual refresher training courses for various asbestos occupational disciplines such as the Building Inspector, Management Planner and Worker/Supervisor from 1991 through 1994.

I certify that the general, local agency responsibilities as stipulated in Section 763.84 will be met.



Gerald F. Junod

Asbestos Designated Person

Environmental Manager

Office of Environmental Management and Services

SCHOOL DISTRICT OF PHILADELPHIA

Accreditation Information Statement

All persons who inspect for Asbestos Containing Building Materials (ACBM) and who will design or carry out response actions with respect to assumed and confirmed ACBM, will be accredited by an EPA approved course and/or a State Contractors Accreditation Program under Sections 206 (c) and 206 (b) of Title II of the ACT.



**Gerald F. Junod
Asbestos Designated Person
Environmental Manager
Office of Environmental Management and Services**

SCHOOL DISTRICT OF PHILADELPHIA
OFFICE OF CAPITAL PROGRAMS
440 NORTH BROAD STREET, SUITE 373
PHILADELPHIA, PENNSYLVANIA 19130

OFFICE OF ENVIRONMENTAL MANAGEMENT AND SERVICES

PHONE (215)-400-4750

September 2015

TO: Principals
Building Administrators/Occupants
Parents/Guardians

FROM: Fran Burns
Chief Operating Officer

Francine Locke, M.S., Director
Office of Environmental Management and Services

SUBJECT: Annual EPA Notification Letter


Pursuant to the Federal Environmental Protection Agency (EPA) mandate, as required by 40 C.F.R. 763.84 (c)(d) of public access to environmental records, this letter is to acknowledge the availability of your facility's Asbestos Hazard Emergency Response Act (AHERA) Management Plan.

Each member of the school staff, parents/guardians, temporary workers and/or contractors, are required to receive a copy of the Notification Letter. At the direction of the Principal, a copy is to be posted on the bulletin boards and an appropriate amount of copies are to be generated for distribution.


Note: The AHERA Three-Year Reinspection reports, in colored binders; White with Pink, Tan, Black, Red, Dark Blue, Green, Yellow and White, are Federal EPA mandated inspection documents. The School District of Philadelphia is subject to severe monetary penalties if the reports and associated paperwork are not available to the EPA and the public upon request.

It is incumbent on designated school personnel to gather and retain this data as it is delivered, in one location for future review. Acceptable locations include the Principal's Office or Main Office for the primary data. The Building Engineer should maintain any secondary or duplicate copies.

If you have any questions, please call 215-400-4750. Thank you for your cooperation.



Fran Burns
Chief Operating Officer

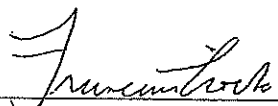

Francine Locke, M.S., Director
Office of Environmental Management
and Services

c: Danielle Floyd

AHERA-4
8/21/15



School District of Philadelphia
OFFICIAL NOTICE

PLEASE POST

September 2015

TO: Principals
Building Administrators
Building Engineers
Building Occupants
Parents/Guardians

FROM: Fran Burns
Chief Operating Officer

Francine Locke, M.S., Director
Office of Environmental Management and Services

SUBJECT: Annual Notification Letter: Asbestos Hazard Emergency Response Act

The Federal Register published on October 30, 1987, Subpart E, in Schools: Final Rule and Notice, 763.84 (c)(d) states that each local education agency shall ensure that workers and building occupants or guardians are to be informed at least once each school year about inspections, response actions and post-response action activities including re-inspections and periodic surveillance activities. The School District as the Local Education Agency (LEA), retains such reports that are available for public inspection in the Office of the Principal or Building Administrator.

The Principal or Building Administrator is required to do the following with this notification:

- 1) Post in a Public Place or Main Office
- 2) Inform Building Occupants
- 3) Send a copy of this notification to Parents or Guardians
- 4) Insert a copy into the latest AHERA Three-Year Reinspection report (white/pink binder) in your office or facility.

Fran Burns
Chief Operating Officer

Francine Locke, M.S., Director
Office of Environmental Management
and Services

c: Danielle Floyd

AHERA-4a
8/21/15

SCHOOL DISTRICT OF PHILADELPHIA
Education Center
440 North Broad Street
Philadelphia, Pennsylvania 19130

Office of Environmental Management and Services

215-400-4750

AHERA
Six Month Surveillance
Outline of Events

- Pursuant to the Federal Environmental Protection Agency (EPA) mandate, as required by 40 CFR 763.92(b), the following procedure is to be implemented. At least once every six (6) months after a Management Plan is in effect, each Local Education Agency (LEA) shall conduct a periodic surveillance in each building that it owns or leases that contains Asbestos Containing Building Materials (ACBM) or is assumed to contain ACBM.
- The first Bi-Annual Inspection starts in the Spring (March, April, May) and again in the Fall (October, November, December) of each year. The Building Engineer/Assistant should assist the Building Inspector with appropriate access to all areas including (Crawlspace/Attics) and rooms in the facility. There is no action required of the Principal.
- The Building Inspector shall visually inspect all areas that are identified in the Management Plan as ACBM or assumed ACBM. The date of the surveillance is recorded, the inspectors name and any changes in the conditions of the materials.
- The Building Inspector shall make a copy of the inspection document and insert into the front of the latest Management Plan (AHERA Three Year Reinspection report). The original document is returned to the LEA's Environmental Library and filed.

SCHOOL DISTRICT OF PHILADELPHIA
Education Center
440 North Broad Street
Philadelphia, Pennsylvania 19130

Office of Environmental Management and Services

215-400-4750

AHERA
Three Year Reinspection
Outline of Events

- Pursuant to the Federal Environmental Protection Agency (EPA) mandate, as required by 40 CFR 763.85(b) the following procedure is to be implemented. At least once every three (3) years after a Management Plan is in effect, each Local Education Agency (LEA) shall conduct a reinspection of each building that it owns or leases that contains Asbestos Containing Building Material's (ACBM's) or is assumed to contain ACBM.
- Subsequent Three Year Re-inspections (2009, 2012, 2015, etc) shall start in the Fall (October, November, December, January). The Building Engineer/Assistant should assist the Building Inspector with appropriate access to all areas including (Crawlspaces/Attics) and rooms in the facility. There is no action required of the Principal.
- An accredited Building Inspector shall visually inspect and touch to determine friability, all areas that are identified in the Management Plan as ACBM or assumed ACBM. The date of the surveillance is recorded, the inspectors name and any changes in the conditions of the materials. The Building Inspectors state of accreditation and license number is required.
- After the inspection, the Building Inspector shall make a copy of the inspection documents and insert into the front of the latest Management Plan (AHERA Three Year Reinspection report). The original document is returned to the LEA's Environmental Library and filed.
- The Building Inspector shall return the reinspection data to the Management Planner to be assessed and determine appropriate response actions and a report issued (AHERA Three Year Reinspection report). One copy of the report is delivered to the schools Principal to be permanently retained with all previous environmental data. Another copy is retained in the LEA's Environmental Library.



School District of Philadelphia
Office of Environmental Management & Services
440 North Broad Street
Philadelphia, PA 19130
(215) 400-4750

**School District of Philadelphia
Asbestos Management Program**

TABLE OF CONTENTS

Definitions.....	Page 9
1. Introduction.....	Page 10
2. Summary of Asbestos Management Plan	
3. Asbestos Management Plan Execution.....	Page 11
a. General Execution	
4. Summary of Program Execution	
a. Asbestos Management Plan Execution	
5. Responsibilities	
a. OEMS	
b. Asbestos Worker/Supervisor “A-TEAM”.....	Page 12
c. Asbestos Designated Person	
d. Supervisor or Project Manager (Capital, Maintenance & Facilities)	
e. Employee Capital.....	Page 13
f. Employee Maintenance	
g. Employee Facilities and Custodial	
6. Requirements.....	Page 14
a. Employee Exposure Monitoring	
b. Employee Notification	
c. Observation of Monitoring	
d. Training Program	
e. Access of Information	
f. Record Keeping	
7. AHERA O&M Plan.....	Page 15
a. Controls	
8. O&M Response Actions.....	Page 16
a. Facility Maintenance Isolation of Area	
b. Unlikely Contact with ACM/PACM	
c. Accidental Disturbance of ACM/PACM	
d. Planned Disturbance of ACM/PACM	
e. Miscellaneous ACM/PACM.....	Page 17
f. Vinyl Asbestos Floor Tile	
g. Mastic/Adhesives	
h. Woven Vibration Dampers	
i. Other Work Practices	
j. Fiber Release Episodes	
9. References and Resources.....	Page 18

DEFINITIONS / ACRONYMS

ACM/PACM:	Asbestos Containing Material/Potential Asbestos Containing Material
AHERA:	Asbestos Hazard Emergency Response Act
AIR FORM:	Asbestos Inspection Report Form
Amended Water:	Water to which a surfactant (soap) has been added
AMP:	Asbestos Management Program/Asbestos Management Plan
Asbestos Designate Person:	Individual assigned by the district to oversee asbestos related issues.
Asbestos Regulated Area:	Location that is posted as an asbestos work area in which only approved and accredited personnel are permitted to enter
AST:	Asbestos Support Team involving approved and accredited school district tradespersons personnel that are school district person
A-TEAM:	School District of Philadelphia asbestos workers
CIP:	Capital Improvement Program
Consultant:	Asbestos consulting firm hired by the District
Demolition Directive:	Memorandum – August 4, 2006 from Patrick Henwood
EPA:	Environmental Protection Agency
In House Personnel:	School District of Philadelphia asbestos workers
LEA:	Local Education Agency
O&M:	Operations and Maintenance
OEMS:	Office of Environmental Management and Services
OSHA:	Occupational Safety and Health Administration
PEL:	Permissible Exposure Limit
PSD or SDP:	Philadelphia School District/School District of Philadelphia
PSIT:	Philadelphia School Improvement Team
STEL:	Short Term Exposure Limit

1. Introduction

The School District of Philadelphia, Asbestos Policy Statement:

“The School District of Philadelphia is dedicated to providing a safe and healthful work environment for its employees, students, faculty, contractors and visitors. In recognition of the potential health problems associated with asbestos, the School District of Philadelphia is committed to a comprehensive asbestos control program. This program is implemented and maintained through the School District of Philadelphia's Office of Environmental Management and Services (OEMS).”

OEMS has the responsibility of establishing procedures for asbestos abatement, asbestos inspection, air monitoring, renovation and demolition activities within all School District of Philadelphia owned or leased facilities.

These procedures are developed to ensure that:

- (1) People are not exposed to significant levels of asbestos fibers
- (2) Asbestos waste is handled and disposed of properly
- (3) Members of the School District of Philadelphia community have access to the Office of Environmental Management and Services for information, assistance, guidance, and interpretation regarding asbestos related matters.
- (4) Members of the School District of Philadelphia community have access to the Asbestos Management Plans as required and outlined in the US EPA AHERA regulations including annual written notification to all parents.
- (5) Compliance with all applicable Federal, State and Local Asbestos Regulations

Requirements outlined in this manual are mandatory in nature where the word “SHALL” is used and are advisory in nature where the word “SHOULD” is used.

2. Summary of Asbestos Management Program

The School District of Philadelphia's Asbestos Management Program was established to meet the requirements of Federal, State, and Local Regulations.

These regulations include, but are not limited to:

- US Environmental Protection Agency Asbestos Hazard Emergency Response Act (US EPA AHERA) and National Emissions Standard for Hazardous Air Pollutants subpart M, Part 61 (NESHAP);
- US Department of Labor, Occupational Safety and Health Administration (OSHA) General Industry Standard (29 CFR 1910.1001) and the OSHA Asbestos Standard for the Construction Industry (29 CFR 1926.1101);
- The Commonwealth of Pennsylvania, Department of Labor and Industry, Asbestos Occupations, Accreditation and Certification Act;
- The City of Philadelphia, Department of Public Health, Asbestos Control Regulations.

3. Asbestos Management Program Execution

a) General Execution

The Office of Environmental Management and Services (OEMS) develops, implements and manages safety and health programs for the School District of Philadelphia faculty, staff and students and assists with ensuring that all contractors comply with Federal, State and Local Environmental Regulations. The OEMS provides the oversight of School District of Philadelphia employees (Asbestos A-Team), environmental consultants, and asbestos abatement contractors for all projects within the School District of Philadelphia concerning Asbestos Containing Materials.

The control of safety and health hazards at the School District of Philadelphia is primarily through the implementation of engineering, work practice and administrative controls. Personal Protective Equipment (PPE) is used to supplement these controls or whenever the controls are not feasible or are in the process of being implemented. PPE is also recommended whenever exposures to chemical, physical or biological agents can be prevented or reduced by its use.

This written program establishes the procedures necessary to:

- 1) meet established standards and federal regulations for occupational exposure to asbestos fibers;
- 2) meet the requirements of the City of Philadelphia Asbestos Control Regulations which encompasses the disturbance and/or abatement of asbestos containing building materials;
- 3) provide the necessary health and safety protection to the School District of Philadelphia staff, faculty, students, contractors and visitors.

This program is strengthened by input and cooperation with the Philadelphia Federation of Teachers (PFT), Health and Welfare Fund.

4. Summary of Program Execution

a) Asbestos Management Program Execution

The Asbestos Management Program is administered by the Office of Environmental Management and Services (OEMS). OEMS provides the following services primarily through professional consultants:

- (1) exposure monitoring services;
- (2) building inspection/surveys (bulk sampling) for the identification of asbestos containing materials;
- (3) asbestos project design services;
- (4) asbestos abatement project and air monitoring services;
- (5) emergency response to fiber release episodes;
- (6) education/information;
- (7) medical monitoring;
- (8) training for School District of Philadelphia personnel

5. Responsibilities

a) Office of Environmental Management and Services

OEMS is responsible for performing the following functions:

- (1) Developing and administering of the Asbestos Management Program.
- (2) Providing asbestos-related services to all School District of Philadelphia departments.
- (3) Conducting required training of the Asbestos Management Program and working jointly with departments to schedule training.
- (4) Identifying and posting areas where labeling/signage are required.
- (5) Medical Monitoring of OEMS "A-TEAM" and other departments "AST" Asbestos Program staff.

- (6) Certification and training as required for OEMS "A-TEAM" and other departments "AST" Asbestos program staff.
- (7) Record keeping as outlined in Section 3.5 and all records as by required by US EPA AHERA regulations.

b) Asbestos Worker/Supervisor - "A-TEAM"

- (1) OEMS shall ensure that all "A-TEAM" workers/supervisors adhere to the following requirements:
 - a) Attend an initial Worker/Supervisor Asbestos Course;
 - b) Maintain the annual re-certification per EPA AHERA requirements and Commonwealth of Pennsylvania Asbestos Occupations, Accreditation and Certifications Act;
 - c) Undergo an annual Asbestos Medical Evaluation;
 - d) Undergo an annual Respirator Medical Clearance;
 - e) Undergo an annual Respirator Fit Testing.

c) Asbestos Designated Person

The Asbestos Designated Person is responsible for:

- (1) Assuring the health and safety of employees, students and visitors in the School District of Philadelphia facilities under his/her control.
- (2) Being kept informed of all areas under his or her jurisdiction where potential asbestos exposures exist and initiating protection programs that adhere to the Asbestos Management Program requirements of this manual.
- (3) Assuring that Asbestos Management Program requirements are adhered to by principal investigators, project managers, supervisors, or division heads, and School District of Philadelphia personnel under their supervision.
- (4) Ensuring that all employees within the Asbestos Management Program comply with (OSHA 1910.1001 (j) (7) (iv)) and the US EPA AHERA regulations by attending the required training.
- (5) Ensure the posting of:
 - a) Warning labels/signage
 - b) Commonwealth of Pennsylvania Asbestos Abatement and Demolition/Renovation Notification form
 - c) Asbestos Inspection Reports (AIR) form (where required)
 - d) Ensuring that Construction Projects follow the Demolition Directive procedures as outlined in the August 4, 2006 letter.

d) Supervisor or Project Manager (Capital, Maintenance and Facilities)

Each person in charge of a project, maintenance/repair, renovation/demolition, or other activity from the Departments of Capital, Maintenance, and/or Facilities, where asbestos containing material may be present is responsible for:

Identifying, with the assistance of OEMS, asbestos containing building materials prior to any disturbance of these materials. Various Federal (EPA and OSHA) and Local (City of Philadelphia Asbestos Control Regulations) require Asbestos Inspections prior to renovation/demolition activities. This shall be accomplished by always following the Asbestos Management Program Procedures as follows:

- (1) Ensure that the requirements of the Asbestos Management Program Procedures are followed by all personnel, trades, and contractors who are involved with the project;

- (2) Review of the required Asbestos Inspection Report (AIR) form (Attachment 1) and AHERA Management Plan documents prior to activities that may disturb any Asbestos Containing Materials;
- (3) Perform all project related duties as outlined in the Project Management Responsibilities;
- (4) Keep the department chairperson or director informed on any actions proposed or taken regarding the Asbestos Management Plan;
- (5) Ensuring that Construction Projects follow the Demolition Directive procedure outlined in the August 4, 2006 letter.

e) Employee – Capital

School District of Philadelphia Capital employees and/or consultants shall:

- (1) Ensure that no suspect or asbestos containing building materials are disturbed in the course of the projects they are performing or managing. This shall be accomplished by notifying their supervisor and OEMS by issuance of a work order permit (a.k.a PSIT Service Request Form) and verifying that the materials which may be disturbed are non-asbestos containing. If this information is not available or verification has not been made, these materials should not be disturbed.
- (2) Immediately notify OEMS and their supervisor in the event of a potential fiber release episode upon discovery of visible damage to asbestos containing materials.
- (3) Ensuring that Construction Projects follow the Demolition Directive procedures as outlined in the August 4, 2006 letter.

The types of projects represented as part of the Capital Improvement Program are as follows:

- (1) Complete Renovation of an existing building that addresses all facility component concerns and educational program needs;
- (2) Major Renovation of an existing building addressing significant facility component and educational improvements;
- (3) Addition to an existing building (either as an attachment or stand-alone structure) to accommodate needed program space;
- (4) Conversion of an existing facility to accommodate a change in educational program;
- (5) Facility Component Improvement of specific facility needs (i.e. electrical or HVAC system upgrades, ADA improvements, life safety improvements, exterior renovations, etc.)

f) Employee – Maintenance

School District of Philadelphia Maintenance employees shall:

- (1) Ensure that no suspect or asbestos containing building materials are disturbed in the course of their duties or work they are performing. This shall be accomplished by notifying their supervisor and OEMS by issuance of a work order permit and verifying that the materials which may be disturbed are non-asbestos containing. If this information is not available or verification has not been made, these materials should not be disturbed.
- (2) Immediately notify OEMS and their supervisor in the event of a potential fiber release episode or upon discovery of visible damage to asbestos containing materials.
- (3) All employees involved in maintenance activities shall attend required Asbestos Awareness training program within 60 days of employment.

g) Employee – Facilities & Custodial

School District of Philadelphia Facilities and Custodial employees shall:

- (1) Ensure that no suspect or asbestos containing building materials are disturbed in the course of their duties or work they are performing. This shall be accomplished by notifying their supervisor and OEMS by issuance of a work permit and verifying that the materials which may be disturbed are non-asbestos containing. If this information is not available or verification has not been made, these materials should not be disturbed;
- (2) Immediately notify OEMS and their supervisor in the event of a potential fiber release episode or upon discovery of visible damage to asbestos containing materials.
- (3) All employees involved in Facilities and Custodial activities shall attend require Asbestos Awareness training program within 60 days of employment.

6. Requirements

a) Employee Exposure Monitoring

When information indicates that an employee's exposure to asbestos fibers may equal or exceed an 8-hour time-weighted average of 0.1 f/cc * (per OSHA 1910.1001 & 1926.1101), OEMS shall develop and implement an asbestos exposure monitoring program. The sampling strategy shall be designed to identify employees by work task (job classification) that is exposed to asbestos fibers that exceed an 8-hour time-weighted average of 0.1 f/cc.

b) Employee Notification

OEMS shall notify in writing, each employee exposed to asbestos fibers at or above an 8-hour time weighted average of 0.1 f/cc.

c) Observation and Monitoring

OEMS shall provide employees or their representatives with an opportunity to observe any exposure measurements conducted.

d) Training Program

OEMS shall institute a training program which meets the requirements of AHERA for all employees who perform maintenance operations in a facility/school which contains asbestos containing materials or presumed asbestos containing materials and 1910.1001 (j), and the Commonwealth of Pennsylvania Department of Labor and Industry and the City of Philadelphia Asbestos Control Regulations. The affected departments shall ensure employee participation in this program. The OEMS "A-TEAM" and other departments "AST" Asbestos Program staff training shall be conducted annually for each employee as required by all Federal, State and Local for each asbestos discipline.

All Asbestos Awareness training as required by AHERA shall be performed within 60 days of employment and shall include:

- Health effects of asbestos
- Locations of ACM and PACM in the building/facility
- Recognition of CM and PACM damage and deterioration
- Requirements of the OSHA 1910.1001 standard relating to maintenance
- Proper response to fiber release episodes
- Procedure to be followed to isolate areas affected by fiber release

e) Access to Information

OEMS shall make available to affected employees or their representative's copies of the Occupational Safety and Health Administration (OSHA) General Industry Standard Part 1910.1001 and the department shall post a copy in the workplace.

f) Record Keeping

OEMS shall maintain an accurate record of all employee exposure measurements. OEMS and/or the School District of Philadelphia Human Resources Department shall maintain records of employee medical monitoring program. OEMS shall maintain all employee training records. All records shall be provided upon request to employees, former employees, representatives designated by the individual employee.

7. AHERA OPERATIONS AND MAINTENANCE PLAN

a) CONTROLS

i. Work Order System

Minimizing disruption of ACM/PACM during maintenance and renovation activities is the primary goal and task encountered by OEMS. Operations and maintenance employees and contractors should be warned to avoid conducting any maintenance work which may disturb ACM/PACM. Initiating a work order system, where all work orders or requests are channeled through the Office of Environmental Management and Services (OEMS), will be the method used to control and minimize disruption of ACM/PACM.

Any work performed by in-house personnel or contractors that could or will impact ACM/PACM shall be coordinated by OEMS. A completed Asbestos Inspection Report Form (Attachment 1) shall be issued to in-house personnel and/or all contractors whose work could impact ACM/PACM. This form should accompany each contract issued to an outside contractor and posted on the jobsite.

All work order requests for maintenance and renovation activities in areas where ACM/PACM is suspected or known to be present are to be submitted to OEMS prior to proceeding with work. OEMS is responsible for reviewing asbestos survey records for information about the presence of ACM/PACM in the area where the work is to be performed. OEMS should physically inspect the area to ensure existing records reflect actual conditions. If no asbestos is present, a work order is not necessary and the planned actions can proceed. If ACM/PACM is found to be present in the area, OEMS will sign the work order application and obtain an approved and accredited asbestos contractor or assign OEMS "A-TEAM" to abate the ACM/PACM.

ii. Regulated Areas

The owner will identify and regulate all areas where airborne concentrations of ACM/PACM exceed the Permissible Exposure Limit (PEL)* (Per OSHA determined to be 0.1 f/cc) and/or short term exposure limit (STEL) (Per OSHA determined to be 0.1 f/cc), or there is reasonable possibility that the (PEL) and/or (STEL) may be exceeded. All ACM/PACM removal activities involving thermal system insulation ACM/PACM (Class I), surfacing ACM/PACM (Class I), and miscellaneous ACM/PACM such as floor tile, roofing, and siding mastic, etc. (Class II), and repair and maintenance operations where thermal system insulation and surfacing ACM/PACM is likely to be disturbed (Class III) will be performed in accordance with federal, state, and local regulations. All asbestos abatement work and activities will be designed and managed as asbestos regulated areas. These areas will be demarcated and labeled.

iii. Warning Signs

Warning signs shall be displayed at all approaches to each asbestos regulated area. The asbestos abatement contractor will provide OSHA warning signs in all regulated areas during removal, repair, and other maintenance activities. OEMS will provide AIRs to all contractors who must inform all employees and supervisors working in locations contiguous to asbestos regulated areas of the potential hazards and work practices required.

iv. Warning Labels

Warning labels and/or signage shall be affixed to all raw materials, mixtures, scrap, waste, debris, and other products containing asbestos fibers, or to their containers. Generally, the asbestos abatement contractor or OEMS A-Team personnel will provide all warning labels for ACM/PACM containment.

8. O & M RESPONSE ACTIONS

The Asbestos Management Program general O&M procedures are outlined in this section. Additional requirements specific to asbestos abatement activities are included in the Project Design documents for all Asbestos Abatement Work. Regular cleaning, inspection, and reporting of ACM/PACM deterioration or other problems must be diligently practiced by all employees including custodial and maintenance personnel.

a) Facility Maintenance Isolation of Area Responsibilities

Maintenance personnel are often required to work in areas where ACM/PACM may potentially be disturbed. Most maintenance activities are conducted by in-house staff, outside contractors, or a combination.

Emergency fiber release episodes, such as pipe fitting or valve breaks, emergency boiler work, or mechanical equipment repair will be responded to by OEMS A-Team personnel or asbestos abatement contractor personnel. The owner's maintenance staff will: (1) isolate the emergency fiber release area; (2) post warning signs to prevent unauthorized access, and (3) notify their supervisor and OEMS. OEMS will ensure that the fiber release area remains isolated and is properly cleaned by and approved and accredited abatement contractor or by OEMS A-TEAM personnel.

b) Unlikely Contact with ACM/PACM

Maintenance activities or repairs which can be performed without contacting or disturbing the ACM/PACM require little more than normal care and good workmanship. For example, valves which are either uncovered or covered with non-asbestos insulation can be packed or repaired without disturbing asbestos insulation on nearby pipes. The major precaution is to ensure that maintenance and custodial personnel are familiar with procedures such as isolating the area, posting warning signs, and notifying OEMS in the event of any accidental ACM/PACM disturbance.

c) Accidental Disturbance of ACM/PACM

Maintenance and facilities personnel shall notify OEMS any time a fiber release is suspected. If friable ACM/PACM becomes airborne in the building,

d) Planned Disturbance of ACM/PACM

Maintenance activities that may impact ACM/PACM include access to a valve, flange, duct, or related system component.

Where asbestos-containing insulation must be removed to maintain or repair the thermal system, the ACM/PACM will imminently be disturbed. ACM/PACM removal work shall be conducted by OEMS A-Team personnel or an approved and accredited asbestos abatement contractor.

If friable ACM/PACM becomes airborne in the building, maintenance and facilities personnel shall secure the area and contact OEMS. OEMS shall respond accordingly.

e) Miscellaneous ACM/PACM

Miscellaneous types of ACM/PACM may include vinyl asbestos floor tiles, mastics/adhesives and woven vibration dampers. Disturbance of these materials should be avoided. Routine maintenance activities involving these materials should not pose a problem if handled properly. Questions on the proper removal and disposal of miscellaneous ACM/PACM should be directed to OEMS. OEMS will contact an approved and accredited asbestos abatement contractor or utilize OEMS A-TEAM personnel to assist with miscellaneous ACM/PACM clean-up activities.

f) Vinyl Asbestos Floor Tile

Asbestos-containing floor tiles in good condition are considered non-friable unless they are crushed, drilled, sawed, sanded or disturbed by any activity that breaks up the material. Routine maintenance of these materials should employ the use of non-abrasive buffers and wet cleaning technique. Broken or loose floor tiles should be removed and disposed of as asbestos waste by OEMS. Remaining debris should be vacuumed with a HEPA vacuum and the area wet mopped using amended water.

g) Mastics/Adhesives

Mastics and adhesives containing asbestos in good condition are considered non-friable and do not pose a potential health concern unless crushed, drilled, sawed, sanded, or otherwise abraded. Questions on the proper removal should be directed to OEMS.

h) Woven Vibration Dampers

Woven vibration dampers in good condition are considered non-friable and do not pose a potential health concern unless cut, crushed, drilled, sawed, sanded, or otherwise abraded. Questions on the proper removal should be directed to OEMS.

i) Other Work Practices

Any special work not included in this section should be addressed to OEMS for review prior to the initiation of work that may involve the disturbance of ACM/PACM.

j) Fiber Release Episodes

Facilities and maintenance staff should report to OEMS the presence of asbestos debris, water or physical damage to ACM/PACM, or any other evidence of possible fiber release. OEMS should have the OEMS A-Team personnel or an approved and accredited abatement contractor respond to the site to clean up debris and make repairs as soon as possible. OEMS will also contact a consultant to conduct air monitoring and prepare a report and submit at project completion to OEMS for each episode. OEMS will forward the reports for each site location AHERA Management Plan accordingly.

9. REFERENCES and RESOURCES

Applicable regulations for asbestos projects impacted by renovation, demolition, and maintenance activities.

- **Philadelphia Air Management Services – Asbestos Control Unit**
<http://www.phila.gov/health/units/ams/Asbestos/asbestos.html>
- **Pennsylvania Asbestos Occupations, Accreditation and Certification Act**
<http://www.dli.state.pa.us/landi/cwp/view.asp?a=185&q=56262&landiNav=>
- **United States Environmental Protection Agency Asbestos Home Page**
<http://www.epa.gov/asbestos/>
- **Occupational Safety and Health Administration (OSHA) Asbestos Home**
<http://www.osha.gov/SLTC/asbestos>