

SCHOOL DISTRICT OF PHILADELPHIA



Asbestos Hazard Emergency Response Act “AHERA”

THREE-YEAR RE-INSPECTION 2015-2016 and ASBESTOS MANAGEMENT PLAN for the

James Logan Elementary School

**ULCS# 6300
Building # B630001-1
1700 Lindley Avenue
Philadelphia, Pennsylvania
19141**

Year Built: 1924

October 2015

Conducted by:

Accredited Environmental Technologies, Incorporated
Batta Environmental Associates, Incorporated
Criterion Laboratories, Incorporated
Environmental Testing Consultants, LLC
G & C Environmental Services, Incorporated
KEM Partners, Incorporated
Synertech, Inc.
TTI Environmental, Inc.
USA Environmental Management, Inc.
The Vertex Companies, Inc.

Management Plan Prepared by:
Criterion Labs, Inc. and Synertech Inc.

This report must remain in the Main Office as mandated by the US EPA AHERA Regulations.

AHERA THREE-YEAR REINSPECTION VOLUME IX

Table of Contents

Transmittal Letter

Executive Summary

- I. Summary list of Confirmed Asbestos Containing Building Materials
- II. Summary list of Assumed Asbestos Contain Building Materials
- III. Summary list of Non-Asbestos Containing Building Materials
- IV. Summary list of Non Suspect Asbestos Containing Building Materials
- V. Summary List of Auditorium DATA for this location
- VI. Summary list of Attic and/or Crawlspace DATA for this location
- VII. Summary list of Pipe Chase/Pipe Shaft DATA for this location

Section I Report of Re-Inspection

- A. Introduction
- B. Three-Year Re-inspection IX Overview
- C. Post- Management Plan Activities and Changes
 - C.1 - Sampling and Analysis
 - C.2 - New Floor Tile Sampling
 - C.3 - Abatement Activity
 - C.4 - Periodic (Six-Month) Surveillance (Damaged Materials)

Section II Re-Inspection Data

- A. Introduction
- B. Re-Inspection Key Definitions
- C. Room by Room Location Log Report

Section III Certificates

- A. Management Planner/Building Inspector Certificates

Section IV	Cross Reference Table	Page 1-8
	Asbestos Management Program	Page 9-19

SCHOOL DISTRICT OF PHILADELPHIA
EDUCATIONAL CENTER
440 NORTH BROAD STREET
PHILADELPHIA, PENNSYLVANIA 19130

OFFICE OF ENVIRONMENTAL MANAGEMENT AND SERVICES

PHONE (215)-400-4750

January 2016


TO: All Principals
All Building Administrators

FROM: Fran Burns
Chief Operating Officer

Francine Locke, M.S., Director
Office of Environmental Management and Services

SUBJECT: AHERA Three (3) Year Re-inspection IX report

In order to comply with the provisions of the Asbestos Hazard Emergency Response Act (AHERA) the attached report is submitted to you. The law requires that this report be kept in the Main/Principal's office. It cannot be removed from these locations. *If the school (program) is relocated to a different building, these environmental documents are to be safely retained for the next school/building occupants.* All asbestos reports must be available to the public and Federal EPA upon request.



Fran Burns
Chief Operation Officer



Francine Locke, M.S., Director
Office of Environmental Management
and Services

Executive Summary

This Asbestos Hazard Emergency Response Act (AHERA) Three-Year Re-inspection “Volume # IX” Management Plan at this location, has been completed and the report of re-inspection submitted to the School District of Philadelphia. The re-inspections in all School District of Philadelphia buildings of 2015-2016 were conducted and completed between October 5th, 2015 through March 30th, 2016 as a joint project by Accredited Environmental Technologies, Inc., Batta Environmental Associates, Inc., Criterion Laboratories, Inc., Environmental Testing Consultants, LLC, G & C Environmental Services, Inc., KEM Partners, Inc., Synertech, Inc., TTI Environmental, Inc., USA Environmental Management, Inc. and The Vertex Companies, Inc.

In general, the School District of Philadelphia Office of Environmental Management and Services conducts Environmental Impact Evaluations and provides Asbestos Inspection Reports prior to any renovation, demolition and/or maintenance activities. The AHERA report must be reviewed prior to any renovation, demolition and/or maintenance activities in order to avoid the unknowing disturbance to Asbestos Containing Building Materials identified within this location. In addition, prior to work activities above all drop ceilings this report should be reviewed to avoid potential disturbances to Asbestos Containing Materials. Refer to Section IV of the Cross Reference Table, for additional Asbestos Management Program information. Contact the Office of Environmental Management and Services to have an Environmental Impact Evaluation conducted prior to any renovation, demolition and/or maintenance activities within this facility.

The information contained in this report was obtained from the original Asbestos Management Plan for the school, from update reports on changes and activities since the completion of the 1st Management Plan for each location and from all prior inspections performed and documented in Volume # I through Volume VIII (dated respectively 1992, 1995, 1998, 2001, 2004, 2007, 2010 or 2013) (if applicable) - and by this Three-Year Re-inspection of this school. The re-inspection report/Management Plan of 2015-2016 were reviewed and prepared collectively by Management Planner Megan Vala, Mary Anne Lerro of Criterion Laboratories, Inc. and/or Monique Causley, of Synertech Inc.

The 2015-2016 inspection process included the addition of a comprehensive Room by Room Inventory of all Thermal (T), Surfacing (S) and Miscellaneous (M) Materials specific to each room of this facility. Inspections of each room's thermal, ceilings, walls, floors and miscellaneous items regardless of Asbestos Content are categorized on the Room by Room Location Log Report for this location. Rooms or areas of the facility that were not accessible at the time of the inspection are marked with an "X". The Room by Room Location Log Report is found in Section II C of this Management Plan.

All Presumed or Suspect Asbestos Containing Building Materials (ACBMs), listed in the following summary charts are categorized as Confirmed, Assumed, Non-Asbestos, and/or Non-Suspect (ACBMs) were identified in the original Management Plan, or in the Volume I through Volume VIII AHERA Three-Year Re-inspection reports, and were re-inspected as part of this project.

As mandated by the U S EPA AHERA regulations, periodic Six-Month inspections and Three-Year Re-inspections of this location will be performed and the Inspection Data in this report will be updated accordingly.

Please feel free to contact the School District of Philadelphia's Office of Environmental Management and Services (OEMS) regarding any comments, questions, or concerns regarding this report or any Environmental related topic. OEMS staff can be reached at (215) 400 4750, via fax at (215) 400 4751 or via e-mail at flocke@philasd.org and/or gfunod@philasd.org.

Additional information can be found on our website. Here is the link to the OEMS website.
<http://webgui.phila.k12.pa.us/offices/e/environmental>

I. Summary list of Confirmed Asbestos Containing Building Materials within this facility

These charts are to be used for a quick reference* in order to avoid the unknowing disturbance of Asbestos Containing Materials during any and all Operations, Maintenance, Renovation, and/or Demolition activities at this location. *These materials have been sampled and Laboratory Analysis has CONFIRMED the presence of Asbestos. Contact OEMS prior to the disturbance of any of the following materials.*

Confirmed Asbestos Containing Building Materials for this location

Floor Tile VAT 9" x 9"	Pipe Fitting Insulation	Pipe Insulation > 6 inch
Pipe Insulation 2-6 inch	Transite Electrical Panel	Transite Stalls

* *Always refer to the Room by Room Logs for each specific material classification as the material classification findings may be different in various rooms throughout this facility.*

** *Some Materials may have multiple classifications (Confirmed, Assumed, NAD and Non Suspect) within this facility.*

II. Summary list of Assumed Asbestos Containing Building Materials within this facility

These charts are to be used for a quick reference* in order to avoid the unknowing disturbance of Asbestos Containing Materials during any and all Operations, Maintenance, Renovation, and/or Demolition activities at this location. These materials have not been sampled and should not be disturbed until verification of Asbestos Content. Contact OEMS for assessment and sampling prior to the disturbance of these materials.

Assumed Asbestos Containing Building Materials for this location

Blackboard Glue Dots	Plaster Ceiling	Tank Insulation
Emergency Generator Piping	Plaster Walls	Transite Stalls
Floor Tile VAT 12" x 12"	Radiator Insulation	Vibration Damper Cloth

* *Always refer to the Room by Room Logs for each specific material classification as the material classification findings may be different in various rooms throughout this facility.*

** *Some Materials may have multiple classifications (Confirmed, Assumed, NAD and Non Suspect) within this facility.*

III. Summary list of Non-Asbestos Containing Building Materials within this facility

These charts are to be used for a quick reference* in order to avoid the unknowing disturbance of Asbestos Containing Materials during any and all Operations, Maintenance, Renovation, and/or Demolition activities at this location. *These materials have been sampled and Laboratory Analysis has indicated NO Asbestos present or NO ASBESTOS DETECTED (NAD).*

Non- Asbestos Containing Building Materials for this location

Plaster Wall	Fireproofing	Plaster Ceiling
--------------	--------------	-----------------

* *Always refer to the Room by Room Logs for each specific material classification as the material classification findings may be different in various rooms throughout this facility.*

** *Some Materials may have multiple classifications (Confirmed, Assumed, NAD and Non Suspect) within this facility.*

IV. Summary list of Non-Suspect Asbestos Containing Building Materials within this facility

These charts are to be used for a quick reference* in order to avoid the unknowing disturbance of Asbestos Containing Materials during any and all Operations, Maintenance, Renovation, and/or Demolition activities at this location. These materials are not typically known to contain Asbestos.

Non-Suspect Asbestos Containing Building Materials for this location

Brick Wall	Concrete Walls	Partition Room Dividers
Carpet	Fiberglass Ceiling Tile 2' x 4'	Sheetrock Wall
Cement Floor	Fiberglass Pipe Fitting Insulation	Wood Ceiling
Ceramic Tile Walls	Fiberglass Pipe Insulation	Wood Floor
Concrete Ceiling	Marble Wall	Wood Wall

* *Always refer to the Room by Room Logs for each specific material classification as the material classification findings may be different in various rooms throughout this facility.*

** *Some Materials may have multiple classifications (Confirmed, Assumed, NAD and Non Suspect) within this facility.*

V. Summary list of Auditorium DATA for this location

These charts are to be used for a quick reference of the Auditorium DATA within this facility. Sampling of the Auditorium Ceilings throughout the District is more difficult because of the various ceiling heights. As sampling occurs this information is updated on a case by case basis for each specific location and facility.

This is a list of known materials for this location's Auditorium

Auditorium		
Auditorium	Plaster Ceiling	Assumed
Auditorium	Plaster Walls	Assumed
Auditorium	Wood Floor	Non Suspect ACM
Auditorium	Radiator Insulation	Assumed
Auditorium Stage	Plaster Ceiling	Assumed
Auditorium Stage	Plaster Walls	Assumed
Auditorium Stage	Wood Floor	Non Suspect ACM

** Always refer to the Room by Room Logs for each specific material classification as the material classification findings may be different in various rooms throughout this facility.*

*** Some Materials may have multiple classifications (Confirmed, Assumed, NAD and Non Suspect) within this facility.*

VI. Summary list of Attic and/or Crawlspace DATA for this location

These charts are to be used for a quick reference regarding the Attics and/or Crawlspaces inspection DATA within this facility. Contact OEMS prior to entering any attic or crawlspace within this facility and refer to the below chart and legend for Category Rank determination. The Data relative to these spaces is updated as conditions change regarding Abatement or Renovation activity on a case by case basis for each specific location and facility. In general, Crawlspaces are below the basement or 1st floor and Attics are above the floor space.

Category Rank Legend

"A" - No Asbestos Containing Materials - Sample Results indicate NO ACM on pipes, fittings, elbows, or equipment located within this functional space, and NO VISIBLE DEBRIS or DAMAGE observed at time of this inspection.
"B" - Asbestos Containing Materials Exist - Sample Results indicate ACM on pipes, fittings, elbows, or equipment located within this functional space, HOWEVER, NO VISIBLE DEBRIS or DAMAGE observed at time of this inspection.
"C" - Asbestos Containing Materials Exist - Sample Results indicate ACM on pipes, fittings, elbows, or equipment located within this functional space, and LOCALIZED VISIBLE DEBRIS or DAMAGE observed at time of this inspection.
"D" - Asbestos Containing Materials Exist - Sample Results indicate ACM on pipes, fittings, elbows, or equipment located within this functional space and DISTRIBUTED VISIBLE DEBRIS or SIGNIFICANT DAMAGE observed at time of this inspection.
"E" - No Bulk Sample Results Available SUSPECT ACM OBSERVED. Contact OEMS immediately for additional instructions.

Attic/Crawlspace	Access Area	Floor Surface	Category Rank	Comments
Attic	Near Slop Closet on Third Floor	Wire Lathe/Wood Planks	A	Fiberglass PI /Plastic/PVC caps
Crawl Space	Girl's Room in Basement	Dirt	No ranking	Sealed shut with screws
Crawl Space	Boy's Room in Basement	Dirt	No ranking	Sealed shut with screws

VII. Summary list of Pipe Chase/Pipe Shaft DATA for this location

These charts are to be used for a quick reference regarding the information known about the Pipe Chases and/or Pipe Shafts inspection DATA within this facility. Contact OEMS prior to performing renovation activities any Pipe Chase and/or Pipe Shaft within this facility and refer to the below chart and legend for Asbestos Content of various materials identified within each space. The Data relative to these spaces is updated as conditions change regarding Inspection, Abatement and/or Renovation activity on a case by case basis for each specific location and facility. In general, Pipe Chases are horizontal spaces and Pipe Shafts are vertical spaces.

<i>Element</i>	<i>Floor</i>	<i>On Site Room Name</i>	<i>Material</i>	<i>Confirmed Assumed NAD/Non Suspect</i>	<i>Amount of Material</i>	<i>Amount of Damage</i>
1	3	Basement Boy's Restroom Pipe Chase	X	X	X	No Access
1	3	Basement Girl's Restroom Pipe Chase	X	X	X	No Access

Section I

Report of Re-Inspection

A. Introduction

B. Three-Year Re-Inspection IX Overview

C. Post-Management Plan Activities and Changes

C.1 Sampling and Analysis

C.2 New Floor Tile Sampling

C.3 Abatement Activity

C.4 Periodic Six-Month Surveillance (Damaged Materials)

Section I - A

Report of Re-inspection

Introduction

The Three-Year Re-inspection IX was performed to fulfill the requirements of 40 CFR Part 763 - the Asbestos Hazard Emergency Response Act (AHERA). As required by AHERA, each Local Education Agency (LEA) must re-inspect all known confirmed or assumed Asbestos Containing Building Material (ACBM) located in the LEA's facilities. This re-inspection is intended to update the original Asbestos Management Plan for the LEA's facilities.

Multiple Building Inspectors of several firms performed the 2015/2016 re-inspection. The re-inspection report/Management Plan of 2015-2016 were reviewed and prepared collectively by Management Planner Megan Vala, Mary Anne Lerro of Criterion Laboratories, Inc. and Monique Causley, of Synertech Inc.

All of the certificates can be found in Section III.

During the re-inspection of each School District of Philadelphia facility, all of the Management Plans for that facility were reviewed. Information from the conclusions section of that report is included in this report. Additionally, information on activities such as abatements, cleanings, sampling and inspections, which have taken place since the completion of the original Management Plan, were reviewed during the re-inspection. Information on those activities is included in this report.

As mandated by the U S EPA AHERA regulations, all future periodic Six-Month inspections and Three-Year Re-inspections of this location will be performed and the Inspection Data in this report will be updated accordingly.

Section I - B

Three-Year Re-inspection IX Overview

Each homogeneous area of Asbestos Containing Building Material (ACBM) listed in the original Management Plan or in the 1992, 1995, 1998, 2001, etc., Three-Year Re-inspection reports were inspected for the AHERA Three-Year Re-inspection Volume IX, and the information for that material verified. Any changes to a homogeneous area listed in the updates to the Management Plans were verified. Any area of suspected ACBM found in the course of the re-inspection, and not listed in the Management Plan or updates, were either assumed to contain asbestos or sampled and analyzed to determine their asbestos content. Any such new areas either assumed to contain asbestos or determined through analysis to contain asbestos were included in the report of the Three-Year Re-inspection. The results of the AHERA Three-Year Re-inspection IX are tabulated in the Room by Room log reports located in *Section II-C* of this report.

As previously noted, all future periodic Six-Month inspections and Three-Year Re-inspections of this location will be performed and the Inspection Data in this report will be updated accordingly.

Section I – C.1

Post Management Plan Activities/Changes

Information on activities affecting Asbestos Containing Building Materials (ACBMs) at this location is contained in updates to the Management Plan. These updates are kept on file by the School District of Philadelphia and were reviewed for this project. Updates to the Management Plan include the following: *Sampling and Analysis, New Tile Installation, Abatement Activity and Periodic Six-Month Surveillance Data.*

Sampling and Analysis

In the event Sampling occurs, data will be listed here.

Section I – C.2

Information on the installation of new floor tiles/renovation activities affecting Asbestos Containing Building Materials (ACBMs) at this location is contained in updates to the Management Plan. These updates are kept on file by the School District of Philadelphia and were reviewed for this project. Updates to the Management Plan include the following:

New Floor Tile Sampling

In the event that new tile is installed, the material must be tested prior to installation.

Section I – C.3

Information on the Asbestos Abatement and renovation activities affecting Asbestos Containing Building Materials (ACBMs) at this location is contained in updates to the Management Plan. These updates are kept on file by the School District of Philadelphia and were reviewed for this project. Updates to the Management Plan include the following:

Abatement Activity

In the event Abatement occurs, data will be listed here.

Section I – C.4

Information on the AHERA inspection that noted damage to various Building Materials at this location is contained in updates to the Management Plan. These updates are kept on file by the School District of Philadelphia and were reviewed for this project. Work orders are created for Corrective Action responses and tracked for completion. Updates to the Management Plan include the following:

Periodic (Six-Month) Surveillance (Damaged Materials)

<i>Date</i>	<i>Element</i>	<i>Floor</i>	<i>On Site Room Name</i>	<i>Material</i>	<i>Amount of Material</i>	<i>Amount of Damage</i>
11/18/2016	1	B	Art Room	Floor Tile VAT 12" x 12"	1008 SF	7 SF
11/18/2016	1	B	Art Room Closet	Vibration Damper Cloth	1 SF	1 SF
11/18/2016	1	B	Gym	Pipe Fitting Insulation	77 EA	2 EA
11/18/2016	1	B	Gym	Pipe Insulation 2-6 inch	404 LF	2 LF
11/18/2016	1	B	Logan Cafe 2	Pipe Insulation 2-6 inch	43 LF	2 LF
11/18/2016	1	B	Kitchen	Vibration Damper Cloth	5 SF	1 SF
11/18/2016	1	1	Classroom 101	Pipe Insulation 2-6 inch	50 LF	2 LF
11/18/2016	1	1	Auditorium	Plaster Ceiling	3500 SF	40 SF
11/18/2016	1	1	Classroom 107	Pipe Fitting Insulation	5 EA	1 EA
11/18/2016	1	1	Classroom 108	Pipe Fitting Insulation	6 EA	1 EA
11/18/2016	1	2	Speech Pathologist Office 201A	Pipe Insulation 2-6 inch	6 LF	1 LF
11/18/2016	1	2	Speech Pathologist Office 201A	Floor Tile VAT 12" x 12"	95 SF	2 SF
11/18/2016	1	2	Speech Pathologist Office 201A Restroom	Floor Tile VAT 12" x 12"	70 SF	1 SF
11/18/2016	1	2	Library 201	Floor Tile VAT 12" x 12"	265 SF	2 LF
11/18/2016	1	2	Library 202	Pipe Insulation 2-6 inch	22 LF	1 LF
11/18/2016	1	2	Library 202	Floor Tile VAT 12" x 12"	357 SF	12 SF
11/18/2016	1	2	Nurse's Office	Pipe Fitting Insulation	2 EA	1 EA
11/18/2016	1	2	Classroom 205 Closet	Pipe Fitting Insulation	6 EA	1 EA
11/18/2016	1	2	Storage Room 205A	Floor Tile VAT 9" x 9"	165 SF	8 SF
11/18/2016	1	2	Classroom 206	Pipe Insulation 2-6 inch	30 LF	1 LF
11/18/2016	1	3	Classroom 301 Closet	Pipe Insulation 2-6 inch	20 LF	1 LF
11/18/2016	1	3	Classroom 305	Pipe Insulation 2-6 inch	49 LF	1 LF

Section II

Re-Inspection Data

A. Introduction

B. Re-Inspection Key Definitions

C. Room by Room Location Log Report

Section II - A

Re-inspection Data

Introduction

The following information documents the Three-Year Re-inspection IX of the subject school/facility. The Homogeneous Area Reports were produced using the building inspector's field data on the facility. The key to the Homogeneous Area Report is outlined in the following pages of this report.

Section II - B
(page 1 of 4)

SCHOOL DISTRICT OF PHILADELPHIA
AHERA THREE YEAR RE-INSPECTION IX

ITEM	DEFINITION
ULCS#	Individual identification number assigned to each school within the School District of Philadelphia.
HOMOGENEOUS AREA ID#	Identification number assigned to each homogeneous area in a school/facility. Each section of the homogeneous area ID is significant. 1010/01/01/01 A B C D A. Is the ULCS# for the school. B. Designates the specific building/building area within the school. C. Designates the floor or level within the building/building area. D. Designates the homogeneous material within that floor or level. Note: Item D may be a number or a letter.
SYSTEM AFFECTED	Corresponds to the AHERA system for classifying materials. T : Thermal System S : Surfacing System M : Miscellaneous
ITEM AFFECTED	Is a description of the homogeneous material.
ORIGINAL INSPECTION DATA	This section contains the information found in the original Management Plan (1988-1989).
AMOUNT OF MATERIAL/ UNIT	Quantity of material, and measuring unit. Units include: Square Feet (SF) Each (EA) Linear Feet (LF) Cubic Feet (CF).

**SCHOOL DISTRICT OF PHILADELPHIA
AHERA THREE YEAR RE-INSPECTION IX**

RE-INSPECTION FORM KEY

ITEM	DEFINITION
CND Condition	Corresponds to AHERA condition rating for materials. 0 : No Damage 1 : Damage 2 : Significant Damage
DP Damage Potential	Corresponds to the AHERA material assessment system. 1 : Potential for Damage 2 : Potential for Significant Damage
ASMD Assumed Asbestos	This means that a material was not sampled for asbestos content during the original Management Plan inspection.
RA Response Action	This corresponds to the AHERA system of response action rating for materials. 1 : Establish O&M Program 2 : Repair and Establish O&M Program 3 : Enclose 4 : Encapsulate 5 : Remove 6 : Partial Removal and Establish O&M Program
CHANGES	This section describes changes to the homogeneous material in the twenty-four years since the original AHERA inspection. The abbreviations are defined below. RMVD : Removed ENCL : Enclosed ENCP : Encapsulated DMGD : Damaged SMPLD : Sampled MTRL : Material RPRD : Repaired N/L : None Located RPLCD : Replaced

**SCHOOL DISTRICT OF PHILADELPHIA
AHERA THREE-YEAR RE-INSPECTION IX**

RE-INSPECTION FORM KEY

ITEM	DEFINITION
THREE YEAR RE-INSPECTION	This section contains the information obtained from the Three-Year Re-inspection IX. With three exceptions, the information categories are identical in format and meaning to those found in the original inspection data section. The three exceptions are defined below.
DMGD AMT Amount Damaged	This section gives the quantity of damaged material in a homogeneous area. The quantity is shown in the same format as the amount of material/unit section.
NF Newly Friable	This section identifies materials in the original Management Plan which have since become friable.
RA Response Action	<p>This rating is based on the AHERA regulations, and is comparable to the RA rating found in the "Original Inspection Data" section. The following table details the response actions.</p> <ol style="list-style-type: none">1. Establish O&M Program2. Repair and Establish O&M Program3. Enclose4. Encapsulate5. Remove6. Partial Removal and Establish O&M Program <ol style="list-style-type: none">a. High Priority Response The homogeneous material has been scheduled for abatement or other response action.b. Medium Priority Response The homogeneous material will be scheduled for abatement or other response action as soon as the high priority responses have been addressed.c. Low Priority Response The homogeneous material will be scheduled for abatement or other response action as soon as the medium priority responses have been addressed.d. On-Going Response/Operations and Maintenance The homogeneous material does not require abatement or other response action at present, and should be included in the facility's on-going operations and maintenance program.

**SCHOOL DISTRICT OF PHILADELPHIA
AHERA THREE-YEAR RE-INSPECTION IX**

RE-INSPECTION FORM KEY

The information presented in the changes section has been compiled from a variety of sources, including the Re-inspection and the following:

- * Quality Control/Quality Assurance Reports of asbestos abatement projects, prepared by consultants to the School District.
- * Permit and Notification Forms for asbestos abatement projects.
- * Periodic Surveillance Forms
- * Operations and Maintenance activities performed by School District personnel.
- * Verbal information from School District personnel.
- * Reports of sampling and analysis of suspected materials by both School District personnel and outside consultants.

**ROOM BY
ROOM
LOCATION LOG
REPORT**

This section gives information, including damage amount and location, for a specific homogeneous material on a room-by-room basis and follows the Re-inspection form.

NOTE: The disparate nature of the above sources of information prohibits the verification of much information within the scope of the AHERA Three-Year Re-inspection. Discrepancies and omissions may exist in this information, and therefore is included on an "as is" basis. The inspectors for the Three-Year Re-inspection IX evaluated homogeneous areas based on the materials current condition and location, as evidenced during the inspector's site visit.

Section II - C

Room by Room Location Log Report

These charts are to be used for a quick reference* in order to avoid the unknowing disturbance of Asbestos Containing Materials during any and all Operations, Maintenance, Renovation, and/or Demolition activities at this location.

NOTE:

Contact OEMS prior to the disturbance of any of the materials that are listed as **Confirmed and/or Assumed**.

The quantities listed for (NAD) non-asbestos containing materials and/or Non-Suspect Materials are only estimated and were not measured for the purpose of this report. Field verification of quantities for renovation purposes would be necessary.

6300 Logan ES 2015-2016 AHERA Three Year Report

E l e m e n t F l o o r		School District of Philadelphia James Logan Elementary School (K-5) 1700 Lindley Avenue, Philadelphia, PA 19141 ULCS# 6300 Year Built: 1924		AHERA Three-Year Reinspection 2015-2016 Room by Room Location Log Report							Reinspection Date: 10/14-16/2015			
								Building Inspector: Bernard Brunner Certificate Number: 45397 Management Planner: Monique Causley Certificate Number: ACC-0215-8-010						
On Site Room Name	System Affected	Material Description	HID#	Confirmed Assumed NAD Non Suspect ACM	Amount of Material	SF LF EA	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic/Crawl Space Ranking	Damage Potential (DP)	Newly Friable (NF)	Response Action (RA)
1 B Basement Boy's Restroom	T	Pipe Fitting Insulation	6300/01/0B/04	Confirmed	29	EA	0	EA				1	No	1/D
1 B Basement Boy's Restroom	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	100	LF	10	LF				N/A	N/A	N/A
1 B Basement Boy's Restroom	N/A	Plaster Ceiling		NAD	575	SF	20	SF				N/A	N/A	N/A
1 B Basement Boy's Restroom	N/A	Plaster Walls		NAD	1155	SF	0	SF				N/A	N/A	N/A
1 B Basement Boy's Restroom	N/A	Cement Floor		Non Suspect ACM	575	SF	0	SF				N/A	N/A	N/A
1 B Basement Boy's Restroom Pipe Chase	X	X	X	X	X	X	X	X	X	No access	X	X	X	X
1 B Classroom 0B1 Large Closet	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	12	LF	0	LF				N/A	N/A	N/A
1 B Classroom 0B1 Large Closet	N/A	Plaster Ceiling		NAD	55	SF	0	SF				N/A	N/A	N/A
1 B Classroom 0B1 Large Closet	N/A	Plaster Walls		NAD	385	SF	0	SF				N/A	N/A	N/A
1 B Classroom 0B1 Large Closet	N/A	Wood Floor		Non Suspect ACM	55	SF	0	SF				N/A	N/A	N/A
1 B Classroom B1 Small Closet	N/A	Plaster Ceiling		NAD	30	SF	0	SF				N/A	N/A	N/A
1 B Classroom B1 Small Closet	N/A	Plaster Walls		NAD	120	SF	0	SF				N/A	N/A	N/A
1 B Classroom B1 Small Closet	N/A	Wood Floor		Non Suspect ACM	30	SF	0	SF				N/A	N/A	N/A
1 B Classroom B1	T	Pipe Fitting Insulation	6300/01/0B/04	Confirmed	8	EA	0	EA				1	No	1/D
1 B Classroom B1	T	Pipe Insulation 2-6 inch	6300/01/0B/02	Confirmed	116	LF	0	LF				1	No	1/D
1 B Classroom B1	N/A	Plaster Ceiling		NAD	864	SF	0	SF				N/A	N/A	N/A
1 B Classroom B1	N/A	Plaster Walls		NAD	720	SF	0	SF				N/A	N/A	N/A
1 B Classroom B1	N/A	Brick Wall		Non Suspect ACM	720	SF	0	SF				N/A	N/A	N/A
1 B Classroom B1	N/A	Wood Floor		Non Suspect ACM	864	SF	0	SF				N/A	N/A	N/A
1 B Classroom B1	M	Blackboard Glue Dots	6300/01/0B/AET/BB/2600	Assumed	130	SF	0	SF				1	No	1/D
1 B Classroom B2	T	Pipe Fitting Insulation	6300/01/0B/04	Confirmed	5	EA	0	EA				1	No	1/D
1 B Classroom B2	T	Pipe Insulation 2-6 inch	6300/01/0B/02	Confirmed	25	LF	0	LF				1	No	1/D
1 B Classroom B2	N/A	Plaster Ceiling		NAD	840	SF	0	SF				N/A	N/A	N/A
1 B Classroom B2	N/A	Plaster Walls		NAD	710	SF	0	SF				N/A	N/A	N/A
1 B Classroom B2	N/A	Brick Wall		Non Suspect ACM	710	SF	0	SF				N/A	N/A	N/A
1 B Classroom B2	N/A	Carpet		Non Suspect ACM	840	SF	0	SF				N/A	N/A	N/A
1 B Classroom B2	N/A	Wood Floor		Non Suspect ACM	840	SF	0	SF				N/A	N/A	N/A
1 B Classroom B2	M	Blackboard Glue Dots	6300/01/0B/AET/BB/2600	Assumed	135	SF	0	SF				1	No	1/D
1 B Classroom B2 Small Closet	N/A	Plaster Ceiling		NAD	55	SF	0	SF				N/A	N/A	N/A
1 B Classroom B2 Small Closet	N/A	Plaster Walls		NAD	385	SF	0	SF				N/A	N/A	N/A
1 B Classroom B2 Small Closet	N/A	Wood Floor		Non Suspect ACM	55	SF	0	SF				N/A	N/A	N/A
1 B Classroom 0B2 Large Closet	N/A	Plaster Ceiling		NAD	66	SF	0	SF				N/A	N/A	N/A
1 B Classroom 0B2 Large Closet	N/A	Plaster Walls		NAD	410	SF	0	SF				N/A	N/A	N/A
1 B Classroom 0B2 Large Closet	N/A	Wood Floor		Non Suspect ACM	66	SF	0	SF				N/A	N/A	N/A
1 B Art Room	T	Pipe Fitting Insulation	6300/01/0B/04	Confirmed	13	EA	0	EA				1	No	1/D
1 B Art Room	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	100	LF	0	LF				N/A	N/A	N/A
1 B Art Room	N/A	Plaster Ceiling		NAD	1008	SF	100	SF				N/A	N/A	N/A
1 B Art Room	N/A	Brick Wall		Non Suspect ACM	1585	SF	0	SF				N/A	N/A	N/A
1 B Art Room	M	Floor Tile VAT 12" x 12"	6300/01/0B/JJ	Assumed	1008	SF	7	SF	Black			1	No	6/C
1 B Art Room	N/A	Cement Floor		Non Suspect ACM	1008	SF	0	SF				N/A	N/A	N/A
1 B Art Room Closet	N/A	Plaster Ceiling		NAD	45	SF	0	SF				N/A	N/A	N/A
1 B Art Room Closet	N/A	Plaster Walls		NAD	200	SF	0	SF				N/A	N/A	N/A
1 B Art Room Closet	N/A	Cement Floor		Non Suspect ACM	45	SF	0	SF				N/A	N/A	N/A
1 B Art Room Closet	M	Vibration Damper Cloth	6300/01/0B/07	Assumed	1	SF	1	SF		Most of the VDC is gone. Material remains inside both sides of the metal duct.		1	No	6/C
1 B Gym	T	Pipe Fitting Insulation	6300/01/0B/04	Confirmed	77	EA	2	EA				1	Yes	2/B
1 B Gym	T	Pipe Insulation 2-6 inch	6300/01/0B/02	Confirmed	404	LF	2	LF				1	Yes	2/B
1 B Gym	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	80	LF	0	LF				N/A	N/A	N/A
1 B Gym	N/A	Plaster Ceiling		NAD	3920	SF	0	SF				N/A	N/A	N/A
1 B Gym	N/A	Brick Wall		Non Suspect ACM	3870	SF	0	SF				N/A	N/A	N/A
1 B Gym	M	Floor Tile VAT 12" x 12"	6300/01/0B/JJ	Assumed	3662	SF	0	SF	Blue			1	No	1/D
1 B Gym	M	Floor Tile VAT 12" x 12"	6300/01/0B/JJ	Assumed	258	SF	0	SF	Grey			1	No	1/D
1 B Gym	N/A	Cement Floor		Non Suspect ACM	3920	SF	0	SF				N/A	N/A	N/A
1 B Gym Storage Room	T	Pipe Fitting Insulation	6300/01/0B/04	Confirmed	6	EA	0	EA		No Access		1	No	1/D
1 B Gym Storage Room	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	100	LF	0	LF				N/A	N/A	N/A
1 B Gym Storage Room	N/A	Concrete Ceiling		Non Suspect ACM	522	SF	0	SF				N/A	N/A	N/A
1 B Gym Storage Room	N/A	Brick Wall		Non Suspect ACM	1410	SF	0	SF				N/A	N/A	N/A
1 B Gym Storage Room	M	Floor Tile VAT 12" x 12"	6300/01/0B/JJ	Assumed	522	SF	0	SF	Brown			1	No	1/D
1 B Gym Storage Room	N/A	Cement Floor		Non Suspect ACM	522	SF	0	SF				N/A	N/A	N/A
1 B Gym Office	T	Pipe Fitting Insulation	6300/01/0B/04	Confirmed	9	EA	0	EA		No Access		1	No	1/D
1 B Gym Office	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	48	LF	0	LF				N/A	N/A	N/A
1 B Gym Office	N/A	Plaster Ceiling		NAD	176	SF	0	SF				N/A	N/A	N/A
1 B Gym Office	N/A	Brick Wall		Non Suspect ACM	810	SF	0	SF				N/A	N/A	N/A
1 B Gym Office	M	Floor Tile VAT 12" x 12"	6300/01/0B/JJ	Assumed	176	SF	0	SF	Brown			1	No	1/D
1 B Gym Office	N/A	Cement Floor		Non Suspect ACM	176	SF	0	SF				N/A	N/A	N/A
1 B Fan Room	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	100	SF	0	SF				N/A	N/A	N/A
1 B Fan Room	M	Transite Electrical Panel	6300/01/0B/BB	Confirmed	58	SF	0	SF				1	No	1/D
1 B Fan Room	N/A	Concrete Ceiling		Non Suspect ACM	1350	SF	1350	SF				N/A	N/A	N/A
1 B Fan Room	N/A	Brick Wall		Non Suspect ACM	2400	SF	2400	SF				N/A	N/A	N/A
1 B Fan Room	N/A	Cement Floor		Non Suspect ACM	1350	SF	0	SF				N/A	N/A	N/A

6300 Logan ES 2015-2016 AHERA Three Year Report

Element		School District of Philadelphia James Logan Elementary School (K-5) 1700 Lindley Avenue, Philadelphia, PA 19141 ULCS# 6300 Year Built: 1924		AHERA Three-Year Reinspection 2015-2016 Room by Room Location Log Report										Reinspection Date: 10/14-16/2015			
														Building Inspector: Bernard Brunner Certificate Number: 45397 Management Planner: Monique Causley Certificate Number: ACC-0215-8-010			
Element	Room	System Affected	Material Description	HID#	Confirmed Assumed NAD Non Suspect ACM	Amount of Material	SF LF EA	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic/Crawl Space Ranking	Damage Potential (DP)	Newly Friable (NF)	Response Action (RA)		
1	B	Boiler Room	T	Pipe Fitting Insulation	6300/01/0B/04	Confirmed	46	EA	0	EA			1	No	1/D		
1	B	Boiler Room	T	Pipe Insulation 2-6 inch	6300/01/0B/02	Confirmed	163	LF	0	LF			1	No	1/D		
1	B	Boiler Room	T	Pipe Insulation > 6 inch	6300/01/0B/03	Confirmed	78	LF	0	LF			1	No	1/D		
1	B	Boiler Room	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	250	LF	0	LF			N/A	N/A	N/A		
1	B	Boiler Room	N/A	Concrete Ceiling		Non Suspect ACM	1848	SF	0	SF			N/A	N/A	N/A		
1	B	Boiler Room	N/A	Brick Wall		Non Suspect ACM	2755	SF	0	SF			N/A	N/A	N/A		
1	B	Boiler Room	N/A	Cement Floor		Non Suspect ACM	1848	SF	0	SF			N/A	N/A	N/A		
1	B	Boiler Room	T	Tank Insulation	6300/01/0B/AET/BB/1660	Assumed	10	SF	0	SF			1	No	1/D		
1	B	Boiler Room	T	Emergency Generator Piping	6300/01/0B/AET/BB/2604	Assumed	10	LF	0	LF			1	No	1/D		
1	B	Boiler Room Storage Closest to Stairs	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	150	LF	0	LF			N/A	N/A	N/A		
1	B	Boiler Room Storage Closest to Stairs	N/A	Fireproofing		NAD	2800	SF	0	SF	sampled March 2011		N/A	N/A	N/A		
1	B	Boiler Room Storage Closest to Stairs	N/A	Concrete Ceiling		Non Suspect ACM	2800	SF	0	SF			N/A	N/A	N/A		
1	B	Boiler Room Storage Closest to Stairs	N/A	Concrete Walls		Non Suspect ACM	2545	SF	0	SF			N/A	N/A	N/A		
1	B	Boiler Room Storage Closest to Stairs	N/A	Cement Floor		Non Suspect ACM	2800	SF	0	SF			N/A	N/A	N/A		
1	B	Boiler Room Storage Closest to Fan Room	N/A	Fireproofing		NAD	1000	SF	0	SF	sampled March 2011		N/A	N/A	N/A		
1	B	Boiler Room Storage Closest to Fan Room	N/A	Concrete Ceiling		Non Suspect ACM	1938	SF	0	SF			N/A	N/A	N/A		
1	B	Boiler Room Storage Closest to Fan Room	N/A	Concrete Walls		Non Suspect ACM	2184	SF	0	SF			N/A	N/A	N/A		
1	B	Boiler Room Storage Closest to Fan Room	N/A	Cement Floor		Non Suspect ACM	1938	SF	0	SF			N/A	N/A	N/A		
1	B	Building Engineer's Restroom	T	Pipe Fitting Insulation	6300/01/0B/04	Confirmed	6	EA	0	EA			1	No	1/D		
1	B	Building Engineer's Restroom	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	80	LF	0	LF			N/A	N/A	N/A		
1	B	Building Engineer's Restroom	N/A	Concrete Ceiling		Non Suspect ACM	168	SF	0	SF			N/A	N/A	N/A		
1	B	Building Engineer's Restroom	N/A	Brick Wall		Non Suspect ACM	625	SF	0	SF			N/A	N/A	N/A		
1	B	Building Engineer's Restroom	N/A	Cement Floor		Non Suspect ACM	168	SF	0	SF			N/A	N/A	N/A		
1	B	Storage Room adjacent to Building Engineer's Restroom	N/A	Concrete Ceiling	X	Non Suspect ACM	200	SF	0	SF	No Access		N/A	N/A	N/A		
1	B	Storage Room adjacent to Building Engineer's Restroom	N/A	Brick Wall		Non Suspect ACM	470	SF	0	SF			N/A	N/A	N/A		
1	B	Storage Room adjacent to Building Engineer's Restroom	N/A	Cement Floor		Non Suspect ACM	200	SF	0	SF			N/A	N/A	N/A		
1	B	Stairwell inside Boiler Room	N/A	Concrete Ceiling		Non Suspect ACM	25	SF	0	SF			N/A	N/A	N/A		
1	B	Stairwell inside Boiler Room	N/A	Brick Wall		Non Suspect ACM	100	SF	0	SF			N/A	N/A	N/A		
1	B	Stairwell inside Boiler Room	N/A	Cement Floor		Non Suspect ACM	25	SF	0	SF			N/A	N/A	N/A		
1	B	Boiler Room Restroom	T	Pipe Fitting Insulation	6300/01/0B/04	Confirmed	8	EA	0	EA			1	No	1/D		
1	B	Boiler Room Restroom	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	50	LF	0	LF			N/A	N/A	N/A		
1	B	Boiler Room Restroom	N/A	Concrete Ceiling		Non Suspect ACM	45	SF	0	SF			N/A	N/A	N/A		
1	B	Boiler Room Restroom	N/A	Brick Wall		Non Suspect ACM	450	SF	0	SF			N/A	N/A	N/A		
1	B	Boiler Room Restroom	N/A	Cement Floor		Non Suspect ACM	45	SF	0	SF			N/A	N/A	N/A		
1	B	Stairwell adjacent to Boiler Room Restroom	T	Pipe Fitting Insulation	6300/01/0B/04	Confirmed	5	EA	0	EA			1	No	1/D		
1	B	Stairwell adjacent to Boiler Room Restroom	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	45	LF	0	LF			N/A	N/A	N/A		
1	B	Stairwell adjacent to Boiler Room Restroom	N/A	Concrete Ceiling		Non Suspect ACM	297	SF	0	SF			N/A	N/A	N/A		
1	B	Stairwell adjacent to Boiler Room Restroom	N/A	Brick Wall		Non Suspect ACM	1220	SF	0	SF			N/A	N/A	N/A		
1	B	Stairwell adjacent to Boiler Room Restroom	N/A	Cement Floor		Non Suspect ACM	297	SF	0	SF			N/A	N/A	N/A		
1	B	Left Storage Room outside Logan Cafe 2	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	30	LF	0	LF			N/A	N/A	N/A		
1	B	Left Storage Room outside Logan Cafe 2	N/A	Concrete Ceiling		Non Suspect ACM	80	SF	0	SF			N/A	N/A	N/A		
1	B	Left Storage Room outside Logan Cafe 2	N/A	Brick Wall		Non Suspect ACM	435	SF	0	SF			N/A	N/A	N/A		
1	B	Left Storage Room outside Logan Cafe 2	N/A	Wood Floor		Non Suspect ACM	80	SF	0	SF			N/A	N/A	N/A		
1	B	Right Storage Room outside Logan Cafe 2	N/A	Concrete Ceiling		Non Suspect ACM	60	SF	0	SF			N/A	N/A	N/A		
1	B	Right Storage Room outside Logan Cafe 2	N/A	Brick Wall		Non Suspect ACM	385	SF	0	SF			N/A	N/A	N/A		
1	B	Right Storage Room outside Logan Cafe 2	N/A	Cement Floor		Non Suspect ACM	60	SF	0	SF			N/A	N/A	N/A		
1	B	Logan Cafe 2	T	Pipe Fitting Insulation	6300/01/0B/04	Confirmed	19	EA	0	EA			1	No	1/D		
1	B	Logan Cafe 2	T	Pipe Insulation 2-6 inch	6300/01/0B/02	Confirmed	43	LF	2	LF			1	Yes	2/B		
1	B	Logan Cafe 2	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	70	LF	0	LF			N/A	N/A	N/A		
1	B	Logan Cafe 2	N/A	Plaster Ceiling		NAD	816	SF	50	SF			N/A	N/A	N/A		
1	B	Logan Cafe 2	N/A	Plaster Walls		NAD	1395	SF	5	SF			N/A	N/A	N/A		
1	B	Logan Cafe 2	N/A	Wood Floor		Non Suspect ACM	816	SF	0	SF			N/A	N/A	N/A		
1	B	Logan Cafe 2 Small Closet	T	Pipe Fitting Insulation	6300/01/0B/04	Confirmed	2	EA	0	EA			1	No	1/D		
1	B	Logan Cafe 2 Small Closet	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	14	LF	5	LF			N/A	N/A	N/A		
1	B	Logan Cafe 2 Small Closet	N/A	Plaster Ceiling		NAD	55	SF	25	SF			N/A	N/A	N/A		
1	B	Logan Cafe 2 Small Closet	N/A	Plaster Walls		NAD	385	SF	20	SF			N/A	N/A	N/A		
1	B	Logan Cafe 2 Small Closet	N/A	Wood Floor		Non Suspect ACM	55	SF	0	SF			N/A	N/A	N/A		
1	B	Logan Cafe 2 Large Closet	X	X	X	X	X	X	X	X	No Access		X	X	X		
1	B	Logan Cafe 1	T	Pipe Fitting Insulation	6300/01/0B/04	Confirmed	8	EA	0	EA			1	No	1/D		
1	B	Logan Cafe 1	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	68	LF	0	LF			N/A	N/A	N/A		
1	B	Logan Cafe 1	N/A	Plaster Ceiling		NAD	1392	SF	25	SF			N/A	N/A	N/A		
1	B	Logan Cafe 1	N/A	Plaster Walls		NAD	985	SF	15	SF			N/A	N/A	N/A		
1	B	Logan Cafe 1	N/A	Brick Wall		Non Suspect ACM	985	SF	0	SF			N/A	N/A	N/A		
1	B	Logan Cafe 1	N/A	Wood Floor		Non Suspect ACM	1392	SF	0	SF			N/A	N/A	N/A		
1	B	Kitchen	T	Pipe Fitting Insulation	6300/01/0B/04	Confirmed	17	EA	0	EA			1	No	1/D		
1	B	Kitchen	N/A	Plaster Ceiling		NAD	504	SF	0	SF			N/A	N/A	N/A		
1	B	Kitchen	N/A	Plaster Walls		NAD	540	SF	0	SF			N/A	N/A	N/A		
1	B	Kitchen	N/A	Brick Wall		Non Suspect ACM	540	SF	0	SF			N/A	N/A	N/A		
1	B	Kitchen	N/A	Wood Floor		Non Suspect ACM	250	SF	0	SF			N/A	N/A	N/A		
1	B	Kitchen	N/A	Cement Floor		Non Suspect ACM	250	SF	0	SF			N/A	N/A	N/A		

6300 Logan ES 2015-2016 AHERA Three Year Report

Element		School District of Philadelphia James Logan Elementary School (K-5) 1700 Lindley Avenue, Philadelphia, PA 19141 ULCS# 6300 Year Built: 1924		AHERA Three-Year Reinspection 2015-2016 Room by Room Location Log Report							Reinspection Date: 10/14-16/2015				
								Building Inspector: Bernard Brunner Certificate Number: 45397 Management Planner: Monique Causley Certificate Number: ACC-0215-8-010							
Element	Room	System Affected	Material Description	HID#	Confirmed Assumed NAD Non Suspect ACM	Amount of Material	SF LF EA	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic/Crawl Space Ranking	Damage Potential (DP)	Newly Friable (NF)	Response Action (RA)
1	B Kitchen	M	Vibration Damper Cloth	6300/01/0B/07	Assumed	5	SF	1	SF				1	No	6/C
1	B Kitchen Office	T	Pipe Fitting Insulation	6300/01/0B/04	Confirmed	5	EA	0	EA		No Access - Unknown Room in Kitchen		1	No	1/D
1	B Kitchen Office	T	Pipe Insulation 2-6 inch	6300/01/0B/02	Confirmed	14	LF	0	LF				1	No	1/D
1	B Kitchen Office	N/A	Plaster Ceiling		NAD	180	SF	0	SF				N/A	N/A	N/A
1	B Kitchen Office	N/A	Plaster Walls		NAD	450	SF	0	SF				N/A	N/A	N/A
1	B Kitchen Office	N/A	Cement Floor		Non Suspect ACM	180	SF	0	SF				N/A	N/A	N/A
1	B Basement Girl's Restroom	T	Pipe Fitting Insulation	6300/01/0B/04	Confirmed	30	EA	0	EA				1	No	1/D
1	B Basement Girl's Restroom	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	100	SF	0	SF				N/A	N/A	N/A
1	B Basement Girl's Restroom	N/A	Plaster Ceiling		NAD	528	SF	0	SF				N/A	N/A	N/A
1	B Basement Girl's Restroom	N/A	Brick Wall		Non Suspect ACM	1100	SF	0	SF				N/A	N/A	N/A
1	B Basement Girl's Restroom	M	Transite Stalls	6300/01/0B/BB	Confirmed	24	SF	0	SF				1	No	1/D
1	B Basement Girl's Restroom	N/A	Cement Floor		Non Suspect ACM	528	SF	0	SF				N/A	N/A	N/A
1	B Basement Girl's Restroom Pipe Chase	X	X		X	X	X	X	X	X	No Access		X	X	X
1	B Hallway outside Logan Cafe 1	T	Pipe Fitting Insulation	6300/01/0B/04	Confirmed	32	EA	0	EA				1	No	1/D
1	B Hallway outside Logan Cafe 1	T	Pipe Insulation 2-6 inch	6300/01/0B/02	Confirmed	10	LF	0	LF				1	No	1/D
1	B Hallway outside Logan Cafe 1	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	360	LF	0	LF				N/A	N/A	N/A
1	B Hallway outside Logan Cafe 1	N/A	Concrete Ceiling		Non Suspect ACM	1060	SF	0	SF				N/A	N/A	N/A
1	B Hallway outside Logan Cafe 1	N/A	Brick Wall		Non Suspect ACM	2545	SF	0	SF				N/A	N/A	N/A
1	B Hallway outside Logan Cafe 1	N/A	Cement Floor		Non Suspect ACM	1060	SF	0	SF				N/A	N/A	N/A
1	B Hallway outside Gym	T	Pipe Fitting Insulation	6300/01/0B/04	Confirmed	38	EA	0	EA				1	No	1/D
1	B Hallway outside Gym	T	Pipe Insulation 2-6 inch	6300/01/0B/02	Confirmed	16	LF	0	LF				1	No	1/D
1	B Hallway outside Gym	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	400	LF	0	LF				N/A	N/A	N/A
1	B Hallway outside Gym	N/A	Concrete Ceiling		Non Suspect ACM	1575	SF	0	SF				N/A	N/A	N/A
1	B Hallway outside Gym	N/A	Brick Wall		Non Suspect ACM	2500	SF	0	SF				N/A	N/A	N/A
1	B Hallway outside Gym	N/A	Cement Floor		Non Suspect ACM	1575	SF	0	SF				N/A	N/A	N/A
1	B Hallway outside Classrooms B1-B2	T	Pipe Fitting Insulation	6300/01/0B/04	Confirmed	30	EA	0	EA				1	No	1/D
1	B Hallway outside Classrooms B1-B2	T	Pipe Insulation 2-6 inch	6300/01/0B/02	Confirmed	45	LF	0	LF				1	No	1/D
1	B Hallway outside Classrooms B1-B2	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	360	LF	0	LF				N/A	N/A	N/A
1	B Hallway outside Classrooms B1-B2	N/A	Concrete Ceiling		Non Suspect ACM	1060	SF	0	SF				N/A	N/A	N/A
1	B Hallway outside Classrooms B1-B2	N/A	Brick Wall		Non Suspect ACM	2545	SF	0	SF				N/A	N/A	N/A
1	B Hallway outside Classrooms B1-B2	N/A	Cement Floor		Non Suspect ACM	1060	SF	0	SF				N/A	N/A	N/A
1	1 Women's Restroom 100	T	Pipe Fitting Insulation	6300/01/01/11	Confirmed	27	EA	0	EA				1	No	1/D
1	1 Women's Restroom 100	T	Pipe Insulation 2-6 inch	6300/01/01/09	Confirmed	6	LF	0	LF				1	No	1/D
1	1 Women's Restroom 100	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	64	LF	3	LF				N/A	N/A	N/A
1	1 Women's Restroom 100	N/A	Plaster Ceiling		NAD	120	SF	5	SF				N/A	N/A	N/A
1	1 Women's Restroom 100	N/A	Plaster Walls		NAD	530	SF	100	SF				N/A	N/A	N/A
1	1 Women's Restroom 100	N/A	Marble Floor		Non Suspect ACM	80	SF	0	SF				N/A	N/A	N/A
1	1 Women's Restroom 100	M	Floor Tile VAT 12" x 12"	6300/01/01/KK	Assumed	120	SF	0	SF	Tan			1	No	1/D
1	1 Women's Restroom 100	N/A	Wood Floor		Non Suspect ACM	120	SF	0	SF				N/A	N/A	N/A
1	1 Classroom 101	T	Pipe Fitting Insulation	6300/01/01/11	Confirmed	9	EA	0	EA				1	No	1/D
1	1 Classroom 101	T	Pipe Insulation 2-6 inch	6300/01/01/09	Confirmed	50	LF	2	LF				1	Yes	2/B
1	1 Classroom 101	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	7	LF	0	LF				N/A	N/A	N/A
1	1 Classroom 101	N/A	Plaster Ceiling		NAD	720	SF	40	SF				N/A	N/A	N/A
1	1 Classroom 101	N/A	Plaster Walls		NAD	1010	SF	0	SF				N/A	N/A	N/A
1	1 Classroom 101	N/A	Partition Room Dividers		Non Suspect ACM	290	SF	0	SF		Wood Partition		N/A	N/A	N/A
1	1 Classroom 101	N/A	Wood Floor		Non Suspect ACM	720	SF	0	SF				N/A	N/A	N/A
1	1 Classroom 101	M	Blackboard Glue Dots	6300/01/01/AET/BB/2600	Assumed	110	SF	0	SF				1	No	1/D
1	1 Classroom 101 Closet	T	Pipe Fitting Insulation	6300/01/01/11	Confirmed	9	EA	0	EA				1	No	1/D
1	1 Classroom 101 Closet	T	Pipe Insulation 2-6 inch	6300/01/01/09	Confirmed	67	LF	0	LF				1	No	1/D
1	1 Classroom 101 Closet	N/A	Plaster Ceiling		NAD	96	SF	0	SF				N/A	N/A	N/A
1	1 Classroom 101 Closet	N/A	Plaster Walls		NAD	585	SF	0	SF				N/A	N/A	N/A
1	1 Classroom 101 Closet	N/A	Wood Floor		Non Suspect ACM	96	SF	0	SF				N/A	N/A	N/A
1	1 Assistant Principal's Office	T	Pipe Fitting Insulation	6300/01/01/11	Confirmed	1	EA	0	EA				1	No	1/D
1	1 Assistant Principal's Office	T	Pipe Insulation 2-6 inch	6300/01/01/09	Confirmed	14	LF	0	LF				1	No	1/D
1	1 Assistant Principal's Office	N/A	Plaster Ceiling		NAD	720	SF	0	SF				N/A	N/A	N/A
1	1 Assistant Principal's Office	N/A	Plaster Walls		NAD	720	SF	0	SF				N/A	N/A	N/A
1	1 Assistant Principal's Office	N/A	Partition Room Dividers		Non Suspect ACM	580	SF	0	SF		Wood Partition		N/A	N/A	N/A
1	1 Assistant Principal's Office	N/A	Wood Floor		Non Suspect ACM	720	SF	5	SF				N/A	N/A	N/A
1	1 Assistant Principal's Office	M	Blackboard Glue Dots	6300/01/01/AET/BB/2600	Assumed	50	SF	0	SF				1	No	1/D
1	1 Classroom 103	T	Pipe Fitting Insulation	6300/01/01/11	Confirmed	4	EA	0	EA				1	No	1/D
1	1 Classroom 103	T	Pipe Insulation 2-6 inch	6300/01/01/09	Confirmed	27	LF	0	LF				1	No	1/D
1	1 Classroom 103	N/A	Plaster Ceiling		NAD	840	SF	0	SF				N/A	N/A	N/A
1	1 Classroom 103	N/A	Plaster Walls		NAD	1130	SF	0	SF				N/A	N/A	N/A
1	1 Classroom 103	N/A	Partition Room Dividers		Non Suspect ACM	290	SF	0	SF		Wood Partition		N/A	N/A	N/A
1	1 Classroom 103	N/A	Wood Floor		Non Suspect ACM	840	SF	0	SF				N/A	N/A	N/A
1	1 Classroom 103	M	Blackboard Glue Dots	6300/01/01/AET/BB/2600	Assumed	75	SF	0	SF				1	No	1/D
1	1 Classroom 103 Closet	T	Pipe Insulation 2-6 inch	6300/01/01/09	Confirmed	6	LF	0	LF				1	No	1/D
1	1 Classroom 103 Closet	N/A	Plaster Ceiling		NAD	96	SF	0	SF				N/A	N/A	N/A
1	1 Classroom 103 Closet	N/A	Plaster Walls		NAD	585	SF	0	SF				N/A	N/A	N/A
1	1 Classroom 103 Closet	N/A	Wood Floor		Non Suspect ACM	96	SF	0	SF				N/A	N/A	N/A

6300 Logan ES 2015-2016 AHERA Three Year Report

Element		School District of Philadelphia James Logan Elementary School (K-5) 1700 Lindley Avenue, Philadelphia, PA 19141 ULCS# 6300 Year Built: 1924		AHERA Three-Year Reinspection 2015-2016 Room by Room Location Log Report										Reinspection Date: 10/14-16/2015			
				Building Inspector: Bernard Brunner				Certificate Number: 45397				Management Planner: Monique Causley					
Floor		On Site Room Name	System Affected	Material Description	HID#	Confirmed Assumed NAD Non Suspect ACM	Amount of Material	SF LF EA	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic/Crawl Space Ranking	Damage Potential (DP)	Newly Friable (NF)	Response Action (RA)	
1	1	Custodial Closet adjacent to Classroom 103	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	60	SF	0	SF				N/A	N/A	N/A	
1	1	Custodial Closet adjacent to Classroom 103	N/A	Plaster Ceiling		NAD	45	SF	20	SF				N/A	N/A	N/A	
1	1	Custodial Closet adjacent to Classroom 103	N/A	Plaster Walls		NAD	340	SF	10	SF				N/A	N/A	N/A	
1	1	Custodial Closet adjacent to Classroom 103	N/A	Cement Floor		Non Suspect ACM	45	SF	0	SF				N/A	N/A	N/A	
1	1	Main Office	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	8	LF	0	LF				N/A	N/A	N/A	
1	1	Main Office	N/A	Fiberglass Ceiling Tile 2' x 4'		Non Suspect ACM	325	SF	0	SF				N/A	N/A	N/A	
1	1	Main Office	N/A	Plaster Ceiling		NAD	325	SF	0	SF				N/A	N/A	N/A	
1	1	Main Office	N/A	Plaster Walls		NAD	890	SF	0	SF				N/A	N/A	N/A	
1	1	Main Office	M	Floor Tile VAT 12" x 12"	6300/01/01/KK	Assumed	325	SF	0	SF	Tan			1	No	1/D	
1	1	Main Office	N/A	Wood Floor		Non Suspect ACM	325	SF	0	SF				N/A	N/A	N/A	
1	1	Principal's Office	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	20	LF	0	LF				N/A	N/A	N/A	
1	1	Principal's Office	N/A	Fiberglass Ceiling Tile 2' x 4'		Non Suspect ACM	285	SF	0	SF				N/A	N/A	N/A	
1	1	Principal's Office	N/A	Plaster Ceiling		NAD	285	SF	0	SF				N/A	N/A	N/A	
1	1	Principal's Office	N/A	Plaster Walls		NAD	700	SF	0	SF				N/A	N/A	N/A	
1	1	Principal's Office	M	Floor Tile VAT 12" x 12"	6300/01/01/KK	Assumed	285	SF	0	SF	Tan			1	No	1/D	
1	1	Principal's Office	N/A	Wood Floor		Non Suspect ACM	285	SF	0	SF				N/A	N/A	N/A	
1	1	Principal's Office Restroom	N/A	Plaster Ceiling		NAD	32	SF	0	SF				N/A	N/A	N/A	
1	1	Principal's Office Restroom	N/A	Plaster Walls		NAD	150	SF	0	SF				N/A	N/A	N/A	
1	1	Principal's Office Restroom	M	Floor Tile VAT 12" x 12"	6300/01/01/KK	Assumed	32	SF	0	SF	Grey			1	No	1/D	
1	1	Principal's Office Restroom	N/A	Wood Floor		Non Suspect ACM	32	SF	0	SF				N/A	N/A	N/A	
1	1	Principals Office Closet	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	36	LF	0	LF				N/A	N/A	N/A	
1	1	Principals Office Closet	N/A	Plaster Ceiling		NAD	20	SF	0	SF				N/A	N/A	N/A	
1	1	Principals Office Closet	N/A	Wood Ceiling		Non Suspect ACM	20	SF	0	SF				N/A	N/A	N/A	
1	1	Principals Office Closet	N/A	Plaster Walls		NAD	140	SF	0	SF				N/A	N/A	N/A	
1	1	Principals Office Closet	M	Floor Tile VAT 12" x 12"	6300/01/01/KK	Assumed	20	SF	0	SF	Brown			1	No	1/D	
1	1	Principals Office Closet	N/A	Wood Floor		Non Suspect ACM	20	SF	0	SF				N/A	N/A	N/A	
1	1	Girls Restroom	T	Pipe Fitting Insulation	6300/01/01/11	Confirmed	19	EA	0	EA				1	No	1/D	
1	1	Girls Restroom	T	Pipe Insulation 2-6 inch	6300/01/01/09	Confirmed	6	LF	0	LF				1	No	1/D	
1	1	Girls Restroom	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	59	LF	0	LF				N/A	N/A	N/A	
1	1	Girls Restroom	N/A	Plaster Ceiling		NAD	161	SF	5	SF				N/A	N/A	N/A	
1	1	Girls Restroom	N/A	Plaster Walls		NAD	720	SF	15	SF				N/A	N/A	N/A	
1	1	Girls Restroom	N/A	Ceramic Tile Walls		Non Suspect ACM	360	SF	0	SF				N/A	N/A	N/A	
1	1	Girls Restroom	N/A	Cement Floor		Non Suspect ACM	161	SF	0	SF				N/A	N/A	N/A	
1	1	Classroom 104	T	Pipe Fitting Insulation	6300/01/01/11	Confirmed	4	EA	0	EA				1	No	1/D	
1	1	Classroom 104	T	Pipe Insulation 2-6 inch	6300/01/01/09	Confirmed	23	LF	0	LF				1	No	1/D	
1	1	Classroom 104	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	5	LF	0	LF				N/A	N/A	N/A	
1	1	Classroom 104	N/A	Plaster Ceiling		NAD	720	SF	0	SF				N/A	N/A	N/A	
1	1	Classroom 104	N/A	Plaster Walls		NAD	1300	SF	0	SF				N/A	N/A	N/A	
1	1	Classroom 104	M	Floor Tile VAT 12" x 12"	6300/01/01/KK	Assumed	720	SF	0	SF	Tan			1	No	1/D	
1	1	Classroom 104	N/A	Wood Floor		Non Suspect ACM	720	SF	0	SF				N/A	N/A	N/A	
1	1	Classroom 104	M	Blackboard Glue Dots	6300/01/01/AET/BB/2600	Assumed	45	SF	0	SF				1	No	1/D	
1	1	Classroom 104 Closet	T	Pipe Insulation 2-6 inch	6300/01/01/09	Confirmed	22	LF	0	LF				1	No	1/D	
1	1	Classroom 104 Closet	N/A	Plaster Ceiling		NAD	52	SF	0	SF				N/A	N/A	N/A	
1	1	Classroom 104 Closet	N/A	Plaster Walls		NAD	410	SF	0	SF				N/A	N/A	N/A	
1	1	Classroom 104 Closet	N/A	Wood Floor		Non Suspect ACM	52	SF	0	SF				N/A	N/A	N/A	
1	1	Classroom 104 Restroom	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	5	LF	0	LF				N/A	N/A	N/A	
1	1	Classroom 104 Restroom	N/A	Plaster Ceiling		NAD	36	SF	0	SF				N/A	N/A	N/A	
1	1	Classroom 104 Restroom	N/A	Plaster Walls		NAD	315	SF	0	SF				N/A	N/A	N/A	
1	1	Classroom 104 Restroom	N/A	Cement Floor		Non Suspect ACM	36	SF	0	SF				N/A	N/A	N/A	
1	1	Hallway to BET Office	N/A	Plaster Ceiling		NAD	377	SF	0	SF				N/A	N/A	N/A	
1	1	Hallway to BET Office	N/A	Plaster Walls		NAD	465	SF	0	SF				N/A	N/A	N/A	
1	1	Hallway to BET Office	N/A	Wood Floor		Non Suspect ACM	377	SF	0	SF				N/A	N/A	N/A	
1	1	BET Office	N/A	Plaster Ceiling		NAD	165	SF	0	SF				N/A	N/A	N/A	
1	1	BET Office	N/A	Plaster Walls		NAD	520	SF	0	SF				N/A	N/A	N/A	
1	1	BET Office	M	Floor Tile VAT 12" x 12"	6300/01/01/KK	Assumed	83	SF	0	SF	Blue			1	No	1/D	
1	1	BET Office	M	Floor Tile VAT 12" x 12"	6300/01/01/KK	Assumed	82	SF	0	SF	Grey			1	No	1/D	
1	1	BET Office	N/A	Wood Floor		Non Suspect ACM	165	SF	0	SF				N/A	N/A	N/A	
1	1	Closet across from Girl's Restroom	N/A	Plaster Ceiling		NAD	99	SF	0	SF				N/A	N/A	N/A	
1	1	Closet across from Girl's Restroom	N/A	Plaster Walls		NAD	480	SF	0	SF				N/A	N/A	N/A	
1	1	Closet across from Girl's Restroom	M	Floor Tile VAT 9" x 9"	6300/01/01/12	Confirmed	99	SF	0	SF	Tan			1	No	1/D	
1	1	Closet across from Girl's Restroom	N/A	Cement Floor		Non Suspect ACM	99	SF	0	SF				N/A	N/A	N/A	
1	1	Closet adjacent to Front Sign in Desk	N/A	Plaster Ceiling		NAD	18	SF	0	SF				N/A	N/A	N/A	
1	1	Closet adjacent to Front Sign in Desk	N/A	Plaster Walls		NAD	180	SF	0	SF				N/A	N/A	N/A	
1	1	Closet adjacent to Front Sign in Desk	M	Floor Tile VAT 9" x 9"	6300/01/01/12	Confirmed	18	SF	0	SF	Tan			1	No	1/D	
1	1	Closet adjacent to Front Sign in Desk	N/A	Cement Floor		Non Suspect ACM	18	SF	0	SF				N/A	N/A	N/A	
1	1	Auditorium	S	Plaster Ceiling	6300/01/01/PP	Assumed	3500	SF	40	SF				1	Yes	2/B	
1	1	Auditorium	S	Plaster Walls	6300/01/01/RR	Assumed	4560	SF	0	SF				1	No	1/D	
1	1	Auditorium	N/A	Wood Floor		Non Suspect ACM	3500	SF	0	SF				N/A	N/A	N/A	
1	1	Auditorium	T	Radiator Insulation	6300/01/01/CC	Assumed	235	SF	0	SF				1	No	1/D	
1	1	Auditorium Stage	S	Plaster Ceiling	6300/01/01/PP	Assumed	580	SF	0	SF				1	No	1/D	

6300 Logan ES 2015-2016 AHERA Three Year Report

Element		School District of Philadelphia James Logan Elementary School (K-5) 1700 Lindley Avenue, Philadelphia, PA 19141 ULCS# 6300 Year Built: 1924		<div style="border: 1px solid black; padding: 5px; text-align: center;"> AHERA Three-Year Reinspection 2015-2016 Room by Room Location Log Report </div>							Reinspection Date: 10/14-16/2015					
											Building Inspector: Bernard Brunner	Certificate Number: 45397	Management Planner: Monique Causley	Certificate Number: ACC-0215-8-010		
		On Site Room Name	System Affected	Material Description	HID#	Confirmed Assumed NAD Non Suspect ACM	Amount of Material	SF LF EA	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic/Crawl Space Ranking	Damage Potential (DP)	Newly Friable (NF)	Response Action (RA)
1	1	Auditorium Stage	S	Plaster Walls	6300/01/01/RR	Assumed	1920	SF	0	SF				1	No	1/D
1	1	Auditorium Stage	N/A	Wood Floor		Non Suspect ACM	580	SF	0	SF				N/A	N/A	N/A
1	1	Closet at rear of Auditorium	N/A	Plaster Ceiling		NAD	84	SF	0	SF				N/A	N/A	N/A
1	1	Closet at rear of Auditorium	N/A	Plaster Walls		NAD	480	SF	0	SF				N/A	N/A	N/A
1	1	Closet at rear of Auditorium	N/A	Wood Floor		Non Suspect ACM	84	SF	0	SF				N/A	N/A	N/A
1	1	Closet adjacent Teacher's Lounge	N/A	Plaster Ceiling		NAD	84	SF	0	SF				N/A	N/A	N/A
1	1	Closet adjacent Teacher's Lounge	N/A	Plaster Walls		NAD	480	SF	0	SF				N/A	N/A	N/A
1	1	Closet adjacent Teacher's Lounge	N/A	Wood Floor		Non Suspect ACM	84	SF	0	SF				N/A	N/A	N/A
1	1	Teacher's Lounge 105	T	Pipe Fitting Insulation	6300/01/01/11	Confirmed	4	EA	0	EA				1	No	1/D
1	1	Teacher's Lounge 105	T	Pipe Insulation 2-6 inch	6300/01/01/09	Confirmed	28	LF	0	LF				1	No	1/D
1	1	Teacher's Lounge 105	N/A	Plaster Ceiling		NAD	720	SF	0	SF				N/A	N/A	N/A
1	1	Teacher's Lounge 105	N/A	Plaster Walls		NAD	1300	SF	0	SF				N/A	N/A	N/A
1	1	Teacher's Lounge 105	N/A	Wood Floor		Non Suspect ACM	720	SF	0	SF				N/A	N/A	N/A
1	1	Teacher's Lounge 105	M	Blackboard Glue Dots	6300/01/01/AET/BB/2600	Assumed	50	SF	0	SF				1	No	1/D
1	1	Teacher's Lounge 105 Closet adjacent to Windows	T	Pipe Insulation 2-6 inch	6300/01/01/09	Confirmed	14	LF	0	LF				1	No	1/D
1	1	Teacher's Lounge 105 Closet adjacent to Windows	N/A	Plaster Ceiling		NAD	48	SF	48	SF				N/A	N/A	N/A
1	1	Teacher's Lounge 105 Closet adjacent to Windows	N/A	Plaster Walls		NAD	295	SF	295	SF				N/A	N/A	N/A
1	1	Teacher's Lounge 105 Closet adjacent to Windows	N/A	Wood Wall		Non Suspect ACM	25	SF	0	SF				N/A	N/A	N/A
1	1	Teacher's Lounge 105 Closet adjacent to Windows	N/A	Wood Floor		Non Suspect ACM	48	SF	0	SF				N/A	N/A	N/A
1	1	Teacher's Lounge 105 Closet adjacent to Auditorium	N/A	Plaster Ceiling		NAD	48	SF	48	SF				N/A	N/A	N/A
1	1	Teacher's Lounge 105 Closet adjacent to Auditorium	N/A	Plaster Walls		NAD	295	SF	295	SF				N/A	N/A	N/A
1	1	Teacher's Lounge 105 Closet adjacent to Auditorium	N/A	Wood Wall		Non Suspect ACM	25	SF	0	SF				N/A	N/A	N/A
1	1	Teacher's Lounge 105 Closet adjacent to Auditorium	N/A	Wood Floor		Non Suspect ACM	48	SF	0	SF				N/A	N/A	N/A
1	1	Boy's Restroom	T	Pipe Fitting Insulation	6300/01/01/11	Confirmed	20	EA	0	EA				1	No	1/D
1	1	Boy's Restroom	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	102	LF	4	LF				N/A	N/A	N/A
1	1	Boy's Restroom	N/A	Plaster Ceiling		NAD	192	SF	60	SF				N/A	N/A	N/A
1	1	Boy's Restroom	N/A	Plaster Walls		NAD	770	SF	60	SF				N/A	N/A	N/A
1	1	Boy's Restroom	N/A	Ceramic Tile Walls		Non Suspect ACM	385	SF	0	SF				N/A	N/A	N/A
1	1	Boy's Restroom	N/A	Cement Floor		Non Suspect ACM	192	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 106	T	Pipe Fitting Insulation	6300/01/01/11	Confirmed	5	EA	0	EA				1	No	1/D
1	1	Classroom 106	T	Pipe Insulation 2-6 inch	6300/01/01/09	Confirmed	21	LF	0	LF				1	No	1/D
1	1	Classroom 106	N/A	Plaster Ceiling		NAD	840	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 106	N/A	Plaster Walls		NAD	1130	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 106	N/A	Partition Room Dividers		Non Suspect ACM	290	SF	0	SF		Wood Partition		N/A	N/A	N/A
1	1	Classroom 106	N/A	Wood Floor		Non Suspect ACM	840	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 106	M	Blackboard Glue Dots	6300/01/01/AET/BB/2600	Assumed	90	SF	0	SF				1	No	1/D
1	1	Classroom 106 Closet	N/A	Plaster Ceiling		NAD	130	SF	10	SF				N/A	N/A	N/A
1	1	Classroom 106 Closet	N/A	Plaster Walls		NAD	600	SF	70	SF				N/A	N/A	N/A
1	1	Classroom 106 Closet	N/A	Wood Floor		Non Suspect ACM	130	SF	0	SF				N/A	N/A	N/A
1	1	Closet adjacent Classroom 106	N/A	Plaster Ceiling		NAD	50	SF	0	SF				N/A	N/A	N/A
1	1	Closet adjacent Classroom 106	N/A	Plaster Walls		NAD	315	SF	0	SF				N/A	N/A	N/A
1	1	Closet adjacent Classroom 106	N/A	Wood Floor		Non Suspect ACM	50	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 107	T	Pipe Fitting Insulation	6300/01/01/11	Confirmed	5	EA	1	EA				1	Yes	2/B
1	1	Classroom 107	T	Pipe Insulation 2-6 inch	6300/01/01/09	Confirmed	26	LF	0	LF				1	No	1/D
1	1	Classroom 107	N/A	Plaster Ceiling		NAD	720	SF	20	SF				N/A	N/A	N/A
1	1	Classroom 107	N/A	Plaster Walls		NAD	720	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 107	N/A	Partition Room Dividers		Non Suspect ACM	580	SF	0	SF		Wood Partition		N/A	N/A	N/A
1	1	Classroom 107	N/A	Wood Floor		Non Suspect ACM	720	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 107	M	Blackboard Glue Dots	6300/01/01/AET/BB/2600	Assumed	50	SF	0	SF				1	No	1/D
1	1	Classroom 108	T	Pipe Fitting Insulation	6300/01/01/11	Confirmed	6	EA	1	EA				1	Yes	2/B
1	1	Classroom 108	T	Pipe Insulation 2-6 inch	6300/01/01/09	Confirmed	26	LF	0	LF				1	No	1/D
1	1	Classroom 108	N/A	Plaster Ceiling		NAD	720	SF	5	SF				N/A	N/A	N/A
1	1	Classroom 108	N/A	Plaster Walls		NAD	1010	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 108	N/A	Partition Room Dividers		Non Suspect ACM	290	SF	0	SF		Wood Partition		N/A	N/A	N/A
1	1	Classroom 108	N/A	Wood Floor		Non Suspect ACM	720	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 108	M	Blackboard Glue Dots	6300/01/01/AET/BB/2600	Assumed	50	SF	0	SF				1	No	1/D
1	1	Classroom 108 Closet	T	Pipe Fitting Insulation	6300/01/01/11	Confirmed	5	EA	0	EA				1	No	1/D
1	1	Classroom 108 Closet	T	Pipe Insulation 2-6 inch	6300/01/01/09	Confirmed	26	LF	0	LF				1	No	1/D
1	1	Classroom 108 Closet	N/A	Plaster Ceiling		NAD	52	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 108 Closet	N/A	Plaster Walls		NAD	360	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 108 Closet	N/A	Partition Room Dividers		Non Suspect ACM	48	SF	0	SF		Wood Partition		N/A	N/A	N/A
1	1	Classroom 108 Closet	N/A	Wood Floor		Non Suspect ACM	52	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 108 Restroom	T	Pipe Fitting Insulation	6300/01/01/11	Confirmed	7	EA	0	EA				1	No	1/D
1	1	Classroom 108 Restroom	T	Pipe Insulation 2-6 inch	6300/01/01/09	Confirmed	14	LF	0	LF				1	No	1/D
1	1	Classroom 108 Restroom	N/A	Plaster Ceiling		NAD	50	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 108 Restroom	N/A	Plaster Walls		NAD	360	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 108 Restroom	N/A	Wood Wall		Non Suspect ACM	48	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 108 Restroom	M	Transite Stalls	6300/01/01/AET/BB/2310	Assumed	22	SF	0	SF				1	No	1/D
1	1	Classroom 108 Restroom	N/A	Cement Floor		Non Suspect ACM	50	SF	0	SF				N/A	N/A	N/A
1	1	Men's Restroom 109	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	8	LF	0	LF				N/A	N/A	N/A

6300 Logan ES 2015-2016 AHERA Three Year Report

Element Identifier		School District of Philadelphia James Logan Elementary School (K-5) 1700 Lindley Avenue, Philadelphia, PA 19141 ULCS# 6300 Year Built: 1924		AHERA Three-Year Reinspection 2015-2016 Room by Room Location Log Report							Reinspection Date: 10/14-16/2015				
											Building Inspector: Bernard Brunner				Certificate Number: 45397
On Site Room Name		System Affected	Material Description	HID#	Confirmed Assumed NAD Non Suspect ACM	Amount of Material	SF LF EA	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic/Crawl Space Ranking	Damage Potential (DP)	Newly Friable (NF)	Response Action (RA)
1	1	Men's Restroom 109	N/A	Plaster Ceiling	NAD	120	SF	0	SF			N/A	N/A	N/A	
1	1	Men's Restroom 109	N/A	Plaster Walls	NAD	530	SF	50	SF			N/A	N/A	N/A	
1	1	Men's Restroom 109	N/A	Marble Wall	Non Suspect ACM	80	SF	0	SF			N/A	N/A	N/A	
1	1	Men's Restroom 109	N/A	Wood Floor	Non Suspect ACM	120	SF	0	SF			N/A	N/A	N/A	
1	1	Stairwell near Classroom 108	T	Pipe Fitting Insulation	6300/01/01/11	Confirmed	8	EA	0	EA		1	No	1/D	
1	1	Stairwell near Classroom 108	N/A	Fiberglass Pipe Insulation	Non Suspect ACM	31	LF	5	LF			N/A	N/A	N/A	
1	1	Stairwell near Classroom 108	N/A	Plaster Ceiling	NAD	24	SF	0	SF			N/A	N/A	N/A	
1	1	Stairwell near Classroom 108	N/A	Plaster Walls	NAD	100	SF	0	SF			N/A	N/A	N/A	
1	1	Stairwell near Classroom 108	N/A	Cement Floor	Non Suspect ACM	24	SF	0	SF			N/A	N/A	N/A	
1	1	Hallway to Fire Tower near Classroom 107	N/A	Concrete Ceiling	Non Suspect ACM	55	SF	20	SF		Hallway to firetower. Regularly used by students	N/A	N/A	N/A	
1	1	Hallway to Fire Tower near Classroom 107	N/A	Brick Wall	Non Suspect ACM	325	SF	100	SF			N/A	N/A	N/A	
1	1	Hallway to Fire Tower near Classroom 107	N/A	Cement Floor	Non Suspect ACM	55	SF	0	SF			N/A	N/A	N/A	
1	1	Fire Tower near Classroom 107	N/A	Concrete Ceiling	Non Suspect ACM	312	SF	150	SF		Firetower. Regularly used by students	N/A	N/A	N/A	
1	1	Fire Tower near Classroom 107	N/A	Brick Wall	Non Suspect ACM	915	SF	0	SF			N/A	N/A	N/A	
1	1	Fire Tower near Classroom 107	N/A	Cement Floor	Non Suspect ACM	312	SF	0	SF			N/A	N/A	N/A	
1	1	Hallway outside Classrooms 106 to 108	N/A	Fiberglass Pipe Insulation	Non Suspect ACM	49	LF	0	LF			N/A	N/A	N/A	
1	1	Hallway outside Classrooms 106 to 108	N/A	Plaster Ceiling	NAD	1176	SF	25	SF			N/A	N/A	N/A	
1	1	Hallway outside Classrooms 106 to 108	N/A	Plaster Walls	NAD	2500	SF	300	SF			N/A	N/A	N/A	
1	1	Hallway outside Classrooms 106 to 108	N/A	Cement Floor	Non Suspect ACM	1176	LF	0	SF			N/A	N/A	N/A	
1	1	Hallway from Classroom 104 to Teacher's Lounge	N/A	Fiberglass Pipe Insulation	Non Suspect ACM	48	LF	0	LF			N/A	N/A	N/A	
1	1	Hallway from Classroom 104 to Teacher's Lounge	N/A	Plaster Ceiling	NAD	900	SF	0	SF			N/A	N/A	N/A	
1	1	Hallway from Classroom 104 to Teacher's Lounge	N/A	Plaster Walls	NAD	2280	SF	0	SF			N/A	N/A	N/A	
1	1	Hallway from Classroom 104 to Teacher's Lounge	N/A	Cement Floor	Non Suspect ACM	900	SF	0	SF			N/A	N/A	N/A	
1	1	Stairwell adjacent to Classroom 106	N/A	Fiberglass Pipe Insulation	Non Suspect ACM	12	LF	0	LF			N/A	N/A	N/A	
1	1	Stairwell adjacent to Classroom 106	N/A	Plaster Ceiling	NAD	275	SF	5	SF			N/A	N/A	N/A	
1	1	Stairwell adjacent to Classroom 106	N/A	Plaster Walls	NAD	675	SF	5	SF			N/A	N/A	N/A	
1	1	Stairwell adjacent to Classroom 106	N/A	Cement Floor	Non Suspect ACM	275	SF	0	SF			N/A	N/A	N/A	
1	1	Stairwell adjacent Classroom 103	N/A	Fiberglass Pipe Insulation	Non Suspect ACM	15	LF	0	LF			N/A	N/A	N/A	
1	1	Stairwell adjacent Classroom 103	N/A	Plaster Ceiling	NAD	275	SF	10	SF			N/A	N/A	N/A	
1	1	Stairwell adjacent Classroom 103	N/A	Plaster Walls	NAD	675	SF	50	SF			N/A	N/A	N/A	
1	1	Stairwell adjacent Classroom 103	N/A	Cement Floor	Non Suspect ACM	275	SF	0	SF			N/A	N/A	N/A	
1	1	Hallway outside Classrooms 101 to 103	N/A	Fiberglass Pipe Insulation	Non Suspect ACM	48	LF	0	LF			N/A	N/A	N/A	
1	1	Hallway outside Classrooms 101 to 103	N/A	Plaster Ceiling	NAD	1176	SF	0	SF			N/A	N/A	N/A	
1	1	Hallway outside Classrooms 101 to 103	N/A	Plaster Walls	NAD	2500	SF	0	SF			N/A	N/A	N/A	
1	1	Hallway outside Classrooms 101 to 103	N/A	Cement Floor	Non Suspect ACM	1176	SF	0	SF			N/A	N/A	N/A	
1	1	Hallway to Fire Tower near Classroom 102	N/A	Concrete Ceiling	Non Suspect ACM	55	SF	20	SF		Hallway to firetower. Regularly used by students	N/A	N/A	N/A	
1	1	Hallway to Fire Tower near Classroom 102	N/A	Brick Wall	Non Suspect ACM	325	SF	100	SF			N/A	N/A	N/A	
1	1	Hallway to Fire Tower near Classroom 102	N/A	Cement Floor	Non Suspect ACM	55	SF	0	SF			N/A	N/A	N/A	
1	1	Fire Tower near Classroom 102	N/A	Concrete Ceiling	Non Suspect ACM	312	SF	150	SF		Firetower. Regularly used by students	N/A	N/A	N/A	
1	1	Fire Tower near Classroom 102	N/A	Brick Wall	Non Suspect ACM	915	SF	50	SF			N/A	N/A	N/A	
1	1	Fire Tower near Classroom 102	N/A	Cement Floor	Non Suspect ACM	312	SF	0	SF			N/A	N/A	N/A	
1	1	Stairwell adjacent to Classroom 101	N/A	Fiberglass Pipe Insulation	Non Suspect ACM	52	LF	0	LF			N/A	N/A	N/A	
1	1	Stairwell adjacent to Classroom 101	N/A	Plaster Ceiling	NAD	24	SF	0	SF			N/A	N/A	N/A	
1	1	Stairwell adjacent to Classroom 101	N/A	Plaster Walls	NAD	100	SF	0	SF			N/A	N/A	N/A	
1	1	Stairwell adjacent to Classroom 101	N/A	Cement Floor	Non Suspect ACM	24	SF	0	SF			N/A	N/A	N/A	
1	2	Speech Pathologist Office 201A	T	Pipe Fitting Insulation	6300/01/02/17	Confirmed	2	LF	0	LF		1	No	1/D	
1	2	Speech Pathologist Office 201A	T	Pipe Insulation 2-6 inch	6300/01/02/15	Confirmed	6	LF	1	LF		1	Yes	2/B	
1	2	Speech Pathologist Office 201A	N/A	Fiberglass Pipe Insulation	Non Suspect ACM	2	LF	0	LF			N/A	N/A	N/A	
1	2	Speech Pathologist Office 201A	N/A	Plaster Ceiling	NAD	190	SF	0	SF			N/A	N/A	N/A	
1	2	Speech Pathologist Office 201A	N/A	Plaster Walls	NAD	700	SF	0	SF			N/A	N/A	N/A	
1	2	Speech Pathologist Office 201A	M	Floor Tile VAT 12" x 12"	6300/01/02/MM	Assumed	95	SF	2	SF	Blue	1	No	6/C	
1	2	Speech Pathologist Office 201A	M	Floor Tile VAT 12" x 12"	6300/01/02/MM	Assumed	95	SF	0	SF	Grey	1	No	1/D	
1	2	Speech Pathologist Office 201A	N/A	Wood Floor	Non Suspect ACM	190	SF	0	SF			N/A	N/A	N/A	
1	2	Office between Library 201 Closet and Speech Pathologist Office 201A (access from Speech Pathologist Office only)	T	Pipe Insulation 2-6 inch	6300/01/02/15	Confirmed	12	LF	0	LF	More pipe insulation is likely above ceiling tile	1	No	1/D	
1	2	Office between Library 201 Closet and Speech Pathologist Office 201A (access from Speech Pathologist Office only)	N/A	Fiberglass Ceiling Tile 2' x 4'	Non Suspect ACM	132	SF	0	SF			N/A	N/A	N/A	
1	2	Office between Library 201 Closet and Speech Pathologist Office 201A (access from Speech Pathologist Office only)	N/A	Plaster Ceiling	NAD	132	SF	0	SF			N/A	N/A	N/A	
1	2	Office between Library 201 Closet and Speech Pathologist Office 201A (access from Speech Pathologist Office only)	N/A	Plaster Walls	NAD	555	SF	0	SF			N/A	N/A	N/A	
1	2	Office between Library 201 Closet and Speech Pathologist Office 201A (access from Speech Pathologist Office only)	M	Floor Tile VAT 12" x 12"	6300/01/02/MM	Assumed	132	SF	0	SF	Blue	1	No	1/D	
1	2	Office between Library 201 Closet and Speech Pathologist Office 201A (access from Speech Pathologist Office only)	M	Floor Tile VAT 12" x 12"	6300/01/02/MM	Assumed	66	SF	0	SF	Grey	1	No	1/D	
1	2	Office between Library 201 Closet and Speech Pathologist Office 201A (access from Speech Pathologist Office only)	N/A	Wood Floor	Non Suspect ACM	132	SF	0	SF			N/A	N/A	N/A	
1	2	Speech Pathologist Office 201A Restroom	T	Pipe Fitting Insulation	6300/01/02/17	Confirmed	11	EA	0	EA		1	No	1/D	
1	2	Speech Pathologist Office 201A Restroom	N/A	Fiberglass Pipe Insulation	Non Suspect ACM	40	SF	0	SF			N/A	N/A	N/A	
1	2	Speech Pathologist Office 201A Restroom	N/A	Plaster Ceiling	NAD	70	SF	0	SF		Water Damage	N/A	N/A	N/A	
1	2	Speech Pathologist Office 201A Restroom	N/A	Plaster Walls	NAD	410	SF	0	SF		Water Damage	N/A	N/A	N/A	
1	2	Speech Pathologist Office 201A Restroom	M	Floor Tile VAT 12" x 12"	6300/01/02/MM	Assumed	70	SF	1	SF	Tan	1	No	6/C	

6300 Logan ES 2015-2016 AHERA Three Year Report

		School District of Philadelphia James Logan Elementary School (K-5) 1700 Lindley Avenue, Philadelphia, PA 19141 ULCS# 6300 Year Built: 1924		AHERA Three-Year Reinspection 2015-2016 Room by Room Location Log Report							Reinspection Date: 10/14-16/2015 Building Inspector: Bernard Brunner Certificate Number: 45397 Management Planner: Monique Causley Certificate Number: ACC-0215-8-010					
E l e m e n t	F l o o r	On Site Room Name	System Affected	Material Description	HID#	Confirmed Assumed NAD Non Suspect ACM	Amount of Material	SF LF EA	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic/Crawl Space Ranking	Damage Potential (DP)	Newly Friable (NF)	Response Action (RA)
1	2	Speech Pathologist Office 201A Restroom	N/A	Wood Floor		Non Suspect ACM	70	SF	0	SF				N/A	N/A	N/A
1	2	Library 201 Closet	T	Pipe Insulation 2-6 inch	6300/01/02/15	Confirmed	12	LF	0	LF		More pipe insulation likely above ceiling tile		1	No	1/D
1	2	Library 201 Closet	N/A	Fiberglass Ceiling Tile 2' x 4'		Non Suspect ACM	156	SF	40	SF				N/A	N/A	N/A
1	2	Library 201 Closet	N/A	Plaster Ceiling		NAD	156	SF	0	SF				N/A	N/A	N/A
1	2	Library 201 Closet	N/A	Plaster Walls		NAD	600	SF	0	SF				N/A	N/A	N/A
1	2	Library 201 Closet	M	Floor Tile VAT 12" x 12"	6300/01/02/MM	Assumed	78	SF	0	SF	Blue			1	No	1/D
1	2	Library 201 Closet	M	Floor Tile VAT 12" x 12"	6300/01/02/MM	Assumed	78	SF	0	SF	Grey			1	No	1/D
1	2	Library 201 Closet	N/A	Wood Floor		Non Suspect ACM	156	SF	0	SF				N/A	N/A	N/A
1	2	Library 201	T	Pipe Insulation 2-6 inch	6300/01/02/15	Confirmed	24	LF	0	LF		More pipe insulation likely above ceiling tile		1	No	1/D
1	2	Library 201	N/A	Fiberglass Ceiling Tile 2' x 4'		Non Suspect ACM	530	SF	0	SF				N/A	N/A	N/A
1	2	Library 201	N/A	Plaster Ceiling		NAD	530	SF	0	SF				N/A	N/A	N/A
1	2	Library 201	N/A	Plaster Walls		NAD	820	SF	0	SF				N/A	N/A	N/A
1	2	Library 201	N/A	Partition Room Dividers		Non Suspect ACM	290	SF	0	SF		Wood Partition with 202 open		N/A	N/A	N/A
1	2	Library 201	M	Floor Tile VAT 12" x 12"	6300/01/02/MM	Assumed	265	SF	2	SF	Blue			1	No	6/C
1	2	Library 201	M	Floor Tile VAT 12" x 12"	6300/01/02/MM	Assumed	265	SF	0	SF	Grey			1	No	1/D
1	2	Library 201	N/A	Wood Floor		Non Suspect ACM	530	SF	0	SF				N/A	N/A	N/A
1	2	Library 202	T	Pipe Insulation 2-6 inch	6300/01/02/15	Confirmed	22	LF	1	LF		More likely above ceiling tile		1	Yes	2/B
1	2	Library 202	N/A	Fiberglass Ceiling Tile 2' x 4'		Non Suspect ACM	720	SF	0	SF				N/A	N/A	N/A
1	2	Library 202	N/A	Plaster Ceiling		NAD	720	SF	0	SF				N/A	N/A	N/A
1	2	Library 202	N/A	Plaster Walls		NAD	720	SF	0	SF				N/A	N/A	N/A
1	2	Library 202	N/A	Partition Room Dividers		Non Suspect ACM	580	SF	0	SF		Wood Partition with 201 open		N/A	N/A	N/A
1	2	Library 202	M	Floor Tile VAT 9" x 9"	6300/01/02/18	Confirmed	6	SF	0	SF	Green	Below open partition		1	No	1/D
1	2	Library 202	M	Floor Tile VAT 12" x 12"	6300/01/02/MM	Assumed	357	SF	12	SF	Blue			1	No	6/C
1	2	Library 202	M	Floor Tile VAT 12" x 12"	6300/01/02/MM	Assumed	357	SF	0	SF	Grey			1	No	1/D
1	2	Library 202	N/A	Wood Floor		Non Suspect ACM	50	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 203	T	Pipe Fitting Insulation	6300/01/02/17	Confirmed	2	EA	0	EA				1	No	1/D
1	2	Classroom 203	T	Pipe Insulation 2-6 inch	6300/01/02/15	Confirmed	11	LF	0	LF				1	No	1/D
1	2	Classroom 203	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	8	LF	0	LF				N/A	N/A	N/A
1	2	Classroom 203	N/A	Plaster Ceiling		NAD	840	SF	5	SF		Water Damage		N/A	N/A	N/A
1	2	Classroom 203	N/A	Plaster Walls		NAD	1130	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 203	N/A	Partition Room Dividers		Non Suspect ACM	290	SF	0	SF		Wood Partition		N/A	N/A	N/A
1	2	Classroom 203	N/A	Wood Floor		Non Suspect ACM	840	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 203	M	Blackboard Glue Dots	6300/01/02/AET/BB/2600	Assumed	75	SF	0	SF				1	No	1/D
1	2	Classroom 203 Closet	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	6	LF	0	LF				N/A	N/A	N/A
1	2	Classroom 203 Closet	N/A	Plaster Ceiling		NAD	120	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 203 Closet	N/A	Plaster Walls		NAD	580	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 203 Closet	N/A	Wood Floor		Non Suspect ACM	120	SF	0	SF				N/A	N/A	N/A
1	2	Custodial Closet near Classroom 203	T	Pipe Fitting Insulation	6300/01/02/17	Confirmed	3	EA	0	EA				1	No	1/D
1	2	Custodial Closet near Classroom 203	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	57	LF	6	LF				N/A	N/A	N/A
1	2	Custodial Closet near Classroom 203	N/A	Plaster Ceiling		NAD	45	SF	0	SF				N/A	N/A	N/A
1	2	Custodial Closet near Classroom 203	N/A	Plaster Walls		NAD	340	SF	0	SF				N/A	N/A	N/A
1	2	Custodial Closet near Classroom 203	N/A	Cement Floor		Non Suspect ACM	45	SF	0	SF				N/A	N/A	N/A
1	2	Teacher's Lounge 204	T	Pipe Fitting Insulation	6300/01/02/17	Confirmed	5	EA	0	EA				1	No	1/D
1	2	Teacher's Lounge 204	T	Pipe Insulation 2-6 inch	6300/01/02/15	Confirmed	6	LF	0	LF				1	No	1/D
1	2	Teacher's Lounge 204	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	70	LF	0	LF				N/A	N/A	N/A
1	2	Teacher's Lounge 204	N/A	Plaster Ceiling		NAD	308	SF	0	SF				N/A	N/A	N/A
1	2	Teacher's Lounge 204	N/A	Plaster Walls		NAD	865	SF	0	SF				N/A	N/A	N/A
1	2	Teacher's Lounge 204	N/A	Sheetrock Wall		Non Suspect ACM	265	SF	0	SF				N/A	N/A	N/A
1	2	Teacher's Lounge 204	N/A	Wood Floor		Non Suspect ACM	308	SF	0	SF				N/A	N/A	N/A
1	2	Teacher's Lounge 204 Restroom	T	Pipe Fitting Insulation	6300/01/02/17	Confirmed	3	LF	0	LF				1	No	1/D
1	2	Teacher's Lounge 204 Restroom	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	15	LF	0	LF				N/A	N/A	N/A
1	2	Teacher's Lounge 204 Restroom	N/A	Plaster Ceiling		NAD	50	SF	2	SF		Water Damage		N/A	N/A	N/A
1	2	Teacher's Lounge 204 Restroom	N/A	Plaster Walls		NAD	460	SF	10	SF		Water Damage		N/A	N/A	N/A
1	2	Teacher's Lounge 204 Restroom	N/A	Marble Wall		Non Suspect ACM	80	SF	0	SF				N/A	N/A	N/A
1	2	Teacher's Lounge 204 Restroom	M	Floor Tile VAT 12" x 12"	6300/01/02/MM	Assumed	50	SF	0	SF	Grey			1	No	1/D
1	2	Teacher's Lounge 204 Restroom	N/A	Wood Floor		Non Suspect ACM	50	SF	0	SF				N/A	N/A	N/A
1	2	Vestibule outside Teacher's Lounge and Restroom	N/A	Plaster Ceiling		NAD	20	SF	0	SF				N/A	N/A	N/A
1	2	Vestibule outside Teacher's Lounge and Restroom	N/A	Plaster Walls		NAD	100	SF	0	SF				N/A	N/A	N/A
1	2	Vestibule outside Teacher's Lounge and Restroom	M	Floor Tile VAT 12" x 12"	6300/01/02/MM	Assumed	20	SF	0	SF	Grey			1	No	1/D
1	2	Vestibule outside Teacher's Lounge and Restroom	N/A	Wood Floor		Non Suspect ACM	20	SF	0	SF				N/A	N/A	N/A
1	2	Teacher's Lounge 204 Telecommunication Equipment Room	X	X		X	X	X	X	X	X	No Access		X	X	X
1	2	Nurse's Office	T	Pipe Fitting Insulation	6300/01/02/17	Confirmed	2	EA	1	EA				1	Yes	2/B
1	2	Nurse's Office	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	47	LF	0	LF				N/A	N/A	N/A
1	2	Nurse's Office	N/A	Plaster Ceiling		NAD	210	SF	0	SF				N/A	N/A	N/A
1	2	Nurse's Office	N/A	Plaster Walls		NAD	770	SF	0	SF				N/A	N/A	N/A
1	2	Nurse's Office	N/A	Wood Floor		Non Suspect ACM	210	SF	0	SF				N/A	N/A	N/A
1	2	Nurse's Office Restroom	T	Pipe Fitting Insulation	6300/01/02/17	Confirmed	2	EA	0	EA				1	No	1/D
1	2	Nurse's Office Restroom	N/A	Fiberglass Pipe Fitting Insulation		Non Suspect ACM	19	LF	0	LF				N/A	N/A	N/A
1	2	Nurse's Office Restroom	N/A	Plaster Ceiling		NAD	15	SF	0	SF				N/A	N/A	N/A
1	2	Nurse's Office Restroom	N/A	Plaster Walls		NAD	195	SF	0	SF				N/A	N/A	N/A

6300 Logan ES 2015-2016 AHERA Three Year Report

Element		School District of Philadelphia James Logan Elementary School (K-5) 1700 Lindley Avenue, Philadelphia, PA 19141 ULCS# 6300 Year Built: 1924		AHERA Three-Year Reinspection 2015-2016 Room by Room Location Log Report										Reinspection Date: 10/14-16/2015		Building Inspector: Bernard Brunner		Certificate Number: 45397		Management Planner: Monique Causley		Certificate Number: ACC-0215-8-010	
				On Site Room Name	System Affected	Material Description	HID#	Confirmed Assumed NAD Non Suspect ACM	Amount of Material	SF LF EA	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic/Crawl Space Ranking	Damage Potential (DP)	Newly Friable (NF)	Response Action (RA)					
1	2	Classroom 209	N/A	Plaster Ceiling		NAD	720	SF	2	SF					N/A	N/A	N/A						
1	2	Classroom 209	N/A	Plaster Walls		NAD	1010	SF	0	SF					N/A	N/A	N/A						
1	2	Classroom 209	N/A	Partition Room Dividers		Non Suspect ACM	290	SF	0	SF		Wood Partition			N/A	N/A	N/A						
1	2	Classroom 209	N/A	Wood Floor		Non Suspect ACM	720	SF	0	SF					N/A	N/A	N/A						
1	2	Classroom 209	M	Blackboard Glue Dots	6300/01/02/AET/BB/2600	Assumed	50	SF	0	SF					1	No	1/D						
1	2	Classroom 209 Closet	T	Pipe Fitting Insulation	6300/01/02/17	Confirmed	7	EA	0	EA					1	No	1/D						
1	2	Classroom 209 Closet	T	Pipe Insulation 2-6 inch	6300/01/02/15	Confirmed	42	LF	0	LF					1	No	1/D						
1	2	Classroom 209 Closet	N/A	Plaster Ceiling		NAD	96	SF	0	SF					N/A	N/A	N/A						
1	2	Classroom 209 Closet	N/A	Plaster Walls		NAD	585	SF	0	SF					N/A	N/A	N/A						
1	2	Classroom 209 Closet	N/A	Wood Floor		Non Suspect ACM	96	SF	0	SF					N/A	N/A	N/A						
1	2	Office 209A	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	20	LF	0	LF					N/A	N/A	N/A						
1	2	Office 209A	N/A	Plaster Ceiling		NAD	270	SF	25	SF					N/A	N/A	N/A						
1	2	Office 209A	N/A	Plaster Walls		NAD	890	SF	25	SF					N/A	N/A	N/A						
1	2	Office 209A	M	Floor Tile VAT 12" x 12"	6300/01/02/MM	Assumed	270	SF	0	SF	Grey				1	No	1/D						
1	2	Office 209A	N/A	Wood Floor		Non Suspect ACM	270	SF	0	SF					N/A	N/A	N/A						
1	2	Hallway to Fire Tower near Classroom 208	N/A	Concrete Ceiling		Non Suspect ACM	55	SF	0	SF		Hallway to firetower. Regularly used by students			N/A	N/A	N/A						
1	2	Hallway to Fire Tower near Classroom 208	N/A	Brick Wall		Non Suspect ACM	325	SF	75	SF					N/A	N/A	N/A						
1	2	Hallway to Fire Tower near Classroom 208	N/A	Cement Floor		Non Suspect ACM	55	SF	0	SF					N/A	N/A	N/A						
1	2	Fire Tower near Classroom 208	N/A	Concrete Ceiling		Non Suspect ACM	312	SF	100	SF		Firetower. Regularly used by students			N/A	N/A	N/A						
1	2	Fire Tower near Classroom 208	N/A	Brick Wall		Non Suspect ACM	915	SF	0	SF					N/A	N/A	N/A						
1	2	Fire Tower near Classroom 208	N/A	Cement Floor		Non Suspect ACM	312	SF	0	SF					N/A	N/A	N/A						
1	2	Hallway outside Classrooms 207 to 209	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	32	LF	0	LF					N/A	N/A	N/A						
1	2	Hallway outside Classrooms 207 to 209	N/A	Plaster Ceiling		NAD	1176	SF	20	SF		Water Damage			N/A	N/A	N/A						
1	2	Hallway outside Classrooms 207 to 209	N/A	Plaster Walls		NAD	2500	SF	400	SF					N/A	N/A	N/A						
1	2	Hallway outside Classrooms 207 to 209	N/A	Cement Floor		Non Suspect ACM	1176	SF	0	SF					N/A	N/A	N/A						
1	2	Stairwell near Classroom 207	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	16	LF	0	LF					N/A	N/A	N/A						
1	2	Stairwell near Classroom 207	N/A	Plaster Ceiling		NAD	275	SF	0	SF					N/A	N/A	N/A						
1	2	Stairwell near Classroom 207	N/A	Plaster Walls		NAD	675	SF	0	SF					N/A	N/A	N/A						
1	2	Stairwell near Classroom 207	N/A	Cement Floor		Non Suspect ACM	275	SF	0	SF					N/A	N/A	N/A						
1	2	2nd Floor Hallway outside Auditorium	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	48	LF	0	LF					N/A	N/A	N/A						
1	2	2nd Floor Hallway outside Auditorium	N/A	Plaster Ceiling		NAD	900	SF	0	SF					N/A	N/A	N/A						
1	2	2nd Floor Hallway outside Auditorium	N/A	Plaster Walls		NAD	2280	SF	25	SF					N/A	N/A	N/A						
1	2	2nd Floor Hallway outside Auditorium	N/A	Cement Floor		Non Suspect ACM	900	SF	0	SF					N/A	N/A	N/A						
1	2	Stairwell near Classroom 203	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	16	LF	0	LF					N/A	N/A	N/A						
1	2	Stairwell near Classroom 203	N/A	Plaster Ceiling		NAD	275	SF	0	SF					N/A	N/A	N/A						
1	2	Stairwell near Classroom 203	N/A	Plaster Walls		NAD	675	SF	5	SF					N/A	N/A	N/A						
1	2	Stairwell near Classroom 203	N/A	Cement Floor		Non Suspect ACM	275	SF	0	SF					N/A	N/A	N/A						
1	2	Hallway outside Classrooms 201 to 203	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	38	LF	0	LF					N/A	N/A	N/A						
1	2	Hallway outside Classrooms 201 to 203	N/A	Plaster Ceiling		NAD	1176	SF	10	SF		Water Damage			N/A	N/A	N/A						
1	2	Hallway outside Classrooms 201 to 203	N/A	Plaster Walls		NAD	2500	SF	0	SF					N/A	N/A	N/A						
1	2	Hallway outside Classrooms 201 to 203	N/A	Cement Floor		Non Suspect ACM	1176	SF	0	SF					N/A	N/A	N/A						
1	2	Hallway to Fire Tower near Classroom 202	N/A	Concrete Ceiling		Non Suspect ACM	55	SF	25	SF		Hallway to firetower. Regularly used by students			N/A	N/A	N/A						
1	2	Hallway to Fire Tower near Classroom 202	N/A	Brick Wall		Non Suspect ACM	325	SF	100	SF					N/A	N/A	N/A						
1	2	Hallway to Fire Tower near Classroom 202	N/A	Cement Floor		Non Suspect ACM	55	SF	0	SF					N/A	N/A	N/A						
1	2	Fire Tower near Classroom 203	N/A	Concrete Ceiling		Non Suspect ACM	312	SF	100	SF		Firetower. Regularly used by students			N/A	N/A	N/A						
1	2	Fire Tower near Classroom 203	N/A	Brick Wall		Non Suspect ACM	915	SF	0	SF					N/A	N/A	N/A						
1	2	Fire Tower near Classroom 203	N/A	Cement Floor		Non Suspect ACM	3120	SF	0	SF					N/A	N/A	N/A						
1	3	Classroom 301	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	8	LF	0	LF					N/A	N/A	N/A						
1	3	Classroom 301	N/A	Plaster Ceiling		NAD	720	SF	1	SF		Water Damage			N/A	N/A	N/A						
1	3	Classroom 301	N/A	Plaster Walls		NAD	1010	SF	0	SF					N/A	N/A	N/A						
1	3	Classroom 301	N/A	Partition Room Dividers		Non Suspect ACM	290	SF	0	SF		Wood Partition			N/A	N/A	N/A						
1	3	Classroom 301	N/A	Wood Floor		Non Suspect ACM	720	SF	0	SF					N/A	N/A	N/A						
1	3	Classroom 301	M	Blackboard Glue Dots	6300/01/03/AET/BB/2600	Assumed	100	SF	0	SF					1	No	1/D						
1	3	Classroom 301 Closet	T	Pipe Insulation 2-6 inch	6300/01/03/22	Confirmed	20	LF	1	LF					1	Yes	2/B						
1	3	Classroom 301 Closet	N/A	Plaster Ceiling		NAD	96	SF	0	SF					N/A	N/A	N/A						
1	3	Classroom 301 Closet	N/A	Plaster Walls		NAD	585	SF	1	SF		Water Damage			N/A	N/A	N/A						
1	3	Classroom 301 Closet	N/A	Wood Floor		Non Suspect ACM	96	SF	0	SF					N/A	N/A	N/A						
1	3	Classroom 302	T	Pipe Insulation 2-6 inch	6300/01/03/22	Confirmed	12	LF	0	LF					1	No	1/D						
1	3	Classroom 302	N/A	Plaster Ceiling		NAD	720	SF	30	SF					N/A	N/A	N/A						
1	3	Classroom 302	N/A	Plaster Walls		NAD	720	SF	7	SF					N/A	N/A	N/A						
1	3	Classroom 302	N/A	Partition Room Dividers		Non Suspect ACM	720	SF	0	SF		Wood Partition			N/A	N/A	N/A						
1	3	Classroom 302	N/A	Wood Floor		Non Suspect ACM	720	SF	0	SF					N/A	N/A	N/A						
1	3	Classroom 302	M	Blackboard Glue Dots	6300/01/03/AET/BB/2600	Assumed	50	SF	0	SF					1	No	1/D						
1	3	Classroom 303	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	8	LF	0	LF					N/A	N/A	N/A						
1	3	Classroom 303	N/A	Plaster Ceiling		NAD	888	SF	2	SF					N/A	N/A	N/A						
1	3	Classroom 303	N/A	Plaster Walls		NAD	1180	SF	2	SF					N/A	N/A	N/A						
1	3	Classroom 303	N/A	Partition Room Dividers		Non Suspect ACM	290	SF	0	SF		Wood Partition			N/A	N/A	N/A						
1	3	Classroom 303	N/A	Wood Floor		Non Suspect ACM	888	SF	0	SF					N/A	N/A	N/A						
1	3	Classroom 303	M	Blackboard Glue Dots	6300/01/03/AET/BB/2600	Assumed	65	SF	0	SF					1	No	1/D						
1	3	Classroom 303 Closet	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	8	LF	0	LF					N/A	N/A	N/A						

6300 Logan ES 2015-2016 AHERA Three Year Report

Element Floor		School District of Philadelphia James Logan Elementary School (K-5) 1700 Lindley Avenue, Philadelphia, PA 19141 ULCS# 6300 Year Built: 1924		AHERA Three-Year Reinspection 2015-2016 Room by Room Location Log Report							Reinspection Date: 10/14-16/2015					
								Building Inspector: Bernard Brunner Certificate Number: 45397 Management Planner: Monique Causley Certificate Number: ACC-0215-8-010								
		On Site Room Name	System Affected	Material Description	HID#	Confirmed Assumed NAD Non Suspect ACM	Amount of Material	SF LF EA	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic/Crawl Space Ranking	Damage Potential (DP)	Newly Friable (NF)	Response Action (RA)
1	3	Classroom 303 Closet	N/A	Plaster Ceiling		NAD	135	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 303 Closet	N/A	Plaster Walls		NAD	625	SF	50	SF				N/A	N/A	N/A
1	3	Classroom 303 Closet	N/A	Wood Floor		Non Suspect ACM	135	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 304	T	Pipe Insulation 2-6 inch	6300/01/03/22	Confirmed	10	LF	0	LF				1	No	1/D
1	3	Classroom 304	N/A	Plaster Ceiling		NAD	816	SF	10	SF		Water Damage		N/A	N/A	N/A
1	3	Classroom 304	N/A	Plaster Walls		NAD	1395	SF	0	SF		Water Damage		N/A	N/A	N/A
1	3	Classroom 304	N/A	Wood Floor		Non Suspect ACM	816	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 304	M	Blackboard Glue Dots	6300/01/03/AET/BB/2600	Assumed	100	SF	0	SF				1	No	1/D
1	3	Classroom 304 Closet	T	Pipe Insulation 2-6 inch	6300/01/03/22	Confirmed	21	LF	0	LF				1	No	1/D
1	3	Classroom 304 Closet	N/A	Plaster Ceiling		NAD	96	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 304 Closet	N/A	Plaster Walls		NAD	585	SF	60	SF		Water Damage		N/A	N/A	N/A
1	3	Classroom 304 Closet	N/A	Wood Floor		Non Suspect ACM	96	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 305	T	Pipe Insulation 2-6 inch	6300/01/03/22	Confirmed	49	LF	1	LF				1	Yes	2/B
1	3	Classroom 305	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	6	LF	4	LF				N/A	N/A	N/A
1	3	Classroom 305	N/A	Plaster Ceiling		NAD	900	SF	5	SF		Water Damage		N/A	N/A	N/A
1	3	Classroom 305	N/A	Plaster Walls		NAD	1440	SF	20	SF		Water Damage		N/A	N/A	N/A
1	3	Classroom 305	N/A	Wood Floor		Non Suspect ACM	900	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 305	M	Blackboard Glue Dots	6300/01/03/AET/BB/2600	Assumed	100	SF	0	SF				1	No	1/D
1	3	Classroom 305 Closet	N/A	Plaster Ceiling		NAD	85	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 305 Closet	N/A	Plaster Walls		NAD	600	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 305 Closet	N/A	Wood Floor		Non Suspect ACM	85	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 306	T	Pipe Fitting Insulation	6300/01/03/24	Confirmed	5	EA	0	EA				1	No	1/D
1	3	Classroom 306	T	Pipe Insulation 2-6 inch	6300/01/03/22	Confirmed	63	LF	0	LF				1	No	1/D
1	3	Classroom 306	N/A	Plaster Ceiling		NAD	984	SF	5	SF				N/A	N/A	N/A
1	3	Classroom 306	N/A	Plaster Walls		NAD	1560	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 306	N/A	Wood Floor		Non Suspect ACM	984	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 306	M	Blackboard Glue Dots	6300/01/03/AET/BB/2600	Assumed	100	SF	0	SF				1	No	1/D
1	3	Classroom 306 Closet	N/A	Plaster Ceiling		NAD	145	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 306 Closet	N/A	Plaster Walls		NAD	720	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 306 Closet	N/A	Wood Floor		Non Suspect ACM	145	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 307	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	8	LF	0	LF				N/A	N/A	N/A
1	3	Classroom 307	N/A	Plaster Ceiling		NAD	1020	LF	10	LF		Water Damage		N/A	N/A	N/A
1	3	Classroom 307	N/A	Plaster Walls		NAD	1540	SF	25	SF		Water Damage		N/A	N/A	N/A
1	3	Classroom 307	N/A	Wood Floor		Non Suspect ACM	1020	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 307	M	Blackboard Glue Dots	6300/01/03/AET/BB/2600	Assumed	170	SF	0	SF				1	No	1/D
1	3	Classroom 307 Closet	N/A	Plaster Ceiling		NAD	96	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 307 Closet	N/A	Plaster Walls		NAD	585	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 307 Closet	N/A	Wood Floor		Non Suspect ACM	96	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 308	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	6	LF	0	LF				N/A	N/A	N/A
1	3	Classroom 308	N/A	Plaster Ceiling		NAD	888	SF	10	SF		Water Damage		N/A	N/A	N/A
1	3	Classroom 308	N/A	Plaster Walls		NAD	1470	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 308	N/A	Wood Floor		Non Suspect ACM	888	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 308	M	Blackboard Glue Dots	6300/01/03/AET/BB/2600	Assumed	100	SF	0	SF				1	No	1/D
1	3	Classroom 308 Closet	N/A	Plaster Ceiling		NAD	120	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 308 Closet	N/A	Plaster Walls		NAD	700	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 308 Closet	N/A	Wood Floor		Non Suspect ACM	120	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 309	T	Pipe Insulation 2-6 inch	6300/01/03/22	Confirmed	10	LF	0	LF				1	No	1/D
1	3	Classroom 309	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	8	LF	0	LF				N/A	N/A	N/A
1	3	Classroom 309	N/A	Plaster Ceiling		NAD	900	SF	10	SF		Water Damage		N/A	N/A	N/A
1	3	Classroom 309	N/A	Plaster Walls		NAD	1440	SF	10	SF				N/A	N/A	N/A
1	3	Classroom 309	N/A	Wood Floor		Non Suspect ACM	900	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 309	M	Blackboard Glue Dots	6300/01/03/AET/BB/2600	Assumed	110	SF	0	SF				1	No	1/D
1	3	Classroom 309 Closet	N/A	Plaster Ceiling		NAD	96	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 309 Closet	N/A	Plaster Walls		NAD	585	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 309 Closet	N/A	Wood Floor		Non Suspect ACM	96	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 310	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	6	LF	3	LF				N/A	N/A	N/A
1	3	Classroom 310	N/A	Plaster Ceiling		NAD	816	SF	5	SF		Water Damage		N/A	N/A	N/A
1	3	Classroom 310	N/A	Plaster Walls		NAD	1395	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 310	N/A	Wood Floor		Non Suspect ACM	816	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 310	M	Blackboard Glue Dots	6300/01/03/AET/BB/2600	Assumed	150	SF	0	SF				1	No	1/D
1	3	Classroom 310 Closet	T	Pipe Insulation 2-6 inch	6300/01/03/22	Confirmed	20	LF	0	LF				1	No	1/D
1	3	Classroom 310 Closet	N/A	Plaster Ceiling		NAD	96	SF	0	SF				N/A	N/A	N/A
1	3	Classroom 310 Closet	N/A	Plaster Walls		NAD	585	SF	50	SF		Water Damage		N/A	N/A	N/A
1	3	Classroom 310 Closet	N/A	Wood Floor		Non Suspect ACM	96	SF	0	SF				N/A	N/A	N/A
1	3	Custodial Closet and Stairs to Attic	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	12	LF	0	LF				N/A	N/A	N/A
1	3	Custodial Closet and Stairs to Attic	N/A	Concrete Ceiling		Non Suspect ACM	50	SF	0	SF				N/A	N/A	N/A
1	3	Custodial Closet and Stairs to Attic	N/A	Plaster Walls		NAD	450	SF	0	SF				N/A	N/A	N/A
1	3	Custodial Closet and Stairs to Attic	N/A	Cement Floor		Non Suspect ACM	50	SF	0	SF				N/A	N/A	N/A
1	3	Girls Restroom	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	4	LF	1	LF				N/A	N/A	N/A
1	3	Girls Restroom	N/A	Plaster Ceiling		NAD	161	SF	35	SF				N/A	N/A	N/A

6300 Logan ES 2015-2016 AHERA Three Year Report

Element		School District of Philadelphia James Logan Elementary School (K-5) 1700 Lindley Avenue, Philadelphia, PA 19141 ULCS# 6300 Year Built: 1924		AHERA Three-Year Reinspection 2015-2016 Room by Room Location Log Report							Reinspection Date: 10/14-16/2015														
											Building Inspector: Bernard Brunner				Certificate Number: 45397										
Floor		On Site Room Name		System Affected		Material Description		HID#		Confirmed Assumed NAD Non Suspect ACM		Amount of Material SF LF EA		Amount of Damage SF LF EA		Color required for VAT		Management Planner: Monique Causley							
																		Certificate Number: ACC-0215-8-010							
																		Attic/Crawl Space Ranking		Damage Potential (DP)		Newly Friable (NF)		Response Action (RA)	
1	3		Girls Restroom	N/A		Plaster Walls				NAD	720	SF	20	SF							N/A	N/A	N/A	N/A	
1	3		Girls Restroom	N/A		Ceramic Tile Walls				Non Suspect ACM	360	SF	0	SF							N/A	N/A	N/A	N/A	
1	3		Girls Restroom	N/A		Cement Floor				Non Suspect ACM	161	SF	0	SF							N/A	N/A	N/A	N/A	
1	3		Girls Restroom	M		Vibration Damper Cloth	6300/01/03/27			Assumed	4	SF	0	SF							1	No	1/D		
1	3		Teacher Lounge adjacent to Classroom 301	T		Pipe Insulation 2-6 inch	6300/01/03/22			Confirmed	6	LF	0	LF							1	No	1/D		
1	3		Teacher Lounge adjacent to Classroom 301	N/A		Plaster Ceiling				NAD	135	SF	0	SF							Water Damage	N/A	N/A	N/A	N/A
1	3		Teacher Lounge adjacent to Classroom 301	N/A		Plaster Walls				NAD	445	SF	0	SF							Water Damage	N/A	N/A	N/A	N/A
1	3		Teacher Lounge adjacent to Classroom 301	N/A		Partition Room Dividers				Non Suspect ACM	70	SF	0	SF							Wood Partition	N/A	N/A	N/A	N/A
1	3		Teacher Lounge adjacent to Classroom 301	N/A		Wood Floor				Non Suspect ACM	135	SF	0	SF								N/A	N/A	N/A	N/A
1	3		Teacher Lounge adjacent to Classroom 301 Restroom	N/A		Plaster Ceiling				NAD	135	SF	0	SF								N/A	N/A	N/A	N/A
1	3		Teacher Lounge adjacent to Classroom 301 Restroom	N/A		Plaster Walls				NAD	445	SF	0	SF								N/A	N/A	N/A	N/A
1	3		Teacher Lounge adjacent to Classroom 301 Restroom	N/A		Wood Wall				Non Suspect ACM	70	SF	0	SF								N/A	N/A	N/A	N/A
1	3		Teacher Lounge adjacent to Classroom 301 Restroom	N/A		Wood Floor				Non Suspect ACM	135	SF	0	SF								N/A	N/A	N/A	N/A
1	3		Boys Restroom	T		Pipe Fitting Insulation	6300/01/03/24			Confirmed	4	EA	0	EA							1	No	1/D		
1	3		Boys Restroom	N/A		Fiberglass Pipe Insulation				Non Suspect ACM	29	LF	2	LF								N/A	N/A	N/A	N/A
1	3		Boys Restroom	N/A		Plaster Ceiling				NAD	192	SF	5	SF							Water Damage	N/A	N/A	N/A	N/A
1	3		Boys Restroom	N/A		Plaster Walls				NAD	770	SF	10	SF							Water Damage	N/A	N/A	N/A	N/A
1	3		Boys Restroom	N/A		Ceramic Tile Walls				Non Suspect ACM	335	SF	0	SF								N/A	N/A	N/A	N/A
1	3		Boys Restroom	N/A		Cement Floor				Non Suspect ACM	192	SF	0	SF								N/A	N/A	N/A	N/A
1	3		Boys Restroom	M		Vibration Damper Cloth	6300/01/03/27			Assumed	4	SF	0	SF							1	No	1/D		
1	3		Classroom 311	N/A		Fiberglass Pipe Insulation				Non Suspect ACM	4	LF	0	LF								N/A	N/A	N/A	N/A
1	3		Classroom 311	N/A		Plaster Ceiling				NAD	720	SF	1	SF							Water Damage	N/A	N/A	N/A	N/A
1	3		Classroom 311	N/A		Plaster Walls				NAD	1010	SF	2	SF								N/A	N/A	N/A	N/A
1	3		Classroom 311	N/A		Partition Room Dividers				Non Suspect ACM	290	SF	0	SF							Wood partition	N/A	N/A	N/A	N/A
1	3		Classroom 311	N/A		Wood Floor				Non Suspect ACM	720	SF	0	SF								N/A	N/A	N/A	N/A
1	3		Classroom 311	M		Blackboard Glue Dots	6300/01/03/AET/BB/2600			Assumed	90	SF	0	SF							1	No	1/D		
1	3		Classroom 311 Closet	N/A		Plaster Ceiling				NAD	130	SF	0	SF								N/A	N/A	N/A	N/A
1	3		Classroom 311 Closet	N/A		Plaster Walls				NAD	600	SF	1	SF							Water Damage	N/A	N/A	N/A	N/A
1	3		Classroom 311 Closet	N/A		Wood Floor				Non Suspect ACM	130	SF	0	SF								N/A	N/A	N/A	N/A
1	3		Closet adjacent to Classroom 311	X		X				X	X	X	X	X							No Access	X	X	X	X
1	3		Classroom 312	T		Pipe Insulation 2-6 inch	6300/01/03/22			Confirmed	6	LF	0	LF							1	No	1/D		
1	3		Classroom 312	N/A		Plaster Ceiling				NAD	720	SF	2	SF							Water Damage	N/A	N/A	N/A	N/A
1	3		Classroom 312	N/A		Plaster Walls				NAD	1010	SF	0	SF								N/A	N/A	N/A	N/A
1	3		Classroom 312	N/A		Partition Room Dividers				Non Suspect ACM	290	SF	0	SF							Wood Partition	N/A	N/A	N/A	N/A
1	3		Classroom 312	N/A		Wood Floor				Non Suspect ACM	720	SF	0	SF								N/A	N/A	N/A	N/A
1	3		Classroom 312	M		Blackboard Glue Dots	6300/01/03/AET/BB/2600			Assumed	50	SF	0	SF							1	No	1/D		
1	3		Classroom 313	N/A		Fiberglass Pipe Insulation				Non Suspect ACM	8	LF	0	LF								N/A	N/A	N/A	N/A
1	3		Classroom 313	N/A		Plaster Ceiling				NAD	720	SF	1	SF							Water Damage	N/A	N/A	N/A	N/A
1	3		Classroom 313	N/A		Plaster Walls				NAD	1010	SF	2	SF							Water Damage	N/A	N/A	N/A	N/A
1	3		Classroom 313	N/A		Partition Room Dividers				Non Suspect ACM	290	SF	0	SF							Wood Partition	N/A	N/A	N/A	N/A
1	3		Classroom 313	N/A		Wood Floor				Non Suspect ACM	720	SF	0	SF								N/A	N/A	N/A	N/A
1	3		Classroom 313	M		Blackboard Glue Dots	6300/01/03/AET/BB/2600			Assumed	50	SF	0	SF							1	No	1/D		
1	3		Classroom 313 Closet	T		Pipe Insulation 2-6 inch	6300/01/03/22			Confirmed	19	LF	0	LF							1	No	1/D		
1	3		Classroom 313 Closet	N/A		Plaster Ceiling				NAD	96	SF	0	SF								N/A	N/A	N/A	N/A
1	3		Classroom 313 Closet	N/A		Plaster Walls				NAD	585	SF	0	SF								N/A	N/A	N/A	N/A
1	3		Classroom 313 Closet	N/A		Wood Floor				Non Suspect ACM	96	SF	0	SF								N/A	N/A	N/A	N/A
1	3		Office 313A	N/A		Fiberglass Pipe Insulation				Non Suspect ACM	16	LF	0	LF								N/A	N/A	N/A	N/A
1	3		Office 313A	N/A		Plaster Ceiling				NAD	270	SF	0	SF								N/A	N/A	N/A	N/A
1	3		Office 313A	N/A		Plaster Walls				NAD	890	SF	25	SF							Water Damage	N/A	N/A	N/A	N/A
1	3		Office 313A	N/A		Cement Floor				Non Suspect ACM	270	SF	0	SF								N/A	N/A	N/A	N/A
1	3		Hallway to Fire Tower near Classroom 312	N/A		Concrete Ceiling				Non Suspect ACM	55	SF	55	SF							Hallway to firetower. Regularly used by students	N/A	N/A	N/A	N/A
1	3		Hallway to Fire Tower near Classroom 312	N/A		Brick Wall				Non Suspect ACM	135	SF	50	SF								N/A	N/A	N/A	N/A
1	3		Hallway to Fire Tower near Classroom 312	N/A		Cement Floor				Non Suspect ACM	55	SF	0	SF								N/A	N/A	N/A	N/A
1	3		Fire Tower near Classroom 312	N/A		Concrete Ceiling				Non Suspect ACM	312	SF	50	SF							Firetower. Regularly used by students	N/A	N/A	N/A	N/A
1	3		Fire Tower near Classroom 312	N/A		Brick Wall				Non Suspect ACM	915	SF	0	SF								N/A	N/A	N/A	N/A
1	3		Fire Tower near Classroom 312	N/A		Cement Floor				Non Suspect ACM	312	SF	0	SF								N/A	N/A	N/A	N/A
1	3		Hallway outside Classrooms 311 to 313	N/A		Fiberglass Pipe Insulation				Non Suspect ACM	16	LF	0	LF								N/A	N/A	N/A	N/A
1	3		Hallway outside Classrooms 311 to 313	N/A		Plaster Ceiling				NAD	1176	SF	2	SF								N/A	N/A	N/A	N/A
1	3		Hallway outside Classrooms 311 to 313	N/A		Plaster Walls				NAD	2500	SF	2	SF								N/A	N/A	N/A	N/A
1	3		Hallway outside Classrooms 311 to 313	N/A		Cement Floor				Non Suspect ACM	1176	SF	0	SF								N/A	N/A	N/A	N/A
1	3		Stairwell near Classroom 311	N/A		Fiberglass Pipe Insulation				Non Suspect ACM	8	LF	0	LF								N/A	N/A	N/A	N/A
1	3		Stairwell near Classroom 311	N/A		Plaster Ceiling				NAD	275	SF	0	SF								N/A	N/A	N/A	N/A
1	3		Stairwell near Classroom 311	N/A		Plaster Walls				NAD	675	SF	0	SF								N/A	N/A	N/A	N/A
1	3		Stairwell near Classroom 311	N/A		Cement Floor				Non Suspect ACM	275	SF	0	SF								N/A	N/A	N/A	N/A
1	3		Hallway outside Classrooms 305 to 309	N/A		Plaster Ceiling				NAD	900	SF	0	SF								N/A	N/A	N/A	N/A
1	3		Hallway outside Classrooms 305 to 309	N/A		Plaster Walls				NAD	2280	SF	0	SF								N/A	N/A	N/A	N/A
1	3		Hallway outside Classrooms 305 to 309	N/A		Cement Floor				Non Suspect ACM	900	SF	0	SF								N/A	N/A	N/A	N/A
1	3		Hallway outside Classrooms 301 to 303	N/A		Fiberglass Pipe Insulation				Non Suspect ACM	16	LF	0	LF								N/A	N/A	N/A	N/A
1	3		Hallway outside Classrooms 301 to 303	N/A		Plaster Ceiling				NAD	1176	SF	0	SF								N/A	N/A	N/A	N/A
1	3		Hallway outside Classrooms 301 to 303	N/A		Plaster Walls				NAD	2500	SF	0	SF								N/A	N/A	N/A	N/A

6300 Logan ES 2015-2016 AHERA Three Year Report

		School District of Philadelphia James Logan Elementary School (K-5) 1700 Lindley Avenue, Philadelphia, PA 19141 ULCS# 6300 Year Built: 1924		AHERA Three-Year Reinspection 2015-2016 Room by Room Location Log Report							Reinspection Date: 10/14-16/2015					
				Building Inspector: Bernard Brunner		Certificate Number: 45397		Management Planner: Monique Causley		Certificate Number: ACC-0215-8-010						
E l e m e n t	F l o o r	On Site Room Name	System Affected	Material Description	HID#	Confirmed Assumed NAD Non Suspect ACM	Amount of Material	SF LF EA	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic/ Crawl Space Ranking	Damage Potential (DP)	Newly Friable (NF)	Response Action (RA)
1	3	Hallway outside Classrooms 301 to 303	N/A	Cement Floor		Non Suspect ACM	1176	SF	0	SF				N/A	N/A	N/A
1	3	Hallway to Fire Tower near Classroom 302	N/A	Concrete Ceiling		Non Suspect ACM	55	SF	55	SF		Hallway to firetower. Regularly used by students		N/A	N/A	N/A
1	3	Hallway to Fire Tower near Classroom 302	N/A	Brick Wall		Non Suspect ACM	135	SF	0	SF				N/A	N/A	N/A
1	3	Hallway to Fire Tower near Classroom 302	N/A	Cement Floor		Non Suspect ACM	55	SF	0	SF				N/A	N/A	N/A
1	3	Fire Tower near Classroom 302	N/A	Concrete Ceiling		Non Suspect ACM	312	SF	50	SF		Firetower. Regularly used by students		N/A	N/A	N/A
1	3	Fire Tower near Classroom 302	N/A	Brick Wall		Non Suspect ACM	915	SF	0	SF				N/A	N/A	N/A
1	3	Fire Tower near Classroom 302	N/A	Cement Floor		Non Suspect ACM	312	SF	0	SF				N/A	N/A	N/A
1	3	Stairwell near Classroom 303	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	16	LF	0	LF				N/A	N/A	N/A
1	3	Stairwell near Classroom 303	N/A	Plaster Ceiling		NAD	275	SF	0	SF		Water Damage		N/A	N/A	N/A
1	3	Stairwell near Classroom 303	N/A	Plaster Walls		NAD	675	SF	5	SF				N/A	N/A	N/A
1	3	Stairwell near Classroom 303	N/A	Cement Floor		Non Suspect ACM	275	SF	0	SF				N/A	N/A	N/A
1	AT	Attic near Stop Closet on Third Floor	X	X		X	X	X	X	X	X	Fiberglass PI /Plastic/PVC caps	A	X	X	X
1	CS	Crawlspace adj. to Girl's Room in Basement	X	X		X	X	X	X	X	X	Sealed Shut with screws	?	X	X	X
1	CS	Crawlspace adj. to Boy's Room in Basement	X	X		X	X	X	X	X	X	Sealed Shut with screws	?	X	X	X
2	1	Modular	X	X		X	X	X	X	X	X	Modular destroyed by fire.		X	X	X

Section III Certificates

A. Management Planner/Building Inspector Certificates

Section III – A

Management Planner/Building Inspector Certificates

These charts indicate the Name, Course Date, Expiration Date and Corresponding Certificate Number of the Management Planner and Building Inspector of individuals that participated in the AHERA 3 Year Inspection and Management Plan process of 2015/2016.

Management Planner	Date Granted	Expiration Date	Certificate Number
Monique Causley	2/15/2015	2/16/2016	ACC-0215-8-010
Monique Causley	2/16/2016	2/17/2017	ACC-0216-8-001
Megan Vala	5/22/2015	6/22/2016	740728
Mary Anne Lerro	4/5/2016	4/5/2017	742327

Building Inspector	Date Granted	Expiration Date	Certificate Number
Scott Magee	8/15/2015	8/15/2016	70016699C
William Garrity	8/15/2015	8/15/2016	70016699A
Bernard Brunner	10/2/2015	8/2/2016	45397
Mary Anne Lerro	3/3/2015	3/3/2016	740092
Mary Anne Lerro	4/5/2016	4/5/2017	742322
James Madden	12/11/2014	12/11/2015	ACC-1214-6-010
James Madden	12/3/2015	12/3/2016	ACC-1215-6-018
Troy Ray	3/15/2015	3/19/2016	ACC-0355-6-011
Ananth Vinjamuri	9/29/2015	9/29/2016	374
Shelton Williams	9/29/2015	9/29/2016	375
Paul Davis	2/12/2015	2/12/2016	ACC-0215-6-015
Paul Davis	2/2/2016	2/2/2017	741836
Bernard Bryson	2/16/2015	2/16/2016	ACC-0125-6-031
Bernard Bryson	2/15/2016	2/15/2017	ACC-0216-6-005
Alexander Roman	9/18/2015	9/18/2016	EHSBIR-150619-008
Norm Harrison	9/2/2015	9/2/2016	ACC-0915-6-011
Kelly Mayberry	2/20/2015	2/20/2016	EHSBIR-150220-005
Kelly Mayberry	2/18/2016	2/18/2017	EHSBIR-160218-006
Andrew Hine	5/6/2015	5/6/2016	AI05042015-3
Maryellen Leotta	2/12/2015	2/12/2016	ACC-0215-6-024

Certificate of Completion

awarded to

Monique Causley

for successfully completing the prescribed course of study in

Pennsylvania Asbestos Management Planner Refresher Course

under TSCA Title II

presented by

ACCESS TRAINING SERVICES, INC.
7921 River Road, Pennsauken, NJ 08110
(856) 665-3449

2/16/15

Course Date

N/A

Exam Date

2/16/16

Expiration Date

Not Provided

Social Security Number

ACC-0215-8-010

Certificate Number

Mark K. Schlüger
Training Director



Certificate of Completion

awarded to

Monique Causley

for successfully completing the prescribed course of study in

**Pennsylvania Asbestos Management Planner
Refresher Course**

under TSCA Title II

presented by

ACCESS TRAINING SERVICES, INC.
7921 River Road, Pennsauken, NJ 08110
(856) 665-3449

2/15/16

Course Date

N/A

Exam Date

2/15/17

Expiration Date

Not Provided

Social Security Number

ACC-0216-8-001

Certificate Number

Mark K. Schlüger
Training Director



Certificate of Training

CRITERION LABORATORIES, INC.

HEREBY CERTIFIES THAT

Megan Vala

HAS SUCCESSFULLY COMPLETED A 16 HOUR COURSE ENTITLED

Asbestos Management Planner Initial

INCLUDING CLASSROOM INSTRUCTION

05/21/2015 to 05/22/2015

Exam passed on this 22nd day of May 2015 - Score - 94

Approved for AHERA Accreditation Under TSCA Title II

DIRECTOR:



James A. Welts, CIH, President

3370 Progress Drive, Suite J

Bensalem, PA 19020

(215) 244-1300 - Phone

(215) 244-4349 - Fax

www.criterionlabs.com

Course is conducted in English

Certificate of Training

CRITERION LABORATORIES, INC.

HEREBY CERTIFIES THAT

Mary Anne Lerro

HAS SUCCESSFULLY COMPLETED A 4 HOUR COURSE ENTITLED

Asbestos Management Planner Refresher

INCLUDING CLASSROOM INSTRUCTION


on this 5th day of April 2016

Approved for AHERA Accreditation Under TSCA Title II

3370 Progress Drive, Suite J
Bensalem, PA 19020
(215) 244-1300 - Phone
(215) 244-4349 - Fax
www.criterionlabs.com

Course is conducted in English

DIRECTOR:



James A. Welts, CIH, President

EMSL ANALYTICAL, INC.

Certifies that

Scott Magee

has successfully completed the course of study for the

Asbestos Building Inspector Refresher Course

for Accreditation under TSCA Title II

EMSL Certificate No. 70016699C


Approved by:

PA Dept. of Labor and Industry
Accreditation # 137

Course Date: 8/15/2015
Granted: 8/15/2015
Expiration Date: 8/15/2016

Sponsored by:

EMSL Analytical, Inc.
200 Route 130 North
Cinnaminson, NJ 08077
Phone: (800) 220-3675
Fax: (856) 786-5973
www.emsl.com

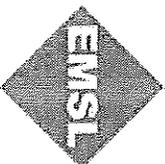

Michael P. Menz

Michael P. Menz, CIH
Training Director

Environmental, Mold, Bacteria, IAQ, Asbestos, Lead, Forensic and Materials Testing Since 1981

EMSL ANALYTICAL, INC.

Certifies that

William Garrity

has successfully completed the course of study for the

Asbestos Building Inspector Refresher Course

for Accreditation under TSCA Title II


EMSL Certificate No. 70016699A

Approved by:
PA Dept. of Labor and Industry
Accreditation # 137

Course Date: 8/15/2015
Granted: 8/15/2015
Expiration Date: 8/15/2016

Sponsored by:

EMSL Analytical, Inc.
200 Route 130 North
Cinnaminson, NJ 08077
Phone: (800) 220-3675
Fax: (856) 786-5973
www.emsl.com

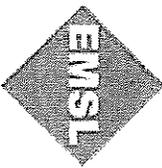

Michael P. Menz

Michael P. Menz, CIH
Training Director

Environmental, Mold, Bacteria, IAQ, Asbestos, Lead, Forensic and Materials Testing Since 1981

45397

National Asbestos & Environmental Training Institute

CERTIFICATE OF COMPLETION

AHERA/EPA Accredited Per 40 CFR Part 763
Asbestos Accreditation under TSCA Title II

This is to certify that


Bernard Brunner, Jr.

Successfully completed the course entitled

**1/2-Day New York State/EPA/AHERA Asbestos Building Inspector Annual Refresher on
October 2, 2015**

Examination Passed October 2, 2015

Expiration Date on October 2, 2016


Doris I. Adler
President, NAEETI

Per 10 NYCRR Part 73.2 (L) (1), DOH 2832 Certificate of Completion of Asbestos
Safety Training is the only official record of training for N.Y.S. students.

Language: English

ABIH 1/2 CM POINT

3321 Doris Avenue, Building B, Ocean, NJ 07712

Phone (732) 531-5571

Fax (732) 531-5956

www.naeti.com

Number 740092

Expiration Date:
03/03/2016

Certificate of Training

CRITERION LABORATORIES, INC.

HEREBY CERTIFIES THAT

Mary Anne Lerro

HAS SUCCESSFULLY COMPLETED A 4 HOUR COURSE ENTITLED

Asbestos Building Inspector Refresher

on this 3rd day of March 2015

Exam passed on this 3rd day of March 2015 - Score - 84

Approved for AHERA Accreditation Under TSCA Title II

3370 Progress Drive, Suite J
Bensalem, PA 19020
(215) 244-1300 - Phone
(215) 244-4349 - Fax
www.criterionlabs.com

Course is conducted in English

DIRECTOR:


James A. Welch, CIH, President

Certificate of Training

CRITERION LABORATORIES, INC.

HEREBY CERTIFIES THAT

Mary Anne Lerro

HAS SUCCESSFULLY COMPLETED A 4 HOUR COURSE ENTITLED

Asbestos Building Inspector Refresher

INCLUDING CLASSROOM INSTRUCTION

on this 5th day of April 2016

Exam passed on this 5th day of April 2016 - Score - 88

Approved for AHERA Accreditation Under TSCA Title II

3370 Progress Drive, Suite J
Bensalem, PA 19020
(215) 244-1300 - Phone
(215) 244-4349 - Fax
www.criterionlabs.com

Course is conducted in English

DIRECTOR:



James A. Weltz, CIH, President

Certificate of Completion

James Madden

for successfully completing the prescribed course of study in

Pennsylvania Asbestos Building Inspector Refresher Course

under TSCA Title II

presented by
ACCESS TRAINING SERVICES, INC.
7921 River Road, Pennsauken, NJ 08110
(856) 665-3449

12/11/14

Course Date

N/A

Exam Date

12/11/15

Expiration Date

Not Provided

Social Security Number

ACC-1214-6-010

Certificate Number

Mark K. Schlüger
Mark K. Schlüger
Training Director

Certificate of Completion

James Madden

for successfully completing the prescribed course of study in

Pennsylvania Asbestos Building Inspector Refresher Course

under TSCA Title II

presented by

ACCESS TRAINING SERVICES, INC.
7921 River Road, Pennsauken, NJ 08110
(856) 665-3449

12/3/15

Course Date

N/A

Exam Date

12/3/16

Expiration Date

Not Provided

Social Security Number

ACC-1215-6-018

Certificate Number

Mark K. Schlüger
Mark K. Schlüger
Training Director

Certificate of Completion

Troy A. Ray

for successfully completing the prescribed course of study in

Pennsylvania Asbestos Building Inspector Refresher Course

under TSCA Title II

presented by

ACCESS TRAINING SERVICES, INC.
7921 River Road, Pennsauken, NJ 08110
(856) 665-3449


3/19/15
Course Date

N/A
Exam Date

3/19/16
Expiration Date

Not Provided
Social Security Number

ACC-0355-6-011
Certificate Number


Mark K. Schlager
Training Director

CERTIFICATE NO 374

G&C Environmental Services, Inc. (#294)
2 Street Road, Newtown Square, Pennsylvania 19073
Telephone: (610) 993-9202 Facsimile: (610) 993-9232
Email: Training@gcenviro.com
www.GCenviro.com

This document certifies that Ananth K. Vinjamuri has successfully completed this
State of New York Department of Health Approved AHERA BUILDING INSPECTOR

REFRESHER COURSE, completed as required for asbestos accreditation under the Toxic

Substances Control Act, Title II. This course was held from 09/29/2015 to 09/29/2015.
MM DD YR MM DD YR

The examination date was 09/29/2015. This certificate expires one year from the date of
MM DD YR MM DD YR
successful completion of the examination 09/29/2016.
MM DD YR

*The official record of successful training completion is the New York State Department of
Health certificate of asbestos safety training completion (DPH 2832).*

Gail M. Conner
Training Director

Gail M. Conner

CERTIFICATE NO 375

G&C Environmental Services, Inc. (#294)
2 Street Road, Newtown Square, Pennsylvania 19073
Telephone: (610) 993-9202 Facsimile: (610) 993-9232
Email: Training@gcenviro.com
www.GCenviro.com

This document certifies that Shelton Williams has successfully completed this
State of New York Department of Health Approved AHERA BUILDING INSPECTOR

REFRESHER COURSE, completed as required for asbestos accreditation under the Toxic

Substances Control Act, Title II. This course was held from 09/29/2015 to 09/29/2015.

The examination date was 09/29/2015. This certificate expires one year from the date of
successful completion of the examination 09/29/2016.

*The official record of successful training completion is the New York State Department of
Health certificate of asbestos safety training completion (DPH 2832).*

Gail M. Conner
Training Director

Gail M. Conner

Certificate of Completion

Paul M. Davis

for successfully completing the prescribed course of study in

Pennsylvania Asbestos Building Inspector Refresher Course

under TSCA Title II

presented by

ACCESS TRAINING SERVICES, INC.
7921 River Road, Pennsauken, NJ 08110
(856) 665-3449

2/12/15

Course Date

N/A

Exam Date

2/12/16

Expiration Date

Not Provided

Social Security Number

ACC-0215-6-015

Certificate Number


Mark K. Schlager
Training Director

Certificate of Training

CRITERION LABORATORIES, INC.

HEREBY CERTIFIES THAT

Paul M. Davis

Asbestos Building Inspector Refresher

HAS SUCCESSFULLY COMPLETED A 4 HOUR COURSE ENTITLED

INCLUDING CLASSROOM INSTRUCTION

on this 2nd day of February 2016

Exam passed on this 2nd day of February 2016 - Score - 92

Approved for AHERA Accreditation Under ISCA Title II

DIRECTOR:

James A. Wertz, CIH, President

3370 Progress Drive, Suite J
Bensalem, PA 19020

(215) 244-1300 - Phone

(215) 244-4349 - Fax

www.criterionlabs.com

Course is conducted in English

Certificate of Completion

Bernard J. Bryson

for successfully completing the prescribed course of study in

Pennsylvania Asbestos Building Inspector Refresher Course

under TSCA Title II

presented by

ACCESS TRAINING SERVICES, INC.
7921 River Road, Pennsauken, NJ 08110
(856) 665-3449

2/16/15

Course Date

N/A

Exam Date

2/16/16

Expiration Date

Not Provided

Social Security Number

ACC-0125-6-031

Certificate Number


Mark K. Schlager
Training Director

Certificate of Completion

Bernard J. Bryson

for successfully completing the prescribed course of study in

Pennsylvania Asbestos Building Inspector Refresher Course

under TSCA Title II

presented by

ACCESS TRAINING SERVICES, INC.
7921 River Road, Pennsauken, NJ 08110
(856) 665-3449

2/15/16

Course Date

N/A

Exam Date

2/15/17

Expiration Date

Not Provided

Social Security Number

ACC-0216-6-005

Certificate Number

Mark K. Schlager
Mark K. Schlager
Training Director

EHS TRAINING INSTITUTE, INC.
A Division of BATA, Inc.

Certificate of Completion

AHERA Building Inspector

(Refresher)

Awarded To:
Alexander Roman

SS#:XXX-XX-1743
Who has completed this 4-hour course and examination,
EPA Approved under TSCA Title II
AHERA / ASHARA Rule
40 CFR Part 763.

EHS TRAINING INSTITUTE, INC.
A Division of BATA, Inc.
Delaware Industrial Park • 6 Garfield Way
Newark, DE 19713-5817
(302) 737-3376 • Fax (302) 737-5764
Course Date: **September 18, 2015**
Date of Expiration: **September 18, 201**
Certification Number : **EHSBIR 150619-008**


Todd K. Zeisloff, Instructor


Neeraj K. Batta, President

Certificate of Completion


Norman Harrison

for successfully completing the prescribed course of study in

**Pennsylvania Asbestos
Building Inspector Refresher Course**

under TSCA Title II

presented by
ACCESS TRAINING SERVICES, INC.
7921 River Road, Pennsauken, NJ 08109
(856) 665-3449

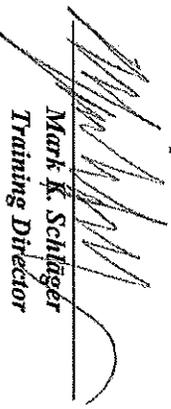9/2/15 <i>Course Date</i>	N/A <i>Exam Date</i>	9/2/16 <i>Expiration Date</i>
Not Provided <i>Social Security Number</i>	ACC-0915-6-011 <i>Certificate Number</i>	 Mark K. Schlager <i>Training Director</i>

EHS TRAINING INSTITUTE, INC.
A Division of BATTI, Inc.

Certificate of Completion

AHERA Building Inspector (Refresher)

Awarded To:
Kelly Mayberry

SS#:XXX-XX-1551
Who has completed this 4-hour course and examination,
EPA Approved under TSCA Title II
AHERA / ASHARA Rule
40 CFR Part 763.

EHS TRAINING INSTITUTE, INC.
A Division of BATTI, Inc.
Delaware Industrial Park • 6 Garfield Way
Newark, DE 19713-5817
(302) 737-3376 • Fax (302) 737-5764
Course Date: February 20, 2015
Date of Expiration: February 20, 2016
Certification Number : EHSBIR 150220-005


Todd K. Zeisloff, Instructor


Neeraj K. Batta, President

EHS TRAINING INSTITUTE, INC.
A Division of BATTI, Inc.


Certificate of Completion

AHERA Building Inspector (Refresher)

Awarded To:
Kelly Mayberry

SS#:XXX-XX-1551
Who has completed this 4-hour course and examination,
EPA Approved under TSCA Title II
AHERA / ASHARA Rule
40 CFR Part 763.

EHS TRAINING INSTITUTE, INC.
A Division of BATTI, Inc.
Delaware Industrial Park • 6 Garfield Way
Newark, DE 19713-5817
(302) 737-3376 • Fax (302) 737-5764
Course Date: February 18, 2016
Date of Expiration: February 18, 2017
Certification Number : EHSBIR 160218-006

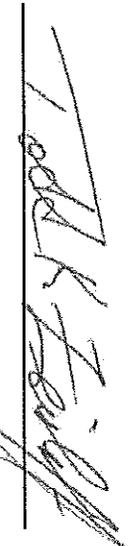
Todd K. Zeisloff, Instructor


Neeraj K. Batta, President

AEROSOL MONITORING & ANALYSIS, INC.

This is to certify that
ANDREW HINE

has met the attendance requirements and successfully completed

the course entitled

3-DAY EPA AHERA INSPECTOR

For Accreditation Under TSCA Title II

05/04/2015 to 05/06/2015

Course Date

05/06/2015

Exam Date

5/6/2016

Expiration Date

STEVE STERAGKI

Principal Instructor



A105042015-3

Certification No.

E. Rush Barnett

Course Director



1331 Ashton Road

P.O.Box 646

Hanover, MD 21076

P: 410-684-3327

F: 410-684-3724

www.amatrainig.com

Certificate of Completion

Maryellen Leotta

for successfully completing the prescribed course of study in

Pennsylvania Asbestos Building Inspector Refresher Course

under TSCA Title II

presented by

ACCESS TRAINING SERVICES, INC.
7921 River Road, Pennsauken, NJ 08110
(856) 665-3449

2/12/15

Course Date

N/A

Exam Date

2/12/16

Expiration Date

Not Provided

Social Security Number

ACC-0215-6-024

Certificate Number

Mark K. Schlager
Training Director



Section IV Cross Reference Table

Asbestos Hazard Emergency Response Act (AHERA) Environmental Compliance Audit Cross Reference Table

In response to the AHERA Environmental Compliance Audit a Cross Reference Table has been prepared for inclusion into the Environmental Management Plan. The purpose of this Cross Reference Table is to link the following documents to the AHERA Management Plan.

Cross Reference Table	
3 Year Reinspection Report follows this Cross Reference Table documentation.	
Subject Matter	Location of Required Documents
Designated Person	Pages 1 - 3
Annual Notification	Pages 4 - 5
6 Month Periodic Surveillance Outline of Events	Page 6
3 Year Re-inspections Outline of Events	Page 7
Asbestos Management Program (operations and maintenance)	Pages 8 - 19
Asbestos Investigation Report (AIR)	Attachment 1 Letter Dated August 4, 2006
Training (included in the Asbestos Management Program)	<p>The original records are centralized at the School District's Environmental Library. Copies are maintained on staff and are required to be maintained in the latest Reinspection Report.</p> <p>2 hour awareness training records for all Building Engineers, Custodian Assistants and maintenance personnel</p> <p>40 hour worker/supervisor training records for the OEMS A-Team and various AST tradesmen.</p>
Response Actions (monthly mailings if applicable)	<p>The original documents are on file at the School District's Environmental Library.</p> <p>Copies of the original are mailed to the Schools Main Office for retention with the Management Plan documentation. These documents are typically kept separate from the management plan in an update binder due to the potential volume of response action reports.</p>

SCHOOL DISTRICT OF PHILADELPHIA

ASBESTOS DESIGNATED PERSON

Gerald F Junod
Office of Capital Programs
Environmental Management & Services
440 N Broad Street, 3rd Floor
Philadelphia, PA 19130
Telephone: 215 400 6738
Fax: 215 400 4751

Drexel University- Asbestos Building Inspector Course January 9-11, 1989 24 Hours
Drexel University- Asbestos Management Planner Course January 12-13, 1989 16 Hours
Criterion Laboratories, Inc. - Asbestos Management Planner Course October 11-12, 2012 16 Hours

Annual Building Inspector Refreshers 1990 to Present
4 Hours
Drexel University
Criterion Laboratories, Inc
Access Training Services, Inc.

Annual Building Management Planner Refreshers 1990 to 1994
4 Hours
Drexel University
Criterion Laboratories, Inc 2013 to Present
4 Hours

Environmental Manager, School District of Philadelphia
Manages the design and implementation of asbestos and lead projects for the Capital Improvement Program and other District Departments including Facilities & Operations and Information Technology. Ensures that asbestos abatement and lead remediation projects are expertly designed and executed in accordance with industry best management practice standards and regulations.

Manager, City of Philadelphia Asbestos Control Program
Served as the Asbestos Control Program Manager for the City of Philadelphia, Department of Public Health, Air Management Services, Asbestos Control Unit from August 1, 2003 through October 23, 2006.

Mid Atlantic Regional Environmental Consortium (MAREC)
Former member with attendance and participation commitments of all quarterly EPA Region III and yearly National Asbestos Regulatory Conferences sponsored by the EPA and the National Conference of State Legislators respectively as a representative for the City of Philadelphia Department of Public Health Air Management Services from 1994 through 2006.


Philadelphia Environmental Task Force
Former member of the Philadelphia Environmental Task force as a representative and point of contact for the City of Philadelphia Department of Public Health Air Management Services Asbestos Control Unit from 2002 through 2006.

Asbestos Instructor

Worked as the primary instructor for the initial and annual Asbestos Project Inspector training and licensing program as mandated by City of Philadelphia Department of Public Health Asbestos Control Regulations from August 1994 through October 2006.

Worked as a lead instructor with an Environmental Consulting Firm and approved by the US EPA for the initial and annual refresher training courses for various asbestos occupational disciplines such as the Building Inspector, Management Planner and Worker/Supervisor from 1991 through 1994.

I certify that the general, local agency responsibilities as stipulated in Section 763.84 will be met.

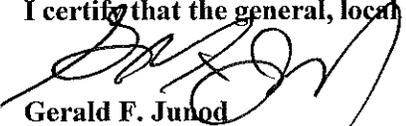

**Gerald F. Junod
Asbestos Designated Person
Environmental Manager
Office of Environmental Management and Services**

SCHOOL DISTRICT OF PHILADELPHIA

Accreditation Information Statement

All persons who inspect for Asbestos Containing Building Materials (ACBM) and who will design or carry out response actions with respect to assumed and confirmed ACBM, will be accredited by an EPA approved course and/or a State Contractors Accreditation Program under Sections 206 (c) and 206 (b) of Title II of the ACT.



**Gerald F. Junod
Asbestos Designated Person
Environmental Manager
Office of Environmental Management and Services**

SCHOOL DISTRICT OF PHILADELPHIA
OFFICE OF CAPITAL PROGRAMS
440 NORTH BROAD STREET, SUITE 373
PHILADELPHIA, PENNSYLVANIA 19130

OFFICE OF ENVIRONMENTAL MANAGEMENT AND SERVICES

PHONE (215)-400-4750

September 2015

TO: Principals
Building Administrators/Occupants
Parents/Guardians

FROM: Fran Burns
Chief Operating Officer

Francine Locke, M.S., Director
Office of Environmental Management and Services

SUBJECT: Annual EPA Notification Letter

Pursuant to the Federal Environmental Protection Agency (EPA) mandate, as required by 40 C.F.R. 763.84 (c)(d) of public access to environmental records, this letter is to acknowledge the availability of your facility's Asbestos Hazard Emergency Response Act (AHERA) Management Plan.

Each member of the school staff, parents/guardians, temporary workers and/or contractors, are required to receive a copy of the Notification Letter. At the direction of the Principal, a copy is to be posted on the bulletin boards and an appropriate amount of copies are to be generated for distribution.


Note: The AHERA Three-Year Reinspection reports, in colored binders; White with Pink, Tan, Black, Red, Dark Blue, Green, Yellow and White, are Federal EPA mandated inspection documents. The School District of Philadelphia is subject to severe monetary penalties if the reports and associated paperwork are not available to the EPA and the public upon request.

It is incumbent on designated school personnel to gather and retain this data as it is delivered, in one location for future review. Acceptable locations include the Principal's Office or Main Office for the primary data. The Building Engineer should maintain any secondary or duplicate copies.

If you have any questions, please call 215-400-4750. Thank you for your cooperation.



Fran Burns
Chief Operating Officer



Francine Locke, M.S., Director
Office of Environmental Management
and Services

c: Danielle Floyd

AHERA-4
8/21/15



School District of Philadelphia
OFFICIAL NOTICE

PLEASE POST

September 2015

TO: Principals
Building Administrators
Building Engineers
Building Occupants
Parents/Guardians

FROM: Fran Burns
Chief Operating Officer

Francine Locke, M.S., Director
Office of Environmental Management and Services

SUBJECT: Annual Notification Letter: Asbestos Hazard Emergency Response Act

The Federal Register published on October 30, 1987, Subpart E, in Schools: Final Rule and Notice, 763.84 (c)(d) states that each local education agency shall ensure that workers and building occupants or guardians are to be informed at least once each school year about inspections, response actions and post-response action activities including re-inspections and periodic surveillance activities. The School District as the Local Education Agency (LEA), retains such reports that are available for public inspection in the Office of the Principal or Building Administrator.

The Principal or Building Administrator is required to do the following with this notification:

- 1) Post in a Public Place or Main Office
- 2) Inform Building Occupants
- 3) Send a copy of this notification to Parents or Guardians
- 4) Insert a copy into the latest AHERA Three-Year Reinspection report (white/pink binder) in your office or facility.

Handwritten signature of Fran Burns in black ink.

Fran Burns
Chief Operating Officer

Handwritten signature of Francine Locke in black ink.

Francine Locke, M.S., Director
Office of Environmental Management
and Services

c: Danielle Floyd

AHERA-4a
8/21/15

SCHOOL DISTRICT OF PHILADELPHIA
Education Center
440 North Broad Street
Philadelphia, Pennsylvania 19130

Office of Environmental Management and Services

215-400-4750

AHERA
Six Month Surveillance
Outline of Events

- Pursuant to the Federal Environmental Protection Agency (EPA) mandate, as required by 40 CFR 763.92(b), the following procedure is to be implemented. At least once every six (6) months after a Management Plan is in effect, each Local Education Agency (LEA) shall conduct a periodic surveillance in each building that it owns or leases that contains Asbestos Containing Building Materials (ACBM) or is assumed to contain ACBM.
- The first Bi-Annual Inspection starts in the Spring (March, April, May) and again in the Fall (October, November, December) of each year. The Building Engineer/Assistant should assist the Building Inspector with appropriate access to all areas including (Crawlspace/Attics) and rooms in the facility. There is no action required of the Principal.
- The Building Inspector shall visually inspect all areas that are identified in the Management Plan as ACBM or assumed ACBM. The date of the surveillance is recorded, the inspectors name and any changes in the conditions of the materials.
- The Building Inspector shall make a copy of the inspection document and insert into the front of the latest Management Plan (AHERA Three Year Reinspection report). The original document is returned to the LEA's Environmental Library and filed.

SCHOOL DISTRICT OF PHILADELPHIA
Education Center
440 North Broad Street
Philadelphia, Pennsylvania 19130

Office of Environmental Management and Services

215-400-4750

AHERA
Three Year Reinspection
Outline of Events

- Pursuant to the Federal Environmental Protection Agency (EPA) mandate, as required by 40 CFR 763.85(b) the following procedure is to be implemented. At least once every three (3) years after a Management Plan is in effect, each Local Education Agency (LEA) shall conduct a reinspection of each building that it owns or leases that contains Asbestos Containing Building Material's (ACBM's) or is assumed to contain ACBM.
- Subsequent Three Year Re-inspections (2009, 2012, 2015, etc) shall start in the Fall (October, November, December, January). The Building Engineer/Assistant should assist the Building Inspector with appropriate access to all areas including (Crawlspace/Attics) and rooms in the facility. There is no action required of the Principal.
- An accredited Building Inspector shall visually inspect and touch to determine friability, all areas that are identified in the Management Plan as ACBM or assumed ACBM. The date of the surveillance is recorded, the inspectors name and any changes in the conditions of the materials. The Building Inspectors state of accreditation and license number is required.
- After the inspection, the Building Inspector shall make a copy of the inspection documents and insert into the front of the latest Management Plan (AHERA Three Year Reinspection report). The original document is returned to the LEA's Environmental Library and filed.
- The Building Inspector shall return the reinspection data to the Management Planner to be assessed and determine appropriate response actions and a report issued (AHERA Three Year Reinspection report). One copy of the report is delivered to the schools Principal to be permanently retained with all previous environmental data. Another copy is retained in the LEA's Environmental Library.



School District of Philadelphia
Office of Environmental Management & Services
440 North Broad Street
Philadelphia, PA 19130
(215) 400-4750

**School District of Philadelphia
Asbestos Management Program**

TABLE OF CONTENTS

Definitions.....	Page 9
1. Introduction.....	Page 10
2. Summary of Asbestos Management Plan	
3. Asbestos Management Plan Execution.....	Page 11
a. General Execution	
4. Summary of Program Execution	
a. Asbestos Management Plan Execution	
5. Responsibilities	
a. OEMS	
b. Asbestos Worker/Supervisor “A-TEAM”.....	Page 12
c. Asbestos Designated Person	
d. Supervisor or Project Manager (Capital, Maintenance & Facilities)	
e. Employee Capital.....	Page 13
f. Employee Maintenance	
g. Employee Facilities and Custodial	
6. Requirements.....	Page 14
a. Employee Exposure Monitoring	
b. Employee Notification	
c. Observation of Monitoring	
d. Training Program	
e. Access of Information	
f. Record Keeping	
7. AHERA O&M Plan.....	Page 15
a. Controls	
8. O&M Response Actions.....	Page 16
a. Facility Maintenance Isolation of Area	
b. Unlikely Contact with ACM/PACM	
c. Accidental Disturbance of ACM/PACM	
d. Planned Disturbance of ACM/PACM	
e. Miscellaneous ACM/PACM.....	Page 17
f. Vinyl Asbestos Floor Tile	
g. Mastic/Adhesives	
h. Woven Vibration Dampers	
i. Other Work Practices	
j. Fiber Release Episodes	
9. References and Resources.....	Page 18

DEFINITIONS / ACRONYMS

ACM/PACM:	Asbestos Containing Material/Potential Asbestos Containing Material
AHERA:	Asbestos Hazard Emergency Response Act
AIR FORM:	Asbestos Inspection Report Form
Amended Water:	Water to which a surfactant (soap) has been added
AMP:	Asbestos Management Program/Asbestos Management Plan
Asbestos Designate Person:	Individual assigned by the district to oversee asbestos related issues.
Asbestos Regulated Area:	Location that is posted as an asbestos work area in which only approved and accredited personnel are permitted to enter
AST:	Asbestos Support Team involving approved and accredited school district tradespersons personnel that are school district person
A-TEAM:	School District of Philadelphia asbestos workers
CIP:	Capital Improvement Program
Consultant:	Asbestos consulting firm hired by the District
Demolition Directive:	Memorandum – August 4, 2006 from Patrick Henwood
EPA:	Environmental Protection Agency
In House Personnel:	School District of Philadelphia asbestos workers
LEA:	Local Education Agency
O&M:	Operations and Maintenance
OEMS:	Office of Environmental Management and Services
OSHA:	Occupational Safety and Health Administration
PEL:	Permissible Exposure Limit
PSD or SDP:	Philadelphia School District/School District of Philadelphia
PSIT:	Philadelphia School Improvement Team
STEL:	Short Term Exposure Limit

1. Introduction

The School District of Philadelphia, Asbestos Policy Statement:

“The School District of Philadelphia is dedicated to providing a safe and healthful work environment for its employees, students, faculty, contractors and visitors. In recognition of the potential health problems associated with asbestos, the School District of Philadelphia is committed to a comprehensive asbestos control program. This program is implemented and maintained through the School District of Philadelphia's Office of Environmental Management and Services (OEMS).”

OEMS has the responsibility of establishing procedures for asbestos abatement, asbestos inspection, air monitoring, renovation and demolition activities within all School District of Philadelphia owned or leased facilities.

These procedures are developed to ensure that:

- (1) People are not exposed to significant levels of asbestos fibers
- (2) Asbestos waste is handled and disposed of properly
- (3) Members of the School District of Philadelphia community have access to the Office of Environmental Management and Services for information, assistance, guidance, and interpretation regarding asbestos related matters.
- (4) Members of the School District of Philadelphia community have access to the Asbestos Management Plans as required and outlined in the US EPA AHERA regulations including annual written notification to all parents.
- (5) Compliance with all applicable Federal, State and Local Asbestos Regulations

Requirements outlined in this manual are mandatory in nature where the word “SHALL” is used and are advisory in nature where the word “SHOULD” is used.

2. Summary of Asbestos Management Program

The School District of Philadelphia's Asbestos Management Program was established to meet the requirements of Federal, State, and Local Regulations.

These regulations include, but are not limited to:

- US Environmental Protection Agency Asbestos Hazard Emergency Response Act (US EPA AHERA) and National Emissions Standard for Hazardous Air Pollutants subpart M, Part 61 (NESHAP);
- US Department of Labor, Occupational Safety and Health Administration (OSHA) General Industry Standard (29 CFR 1910.1001) and the OSHA Asbestos Standard for the Construction Industry (29 CFR 1926.1101);
- The Commonwealth of Pennsylvania, Department of Labor and Industry, Asbestos Occupations, Accreditation and Certification Act;
- The City of Philadelphia, Department of Public Health, Asbestos Control Regulations.

3. Asbestos Management Program Execution

a) General Execution

The Office of Environmental Management and Services (OEMS) develops, implements and manages safety and health programs for the School District of Philadelphia faculty, staff and students and assists with ensuring that all contractors comply with Federal, State and Local Environmental Regulations. The OEMS provides the oversight of School District of Philadelphia employees (Asbestos A-Team), environmental consultants, and asbestos abatement contractors for all projects within the School District of Philadelphia concerning Asbestos Containing Materials.

The control of safety and health hazards at the School District of Philadelphia is primarily through the implementation of engineering, work practice and administrative controls. Personal Protective Equipment (PPE) is used to supplement these controls or whenever the controls are not feasible or are in the process of being implemented. PPE is also recommended whenever exposures to chemical, physical or biological agents can be prevented or reduced by its use.

This written program establishes the procedures necessary to:

- 1) meet established standards and federal regulations for occupational exposure to asbestos fibers;
- 2) meet the requirements of the City of Philadelphia Asbestos Control Regulations which encompasses the disturbance and/or abatement of asbestos containing building materials;
- 3) provide the necessary health and safety protection to the School District of Philadelphia staff, faculty, students, contractors and visitors.

This program is strengthened by input and cooperation with the Philadelphia Federation of Teachers (PFT), Health and Welfare Fund.

4. Summary of Program Execution

a) Asbestos Management Program Execution

The Asbestos Management Program is administered by the Office of Environmental Management and Services (OEMS). OEMS provides the following services primarily through professional consultants:

- (1) exposure monitoring services;
- (2) building inspection/surveys (bulk sampling) for the identification of asbestos containing materials;
- (3) asbestos project design services;
- (4) asbestos abatement project and air monitoring services;
- (5) emergency response to fiber release episodes;
- (6) education/information;
- (7) medical monitoring;
- (8) training for School District of Philadelphia personnel

5. Responsibilities

a) Office of Environmental Management and Services

OEMS is responsible for performing the following functions:

- (1) Developing and administering of the Asbestos Management Program.
- (2) Providing asbestos-related services to all School District of Philadelphia departments.
- (3) Conducting required training of the Asbestos Management Program and working jointly with departments to schedule training.
- (4) Identifying and posting areas where labeling/signage are required.
- (5) Medical Monitoring of OEMS "A-TEAM" and other departments "AST" Asbestos Program staff.

- (6) Certification and training as required for OEMS "A-TEAM" and other departments "AST" Asbestos program staff.
- (7) Record keeping as outlined in Section 3.5 and all records as by required by US EPA AHERA regulations.

b) Asbestos Worker/Supervisor - "A-TEAM"

- (1) OEMS shall ensure that all "A-TEAM" workers/supervisors adhere to the following requirements:
 - a) Attend an initial Worker/Supervisor Asbestos Course;
 - b) Maintain the annual re-certification per EPA AHERA requirements and Commonwealth of Pennsylvania Asbestos Occupations, Accreditation and Certifications Act;
 - c) Undergo an annual Asbestos Medical Evaluation;
 - d) Undergo an annual Respirator Medical Clearance;
 - e) Undergo an annual Respirator Fit Testing.

c) Asbestos Designated Person

The Asbestos Designated Person is responsible for:

- (1) Assuring the health and safety of employees, students and visitors in the School District of Philadelphia facilities under his/her control.
- (2) Being kept informed of all areas under his or her jurisdiction where potential asbestos exposures exist and initiating protection programs that adhere to the Asbestos Management Program requirements of this manual.
- (3) Assuring that Asbestos Management Program requirements are adhered to by principal investigators, project managers, supervisors, or division heads, and School District of Philadelphia personnel under their supervision.
- (4) Ensuring that all employees within the Asbestos Management Program comply with (OSHA 1910.1001 (j) (7) (iv)) and the US EPA AHERA regulations by attending the required training.
- (5) Ensure the posting of:
 - a) Warning labels/signage
 - b) Commonwealth of Pennsylvania Asbestos Abatement and Demolition/Renovation Notification form
 - c) Asbestos Inspection Reports (AIR) form (where required)
 - d) Ensuring that Construction Projects follow the Demolition Directive procedures as outlined in the August 4, 2006 letter.

d) Supervisor or Project Manager (Capital, Maintenance and Facilities)

Each person in charge of a project, maintenance/repair, renovation/demolition, or other activity from the Departments of Capital, Maintenance, and/or Facilities, where asbestos containing material may be present is responsible for:

Identifying, with the assistance of OEMS, asbestos containing building materials prior to any disturbance of these materials. Various Federal (EPA and OSHA) and Local (City of Philadelphia Asbestos Control Regulations) require Asbestos Inspections prior to renovation/demolition activities. This shall be accomplished by always following the Asbestos Management Program Procedures as follows:

- (1) Ensure that the requirements of the Asbestos Management Program Procedures are followed by all personnel, trades, and contractors who are involved with the project;

- (2) Review of the required Asbestos Inspection Report (AIR) form (Attachment 1) and AHERA Management Plan documents prior to activities that may disturb any Asbestos Containing Materials;
- (3) Perform all project related duties as outlined in the Project Management Responsibilities;
- (4) Keep the department chairperson or director informed on any actions proposed or taken regarding the Asbestos Management Plan;
- (5) Ensuring that Construction Projects follow the Demolition Directive procedure outlined in the August 4, 2006 letter.

e) Employee – Capital

School District of Philadelphia Capital employees and/or consultants shall:

- (1) Ensure that no suspect or asbestos containing building materials are disturbed in the course of the projects they are performing or managing. This shall be accomplished by notifying their supervisor and OEMS by issuance of a work order permit (a.k.a PSIT Service Request Form) and verifying that the materials which may be disturbed are non-asbestos containing. If this information is not available or verification has not been made, these materials should not be disturbed.
- (2) Immediately notify OEMS and their supervisor in the event of a potential fiber release episode upon discovery of visible damage to asbestos containing materials.
- (3) Ensuring that Construction Projects follow the Demolition Directive procedures as outlined in the August 4, 2006 letter.

The types of projects represented as part of the Capital Improvement Program are as follows:

- (1) Complete Renovation of an existing building that addresses all facility component concerns and educational program needs;
- (2) Major Renovation of an existing building addressing significant facility component and educational improvements;
- (3) Addition to an existing building (either as an attachment or stand-alone structure) to accommodate needed program space;
- (4) Conversion of an existing facility to accommodate a change in educational program;
- (5) Facility Component Improvement of specific facility needs (i.e. electrical or HVAC system upgrades, ADA improvements, life safety improvements, exterior renovations, etc.)

f) Employee – Maintenance

School District of Philadelphia Maintenance employees shall:

- (1) Ensure that no suspect or asbestos containing building materials are disturbed in the course of their duties or work they are performing. This shall be accomplished by notifying their supervisor and OEMS by issuance of a work order permit and verifying that the materials which may be disturbed are non-asbestos containing. If this information is not available or verification has not been made, these materials should not be disturbed.
- (2) Immediately notify OEMS and their supervisor in the event of a potential fiber release episode or upon discovery of visible damage to asbestos containing materials.
- (3) All employees involved in maintenance activities shall attend required Asbestos Awareness training program within 60 days of employment.

g) Employee – Facilities & Custodial

School District of Philadelphia Facilities and Custodial employees shall:

- (1) Ensure that no suspect or asbestos containing building materials are disturbed in the course of their duties or work they are performing. This shall be accomplished by notifying their supervisor and OEMS by issuance of a work permit and verifying that the materials which may be disturbed are non-asbestos containing. If this information is not available or verification has not been made, these materials should not be disturbed;
- (2) Immediately notify OEMS and their supervisor in the event of a potential fiber release episode or upon discovery of visible damage to asbestos containing materials.
- (3) All employees involved in Facilities and Custodial activities shall attend require Asbestos Awareness training program within 60 days of employment.

6. Requirements

a) **Employee Exposure Monitoring**

When information indicates that an employee's exposure to asbestos fibers may equal or exceed an 8-hour time-weighted average of 0.1 f/cc * (per OSHA 1910.1001 & 1926.1101), OEMS shall develop and implement an asbestos exposure monitoring program. The sampling strategy shall be designed to identify employees by work task (job classification) that is exposed to asbestos fibers that exceed an 8-hour time-weighted average of 0.1 f/cc.

b) **Employee Notification**

OEMS shall notify in writing, each employee exposed to asbestos fibers at or above an 8-hour time weighted average of 0.1 f/cc.

c) **Observation and Monitoring**

OEMS shall provide employees or their representatives with an opportunity to observe any exposure measurements conducted.

d) **Training Program**

OEMS shall institute a training program which meets the requirements of AHERA for all employees who perform maintenance operations in a facility/school which contains asbestos containing materials or presumed asbestos containing materials and 1910.1001 (j), and the Commonwealth of Pennsylvania Department of Labor and Industry and the City of Philadelphia Asbestos Control Regulations. The affected departments shall ensure employee participation in this program. The OEMS "A-TEAM" and other departments "AST" Asbestos Program staff training shall be conducted annually for each employee as required by all Federal, State and Local for each asbestos discipline.

All Asbestos Awareness training as required by AHERA shall be performed within 60 days of employment and shall include:

- Health effects of asbestos
 - Locations of ACM and PACM in the building/facility
 - Recognition of CM and PACM damage and deterioration
 - Requirements of the OSHA 1910.1001 standard relating to maintenance
 - Proper response to fiber release episodes
 - Procedure to be followed to isolate areas affected by fiber release
- e) **Access to Information**
OEMS shall make available to affected employees or their representative's copies of the Occupational Safety and Health Administration (OSHA) General Industry Standard Part 1910.1001 and the department shall post a copy in the workplace.
- f) **Record Keeping**
OEMS shall maintain an accurate record of all employee exposure measurements. OEMS and/or the School District of Philadelphia Human Resources Department shall maintain records of employee medical monitoring program. OEMS shall maintain all employee training records. All records shall be provided upon request to employees, former employees, representatives designated by the individual employee.

7. AHERA OPERATIONS AND MAINTENANCE PLAN

a) CONTROLS

i. Work Order System

Minimizing disruption of ACM/PACM during maintenance and renovation activities is the primary goal and task encountered by OEMS. Operations and maintenance employees and contractors should be warned to avoid conducting any maintenance work which may disturb ACM/PACM. Initiating a work order system, where all work orders or requests are channeled through the Office of Environmental Management and Services (OEMS), will be the method used to control and minimize disruption of ACM/PACM.

Any work performed by in-house personnel or contractors that could or will impact ACM/PACM shall be coordinated by OEMS. A completed Asbestos Inspection Report Form (Attachment 1) shall be issued to in-house personnel and/or all contractors whose work could impact ACM/PACM. This form should accompany each contract issued to an outside contractor and posted on the jobsite.

All work order requests for maintenance and renovation activities in areas where ACM/PACM is suspected or known to be present are to be submitted to OEMS prior to proceeding with work. OEMS is responsible for reviewing asbestos survey records for information about the presence of ACM/PACM in the area where the work is to be performed. OEMS should physically inspect the area to ensure existing records reflect actual conditions. If no asbestos is present, a work order is not necessary and the planned actions can proceed. If ACM/PACM is found to be present in the area, OEMS will sign the work order application and obtain an approved and accredited asbestos contractor or assign OEMS "A-TEAM" to abate the ACM/PACM.

ii. Regulated Areas

The owner will identify and regulate all areas where airborne concentrations of ACM/PACM exceed the Permissible Exposure Limit (PEL)* (Per OSHA determined to be 0.1 f/cc) and/or short term exposure limit (STEL) (Per OSHA determined to be 0.1 f/cc), or there is reasonable possibility that the (PEL) and/or (STEL) may be exceeded. All ACM/PACM removal activities involving thermal system insulation ACM/PACM (Class I), surfacing ACM/PACM (Class I), and miscellaneous ACM/PACM such as floor tile, roofing, and siding mastic, etc. (Class II), and repair and maintenance operations where thermal system insulation and surfacing ACM/PACM is likely to be disturbed (Class III) will be performed in accordance with federal, state, and local regulations. All asbestos abatement work and activities will be designed and managed as asbestos regulated areas. These areas will be demarcated and labeled.

iii. Warning Signs

Warning signs shall be displayed at all approaches to each asbestos regulated area. The asbestos abatement contractor will provide OSHA warning signs in all regulated areas during removal, repair, and other maintenance activities. OEMS will provide AIRs to all contractors who must inform all employees and supervisors working in locations contiguous to asbestos regulated areas of the potential hazards and work practices required.

iv. Warning Labels

Warning labels and/or signage shall be affixed to all raw materials, mixtures, scrap, waste, debris, and other products containing asbestos fibers, or to their containers. Generally, the asbestos abatement contractor or OEMS A-Team personnel will provide all warning labels for ACM/PACM containment.

8. O & M RESPONSE ACTIONS

The Asbestos Management Program general O&M procedures are outlined in this section. Additional requirements specific to asbestos abatement activities are included in the Project Design documents for all Asbestos Abatement Work. Regular cleaning, inspection, and reporting of ACM/PACM deterioration or other problems must be diligently practiced by all employees including custodial and maintenance personnel.

a) Facility Maintenance Isolation of Area Responsibilities

Maintenance personnel are often required to work in areas where ACM/PACM may potentially be disturbed. Most maintenance activities are conducted by in-house staff, outside contractors, or a combination.

Emergency fiber release episodes, such as pipe fitting or valve breaks, emergency boiler work, or mechanical equipment repair will be responded to by OEMS A-Team personnel or asbestos abatement contractor personnel. The owner's maintenance staff will: (1) isolate the emergency fiber release area; (2) post warning signs to prevent unauthorized access, and (3) notify their supervisor and OEMS. OEMS will ensure that the fiber release area remains isolated and is properly cleaned by and approved and accredited abatement contractor or by OEMS A-TEAM personnel.

b) Unlikely Contact with ACM/PACM

Maintenance activities or repairs which can be performed without contacting or disturbing the ACM/PACM require little more than normal care and good workmanship. For example, valves which are either uncovered or covered with non-asbestos insulation can be packed or repaired without disturbing asbestos insulation on nearby pipes. The major precaution is to ensure that maintenance and custodial personnel are familiar with procedures such as isolating the area, posting warning signs, and notifying OEMS in the event of any accidental ACM/PACM disturbance.

c) Accidental Disturbance of ACM/PACM

Maintenance and facilities personnel shall notify OEMS any time a fiber release is suspected. If friable ACM/PACM becomes airborne in the building,

d) Planned Disturbance of ACM/PACM

Maintenance activities that may impact ACM/PACM include access to a valve, flange, duct, or related system component.

Where asbestos-containing insulation must be removed to maintain or repair the thermal system, the ACM/PACM will imminently be disturbed. ACM/PACM removal work shall be conducted by OEMS A-Team personnel or an approved and accredited asbestos abatement contractor.

If friable ACM/PACM becomes airborne in the building, maintenance and facilities personnel shall secure the area and contact OEMS. OEMS shall respond accordingly.

e) Miscellaneous ACM/PACM

Miscellaneous types of ACM/PACM may include vinyl asbestos floor tiles, mastics/adhesives and woven vibration dampers. Disturbance of these materials should be avoided. Routine maintenance activities involving these materials should not pose a problem if handled properly. Questions on the proper removal and disposal of miscellaneous ACM/PACM should be directed to OEMS. OEMS will contact an approved and accredited asbestos abatement contractor or utilize OEMS A-TEAM personnel to assist with miscellaneous ACM/PACM clean-up activities.

f) Vinyl Asbestos Floor Tile

Asbestos-containing floor tiles in good condition are considered non-friable unless they are crushed, drilled, sawed, sanded or disturbed by any activity that breaks up the material. Routine maintenance of these materials should employ the use of non-abrasive buffers and wet cleaning technique. Broken or loose floor tiles should be removed and disposed of as asbestos waste by OEMS. Remaining debris should be vacuumed with a HEPA vacuum and the area wet mopped using amended water.

g) Mastics/Adhesives

Mastics and adhesives containing asbestos in good condition are considered non-friable and do not pose a potential health concern unless crushed, drilled, sawed, sanded, or otherwise abraded. Questions on the proper removal should be directed to OEMS.

h) Woven Vibration Dampers

Woven vibration dampers in good condition are considered non-friable and do not pose a potential health concern unless cut, crushed, drilled, sawed, sanded, or otherwise abraded. Questions on the proper removal should be directed to OEMS.

i) Other Work Practices

Any special work not included in this section should be addressed to OEMS for review prior to the initiation of work that may involve the disturbance of ACM/PACM.

j) Fiber Release Episodes

Facilities and maintenance staff should report to OEMS the presence of asbestos debris, water or physical damage to ACM/PACM, or any other evidence of possible fiber release. OEMS should have the OEMS A-Team personnel or an approved and accredited abatement contractor respond to the site to clean up debris and make repairs as soon as possible. OEMS will also contact a consultant to conduct air monitoring and prepare a report and submit at project completion to OEMS for each episode. OEMS will forward the reports for each site location AHERA Management Plan accordingly.

9. REFERENCES and RESOURCES

Applicable regulations for asbestos projects impacted by renovation, demolition, and maintenance activities.

- **Philadelphia Air Management Services – Asbestos Control Unit**
<http://www.phila.gov/health/units/ams/Asbestos/asbestos.html>
- **Pennsylvania Asbestos Occupations, Accreditation and Certification Act**
<http://www.dli.state.pa.us/landi/cwp/view.asp?a=185&q=56262&landiNav=>
- **United States Environmental Protection Agency Asbestos Home Page**
<http://www.epa.gov/asbestos/>
- **Occupational Safety and Health Administration (OSHA) Asbestos Home**
<http://www.osha.gov/SLTC/asbestos>