

# SCHOOL DISTRICT OF PHILADELPHIA



## Asbestos Hazard Emergency Response Act “AHERA”

### THREE-YEAR RE-INSPECTION 2015-2016 and ASBESTOS MANAGEMENT PLAN for the

**Austin Meehan Middle School**

**ULCS# 8140  
Building # B814001-1  
3001 Ryan Avenue  
Philadelphia, Pennsylvania  
19152**

**Year Built: 1970**

October 28, 2015

*Conducted by:*

Accredited Environmental Technologies, Incorporated  
Batta Environmental Associates, Incorporated  
Criterion Laboratories, Incorporated  
Environmental Testing Consultants, LLC  
G & C Environmental Services, Incorporated  
KEM Partners, Incorporated  
Synertech, Inc.  
TTI Environmental, Inc.  
USA Environmental Management, Inc.  
The Vertex Companies, Inc.

*Management Plan Prepared by:*  
Criterion Labs, Inc and Synertech Inc.

*This report must remain in the Main Office as mandated by the US EPA AHERA Regulations.*

# **AHERA THREE-YEAR REINSPECTION VOLUME IX**

## **Table of Contents**

### **Transmittal Letter**

### **Executive Summary**

- I. Summary list of Confirmed Asbestos Containing Building Materials
- II. Summary list of Assumed Asbestos Contain Building Materials
- III. Summary list of Non-Asbestos Containing Building Materials
- IV. Summary list of Non Suspect Asbestos Containing Building Materials
- V. Summary List of Auditorium DATA for this location
- VI. Summary list of Attic and/or Crawlspace DATA for this location
- VII. Summary list of Pipe Chase/Pipe Shaft DATA for this location

### **Section I Report of Re-Inspection**

- A. Introduction
- B. Three-Year Re-inspection IX Overview
- C. Post- Management Plan Activities and Changes
  - C.1 - Sampling and Analysis
  - C.2 - New Floor Tile Sampling
  - C.3 - Abatement Activity
  - C.4 - Periodic (Six-Month) Surveillance (Damaged Materials)

### **Section II Re-Inspection Data**

- A. Introduction
- B. Re-Inspection Key Definitions
- C. Room by Room Location Log Report

### **Section III Certificates**

- A. Management Planner/Building Inspector Certificates

<b>Section IV</b>	<b>Cross Reference Table</b>	Page 1-8
	Asbestos Management Program	Page 9-19

SCHOOL DISTRICT OF PHILADELPHIA  
EDUCATIONAL CENTER  
440 NORTH BROAD STREET  
PHILADELPHIA, PENNSYLVANIA 19130

OFFICE OF ENVIRONMENTAL MANAGEMENT AND SERVICES

PHONE (215)-400-4750

January 2016


TO: All Principals  
All Building Administrators

FROM: Fran Burns  
Chief Operating Officer

Francine Locke, M.S., Director  
Office of Environmental Management and Services

SUBJECT: AHERA Three (3) Year Re-inspection IX report

In order to comply with the provisions of the Asbestos Hazard Emergency Response Act (AHERA) the attached report is submitted to you. The law requires that this report be kept in the Main/Principal's office. It cannot be removed from these locations. *If the school (program) is relocated to a different building, these environmental documents are to be safely retained for the next school/building occupants.* All asbestos reports must be available to the public and Federal EPA upon request.



Fran Burns  
Chief Operation Officer



Francine Locke, M.S., Director  
Office of Environmental Management  
and Services

## **Executive Summary**

This Asbestos Hazard Emergency Response Act (AHERA) Three-Year Re-inspection “Volume # IX” Management Plan at this location, has been completed and the report of re-inspection submitted to the School District of Philadelphia. The re-inspections in all School District of Philadelphia buildings of 2015-2016 were conducted and completed between October 5<sup>th</sup>, 2015 through March 30<sup>th</sup>, 2016 as a joint project by Accredited Environmental Technologies, Inc., Batta Environmental Associates, Inc., Criterion Laboratories, Inc., Environmental Testing Consultants, LLC, G & C Environmental Services, Inc., KEM Partners, Inc., Synertech, Inc., TTI Environmental, Inc., USA Environmental Management, Inc. and The Vertex Companies, Inc.

In general, the School District of Philadelphia Office of Environmental Management and Services conducts Environmental Impact Evaluations and provides Asbestos Inspection Reports prior to any renovation, demolition and/or maintenance activities. The AHERA report must be reviewed prior to any renovation, demolition and/or maintenance activities in order to avoid the unknowing disturbance to Asbestos Containing Building Materials identified within this location. In addition, prior to work activities above all drop ceilings this report should be reviewed to avoid potential disturbances to Asbestos Containing Materials. Refer to Section IV of the Cross Reference Table, for additional Asbestos Management Program information. Contact the Office of Environmental Management and Services to have an Environmental Impact Evaluation conducted prior to any renovation, demolition and/or maintenance activities within this facility.

The information contained in this report was obtained from the original Asbestos Management Plan for the school, from update reports on changes and activities since the completion of the 1<sup>st</sup> Management Plan for each location and from all prior inspections performed and documented in Volume # I through Volume VIII (dated respectively 1992, 1995, 1998, 2001, 2004, 2007, 2010 or 2013) (if applicable) - and by this Three-Year Re-inspection of this school. The re-inspection report/Management Plan of 2015-2016 were reviewed and prepared collectively by Management Planner Megan Vala, Mary Anne Lerro of Criterion Laboratories, Inc. and/or Monique Causley, of Synertech Inc.

The 2015-2016 inspection process included the addition of a comprehensive Room by Room Inventory of all Thermal (T), Surfacing (S) and Miscellaneous (M) Materials specific to each room of this facility. Inspections of each room's thermal, ceilings, walls, floors and miscellaneous items regardless of Asbestos Content are categorized on the Room by Room Location Log Report for this location. Rooms or areas of the facility that were not accessible at the time of the inspection are marked with an "X". The Room by Room Location Log Report is found in Section II C of this Management Plan.

All Presumed or Suspect Asbestos Containing Building Materials (ACBMs), listed in the following summary charts are categorized as Confirmed, Assumed, Non-Asbestos, and/or Non-Suspect (ACBMs) were identified in the original Management Plan, or in the Volume I through Volume VIII AHERA Three-Year Re-inspection reports, and were re-inspected as part of this project.

As mandated by the U S EPA AHERA regulations, periodic Six-Month inspections and Three-Year Re-inspections of this location will be performed and the Inspection Data in this report will be updated accordingly.

Please feel free to contact the School District of Philadelphia's Office of Environmental Management and Services (OEMS) regarding any comments, questions, or concerns regarding this report or any Environmental related topic. OEMS staff can be reached at (215) 400 4750, via fax at (215) 400 4751 or via e-mail at [flocke@philasd.org](mailto:flocke@philasd.org) and/or [gfunod@philasd.org](mailto:gfunod@philasd.org).

Additional information can be found on our website. Here is the link to the OEMS website.  
<http://webgui.phila.k12.pa.us/offices/e/environmental>

## I. Summary list of Confirmed Asbestos Containing Building Materials within this facility

These charts are to be used for a quick reference\* in order to avoid the unknowing disturbance of Asbestos Containing Materials during any and all Operations, Maintenance, Renovation, and/or Demolition activities at this location. *These materials have been sampled and Laboratory Analysis has CONFIRMED the presence of Asbestos. Contact OEMS prior to the disturbance of any of the following materials.*

### Confirmed Asbestos Containing Building Materials for this location

Fireproofing		
--------------	--	--

\* *Always refer to the Room by Room Logs for each specific material classification as the material classification findings may be different in various rooms throughout this facility.*

\*\* *Some Materials may have multiple classifications (Confirmed, Assumed, NAD and Non Suspect) within this facility.*

## II. Summary list of Assumed Asbestos Containing Building Materials within this facility

These charts are to be used for a quick reference\* in order to avoid the unknowing disturbance of Asbestos Containing Materials during any and all Operations, Maintenance, Renovation, and/or Demolition activities at this location. These materials have not been sampled and should not be disturbed until verification of Asbestos Content. Contact OEMS for assessment and sampling prior to the disturbance of these materials.

### Assumed Asbestos Containing Building Materials for this location

Blackboard Glue Dots	Floor Tile VAT 12" x 12"	Pipe Fitting Insulation
Pipe Saddles	Sectional Boilers	Sink Undercoat Mastic
Tank Insulation	Transite	Transite Sink

\* *Always refer to the Room by Room Logs for each specific material classification as the material classification findings may be different in various rooms throughout this facility.*

\*\* *Some Materials may have multiple classifications (Confirmed, Assumed, NAD and Non Suspect) within this facility.*

### III. Summary list of Non-Asbestos Containing Building Materials within this facility

These charts are to be used for a quick reference\* in order to avoid the unknowing disturbance of Asbestos Containing Materials during any and all Operations, Maintenance, Renovation, and/or Demolition activities at this location. *These materials have been sampled and Laboratory Analysis has indicated NO Asbestos present or NO ASBESTOS DETECTED (NAD).*

#### Non- Asbestos Containing Building Materials for this location

Ceiling Tile 1' x 1'	Plaster Ceiling	Plaster Walls
----------------------	-----------------	---------------

\* *Always refer to the Room by Room Logs for each specific material classification as the material classification findings may be different in various rooms throughout this facility.*

\*\* *Some Materials may have multiple classifications (Confirmed, Assumed, NAD and Non Suspect) within this facility.*

#### **IV. Summary list of Non-Suspect Asbestos Containing Building Materials within this facility**

These charts are to be used for a quick reference\* in order to avoid the unknowing disturbance of Asbestos Containing Materials during any and all Operations, Maintenance, Renovation, and/or Demolition activities at this location. These materials are not typically known to contain Asbestos.

##### **Non-Suspect Asbestos Containing Building Materials for this location**

Carpet	Cement Floor	Ceramic Tile Floors
Concrete Block Wall	Concrete Ceiling	Corrugated Metal Ceiling
Fiberglass Duct Insulation	Fiberglass Pipe Insulation	Vibration Damper Cloth
Wood Floor		

*\* Always refer to the Room by Room Logs for each specific material classification as the material classification findings may be different in various rooms throughout this facility.*

*\*\* Some Materials may have multiple classifications (Confirmed, Assumed, NAD and Non Suspect) within this facility.*

## V. Summary list of Auditorium DATA for this location

These charts are to be used for a quick reference of the Auditorium DATA within this facility. Sampling of the Auditorium Ceilings throughout the District is more difficult because of the various ceiling heights. As sampling occurs this information is updated on a case by case basis for each specific location and facility.

### This is a list of known materials for this location's Auditorium

<b>Auditorium</b>		
Auditorium	Carpet	Non Suspect ACM
Auditorium	Cement Floor	Non Suspect ACM
Auditorium	Concrete Block Wall	Non Suspect ACM
Auditorium	Concrete Ceiling	Non Suspect ACM
Auditorium Stage	Wood Floor	Non Suspect ACM
Auditorium Stage	Concrete Block Wall	Non Suspect ACM
Auditorium Stage	Concrete Ceiling	Non Suspect ACM

*\* Always refer to the Room by Room Logs for each specific material classification as the material classification findings may be different in various rooms throughout this facility.*

*\*\* Some Materials may have multiple classifications (Confirmed, Assumed, NAD and Non Suspect) within this facility.*

## VI. Summary list of Attic and/or Crawlspace DATA for this location

These charts are to be used for a quick reference regarding the Attics and/or Crawlspaces inspection DATA within this facility. Contact OEMS prior to entering any attic or crawlspace within this facility and refer to the below chart and legend for Category Rank determination. The Data relative to these spaces is updated as conditions change regarding Abatement or Renovation activity on a case by case basis for each specific location and facility. In general, Crawlspaces are below the basement or 1<sup>st</sup> floor and Attics are above the floor space.

### *Category Rank Legend*

"A" - No Asbestos Containing Materials - Sample Results indicate NO ACM on pipes, fittings, elbows, or equipment located within this functional space, and NO VISIBLE DEBRIS or DAMAGE observed at time of this inspection.
"B" - Asbestos Containing Materials Exist - Sample Results indicate ACM on pipes, fittings, elbows, or equipment located within this functional space, HOWEVER, NO VISIBLE DEBRIS or DAMAGE observed at time of this inspection.
"C" - Asbestos Containing Materials Exist - Sample Results indicate ACM on pipes, fittings, elbows, or equipment located within this functional space, and LOCALIZED VISIBLE DEBRIS or DAMAGE observed at time of this inspection.
"D" - Asbestos Containing Materials Exist - Sample Results indicate ACM on pipes, fittings, elbows, or equipment located within this functional space and DISTRIBUTED VISIBLE DEBRIS or SIGNIFICANT DAMAGE observed at time of this inspection.
"E" - No Bulk Sample Results Available SUSPECT ACM OBSERVED. Contact OEMS immediately for additional instructions.

Attic/Crawlspace	Access Area	Floor Surface	Category Rank	Comments
Attic	X	X	X	No Attic
Crawlspace	X	X	X	No Crawlspace

## VII. Summary list of Pipe Chase/Pipe Shaft DATA for this location

These charts are to be used for a quick reference regarding the information known about the Pipe Chases and/or Pipe Shafts inspection DATA within this facility. Contact OEMS prior to performing renovation activities any Pipe Chase and/or Pipe Shaft within this facility and refer to the below chart and legend for Asbestos Content of various materials identified within each space. The Data relative to these spaces is updated as conditions change regarding Inspection, Abatement and/or Renovation activity on a case by case basis for each specific location and facility. In general, Pipe Chases are horizontal spaces and Pipe Shafts are vertical spaces.

<i>Element</i>	<i>Floor</i>	<i>On Site Room Name</i>	<i>Material</i>	<i>Confirmed /Assumed NAD/Non Suspect</i>	<i>Amount of Material</i>	<i>Amount of Damage</i>
1	LL	Pipe Chase inside B50 Elevator Mechanical Room	Cement Floor	Non Suspect ACM	100 SF	0
1	LL	Pipe Chase inside B50 Elevator Mechanical Room	Concrete Block Wall	Non Suspect ACM	300 SF	0
1	LL	Pipe Chase inside B50 Elevator Mechanical Room	Concrete Ceiling	Non Suspect ACM	100 SF	0
1	LL	Pipe Chase inside B50 Elevator Mechanical Room	Fiberglass Pipe Insulation	Non Suspect ACM	50 LF	0

**Section I**

**Report of Re-Inspection**

**A. Introduction**

**B. Three-Year Re-Inspection IX Overview**

**C. Post-Management Plan Activities and Changes**

**C.1 Sampling and Analysis**

**C.2 New Floor Tile Sampling**

**C.3 Abatement Activity**

**C.4 Periodic Six-Month Surveillance (Damaged Materials)**

## Section I - A

### Report of Re-inspection

#### Introduction

The Three-Year Re-inspection IX was performed to fulfill the requirements of 40 CFR Part 763 - the Asbestos Hazard Emergency Response Act (AHERA). As required by AHERA, each Local Education Agency (LEA) must re-inspect all known confirmed or assumed Asbestos Containing Building Material (ACBM) located in the LEA's facilities. This re-inspection is intended to update the original Asbestos Management Plan for the LEA's facilities.

Multiple Building Inspectors of several firms performed the 2015/2016 re-inspection. The re-inspection report/Management Plan of 2015-2016 were reviewed and prepared collectively by Management Planner Megan Vala, Mary Anne Lerro of Criterion Laboratories, Inc. and Monique Causley, of Synertech Inc.

All of the certificates can be found in Section III.

During the re-inspection of each School District of Philadelphia facility, all of the Management Plans for that facility were reviewed. Information from the conclusions section of that report is included in this report. Additionally, information on activities such as abatements, cleanings, sampling and inspections, which have taken place since the completion of the original Management Plan, were reviewed during the re-inspection. Information on those activities is included in this report.

As mandated by the U S EPA AHERA regulations, all future periodic Six-Month inspections and Three-Year Re-inspections of this location will be performed and the Inspection Data in this report will be updated accordingly.

## Section I - B

### **Three-Year Re-inspection IX Overview**

Each homogeneous area of Asbestos Containing Building Material (ACBM) listed in the original Management Plan or in the 1992, 1995, 1998, 2001, etc., Three-Year Re-inspection reports were inspected for the AHERA Three-Year Re-inspection Volume IX, and the information for that material verified. Any changes to a homogeneous area listed in the updates to the Management Plans were verified. Any area of suspected ACBM found in the course of the re-inspection, and not listed in the Management Plan or updates, were either assumed to contain asbestos or sampled and analyzed to determine their asbestos content. Any such new areas either assumed to contain asbestos or determined through analysis to contain asbestos were included in the report of the Three-Year Re-inspection. The results of the AHERA Three-Year Re-inspection IX are tabulated in the Room by Room log reports located in *Section II-C* of this report.

As previously noted, all future periodic Six-Month inspections and Three-Year Re-inspections of this location will be performed and the Inspection Data in this report will be updated accordingly.

## Section I – C.1

### **Post Management Plan Activities/Changes**

Information on activities affecting Asbestos Containing Building Materials (ACBMs) at this location is contained in updates to the Management Plan. These updates are kept on file by the School District of Philadelphia and were reviewed for this project. Updates to the Management Plan include the following: *Sampling and Analysis, New Tile Installation, Abatement Activity and Periodic Six-Month Surveillance Data.*

#### **Sampling and Analysis**

*In the event Sampling occurs, data will be listed here.*

## **Section I – C.2**

Information on the installation of new floor tiles/renovation activities affecting Asbestos Containing Building Materials (ACBMs) at this location is contained in updates to the Management Plan. These updates are kept on file by the School District of Philadelphia and were reviewed for this project. Updates to the Management Plan include the following:

### **New Floor Tile Sampling**

*In the event that new tile is installed, the material must be tested prior to installation.*

## **Section I – C.3**

Information on the Asbestos Abatement and renovation activities affecting Asbestos Containing Building Materials (ACBMs) at this location is contained in updates to the Management Plan. These updates are kept on file by the School District of Philadelphia and were reviewed for this project. Updates to the Management Plan include the following:

### **Abatement Activity**

*In the event Abatement occurs, data will be listed here.*

## Section I – C.4

Information on the AHERA inspection that noted damage to various Building Materials at this location is contained in updates to the Management Plan. These updates are kept on file by the School District of Philadelphia and were reviewed for this project. Work orders are created for Corrective Action responses and tracked for completion. Updates to the Management Plan include the following:

### *Periodic (Six-Month) Surveillance (Damaged Materials)*

<i>Date</i>	<i>Element</i>	<i>Floor</i>	<i>On Site Room Name</i>	<i>Material</i>	<i>Amount of Material</i>	<i>Amount of Damage</i>
11/1/2016	1	G	Hallway outside Classrooms 411-415 (4 Pod Hallway)	Floor Tile VAT 12" x 12"	4000 SF	50 SF
11/1/2016	1	Ex	Exterior - on underside of Upper Classroom Cantilevers	Fireproofing	5000 SF	50 SF

## **Section II**

### **Re-Inspection Data**

#### **A. Introduction**

#### **B. Re-Inspection Key Definitions**

#### **C. Room by Room Location Log Report**

## Section II - A

### Re-inspection Data

#### Introduction

The following information documents the Three-Year Re-inspection IX of the subject school/facility. The Homogeneous Area Reports were produced using the building inspector's field data on the facility. The key to the Homogeneous Area Report is outlined in the following pages of this report.

**Section II - B**  
**(page 1 of 4)**

**SCHOOL DISTRICT OF PHILADELPHIA**  
**AHERA THREE YEAR RE-INSPECTION IX**

<b>ITEM</b>	<b>DEFINITION</b>
<b>ULCS#</b>	Individual identification number assigned to each school within the School District of Philadelphia.
<b>HOMOGENEOUS AREA ID#</b>	Identification number assigned to each homogeneous area in a school/facility. Each section of the homogeneous area ID is significant.  1010/01/01/01 <b>A B C D</b>  <b>A.</b> Is the ULCS# for the school. <b>B.</b> Designates the specific building/building area within the school. <b>C.</b> Designates the floor or level within the building/building area. <b>D.</b> Designates the homogeneous material within that floor or level. Note: Item D may be a number or a letter.
<b>SYSTEM AFFECTED</b>	Corresponds to the AHERA system for classifying materials.  <b>T</b> : Thermal System <b>S</b> : Surfacing System <b>M</b> : Miscellaneous
<b>ITEM AFFECTED</b>	Is a description of the homogeneous material.
<b>ORIGINAL INSPECTION DATA</b>	This section contains the information found in the original Management Plan (1988-1989).
<b>AMOUNT OF MATERIAL/ UNIT</b>	Quantity of material, and measuring unit. Units include: Square Feet (SF) Each (EA) Linear Feet (LF) Cubic Feet (CF).

**SCHOOL DISTRICT OF PHILADELPHIA  
AHERA THREE YEAR RE-INSPECTION IX**

**RE-INSPECTION FORM KEY**

<b>ITEM</b>	<b>DEFINITION</b>
<b>CND Condition</b>	Corresponds to AHERA condition rating for materials.  <b>0</b> : No Damage <b>1</b> : Damage <b>2</b> : Significant Damage
<b>DP Damage Potential</b>	Corresponds to the AHERA material assessment system.  <b>1</b> : Potential for Damage <b>2</b> : Potential for Significant Damage
<b>ASMD Assumed Asbestos</b>	This means that a material was not sampled for asbestos content during the original Management Plan inspection.
<b>RA Response Action</b>	This corresponds to the AHERA system of response action rating for materials.  <b>1</b> : Establish O&M Program <b>2</b> : Repair and Establish O&M Program <b>3</b> : Enclose <b>4</b> : Encapsulate <b>5</b> : Remove <b>6</b> : Partial Removal and Establish O&M Program
<b>CHANGES</b>	This section describes changes to the homogeneous material in the twenty-four years since the original AHERA inspection. The abbreviations are defined below.  <b>RMVD</b> : Removed <b>ENCL</b> : Enclosed <b>ENCP</b> : Encapsulated <b>DMGD</b> : Damaged <b>SMPLD</b> : Sampled <b>MTRL</b> : Material <b>RPRD</b> : Repaired <b>N/L</b> : None Located <b>RPLCD</b> : Replaced

**SCHOOL DISTRICT OF PHILADELPHIA  
AHERA THREE-YEAR RE-INSPECTION IX**

**RE-INSPECTION FORM KEY**

<b>ITEM</b>	<b>DEFINITION</b>
<b>THREE YEAR RE-INSPECTION</b>	<p>This section contains the information obtained from the Three-Year Re-inspection IX. With three exceptions, the information categories are identical in format and meaning to those found in the original inspection data section. The three exceptions are defined below.</p>
<b>DMGD AMT Amount Damaged</b>	<p>This section gives the quantity of damaged material in a homogeneous area. The quantity is shown in the same format as the amount of material/unit section.</p>
<b>NF Newly Friable</b>	<p>This section identifies materials in the original Management Plan which have since become friable.</p>
<b>RA Response Action</b>	<p>This rating is based on the AHERA regulations, and is comparable to the RA rating found in the "Original Inspection Data" section. The following table details the response actions.</p> <ol style="list-style-type: none"><li>1. Establish O&amp;M Program</li><li>2. Repair and Establish O&amp;M Program</li><li>3. Enclose</li><li>4. Encapsulate</li><li>5. Remove</li><li>6. Partial Removal and Establish O&amp;M Program</li></ol> <ol style="list-style-type: none"><li>a. <b>High Priority Response</b> The homogeneous material has been scheduled for abatement or other response action.</li><li>b. <b>Medium Priority Response</b> The homogeneous material will be scheduled for abatement or other response action as soon as the high priority responses have been addressed.</li><li>c. <b>Low Priority Response</b> The homogeneous material will be scheduled for abatement or other response action as soon as the medium priority responses have been addressed.</li><li>d. <b>On-Going Response/Operations and Maintenance</b> The homogeneous material does not require abatement or other response action at present, and should be included in the facility's on-going operations and maintenance program.</li></ol>

**SCHOOL DISTRICT OF PHILADELPHIA  
AHERA THREE-YEAR RE-INSPECTION IX**

**RE-INSPECTION FORM KEY**

---

The information presented in the changes section has been compiled from a variety of sources, including the Re-inspection and the following:

- \* Quality Control/Quality Assurance Reports of asbestos abatement projects, prepared by consultants to the School District.
- \* Permit and Notification Forms for asbestos abatement projects.
- \* Periodic Surveillance Forms
- \* Operations and Maintenance activities performed by School District personnel.
- \* Verbal information from School District personnel.
- \* Reports of sampling and analysis of suspected materials by both School District personnel and outside consultants.

**ROOM BY  
ROOM  
LOCATION LOG  
REPORT**

This section gives information, including damage amount and location, for a specific homogeneous material on a room-by-room basis and follows the Re-inspection form.

*NOTE:* The disparate nature of the above sources of information prohibits the verification of much information within the scope of the AHERA Three-Year Re-inspection. Discrepancies and omissions may exist in this information, and therefore is included on an "as is" basis. The inspectors for the Three-Year Re-inspection IX evaluated homogeneous areas based on the materials current condition and location, as evidenced during the inspector's site visit.

## Section II - C

### Room by Room Location Log Report

These charts are to be used for a quick reference\* in order to avoid the unknowing disturbance of Asbestos Containing Materials during any and all Operations, Maintenance, Renovation, and/or Demolition activities at this location.

*NOTE:*

*Contact OEMS prior to the disturbance of any of the materials that are listed as **Confirmed and/or Assumed**.*

*The quantities listed for (NAD) non-asbestos containing materials and/or Non-Suspect Materials are only estimated and were not measured for the purpose of this report. Field verification of quantities for renovation purposes would be necessary.*

## 8140 Meehan MS 2015 2016 AHERA Three-Year Report.xls

		School District of Philadelphia Austin Meehan Middle School 3001 Ryan Avenue, Philadelphia, PA 19152 ULCS# 8140 Year Built: 1970		AHERA Three-Year Reinspection 2015-2016 Room by Room Location Log Report							Reinspection Date: October 28, 2015 Building Inspector: Bernard J Bryson Number: ACC-0125-6-031 Management Planner: Megan Vala Number: 740728					
E l e m e n t	F l o o r	On Site Room Name	System Affected	Material Description	HID#	Confirmed/Assumed/NAD/ Non Suspect ACM	Amount of Material	SF LF EA	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic/ Crawl Space Ranking	Damage Potential (DP)	Newly Friable (NF)	Response Action (RA)
1	LL	Auditorium	N/A	Carpet		Non Suspect ACM	3000	SF	0	SF				N/A	N/A	N/A
1	LL	Auditorium	N/A	Cement Floor		Non Suspect ACM	3000	SF	0	SF				N/A	N/A	N/A
1	LL	Auditorium	N/A	Concrete Block Wall		Non Suspect ACM	9000	SF	0	SF				N/A	N/A	N/A
1	LL	Auditorium	N/A	Concrete Ceiling		Non Suspect ACM	3000	SF	0	SF				N/A	N/A	N/A
1	LL	Auditorium Stage	N/A	Wood Floor		Non Suspect ACM	1000	SF	0	SF				N/A	N/A	N/A
1	LL	Auditorium Stage	N/A	Concrete Block Wall		Non Suspect ACM	3000	SF	0	SF				N/A	N/A	N/A
1	LL	Auditorium Stage	N/A	Concrete Ceiling		Non Suspect ACM	1000	SF	0	SF				N/A	N/A	N/A
1	LL	Auditorium Backstage	N/A	Wood Floor		Non Suspect ACM	1000	SF	0	SF				N/A	N/A	N/A
1	LL	Auditorium Backstage	N/A	Concrete Block Wall		Non Suspect ACM	3000	SF	0	SF				N/A	N/A	N/A
1	LL	Auditorium Backstage	N/A	Concrete Ceiling		Non Suspect ACM	1000	SF	0	SF				N/A	N/A	N/A
1	LL	Auditorium Backstage	N/A	Ceiling Tile 1' x 1'		NAD	500	SF	0	SF				N/A	N/A	N/A
1	LL	Music Room M01	M	Floor Tile VAT 12" x 12"	8140/01/LL/GG	Assumed	1200	SF	0	SF	Brown			1	No	1/D
1	LL	Music Room M01	N/A	Plaster Walls		NAD	3000	SF	0	SF				N/A	N/A	N/A
1	LL	Music Room M01	N/A	Concrete Ceiling		Non Suspect ACM	1200	SF	0	SF				N/A	N/A	N/A
1	LL	Music Room M01	N/A	Ceiling Tile 1' x 1'		NAD	600	SF	0	SF				N/A	N/A	N/A
1	LL	Music Room M01	M	Sink Undercoat Mastic	8140/01/LL/SYN/BB/2600	Assumed	8	SF	0	SF		1 Sink - 8 SF		1	No	1/D
1	LL	Music Room M01	M	Blackboard Glue Dots	8140/01/LL/SYN/BB/2600	Assumed	80	SF	0	SF		Blackboard/Tackboard		1	No	1/D
1	LL	Boy's Restroom	N/A	Ceramic Tile Floors		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A
1	LL	Boy's Restroom	N/A	Plaster Walls		NAD	600	SF	0	SF				N/A	N/A	N/A
1	LL	Boy's Restroom	N/A	Plaster Ceiling		NAD	200	SF	0	SF				N/A	N/A	N/A
1	LL	Boy's Restroom	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	1	LF	0	LF				N/A	N/A	N/A
1	LL	Girl's Restroom	N/A	Ceramic Tile Floors		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A
1	LL	Girl's Restroom	N/A	Plaster Walls		NAD	600	SF	0	SF				N/A	N/A	N/A
1	LL	Girl's Restroom	N/A	Plaster Ceiling		NAD	200	SF	0	SF				N/A	N/A	N/A
1	LL	Girl's Restroom	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	1	LF	0	LF				N/A	N/A	N/A
1	LL	Music Room M01 Office	M	Floor Tile VAT 12" x 12"	8140/01/LL/GG	Assumed	100	SF	0	SF	Brown			1	No	1/D
1	LL	Music Room M01 Office	N/A	Plaster Walls		NAD	300	SF	0	SF				N/A	N/A	N/A
1	LL	Music Room M01 Office	N/A	Plaster Ceiling		NAD	100	SF	0	SF				N/A	N/A	N/A
1	LL	Music Room M01 Hallway to Practice Rooms	M	Floor Tile VAT 12" x 12"	8140/01/LL/GG	Assumed	100	SF	0	SF	Brown			1	No	1/D
1	LL	Music Room M01 Hallway to Practice Rooms	N/A	Plaster Walls		NAD	300	SF	0	SF				N/A	N/A	N/A
1	LL	Music Room M01 Hallway to Practice Rooms	N/A	Plaster Ceiling		NAD	100	SF	0	SF				N/A	N/A	N/A
1	LL	Music Room M01 Practice Room	M	Floor Tile VAT 12" x 12"	8140/01/LL/GG	Assumed	100	SF	0	SF	Brown			1	No	1/D
1	LL	Music Room M01 Practice Room	N/A	Plaster Walls		NAD	300	SF	0	SF				N/A	N/A	N/A
1	LL	Music Room M01 Practice Room	N/A	Plaster Ceiling		NAD	100	SF	0	SF				N/A	N/A	N/A
1	LL	Music Room M01 Practice Room	M	Floor Tile VAT 12" x 12"	8140/01/LL/GG	Assumed	100	SF	0	SF	Brown			1	No	1/D
1	LL	Music Room M01 Practice Room	N/A	Plaster Walls		NAD	300	SF	0	SF				N/A	N/A	N/A
1	LL	Music Room M01 Practice Room	N/A	Plaster Ceiling		NAD	100	SF	0	SF				N/A	N/A	N/A
1	LL	Office M02	M	Floor Tile VAT 12" x 12"	8140/01/LL/GG	Assumed	300	SF	0	SF	Brown			1	No	1/D
1	LL	Office M02	N/A	Plaster Walls		NAD	900	SF	0	SF				N/A	N/A	N/A
1	LL	Office M02	N/A	Plaster Ceiling		NAD	300	SF	0	SF				N/A	N/A	N/A
1	LL	Custodial Closet M02A	N/A	Cement Floor		Non Suspect ACM	20	SF	0	SF				N/A	N/A	N/A
1	LL	Custodial Closet M02A	N/A	Concrete Block Wall		Non Suspect ACM	100	SF	0	SF				N/A	N/A	N/A
1	LL	Custodial Closet M02A	N/A	Concrete Ceiling		Non Suspect ACM	20	SF	0	SF				N/A	N/A	N/A
1	LL	Custodial Closet M02A	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	8	LF	0	LF				N/A	N/A	N/A
1	LL	Classroom N01	M	Floor Tile VAT 12" x 12"	8140/01/LL/GG	Assumed	900	SF	0	SF	Brown	Brown/Black		1	No	1/D
1	LL	Classroom N01	N/A	Plaster Walls		NAD	2700	SF	0	SF				N/A	N/A	N/A
1	LL	Classroom N01	N/A	Concrete Ceiling		Non Suspect ACM	900	SF	0	SF				N/A	N/A	N/A
1	LL	Classroom N01	N/A	Ceiling Tile 1' x 1'		NAD	450	SF	0	SF				N/A	N/A	N/A
1	LL	Classroom N01	M	Blackboard Glue Dots	8140/01/LL/SYN/BB/2600	Assumed	80	SF	0	SF		Blackboard/Tackboard		1	No	1/D
1	LL	Closet B31	M	Floor Tile VAT 12" x 12"	8140/01/LL/GG	Assumed	100	SF	0	SF	Brown			1	No	1/D
1	LL	Closet B31	N/A	Plaster Walls		NAD	300	SF	0	SF				N/A	N/A	N/A
1	LL	Closet B31	N/A	Plaster Ceiling		NAD	100	SF	0	SF				N/A	N/A	N/A
1	LL	Closet B32	M	Floor Tile VAT 12" x 12"	8140/01/LL/GG	Assumed	100	SF	0	SF	Brown			1	No	1/D
1	LL	Closet B32	N/A	Plaster Walls		NAD	300	SF	0	SF				N/A	N/A	N/A
1	LL	Closet B32	N/A	Plaster Ceiling		NAD	100	SF	0	SF				N/A	N/A	N/A
1	LL	Office N16A	N/A	Carpet		Non Suspect ACM	100	SF	0	SF				N/A	N/A	N/A
1	LL	Office N16A	N/A	Cement Floor		Non Suspect ACM	100	SF	0	SF				N/A	N/A	N/A
1	LL	Office N16A	N/A	Plaster Walls		NAD	300	SF	0	SF				N/A	N/A	N/A
1	LL	Office N16A	N/A	Plaster Ceiling		NAD	100	SF	0	SF				N/A	N/A	N/A
1	LL	Classroom N02	M	Floor Tile VAT 12" x 12"	8140/01/LL/GG	Assumed	700	SF	0	SF	Brown			1	No	1/D
1	LL	Classroom N02	N/A	Plaster Walls		NAD	2100	SF	0	SF				N/A	N/A	N/A
1	LL	Classroom N02	N/A	Concrete Ceiling		Non Suspect ACM	700	SF	0	SF				N/A	N/A	N/A
1	LL	Classroom N02	N/A	Ceiling Tile 1' x 1'		NAD	350	SF	0	SF				N/A	N/A	N/A
1	LL	Classroom N02	M	Blackboard Glue Dots	8140/01/LL/SYN/BB/2600	Assumed	80	SF	0	SF		Blackboard/Tackboard		1	No	1/D
1	LL	Classroom N03	M	Floor Tile VAT 12" x 12"	8140/01/LL/GG	Assumed	900	SF	0	SF	Brown			1	No	1/D
1	LL	Classroom N03	N/A	Plaster Walls		NAD	2700	SF	0	SF				N/A	N/A	N/A
1	LL	Classroom N03	N/A	Concrete Ceiling		Non Suspect ACM	900	SF	0	SF				N/A	N/A	N/A
1	LL	Classroom N03	N/A	Ceiling Tile 1' x 1'		NAD	450	SF	0	SF				N/A	N/A	N/A
1	LL	Classroom N03	M	Blackboard Glue Dots	8140/01/LL/SYN/BB/2600	Assumed	80	SF	0	SF		Blackboard/Tackboard		1	No	1/D
1	LL	Closet D35	N/A	Ceramic Tile Floors		Non Suspect ACM	100	SF	0	SF				N/A	N/A	N/A
1	LL	Closet D35	N/A	Plaster Walls		NAD	300	SF	0	SF				N/A	N/A	N/A
1	LL	Closet D35	N/A	Concrete Ceiling		Non Suspect ACM	100	SF	0	SF				N/A	N/A	N/A
1	LL	Closet D36	N/A	Ceramic Tile Floors		Non Suspect ACM	100	SF	0	SF				N/A	N/A	N/A
1	LL	Closet D36	N/A	Plaster Walls		NAD	300	SF	0	SF				N/A	N/A	N/A

## 8140 Meehan MS 2015 2016 AHERA Three-Year Report.xls

		School District of Philadelphia Austin Meehan Middle School 3001 Ryan Avenue, Philadelphia, PA 19152 ULCS# 8140 Year Built: 1970		AHERA Three-Year Reinspection 2015-2016 Room by Room Location Log Report							Reinspection Date: October 28, 2015 Building Inspector: Bernard J Bryson Number: ACC-0125-6-031 Management Planner: Megan Vala Number: 740728					
E l e m e n t	F l o o r	On Site Room Name	System Affected	Material Description	HID#	Confirmed/Assumed/NAD/ Non Suspect ACM	Amount of Material	SF LF EA	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic/ Crawl Space Ranking	Damage Potential (DP)	Newly Friable (NF)	Response Action (RA)
1	LL	Closet D36	N/A	Concrete Ceiling		Non Suspect ACM	100	SF	0	SF				N/A	N/A	N/A
1	LL	Music Room M05	N/A	Carpet		Non Suspect ACM	900	SF	0	SF				N/A	N/A	N/A
1	LL	Music Room M05	N/A	Cement Floor		Non Suspect ACM	900	SF	0	SF				N/A	N/A	N/A
1	LL	Music Room M05	N/A	Plaster Walls		NAD	2700	SF	0	SF				N/A	N/A	N/A
1	LL	Music Room M05	N/A	Concrete Ceiling		Non Suspect ACM	900	SF	0	SF				N/A	N/A	N/A
1	LL	Music Room M05	N/A	Ceiling Tile 1' x 1'		NAD	450	SF	0	SF				N/A	N/A	N/A
1	LL	Music Room M05	M	Blackboard Glue Dots	8140/01/LL/SYN/BB/2600	Assumed	80	SF	0	SF		Blackboard/Tackboard		1	No	1/D
1	LL	Music Room M05 Hallway to Practice Rooms	M	Floor Tile VAT 12" x 12"	8140/01/LL/GG	Assumed	100	SF	0	SF	Brown			1	No	1/D
1	LL	Music Room M05 Hallway to Practice Rooms	N/A	Plaster Walls		NAD	300	SF	0	SF				N/A	N/A	N/A
1	LL	Music Room M05 Hallway to Practice Rooms	N/A	Plaster Ceiling		NAD	100	SF	0	SF				N/A	N/A	N/A
1	LL	Office M06	M	Floor Tile VAT 12" x 12"	8140/01/LL/GG	Assumed	300	SF	0	SF	Brown			1	No	1/D
1	LL	Office M06	N/A	Plaster Walls		NAD	900	SF	0	SF				N/A	N/A	N/A
1	LL	Office M06	N/A	Plaster Ceiling		NAD	300	SF	0	SF				N/A	N/A	N/A
1	LL	Music Room M05 Practice Room	M	Floor Tile VAT 12" x 12"	8140/01/LL/GG	Assumed	100	SF	0	SF	Brown			1	No	1/D
1	LL	Music Room M05 Practice Room	N/A	Plaster Walls		NAD	300	SF	0	SF				N/A	N/A	N/A
1	LL	Music Room M05 Practice Room	N/A	Plaster Ceiling		NAD	100	SF	0	SF				N/A	N/A	N/A
1	LL	Music Room M05 Practice Room	M	Floor Tile VAT 12" x 12"	8140/01/LL/GG	Assumed	100	SF	0	SF	Brown			1	No	1/D
1	LL	Music Room M05 Practice Room	N/A	Plaster Walls		NAD	300	SF	0	SF				N/A	N/A	N/A
1	LL	Music Room M05 Practice Room	N/A	Plaster Ceiling		NAD	100	SF	0	SF				N/A	N/A	N/A
1	LL	Music Room M05 Practice Room	M	Floor Tile VAT 12" x 12"	8140/01/LL/GG	Assumed	100	SF	0	SF	Brown			1	No	1/D
1	LL	Music Room M05 Practice Room	N/A	Plaster Walls		NAD	300	SF	0	SF				N/A	N/A	N/A
1	LL	Music Room M05 Practice Room	N/A	Plaster Ceiling		NAD	100	SF	0	SF				N/A	N/A	N/A
1	LL	Music Room M05 Practice Room	N/A	Plaster Ceiling		NAD	100	SF	0	SF				N/A	N/A	N/A
1	LL	Music Room M05 Practice Room	N/A	Ceramic Tile Floors		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A
1	LL	Boy's Restroom	N/A	Plaster Walls		NAD	600	SF	0	SF				N/A	N/A	N/A
1	LL	Boy's Restroom	N/A	Plaster Ceiling		NAD	200	SF	0	SF				N/A	N/A	N/A
1	LL	Boy's Restroom	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	2	LF	0	LF				N/A	N/A	N/A
1	LL	Girl's Restroom	N/A	Ceramic Tile Floors		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A
1	LL	Girl's Restroom	N/A	Plaster Walls		NAD	600	SF	0	SF				N/A	N/A	N/A
1	LL	Girl's Restroom	N/A	Plaster Ceiling		NAD	200	SF	0	SF				N/A	N/A	N/A
1	LL	Girl's Restroom	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	2	LF	0	LF				N/A	N/A	N/A
1	LL	Custodial Closet M06A	N/A	Cement Floor		Non Suspect ACM	20	SF	0	SF				N/A	N/A	N/A
1	LL	Custodial Closet M06A	N/A	Concrete Block Wall		Non Suspect ACM	100	SF	0	SF				N/A	N/A	N/A
1	LL	Custodial Closet M06A	N/A	Concrete Ceiling		Non Suspect ACM	20	SF	0	SF				N/A	N/A	N/A
1	LL	Custodial Closet M06A	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	10	LF	0	LF				N/A	N/A	N/A
1	LL	Stairwell 2-B	N/A	Cement Floor		Non Suspect ACM	400	SF	0	SF				N/A	N/A	N/A
1	LL	Stairwell 2-B	N/A	Concrete Block Wall		Non Suspect ACM	1200	SF	0	SF				N/A	N/A	N/A
1	LL	Stairwell 2-B	N/A	Concrete Ceiling		Non Suspect ACM	400	SF	0	SF				N/A	N/A	N/A
1	LL	Stairwell 4-B	N/A	Cement Floor		Non Suspect ACM	400	SF	0	SF				N/A	N/A	N/A
1	LL	Stairwell 4-B	N/A	Concrete Block Wall		Non Suspect ACM	1200	SF	0	SF				N/A	N/A	N/A
1	LL	Stairwell 4-B	N/A	Concrete Ceiling		Non Suspect ACM	400	SF	0	SF				N/A	N/A	N/A
1	LL	Stairwell 3-B	N/A	Cement Floor		Non Suspect ACM	400	SF	0	SF				N/A	N/A	N/A
1	LL	Stairwell 3-B	N/A	Concrete Block Wall		Non Suspect ACM	1200	SF	0	SF				N/A	N/A	N/A
1	LL	Stairwell 3-B	N/A	Concrete Ceiling		Non Suspect ACM	400	SF	0	SF				N/A	N/A	N/A
1	LL	Power Technology Lab S01A	N/A	Cement Floor		Non Suspect ACM	1200	SF	0	SF				N/A	N/A	N/A
1	LL	Power Technology Lab S01A	N/A	Concrete Block Wall		Non Suspect ACM	3600	SF	0	SF				N/A	N/A	N/A
1	LL	Power Technology Lab S01A	N/A	Concrete Ceiling		Non Suspect ACM	1200	SF	0	SF				N/A	N/A	N/A
1	LL	Power Technology Lab S01A	N/A	Ceiling Tile 1' x 1'		NAD	600	SF	0	SF				N/A	N/A	N/A
1	LL	Power Technology Lab S01A	N/A	Vibration Damper Cloth		Non Suspect ACM	2	SF	0	SF		Black Vinyl VDC		N/A	N/A	N/A
1	LL	Power Technology Lab S01A	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	100	LF	0	LF				N/A	N/A	N/A
1	LL	Power Technology Lab S01A	M	Blackboard Glue Dots	8140/01/LL/SYN/BB/2600	Assumed	80	SF	0	SF		Blackboard/Tackboard		1	No	1/D
1	LL	Power Technology Lab S01A Office	N/A	Cement Floor		Non Suspect ACM	100	SF	0	SF				N/A	N/A	N/A
1	LL	Power Technology Lab S01A Office	N/A	Plaster Walls		NAD	300	SF	0	SF				N/A	N/A	N/A
1	LL	Power Technology Lab S01A Office	N/A	Plaster Ceiling		NAD	100	SF	0	SF				N/A	N/A	N/A
1	LL	Shop S02A Office	N/A	Cement Floor		Non Suspect ACM	100	SF	0	SF				N/A	N/A	N/A
1	LL	Shop S02A Office	N/A	Concrete Block Wall		Non Suspect ACM	300	SF	0	SF				N/A	N/A	N/A
1	LL	Shop S02A Office	N/A	Plaster Ceiling		NAD	100	SF	0	SF				N/A	N/A	N/A
1	LL	Shop S02A	N/A	Cement Floor		Non Suspect ACM	1800	SF	0	SF				N/A	N/A	N/A
1	LL	Shop S02A	N/A	Concrete Block Wall		Non Suspect ACM	5400	SF	0	SF				N/A	N/A	N/A
1	LL	Shop S02A	N/A	Concrete Ceiling		Non Suspect ACM	1800	SF	0	SF				N/A	N/A	N/A
1	LL	Shop S02A	N/A	Ceiling Tile 1' x 1'		NAD	900	SF	0	SF				N/A	N/A	N/A
1	LL	Shop S02A	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	100	LF	0	LF				N/A	N/A	N/A
1	LL	Shop S02A	M	Blackboard Glue Dots	8140/01/LL/SYN/BB/2600	Assumed	80	SF	0	SF		Blackboard/Tackboard		1	No	1/D
1	LL	Classroom S03	X	X		X	X	X	X	X		No Access		X	X	X
1	LL	Classroom S03 Office	X	X		X	X	X	X	X		No Access		X	X	X
1	LL	203A	X	X		X	X	X	X	X		No Access		X	X	X
1	LL	Office behind Elevator	N/A	Carpet		Non Suspect ACM	150	SF	0	SF				N/A	N/A	N/A
1	LL	Office behind Elevator	N/A	Cement Floor		Non Suspect ACM	150	SF	0	SF				N/A	N/A	N/A
1	LL	Office behind Elevator	N/A	Concrete Block Wall		Non Suspect ACM	450	SF	0	SF				N/A	N/A	N/A
1	LL	Office behind Elevator	N/A	Plaster Ceiling		NAD	150	SF	0	SF				N/A	N/A	N/A
1	LL	Elevator Mechanical Room	N/A	Cement Floor		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A
1	LL	Elevator Mechanical Room	N/A	Concrete Block Wall		Non Suspect ACM	600	SF	0	SF				N/A	N/A	N/A
1	LL	Elevator Mechanical Room	N/A	Concrete Ceiling		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A
1	LL	Pipe Chase inside B50 Elevator Mechanical Room	N/A	Cement Floor		Non Suspect ACM	100	SF	0	SF				N/A	N/A	N/A
1	LL	Pipe Chase inside B50 Elevator Mechanical Room	N/A	Concrete Block Wall		Non Suspect ACM	300	SF	0	SF				N/A	N/A	N/A

# 8140 Meehan MS 2015 2016 AHERA Three-Year Report.xls

		School District of Philadelphia Austin Meehan Middle School 3001 Ryan Avenue, Philadelphia, PA 19152 ULCS# 8140 Year Built: 1970		AHERA Three-Year Reinspection 2015-2016 Room by Room Location Log Report							Reinspection Date: October 28, 2015 Building Inspector: Bernard J Bryson Number: ACC-0125-6-031 Management Planner: Megan Vala Number: 740728					
E l e m e n t	F l o o r	On Site Room Name	System Affected	Material Description	HIB#	Confirmed/Assumed/NAD/ Non Suspect ACM	Amount of Material	SF LF EA	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic/ Crawl Space Ranking	Damage Potential (DP)	Newly Friable (NF)	Response Action (RA)
1	LL	Pipe Chase inside B50 Elevator Mechanical Room	N/A	Concrete Ceiling		Non Suspect ACM	100	SF	0	SF				N/A	N/A	N/A
1	LL	Pipe Chase inside B50 Elevator Mechanical Room	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	50	LF	0	LF				N/A	N/A	N/A
1	LL	Men's Restroom	N/A	Ceramic Tile Floors		Non Suspect ACM	50	SF	0	SF				N/A	N/A	N/A
1	LL	Men's Restroom	N/A	Plaster Walls		NAD	150	SF	0	SF				N/A	N/A	N/A
1	LL	Men's Restroom	N/A	Plaster Ceiling		NAD	50	SF	0	SF				N/A	N/A	N/A
1	LL	Women's Restroom	N/A	Ceramic Tile Floors		Non Suspect ACM	50	SF	0	SF				N/A	N/A	N/A
1	LL	Women's Restroom	N/A	Plaster Walls		NAD	100	SF	0	SF				N/A	N/A	N/A
1	LL	Women's Restroom	N/A	Plaster Ceiling		NAD	50	SF	0	SF				N/A	N/A	N/A
1	LL	S Pod Hallway/Music Wing Hallway	M	Floor Tile VAT 12" x 12"	8140/01/LL/GG	Assumed	1600	SF	0	SF	Brown	Includes H01, H02, H07 and half of H06		1	No	1/D
1	LL	S Pod Hallway/Music Wing Hallway	N/A	Concrete Block Wall		Non Suspect ACM	4800	SF	0	SF				N/A	N/A	N/A
1	LL	S Pod Hallway/Music Wing Hallway	N/A	Plaster Ceiling		NAD	1800	SF	0	SF				N/A	N/A	N/A
1	LL	A Pod Hallway	M	Floor Tile VAT 12" x 12"	8140/01/LL/GG	Assumed	1800	SF	0	SF	Brown	Includes H03, H04, H05, H10B, HB6A and half of H06		1	No	1/D
1	LL	A Pod Hallway	N/A	Concrete Block Wall		Non Suspect ACM	5400	SF	0	SF				N/A	N/A	N/A
1	LL	A Pod Hallway	N/A	Plaster Ceiling		NAD	1800	SF	0	SF				N/A	N/A	N/A
1	LL	Classroom A01	M	Floor Tile VAT 12" x 12"	8140/01/LL/GG	Assumed	1200	SF	0	SF	Brown			1	No	1/D
1	LL	Classroom A01	N/A	Plaster Walls		NAD	3600	SF	0	SF				N/A	N/A	N/A
1	LL	Classroom A01	N/A	Concrete Ceiling		Non Suspect ACM	1200	SF	0	SF				N/A	N/A	N/A
1	LL	Classroom A01	N/A	Ceiling Tile 1' x 1'		NAD	600	SF	0	SF				N/A	N/A	N/A
1	LL	Classroom A01	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	20	LF	0	LF				N/A	N/A	N/A
1	LL	Classroom A01	M	Blackboard Glue Dots	8140/01/LL/SYN/BB/2600	Assumed	80	SF	0	SF		Blackboard/Tackboard		1	No	1/D
1	LL	Classroom A02	M	Floor Tile VAT 12" x 12"	8140/01/LL/GG	Assumed	1800	SF	0	SF	Grey			1	No	1/D
1	LL	Classroom A02	N/A	Plaster Walls		NAD	5400	SF	0	SF				N/A	N/A	N/A
1	LL	Classroom A02	N/A	Concrete Ceiling		Non Suspect ACM	1800	SF	0	SF				N/A	N/A	N/A
1	LL	Classroom A02	N/A	Ceiling Tile 1' x 1'		NAD	900	SF	0	SF				N/A	N/A	N/A
1	LL	Classroom A02	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	80	LF	0	LF				N/A	N/A	N/A
1	LL	Classroom A02	M	Sink Undercoat Mastic	8140/01/LL/SYN/BB/2602	Assumed	16	SF	0	SF		2 Sinks - 8 SF EA		1	No	1/D
1	LL	Classroom A02	M	Blackboard Glue Dots	8140/01/LL/SYN/BB/2600	Assumed	80	SF	0	SF		Blackboard/Tackboard		1	No	1/D
1	LL	Classroom A03	M	Floor Tile VAT 12" x 12"	8140/01/LL/GG	Assumed	1200	SF	0	SF	Grey			1	No	1/D
1	LL	Classroom A03	N/A	Plaster Walls		NAD	3600	SF	0	SF				N/A	N/A	N/A
1	LL	Classroom A03	N/A	Concrete Ceiling		Non Suspect ACM	1200	SF	0	SF				N/A	N/A	N/A
1	LL	Classroom A03	N/A	Ceiling Tile 1' x 1'		NAD	600	SF	0	SF				N/A	N/A	N/A
1	LL	Classroom A03	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	100	LF	0	LF				N/A	N/A	N/A
1	LL	Classroom A03	M	Sink Undercoat Mastic	8140/01/LL/SYN/BB/2602	Assumed	16	SF	0	SF		2 Sinks - 8 SF EA		1	No	1/D
1	LL	Classroom A03	M	Blackboard Glue Dots	8140/01/LL/SYN/BB/2600	Assumed	80	SF	0	SF		Blackboard/Tackboard		1	No	1/D
1	LL	Office A18	M	Floor Tile VAT 12" x 12"	8140/01/LL/GG	Assumed	300	SF	0	SF	Brown			1	No	1/D
1	LL	Office A18	N/A	Plaster Walls		NAD	900	SF	0	SF				N/A	N/A	N/A
1	LL	Office A18	N/A	Plaster Ceiling		NAD	300	SF	0	SF				N/A	N/A	N/A
1	LL	Closet B21	M	Floor Tile VAT 12" x 12"	8140/01/LL/GG	Assumed	100	SF	0	SF	Grey			1	No	1/D
1	LL	Closet B21	N/A	Plaster Walls		NAD	300	SF	0	SF				N/A	N/A	N/A
1	LL	Closet B21	N/A	Plaster Ceiling		NAD	100	SF	0	SF				N/A	N/A	N/A
1	LL	Office B77A	M	Floor Tile VAT 12" x 12"	8140/01/LL/GG	Assumed	200	SF	0	SF	Grey			1	No	1/D
1	LL	Office B77A	N/A	Plaster Walls		NAD	600	SF	0	SF				N/A	N/A	N/A
1	LL	Office B77A	N/A	Plaster Ceiling		NAD	200	SF	0	SF				N/A	N/A	N/A
1	GD	Gymnasium Fan Room	N/A	Cement Floor		Non Suspect ACM	1250	SF	0	SF		Accessible from 600 Fitness Center		N/A	N/A	N/A
1	GD	Gymnasium Fan Room	N/A	Concrete Block Wall		Non Suspect ACM	3750	SF	0	SF				N/A	N/A	N/A
1	GD	Gymnasium Fan Room	N/A	Concrete Ceiling		Non Suspect ACM	1250	SF	0	SF		Corrugated Metal Ceiling with Steel Beam Supports		N/A	N/A	N/A
1	GD	Gymnasium Fan Room	S	Fireproofing	8140/01/0G/14	Confirmed	625	SF	0	SF				1	No	1/D
1	GD	Gymnasium Fan Room	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	150	LF	0	LF				N/A	N/A	N/A
1	GD	Gymnasium Fan Room	T	Pipe Fitting Insulation	8140/01/0G/06	Assumed	40	EA	0	EA				1	No	1/D
1	GD	Gymnasium Fan Room	T	Pipe Saddles	8140/01/0G/FF	Assumed	10	EA	0	EA				1	No	1/D
1	GD	Gymnasium Fan Room	N/A	Vibration Damper Cloth		Non Suspect ACM	50	SF	0	SF		Black Vinyl VDC		N/A	N/A	N/A
1	GD	Gymnasium Fitness Center	N/A	Wood Floor		Non Suspect ACM	1250	SF	0	SF				N/A	N/A	N/A
1	GD	Gymnasium Fitness Center	N/A	Concrete Block Wall		Non Suspect ACM	3750	SF	0	SF				N/A	N/A	N/A
1	GD	Gymnasium Fitness Center	N/A	Plaster Ceiling		NAD	1250	SF	0	SF				N/A	N/A	N/A
1	GD	Gymnasium Fitness Center Stairwell to Gymnasium Fan Room	N/A	Cement Floor		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A
1	GD	Gymnasium Fitness Center Stairwell to Gymnasium Fan Room	N/A	Concrete Block Wall		Non Suspect ACM	600	SF	0	SF				N/A	N/A	N/A
1	GD	Boiler Room	N/A	Plaster Ceiling		NAD	200	SF	0	SF				N/A	N/A	N/A
1	GD	Boiler Room	N/A	Cement Floor		Non Suspect ACM	1800	SF	0	SF				N/A	N/A	N/A
1	GD	Boiler Room	N/A	Concrete Block Wall		Non Suspect ACM	5400	SF	0	SF				N/A	N/A	N/A
1	GD	Boiler Room	N/A	Plaster Ceiling		NAD	1800	SF	0	SF				N/A	N/A	N/A
1	GD	Boiler Room	S	Fireproofing	8140/01/0G/14	Confirmed	1800	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	GD	Boiler Room	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	500	LF	0	LF				N/A	N/A	N/A
1	GD	Boiler Room	T	Pipe Fitting Insulation	8140/01/0G/06	Assumed	30	EA	0	EA		<6" Steam Piping		1	No	1/D
1	GD	Boiler Room	T	Pipe Saddles	8140/01/0G/FF	Assumed	40	EA	0	EA				1	No	1/D
1	GD	Boiler Room	T	Sectional Boilers	8140/01/0G/BB	Assumed	3	EA	0	EA				1	No	1/D
1	GD	Boiler Room	T	Tank Insulation	8140/01/GD/SYN/BB/0800	Assumed	75	SF	0	SF		Elevated Tank Near Ceiling - Labeled ACM		1	No	1/D
1	GD	Electric Room	N/A	Cement Floor		Non Suspect ACM	375	SF	0	SF				N/A	N/A	N/A
1	GD	Electric Room	N/A	Concrete Block Wall		Non Suspect ACM	1500	SF	0	SF				N/A	N/A	N/A
1	GD	Electric Room	N/A	Plaster Ceiling		NAD	375	SF	0	SF				N/A	N/A	N/A
1	GD	Electric Room	S	Fireproofing	8140/01/0G/14	Confirmed	375	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	GD	Electric Room	M	Transite	8140/01/GD/SYN/BB/2350	Assumed	150	SF	0	SF		Inside Transformer Switchboard		1	No	1/D
1	GD	Electric Room	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	10	LF	0	LF				N/A	N/A	N/A

## 8140 Meehan MS 2015 2016 AHERA Three-Year Report.xls

		School District of Philadelphia Austin Meehan Middle School 3001 Ryan Avenue, Philadelphia, PA 19152 ULCS# 8140 Year Built: 1970		AHERA Three-Year Reinspection 2015-2016 Room by Room Location Log Report							Reinspection Date: October 28, 2015 Building Inspector: Bernard J Bryson Number: ACC-0125-6-031 Management Planner: Megan Vala Number: 740728					
E l e m e n t	F l o o r	On Site Room Name	System Affected	Material Description	HID#	Confirmed/Assumed/NAD/ Non Suspect ACM	Amount of Material	SF LF EA	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic/ Crawl Space Ranking	Damage Potential (DP)	Newly Friable (NF)	Response Action (RA)
1	GD	Stairs to Boiler Room	N/A	Cement Floor		Non Suspect ACM	75	SF	0	SF				N/A	N/A	N/A
1	GD	Stairs to Boiler Room	N/A	Concrete Block Wall		Non Suspect ACM	225	SF	0	SF				N/A	N/A	N/A
1	GD	Stairs to Boiler Room	N/A	Plaster Ceiling		NAD	75	SF	0	SF				N/A	N/A	N/A
1	GD	Stairs to Boiler Room	S	Fireproofing	8140/01/0G/14	Confirmed	75	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	GD	Facilities Storage Area/Loading Dock	N/A	Cement Floor		Non Suspect ACM	600	SF	0	SF				N/A	N/A	N/A
1	GD	Facilities Storage Area/Loading Dock	N/A	Concrete Block Wall		Non Suspect ACM	1800	SF	0	SF				N/A	N/A	N/A
1	GD	Facilities Storage Area/Loading Dock	N/A	Plaster Ceiling		NAD	600	SF	0	SF				N/A	N/A	N/A
1	GD	Facilities Storage Area/Loading Dock	S	Fireproofing	8140/01/0G/14	Confirmed	600	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	GD	Facilities Storage Area/Loading Dock	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	30	LF	0	LF				N/A	N/A	N/A
1	GD	Closet B70A	M	Floor Tile VAT 12" x 12"	8140/01/0G/HH	Assumed	50	SF	0	SF	Brown			1	No	1/D
1	GD	Closet B70A	N/A	Concrete Block Wall		Non Suspect ACM	150	SF	0	SF				N/A	N/A	N/A
1	GD	Closet B70A	N/A	Plaster Ceiling		NAD	50	SF	0	SF				N/A	N/A	N/A
1	GD	Closet B70A	S	Fireproofing	8140/01/0G/14	Confirmed	50	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	GD	Storage Room B71	N/A	Cement Floor		Non Suspect ACM	150	SF	0	SF				N/A	N/A	N/A
1	GD	Storage Room B71	N/A	Concrete Block Wall		Non Suspect ACM	450	SF	0	SF				N/A	N/A	N/A
1	GD	Storage Room B71	N/A	Concrete Ceiling		Non Suspect ACM	150	SF	0	SF				N/A	N/A	N/A
1	GD	Storage Room B71	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	80	LF	0	LF				N/A	N/A	N/A
1	GD	Storage Room B71	T	Pipe Saddles	8140/01/0G/FF	Assumed	12	EA	0	EA				1	No	1/D
1	GD	Women's Locker Room	N/A	Cement Floor		Non Suspect ACM	100	SF	0	SF				N/A	N/A	N/A
1	GD	Women's Locker Room	N/A	Concrete Block Wall		Non Suspect ACM	300	SF	0	SF				N/A	N/A	N/A
1	GD	Women's Locker Room	N/A	Plaster Ceiling		NAD	100	SF	0	SF				N/A	N/A	N/A
1	GD	Women's Locker Room	S	Fireproofing	8140/01/0G/14	Confirmed	100	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	GD	Kitchen	M	Floor Tile VAT 12" x 12"	8140/01/0G/HH	Assumed	440	SF	0	SF	Brown			1	No	1/D
1	GD	Kitchen	N/A	Concrete Block Wall		Non Suspect ACM	1320	SF	0	SF				N/A	N/A	N/A
1	GD	Kitchen	N/A	Plaster Ceiling		NAD	440	SF	0	SF				N/A	N/A	N/A
1	GD	Kitchen	S	Fireproofing	8140/01/0G/14	Confirmed	440	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	GD	Building Engineer's Office	M	Floor Tile VAT 12" x 12"	8140/01/0G/HH	Assumed	100	SF	0	SF	Brown			1	No	1/D
1	GD	Building Engineer's Office	N/A	Concrete Block Wall		Non Suspect ACM	300	SF	0	SF				N/A	N/A	N/A
1	GD	Building Engineer's Office	N/A	Plaster Ceiling		NAD	100	SF	0	SF				N/A	N/A	N/A
1	GD	Building Engineer's Office	S	Fireproofing	8140/01/0G/14	Confirmed	100	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	GD	Hallway outside of Building Engineer's Office	M	Floor Tile VAT 12" x 12"	8140/01/0G/HH	Assumed	50	SF	0	SF	Brown			1	No	1/D
1	GD	Hallway outside of Building Engineer's Office	N/A	Concrete Block Wall		Non Suspect ACM	150	SF	0	SF				N/A	N/A	N/A
1	GD	Hallway outside of Building Engineer's Office	N/A	Plaster Ceiling		NAD	50	SF	0	SF				N/A	N/A	N/A
1	GD	Hallway outside of Building Engineer's Office	S	Fireproofing	8140/01/0G/14	Confirmed	50	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	GD	Kitchen Staff Locker Room	M	Floor Tile VAT 12" x 12"	8140/01/0G/HH	Assumed	40	SF	0	SF	Brown			1	No	1/D
1	GD	Kitchen Staff Locker Room	N/A	Concrete Block Wall		Non Suspect ACM	240	SF	0	SF				N/A	N/A	N/A
1	GD	Kitchen Staff Locker Room	N/A	Plaster Ceiling		NAD	80	SF	0	SF				N/A	N/A	N/A
1	GD	Kitchen Staff Locker Room	S	Fireproofing	8140/01/0G/14	Confirmed	80	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	GD	Kitchen Staff Restroom	M	Floor Tile VAT 12" x 12"	8140/01/0G/HH	Assumed	120	SF	0	SF	Brown			1	No	1/D
1	GD	Kitchen Staff Restroom	N/A	Concrete Block Wall		Non Suspect ACM	360	SF	0	SF				N/A	N/A	N/A
1	GD	Kitchen Staff Restroom	N/A	Plaster Ceiling		NAD	120	SF	0	SF				N/A	N/A	N/A
1	GD	Kitchen Staff Restroom	S	Fireproofing	8140/01/0G/14	Confirmed	120	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	GD	Men's Restroom	N/A	Cement Floor		Non Suspect ACM	120	SF	0	SF				N/A	N/A	N/A
1	GD	Men's Restroom	N/A	Concrete Block Wall		Non Suspect ACM	360	SF	0	SF				N/A	N/A	N/A
1	GD	Men's Restroom	N/A	Plaster Ceiling		NAD	120	SF	0	SF				N/A	N/A	N/A
1	GD	Men's Restroom	S	Fireproofing	8140/01/0G/14	Confirmed	120	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	GD	Hallway outside of Kitchen	N/A	Cement Floor		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A
1	GD	Hallway outside of Kitchen	N/A	Concrete Block Wall		Non Suspect ACM	600	SF	0	SF				N/A	N/A	N/A
1	GD	Hallway outside of Kitchen	N/A	Plaster Ceiling		NAD	200	SF	0	SF				N/A	N/A	N/A
1	GD	Hallway outside of Kitchen	S	Fireproofing	8140/01/0G/14	Confirmed	200	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	GD	Boy's Locker Room	M	Floor Tile VAT 12" x 12"	8140/01/0G/HH	Assumed	800	SF	0	SF	Brown			1	No	1/D
1	GD	Boy's Locker Room	N/A	Concrete Block Wall		Non Suspect ACM	2400	SF	0	SF				N/A	N/A	N/A
1	GD	Boy's Locker Room	N/A	Plaster Ceiling		NAD	800	SF	0	SF				N/A	N/A	N/A
1	GD	Boy's Locker Room	S	Fireproofing	8140/01/0G/14	Confirmed	800	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	GD	Boy's Locker Room Shower Area	N/A	Cement Floor		Non Suspect ACM	600	SF	0	SF				N/A	N/A	N/A
1	GD	Boy's Locker Room Shower Area	N/A	Concrete Block Wall		Non Suspect ACM	1800	SF	0	SF				N/A	N/A	N/A
1	GD	Boy's Locker Room Shower Area	N/A	Plaster Ceiling		NAD	600	SF	0	SF				N/A	N/A	N/A
1	GD	Boy's Locker Room Shower Area	S	Fireproofing	8140/01/0G/14	Confirmed	600	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	GD	Boy's Locker Room Closet	N/A	Cement Floor		Non Suspect ACM	80	SF	0	SF				N/A	N/A	N/A
1	GD	Boy's Locker Room Closet	N/A	Concrete Block Wall		Non Suspect ACM	240	SF	0	SF				N/A	N/A	N/A
1	GD	Boy's Locker Room Closet	N/A	Plaster Ceiling		NAD	80	SF	0	SF				N/A	N/A	N/A
1	GD	Boy's Locker Room Closet	S	Fireproofing	8140/01/0G/14	Confirmed	80	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	GD	Boy's Locker Room Closet	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	2	LF	0	LF				N/A	N/A	N/A
1	GD	Stairwell inside Boy's Locker Room	N/A	Cement Floor		Non Suspect ACM	400	SF	0	SF				N/A	N/A	N/A
1	GD	Stairwell inside Boy's Locker Room	N/A	Concrete Block Wall		Non Suspect ACM	1200	SF	0	SF				N/A	N/A	N/A
1	GD	Stairwell inside Boy's Locker Room	N/A	Concrete Ceiling		Non Suspect ACM	400	SF	0	SF				N/A	N/A	N/A
1	GD	Gymnasium	N/A	Wood Floor		Non Suspect ACM	7200	SF	0	SF				N/A	N/A	N/A
1	GD	Gymnasium	N/A	Concrete Block Wall		Non Suspect ACM	28800	SF	0	SF				N/A	N/A	N/A
1	GD	Gymnasium	N/A	Concrete Ceiling		Non Suspect ACM	7200	SF	0	SF		Corrugated Metal Ceiling with Steel Beam Supports		N/A	N/A	N/A
1	GD	Gymnasium	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	30	LF	0	LF				N/A	N/A	N/A
1	GD	Men's Gym Teacher Restroom	N/A	Ceramic Tile Floors		Non Suspect ACM	75	SF	0	SF				N/A	N/A	N/A
1	GD	Men's Gym Teacher Restroom	N/A	Concrete Block Wall		Non Suspect ACM	225	SF	0	SF				N/A	N/A	N/A
1	GD	Men's Gym Teacher Restroom	N/A	Plaster Ceiling		NAD	75	SF	0	SF				N/A	N/A	N/A
1	GD	Men's Gym Teacher Restroom	S	Fireproofing	8140/01/0G/14	Confirmed	75	SF	0	SF		Above Plaster Ceiling		1	No	1/D

## 8140 Meehan MS 2015 2016 AHERA Three-Year Report.xls

		School District of Philadelphia Austin Meehan Middle School 3001 Ryan Avenue, Philadelphia, PA 19152 ULCS# 8140 Year Built: 1970		AHERA Three-Year Reinspection 2015-2016 Room by Room Location Log Report							Reinspection Date: October 28, 2015 Building Inspector: Bernard J Bryson Number: ACC-0125-6-031 Management Planner: Megan Vala Number: 740728					
E l e m e n t	F l o o r	On Site Room Name	System Affected	Material Description	HID#	Confirmed/Assumed/NAD/ Non Suspect ACM	Amount of Material	SF LF EA	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic/ Crawl Space Ranking	Damage Potential (DP)	Newly Friable (NF)	Response Action (RA)
1	GD	Men's Gym Teacher Office	M	Floor Tile VAT 12" x 12"	8140/01/0G/HH	Assumed	200	SF	0	SF	Brown		1	No	1/D	
1	GD	Men's Gym Teacher Office	N/A	Concrete Block Wall		Non Suspect ACM	600	SF	0	SF			N/A	N/A	N/A	
1	GD	Men's Gym Teacher Office	N/A	Plaster Ceiling		NAD	200	SF	0	SF			N/A	N/A	N/A	
1	GD	Men's Gym Teacher Office	S	Fireproofing	8140/01/0G/14	Confirmed	200	SF	0	SF		Above Plaster Ceiling	1	No	1/D	
1	GD	Boy's Gymnasium Restroom	N/A	Ceramic Tile Floors		Non Suspect ACM	100	SF	0	SF		Includes B57 and B57A	N/A	N/A	N/A	
1	GD	Boy's Gymnasium Restroom	N/A	Concrete Block Wall		Non Suspect ACM	300	SF	0	SF			N/A	N/A	N/A	
1	GD	Boy's Gymnasium Restroom	N/A	Plaster Ceiling		NAD	100	SF	0	SF			N/A	N/A	N/A	
1	GD	Boy's Gymnasium Restroom	S	Fireproofing	8140/01/0G/14	Confirmed	100	SF	0	SF		Above Plaster Ceiling	1	No	1/D	
1	GD	Boy's Gymnasium Closet	N/A	Cement Floor		Non Suspect ACM	150	SF	0	SF			N/A	N/A	N/A	
1	GD	Boy's Gymnasium Closet	N/A	Concrete Block Wall		Non Suspect ACM	450	SF	0	SF			N/A	N/A	N/A	
1	GD	Boy's Gymnasium Closet	N/A	Corrugated Metal Ceiling		Non Suspect ACM	150	SF	0	SF			N/A	N/A	N/A	
1	GD	Boy's Gymnasium Closet	S	Fireproofing	8140/01/0G/14	Confirmed	75	SF	0	SF			1	No	1/D	
1	GD	Boy's Gymnasium Closet	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	25	LF	0	LF			N/A	N/A	N/A	
1	GD	Women's Gym Teacher Restroom	N/A	Ceramic Tile Floors		Non Suspect ACM	75	SF	0	SF			N/A	N/A	N/A	
1	GD	Women's Gym Teacher Restroom	N/A	Concrete Block Wall		Non Suspect ACM	225	SF	0	SF			N/A	N/A	N/A	
1	GD	Women's Gym Teacher Restroom	N/A	Plaster Ceiling		NAD	75	SF	0	SF			N/A	N/A	N/A	
1	GD	Women's Gym Teacher Restroom	S	Fireproofing	8140/01/0G/14	Confirmed	75	SF	0	SF		Above Plaster Ceiling	1	No	1/D	
1	GD	Women's Gym Teacher Office	M	Floor Tile VAT 12" x 12"	8140/01/0G/HH	Assumed	150	SF	0	SF	Brown		1	No	1/D	
1	GD	Women's Gym Teacher Office	N/A	Concrete Block Wall		Non Suspect ACM	450	SF	0	SF			N/A	N/A	N/A	
1	GD	Women's Gym Teacher Office	N/A	Plaster Ceiling		NAD	150	SF	0	SF			N/A	N/A	N/A	
1	GD	Women's Gym Teacher Office	S	Fireproofing	8140/01/0G/14	Confirmed	150	SF	0	SF		Above Plaster Ceiling	1	No	1/D	
1	GD	Women's Gym Custodial Closet	N/A	Cement Floor		Non Suspect ACM	50	SF	0	SF			N/A	N/A	N/A	
1	GD	Women's Gym Custodial Closet	N/A	Concrete Block Wall		Non Suspect ACM	150	SF	0	SF			N/A	N/A	N/A	
1	GD	Women's Gym Custodial Closet	N/A	Plaster Ceiling		NAD	50	SF	0	SF			N/A	N/A	N/A	
1	GD	Women's Gym Custodial Closet	S	Fireproofing	8140/01/0G/14	Confirmed	50	SF	0	SF		Above Plaster Ceiling	1	No	1/D	
1	GD	Women's Gym Custodial Closet	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	20	LF	0	LF			N/A	N/A	N/A	
1	GD	Girls Gymnasium Restroom	N/A	Ceramic Tile Floors		Non Suspect ACM	100	SF	0	SF		Includes B39 and B39A	N/A	N/A	N/A	
1	GD	Girls Gymnasium Restroom	N/A	Concrete Block Wall		Non Suspect ACM	300	SF	0	SF			N/A	N/A	N/A	
1	GD	Girls Gymnasium Restroom	N/A	Plaster Ceiling		NAD	100	SF	0	SF			N/A	N/A	N/A	
1	GD	Girls Gymnasium Restroom	S	Fireproofing	8140/01/0G/14	Confirmed	100	SF	0	SF		Above Plaster Ceiling	1	No	1/D	
1	GD	Girls Gymnasium Restroom	M	Blackboard Glue Dots	8140/01/GD/SYNBB/2600	Assumed	20	SF	0	SF		Blackboard/Tackboard	1	No	1/D	
1	GD	Girls Gymnasium Closet	N/A	Cement Floor		Non Suspect ACM	150	SF	0	SF			N/A	N/A	N/A	
1	GD	Girls Gymnasium Closet	N/A	Concrete Block Wall		Non Suspect ACM	450	SF	0	SF			N/A	N/A	N/A	
1	GD	Girls Gymnasium Closet	N/A	Corrugated Metal Ceiling		Non Suspect ACM	150	SF	0	SF			N/A	N/A	N/A	
1	GD	Girls Gymnasium Closet	S	Fireproofing	8140/01/0G/14	Confirmed	75	SF	0	SF			1	No	1/D	
1	GD	Girls Gymnasium Closet	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	35	LF	0	LF			N/A	N/A	N/A	
1	GD	Stairwell inside Girls Locker Room	N/A	Cement Floor		Non Suspect ACM	400	SF	0	SF			N/A	N/A	N/A	
1	GD	Stairwell inside Girls Locker Room	N/A	Concrete Block Wall		Non Suspect ACM	1200	SF	0	SF			N/A	N/A	N/A	
1	GD	Stairwell inside Girls Locker Room	N/A	Concrete Ceiling		Non Suspect ACM	400	SF	0	SF			N/A	N/A	N/A	
1	GD	Girls Locker Room	M	Floor Tile VAT 12" x 12"	8140/01/0G/HH	Assumed	800	SF	0	SF	Brown		1	No	1/D	
1	GD	Girls Locker Room	N/A	Concrete Block Wall		Non Suspect ACM	2400	SF	0	SF			N/A	N/A	N/A	
1	GD	Girls Locker Room	N/A	Plaster Ceiling		NAD	800	SF	0	SF			N/A	N/A	N/A	
1	GD	Girls Locker Room	S	Fireproofing	8140/01/0G/14	Confirmed	800	SF	0	SF		Above Plaster Ceiling	1	No	1/D	
1	GD	Girls Locker Room Shower Area	N/A	Cement Floor		Non Suspect ACM	600	SF	0	SF		Includes B35 and B34	N/A	N/A	N/A	
1	GD	Girls Locker Room Shower Area	N/A	Concrete Block Wall		Non Suspect ACM	1800	SF	0	SF			N/A	N/A	N/A	
1	GD	Girls Locker Room Shower Area	N/A	Plaster Ceiling		NAD	600	SF	0	SF			N/A	N/A	N/A	
1	GD	Girls Locker Room Shower Area	S	Fireproofing	8140/01/0G/14	Confirmed	600	SF	0	SF		Above Plaster Ceiling	1	No	1/D	
1	GD	Hallway outside of Gymnasium	M	Floor Tile VAT 12" x 12"	8140/01/0G/HH	Assumed	1800	SF	0	SF	Brown	Includes B45A, B45B & B46A	1	No	1/D	
1	GD	Hallway outside of Gymnasium	N/A	Concrete Block Wall		Non Suspect ACM	5400	SF	0	SF			N/A	N/A	N/A	
1	GD	Hallway outside of Gymnasium	N/A	Concrete Ceiling		Non Suspect ACM	1800	SF	0	SF			N/A	N/A	N/A	
1	GD	Left Fenced Storage Room in Hallway outside of Gymnasium	M	Floor Tile VAT 12" x 12"	8140/01/0G/HH	Assumed	150	SF	0	SF	Brown		1	No	1/D	
1	GD	Left Fenced Storage Room in Hallway outside of Gymnasium	N/A	Concrete Block Wall		Non Suspect ACM	150	SF	0	SF			N/A	N/A	N/A	
1	GD	Left Fenced Storage Room in Hallway outside of Gymnasium	N/A	Concrete Ceiling		Non Suspect ACM	150	SF	0	SF			N/A	N/A	N/A	
1	GD	Right Fenced Storage Room in Hallway outside of Gymnasium	M	Floor Tile VAT 12" x 12"	8140/01/0G/HH	Assumed	150	SF	0	SF	Brown		1	No	1/D	
1	GD	Right Fenced Storage Room in Hallway outside of Gymnasium	N/A	Concrete Block Wall		Non Suspect ACM	150	SF	0	SF			N/A	N/A	N/A	
1	GD	Right Fenced Storage Room in Hallway outside of Gymnasium	N/A	Concrete Ceiling		Non Suspect ACM	150	SF	0	SF			N/A	N/A	N/A	
1	GD	Stairwell 3-B	N/A	Cement Floor		Non Suspect ACM	400	SF	0	SF			N/A	N/A	N/A	
1	GD	Stairwell 3-B	N/A	Concrete Block Wall		Non Suspect ACM	1200	SF	0	SF			N/A	N/A	N/A	
1	GD	Stairwell 3-B	N/A	Concrete Ceiling		Non Suspect ACM	400	SF	0	SF			N/A	N/A	N/A	
1	GD	School Store B45	N/A	Carpet		Non Suspect ACM	150	SF	0	SF		Floor Tile Below?	N/A	N/A	N/A	
1	GD	School Store B45	N/A	Plaster Walls		NAD	450	SF	0	SF			N/A	N/A	N/A	
1	GD	School Store B45	N/A	Plaster Ceiling		NAD	150	SF	0	SF			N/A	N/A	N/A	
1	GD	School Store B45	S	Fireproofing	8140/01/0G/14	Confirmed	150	SF	0	SF		Above Plaster Ceiling	1	No	1/D	
1	GD	Teacher's Lounge	M	Floor Tile VAT 12" x 12"	8140/01/0G/HH	Assumed	500	SF	0	SF	Brown		1	No	1/D	
1	GD	Teacher's Lounge	N/A	Plaster Walls		NAD	1500	SF	0	SF			N/A	N/A	N/A	
1	GD	Teacher's Lounge	N/A	Plaster Ceiling		NAD	500	SF	0	SF			N/A	N/A	N/A	
1	GD	Teacher's Lounge	S	Fireproofing	8140/01/0G/14	Confirmed	500	SF	0	SF		Above Plaster Ceiling	1	No	1/D	
1	GD	Teacher's Lounge	M	Sink Undercoat Mastic	8140/01/GD/SYNBB/2602	Assumed	8	SF	0	SF		1 Sink - 8 SF	1	No	1/D	
1	GD	Women's Staff Restroom	N/A	Ceramic Tile Floors		Non Suspect ACM	50	SF	0	SF			N/A	N/A	N/A	

## 8140 Meehan MS 2015 2016 AHERA Three-Year Report.xls

		School District of Philadelphia Austin Meehan Middle School 3001 Ryan Avenue, Philadelphia, PA 19152 ULCS# 8140 Year Built: 1970		AHERA Three-Year Reinspection 2015-2016 Room by Room Location Log Report							Reinspection Date: October 28, 2015 Building Inspector: Bernard J Bryson Number: ACC-0125-6-031 Management Planner: Megan Vala Number: 740728					
E l e m e n t	F l o o r	On Site Room Name	System Affected	Material Description	HID#	Confirmed/Assumed/NAD/ Non Suspect ACM	Amount of Material	SF LF EA	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic/ Crawl Space Ranking	Damage Potential (DP)	Newly Friable (NF)	Response Action (RA)
1	GD	Women's Staff Restroom	N/A	Plaster Walls		NAD	150	SF	0	SF				N/A	N/A	N/A
1	GD	Women's Staff Restroom	N/A	Plaster Ceiling		NAD	50	SF	0	SF				N/A	N/A	N/A
1	GD	Women's Staff Restroom	S	Fireproofing	8140/01/0G/14	Confirmed	50	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	GD	Men's Staff Restroom	N/A	Ceramic Tile Floors		Non Suspect ACM	50	SF	0	SF				N/A	N/A	N/A
1	GD	Men's Staff Restroom	N/A	Plaster Walls		NAD	150	SF	0	SF				N/A	N/A	N/A
1	GD	Men's Staff Restroom	N/A	Plaster Ceiling		NAD	50	SF	0	SF				N/A	N/A	N/A
1	GD	Men's Staff Restroom	S	Fireproofing	8140/01/0G/14	Confirmed	50	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	GD	Closet between B47W and B48M	N/A	Cement Floor		Non Suspect ACM	50	SF	0	SF				N/A	N/A	N/A
1	GD	Closet between B47W and B48M	N/A	Plaster Walls		NAD	150	SF	0	SF				N/A	N/A	N/A
1	GD	Closet between B47W and B48M	N/A	Concrete Ceiling		Non Suspect ACM	50	SF	0	SF				N/A	N/A	N/A
1	GD	Closet between B47W and B48M	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	40	LF	0	LF				N/A	N/A	N/A
1	GD	Library Fan Room	N/A	Cement Floor		Non Suspect ACM	2000	SF	0	SF		Accessible from 600 Fitness Center		N/A	N/A	N/A
1	GD	Library Fan Room	N/A	Concrete Block Wall		Non Suspect ACM	6000	SF	0	SF				N/A	N/A	N/A
1	GD	Library Fan Room	N/A	Concrete Ceiling		Non Suspect ACM	2000	SF	0	SF		Corrugated Metal Ceiling with Steel Beam Supports		N/A	N/A	N/A
1	GD	Library Fan Room	S	Fireproofing	8140/01/0G/14	Confirmed	1000	SF	0	SF				1	No	1/D
1	GD	Library Fan Room	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	300	LF	0	LF				N/A	N/A	N/A
1	GD	Library Fan Room	T	Pipe Fitting Insulation	8140/01/0G/06	Assumed	100	EA	0	EA				1	No	1/D
1	GD	Library Fan Room	T	Pipe Saddles	8140/01/0G/FF	Assumed	40	EA	0	EA				1	No	1/D
1	GD	Library Fan Room	N/A	Vibration Damper Cloth		Non Suspect ACM	100	SF	0	SF		Black Vinyl VDC		N/A	N/A	N/A
1	GD	Library Fan Room	N/A	Fiberglass Duct Insulation		Non Suspect ACM	1000	SF	0	SF				N/A	N/A	N/A
1	GD	Stairwell 1-B	N/A	Cement Floor		Non Suspect ACM	400	SF	0	SF				N/A	N/A	N/A
1	GD	Stairwell 1-B	N/A	Concrete Block Wall		Non Suspect ACM	1200	SF	0	SF				N/A	N/A	N/A
1	GD	Stairwell 1-B	N/A	Concrete Ceiling		Non Suspect ACM	400	SF	0	SF				N/A	N/A	N/A
1	GD	1 Pod Hallway/Visitor's Entrance Vestibule	M	Floor Tile VAT 12" x 12"	8140/01/0G/HH	Assumed	4000	SF	0	SF	Pink	Includes H119, H119A, A94, H119B, H1A, H1B, H17, H18B & H19		1	No	1/D
1	GD	1 Pod Hallway/Visitor's Entrance Vestibule	N/A	Plaster Walls		NAD	12000	SF	0	SF				N/A	N/A	N/A
1	GD	1 Pod Hallway/Visitor's Entrance Vestibule	N/A	Concrete Ceiling		Non Suspect ACM	1600	SF	0	SF				N/A	N/A	N/A
1	GD	1 Pod Hallway/Visitor's Entrance Vestibule	N/A	Ceiling Tile 1' x 1'		NAD	800	SF	0	SF				N/A	N/A	N/A
1	GD	1 Pod Hallway/Visitor's Entrance Vestibule	N/A	Plaster Ceiling		NAD	2400	SF	0	SF				N/A	N/A	N/A
1	GD	1 Pod Hallway/Visitor's Entrance Vestibule	S	Fireproofing	8140/01/0G/14	Confirmed	2400	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	GD	Hallway behind Auditorium (between 1 Pod & 4 Pod)	M	Floor Tile VAT 12" x 12"	8140/01/0G/HH	Assumed	900	SF	0	SF	Pink	Includes H11 and H10		1	No	1/D
1	GD	Hallway behind Auditorium (between 1 Pod & 4 Pod)	N/A	Plaster Walls		NAD	2700	SF	0	SF				N/A	N/A	N/A
1	GD	Hallway behind Auditorium (between 1 Pod & 4 Pod)	N/A	Plaster Ceiling		NAD	900	SF	0	SF				N/A	N/A	N/A
1	GD	Hallway behind Auditorium (between 1 Pod & 4 Pod)	S	Fireproofing	8140/01/0G/14	Confirmed	900	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	GD	2 Pod Hallway	M	Floor Tile VAT 12" x 12"	8140/01/0G/HH	Assumed	2600	SF	0	SF	Pink	Includes H112, H112A, H112B, A95, H2A, H2B & J1		1	No	1/D
1	GD	2 Pod Hallway	N/A	Plaster Walls		NAD	7800	SF	0	SF				N/A	N/A	N/A
1	GD	2 Pod Hallway	N/A	Concrete Ceiling		Non Suspect ACM	1600	SF	0	SF				N/A	N/A	N/A
1	GD	2 Pod Hallway	N/A	Ceiling Tile 1' x 1'		NAD	800	SF	0	SF				N/A	N/A	N/A
1	GD	2 Pod Hallway	N/A	Plaster Ceiling		NAD	1000	SF	0	SF				N/A	N/A	N/A
1	GD	2 Pod Hallway	S	Fireproofing	8140/01/0G/14	Confirmed	1000	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	GD	3 Pod Hallway	M	Floor Tile VAT 12" x 12"	8140/01/0G/HH	Assumed	2600	SF	0	SF	Pink	Includes H111, H111A, H111B, A96, H3A & H3B		1	No	1/D
1	GD	3 Pod Hallway	N/A	Plaster Walls		NAD	7800	SF	0	SF				N/A	N/A	N/A
1	GD	3 Pod Hallway	N/A	Concrete Ceiling		Non Suspect ACM	1600	SF	0	SF				N/A	N/A	N/A
1	GD	3 Pod Hallway	N/A	Ceiling Tile 1' x 1'		NAD	800	SF	0	SF				N/A	N/A	N/A
1	GD	3 Pod Hallway	N/A	Plaster Ceiling		NAD	1000	SF	0	SF				N/A	N/A	N/A
1	GD	3 Pod Hallway	S	Fireproofing	8140/01/0G/14	Confirmed	1000	SF	0	SF		Above Plaster Ceiling Includes H110, H110A, H18, A97M, H18A, H4A, H4B, H12, H13 & J2 - Tiles are cracking along what appears to be a shifting concrete floor slab		1	No	1/D
1	GD	4 Pod Hallway	M	Floor Tile VAT 12" x 12"	8140/01/0G/HH	Assumed	4000	SF	50	SF	Pink			1	Yes	5/B
1	GD	4 Pod Hallway	N/A	Plaster Walls		NAD	12000	SF	0	SF				N/A	N/A	N/A
1	GD	4 Pod Hallway	N/A	Concrete Ceiling		Non Suspect ACM	1600	SF	0	SF				N/A	N/A	N/A
1	GD	4 Pod Hallway	N/A	Ceiling Tile 1' x 1'		NAD	800	SF	0	SF				N/A	N/A	N/A
1	GD	4 Pod Hallway	N/A	Plaster Ceiling		NAD	2400	SF	0	SF				N/A	N/A	N/A
1	GD	4 Pod Hallway	S	Fireproofing	8140/01/0G/14	Confirmed	2400	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	GD	Office 101	M	Floor Tile VAT 12" x 12"	8140/01/0G/HH	Assumed	100	SF	0	SF	Brown			1	No	1/D
1	GD	Office 101	N/A	Plaster Walls		NAD	300	SF	0	SF				N/A	N/A	N/A
1	GD	Office 101	N/A	Plaster Ceiling		NAD	100	SF	0	SF				N/A	N/A	N/A
1	GD	Office 101	S	Fireproofing	8140/01/0G/14	Confirmed	100	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	GD	Office 102	M	Floor Tile VAT 12" x 12"	8140/01/0G/HH	Assumed	100	SF	0	SF	Brown			1	No	1/D
1	GD	Office 102	N/A	Plaster Walls		NAD	300	SF	0	SF				N/A	N/A	N/A
1	GD	Office 102	N/A	Plaster Ceiling		NAD	100	SF	0	SF				N/A	N/A	N/A
1	GD	Office 102	S	Fireproofing	8140/01/0G/14	Confirmed	100	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	GD	Office 103	M	Floor Tile VAT 12" x 12"	8140/01/0G/HH	Assumed	100	SF	0	SF	Brown			1	No	1/D
1	GD	Office 103	N/A	Plaster Walls		NAD	300	SF	0	SF				N/A	N/A	N/A
1	GD	Office 103	N/A	Plaster Ceiling		NAD	100	SF	0	SF				N/A	N/A	N/A
1	GD	Office 103	S	Fireproofing	8140/01/0G/14	Confirmed	100	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	GD	Office 104	M	Floor Tile VAT 12" x 12"	8140/01/0G/HH	Assumed	100	SF	0	SF	Brown			1	No	1/D
1	GD	Office 104	N/A	Plaster Walls		NAD	300	SF	0	SF				N/A	N/A	N/A
1	GD	Office 104	N/A	Plaster Ceiling		NAD	100	SF	0	SF				N/A	N/A	N/A
1	GD	Office 104	S	Fireproofing	8140/01/0G/14	Confirmed	100	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	GD	Office 105	M	Floor Tile VAT 12" x 12"	8140/01/0G/HH	Assumed	100	SF	0	SF	Brown			1	No	1/D
1	GD	Office 105	N/A	Plaster Walls		NAD	300	SF	0	SF				N/A	N/A	N/A
1	GD	Office 105	N/A	Plaster Ceiling		NAD	100	SF	0	SF				N/A	N/A	N/A
1	GD	Office 105	S	Fireproofing	8140/01/0G/14	Confirmed	100	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	GD	Office 106	M	Floor Tile VAT 12" x 12"	8140/01/0G/HH	Assumed	100	SF	0	SF	Brown			1	No	1/D

## 8140 Meehan MS 2015 2016 AHERA Three-Year Report.xls

		School District of Philadelphia Austin Meehan Middle School 3001 Ryan Avenue, Philadelphia, PA 19152 ULCS# 8140 Year Built: 1970		<b>AHERA Three-Year Reinspection 2015-2016 Room by Room Location Log Report</b>							Reinspection Date: October 28, 2015 Building Inspector: Bernard J Bryson Number: ACC-0125-6-031 Management Planner: Megan Vala Number: 740728					
E l e m e n t	F l o o r	On Site Room Name	System Affected	Material Description	HID#	Confirmed/Assumed/NAD/ Non Suspect ACM	Amount of Material	SF LF EA	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic/ Crawl Space Ranking	Damage Potential (DP)	Newly Friable (NF)	Response Action (RA)
1	GD	Office 106	N/A	Plaster Walls		NAD	300	SF	0	SF				N/A	N/A	N/A
1	GD	Office 106	N/A	Plaster Ceiling		NAD	100	SF	0	SF				N/A	N/A	N/A
1	GD	Office 106	S	Fireproofing	8140/01/0G/14	Confirmed	100	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	GD	Office 201	M	Floor Tile VAT 12" x 12"	8140/01/0G/HH	Assumed	100	SF	0	SF	Brown			1	No	1/D
1	GD	Office 201	N/A	Plaster Walls		NAD	300	SF	0	SF				N/A	N/A	N/A
1	GD	Office 201	N/A	Plaster Ceiling		NAD	100	SF	0	SF				N/A	N/A	N/A
1	GD	Office 201	S	Fireproofing	8140/01/0G/14	Confirmed	100	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	GD	Office 202	M	Floor Tile VAT 12" x 12"	8140/01/0G/HH	Assumed	100	SF	0	SF	Brown			1	No	1/D
1	GD	Office 202	N/A	Plaster Walls		NAD	300	SF	0	SF				N/A	N/A	N/A
1	GD	Office 202	N/A	Plaster Ceiling		NAD	100	SF	0	SF				N/A	N/A	N/A
1	GD	Office 202	S	Fireproofing	8140/01/0G/14	Confirmed	100	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	GD	Office 203	M	Floor Tile VAT 12" x 12"	8140/01/0G/HH	Assumed	100	SF	0	SF	Brown			1	No	1/D
1	GD	Office 203	N/A	Plaster Walls		NAD	300	SF	0	SF				N/A	N/A	N/A
1	GD	Office 203	N/A	Plaster Ceiling		NAD	100	SF	0	SF				N/A	N/A	N/A
1	GD	Office 203	S	Fireproofing	8140/01/0G/14	Confirmed	100	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	GD	Office 204	M	Floor Tile VAT 12" x 12"	8140/01/0G/HH	Assumed	100	SF	0	SF	Brown			1	No	1/D
1	GD	Office 204	N/A	Plaster Walls		NAD	300	SF	0	SF				N/A	N/A	N/A
1	GD	Office 204	N/A	Plaster Ceiling		NAD	100	SF	0	SF				N/A	N/A	N/A
1	GD	Office 204	S	Fireproofing	8140/01/0G/14	Confirmed	100	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	GD	Office 205	M	Floor Tile VAT 12" x 12"	8140/01/0G/HH	Assumed	100	SF	0	SF	Brown			1	No	1/D
1	GD	Office 205	N/A	Plaster Walls		NAD	300	SF	0	SF				N/A	N/A	N/A
1	GD	Office 205	N/A	Plaster Ceiling		NAD	100	SF	0	SF				N/A	N/A	N/A
1	GD	Office 205	S	Fireproofing	8140/01/0G/14	Confirmed	100	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	GD	Office 206	M	Floor Tile VAT 12" x 12"	8140/01/0G/HH	Assumed	100	SF	0	SF	Brown			1	No	1/D
1	GD	Office 206	N/A	Plaster Walls		NAD	300	SF	0	SF				N/A	N/A	N/A
1	GD	Office 206	N/A	Plaster Ceiling		NAD	100	SF	0	SF				N/A	N/A	N/A
1	GD	Office 206	S	Fireproofing	8140/01/0G/14	Confirmed	100	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	GD	Office 301	M	Floor Tile VAT 12" x 12"	8140/01/0G/HH	Assumed	100	SF	0	SF	Brown			1	No	1/D
1	GD	Office 301	N/A	Plaster Walls		NAD	300	SF	0	SF				N/A	N/A	N/A
1	GD	Office 301	N/A	Plaster Ceiling		NAD	100	SF	0	SF				N/A	N/A	N/A
1	GD	Office 301	S	Fireproofing	8140/01/0G/14	Confirmed	100	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	GD	Office 302	M	Floor Tile VAT 12" x 12"	8140/01/0G/HH	Assumed	100	SF	0	SF	Brown			1	No	1/D
1	GD	Office 302	N/A	Plaster Walls		NAD	300	SF	0	SF				N/A	N/A	N/A
1	GD	Office 302	N/A	Plaster Ceiling		NAD	100	SF	0	SF				N/A	N/A	N/A
1	GD	Office 302	S	Fireproofing	8140/01/0G/14	Confirmed	100	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	GD	Office 303	M	Floor Tile VAT 12" x 12"	8140/01/0G/HH	Assumed	100	SF	0	SF	Brown			1	No	1/D
1	GD	Office 303	N/A	Plaster Walls		NAD	300	SF	0	SF				N/A	N/A	N/A
1	GD	Office 303	N/A	Plaster Ceiling		NAD	100	SF	0	SF				N/A	N/A	N/A
1	GD	Office 303	S	Fireproofing	8140/01/0G/14	Confirmed	100	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	GD	Office 304	M	Floor Tile VAT 12" x 12"	8140/01/0G/HH	Assumed	100	SF	0	SF	Brown			1	No	1/D
1	GD	Office 304	N/A	Plaster Walls		NAD	300	SF	0	SF				N/A	N/A	N/A
1	GD	Office 304	N/A	Plaster Ceiling		NAD	100	SF	0	SF				N/A	N/A	N/A
1	GD	Office 304	S	Fireproofing	8140/01/0G/14	Confirmed	100	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	GD	Office 305	M	Floor Tile VAT 12" x 12"	8140/01/0G/HH	Assumed	100	SF	0	SF	Brown			1	No	1/D
1	GD	Office 305	N/A	Plaster Walls		NAD	300	SF	0	SF				N/A	N/A	N/A
1	GD	Office 305	N/A	Plaster Ceiling		NAD	100	SF	0	SF				N/A	N/A	N/A
1	GD	Office 305	S	Fireproofing	8140/01/0G/14	Confirmed	100	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	GD	Office 306	M	Floor Tile VAT 12" x 12"	8140/01/0G/HH	Assumed	100	SF	0	SF	Brown			1	No	1/D
1	GD	Office 306	N/A	Plaster Walls		NAD	300	SF	0	SF				N/A	N/A	N/A
1	GD	Office 306	N/A	Plaster Ceiling		NAD	100	SF	0	SF				N/A	N/A	N/A
1	GD	Office 306	S	Fireproofing	8140/01/0G/14	Confirmed	100	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	GD	Office 401	M	Floor Tile VAT 12" x 12"	8140/01/0G/HH	Assumed	100	SF	0	SF	Brown			1	No	1/D
1	GD	Office 401	N/A	Plaster Walls		NAD	300	SF	0	SF				N/A	N/A	N/A
1	GD	Office 401	N/A	Plaster Ceiling		NAD	100	SF	0	SF				N/A	N/A	N/A
1	GD	Office 401	S	Fireproofing	8140/01/0G/14	Confirmed	100	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	GD	Office 402	M	Floor Tile VAT 12" x 12"	8140/01/0G/HH	Assumed	100	SF	0	SF	Brown			1	No	1/D
1	GD	Office 402	N/A	Plaster Walls		NAD	300	SF	0	SF				N/A	N/A	N/A
1	GD	Office 402	N/A	Plaster Ceiling		NAD	100	SF	0	SF				N/A	N/A	N/A
1	GD	Office 402	S	Fireproofing	8140/01/0G/14	Confirmed	100	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	GD	Office 403	M	Floor Tile VAT 12" x 12"	8140/01/0G/HH	Assumed	100	SF	0	SF	Brown			1	No	1/D
1	GD	Office 403	N/A	Plaster Walls		NAD	300	SF	0	SF				N/A	N/A	N/A
1	GD	Office 403	N/A	Plaster Ceiling		NAD	100	SF	0	SF				N/A	N/A	N/A
1	GD	Office 403	S	Fireproofing	8140/01/0G/14	Confirmed	100	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	GD	Office 404	M	Floor Tile VAT 12" x 12"	8140/01/0G/HH	Assumed	100	SF	0	SF	Brown			1	No	1/D
1	GD	Office 404	N/A	Plaster Walls		NAD	300	SF	0	SF				N/A	N/A	N/A
1	GD	Office 404	N/A	Plaster Ceiling		NAD	100	SF	0	SF				N/A	N/A	N/A
1	GD	Office 404	S	Fireproofing	8140/01/0G/14	Confirmed	100	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	GD	Office 405	M	Floor Tile VAT 12" x 12"	8140/01/0G/HH	Assumed	100	SF	0	SF	Brown			1	No	1/D
1	GD	Office 405	N/A	Plaster Walls		NAD	300	SF	0	SF				N/A	N/A	N/A
1	GD	Office 405	N/A	Plaster Ceiling		NAD	100	SF	0	SF				N/A	N/A	N/A
1	GD	Office 405	S	Fireproofing	8140/01/0G/14	Confirmed	100	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	GD	Office 406	M	Floor Tile VAT 12" x 12"	8140/01/0G/HH	Assumed	100	SF	0	SF	Brown			1	No	1/D
1	GD	Office 406	N/A	Plaster Walls		NAD	300	SF	0	SF				N/A	N/A	N/A
1	GD	Office 406	N/A	Plaster Ceiling		NAD	100	SF	0	SF				N/A	N/A	N/A

## 8140 Meehan MS 2015 2016 AHERA Three-Year Report.xls

E l e m e n t		School District of Philadelphia Austin Meehan Middle School 3001 Ryan Avenue, Philadelphia, PA 19152 ULCS# 8140 Year Built: 1970		AHERA Three-Year Reinspection 2015-2016 Room by Room Location Log Report							Reinspection Date: October 28, 2015 Building Inspector: Bernard J Bryson Number: ACC-0125-6-031 Management Planner: Megan Vala Number: 740728					
				System Affected	Material Description	HID#	Confirmed/Assumed/NAD/ Non Suspect ACM	Amount of Material	SF LF EA	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic/ Crawl Space Ranking	Damage Potential (DP)	Newly Friable (NF)
1	GD	Office 406	S	Fireproofing	8140/01/0G/14	Confirmed	100	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	GD	Cafeteria	M	Floor Tile VAT 12" x 12"	8140/01/0G/HH	Assumed	600	SF	0	SF	Pink			1	No	1/D
1	GD	Cafeteria	N/A	Plaster Walls		NAD	1800	SF	0	SF				N/A	N/A	N/A
1	GD	Cafeteria	N/A	Plaster Ceiling		NAD	600	SF	0	SF				N/A	N/A	N/A
1	GD	Cafeteria	S	Fireproofing	8140/01/0G/14	Confirmed	600	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	GD	Cafeteria	M	Floor Tile VAT 12" x 12"	8140/01/0G/HH	Assumed	600	SF	0	SF	Pink			1	No	1/D
1	GD	Cafeteria	N/A	Plaster Walls		NAD	1800	SF	0	SF				N/A	N/A	N/A
1	GD	Cafeteria	N/A	Plaster Ceiling		NAD	600	SF	0	SF				N/A	N/A	N/A
1	GD	Cafeteria	S	Fireproofing	8140/01/0G/14	Confirmed	600	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	GD	Cafeteria	M	Floor Tile VAT 12" x 12"	8140/01/0G/HH	Assumed	800	SF	0	SF	Pink			1	No	1/D
1	GD	Cafeteria	N/A	Plaster Walls		NAD	2400	SF	0	SF				N/A	N/A	N/A
1	GD	Cafeteria	N/A	Plaster Ceiling		NAD	800	SF	0	SF				N/A	N/A	N/A
1	GD	Cafeteria	S	Fireproofing	8140/01/0G/14	Confirmed	800	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	GD	Cafeteria	M	Floor Tile VAT 12" x 12"	8140/01/0G/HH	Assumed	600	SF	0	SF	Pink			1	No	1/D
1	GD	Cafeteria	N/A	Plaster Walls		NAD	1800	SF	0	SF				N/A	N/A	N/A
1	GD	Cafeteria	N/A	Plaster Ceiling		NAD	600	SF	0	SF				N/A	N/A	N/A
1	GD	Cafeteria	S	Fireproofing	8140/01/0G/14	Confirmed	600	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	GD	Cafeteria	M	Floor Tile VAT 12" x 12"	8140/01/0G/HH	Assumed	600	SF	0	SF	Pink			1	No	1/D
1	GD	Cafeteria	N/A	Plaster Walls		NAD	1800	SF	0	SF				N/A	N/A	N/A
1	GD	Cafeteria	N/A	Plaster Ceiling		NAD	600	SF	0	SF				N/A	N/A	N/A
1	GD	Cafeteria	S	Fireproofing	8140/01/0G/14	Confirmed	600	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	GD	Stairwell 2-B	N/A	Cement Floor		Non Suspect ACM	400	SF	0	SF				N/A	N/A	N/A
1	GD	Stairwell 2-B	N/A	Concrete Block Wall		Non Suspect ACM	1200	SF	0	SF				N/A	N/A	N/A
1	GD	Stairwell 2-B	N/A	Concrete Ceiling		Non Suspect ACM	400	SF	0	SF				N/A	N/A	N/A
1	GD	Stairwell 4-B	N/A	Cement Floor		Non Suspect ACM	400	SF	0	SF				N/A	N/A	N/A
1	GD	Stairwell 4-B	N/A	Concrete Block Wall		Non Suspect ACM	1200	SF	0	SF				N/A	N/A	N/A
1	GD	Stairwell 4-B	N/A	Concrete Ceiling		Non Suspect ACM	400	SF	0	SF				N/A	N/A	N/A
1	GD	Stairwell 5-B	N/A	Cement Floor		Non Suspect ACM	400	SF	0	SF				N/A	N/A	N/A
1	GD	Stairwell 5-B	N/A	Concrete Block Wall		Non Suspect ACM	1200	SF	0	SF				N/A	N/A	N/A
1	GD	Stairwell 5-B	N/A	Concrete Ceiling		Non Suspect ACM	400	SF	0	SF				N/A	N/A	N/A
1	GD	Boy's Restroom	N/A	Ceramic Tile Floors		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A
1	GD	Boy's Restroom	N/A	Plaster Walls		NAD	600	SF	0	SF				N/A	N/A	N/A
1	GD	Boy's Restroom	N/A	Plaster Ceiling		NAD	200	SF	0	SF				N/A	N/A	N/A
1	GD	Boy's Restroom	S	Fireproofing	8140/01/0G/14	Confirmed	200	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	GD	Girl's Restroom	N/A	Ceramic Tile Floors		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A
1	GD	Girl's Restroom	N/A	Plaster Walls		NAD	600	SF	0	SF				N/A	N/A	N/A
1	GD	Girl's Restroom	N/A	Plaster Ceiling		NAD	200	SF	0	SF				N/A	N/A	N/A
1	GD	Girl's Restroom	S	Fireproofing	8140/01/0G/14	Confirmed	200	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	GD	Boy's Restroom	N/A	Ceramic Tile Floors		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A
1	GD	Boy's Restroom	N/A	Plaster Walls		NAD	600	SF	0	SF				N/A	N/A	N/A
1	GD	Boy's Restroom	N/A	Plaster Ceiling		NAD	200	SF	0	SF				N/A	N/A	N/A
1	GD	Boy's Restroom	S	Fireproofing	8140/01/0G/14	Confirmed	200	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	GD	Girl's Restroom	N/A	Ceramic Tile Floors		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A
1	GD	Girl's Restroom	N/A	Plaster Walls		NAD	600	SF	0	SF				N/A	N/A	N/A
1	GD	Girl's Restroom	N/A	Plaster Ceiling		NAD	200	SF	0	SF				N/A	N/A	N/A
1	GD	Girl's Restroom	S	Fireproofing	8140/01/0G/14	Confirmed	200	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	GD	Storage Room 110	M	Floor Tile VAT 12" x 12"	8140/01/0G/HH	Assumed	200	SF	0	SF	Pink			1	No	1/D
1	GD	Storage Room 110	N/A	Plaster Walls		NAD	600	SF	0	SF				N/A	N/A	N/A
1	GD	Storage Room 110	N/A	Plaster Ceiling		NAD	200	SF	0	SF				N/A	N/A	N/A
1	GD	Storage Room 110	S	Fireproofing	8140/01/0G/14	Confirmed	200	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	GD	Classroom 111	M	Floor Tile VAT 12" x 12"	8140/01/0G/HH	Assumed	900	SF	0	SF	Pink			1	No	1/D
1	GD	Classroom 111	N/A	Plaster Walls		NAD	2700	SF	0	SF				N/A	N/A	N/A
1	GD	Classroom 111	N/A	Concrete Ceiling		Non Suspect ACM	900	SF	0	SF				N/A	N/A	N/A
1	GD	Classroom 111	N/A	Ceiling Tile 1' x 1'		NAD	450	SF	0	SF				N/A	N/A	N/A
1	GD	Classroom 111	M	Blackboard Glue Dots	8140/01/GD/SYN/BB/2600	Assumed	80	SF	0	SF		Blackboard/Tackboard		1	No	1/D
1	GD	Classroom 112	M	Floor Tile VAT 12" x 12"	8140/01/0G/HH	Assumed	1200	SF	0	SF	Pink			1	No	1/D
1	GD	Classroom 112	N/A	Plaster Walls		NAD	3600	SF	0	SF				N/A	N/A	N/A
1	GD	Classroom 112	N/A	Concrete Ceiling		Non Suspect ACM	1200	SF	0	SF				N/A	N/A	N/A
1	GD	Classroom 112	N/A	Ceiling Tile 1' x 1'		NAD	600	SF	0	SF				N/A	N/A	N/A
1	GD	Classroom 112	M	Blackboard Glue Dots	8140/01/GD/SYN/BB/2600	Assumed	80	SF	0	SF		Blackboard/Tackboard		1	No	1/D
1	GD	Classroom 114	M	Floor Tile VAT 12" x 12"	8140/01/0G/HH	Assumed	1200	SF	0	SF	Brown			1	No	1/D
1	GD	Classroom 114	N/A	Plaster Walls		NAD	3600	SF	0	SF				N/A	N/A	N/A
1	GD	Classroom 114	N/A	Concrete Ceiling		Non Suspect ACM	1200	SF	0	SF				N/A	N/A	N/A
1	GD	Classroom 114	N/A	Ceiling Tile 1' x 1'		NAD	600	SF	0	SF				N/A	N/A	N/A
1	GD	Classroom 114	M	Blackboard Glue Dots	8140/01/GD/SYN/BB/2600	Assumed	80	SF	0	SF		Blackboard/Tackboard		1	No	1/D
1	GD	Classroom 114	M	Transte Sink	8140/01/0G/08	Assumed	8	SF	0	SF		4 Sinks - 2 SF EA		1	No	1/D
1	GD	Classroom 115	M	Floor Tile VAT 12" x 12"	8140/01/0G/HH	Assumed	1200	SF	0	SF	Blue			1	No	1/D
1	GD	Classroom 115	N/A	Plaster Walls		NAD	3600	SF	0	SF				N/A	N/A	N/A
1	GD	Classroom 115	N/A	Concrete Ceiling		Non Suspect ACM	1200	SF	0	SF				N/A	N/A	N/A
1	GD	Classroom 115	N/A	Ceiling Tile 1' x 1'		NAD	600	SF	0	SF				N/A	N/A	N/A

## 8140 Meehan MS 2015 2016 AHERA Three-Year Report.xls

		School District of Philadelphia Austin Meehan Middle School 3001 Ryan Avenue, Philadelphia, PA 19152 ULCS# 8140 Year Built: 1970		AHERA Three-Year Reinspection 2015-2016 Room by Room Location Log Report							Reinspection Date: October 28, 2015 Building Inspector: Bernard J Bryson Number: ACC-0125-6-031 Management Planner: Megan Vala Number: 740728					
E l e m e n t	F l o o r	On Site Room Name	System Affected	Material Description	HID#	Confirmed/Assumed/NAD/ Non Suspect ACM	Amount of Material	SF LF EA	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic/ Crawl Space Ranking	Damage Potential (DP)	Newly Friable (NF)	Response Action (RA)
1	GD	Classroom 115	M	Blackboard Glue Dots	8140/01/GD/SYN/BB/2600	Assumed	80	SF	0	SF		Blackboard/Tackboard		1	No	1/D
1	GD	Storage Room 210	M	Floor Tile VAT 12" x 12"	8140/01/0G/HH	Assumed	200	SF	0	SF	Pink			1	No	1/D
1	GD	Storage Room 210	N/A	Plaster Walls		NAD	600	SF	0	SF				N/A	N/A	N/A
1	GD	Storage Room 210	N/A	Plaster Ceiling		NAD	200	SF	0	SF				N/A	N/A	N/A
1	GD	Storage Room 210	S	Fireproofing	8140/01/0G/14	Confirmed	200	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	GD	Classroom 211	M	Floor Tile VAT 12" x 12"	8140/01/0G/HH	Assumed	900	SF	0	SF	Grey			1	No	1/D
1	GD	Classroom 211	N/A	Plaster Walls		NAD	2700	SF	0	SF				N/A	N/A	N/A
1	GD	Classroom 211	N/A	Concrete Ceiling		Non Suspect ACM	900	SF	0	SF				N/A	N/A	N/A
1	GD	Classroom 211	N/A	Ceiling Tile 1' x 1'		NAD	450	SF	0	SF				N/A	N/A	N/A
1	GD	Classroom 211	M	Blackboard Glue Dots	8140/01/GD/SYN/BB/2600	Assumed	80	SF	0	SF		Blackboard/Tackboard		1	No	1/D
1	GD	Classroom 211	M	Transite Sink	8140/01/0G/08	Assumed	2	SF	0	SF		1 Sink - 2 SF		1	No	1/D
1	GD	Classroom 212	M	Floor Tile VAT 12" x 12"	8140/01/0G/HH	Assumed	1200	SF	0	SF	Brown			1	No	1/D
1	GD	Classroom 212	N/A	Plaster Walls		NAD	3600	SF	0	SF				N/A	N/A	N/A
1	GD	Classroom 212	N/A	Concrete Ceiling		Non Suspect ACM	1200	SF	0	SF				N/A	N/A	N/A
1	GD	Classroom 212	N/A	Ceiling Tile 1' x 1'		NAD	600	SF	0	SF				N/A	N/A	N/A
1	GD	Classroom 212	M	Blackboard Glue Dots	8140/01/GD/SYN/BB/2600	Assumed	80	SF	0	SF		Blackboard/Tackboard		1	No	1/D
1	GD	Classroom 214	M	Floor Tile VAT 12" x 12"	8140/01/0G/HH	Assumed	1200	SF	0	SF	Grey			1	No	1/D
1	GD	Classroom 214	N/A	Plaster Walls		NAD	3600	SF	0	SF				N/A	N/A	N/A
1	GD	Classroom 214	N/A	Concrete Ceiling		Non Suspect ACM	1200	SF	0	SF				N/A	N/A	N/A
1	GD	Classroom 214	N/A	Ceiling Tile 1' x 1'		NAD	600	SF	0	SF				N/A	N/A	N/A
1	GD	Classroom 214	M	Blackboard Glue Dots	8140/01/GD/SYN/BB/2600	Assumed	80	SF	0	SF		Blackboard/Tackboard		1	No	1/D
1	GD	Classroom 215	M	Floor Tile VAT 12" x 12"	8140/01/0G/HH	Assumed	1200	SF	0	SF	Grey			1	No	1/D
1	GD	Classroom 215	N/A	Plaster Walls		NAD	3600	SF	0	SF				N/A	N/A	N/A
1	GD	Classroom 215	N/A	Concrete Ceiling		Non Suspect ACM	1200	SF	0	SF				N/A	N/A	N/A
1	GD	Classroom 215	N/A	Ceiling Tile 1' x 1'		NAD	600	SF	0	SF				N/A	N/A	N/A
1	GD	Classroom 215	M	Blackboard Glue Dots	8140/01/GD/SYN/BB/2600	Assumed	80	SF	0	SF		Blackboard/Tackboard		1	No	1/D
1	GD	Storage Room 217	M	Floor Tile VAT 12" x 12"	8140/01/0G/HH	Assumed	200	SF	0	SF	Brown			1	No	1/D
1	GD	Storage Room 217	N/A	Plaster Walls		NAD	600	SF	0	SF				N/A	N/A	N/A
1	GD	Storage Room 217	N/A	Plaster Ceiling		NAD	200	SF	0	SF				N/A	N/A	N/A
1	GD	Storage Room 217	S	Fireproofing	8140/01/0G/14	Confirmed	200	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	GD	Storage Room 117	M	Floor Tile VAT 12" x 12"	8140/01/0G/HH	Assumed	200	SF	0	SF	Brown			1	No	1/D
1	GD	Storage Room 117	N/A	Plaster Walls		NAD	600	SF	0	SF				N/A	N/A	N/A
1	GD	Storage Room 117	N/A	Plaster Ceiling		NAD	200	SF	0	SF				N/A	N/A	N/A
1	GD	Storage Room 117	S	Fireproofing	8140/01/0G/14	Confirmed	200	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	GD	Storage Room 317	M	Floor Tile VAT 12" x 12"	8140/01/0G/HH	Assumed	200	SF	0	SF	Brown			1	No	1/D
1	GD	Storage Room 317	N/A	Plaster Walls		NAD	600	SF	0	SF				N/A	N/A	N/A
1	GD	Storage Room 317	N/A	Plaster Ceiling		NAD	200	SF	0	SF				N/A	N/A	N/A
1	GD	Storage Room 317	S	Fireproofing	8140/01/0G/14	Confirmed	200	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	GD	Storage Room 417	M	Floor Tile VAT 12" x 12"	8140/01/0G/HH	Assumed	200	SF	0	SF	Brown			1	No	1/D
1	GD	Storage Room 417	N/A	Plaster Walls		NAD	600	SF	0	SF				N/A	N/A	N/A
1	GD	Storage Room 417	N/A	Plaster Ceiling		NAD	200	SF	0	SF				N/A	N/A	N/A
1	GD	Storage Room 417	S	Fireproofing	8140/01/0G/14	Confirmed	200	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	GD	Storage Room 417	M	Transite Sink	8140/01/0G/08	Assumed	14	SF	0	SF		2 Sinks - 2 SF EA and 1 Drying Rack - 10 SF		1	No	1/D
1	GD	Storage Room 310	M	Floor Tile VAT 12" x 12"	8140/01/0G/HH	Assumed	200	SF	0	SF	Brown			1	No	1/D
1	GD	Storage Room 310	N/A	Plaster Walls		NAD	600	SF	0	SF				N/A	N/A	N/A
1	GD	Storage Room 310	N/A	Plaster Ceiling		NAD	200	SF	0	SF				N/A	N/A	N/A
1	GD	Storage Room 310	S	Fireproofing	8140/01/0G/14	Confirmed	200	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	GD	Storage Room 410	M	Floor Tile VAT 12" x 12"	8140/01/0G/HH	Assumed	200	SF	0	SF	Brown			1	No	1/D
1	GD	Storage Room 410	N/A	Plaster Walls		NAD	600	SF	0	SF				N/A	N/A	N/A
1	GD	Storage Room 410	N/A	Plaster Ceiling		NAD	200	SF	0	SF				N/A	N/A	N/A
1	GD	Storage Room 410	S	Fireproofing	8140/01/0G/14	Confirmed	200	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	GD	Classroom 311	M	Floor Tile VAT 12" x 12"	8140/01/0G/HH	Assumed	900	SF	0	SF	Brown			1	No	1/D
1	GD	Classroom 311	N/A	Plaster Walls		NAD	2700	SF	0	SF				N/A	N/A	N/A
1	GD	Classroom 311	N/A	Concrete Ceiling		Non Suspect ACM	900	SF	0	SF				N/A	N/A	N/A
1	GD	Classroom 311	N/A	Ceiling Tile 1' x 1'		NAD	450	SF	0	SF				N/A	N/A	N/A
1	GD	Classroom 311	M	Blackboard Glue Dots	8140/01/GD/SYN/BB/2600	Assumed	80	SF	0	SF		Blackboard/Tackboard		1	No	1/D
1	GD	Classroom 311	M	Transite Sink	8140/01/0G/08	Assumed	4	SF	0	SF		2 Sinks - 2 SF EA		1	No	1/D
1	GD	Classroom 312	M	Floor Tile VAT 12" x 12"	8140/01/0G/HH	Assumed	1200	SF	0	SF	Brown			1	No	1/D
1	GD	Classroom 312	N/A	Plaster Walls		NAD	3600	SF	0	SF				N/A	N/A	N/A
1	GD	Classroom 312	N/A	Concrete Ceiling		Non Suspect ACM	1200	SF	0	SF				N/A	N/A	N/A
1	GD	Classroom 312	N/A	Ceiling Tile 1' x 1'		NAD	600	SF	0	SF				N/A	N/A	N/A
1	GD	Classroom 312	M	Blackboard Glue Dots	8140/01/GD/SYN/BB/2600	Assumed	80	SF	0	SF		Blackboard/Tackboard		1	No	1/D
1	GD	Classroom 312	M	Transite Sink	8140/01/0G/08	Assumed	6	SF	0	SF		3 Sinks - 2 SF EA		1	No	1/D
1	GD	Classroom 314	M	Floor Tile VAT 12" x 12"	8140/01/0G/HH	Assumed	1200	SF	0	SF	Brown			1	No	1/D
1	GD	Classroom 314	N/A	Plaster Walls		NAD	3600	SF	0	SF				N/A	N/A	N/A
1	GD	Classroom 314	N/A	Concrete Ceiling		Non Suspect ACM	1200	SF	0	SF				N/A	N/A	N/A
1	GD	Classroom 314	N/A	Ceiling Tile 1' x 1'		NAD	600	SF	0	SF				N/A	N/A	N/A
1	GD	Classroom 314	M	Blackboard Glue Dots	8140/01/GD/SYN/BB/2600	Assumed	80	SF	0	SF		Blackboard/Tackboard		1	No	1/D
1	GD	Classroom 315	M	Floor Tile VAT 12" x 12"	8140/01/0G/HH	Assumed	1200	SF	0	SF	Blue			1	No	1/D
1	GD	Classroom 315	N/A	Plaster Walls		NAD	3600	SF	0	SF				N/A	N/A	N/A
1	GD	Classroom 315	N/A	Concrete Ceiling		Non Suspect ACM	1200	SF	0	SF				N/A	N/A	N/A
1	GD	Classroom 315	N/A	Ceiling Tile 1' x 1'		NAD	600	SF	0	SF				N/A	N/A	N/A
1	GD	Classroom 315	M	Blackboard Glue Dots	8140/01/GD/SYN/BB/2600	Assumed	80	SF	0	SF		Blackboard/Tackboard		1	No	1/D
1	GD	Classroom 411	M	Floor Tile VAT 12" x 12"	8140/01/0G/HH	Assumed	900	SF	0	SF	Brown			1	No	1/D

## 8140 Meehan MS 2015 2016 AHERA Three-Year Report.xls

		School District of Philadelphia Austin Meehan Middle School 3001 Ryan Avenue, Philadelphia, PA 19152 ULCS# 8140 Year Built: 1970		<b>AHERA Three-Year Reinspection 2015-2016 Room by Room Location Log Report</b>							Reinspection Date: October 28, 2015 Building Inspector: Bernard J Bryson Number: ACC-0125-6-031 Management Planner: Megan Vala Number: 740728					
E l e m e n t	F l o o r	On Site Room Name	System Affected	Material Description	HID#	Confirmed/Assumed/NAD/ Non Suspect ACM	Amount of Material	SF LF EA	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic/ Crawl Space Ranking	Damage Potential (DP)	Newly Friable (NF)	Response Action (RA)
1	GD	Classroom 411	N/A	Plaster Walls		NAD	2700	SF	0	SF				N/A	N/A	N/A
1	GD	Classroom 411	N/A	Concrete Ceiling		Non Suspect ACM	900	SF	0	SF				N/A	N/A	N/A
1	GD	Classroom 411	N/A	Ceiling Tile 1' x 1'		NAD	450	SF	0	SF				N/A	N/A	N/A
1	GD	Classroom 411	M	Blackboard Glue Dots	8140/01/GD/SYN/BB/2600	Assumed	80	SF	0	SF		Blackboard/Tackboard		1	No	1/D
1	GD	Classroom 411	M	Sink Undercoat Mastic	8140/01/GD/SYN/BB/2602	Assumed	6	SF	0	SF		1 Sink - 6 SF		1	No	1/D
1	GD	Classroom 412	M	Floor Tile VAT 12" x 12"	8140/01/0G/HH	Assumed	1200	SF	0	SF	Brown			1	No	1/D
1	GD	Classroom 412	N/A	Plaster Walls		NAD	3600	SF	0	SF				N/A	N/A	N/A
1	GD	Classroom 412	N/A	Concrete Ceiling		Non Suspect ACM	1200	SF	0	SF				N/A	N/A	N/A
1	GD	Classroom 412	N/A	Ceiling Tile 1' x 1'		NAD	600	SF	0	SF				N/A	N/A	N/A
1	GD	Classroom 412	M	Blackboard Glue Dots	8140/01/GD/SYN/BB/2600	Assumed	80	SF	0	SF		Blackboard/Tackboard		1	No	1/D
1	GD	Classroom 412	M	Transite Sink	8140/01/0G/08	Assumed	6	SF	0	SF		3 Sinks - 2 SF EA		1	No	1/D
1	GD	Classroom 414	M	Floor Tile VAT 12" x 12"	8140/01/0G/HH	Assumed	1200	SF	0	SF	Brown			1	No	1/D
1	GD	Classroom 414	N/A	Plaster Walls		NAD	3600	SF	0	SF				N/A	N/A	N/A
1	GD	Classroom 414	N/A	Concrete Ceiling		Non Suspect ACM	1200	SF	0	SF				N/A	N/A	N/A
1	GD	Classroom 414	N/A	Ceiling Tile 1' x 1'		NAD	600	SF	0	SF				N/A	N/A	N/A
1	GD	Classroom 414	M	Blackboard Glue Dots	8140/01/GD/SYN/BB/2600	Assumed	80	SF	0	SF		Blackboard/Tackboard		1	No	1/D
1	GD	Classroom 414	M	Transite Sink	8140/01/0G/08	Assumed	8	SF	0	SF		4 Sinks - 2 SF EA		1	No	1/D
1	GD	Classroom 415	M	Floor Tile VAT 12" x 12"	8140/01/0G/HH	Assumed	1200	SF	0	SF	Grey			1	No	1/D
1	GD	Classroom 415	N/A	Plaster Walls		NAD	3600	SF	0	SF				N/A	N/A	N/A
1	GD	Classroom 415	N/A	Concrete Ceiling		Non Suspect ACM	1200	SF	0	SF				N/A	N/A	N/A
1	GD	Classroom 415	N/A	Ceiling Tile 1' x 1'		NAD	600	SF	0	SF				N/A	N/A	N/A
1	GD	Classroom 415	M	Blackboard Glue Dots	8140/01/UL/SYN/BB/2600	Assumed	80	SF	0	SF		Blackboard/Tackboard		1	No	1/D
1	GD	Classroom 415	M	Transite Sink	8140/01/0G/08	Assumed	2	SF	0	SF		1 Sink - 2 SF		1	No	1/D
1	GD	Narrow Hallway behind Classroom 215	M	Floor Tile VAT 12" x 12"	8140/01/0G/HH	Assumed	200	SF	0	SF	Pink			1	No	1/D
1	GD	Narrow Hallway behind Classroom 215	N/A	Plaster Walls		NAD	600	SF	0	SF				N/A	N/A	N/A
1	GD	Narrow Hallway behind Classroom 215	N/A	Plaster Ceiling		NAD	200	SF	0	SF				N/A	N/A	N/A
1	GD	Narrow Hallway behind Classroom 215	S	Fireproofing	8140/01/0G/14	Confirmed	200	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	GD	Narrow Hallway behind Classroom 315	M	Floor Tile VAT 12" x 12"	8140/01/0G/HH	Assumed	200	SF	0	SF	Pink			1	No	1/D
1	GD	Narrow Hallway behind Classroom 315	N/A	Plaster Walls		NAD	600	SF	0	SF				N/A	N/A	N/A
1	GD	Narrow Hallway behind Classroom 315	N/A	Plaster Ceiling		NAD	200	SF	0	SF				N/A	N/A	N/A
1	GD	Narrow Hallway behind Classroom 315	S	Fireproofing	8140/01/0G/14	Confirmed	200	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	GD	Main Office	M	Floor Tile VAT 12" x 12"	8140/01/0G/HH	Assumed	300	SF	0	SF	Pink			1	No	1/D
1	GD	Main Office	N/A	Plaster Walls		NAD	900	SF	0	SF				N/A	N/A	N/A
1	GD	Main Office	N/A	Plaster Ceiling		NAD	300	SF	0	SF				N/A	N/A	N/A
1	GD	Main Office	S	Fireproofing	8140/01/0G/14	Confirmed	300	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	GD	Office A53	N/A	Carpet		Non Suspect ACM	100	SF	0	SF		VAT Below?		1	No	1/D
1	GD	Office A53	N/A	Plaster Walls		NAD	300	SF	0	SF				N/A	N/A	N/A
1	GD	Office A53	N/A	Plaster Ceiling		NAD	100	SF	0	SF				N/A	N/A	N/A
1	GD	Office A53	S	Fireproofing	8140/01/0G/14	Confirmed	100	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	GD	Office A51	M	Floor Tile VAT 12" x 12"	8140/01/0G/HH	Assumed	100	SF	0	SF	Brown			1	No	1/D
1	GD	Office A51	N/A	Plaster Walls		NAD	300	SF	0	SF				N/A	N/A	N/A
1	GD	Office A51	N/A	Plaster Ceiling		NAD	100	SF	0	SF				N/A	N/A	N/A
1	GD	Office A51	S	Fireproofing	8140/01/0G/14	Confirmed	100	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	GD	Principal's Office	M	Floor Tile VAT 12" x 12"	8140/01/0G/HH	Assumed	200	SF	0	SF	Brown			1	No	1/D
1	GD	Principal's Office	N/A	Plaster Walls		NAD	600	SF	0	SF				N/A	N/A	N/A
1	GD	Principal's Office	N/A	Plaster Ceiling		NAD	200	SF	0	SF				N/A	N/A	N/A
1	GD	Principal's Office	S	Fireproofing	8140/01/0G/14	Confirmed	200	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	GD	Copy Room A50	M	Floor Tile VAT 12" x 12"	8140/01/0G/HH	Assumed	100	SF	0	SF	Brown			1	No	1/D
1	GD	Copy Room A50	N/A	Plaster Walls		NAD	300	SF	0	SF				N/A	N/A	N/A
1	GD	Copy Room A50	N/A	Plaster Ceiling		NAD	100	SF	0	SF				N/A	N/A	N/A
1	GD	Copy Room A50	S	Fireproofing	8140/01/0G/14	Confirmed	100	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	GD	Main Office	M	Floor Tile VAT 12" x 12"	8140/01/0G/HH	Assumed	100	SF	0	SF	Brown			1	No	1/D
1	GD	Main Office	N/A	Plaster Walls		NAD	300	SF	0	SF				N/A	N/A	N/A
1	GD	Main Office	N/A	Plaster Ceiling		NAD	100	SF	0	SF				N/A	N/A	N/A
1	GD	Main Office	S	Fireproofing	8140/01/0G/14	Confirmed	100	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	GD	Main Office	M	Floor Tile VAT 12" x 12"	8140/01/0G/HH	Assumed	80	SF	0	SF	Brown			1	No	1/D
1	GD	Main Office	N/A	Plaster Walls		NAD	240	SF	0	SF				N/A	N/A	N/A
1	GD	Main Office	N/A	Plaster Ceiling		NAD	80	SF	0	SF				N/A	N/A	N/A
1	GD	Main Office	S	Fireproofing	8140/01/0G/14	Confirmed	80	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	GD	Main Office Restroom	N/A	Ceramic Tile Floors		Non Suspect ACM	50	SF	0	SF				N/A	N/A	N/A
1	GD	Main Office Restroom	N/A	Plaster Walls		NAD	150	SF	0	SF				N/A	N/A	N/A
1	GD	Main Office Restroom	N/A	Plaster Ceiling		NAD	50	SF	0	SF				N/A	N/A	N/A
1	GD	Main Office Restroom	S	Fireproofing	8140/01/0G/14	Confirmed	50	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	GD	Main Office IT Closet (former restroom)	N/A	Ceramic Tile Floors		Non Suspect ACM	50	SF	0	SF				N/A	N/A	N/A
1	GD	Main Office IT Closet (former restroom)	N/A	Plaster Walls		NAD	150	SF	0	SF				N/A	N/A	N/A
1	GD	Main Office IT Closet (former restroom)	N/A	Plaster Ceiling		NAD	50	SF	0	SF				N/A	N/A	N/A
1	GD	Main Office IT Closet (former restroom)	S	Fireproofing	8140/01/0G/14	Confirmed	50	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	GD	Former Auditorium Projection Room	M	Floor Tile VAT 12" x 12"	8140/01/0G/HH	Assumed	100	SF	0	SF	Brown			1	No	1/D
1	GD	Former Auditorium Projection Room	N/A	Plaster Walls		NAD	300	SF	0	SF				N/A	N/A	N/A
1	GD	Former Auditorium Projection Room	N/A	Plaster Ceiling		NAD	100	SF	0	SF				N/A	N/A	N/A
1	GD	Former Auditorium Projection Room	S	Fireproofing	8140/01/0G/14	Confirmed	100	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	GD	Storage Room beside Former Auditorium Projection Room	X	X		X	X	X	X	X		No Access		X	X	X
1	GD	Nurse's Office	M	Floor Tile VAT 12" x 12"	8140/01/0G/HH	Assumed	250	SF	0	SF	Pink			1	No	1/D

## 8140 Meehan MS 2015 2016 AHERA Three-Year Report.xls

		School District of Philadelphia Austin Meehan Middle School 3001 Ryan Avenue, Philadelphia, PA 19152 ULCS# 8140 Year Built: 1970		AHERA Three-Year Reinspection 2015-2016 Room by Room Location Log Report							Reinspection Date: October 28, 2015 Building Inspector: Bernard J Bryson Number: ACC-0125-6-031 Management Planner: Megan Vala Number: 740728					
E l e m e n t	F l o o r	On Site Room Name	System Affected	Material Description	HID#	Confirmed/Assumed/NAD/ Non Suspect ACM	Amount of Material	SF LF EA	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic/ Crawl Space Ranking	Damage Potential (DP)	Newly Friable (NF)	Response Action (RA)
1	GD	Nurse's Office	N/A	Plaster Walls		NAD	750	SF	0	SF				N/A	N/A	N/A
1	GD	Nurse's Office	N/A	Plaster Ceiling		NAD	250	SF	0	SF				N/A	N/A	N/A
1	GD	Nurse's Office	S	Fireproofing	8140/01/0G/14	Confirmed	250	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	GD	Nurse's Office Exam Room	M	Floor Tile VAT 12" x 12"	8140/01/0G/HH	Assumed	100	SF	0	SF	Pink			1	No	1/D
1	GD	Nurse's Office Exam Room	N/A	Plaster Walls		NAD	300	SF	0	SF				N/A	N/A	N/A
1	GD	Nurse's Office Exam Room	N/A	Plaster Ceiling		NAD	100	SF	0	SF				N/A	N/A	N/A
1	GD	Nurse's Office Exam Room	S	Fireproofing	8140/01/0G/14	Confirmed	100	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	GD	Nurse's Office Exam Room	M	Floor Tile VAT 12" x 12"	8140/01/0G/HH	Assumed	100	SF	0	SF	Pink			1	No	1/D
1	GD	Nurse's Office Exam Room	N/A	Plaster Walls		NAD	300	SF	0	SF				N/A	N/A	N/A
1	GD	Nurse's Office Exam Room	N/A	Plaster Ceiling		NAD	100	SF	0	SF				N/A	N/A	N/A
1	GD	Nurse's Office Exam Room	S	Fireproofing	8140/01/0G/14	Confirmed	100	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	GD	Roster Room A56	M	Floor Tile VAT 12" x 12"	8140/01/0G/HH	Assumed	120	SF	0	SF	Brown			1	No	1/D
1	GD	Roster Room A56	N/A	Plaster Walls		NAD	360	SF	0	SF				N/A	N/A	N/A
1	GD	Roster Room A56	N/A	Plaster Ceiling		NAD	120	SF	0	SF				N/A	N/A	N/A
1	GD	Roster Room A56	S	Fireproofing	8140/01/0G/14	Confirmed	120	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	GD	Teacher's Lounge A60	M	Floor Tile VAT 12" x 12"	8140/01/0G/HH	Assumed	200	SF	0	SF	Brown			1	No	1/D
1	GD	Teacher's Lounge A60	N/A	Plaster Walls		NAD	600	SF	0	SF				N/A	N/A	N/A
1	GD	Teacher's Lounge A60	N/A	Plaster Ceiling		NAD	200	SF	0	SF				N/A	N/A	N/A
1	GD	Teacher's Lounge A60	S	Fireproofing	8140/01/0G/14	Confirmed	200	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	GD	Teacher's Lounge Women's Restroom	N/A	Ceramic Tile Floors		Non Suspect ACM	50	SF	0	SF		Includes A74 and A77		N/A	N/A	N/A
1	GD	Teacher's Lounge Women's Restroom	N/A	Plaster Walls		NAD	150	SF	0	SF				N/A	N/A	N/A
1	GD	Teacher's Lounge Women's Restroom	N/A	Plaster Ceiling		NAD	50	SF	0	SF				N/A	N/A	N/A
1	GD	Teacher's Lounge Women's Restroom	S	Fireproofing	8140/01/0G/14	Confirmed	50	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	GD	Teacher's Lounge Men's Restroom	N/A	Ceramic Tile Floors		Non Suspect ACM	50	SF	0	SF		Includes A75 and A76		N/A	N/A	N/A
1	GD	Teacher's Lounge Men's Restroom	N/A	Plaster Walls		NAD	150	SF	0	SF				N/A	N/A	N/A
1	GD	Teacher's Lounge Men's Restroom	N/A	Plaster Ceiling		NAD	50	SF	0	SF				N/A	N/A	N/A
1	GD	Teacher's Lounge Men's Restroom	S	Fireproofing	8140/01/0G/14	Confirmed	50	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	UL	Stairwell 1-B	N/A	Cement Floor		Non Suspect ACM	400	SF	0	SF				N/A	N/A	N/A
1	UL	Stairwell 1-B	N/A	Concrete Block Wall		Non Suspect ACM	1200	SF	0	SF				N/A	N/A	N/A
1	UL	Stairwell 1-B	N/A	Concrete Ceiling		Non Suspect ACM	400	SF	0	SF				N/A	N/A	N/A
1	UL	Stairwell 2-B	N/A	Cement Floor		Non Suspect ACM	400	SF	0	SF				N/A	N/A	N/A
1	UL	Stairwell 2-B	N/A	Concrete Block Wall		Non Suspect ACM	1200	SF	0	SF				N/A	N/A	N/A
1	UL	Stairwell 2-B	N/A	Concrete Ceiling		Non Suspect ACM	400	SF	0	SF				N/A	N/A	N/A
1	UL	Stairwell 3-B	N/A	Cement Floor		Non Suspect ACM	400	SF	0	SF				N/A	N/A	N/A
1	UL	Stairwell 3-B	N/A	Concrete Block Wall		Non Suspect ACM	1200	SF	0	SF				N/A	N/A	N/A
1	UL	Stairwell 3-B	N/A	Concrete Ceiling		Non Suspect ACM	400	SF	0	SF				N/A	N/A	N/A
1	UL	Stairwell 4-B	N/A	Cement Floor		Non Suspect ACM	400	SF	0	SF				N/A	N/A	N/A
1	UL	Stairwell 4-B	N/A	Concrete Block Wall		Non Suspect ACM	1200	SF	0	SF				N/A	N/A	N/A
1	UL	Stairwell 4-B	N/A	Concrete Ceiling		Non Suspect ACM	400	SF	0	SF				N/A	N/A	N/A
1	UL	Stairwell 5-B	N/A	Cement Floor		Non Suspect ACM	400	SF	0	SF				N/A	N/A	N/A
1	UL	Stairwell 5-B	N/A	Concrete Block Wall		Non Suspect ACM	1200	SF	0	SF				N/A	N/A	N/A
1	UL	Stairwell 5-B	N/A	Concrete Ceiling		Non Suspect ACM	400	SF	0	SF				N/A	N/A	N/A
1	UL	1 Pod Hallway	M	Floor Tile VAT 12" x 12"	8140/01/UL/JJ	Assumed	3200	SF	0	SF	Grey	Includes 100, 100B, 100C, J7, 120 and 100A		1	No	1/D
1	UL	1 Pod Hallway	N/A	Concrete Block Wall		Non Suspect ACM	9600	SF	0	SF				N/A	N/A	N/A
1	UL	1 Pod Hallway	N/A	Plaster Ceiling		NAD	3200	SF	0	SF				N/A	N/A	N/A
1	UL	1 Pod Hallway	N/A	Ceiling Tile 1' x 1'		NAD	3200	SF	0	SF				N/A	N/A	N/A
1	UL	1 Pod Hallway	S	Fireproofing	8140/01/UL/KK	Confirmed	3200	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	UL	2 Pod Hallway	M	Floor Tile VAT 12" x 12"	8140/01/UL/JJ	Assumed	3650	SF	0	SF	Grey	Includes 200, 220, 200A, H220 & J6		1	No	1/D
1	UL	2 Pod Hallway	N/A	Concrete Block Wall		Non Suspect ACM	10950	SF	0	SF				N/A	N/A	N/A
1	UL	2 Pod Hallway	N/A	Plaster Ceiling		NAD	3650	SF	0	SF				N/A	N/A	N/A
1	UL	2 Pod Hallway	N/A	Ceiling Tile 1' x 1'		NAD	3650	SF	0	SF				N/A	N/A	N/A
1	UL	2 Pod Hallway	S	Fireproofing	8140/01/UL/KK	Confirmed	3650	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	UL	3 Pod Hallway	M	Floor Tile VAT 12" x 12"	8140/01/UL/JJ	Assumed	3650	SF	0	SF	Grey	Includes 003, 320, 003A and H003		1	No	1/D
1	UL	3 Pod Hallway	N/A	Concrete Block Wall		Non Suspect ACM	10950	SF	0	SF				N/A	N/A	N/A
1	UL	3 Pod Hallway	N/A	Plaster Ceiling		NAD	3650	SF	0	SF				N/A	N/A	N/A
1	UL	3 Pod Hallway	N/A	Ceiling Tile 1' x 1'		NAD	3650	SF	30	SF		Aesthetic Damage - Not IEQ Issue		N/A	N/A	N/A
1	UL	3 Pod Hallway	S	Fireproofing	8140/01/UL/KK	Confirmed	3650	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	UL	4 Pod Hallway	M	Floor Tile VAT 12" x 12"	8140/01/UL/JJ	Assumed	2700	SF	0	SF	Grey	Includes 420, 400A, 400, 400B, J4, J5 & 400C		1	No	1/D
1	UL	4 Pod Hallway	N/A	Concrete Block Wall		Non Suspect ACM	8100	SF	0	SF				N/A	N/A	N/A
1	UL	4 Pod Hallway	N/A	Plaster Ceiling		NAD	2700	SF	0	SF				N/A	N/A	N/A
1	UL	4 Pod Hallway	N/A	Ceiling Tile 1' x 1'		NAD	2700	SF	0	SF				N/A	N/A	N/A
1	UL	4 Pod Hallway	S	Fireproofing	8140/01/UL/KK	Confirmed	2700	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	UL	Storage Room 150	M	Floor Tile VAT 12" x 12"	8140/01/UL/JJ	Assumed	200	SF	0	SF	Pink			1	No	1/D
1	UL	Storage Room 150	N/A	Plaster Walls		NAD	600	SF	0	SF				N/A	N/A	N/A
1	UL	Storage Room 150	N/A	Plaster Ceiling		NAD	200	SF	0	SF				N/A	N/A	N/A
1	UL	Storage Room 150	S	Fireproofing	8140/01/UL/KK	Confirmed	200	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	UL	Storage Room 150A	M	Floor Tile VAT 12" x 12"	8140/01/UL/JJ	Assumed	200	SF	0	SF	Pink			1	No	1/D
1	UL	Storage Room 150A	N/A	Plaster Walls		NAD	600	SF	0	SF				N/A	N/A	N/A
1	UL	Storage Room 150A	N/A	Plaster Ceiling		NAD	200	SF	0	SF				N/A	N/A	N/A
1	UL	Storage Room 150A	S	Fireproofing	8140/01/UL/KK	Confirmed	200	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	UL	Narrow Hallway outside of Lab Classrooms	M	Floor Tile VAT 12" x 12"	8140/01/UL/JJ	Assumed	1200	SF	0	SF	Grey			1	No	1/D
1	UL	Narrow Hallway outside of Lab Classrooms	N/A	Concrete Block Wall		Non Suspect ACM	3600	SF	0	SF				N/A	N/A	N/A
1	UL	Narrow Hallway outside of Lab Classrooms	N/A	Plaster Ceiling		NAD	1200	SF	0	SF				N/A	N/A	N/A
1	UL	Narrow Hallway outside of Lab Classrooms	S	Fireproofing	8140/01/UL/KK	Confirmed	1200	SF	0	SF		Above Plaster Ceiling		1	No	1/D

## 8140 Meehan MS 2015 2016 AHERA Three-Year Report.xls

		School District of Philadelphia Austin Meehan Middle School 3001 Ryan Avenue, Philadelphia, PA 19152 ULCS# 8140 Year Built: 1970		AHERA Three-Year Reinspection 2015-2016 Room by Room Location Log Report							Reinspection Date: October 28, 2015 Building Inspector: Bernard J Bryson Number: ACC-0125-6-031 Management Planner: Megan Vala Number: 740728					
E l e m e n t	F l o o r	On Site Room Name	System Affected	Material Description	HID#	Confirmed/Assumed/NAD/ Non Suspect ACM	Amount of Material	SF LF EA	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic/ Crawl Space Ranking	Damage Potential (DP)	Newly Friable (NF)	Response Action (RA)
1	UL	Men's Restroom 158B	N/A	Ceramic Tile Floors		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A
1	UL	Men's Restroom 158B	N/A	Plaster Walls		NAD	600	SF	0	SF				N/A	N/A	N/A
1	UL	Men's Restroom 158B	N/A	Plaster Ceiling		NAD	200	SF	0	SF				N/A	N/A	N/A
1	UL	Men's Restroom 158B	S	Fireproofing	8140/01/UL/KK	Confirmed	200	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	UL	Women's Restroom 158C	N/A	Ceramic Tile Floors		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A
1	UL	Women's Restroom 158C	N/A	Plaster Walls		NAD	600	SF	0	SF				N/A	N/A	N/A
1	UL	Women's Restroom 158C	N/A	Plaster Ceiling		NAD	200	SF	0	SF				N/A	N/A	N/A
1	UL	Women's Restroom 158C	S	Fireproofing	8140/01/UL/KK	Confirmed	200	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	UL	Men's Restroom 258B	N/A	Ceramic Tile Floors		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A
1	UL	Men's Restroom 258B	N/A	Plaster Walls		NAD	600	SF	0	SF				N/A	N/A	N/A
1	UL	Men's Restroom 258B	N/A	Plaster Ceiling		NAD	200	SF	0	SF				N/A	N/A	N/A
1	UL	Men's Restroom 258B	S	Fireproofing	8140/01/UL/KK	Confirmed	200	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	UL	Women's Restroom 258C	N/A	Ceramic Tile Floors		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A
1	UL	Women's Restroom 258C	N/A	Plaster Walls		NAD	600	SF	0	SF				N/A	N/A	N/A
1	UL	Women's Restroom 258C	N/A	Plaster Ceiling		NAD	200	SF	0	SF				N/A	N/A	N/A
1	UL	Women's Restroom 258C	S	Fireproofing	8140/01/UL/KK	Confirmed	200	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	UL	Men's Restroom 358B	N/A	Ceramic Tile Floors		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A
1	UL	Men's Restroom 358B	N/A	Plaster Walls		NAD	600	SF	0	SF				N/A	N/A	N/A
1	UL	Men's Restroom 358B	N/A	Plaster Ceiling		NAD	200	SF	0	SF				N/A	N/A	N/A
1	UL	Men's Restroom 358B	S	Fireproofing	8140/01/UL/KK	Confirmed	200	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	UL	Women's Restroom 358C	N/A	Ceramic Tile Floors		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A
1	UL	Women's Restroom 358C	N/A	Plaster Walls		NAD	600	SF	0	SF				N/A	N/A	N/A
1	UL	Women's Restroom 358C	N/A	Plaster Ceiling		NAD	200	SF	0	SF				N/A	N/A	N/A
1	UL	Women's Restroom 358C	S	Fireproofing	8140/01/UL/KK	Confirmed	200	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	UL	Classroom 121	M	Floor Tile VAT 12" x 12"	8140/01/UL/JJ	Assumed	800	SF	0	SF	Grey			1	No	1/D
1	UL	Classroom 121	N/A	Plaster Walls		NAD	2400	SF	0	SF				N/A	N/A	N/A
1	UL	Classroom 121	N/A	Plaster Ceiling		NAD	800	SF	0	SF				N/A	N/A	N/A
1	UL	Classroom 121	S	Fireproofing	8140/01/UL/KK	Confirmed	800	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	UL	Classroom 121	N/A	Ceiling Tile 1' x 1'		NAD	120	SF	0	SF		Applied to Upper Walls		N/A	N/A	N/A
1	UL	Classroom 121	M	Blackboard Glue Dots	8140/01/UL/SYN/BB/2600	Assumed	200	SF	0	SF		Blackboard/Tackboard		1	No	1/D
1	UL	Classroom 122	M	Floor Tile VAT 12" x 12"	8140/01/UL/JJ	Assumed	800	SF	0	SF	Grey			1	No	1/D
1	UL	Classroom 122	N/A	Plaster Walls		NAD	2400	SF	0	SF				N/A	N/A	N/A
1	UL	Classroom 122	N/A	Plaster Ceiling		NAD	800	SF	0	SF				N/A	N/A	N/A
1	UL	Classroom 122	S	Fireproofing	8140/01/UL/KK	Confirmed	800	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	UL	Classroom 122	N/A	Ceiling Tile 1' x 1'		NAD	120	SF	0	SF		Applied to Upper Walls		N/A	N/A	N/A
1	UL	Classroom 122	M	Blackboard Glue Dots	8140/01/UL/SYN/BB/2600	Assumed	200	SF	0	SF		Blackboard/Tackboard		1	No	1/D
1	UL	Classroom 123	M	Floor Tile VAT 12" x 12"	8140/01/UL/JJ	Assumed	800	SF	0	SF	Grey			1	No	1/D
1	UL	Classroom 123	N/A	Plaster Walls		NAD	2400	SF	0	SF				N/A	N/A	N/A
1	UL	Classroom 123	N/A	Plaster Ceiling		NAD	800	SF	0	SF				N/A	N/A	N/A
1	UL	Classroom 123	S	Fireproofing	8140/01/UL/KK	Confirmed	800	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	UL	Classroom 123	N/A	Ceiling Tile 1' x 1'		NAD	120	SF	0	SF		Applied to Upper Walls		N/A	N/A	N/A
1	UL	Classroom 123	M	Blackboard Glue Dots	8140/01/UL/SYN/BB/2600	Assumed	200	SF	0	SF		Blackboard/Tackboard		1	No	1/D
1	UL	Classroom 124	M	Floor Tile VAT 12" x 12"	8140/01/UL/JJ	Assumed	800	SF	0	SF	Grey			1	No	1/D
1	UL	Classroom 124	N/A	Plaster Walls		NAD	2400	SF	0	SF				N/A	N/A	N/A
1	UL	Classroom 124	N/A	Plaster Ceiling		NAD	800	SF	0	SF				N/A	N/A	N/A
1	UL	Classroom 124	S	Fireproofing	8140/01/UL/KK	Confirmed	800	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	UL	Classroom 124	N/A	Ceiling Tile 1' x 1'		NAD	120	SF	0	SF		Applied to Upper Walls		N/A	N/A	N/A
1	UL	Classroom 124	M	Blackboard Glue Dots	8140/01/UL/SYN/BB/2600	Assumed	200	SF	0	SF		Blackboard/Tackboard		1	No	1/D
1	UL	Classroom 125	M	Floor Tile VAT 12" x 12"	8140/01/UL/JJ	Assumed	800	SF	0	SF	Grey			1	No	1/D
1	UL	Classroom 125	N/A	Plaster Walls		NAD	2400	SF	0	SF				N/A	N/A	N/A
1	UL	Classroom 125	N/A	Plaster Ceiling		NAD	800	SF	0	SF				N/A	N/A	N/A
1	UL	Classroom 125	S	Fireproofing	8140/01/UL/KK	Confirmed	800	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	UL	Classroom 125	N/A	Ceiling Tile 1' x 1'		NAD	120	SF	0	SF		Applied to Upper Walls		N/A	N/A	N/A
1	UL	Classroom 125	M	Blackboard Glue Dots	8140/01/UL/SYN/BB/2600	Assumed	200	SF	0	SF		Blackboard/Tackboard		1	No	1/D
1	UL	Classroom 126	M	Floor Tile VAT 12" x 12"	8140/01/UL/JJ	Assumed	800	SF	0	SF	Grey			1	No	1/D
1	UL	Classroom 126	N/A	Plaster Walls		NAD	2400	SF	0	SF				N/A	N/A	N/A
1	UL	Classroom 126	N/A	Plaster Ceiling		NAD	800	SF	0	SF				N/A	N/A	N/A
1	UL	Classroom 126	S	Fireproofing	8140/01/UL/KK	Confirmed	800	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	UL	Classroom 126	N/A	Ceiling Tile 1' x 1'		NAD	120	SF	0	SF		Applied to Upper Walls		N/A	N/A	N/A
1	UL	Classroom 127	M	Blackboard Glue Dots	8140/01/UL/SYN/BB/2600	Assumed	200	SF	0	SF		Blackboard/Tackboard		1	No	1/D
1	UL	Classroom 127	M	Floor Tile VAT 12" x 12"	8140/01/UL/JJ	Assumed	800	SF	0	SF	Grey			1	No	1/D
1	UL	Classroom 127	N/A	Plaster Walls		NAD	2400	SF	0	SF				N/A	N/A	N/A
1	UL	Classroom 127	N/A	Plaster Ceiling		NAD	800	SF	0	SF				N/A	N/A	N/A
1	UL	Classroom 127	S	Fireproofing	8140/01/UL/KK	Confirmed	800	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	UL	Classroom 127	N/A	Ceiling Tile 1' x 1'		NAD	120	SF	0	SF		Applied to Upper Walls		N/A	N/A	N/A
1	UL	Classroom 127	M	Blackboard Glue Dots	8140/01/UL/SYN/BB/2600	Assumed	200	SF	0	SF		Blackboard/Tackboard		1	No	1/D
1	UL	Classroom 128	M	Floor Tile VAT 12" x 12"	8140/01/UL/JJ	Assumed	800	SF	0	SF	Grey			1	No	1/D
1	UL	Classroom 128	N/A	Plaster Walls		NAD	2400	SF	0	SF				N/A	N/A	N/A
1	UL	Classroom 128	N/A	Plaster Ceiling		NAD	800	SF	0	SF				N/A	N/A	N/A
1	UL	Classroom 128	S	Fireproofing	8140/01/UL/KK	Confirmed	800	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	UL	Classroom 128	N/A	Ceiling Tile 1' x 1'		NAD	120	SF	0	SF		Applied to Upper Walls		N/A	N/A	N/A
1	UL	Classroom 128	M	Blackboard Glue Dots	8140/01/UL/SYN/BB/2600	Assumed	200	SF	0	SF		Blackboard/Tackboard		1	No	1/D
1	UL	Classroom 221	M	Floor Tile VAT 12" x 12"	8140/01/UL/JJ	Assumed	800	SF	0	SF	Grey			1	No	1/D
1	UL	Classroom 221	N/A	Plaster Walls		NAD	2400	SF	0	SF				N/A	N/A	N/A

## 8140 Meehan MS 2015 2016 AHERA Three-Year Report.xls

		School District of Philadelphia Austin Meehan Middle School 3001 Ryan Avenue, Philadelphia, PA 19152 ULCS# 8140 Year Built: 1970		<b>AHERA Three-Year Reinspection 2015-2016 Room by Room Location Log Report</b>							Reinspection Date: October 28, 2015 Building Inspector: Bernard J Bryson Number: ACC-0125-6-031 Management Planner: Megan Vala Number: 740728					
E l e m e n t	F l o o r	On Site Room Name	System Affected	Material Description	HID#	Confirmed/Assumed/NAD/ Non Suspect ACM	Amount of Material	SF LF EA	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic/ Crawl Space Ranking	Damage Potential (DP)	Newly Friable (NF)	Response Action (RA)
1	UL	Classroom 221	N/A	Plaster Ceiling		NAD	800	SF	0	SF				N/A	N/A	N/A
1	UL	Classroom 221	S	Fireproofing	8140/01/UL/KK	Confirmed	800	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	UL	Classroom 221	N/A	Ceiling Tile 1' x 1'		NAD	120	SF	0	SF		Applied to Upper Walls		N/A	N/A	N/A
1	UL	Classroom 221	M	Blackboard Glue Dots	8140/01/UL/SYN/BB/2600	Assumed	200	SF	0	SF		Blackboard/Tackboard		1	No	1/D
1	UL	Classroom 222	M	Floor Tile VAT 12" x 12"	8140/01/UL/JJ	Assumed	800	SF	0	SF	Grey			1	No	1/D
1	UL	Classroom 222	N/A	Plaster Walls		NAD	2400	SF	0	SF				N/A	N/A	N/A
1	UL	Classroom 222	N/A	Plaster Ceiling		NAD	800	SF	0	SF				N/A	N/A	N/A
1	UL	Classroom 222	S	Fireproofing	8140/01/UL/KK	Confirmed	800	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	UL	Classroom 222	N/A	Ceiling Tile 1' x 1'		NAD	120	SF	0	SF		Applied to Upper Walls		N/A	N/A	N/A
1	UL	Classroom 222	M	Blackboard Glue Dots	8140/01/UL/SYN/BB/2600	Assumed	200	SF	0	SF		Blackboard/Tackboard		1	No	1/D
1	UL	Classroom 223	M	Floor Tile VAT 12" x 12"	8140/01/UL/JJ	Assumed	800	SF	0	SF	Grey			1	No	1/D
1	UL	Classroom 223	N/A	Plaster Walls		NAD	2400	SF	0	SF				N/A	N/A	N/A
1	UL	Classroom 223	N/A	Plaster Ceiling		NAD	800	SF	0	SF				N/A	N/A	N/A
1	UL	Classroom 223	S	Fireproofing	8140/01/UL/KK	Confirmed	800	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	UL	Classroom 223	N/A	Ceiling Tile 1' x 1'		NAD	120	SF	0	SF		Applied to Upper Walls		N/A	N/A	N/A
1	UL	Classroom 223	M	Blackboard Glue Dots	8140/01/UL/SYN/BB/2600	Assumed	200	SF	0	SF		Blackboard/Tackboard		1	No	1/D
1	UL	Classroom 224	M	Floor Tile VAT 12" x 12"	8140/01/UL/JJ	Assumed	800	SF	0	SF	Grey			1	No	1/D
1	UL	Classroom 224	N/A	Plaster Walls		NAD	2400	SF	0	SF				N/A	N/A	N/A
1	UL	Classroom 224	N/A	Plaster Ceiling		NAD	800	SF	0	SF				N/A	N/A	N/A
1	UL	Classroom 224	S	Fireproofing	8140/01/UL/KK	Confirmed	800	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	UL	Classroom 224	N/A	Ceiling Tile 1' x 1'		NAD	120	SF	0	SF		Applied to Upper Walls		N/A	N/A	N/A
1	UL	Classroom 224	M	Blackboard Glue Dots	8140/01/UL/SYN/BB/2600	Assumed	200	SF	0	SF		Blackboard/Tackboard		1	No	1/D
1	UL	Classroom 225	M	Floor Tile VAT 12" x 12"	8140/01/UL/JJ	Assumed	800	SF	0	SF	Grey			1	No	1/D
1	UL	Classroom 225	N/A	Plaster Walls		NAD	2400	SF	0	SF				N/A	N/A	N/A
1	UL	Classroom 225	N/A	Plaster Ceiling		NAD	800	SF	0	SF				N/A	N/A	N/A
1	UL	Classroom 225	S	Fireproofing	8140/01/UL/KK	Confirmed	800	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	UL	Classroom 225	N/A	Ceiling Tile 1' x 1'		NAD	120	SF	0	SF		Applied to Upper Walls		N/A	N/A	N/A
1	UL	Classroom 225	M	Blackboard Glue Dots	8140/01/UL/SYN/BB/2600	Assumed	200	SF	0	SF		Blackboard/Tackboard		1	No	1/D
1	UL	Classroom 226	M	Floor Tile VAT 12" x 12"	8140/01/UL/JJ	Assumed	800	SF	0	SF	Grey			1	No	1/D
1	UL	Classroom 226	N/A	Plaster Walls		NAD	2400	SF	0	SF				N/A	N/A	N/A
1	UL	Classroom 226	N/A	Plaster Ceiling		NAD	800	SF	0	SF				N/A	N/A	N/A
1	UL	Classroom 226	S	Fireproofing	8140/01/UL/KK	Confirmed	800	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	UL	Classroom 226	N/A	Ceiling Tile 1' x 1'		NAD	120	SF	0	SF		Applied to Upper Walls		N/A	N/A	N/A
1	UL	Classroom 226	M	Blackboard Glue Dots	8140/01/UL/SYN/BB/2600	Assumed	200	SF	0	SF		Blackboard/Tackboard		1	No	1/D
1	UL	Classroom 227	M	Floor Tile VAT 12" x 12"	8140/01/UL/JJ	Assumed	800	SF	0	SF	Grey			1	No	1/D
1	UL	Classroom 227	N/A	Plaster Walls		NAD	2400	SF	0	SF				N/A	N/A	N/A
1	UL	Classroom 227	N/A	Plaster Ceiling		NAD	800	SF	0	SF				N/A	N/A	N/A
1	UL	Classroom 227	S	Fireproofing	8140/01/UL/KK	Confirmed	800	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	UL	Classroom 227	N/A	Ceiling Tile 1' x 1'		NAD	120	SF	0	SF		Applied to Upper Walls		N/A	N/A	N/A
1	UL	Classroom 227	M	Blackboard Glue Dots	8140/01/UL/SYN/BB/2600	Assumed	200	SF	0	SF		Blackboard/Tackboard		1	No	1/D
1	UL	Classroom 228	M	Floor Tile VAT 12" x 12"	8140/01/UL/JJ	Assumed	800	SF	0	SF	Grey			1	No	1/D
1	UL	Classroom 228	N/A	Plaster Walls		NAD	2400	SF	0	SF				N/A	N/A	N/A
1	UL	Classroom 228	N/A	Plaster Ceiling		NAD	800	SF	0	SF				N/A	N/A	N/A
1	UL	Classroom 228	S	Fireproofing	8140/01/UL/KK	Confirmed	800	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	UL	Classroom 228	N/A	Ceiling Tile 1' x 1'		NAD	120	SF	0	SF		Applied to Upper Walls		N/A	N/A	N/A
1	UL	Classroom 228	M	Blackboard Glue Dots	8140/01/UL/SYN/BB/2600	Assumed	200	SF	0	SF		Blackboard/Tackboard		1	No	1/D
1	UL	Classroom 321	M	Floor Tile VAT 12" x 12"	8140/01/UL/JJ	Assumed	800	SF	0	SF	Grey			1	No	1/D
1	UL	Classroom 321	N/A	Plaster Walls		NAD	2400	SF	0	SF				N/A	N/A	N/A
1	UL	Classroom 321	S	Fireproofing	8140/01/UL/KK	Confirmed	800	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	UL	Classroom 321	N/A	Ceiling Tile 1' x 1'		NAD	120	SF	0	SF		Applied to Upper Walls		N/A	N/A	N/A
1	UL	Classroom 321	M	Blackboard Glue Dots	8140/01/UL/SYN/BB/2600	Assumed	200	SF	0	SF		Blackboard/Tackboard		1	No	1/D
1	UL	Classroom 322	M	Floor Tile VAT 12" x 12"	8140/01/UL/JJ	Assumed	800	SF	0	SF	Grey			1	No	1/D
1	UL	Classroom 322	N/A	Plaster Walls		NAD	2400	SF	0	SF				N/A	N/A	N/A
1	UL	Classroom 322	N/A	Plaster Ceiling		NAD	800	SF	0	SF				N/A	N/A	N/A
1	UL	Classroom 322	S	Fireproofing	8140/01/UL/KK	Confirmed	800	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	UL	Classroom 322	N/A	Ceiling Tile 1' x 1'		NAD	120	SF	0	SF		Applied to Upper Walls		N/A	N/A	N/A
1	UL	Classroom 322	M	Blackboard Glue Dots	8140/01/UL/SYN/BB/2600	Assumed	200	SF	0	SF		Blackboard/Tackboard		1	No	1/D
1	UL	Classroom 323	M	Floor Tile VAT 12" x 12"	8140/01/UL/JJ	Assumed	800	SF	0	SF	Grey			1	No	1/D
1	UL	Classroom 323	N/A	Plaster Walls		NAD	2400	SF	0	SF				N/A	N/A	N/A
1	UL	Classroom 323	N/A	Plaster Ceiling		NAD	800	SF	0	SF				N/A	N/A	N/A
1	UL	Classroom 323	S	Fireproofing	8140/01/UL/KK	Confirmed	800	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	UL	Classroom 323	N/A	Ceiling Tile 1' x 1'		NAD	120	SF	0	SF		Applied to Upper Walls		N/A	N/A	N/A
1	UL	Classroom 323	M	Blackboard Glue Dots	8140/01/UL/SYN/BB/2600	Assumed	200	SF	0	SF		Blackboard/Tackboard		1	No	1/D
1	UL	Classroom 324	M	Floor Tile VAT 12" x 12"	8140/01/UL/JJ	Assumed	800	SF	0	SF	Grey			1	No	1/D
1	UL	Classroom 324	N/A	Plaster Walls		NAD	2400	SF	0	SF				N/A	N/A	N/A
1	UL	Classroom 324	N/A	Plaster Ceiling		NAD	800	SF	0	SF				N/A	N/A	N/A
1	UL	Classroom 324	S	Fireproofing	8140/01/UL/KK	Confirmed	800	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	UL	Classroom 324	N/A	Ceiling Tile 1' x 1'		NAD	120	SF	0	SF		Applied to Upper Walls		N/A	N/A	N/A
1	UL	Classroom 324	M	Blackboard Glue Dots	8140/01/UL/SYN/BB/2600	Assumed	200	SF	0	SF		Blackboard/Tackboard		1	No	1/D
1	UL	Classroom 325	M	Floor Tile VAT 12" x 12"	8140/01/UL/JJ	Assumed	800	SF	0	SF	Grey			1	No	1/D
1	UL	Classroom 325	N/A	Plaster Walls		NAD	2400	SF	0	SF				N/A	N/A	N/A
1	UL	Classroom 325	N/A	Plaster Ceiling		NAD	800	SF	0	SF				N/A	N/A	N/A
1	UL	Classroom 325	S	Fireproofing	8140/01/UL/KK	Confirmed	800	SF	0	SF		Above Plaster Ceiling		1	No	1/D

## 8140 Meehan MS 2015 2016 AHERA Three-Year Report.xls

		School District of Philadelphia Austin Meehan Middle School 3001 Ryan Avenue, Philadelphia, PA 19152 ULCS# 8140 Year Built: 1970		<b>AHERA Three-Year Reinspection 2015-2016 Room by Room Location Log Report</b>							Reinspection Date: October 28, 2015 Building Inspector: Bernard J Bryson Number: ACC-0125-6-031 Management Planner: Megan Vala Number: 740728					
E l e m e n t	F l o o r	On Site Room Name	System Affected	Material Description	HID#	Confirmed/Assumed/NAD/ Non Suspect ACM	Amount of Material	SF LF EA	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic/ Crawl Space Ranking	Damage Potential (DP)	Newly Friable (NF)	Response Action (RA)
1	UL	Classroom 325	N/A	Ceiling Tile 1' x 1'		NAD	120	SF	0	SF		Applied to Upper Walls		N/A	N/A	N/A
1	UL	Classroom 325	M	Blackboard Glue Dots	8140/01/UL/SYN/BB/2600	Assumed	200	SF	0	SF		Blackboard/Tackboard		1	No	1/D
1	UL	Classroom 326	M	Floor Tile VAT 12" x 12"	8140/01/UL/JJ	Assumed	800	SF	0	SF	Grey			1	No	1/D
1	UL	Classroom 326	N/A	Plaster Walls		NAD	2400	SF	0	SF				N/A	N/A	N/A
1	UL	Classroom 326	N/A	Plaster Ceiling		NAD	800	SF	0	SF				N/A	N/A	N/A
1	UL	Classroom 326	S	Fireproofing	8140/01/UL/KK	Confirmed	800	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	UL	Classroom 326	N/A	Ceiling Tile 1' x 1'		NAD	120	SF	0	SF		Applied to Upper Walls		N/A	N/A	N/A
1	UL	Classroom 326	M	Blackboard Glue Dots	8140/01/UL/SYN/BB/2600	Assumed	200	SF	0	SF		Blackboard/Tackboard		1	No	1/D
1	UL	Classroom 327	M	Floor Tile VAT 12" x 12"	8140/01/UL/JJ	Assumed	800	SF	0	SF	Grey			1	No	1/D
1	UL	Classroom 327	N/A	Plaster Walls		NAD	2400	SF	0	SF				N/A	N/A	N/A
1	UL	Classroom 327	N/A	Plaster Ceiling		NAD	800	SF	0	SF				N/A	N/A	N/A
1	UL	Classroom 327	S	Fireproofing	8140/01/UL/KK	Confirmed	800	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	UL	Classroom 327	N/A	Ceiling Tile 1' x 1'		NAD	120	SF	0	SF		Applied to Upper Walls		N/A	N/A	N/A
1	UL	Classroom 327	M	Blackboard Glue Dots	8140/01/UL/SYN/BB/2600	Assumed	200	SF	0	SF		Blackboard/Tackboard		1	No	1/D
1	UL	Classroom 328	M	Floor Tile VAT 12" x 12"	8140/01/UL/JJ	Assumed	800	SF	0	SF	Grey			1	No	1/D
1	UL	Classroom 328	N/A	Plaster Walls		NAD	2400	SF	0	SF				N/A	N/A	N/A
1	UL	Classroom 328	N/A	Plaster Ceiling		NAD	800	SF	0	SF				N/A	N/A	N/A
1	UL	Classroom 328	S	Fireproofing	8140/01/UL/KK	Confirmed	800	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	UL	Classroom 328	N/A	Ceiling Tile 1' x 1'		NAD	120	SF	0	SF		Applied to Upper Walls		N/A	N/A	N/A
1	UL	Classroom 328	M	Blackboard Glue Dots	8140/01/UL/SYN/BB/2600	Assumed	200	SF	0	SF		Blackboard/Tackboard		1	No	1/D
1	UL	Classroom 421	M	Floor Tile VAT 12" x 12"	8140/01/UL/JJ	Assumed	800	SF	0	SF	Grey			1	No	1/D
1	UL	Classroom 421	N/A	Plaster Walls		NAD	2400	SF	0	SF				N/A	N/A	N/A
1	UL	Classroom 421	N/A	Plaster Ceiling		NAD	800	SF	0	SF				N/A	N/A	N/A
1	UL	Classroom 421	S	Fireproofing	8140/01/UL/KK	Confirmed	800	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	UL	Classroom 421	N/A	Ceiling Tile 1' x 1'		NAD	120	SF	0	SF		Applied to Upper Walls		N/A	N/A	N/A
1	UL	Classroom 421	M	Blackboard Glue Dots	8140/01/UL/SYN/BB/2600	Assumed	200	SF	0	SF		Blackboard/Tackboard		1	No	1/D
1	UL	Classroom 422	M	Floor Tile VAT 12" x 12"	8140/01/UL/JJ	Assumed	800	SF	0	SF	Brown			1	No	1/D
1	UL	Classroom 422	N/A	Plaster Walls		NAD	2400	SF	0	SF				N/A	N/A	N/A
1	UL	Classroom 422	N/A	Plaster Ceiling		NAD	800	SF	0	SF				N/A	N/A	N/A
1	UL	Classroom 422	S	Fireproofing	8140/01/UL/KK	Confirmed	800	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	UL	Classroom 422	N/A	Ceiling Tile 1' x 1'		NAD	120	SF	0	SF		Applied to Upper Walls		N/A	N/A	N/A
1	UL	Classroom 422	M	Blackboard Glue Dots	8140/01/UL/SYN/BB/2600	Assumed	200	SF	0	SF		Blackboard/Tackboard		1	No	1/D
1	UL	Classroom 423	M	Floor Tile VAT 12" x 12"	8140/01/UL/JJ	Assumed	800	SF	0	SF	Brown			1	No	1/D
1	UL	Classroom 423	N/A	Plaster Walls		NAD	2400	SF	0	SF				N/A	N/A	N/A
1	UL	Classroom 423	N/A	Plaster Ceiling		NAD	800	SF	0	SF				N/A	N/A	N/A
1	UL	Classroom 423	S	Fireproofing	8140/01/UL/KK	Confirmed	800	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	UL	Classroom 423	N/A	Ceiling Tile 1' x 1'		NAD	120	SF	0	SF		Applied to Upper Walls		N/A	N/A	N/A
1	UL	Classroom 423	M	Blackboard Glue Dots	8140/01/UL/SYN/BB/2600	Assumed	200	SF	0	SF		Blackboard/Tackboard		1	No	1/D
1	UL	Classroom 424	M	Floor Tile VAT 12" x 12"	8140/01/UL/JJ	Assumed	800	SF	0	SF	White			1	No	1/D
1	UL	Classroom 424	N/A	Plaster Walls		NAD	2400	SF	0	SF				N/A	N/A	N/A
1	UL	Classroom 424	N/A	Plaster Ceiling		NAD	800	SF	0	SF				N/A	N/A	N/A
1	UL	Classroom 424	S	Fireproofing	8140/01/UL/KK	Confirmed	800	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	UL	Classroom 424	N/A	Ceiling Tile 1' x 1'		NAD	120	SF	0	SF		Applied to Upper Walls		N/A	N/A	N/A
1	UL	Classroom 424	M	Blackboard Glue Dots	8140/01/UL/SYN/BB/2600	Assumed	200	SF	0	SF		Blackboard/Tackboard		1	No	1/D
1	UL	Classroom 425	M	Floor Tile VAT 12" x 12"	8140/01/UL/JJ	Assumed	800	SF	0	SF	White			1	No	1/D
1	UL	Classroom 425	N/A	Plaster Walls		NAD	2400	SF	0	SF				N/A	N/A	N/A
1	UL	Classroom 425	N/A	Plaster Ceiling		NAD	800	SF	0	SF				N/A	N/A	N/A
1	UL	Classroom 425	S	Fireproofing	8140/01/UL/KK	Confirmed	800	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	UL	Classroom 425	N/A	Ceiling Tile 1' x 1'		NAD	120	SF	0	SF		Applied to Upper Walls		N/A	N/A	N/A
1	UL	Classroom 425	M	Blackboard Glue Dots	8140/01/UL/SYN/BB/2600	Assumed	200	SF	0	SF		Blackboard/Tackboard		1	No	1/D
1	UL	Classroom 426	M	Floor Tile VAT 12" x 12"	8140/01/UL/JJ	Assumed	800	SF	0	SF	White			1	No	1/D
1	UL	Classroom 426	N/A	Plaster Walls		NAD	2400	SF	0	SF				N/A	N/A	N/A
1	UL	Classroom 426	N/A	Plaster Ceiling		NAD	800	SF	0	SF				N/A	N/A	N/A
1	UL	Classroom 426	S	Fireproofing	8140/01/UL/KK	Confirmed	800	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	UL	Classroom 426	N/A	Ceiling Tile 1' x 1'		NAD	120	SF	0	SF		Applied to Upper Walls		N/A	N/A	N/A
1	UL	Classroom 426	M	Blackboard Glue Dots	8140/01/UL/SYN/BB/2600	Assumed	200	SF	0	SF		Blackboard/Tackboard		1	No	1/D
1	UL	Classroom 427	M	Floor Tile VAT 12" x 12"	8140/01/UL/JJ	Assumed	800	SF	0	SF	White			1	No	1/D
1	UL	Classroom 427	N/A	Plaster Walls		NAD	2400	SF	0	SF				N/A	N/A	N/A
1	UL	Classroom 427	N/A	Plaster Ceiling		NAD	800	SF	0	SF				N/A	N/A	N/A
1	UL	Classroom 427	S	Fireproofing	8140/01/UL/KK	Confirmed	800	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	UL	Classroom 427	N/A	Ceiling Tile 1' x 1'		NAD	120	SF	0	SF		Applied to Upper Walls		N/A	N/A	N/A
1	UL	Classroom 427	M	Blackboard Glue Dots	8140/01/UL/SYN/BB/2600	Assumed	200	SF	0	SF		Blackboard/Tackboard		1	No	1/D
1	UL	Classroom 428	M	Floor Tile VAT 12" x 12"	8140/01/UL/JJ	Assumed	800	SF	0	SF	Brown			1	No	1/D
1	UL	Classroom 428	N/A	Plaster Walls		NAD	2400	SF	0	SF				N/A	N/A	N/A
1	UL	Classroom 428	N/A	Plaster Ceiling		NAD	800	SF	0	SF				N/A	N/A	N/A
1	UL	Classroom 428	S	Fireproofing	8140/01/UL/KK	Confirmed	800	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	UL	Classroom 428	N/A	Ceiling Tile 1' x 1'		NAD	120	SF	0	SF		Applied to Upper Walls		N/A	N/A	N/A
1	UL	Classroom 428	M	Blackboard Glue Dots	8140/01/UL/SYN/BB/2600	Assumed	200	SF	0	SF		Blackboard/Tackboard		1	No	1/D
1	UL	Office 429	M	Floor Tile VAT 12" x 12"	8140/01/UL/JJ	Assumed	800	SF	0	SF	Pink			1	No	1/D
1	UL	Office 429	N/A	Plaster Walls		NAD	2400	SF	0	SF				N/A	N/A	N/A
1	UL	Office 429	N/A	Plaster Ceiling		NAD	800	SF	0	SF				N/A	N/A	N/A
1	UL	Office 429	S	Fireproofing	8140/01/UL/KK	Confirmed	800	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	UL	Counselor's Office 429B	M	Floor Tile VAT 12" x 12"	8140/01/UL/JJ	Assumed	800	SF	0	SF	Pink			1	No	1/D
1	UL	Counselor's Office 429B	N/A	Plaster Walls		NAD	2400	SF	0	SF				N/A	N/A	N/A

8140 Meehan MS 2015 2016 AHERA Three-Year Report.xls

		School District of Philadelphia Austin Meehan Middle School 3001 Ryan Avenue, Philadelphia, PA 19152 ULCS# 8140 Year Built: 1970		AHERA Three-Year Reinspection 2015-2016 Room by Room Location Log Report							Reinspection Date: October 28, 2015 Building Inspector: Bernard J Bryson Number: ACC-0125-6-031 Management Planner: Megan Vala Number: 740728					
E l e m e n t	F l o o r	On Site Room Name	System Affected	Material Description	HID#	Confirmed/Assumed/NAD/ Non Suspect ACM	Amount of Material	SF LF EA	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic/ Crawl Space Ranking	Damage Potential (DP)	Newly Friable (NF)	Response Action (RA)
1	UL	Counselor's Office 429B	N/A	Plaster Ceiling		NAD	800	SF	0	SF				N/A	N/A	N/A
1	UL	Counselor's Office 429B	S	Fireproofing	8140/01/UL/KK	Confirmed	800	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	UL	Library 527	N/A	Carpet		Non Suspect ACM	4000	SF	0	SF		Includes 525, 527 and 528		N/A	N/A	N/A
1	UL	Library 527	N/A	Cement Floor		Non Suspect ACM	4000	SF	0	SF				N/A	N/A	N/A
1	UL	Library 527	N/A	Plaster Walls		NAD	12000	SF	0	SF				N/A	N/A	N/A
1	UL	Library 527	N/A	Plaster Ceiling		NAD	4000	SF	0	SF				N/A	N/A	N/A
1	UL	Library 527	S	Fireproofing	8140/01/UL/KK	Confirmed	4000	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	UL	Library IT Storage Room	M	Floor Tile VAT 12" x 12"	8140/01/UL/JJ	Assumed	200	SF	0	SF	Brown			1	No	1/D
1	UL	Library IT Storage Room	N/A	Plaster Walls		NAD	600	SF	0	SF				N/A	N/A	N/A
1	UL	Library IT Storage Room	N/A	Plaster Ceiling		NAD	200	SF	0	SF				N/A	N/A	N/A
1	UL	Library IT Storage Room	S	Fireproofing	8140/01/UL/KK	Confirmed	200	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	UL	Lab A 520	M	Floor Tile VAT 12" x 12"	8140/01/UL/JJ	Assumed	800	SF	0	SF	Brown			1	No	1/D
1	UL	Lab A 520	N/A	Plaster Walls		NAD	2400	SF	0	SF				N/A	N/A	N/A
1	UL	Lab A 520	N/A	Plaster Ceiling		NAD	800	SF	0	SF				N/A	N/A	N/A
1	UL	Lab A 520	S	Fireproofing	8140/01/UL/KK	Confirmed	800	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	UL	Lab A 520	M	Blackboard Glue Dots	8140/01/UL/SYN/BB/2600	Assumed	200	SF	0	SF		Blackboard/Tackboard		1	No	1/D
1	UL	Lab B 521	M	Floor Tile VAT 12" x 12"	8140/01/UL/JJ	Assumed	400	SF	0	SF	Brown			1	No	1/D
1	UL	Lab B 521	N/A	Plaster Walls		NAD	1200	SF	0	SF				N/A	N/A	N/A
1	UL	Lab B 521	N/A	Plaster Ceiling		NAD	400	SF	0	SF				N/A	N/A	N/A
1	UL	Lab B 521	S	Fireproofing	8140/01/UL/KK	Confirmed	400	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	UL	Lab B 521	M	Blackboard Glue Dots	8140/01/UL/SYN/BB/2600	Assumed	100	SF	0	SF		Blackboard/Tackboard		1	No	1/D
1	UL	Computer Lab C 522	M	Floor Tile VAT 12" x 12"	8140/01/UL/JJ	Assumed	800	SF	0	SF	Brown			1	No	1/D
1	UL	Computer Lab C 522	N/A	Plaster Walls		NAD	2400	SF	0	SF				N/A	N/A	N/A
1	UL	Computer Lab C 522	N/A	Plaster Ceiling		NAD	800	SF	0	SF				N/A	N/A	N/A
1	UL	Computer Lab C 522	S	Fireproofing	8140/01/UL/KK	Confirmed	800	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	UL	Computer Lab C 522	M	Blackboard Glue Dots	8140/01/UL/SYN/BB/2600	Assumed	200	SF	0	SF		Blackboard/Tackboard		1	No	1/D
1	UL	Computer Lab C 522	M	Sink Undercoat Mastic	8140/01/UL/SYN/BB/2602	Assumed	12	SF	0	SF		2 Sinks - 6 SF EA		1	No	1/D
1	UL	Office 523	M	Floor Tile VAT 12" x 12"	8140/01/UL/JJ	Assumed	200	SF	0	SF	Grey			1	No	1/D
1	UL	Office 523	N/A	Plaster Walls		NAD	600	SF	0	SF				N/A	N/A	N/A
1	UL	Office 523	N/A	Plaster Ceiling		NAD	200	SF	0	SF				N/A	N/A	N/A
1	UL	Office 523	S	Fireproofing	8140/01/UL/KK	Confirmed	200	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	UL	Women's Restroom 523A	N/A	Ceramic Tile Floors		Non Suspect ACM	50	SF	0	SF				N/A	N/A	N/A
1	UL	Women's Restroom 523A	N/A	Plaster Walls		NAD	150	SF	0	SF				N/A	N/A	N/A
1	UL	Women's Restroom 523A	N/A	Plaster Ceiling		NAD	50	SF	0	SF				N/A	N/A	N/A
1	UL	Women's Restroom 523A	S	Fireproofing	8140/01/UL/KK	Confirmed	50	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	UL	Men's Restroom 523B	N/A	Ceramic Tile Floors		Non Suspect ACM	50	SF	0	SF				N/A	N/A	N/A
1	UL	Men's Restroom 523B	N/A	Plaster Walls		NAD	150	SF	0	SF				N/A	N/A	N/A
1	UL	Men's Restroom 523B	N/A	Plaster Ceiling		NAD	50	SF	0	SF				N/A	N/A	N/A
1	UL	Men's Restroom 523B	S	Fireproofing	8140/01/UL/KK	Confirmed	50	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	UL	Storage Room 524	M	Floor Tile VAT 12" x 12"	8140/01/UL/JJ	Assumed	200	SF	0	SF	Brown			1	No	1/D
1	UL	Storage Room 524	N/A	Plaster Walls		NAD	750	SF	0	SF				N/A	N/A	N/A
1	UL	Storage Room 524	N/A	Plaster Ceiling		NAD	250	SF	0	SF				N/A	N/A	N/A
1	UL	Storage Room 524	S	Fireproofing	8140/01/UL/KK	Confirmed	250	SF	0	SF		Above Plaster Ceiling		1	No	1/D
1	E	Exterior - on underside of Upper Classroom Cantilevers	S	Fireproofing	8140/01/UL/KK	Confirmed	5000	SF	50	SF		Noticeable damage cause by impact; no dangling material or debris identified		2	Yes	5/A
1	A	Attic - None	X	X		X	X	X	X	X		None	None	X	X	X
1	C	Crawl Space - None	X	X		X	X	X	X	X		None	None	X	X	X

**Section III Certificates**

A. Management Planner/Building Inspector Certificates

## Section III – A

### Management Planner/Building Inspector Certificates

These charts indicate the Name, Course Date, Expiration Date and Corresponding Certificate Number of the Management Planner and Building Inspector of individuals that participated in the AHERA 3 Year Inspection and Management Plan process of 2015/2016.

Management Planner	Date Granted	Expiration Date	Certificate Number
Monique Causley	2/15/2015	2/16/2016	ACC-0215-8-010
Monique Causley	2/16/2016	2/17/2017	ACC-0216-8-001
Megan Vala	5/22/2015	6/22/2016	740728
Mary Anne Lerro	4/5/2016	4/5/2017	742327

Building Inspector	Date Granted	Expiration Date	Certificate Number
Scott Magee	8/15/2015	8/15/2016	70016699C
William Garrity	8/15/2015	8/15/2016	70016699A
Bernard Brunner	10/2/2015	8/2/2016	45397
Mary Anne Lerro	3/3/2015	3/3/2016	740092
Mary Anne Lerro	4/5/2016	4/5/2017	742322
James Madden	12/11/2014	12/11/2015	ACC-1214-6-010
James Madden	12/3/2015	12/3/2016	ACC-1215-6-018
Troy Ray	3/15/2015	3/19/2016	ACC-0355-6-011
Ananth Vinjamuri	9/29/2015	9/29/2016	374
Shelton Williams	9/29/2015	9/29/2016	375
Paul Davis	2/12/2015	2/12/2016	ACC-0215-6-015
Paul Davis	2/2/2016	2/2/2017	741836
Bernard Bryson	2/16/2015	2/16/2016	ACC-0125-6-031
Bernard Bryson	2/15/2016	2/15/2017	ACC-0216-6-005
Alexander Roman	9/18/2015	9/18/2016	EHSBIR-150619-008
Norm Harrison	9/2/2015	9/2/2016	ACC-0915-6-011
Kelly Mayberry	2/20/2015	2/20/2016	EHSBIR-150220-005
Kelly Mayberry	2/18/2016	2/18/2017	EHSBIR-160218-006
Andrew Hine	5/6/2015	5/6/2016	AI05042015-3
Maryellen Leotta	2/12/2015	2/12/2016	ACC-0215-6-024

# Certificate of Completion

awarded to

**Monique Causley**

*for successfully completing the prescribed course of study in*

**Pennsylvania Asbestos Management Planner  
Refresher Course**

under TSCA Title II

*presented by*

**ACCESS TRAINING SERVICES, INC.**  
7921 River Road, Pennsauken, NJ 08110  
(856) 665-3449

2/16/15

*Course Date*

N/A

*Exam Date*

2/16/16

*Expiration Date*

Not Provided

*Social Security Number*

ACC-0215-8-010

*Certificate Number*

**Mark K. Schläger**  
*Training Director*



# Certificate of Completion

awarded to

**Monique Causley**

*for successfully completing the prescribed course of study in*

**Pennsylvania Asbestos Management Planner  
Refresher Course**  
under TSCA Title II

*presented by*

**ACCESS TRAINING SERVICES, INC.**  
7921 River Road, Pennsauken, NJ 08110  
(856) 665-3449

2/15/16

Course Date

N/A

Exam Date

2/15/17

Expiration Date

Not Provided

Social Security Number

ACC-0216-8-001

Certificate Number

  
Mark K. Schlüger  
Training Director

# Certificate of Training

CRITERION LABORATORIES, INC.

HEREBY CERTIFIES THAT

Megan Vala

HAS SUCCESSFULLY COMPLETED A 16 HOUR COURSE ENTITLED

Asbestos Management Planner Initial

INCLUDING CLASSROOM INSTRUCTION

05/21/2015 to 05/22/2015

Exam passed on this 22nd day of May 2015 - Score - 94

Approved for AHERA Accreditation Under TSCA Title II

3370 Progress Drive, Suite J  
Bensalem, PA 19020  
(215) 244-1300 - Phone  
(215) 244-4349 - Fax  
www.criterionlabs.com

Course is conducted in English

DIRECTOR:

  
James A. Welts, CH, President

# Certificate of Training

CRITERION LABORATORIES, INC.

HEREBY CERTIFIES THAT

Mary Anne Lerro

HAS SUCCESSFULLY COMPLETED A 4 HOUR COURSE ENTITLED  
Asbestos Management Planner Refresher

INCLUDING CLASSROOM INSTRUCTION  
on this 5th day of April 2016

Approved for AHERA Accreditation Under TSCA Title II

3370 Progress Drive, Suite J  
Bensalem, PA 19020  
(215) 244-1300 - Phone  
(215) 244-4349 - Fax  
www.criterionlabs.com

Course is conducted in English

DIRECTOR:

  
James A. Waltz, CIH, President

# EMSL ANALYTICAL, INC.

Certifies that

Scott Magee

has successfully completed the course of study for the

## Asbestos Building Inspector Refresher Course

for Accreditation under TSCA Title II

EMSL Certificate No. 70016699C


### Approved by:

PA Dept. of Labor and Industry  
Accreditation # 137

Course Date: 8/15/2015  
Granted: 8/15/2015  
Expiration Date: 8/15/2016

Sponsored by:

EMSL Analytical, Inc.  
200 Route 130 North  
Cinnaminson, NJ 08077  
Phone: (800) 220-3675  
Fax: (856) 786-5973  
[www.emsl.com](http://www.emsl.com)

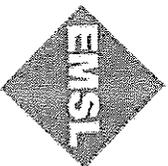

Michael P. Menz, CIH  
Training Director

Environmental, Mold, Bacteria, IAQ, Asbestos, Lead, Forensic and Materials Testing Since 1981

# EMSL ANALYTICAL, INC.

Certifies that

William Garrity

has successfully completed the course of study for the

## Asbestos Building Inspector Refresher Course

for Accreditation under TSCA Title II

EMSL Certificate No. 70016699A


**Approved by:**

PA Dept. of Labor and Industry  
Accreditation # 137

Course Date: 8/15/2015  
Granted: 8/15/2015  
Expiration Date: 8/15/2016

**Sponsored by:**

EMSL Analytical, Inc.  
200 Route 130 North  
Cinnaminson, NJ 08077  
Phone: (800) 220-3675  
Fax: (856) 786-5973  
[www.emsl.com](http://www.emsl.com)

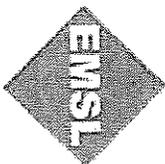

*Michael P. Menz*

Michael P. Menz, CIH  
Training Director

Environmental, Mold, Bacteria, IAQ, Asbestos, Lead, Forensic and Materials Testing Since 1981

45397

# National Asbestos & Environmental Training Institute

## CERTIFICATE OF COMPLETION

AHERA/EPA Accredited Per 40 CFR Part 763  
Asbestos Accreditation under TSCA Title II

*This is to certify that*


**Bernard Brunner, Jr.**

*Successfully completed the course entitled*

1/2-Day New York State/EPA/AHERA Asbestos Building Inspector Annual Refresher on  
October 2, 2015

*Examination Passed October 2, 2015*

*Expiration Date on October 2, 2016*

  
Doris L. Adler  
President, NAEETI

Per 10 NYCRR Part 73.2 (L) (1), DOH 2832 Certificate of Completion of Asbestos  
Safety Training is the only official record of training for N.Y.S. students.

Language: English

ABIH 1/2 CM POINT

3321 Doris Avenue, Building B, Ocean, NJ 07712

Phone (732) 531-5571

Fax (732) 531-5956

[www.naeti.com](http://www.naeti.com)

Number 740092

Expiration Date:  
03/03/2016

# Certificate of Training

CRITERION LABORATORIES, INC.

HEREBY CERTIFIES THAT

Mary Anne Lerro

HAS SUCCESSFULLY COMPLETED A 4 HOUR COURSE ENTITLED

Asbestos Building Inspector Refresher

on this 3rd day of March 2015

Exam passed on this 3rd day of March 2015 - Score - 84

Approved for AHERA Accreditation Under TSCA Title II

3370 Progress Drive, Suite J  
Bensalem, PA 19020  
(215) 244-1300 - Phone  
(215) 244-4349 - Fax  
www.criterionlabs.com

Course is conducted in English

DIRECTOR:



James A. Welts, CIH, President

# Certificate of Training

CRITERION LABORATORIES, INC.

HEREBY CERTIFIES THAT

Mary Anne Letro

HAS SUCCESSFULLY COMPLETED A 4 HOUR COURSE ENTITLED

Asbestos Building Inspector Refresher

INCLUDING CLASSROOM INSTRUCTION

on this 5th day of April 2016

Exam passed on this 5th day of April 2016 - Score - 88

Approved for AHERA Accreditation Under TSCA Title II

3370 Progress Drive, Suite J  
Bensalem, PA 19020  
(215) 244-1300 - Phone  
(215) 244-4349 - Fax  
www.criterionlabs.com

Course is conducted in English

DIRECTOR:



James A. Welts, CIH, President

# Certificate of Completion

**James Madden**

*for successfully completing the prescribed course of study in*

## **Pennsylvania Asbestos Building Inspector Refresher Course**

under TSCA Title II

*presented by*

**ACCESS TRAINING SERVICES, INC.**  
7921 River Road, Pennsauken, NJ 08110  
(856) 665-3449

12/11/14

*Course Date*

N/A

*Exam Date*

12/11/15

*Expiration Date*

Not Provided

*Social Security Number*

ACC-1214-6-010

*Certificate Number*

*Mark K. Schlager*  
Mark K. Schlager  
Training Director

# Certificate of Completion

**James Madden**

*for successfully completing the prescribed course of study in*

## **Pennsylvania Asbestos Building Inspector Refresher Course**

under TSCA Title II

*presented by*

**ACCESS TRAINING SERVICES, INC.**  
7921 River Road, Pennsauken, NJ 08110  
(856) 665-3449

12/3/15  
*Course Date*

N/A  
*Exam Date*

12/3/16  
*Expiration Date*

Not Provided  
*Social Security Number*

ACC-1215-6-018  
*Certificate Number*

  
Mark K. Schlager  
*Training Director*

# Certificate of Completion

**Troy A. Ray**

*for successfully completing the prescribed course of study in*

## **Pennsylvania Asbestos Building Inspector Refresher Course**

under TSCA Title II

*presented by*

**ACCESS TRAINING SERVICES, INC.  
7921 River Road, Pennsauken, NJ 08110  
(856) 665-3449**

**3/19/15**

*Course Date*

**N/A**

*Exam Date*

**3/19/16**

*Expiration Date*

**Not Provided**

*Social Security Number*

**ACC-0355-6-011**

*Certificate Number*

**Mark K. Schlager**  
*Training Director*

CERTIFICATE NO 374

G&C Environmental Services, Inc. (#294)  
2 Street Road, Newtown Square, Pennsylvania 19073  
Telephone: (610) 993-9202 Facsimile: (610) 993-9232  
Email: Training@gcenviro.com  
www.GCenviro.com

This document certifies that Ananth K. Vinjammuri has successfully completed this  
State of New York Department of Health Approved AHERA BUILDING INSPECTOR

REFRESHER COURSE, completed as required for asbestos accreditation under the Toxic

Substances Control Act, Title II. This course was held from 09/29/2015 to 09/29/2015.

The examination date was 09/29/2015. This certificate expires one year from the date of  
successful completion of the examination 09/29/2016.

*The official record of successful training completion is the New York State Department of  
Health certificate of asbestos safety training completion (DPH 2832).*

Gail M. Conner  
Training Director

Gail M. Conner

CERTIFICATE NO 375

G&C Environmental Services, Inc. (#294)  
2 Street Road, Newtown Square, Pennsylvania 19073  
Telephone: (610) 993-9202 Facsimile: (610) 993-9232  
Email: Training@gcenviro.com  
www.GCenviro.com

This document certifies that Shelton Williams has successfully completed this  
State of New York Department of Health Approved AHERA BUILDING INSPECTOR

REFRESHER COURSE, completed as required for asbestos accreditation under the Toxic  
Substances Control Act, Title II. This course was held from 09/29/2015 to 09/29/2015.  
The examination date was 09/29/2015. This certificate expires one year from the date of  
successful completion of the examination 09/29/2016.

*The official record of successful training completion is the New York State Department of  
Health certificate of asbestos safety training completion (DPH 2832).*

Gail M. Conner  
Training Director  
  
Gail M. Conner

# Certificate of Completion

**Paul M. Davis**

*for successfully completing the prescribed course of study in*

## **Pennsylvania Asbestos Building Inspector Refresher Course**

under TSCA Title II

*presented by*

**ACCESS TRAINING SERVICES, INC.**  
7921 River Road, Pennsauken, NJ 08110  
(856) 665-3449

2/12/15

*Course Date*

N/A

*Exam Date*

2/12/16

*Expiration Date*

Not Provided

*Social Security Number*

ACC-0215-6-015

*Certificate Number*

*Mark K. Schlager*  
Training Director

# Certificate of Training

CRITERION LABORATORIES, INC.

HEREBY CERTIFIES THAT

Paul M. Davis

Asbestos Building Inspector Refresher

HAS SUCCESSFULLY COMPLETED A 4 HOUR COURSE ENTITLED

INCLUDING CLASSROOM INSTRUCTION

on this 2nd day of February 2016

Exam passed on this 2nd day of February 2016 - Score - 92

Approved for AHERA Accreditation Under ISCA Title II

DIRECTOR:

*James A. Welch*  
James A. Welch, CHH, President

3370 Progress Drive, Suite J  
Bensalem, PA 19020

(215) 244-1300 - Phone

(215) 244-4349 - Fax

www.criterionlabs.com

Course is conducted in English

# Certificate of Completion

**Bernard J. Bryson**

*for successfully completing the prescribed course of study in*

**Pennsylvania Asbestos  
Building Inspector Refresher Course**  
under TSCA Title II

*presented by*

**ACCESS TRAINING SERVICES, INC.**  
7921 River Road, Pennsauken, NJ 08110  
(856) 665-3449

<b>2/16/15</b> <i>Course Date</i>	<b>N/A</b> <i>Exam Date</i>	<b>2/16/16</b> <i>Expiration Date</i>
<b>Not Provided</b> <i>Social Security Number</i>	<b>ACC-0125-6-031</b> <i>Certificate Number</i>	 <b>Mark K. Schlager</b> <i>Training Director</i>

# Certificate of Completion

**Bernard J. Bryson**

*for successfully completing the prescribed course of study in*

**Pennsylvania Asbestos  
Building Inspector Refresher Course**

under TSCA Title II

*presented by*

**ACCESS TRAINING SERVICES, INC.  
7921 River Road, Pennsauken, NJ 08110  
(856) 665-3449**


2/15/16  
Course Date

N/A  
Exam Date

2/15/17  
Expiration Date

Not Provided  
Social Security Number

ACC-0216-6-005  
Certificate Number

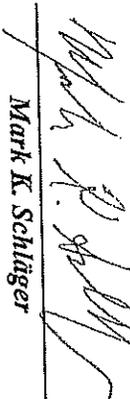  
Mark K. Schläger  
Training Director

**EHS TRAINING INSTITUTE, INC.**

A Division of BATA, Inc.

# Certificate of Completion

## AHERA Building Inspector (Refresher)

Awarded To:

**Alexander Roman**

SS#:XXX-XX-1743

Who has completed this 4-hour course and examination,

EPA Approved under TSCA Title II

AHERA / ASHARA Rule

40 CFR Part 763.

**EHS TRAINING INSTITUTE, INC.**

A Division of BATA, Inc.

Delaware Industrial Park • 6 Garfield Way

Newark, DE 19713-5817

(302) 737-3376 • Fax (302) 737-5764

Course Date: **September 18, 2015**

Date of Expiration: **September 18, 201**

Certification Number : **EHSBIR 150619-008**



Todd K. Zeisloff, Instructor



Neeraj K. Batta, President

# Certificate of Completion

**Norman Harrison**

*for successfully completing the prescribed course of study in*

**Pennsylvania Asbestos  
Building Inspector Refresher Course**

under TSCA Title II

*presented by*  
**ACCESS TRAINING SERVICES, INC.**  
7921 River Road, Pennsauken, NJ 08109  
(856) 665-3449

9/2/15

Course Date

N/A

Exam Date

9/2/16


Expiration Date

Not Provided

Social Security Number

ACC-0915-6-011

Certificate Number

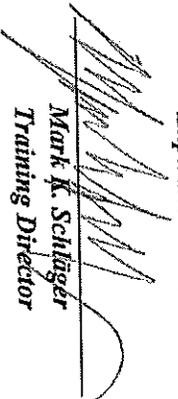  
**Mark A. Schlenger**  
Training Director

EHS TRAINING INSTITUTE, INC.  
A Division of BATTI, Inc.

# Certificate of Completion

## AHERA Building Inspector (Refresher)

Awarded To:

**Kelly Mayberry**

SS#:XXX-XX-1551  
Who has completed this 4-hour course and examination,  
EPA Approved under TSCA Title II  
AHERA / ASHARA Rule  
40 CFR Part 763.

**EHS TRAINING INSTITUTE, INC.**  
A Division of BATTI, Inc.  
Delaware Industrial Park • 6 Garfield Way  
Newark, DE 19713-5817  
(302) 737-3376 • Fax (302) 737-5764  
Course Date: February 20, 2015  
Date of Expiration: February 20, 2016  
Certification Number : EHSBIR 150220-005

  
Todd K. Zeisloft, Instructor

  
Neeraj K. Batta, President

EHS TRAINING INSTITUTE, INC.  
A Division of BATTI, Inc.

# Certificate of Completion

## AHERA Building Inspector

(Refresher)

Awarded To:  
**Kelly Mayberry**

Who has completed this 4-hour course and examination,  
SS#:XXX-XX-1551  
EPA Approved under TSCA Title II  
AHERA / ASHARA Rule  
40 CFR Part 763.

**EHS TRAINING INSTITUTE, INC.**  
A Division of BATTI, Inc.  
Delaware Industrial Park • 6 Garfield Way  
Newark, DE 19713-5817  
(302) 737-3376 • Fax (302) 737-5764  
Course Date: February 18, 2016  
Date of Expiration: February 18, 2017  
Certification Number : EHSBIR 160218-006

  
Todd K. Zeisloft, Instructor

  
Neeraj K. Batta, President

# AEROSOL MONITORING & ANALYSIS, INC.

This is to certify that  
**ANDREW HINE**

has met the attendance requirements and successfully completed  
the course entitled

**3-DAY EPA AHERA INSPECTOR**

For Accreditation Under TSCA Title II

05/04/2015 to 05/06/2015

Course Date

05/06/2015

Exam Date

5/6/2016

Expiration Date

STEVE SIERAGKI

Principal Instructor



A105042015-3

Certification No.

E. Rush Barnett

Course Director



1331 Ashton Road

P.O.Box 646

Hanover, MD 21076

P: 410-684-3327

F: 410-684-3724

[www.amatraining.com](http://www.amatraining.com)

# Certificate of Completion

**Maryellen Leotta**

*for successfully completing the prescribed course of study in*

## **Pennsylvania Asbestos Building Inspector Refresher Course**

under TSCA Title II

*presented by*

**ACCESS TRAINING SERVICES, INC.**  
7921 River Road, Pennsauken, NJ 08110  
(856) 665-3449

2/12/15  
*Course Date*

N/A  
*Exam Date*

2/12/16  
*Expiration Date*

Not Provided  
*Social Security Number*

ACC-0215-6-024  
*Certificate Number*

  
**Mark K. Schlager**  
*Training Director*

# Asbestos Hazard Emergency Response Act (AHERA) Environmental Compliance Audit Cross Reference Table

In response to the AHERA Environmental Compliance Audit a Cross Reference Table has been prepared for inclusion into the Environmental Management Plan. The purpose of this Cross Reference Table is to link the following documents to the AHERA Management Plan.

<b>Cross Reference Table</b>	
3 Year Reinspection Report follows this Cross Reference Table documentation.	
<b>Subject Matter</b>	<b>Location of Required Documents</b>
Designated Person	Pages 1 - 3
Annual Notification	Pages 4 - 5
6 Month Periodic Surveillance Outline of Events	Page 6
3 Year Re-inspections Outline of Events	Page 7
Asbestos Management Program (operations and maintenance)	Pages 8 - 19
Asbestos Investigation Report (AIR)	Attachment 1 Letter Dated August 4, 2006
Training (included in the Asbestos Management Program)	<p>The original records are centralized at the School District's Environmental Library. Copies are maintained on staff and are required to be maintained in the latest Reinspection Report.</p> <p>2 hour awareness training records for all Building Engineers, Custodian Assistants and maintenance personnel</p> <p>40 hour worker/supervisor training records for the OEMS A-Team and various AST tradesmen.</p>
Response Actions (monthly mailings if applicable)	<p>The original documents are on file at the School District's Environmental Library.</p> <p>Copies of the original are mailed to the Schools Main Office for retention with the Management Plan documentation. These documents are typically kept separate from the management plan in an update binder due to the potential volume of response action reports.</p>

**SCHOOL DISTRICT OF PHILADELPHIA**

**ASBESTOS DESIGNATED PERSON**

**Gerald F Junod**  
**Office of Capital Programs**  
**Environmental Management & Services**  
**440 N Broad Street, 3<sup>rd</sup> Floor**  
**Philadelphia, PA 19130**  
**Telephone: 215 400 6738**  
**Fax: 215 400 4751**

**Drexel University- Asbestos Building Inspector Course** January 9-11, 1989 24 Hours  
**Drexel University- Asbestos Management Planner Course** January 12-13, 1989 16 Hours  
**Criterion Laboratories, Inc. - Asbestos Management Planner Course** October 11-12, 2012 16 Hours

**Annual Building Inspector Refreshers** 1990 to Present  
4 Hours  
**Drexel University**  
**Criterion Laboratories, Inc**  
**Access Training Services, Inc.**

**Annual Building Management Planner Refreshers** 1990 to 1994  
4 Hours  
**Drexel University**  
**Criterion Laboratories, Inc** 2013 to Present  
4 Hours

**Environmental Manager, School District of Philadelphia**  
Manages the design and implementation of asbestos and lead projects for the Capital Improvement Program and other District Departments including Facilities & Operations and Information Technology. Ensures that asbestos abatement and lead remediation projects are expertly designed and executed in accordance with industry best management practice standards and regulations.

**Manager, City of Philadelphia Asbestos Control Program**  
Served as the Asbestos Control Program Manager for the City of Philadelphia, Department of Public Health, Air Management Services, Asbestos Control Unit from August 1, 2003 through October 23, 2006.

**Mid Atlantic Regional Environmental Consortium (MAREC)**  
Former member with attendance and participation commitments of all quarterly EPA Region III and yearly National Asbestos Regulatory Conferences sponsored by the EPA and the National Conference of State Legislators respectively as a representative for the City of Philadelphia Department of Public Health Air Management Services from 1994 through 2006.


**Philadelphia Environmental Task Force**  
Former member of the Philadelphia Environmental Task force as a representative and point of contact for the City of Philadelphia Department of Public Health Air Management Services Asbestos Control Unit from 2002 through 2006.

**Asbestos Instructor**

Worked as the primary instructor for the initial and annual Asbestos Project Inspector training and licensing program as mandated by City of Philadelphia Department of Public Health Asbestos Control Regulations from August 1994 through October 2006.

Worked as a lead instructor with an Environmental Consulting Firm and approved by the US EPA for the initial and annual refresher training courses for various asbestos occupational disciplines such as the Building Inspector, Management Planner and Worker/Supervisor from 1991 through 1994.

I certify that the general, local agency responsibilities as stipulated in Section 763.84 will be met.

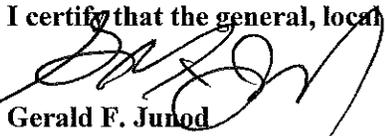

**Gerald F. Junod**  
Asbestos Designated Person  
Environmental Manager  
Office of Environmental Management and Services

**SCHOOL DISTRICT OF PHILADELPHIA**

**Accreditation Information Statement**

All persons who inspect for Asbestos Containing Building Materials (ACBM) and who will design or carry out response actions with respect to assumed and confirmed ACBM, will be accredited by an EPA approved course and/or a State Contractors Accreditation Program under Sections 206 (c) and 206 (b) of Title II of the ACT.



**Gerald F. Junod**  
**Asbestos Designated Person**  
**Environmental Manager**  
**Office of Environmental Management and Services**

SCHOOL DISTRICT OF PHILADELPHIA  
OFFICE OF CAPITAL PROGRAMS  
440 NORTH BROAD STREET, SUITE 373  
PHILADELPHIA, PENNSYLVANIA 19130

OFFICE OF ENVIRONMENTAL MANAGEMENT AND SERVICES

PHONE (215)-400-4750

September 2015

TO: Principals  
Building Administrators/Occupants  
Parents/Guardians

FROM: Fran Burns  
Chief Operating Officer

Francine Locke, M.S., Director  
Office of Environmental Management and Services

SUBJECT: Annual EPA Notification Letter


Pursuant to the Federal Environmental Protection Agency (EPA) mandate, as required by 40 C.F.R. 763.84 (c)(d) of public access to environmental records, this letter is to acknowledge the availability of your facility's Asbestos Hazard Emergency Response Act (AHERA) Management Plan.

Each member of the school staff, parents/guardians, temporary workers and/or contractors, are required to receive a copy of the Notification Letter. At the direction of the Principal, a copy is to be posted on the bulletin boards and an appropriate amount of copies are to be generated for distribution.

Note: The AHERA Three-Year Reinspection reports, in colored binders; White with Pink, Tan, Black, Red, Dark Blue, Green, Yellow and White, are Federal EPA mandated inspection documents. The School District of Philadelphia is subject to severe monetary penalties if the reports and associated paperwork are not available to the EPA and the public upon request.

It is incumbent on designated school personnel to gather and retain this data as it is delivered, in one location for future review. Acceptable locations include the Principal's Office or Main Office for the primary data. The Building Engineer should maintain any secondary or duplicate copies.

If you have any questions, please call 215-400-4750. Thank you for your cooperation.



Fran Burns  
Chief Operating Officer



Francine Locke, M.S., Director  
Office of Environmental Management  
and Services

c: Danielle Floyd

AHERA-4  
8/21/15



**School District of Philadelphia**  
**OFFICIAL NOTICE**

**PLEASE POST**

September 2015

TO: Principals  
Building Administrators  
Building Engineers  
Building Occupants  
Parents/Guardians

FROM: Fran Burns  
Chief Operating Officer


Francine Locke, M.S., Director  
Office of Environmental Management and Services


SUBJECT: Annual Notification Letter: Asbestos Hazard Emergency Response Act

The Federal Register published on October 30, 1987, Subpart E, in Schools: Final Rule and Notice, 763.84 (c)(d) states that each local education agency shall ensure that workers and building occupants or guardians are to be informed at least once each school year about inspections, response actions and post-response action activities including re-inspections and periodic surveillance activities. The School District as the Local Education Agency (LEA), retains such reports that are available for public inspection in the Office of the Principal or Building Administrator.

The Principal or Building Administrator is required to do the following with this notification:

- 1) Post in a Public Place or Main Office
- 2) Inform Building Occupants
- 3) Send a copy of this notification to Parents or Guardians
- 4) Insert a copy into the latest AHERA Three-Year Reinspection report (white/pink binder) in your office or facility.

  
\_\_\_\_\_  
Fran Burns  
Chief Operating Officer

  
\_\_\_\_\_  
Francine Locke, M.S., Director  
Office of Environmental Management  
and Services

c: Danielle Floyd

AHERA-4a  
8/21/15

SCHOOL DISTRICT OF PHILADELPHIA  
Education Center  
440 North Broad Street  
Philadelphia, Pennsylvania 19130

Office of Environmental Management and Services

215-400-4750

AHERA  
Six Month Surveillance  
Outline of Events

- Pursuant to the Federal Environmental Protection Agency (EPA) mandate, as required by 40 CFR 763.92(b), the following procedure is to be implemented. At least once every six (6) months after a Management Plan is in effect, each Local Education Agency (LEA) shall conduct a periodic surveillance in each building that it owns or leases that contains Asbestos Containing Building Materials (ACBM) or is assumed to contain ACBM.
- The first Bi-Annual Inspection starts in the Spring (March, April, May) and again in the Fall (October, November, December) of each year. The Building Engineer/Assistant should assist the Building Inspector with appropriate access to all areas including (Crawlspace/Attics) and rooms in the facility. There is no action required of the Principal.
- The Building Inspector shall visually inspect all areas that are identified in the Management Plan as ACBM or assumed ACBM. The date of the surveillance is recorded, the inspectors name and any changes in the conditions of the materials.
- The Building Inspector shall make a copy of the inspection document and insert into the front of the latest Management Plan (AHERA Three Year Reinspection report). The original document is returned to the LEA's Environmental Library and filed.

SCHOOL DISTRICT OF PHILADELPHIA  
Education Center  
440 North Broad Street  
Philadelphia, Pennsylvania 19130

Office of Environmental Management and Services

215-400-4750

AHERA  
Three Year Reinspection  
Outline of Events

- Pursuant to the Federal Environmental Protection Agency (EPA) mandate, as required by 40 CFR 763.85(b) the following procedure is to be implemented. At least once every three (3) years after a Management Plan is in effect, each Local Education Agency (LEA) shall conduct a reinspection of each building that it owns or leases that contains Asbestos Containing Building Material's (ACBM's) or is assumed to contain ACBM.
- Subsequent Three Year Re-inspections (2009, 2012, 2015, etc) shall start in the Fall (October, November, December, January). The Building Engineer/Assistant should assist the Building Inspector with appropriate access to all areas including (Crawlspaces/Attics) and rooms in the facility. There is no action required of the Principal.
- An accredited Building Inspector shall visually inspect and touch to determine friability, all areas that are identified in the Management Plan as ACBM or assumed ACBM. The date of the surveillance is recorded, the inspectors name and any changes in the conditions of the materials. The Building Inspectors state of accreditation and license number is required.
- After the inspection, the Building Inspector shall make a copy of the inspection documents and insert into the front of the latest Management Plan (AHERA Three Year Reinspection report). The original document is returned to the LEA's Environmental Library and filed.
- The Building Inspector shall return the reinspection data to the Management Planner to be assessed and determine appropriate response actions and a report issued (AHERA Three Year Reinspection report). One copy of the report is delivered to the schools Principal to be permanently retained with all previous environmental data. Another copy is retained in the LEA's Environmental Library.



**School District of Philadelphia**  
Office of Environmental Management & Services  
440 North Broad Street  
Philadelphia, PA 19130  
(215) 400-4750

**School District of Philadelphia**  
**Asbestos Management Program**

## TABLE OF CONTENTS

Definitions.....	Page 9
1. Introduction.....	Page 10
2. Summary of Asbestos Management Plan	
3. Asbestos Management Plan Execution.....	Page 11
a. General Execution	
4. Summary of Program Execution	
a. Asbestos Management Plan Execution	
5. Responsibilities	
a. OEMS	
b. Asbestos Worker/Supervisor “A-TEAM”.....	Page 12
c. Asbestos Designated Person	
d. Supervisor or Project Manager (Capital, Maintenance & Facilities)	
e. Employee Capital.....	Page 13
f. Employee Maintenance	
g. Employee Facilities and Custodial	
6. Requirements.....	Page 14
a. Employee Exposure Monitoring	
b. Employee Notification	
c. Observation of Monitoring	
d. Training Program	
e. Access of Information	
f. Record Keeping	
7. AHERA O&M Plan.....	Page 15
a. Controls	
8. O&M Response Actions.....	Page 16
a. Facility Maintenance Isolation of Area	
b. Unlikely Contact with ACM/PACM	
c. Accidental Disturbance of ACM/PACM	
d. Planned Disturbance of ACM/PACM	
e. Miscellaneous ACM/PACM.....	Page 17
f. Vinyl Asbestos Floor Tile	
g. Mastic/Adhesives	
h. Woven Vibration Dampers	
i. Other Work Practices	
j. Fiber Release Episodes	
9. References and Resources.....	Page 18

**DEFINITIONS / ACRONYMS**

<b>ACM/PACM:</b>	<b>Asbestos Containing Material/Potential Asbestos Containing Material</b>
<b>AHERA:</b>	<b>Asbestos Hazard Emergency Response Act</b>
<b>AIR FORM:</b>	<b>Asbestos Inspection Report Form</b>
<b>Amended Water:</b>	<b>Water to which a surfactant (soap) has been added</b>
<b>AMP:</b>	<b>Asbestos Management Program/Asbestos Management Plan</b>
<b>Asbestos Designate Person:</b>	<b>Individual assigned by the district to oversee asbestos related issues.</b>
<b>Asbestos Regulated Area:</b>	<b>Location that is posted as an asbestos work area in which only approved and accredited personnel are permitted to enter</b>
<b>AST:</b>	<b>Asbestos Support Team involving approved and accredited school district tradespersons personnel that are school district person</b>
<b>A-TEAM:</b>	<b>School District of Philadelphia asbestos workers</b>
<b>CIP:</b>	<b>Capital Improvement Program</b>
<b>Consultant:</b>	<b>Asbestos consulting firm hired by the District</b>
<b>Demolition Directive:</b>	<b>Memorandum – August 4, 2006 from Patrick Henwood</b>
<b>EPA:</b>	<b>Environmental Protection Agency</b>
<b>In House Personnel:</b>	<b>School District of Philadelphia asbestos workers</b>
<b>LEA:</b>	<b>Local Education Agency</b>
<b>O&amp;M:</b>	<b>Operations and Maintenance</b>
<b>OEMS:</b>	<b>Office of Environmental Management and Services</b>
<b>OSHA:</b>	<b>Occupational Safety and Health Administration</b>
<b>PEL:</b>	<b>Permissible Exposure Limit</b>
<b>PSD or SDP:</b>	<b>Philadelphia School District/School District of Philadelphia</b>
<b>PSIT:</b>	<b>Philadelphia School Improvement Team</b>
<b>STEL:</b>	<b>Short Term Exposure Limit</b>

## **1. Introduction**

The School District of Philadelphia, Asbestos Policy Statement:

“The School District of Philadelphia is dedicated to providing a safe and healthful work environment for its employees, students, faculty, contractors and visitors. In recognition of the potential health problems associated with asbestos, the School District of Philadelphia is committed to a comprehensive asbestos control program. This program is implemented and maintained through the School District of Philadelphia's Office of Environmental Management and Services (OEMS).”

OEMS has the responsibility of establishing procedures for asbestos abatement, asbestos inspection, air monitoring, renovation and demolition activities within all School District of Philadelphia owned or leased facilities.

These procedures are developed to ensure that:

- (1) People are not exposed to significant levels of asbestos fibers
- (2) Asbestos waste is handled and disposed of properly
- (3) Members of the School District of Philadelphia community have access to the Office of Environmental Management and Services for information, assistance, guidance, and interpretation regarding asbestos related matters.
- (4) Members of the School District of Philadelphia community have access to the Asbestos Management Plans as required and outlined in the US EPA AHERA regulations including annual written notification to all parents.
- (5) Compliance with all applicable Federal, State and Local Asbestos Regulations

Requirements outlined in this manual are mandatory in nature where the word “SHALL” is used and are advisory in nature where the word “SHOULD” is used.

## **2. Summary of Asbestos Management Program**

The School District of Philadelphia’s Asbestos Management Program was established to meet the requirements of Federal, State, and Local Regulations.

These regulations include, but are not limited to:

- US Environmental Protection Agency Asbestos Hazard Emergency Response Act (US EPA AHERA) and National Emissions Standard for Hazardous Air Pollutants subpart M, Part 61 (NESHAP);
- US Department of Labor, Occupational Safety and Health Administration (OSHA) General Industry Standard (29 CFR 1910.1001) and the OSHA Asbestos Standard for the Construction Industry (29 CFR 1926.1101);
- The Commonwealth of Pennsylvania, Department of Labor and Industry, Asbestos Occupations, Accreditation and Certification Act;
- The City of Philadelphia, Department of Public Health, Asbestos Control Regulations.

### **3. Asbestos Management Program Execution**

#### **a) General Execution**

The Office of Environmental Management and Services (OEMS) develops, implements and manages safety and health programs for the School District of Philadelphia faculty, staff and students and assists with ensuring that all contractors comply with Federal, State and Local Environmental Regulations. The OEMS provides the oversight of School District of Philadelphia employees (Asbestos A-Team), environmental consultants, and asbestos abatement contractors for all projects within the School District of Philadelphia concerning Asbestos Containing Materials.

The control of safety and health hazards at the School District of Philadelphia is primarily through the implementation of engineering, work practice and administrative controls. Personal Protective Equipment (PPE) is used to supplement these controls or whenever the controls are not feasible or are in the process of being implemented. PPE is also recommended whenever exposures to chemical, physical or biological agents can be prevented or reduced by its use.

This written program establishes the procedures necessary to:

- 1) meet established standards and federal regulations for occupational exposure to asbestos fibers;
- 2) meet the requirements of the City of Philadelphia Asbestos Control Regulations which encompasses the disturbance and/or abatement of asbestos containing building materials;
- 3) provide the necessary health and safety protection to the School District of Philadelphia staff, faculty, students, contractors and visitors.

This program is strengthened by input and cooperation with the Philadelphia Federation of Teachers (PFT), Health and Welfare Fund.

### **4. Summary of Program Execution**

#### **a) Asbestos Management Program Execution**

The Asbestos Management Program is administered by the Office of Environmental Management and Services (OEMS). OEMS provides the following services primarily through professional consultants:

- (1) exposure monitoring services;
- (2) building inspection/surveys (bulk sampling) for the identification of asbestos containing materials;
- (3) asbestos project design services;
- (4) asbestos abatement project and air monitoring services;
- (5) emergency response to fiber release episodes;
- (6) education/information;
- (7) medical monitoring;
- (8) training for School District of Philadelphia personnel

### **5. Responsibilities**

#### **a) Office of Environmental Management and Services**

OEMS is responsible for performing the following functions:

- (1) Developing and administering of the Asbestos Management Program.
- (2) Providing asbestos-related services to all School District of Philadelphia departments.
- (3) Conducting required training of the Asbestos Management Program and working jointly with departments to schedule training.
- (4) Identifying and posting areas where labeling/signage are required.
- (5) Medical Monitoring of OEMS "A-TEAM" and other departments "AST" Asbestos Program staff.

- (6) Certification and training as required for OEMS "A-TEAM" and other departments "AST" Asbestos program staff.
- (7) Record keeping as outlined in Section 3.5 and all records as by required by US EPA AHERA regulations.

**b) Asbestos Worker/Supervisor - "A-TEAM"**

- (1) OEMS shall ensure that all "A-TEAM" workers/supervisors adhere to the following requirements:
  - a) Attend an initial Worker/Supervisor Asbestos Course;
  - b) Maintain the annual re-certification per EPA AHERA requirements and Commonwealth of Pennsylvania Asbestos Occupations, Accreditation and Certifications Act;
  - c) Undergo an annual Asbestos Medical Evaluation;
  - d) Undergo an annual Respirator Medical Clearance;
  - e) Undergo an annual Respirator Fit Testing.

**c) Asbestos Designated Person**

The Asbestos Designated Person is responsible for:

- (1) Assuring the health and safety of employees, students and visitors in the School District of Philadelphia facilities under his/her control.
- (2) Being kept informed of all areas under his or her jurisdiction where potential asbestos exposures exist and initiating protection programs that adhere to the Asbestos Management Program requirements of this manual.
- (3) Assuring that Asbestos Management Program requirements are adhered to by principal investigators, project managers, supervisors, or division heads, and School District of Philadelphia personnel under their supervision.
- (4) Ensuring that all employees within the Asbestos Management Program comply with (OSHA 1910.1001 (j) (7) (iv)) and the US EPA AHERA regulations by attending the required training.
- (5) Ensure the posting of:
  - a) Warning labels/signage
  - b) Commonwealth of Pennsylvania Asbestos Abatement and Demolition/Renovation Notification form
  - c) Asbestos Inspection Reports (AIR) form (where required)
  - d) Ensuring that Construction Projects follow the Demolition Directive procedures as outlined in the August 4, 2006 letter.

**d) Supervisor or Project Manager (Capital, Maintenance and Facilities)**

Each person in charge of a project, maintenance/repair, renovation/demolition, or other activity from the Departments of Capital, Maintenance, and/or Facilities, where asbestos containing material may be present is responsible for:

Identifying, with the assistance of OEMS, asbestos containing building materials prior to any disturbance of these materials. Various Federal (EPA and OSHA) and Local (City of Philadelphia Asbestos Control Regulations) require Asbestos Inspections prior to renovation/demolition activities. This shall be accomplished by always following the Asbestos Management Program Procedures as follows:

- (1) Ensure that the requirements of the Asbestos Management Program Procedures are followed by all personnel, trades, and contractors who are involved with the project;

- (2) Review of the required Asbestos Inspection Report (AIR) form (Attachment 1) and AHERA Management Plan documents prior to activities that may disturb any Asbestos Containing Materials;
- (3) Perform all project related duties as outlined in the Project Management Responsibilities;
- (4) Keep the department chairperson or director informed on any actions proposed or taken regarding the Asbestos Management Plan;
- (5) Ensuring that Construction Projects follow the Demolition Directive procedure outlined in the August 4, 2006 letter.

**e) Employee – Capital**

School District of Philadelphia Capital employees and/or consultants shall:

- (1) Ensure that no suspect or asbestos containing building materials are disturbed in the course of the projects they are performing or managing. This shall be accomplished by notifying their supervisor and OEMS by issuance of a work order permit (a.k.a PSIT Service Request Form) and verifying that the materials which may be disturbed are non-asbestos containing. If this information is not available or verification has not been made, these materials should not be disturbed.
- (2) Immediately notify OEMS and their supervisor in the event of a potential fiber release episode upon discovery of visible damage to asbestos containing materials.
- (3) Ensuring that Construction Projects follow the Demolition Directive procedures as outlined in the August 4, 2006 letter.

The types of projects represented as part of the Capital Improvement Program are as follows:

- (1) Complete Renovation of an existing building that addresses all facility component concerns and educational program needs;
- (2) Major Renovation of an existing building addressing significant facility component and educational improvements;
- (3) Addition to an existing building (either as an attachment or stand-alone structure) to accommodate needed program space;
- (4) Conversion of an existing facility to accommodate a change in educational program;
- (5) Facility Component Improvement of specific facility needs (i.e. electrical or HVAC system upgrades, ADA improvements, life safety improvements, exterior renovations, etc.)

**f) Employee – Maintenance**

School District of Philadelphia Maintenance employees shall:

- (1) Ensure that no suspect or asbestos containing building materials are disturbed in the course of their duties or work they are performing. This shall be accomplished by notifying their supervisor and OEMS by issuance of a work order permit and verifying that the materials which may be disturbed are non-asbestos containing. If this information is not available or verification has not been made, these materials should not be disturbed.
- (2) Immediately notify OEMS and their supervisor in the event of a potential fiber release episode or upon discovery of visible damage to asbestos containing materials.
- (3) All employees involved in maintenance activities shall attend required Asbestos Awareness training program within 60 days of employment.

**g) Employee – Facilities & Custodial**

School District of Philadelphia Facilities and Custodial employees shall:

- (1) Ensure that no suspect or asbestos containing building materials are disturbed in the course of their duties or work they are performing. This shall be accomplished by notifying their supervisor and OEMS by issuance of a work permit and verifying that the materials which may be disturbed are non-asbestos containing. If this information is not available or verification has not been made, these materials should not be disturbed;
- (2) Immediately notify OEMS and their supervisor in the event of a potential fiber release episode or upon discovery of visible damage to asbestos containing materials.
- (3) All employees involved in Facilities and Custodial activities shall attend require Asbestos Awareness training program within 60 days of employment.

## **6. Requirements**

### **a) Employee Exposure Monitoring**

When information indicates that an employee's exposure to asbestos fibers may equal or exceed an 8-hour time-weighted average of 0.1 f/cc \* (per OSHA 1910.1001 & 1926.1101), OEMS shall develop and implement an asbestos exposure monitoring program. The sampling strategy shall be designed to identify employees by work task (job classification) that is exposed to asbestos fibers that exceed an 8-hour time-weighted average of 0.1 f/cc.

### **b) Employee Notification**

OEMS shall notify in writing, each employee exposed to asbestos fibers at or above an 8-hour time weighted average of 0.1 f/cc.

### **c) Observation and Monitoring**

OEMS shall provide employees or their representatives with an opportunity to observe any exposure measurements conducted.

### **d) Training Program**

OEMS shall institute a training program which meets the requirements of AHERA for all employees who perform maintenance operations in a facility/school which contains asbestos containing materials or presumed asbestos containing materials and 1910.1001 (j), and the Commonwealth of Pennsylvania Department of Labor and Industry and the City of Philadelphia Asbestos Control Regulations. The affected departments shall ensure employee participation in this program. The OEMS "A-TEAM" and other departments "AST" Asbestos Program staff training shall be conducted annually for each employee as required by all Federal, State and Local for each asbestos discipline.

All Asbestos Awareness training as required by AHERA shall be performed within 60 days of employment and shall include:

- Health effects of asbestos
- Locations of ACM and PACM in the building/facility
- Recognition of CM and PACM damage and deterioration
- Requirements of the OSHA 1910.1001 standard relating to maintenance
- Proper response to fiber release episodes
- Procedure to be followed to isolate areas affected by fiber release

### **e) Access to Information**

OEMS shall make available to affected employees or their representative's copies of the Occupational Safety and Health Administration (OSHA) General Industry Standard Part 1910.1001 and the department shall post a copy in the workplace.

### **f) Record Keeping**

OEMS shall maintain an accurate record of all employee exposure measurements. OEMS and/or the School District of Philadelphia Human Resources Department shall maintain records of employee medical monitoring program. OEMS shall maintain all employee training records. All records shall be provided upon request to employees, former employees, representatives designated by the individual employee.

## 7. AHERA OPERATIONS AND MAINTENANCE PLAN

### a) CONTROLS

#### i. Work Order System

Minimizing disruption of ACM/PACM during maintenance and renovation activities is the primary goal and task encountered by OEMS. Operations and maintenance employees and contractors should be warned to avoid conducting any maintenance work which may disturb ACM/PACM. Initiating a work order system, where all work orders or requests are channeled through the Office of Environmental Management and Services (OEMS), will be the method used to control and minimize disruption of ACM/PACM.

Any work performed by in-house personnel or contractors that could or will impact ACM/PACM shall be coordinated by OEMS. A completed Asbestos Inspection Report Form (Attachment 1) shall be issued to in-house personnel and/or all contractors whose work could impact ACM/PACM. This form should accompany each contract issued to an outside contractor and posted on the jobsite.

All work order requests for maintenance and renovation activities in areas where ACM/PACM is suspected or known to be present are to be submitted to OEMS prior to proceeding with work. OEMS is responsible for reviewing asbestos survey records for information about the presence of ACM/PACM in the area where the work is to be performed. OEMS should physically inspect the area to ensure existing records reflect actual conditions. If no asbestos is present, a work order is not necessary and the planned actions can proceed. If ACM/PACM is found to be present in the area, OEMS will sign the work order application and obtain an approved and accredited asbestos contractor or assign OEMS "A-TEAM" to abate the ACM/PACM.

#### ii. Regulated Areas

The owner will identify and regulate all areas where airborne concentrations of ACM/PACM exceed the Permissible Exposure Limit (PEL)\* (Per OSHA determined to be 0.1 f/cc) and/or short term exposure limit (STEL) (Per OSHA determined to be 0.1 f/cc), or there is reasonable possibility that the (PEL) and/or (STEL) may be exceeded. All ACM/PACM removal activities involving thermal system insulation ACM/PACM (Class I), surfacing ACM/PACM (Class I), and miscellaneous ACM/PACM such as floor tile, roofing, and siding mastic, etc. (Class II), and repair and maintenance operations where thermal system insulation and surfacing ACM/PACM is likely to be disturbed (Class III) will be performed in accordance with federal, state, and local regulations. All asbestos abatement work and activities will be designed and managed as asbestos regulated areas. These areas will be demarcated and labeled.

#### iii. Warning Signs

Warning signs shall be displayed at all approaches to each asbestos regulated area. The asbestos abatement contractor will provide OSHA warning signs in all regulated areas during removal, repair, and other maintenance activities. OEMS will provide AIRs to all contractors who must inform all employees and supervisors working in locations contiguous to asbestos regulated areas of the potential hazards and work practices required.

#### iv. Warning Labels

Warning labels and/or signage shall be affixed to all raw materials, mixtures, scrap, waste, debris, and other products containing asbestos fibers, or to their containers. Generally, the asbestos abatement contractor or OEMS A-Team personnel will provide all warning labels for ACM/PACM containment.

## 8. O & M RESPONSE ACTIONS

The Asbestos Management Program general O&M procedures are outlined in this section. Additional requirements specific to asbestos abatement activities are included in the Project Design documents for all Asbestos Abatement Work. Regular cleaning, inspection, and reporting of ACM/PACM deterioration or other problems must be diligently practiced by all employees including custodial and maintenance personnel.

### a) Facility Maintenance Isolation of Area Responsibilities

Maintenance personnel are often required to work in areas where ACM/PACM may potentially be disturbed. Most maintenance activities are conducted by in-house staff, outside contractors, or a combination.

Emergency fiber release episodes, such as pipe fitting or valve breaks, emergency boiler work, or mechanical equipment repair will be responded to by OEMS A-Team personnel or asbestos abatement contractor personnel. The owner's maintenance staff will: (1) isolate the emergency fiber release area; (2) post warning signs to prevent unauthorized access, and (3) notify their supervisor and OEMS. OEMS will ensure that the fiber release area remains isolated and is properly cleaned by and approved and accredited abatement contractor or by OEMS A-TEAM personnel.

### b) Unlikely Contact with ACM/PACM

Maintenance activities or repairs which can be performed without contacting or disturbing the ACM/PACM require little more than normal care and good workmanship. For example, valves which are either uncovered or covered with non-asbestos insulation can be packed or repaired without disturbing asbestos insulation on nearby pipes. The major precaution is to ensure that maintenance and custodial personnel are familiar with procedures such as isolating the area, posting warning signs, and notifying OEMS in the event of any accidental ACM/PACM disturbance.

### c) Accidental Disturbance of ACM/PACM

Maintenance and facilities personnel shall notify OEMS any time a fiber release is suspected. If friable ACM/PACM becomes airborne in the building,

### d) Planned Disturbance of ACM/PACM

Maintenance activities that may impact ACM/PACM include access to a valve, flange, duct, or related system component.

Where asbestos-containing insulation must be removed to maintain or repair the thermal system, the ACM/PACM will imminently be disturbed. ACM/PACM removal work shall be conducted by OEMS A-Team personnel or an approved and accredited asbestos abatement contractor.

If friable ACM/PACM becomes airborne in the building, maintenance and facilities personnel shall secure the area and contact OEMS. OEMS shall respond accordingly.

**e) Miscellaneous ACM/PACM**

Miscellaneous types of ACM/PACM may include vinyl asbestos floor tiles, mastics/adhesives and woven vibration dampers. Disturbance of these materials should be avoided. Routine maintenance activities involving these materials should not pose a problem if handled properly. Questions on the proper removal and disposal of miscellaneous ACM/PACM should be directed to OEMS. OEMS will contact an approved and accredited asbestos abatement contractor or utilize OEMS A-TEAM personnel to assist with miscellaneous ACM/PACM clean-up activities.

**f) Vinyl Asbestos Floor Tile**

Asbestos-containing floor tiles in good condition are considered non-friable unless they are crushed, drilled, sawed, sanded or disturbed by any activity that breaks up the material. Routine maintenance of these materials should employ the use of non-abrasive buffers and wet cleaning technique. Broken or loose floor tiles should be removed and disposed of as asbestos waste by OEMS. Remaining debris should be vacuumed with a HEPA vacuum and the area wet mopped using amended water.

**g) Mastics/Adhesives**

Mastics and adhesives containing asbestos in good condition are considered non-friable and do not pose a potential health concern unless crushed, drilled, sawed, sanded, or otherwise abraded. Questions on the proper removal should be directed to OEMS.

**h) Woven Vibration Dampers**

Woven vibration dampers in good condition are considered non-friable and do not pose a potential health concern unless cut, crushed, drilled, sawed, sanded, or otherwise abraded. Questions on the proper removal should be directed to OEMS.

**i) Other Work Practices**

Any special work not included in this section should be addressed to OEMS for review prior to the initiation of work that may involve the disturbance of ACM/PACM.

**j) Fiber Release Episodes**

Facilities and maintenance staff should report to OEMS the presence of asbestos debris, water or physical damage to ACM/PACM, or any other evidence of possible fiber release. OEMS should have the OEMS A-Team personnel or an approved and accredited abatement contractor respond to the site to clean up debris and make repairs as soon as possible. OEMS will also contact a consultant to conduct air monitoring and prepare a report and submit at project completion to OEMS for each episode. OEMS will forward the reports for each site location AHERA Management Plan accordingly.

## 9. REFERENCES and RESOURCES

Applicable regulations for asbestos projects impacted by renovation, demolition, and maintenance activities.

- **Philadelphia Air Management Services – Asbestos Control Unit**  
<http://www.phila.gov/health/units/ams/Asbestos/asbestos.html>
- **Pennsylvania Asbestos Occupations, Accreditation and Certification Act**  
<http://www.dli.state.pa.us/landi/cwp/view.asp?a=185&q=56262&landiNav=>
- **United States Environmental Protection Agency Asbestos Home Page**  
<http://www.epa.gov/asbestos/>
- **Occupational Safety and Health Administration (OSHA) Asbestos Home**  
<http://www.osha.gov/SLTC/asbestos>