SCHOOL DISTRICT OF PHILADELPHIA



Asbestos Hazard Emergency Response Act "AHERA"

THREE-YEAR RE-INSPECTION 2015-2016

and

ASBESTOS MANAGEMENT PLAN

for the

Kensington Health Sciences Academy

ULCS# 5011/5550 Building # B555001-1 2463 Emerald Street Philadelphia, Pennsylvania 19125

Year Built: 2001

May 2016

Conducted By: Accredited Environmental Technologies, Incorporated Batta Environmental Associates, Incorporated Criterion Laboratories, Incorporated Environmental Testing Consultants, LLC G & C Environmental Services, Incorporated KEM Partners, Incorporated Synertech, Inc. TTI Environmental, Inc. USA Environmental Management, Inc. The Vertex Companies, Inc.

> Management Plan Prepared By: Criterion Labs, Inc and Synertech Inc.

This report must remain in the Main Office as mandated by the US EPA AHERA Regulations.

AHERA THREE-YEAR REINSPECTION VOLUME IX

Table of Contents

Transmittal Letter

Executive Summary

- I. Summary list of Confirmed Asbestos Containing Building Materials
- II. Summary list of Assumed Asbestos Contain Building Materials
- III. Summary list of Non-Asbestos Containing Building Materials
- IV. Summary list of Non Suspect Asbestos Containing Building Materials
- V. Summary List of Auditorium DATA for this location
- VI. Summary list of Attic and/or Crawlspace DATA for this location
- VII. Summary list of Pipe Chase/Pipe Shaft DATA for this location

Section I Report of Re-Inspection

- A. Introduction
- B. Three-Year Re-inspection IX Overview
- C. Post- Management Plan Activities and Changes
 - C.1 Sampling and Analysis
 - C.2 New Floor Tile Sampling
 - C.3 Abatement Activity
 - C.4 Periodic (Six-Month) Surveillance (Damaged Materials)

Section II Re-Inspection Data

- A. Introduction
- B. Re-Inspection Key Definitions
- C. Room by Room Location Log Report

Section III Certificates

A. Management Planner/Building Inspector Certificates

| Section IV | Cross Reference Table | Page 1-8 |
|------------|------------------------------|-----------|
| | Asbestos Management Program | Page 9-19 |

SCHOOL DISTRICT OF PHILADELPHIA EDUCATIONAL CENTER 440 NORTH BROAD STREET PHILADELPHIA, PENNSYLVANIA 19130

OFFICE OF ENVIRONMENT AL MANAGEMENT AND SERVICES

PHONE (215)-400-4750

January 2016

TO: All Principals All Building Administrators

FROM: Fran Burns Chief Operating Officer

> Francine Locke, M.S., Director Office of Environmental Management and Services

SUBJECT: AHERA Three (3) Year Re-inspection IX report

In order to comply with the provisions of the Asbestos Hazard Emergency Response Act (AHERA) the attached report is submitted to you. The law requires that this report be kept in the Main/Principal's office. It cannot be removed from these locations. *If the school (program) is relocated to a different building, these environmental documents are to be safely retained for the next school/building occupants.* All asbestos reports must be available to the public and Federal EPA upon request.

Fran Burns Chief Operation Officer

Francine Locke, M.S., Director Office of Environmental Management and Services

AHERA-2d Revised 12/14/15

Executive Summary

This Asbestos Hazard Emergency Response Act (AHERA) Three-Year Re-inspection <u>"Volume #</u> <u>IX"</u> Management Plan at this location, has been completed and the report of re-inspection submitted to the School District of Philadelphia. The re-inspections in all School District of Philadelphia buildings of 2015-2016 were conducted and completed between October 5th, 2015 through March 30th, 2016 as a joint project by Accredited Environmental Technologies, Inc., Batta Environmental Associates, Inc., Criterion Laboratories, Inc., Environmental Testing Consultants, LLC, G & C Environmental Services, Inc., KEM Partners, Inc., Synertech, Inc., TTI Environmental, Inc., USA Environmental Management, Inc. and The Vertex Companies, Inc.

In general, the School District of Philadelphia Office of Environmental Management and Services conducts Environmental Impact Evaluations and provides Asbestos Inspection Reports prior to any renovation, demolition and/or maintenance activities. The AHERA report must be reviewed prior to any renovation, demolition and/or maintenance activities in order to avoid the unknowing disturbance to Asbestos Containing Building Materials identified within this location. In addition, prior to work activities above all drop ceilings this report should be reviewed to avoid potential disturbances to Asbestos Containing Materials. Refer to Section IV of the Cross Reference Table, for additional Asbestos Management Program information. Contact the Office of Environmental Management and Services to have an Environmental Impact Evaluation conducted prior to any renovation, demolition and/or maintenance activities within this facility.

The information contained in this report was obtained from the original Asbestos Management Plan for the school, from update reports on changes and activities since the completion of the 1st Management Plan for each location and from all prior inspections performed and documented in Volume # I through Volume VIII (dated respectively 1992, 1995, 1998, 2001, 2004, 2007, 2010 or 2013) (if applicable)- and by this Three-Year Re-inspection of this school. The re-inspection report/Management Plan of 2015-2016 were reviewed and prepared collectively by Management Planner Megan Vala, Mary Anne Lerro of Criterion Laboratories, Inc. and/or Monique Causley, of Synertech Inc.

The 2015-2016 inspection process included the addition of a comprehensive Room by Room Inventory of all Thermal (T), Surfacing (S) and Miscellaneous (M) Materials specific to each room of this facility. Inspections of each room's thermal, ceilings, walls, floors and miscellaneous items regardless of Asbestos Content are categorized on the Room by Room Location Log Report for this location. Rooms or areas of the facility that were not accessible at the time of the inspection are marked with an "X". The Room by Room Location Log Report is found in Section II C of this Management Plan.

All Presumed or Suspect Asbestos Containing Building Materials (ACBMs), listed in the following summary charts are categorized as Confirmed, Assumed, Non-Asbestos, and/or Non-Suspect (ACBMs) were identified in the original Management Plan, or in the Volume I through Volume VIII AHERA Three-Year Re-inspection reports, and were re-inspected as part of this project.

As mandated by the U S EPA AHERA regulations, periodic Six-Month inspections and Three-Year Re-inspections of this location will be performed and the Inspection Data in this report will be updated accordingly.

Please feel free to contact the School District of Philadelphia's Office of Environmental Management and Services (OEMS) regarding any comments, questions, or concerns regarding this report or any Environmental related topic. OEMS staff can be reached at (215) 400 4750, via fax at (215) 400 4751 or via e-mail at <u>flocke@philasd.org</u> and/or <u>gfjunod@philasd.org</u>.

Additional information can be found on our website. Here is the link to the OEMS website. http://webgui.phila.k12.pa.us/offices/e/environmental

I. Summary list of Confirmed Asbestos Containing Building Materials within this facility

These charts are to be used for a quick reference* in order to avoid the unknowing disturbance of Asbestos Containing Materials during any and all Operations, Maintenance, Renovation, and/or Demolition activities at this location. *These materials have been sampled and Laboratory Analysis has CONFIRMED the presence of Asbestos. Contact OEMS prior to the disturbance of any of the following materials.*

Confirmed Asbestos Containing Building Materials for this location

Since this facility was fully renovated and/or built after December 31, 1980 all suspect friable asbestos containing building materials do not exist in this facility.

II. Summary list of Assumed Asbestos Containing Building Materials within this facility

These charts are to be used for a quick reference* in order to avoid the unknowing disturbance of Asbestos Containing Materials during any and all Operations, Maintenance, Renovation, and/or Demolition activities at this location. These materials have not been sampled and should not be disturbed until verification of Asbestos Content. Contact OEMS for assessment and sampling prior to the disturbance of these materials.

Assumed Asbestos Containing Building Materials for this location

Since this facility was fully renovated and/or built after December 31, 1980 all suspect friable asbestos containing building materials do not exist in this facility.

III. Summary list of Non-Asbestos Containing Building Materials within this facility

These charts are to be used for a quick reference* in order to avoid the unknowing disturbance of Asbestos Containing Materials during any and all Operations, Maintenance, Renovation, and/or Demolition activities at this location. *These materials have been sampled and Laboratory Analysis has indicated NO Asbestos present or NO ASBESTOS DETECTED (NAD)*.

Non- Asbestos Containing Building Materials for this location

| Fire Doors | Floor Tile VAT 12" x 12" | |
|------------|--------------------------|--|

* Always refer to the Room by Room Logs for each specific material classification as the material classification findings may be different in various rooms throughout this facility.
 ** Some Materials may have multiple classifications (Confirmed, Assumed, NAD and Non Suspect) within this facility.

IV. Summary list of Non-Suspect Asbestos Containing Building Materials within this facility

These charts are to be used for a quick reference* in order to avoid the unknowing disturbance of Asbestos Containing Materials during any and all Operations, Maintenance, Renovation, and/or Demolition activities at this location. These materials are not typically known to contain Asbestos.

| Non-Suspect Asbestos | Containing Building | Materials for this location |
|-----------------------------|----------------------------|-----------------------------|
|-----------------------------|----------------------------|-----------------------------|

| Carpet | Ceiling Tile 2' x 4' | Ceramic Tile Floors |
|------------------------------------|----------------------------|----------------------------|
| Ceramic Tile Walls | Concrete Block Wall | Concrete Floor |
| Fiberglass Pipe Fitting Insulation | Fiberglass Pipe Insulation | Fiberglass Tank Insulation |
| Metal Deck Ceiling | Sheetrock Ceiling | Sheetrock Wall |
| Wood Floor | | |

* Always refer to the Room by Room Logs for each specific material classification as the material classification findings may be different in various rooms throughout this facility.
 ** Some Materials may have multiple classifications (Confirmed, Assumed, NAD and Non Suspect) within this facility.

V. Summary list of Auditorium DATA for this location

These charts are to be used for a quick reference of the Auditorium DATA within this facility. Sampling of the Auditorium Ceilings throughout the District is more difficult because of the various ceiling heights. As sampling occurs this information is updated on a case by case basis for each specific location and facility.

This is a list of known materials for this location's Auditorium

This building does not have an Auditorium.

* Always refer to the Room by Room Logs for each specific material classification as the material classification findings may be different in various rooms throughout this facility.
 ** Some Materials may have multiple classifications (Confirmed, Assumed, NAD and Non Suspect) within this facility.

VI. Summary list of Attic and/or Crawlspace DATA for this location

These charts are to be used for a quick reference regarding the Attics and/or Crawlspaces inspection DATA within this facility. Contact OEMS prior to entering any attic or crawlspace within this facility and refer to the below chart and legend for Category Rank determination. The Data relative to these spaces is updated as conditions change regarding Abatement or Renovation activity on a case by case basis for each specific location and facility. In general, Crawlspaces are below the basement or 1st floor and Attics are above the floor space.

Category Rank Legend

"A" - No Asbestos Containing Materials - Sample Results indicate NO ACM on pipes, fittings, elbows, or equipment located within this functional space, and NO VISIBLE DEBRIS or DAMAGE observed at time of this inspection.
"B" - Asbestos Containing Materials Exist - Sample Results indicate ACM on pipes, fittings, elbows, or equipment located within this functional space, HOWEVER, NO VISIBLE DEBRIS or DAMAGE observed at time of this inspection.
"C" - Asbestos Containing Materials Exist - Sample Results indicate ACM on pipes, fittings, elbows, or equipment located within this functional space, and LOCALIZED VISIBLE DEBRIS or DAMAGE observed at time of this inspection.
"D" - Asbestos Containing Materials Exist - Sample Results indicate ACM on pipes, fittings, elbows, or equipment located within this functional space, and LOCALIZED VISIBLE DEBRIS or DAMAGE observed at time of this inspection.
"D" - Asbestos Containing Materials Exist - Sample Results indicate ACM on pipes, fittings, elbows, or equipment located within this functional space and DISTRIBUTED VISIBLE DEBRIS or SIGNIFICANT DAMAGE observed at time of this inspection.
"E" - No Bulk Sample Results Available SUSPECT ACM OBSERVED. Contact OEMS immediately for additional instructions.

| Attic/Crawlspace | Access Area | Floor Surface | Category Rank | Comments |
|------------------|----------------|---------------|------------------|---------------|
| Attic | Х | Х | Х | No Attic |
| Crawlspace | Х | Х | Х | No Crawlspace |

VII. Summary list of Pipe Chase/Pipe Shaft DATA for this location

These charts are to be used for a quick reference regarding the information known about the Pipe Chases and/or Pipe Shafts inspection DATA within this facility. Contact OEMS prior to performing renovation activities any Pipe Chase and/or Pipe Shaft within this facility and refer to the below chart and legend for Asbestos Content of various materials identified within each space. The Data relative to these spaces is updated as conditions change regarding Inspection, Abatement and/or Renovation activity on a case by case basis for each specific location and facility. In general, Pipe Chases are horizontal spaces and Pipe Shafts are vertical spaces.

Pipe Chases and Pipe Shafts need to be assessed.

Section I

Report of Re-Inspection

A. Introduction

B. Three-Year Re-Inspection IX Overview

C. Post-Management Plan Activities and Changes

- C.1 Sampling and Analysis
- C.2 New Floor Tile Sampling
- C.3 Abatement Activity
- C.4 Periodic Six-Month Surveillance (Damaged Materials)

Section I - A

Report of Re-inspection

Introduction

The Three-Year Re-inspection IX was performed to fulfill the requirements of 40 CFR Part 763 - the Asbestos Hazard Emergency Response Act (AHERA). As required by AHERA, each Local Education Agency (LEA) must re-inspect all known confirmed or assumed Asbestos Containing Building Material (ACBM) located in the LEA's facilities. This re-inspection is intended to update the original Asbestos Management Plan for the LEA's facilities.

Multiple Building Inspectors of several firms performed the 2015/2016 re-inspection. The reinspection report/Management Plan of 2015-2016 were reviewed and prepared collectively by Management Planner Megan Vala, Mary Anne Lerro of Criterion Laboratories, Inc. and Monique Causley, of Synertech Inc.

All of the certificates can be found in Section III.

During the re-inspection of each School District of Philadelphia facility, all of the Management Plans for that facility were reviewed. Information from the conclusions section of that report is included in this report. Additionally, information on activities such as abatements, cleanings, sampling and inspections, which have taken place since the completion of the original Management Plan, were reviewed during the re-inspection. Information on those activities are included in this report.

As mandated by the U S EPA AHERA regulations, all future periodic Six-Month inspections and Three-Year Re-inspections of this location will be performed and the Inspection Data in this report will be updated accordingly.

Section I - B

Three-Year Re-inspection IX Overview

Each homogeneous area of Asbestos Containing Building Material (ACBM) listed in the original Management Plan or in the 1992, 1995, 1998, 2001, etc., Three-Year Re-inspection reports were inspected for the AHERA Three-Year Re-inspection Volume IX, and the information for that material verified. Any changes to a homogeneous area listed in the updates to the Management Plans were verified. Any area of suspected ACBM found in the course of the re-inspection, and not listed in the Management Plan or updates, were either assumed to contain asbestos or sampled and analyzed to determine their asbestos content. Any such new areas either assumed to contain asbestos or determine their asbestos or determined through analysis to contain asbestos were included in the report of the Three-Year Re-inspection. The results of the AHERA Three-Year Re-inspection IX are tabulated in the Room by Room log reports located in *Section II-C* of this report.

As previously noted, all future periodic Six-Month inspections and Three-Year Reinspections of this location will be performed and the Inspection Data in this report will be updated accordingly.

Post Management Plan Activities/Changes

Information on activities affecting Asbestos Containing Building Materials (ACBMs) at this location is contained in updates to the Management Plan. These updates are kept on file by the School District of Philadelphia and were reviewed for this project. Updates to the Management Plan include the following: *Sampling and Analysis, New Tile Installation, Abatement Activity and Periodic Six-Month Surveillance Data*.

Sampling and Analysis

In the event Sampling occurs, data will be listed here.

Information on the installation of new floor tiles/renovation activities affecting Asbestos Containing Building Materials (ACBMs) at this location is contained in updates to the Management Plan. These updates are kept on file by the School District of Philadelphia and were reviewed for this project. Updates to the Management Plan include the following:

New Floor Tile Sampling

In the event that new tile is installed, the material must be tested prior to installation.

Information on the Asbestos Abatement and renovation activities affecting Asbestos Containing Building Materials (ACBMs) at this location is contained in updates to the Management Plan. These updates are kept on file by the School District of Philadelphia and were reviewed for this project. Updates to the Management Plan include the following:

Abatement Activity

In the event that Abatement occurs, data will be listed here.

Information on the AHERA inspection that noted damage to various Building Materials at this location is contained in updates to the Management Plan. These updates are kept on file by the School District of Philadelphia and were reviewed for this project. Work orders are created for Corrective Action responses and tracked for completion. Updates to the Management Plan include the following:

Periodic (Six-Month) Surveillance (Damaged Materials)

This building is excluded from having any asbestos-containing materials via sampling data. However, our inspections may, if observed, report findings of damaged materials in order for work orders to be issued for material repairs/corrective action as necessary.

Damaged materials reported in this section will be forwarded to maintenance for repairs.

| Date | Element | Floor | On Site Room Name | Material | Amount of Material | of |
|----------|---------|-------|-------------------|----------------------------|--------------------------|----|
| | | | | No changes in the material | | |
| 5/2/2017 | Χ | Х | Х | were observed | Х | Х |

Section II

Re-Inspection Data

A. IntroductionB. Re-Inspection Key DefinitionsC. Room by Room Location Log Report

Section II - A

Re-inspection Data

Introduction

The following information documents the Three-Year Re-inspection IX of the subject school/facility. The Homogeneous Area Reports were produced using the building inspector's field data on the facility. The key to the Homogeneous Area Report is outlined in the following pages of this report.

SCHOOL DISTRICT OF PHILADELPHIA AHERA THREE YEAR RE-INSPECTION IX

ITEM DEFINITION

| ULCS# | Individual identification number assigned to each school within the School District of Philadelphia. | | | | | | | | |
|--------------------------------|--|--|--|--|--|--|--|--|--|
| HOMOGENEOUS AREA ID# | Identification number assigned to each homogeneous area in a school/facility. Each section of the homogeneous area ID is significant. | | | | | | | | |
| | 1010/01/01 A B C D | | | | | | | | |
| | A. Is the ULCS# for the school. B. Designates the specific building/building area within the school. C. Designates the floor or level within the building/building area. D. Designates the homogeneous material within that floor or level. Note: Item D may be a number or a letter. | | | | | | | | |
| SYSTEM AFFECTED | Corresponds to the AHERA system for classifying materials. | | | | | | | | |
| | T:Thermal SystemS:Surfacing SystemM:Miscellaneous | | | | | | | | |
| ITEM AFFECTED | Is a description of the homogeneous material. | | | | | | | | |
| ORIGINAL INSPECTION DATA | This section contains the information found in the original Management Plan (1988-1989). | | | | | | | | |
| AMOUNT OF MATERIAL/ UNIT | Quantity of material, and measuring unit. Units include: Square Feet (SF) Each (EA) Linear Feet (LF) Cubic Feet (CF). | | | | | | | | |

SCHOOL DISTRICT OF PHILADELPHIA AHERA THREE YEAR RE-INSPECTION IX

RE-INSPECTION FORM KEY

ITEM DEFINITION

| CND Condition | Corresp | ponds to | AHERA condition rating for materials. |
|------------------------|-------------|-----------|---|
| 00101010 | 0 | : | No Damage |
| | 1 | : | Damage |
| | 2 | : | Significant Damage |
| DP Damage Potential | Corres | ponds to | the AHERA material assessment system. |
| Duniage I otentiai | 1 | : | Potential for Damage |
| | 2 | : | Potential for Significant Damage |
| ASMD | This m | eans that | t a material was not sampled for asbestos content |
| Assumed Asbestos | during | the orig | inal Management Plan inspection. |
| DA | T 1. | | |
| RA Response | | orrespond | ds to the AHERA system of response action rating for materials. |
| Action | 1 | : | Establish O&M Program |
| | 2 | : | Repair and Establish O&M Program |
| | 3 | : | Enclose |
| | 4 | : | Encapsulate |
| | 5 | : | Remove |
| | 6 | : | Partial Removal and Establish O&M Program |
| CHANGES | | | scribes changes to the homogeneous material in the twenty-four years since the A inspection. The abbreviations are defined below. |
| | RMVD |) | : Removed |
| | ENCL | | : Enclosed |
| | ENCP | | : Encapsulated |
| | DMGI |) | : Damaged |
| | SMPL | | : Sampled |
| | MTRL | | : Material |
| | RPRD | | : Repaired |
| | N/L | | : None Located |
| | RPLC | D | : Replaced |

SCHOOL DISTRICT OF PHILADELPHIA AHERA THREE-YEAR RE-INSPECTION IX

RE-INSPECTION FORM KEY

ITEM DEFINITION

| THREE YEAR RE-INSPECTION | This section contains the information obtained from the Three-Year Re-inspection IX. With three exceptions, the information categories are identical in format and meaning to those found in the original inspection data section. The three exceptions are defined below. |
|-----------------------------|--|
| DMGD AMT Amount Damaged | This section gives the quantity of damaged material in a homogeneous area. The quantity is shown in the same format as the amount of material/unit section. |
| NF Newly Friable | This section identifies materials in the original Management Plan which have since become friable. |
| RA Response Action | This rating is based on the AHERA regulations, and is comparable to the RA rating found in the "Original Inspection Data" section. The following table details the response actions. |
| | Establish O&M Program Repair and Establish O&M Program Enclose Encapsulate Remove Partial Removal and Establish O&M Program |
| | High Priority Response The homogeneous material has been scheduled for abatement or other response action. |
| | b. Medium Priority Response The homogeneous material will be scheduled for abatement or other response action as soon as the high priority responses have been addressed. |
| | c. Low Priority Response The homogeneous material will be scheduled for abatement or other response action as soon as the medium priority responses have been addressed. |
| | d. On-Going Response/Operations and Maintenance The homogeneous material does not require abatement or other response action at present, and should be included in the facility's on-going operations and maintenance program. |

SCHOOL DISTRICT OF PHILADELPHIA AHERA THREE-YEAR RE-INSPECTION IX

RE-INSPECTION FORM KEY

The information presented in the changes section has been compiled from a variety of sources, including the Re-inspection and the following:

* Quality Control/Quality Assurance Reports of asbestos abatement projects, prepared by consultants to the School District.

- * Permit and Notification Forms for asbestos abatement projects.
- * Periodic Surveillance Forms
- * Operations and Maintenance activities performed by School District personnel.
- * Verbal information from School District personnel.

* Reports of sampling and analysis of suspected materials by both School District personnel and outside consultants.

ROOM BY ROOM LOCATION LOG REPORT

This section gives information, including damage amount and location, for a specific homogeneous material on a room-by-room basis and follows the Re-inspection form.

NOTE: The disparate nature of the above sources of information prohibits the verification of much information within the scope of the AHERA Three-Year Re-inspection. Discrepancies and omissions may exist in this information, and therefore is included on an "as is" basis. The inspectors for the Three-Year Re-inspection IX evaluated homogeneous areas based on the materials current condition and location, as evidenced during the inspector's site visit.

Section II - C

Room by Room Location Log Report

These charts are to be used for a quick reference* in order to avoid the unknowing disturbance of Asbestos Containing Materials during any and all Operations, Maintenance, Renovation, and/or Demolition activities at this location.

NOTE:

Contact OEMS prior to the disturbance of any of the materials that are listed as **Confirmed and/or Assumed**.

The quantities listed for (NAD) non-asbestos containing materials and/or Non-Suspect Materials are only estimated and were not measured for the purpose of this report. Field verification of quantities for renovation purposes would be necessary.


| | School District of Philadelphia | | AHERA Thr | ee-Year Reinspection 2015-2 | 2016 | | | | R | einspection Date: 05/05/2016 | |
|-------------------|--|-----------------|--|------------------------------------|--------------|----------|-----------|----------|----------------|---------------------------------|-----------------------|
| | Kensington Health Sciences Academy | | | by Room Location Log Report | | | | | B | uilding Inspector: James Madden | |
| | 2463 Emerald Street, Philadelphia, PA 19125 | L | | | | | | | | umber: 030867 | |
| | ULCS# 5011/5550 | | | | | | | | | anagement Planner: M. Causley | |
| | | | | | | | | | | umber: 046177 | |
| E | Year Built: 2001 | | | | | | | 1 | | | |
| e F | | | | | | | | | | | |
| m 1 e 0 n 0 | | | | Confirmed/Assumed/NAD/ | Amount of | SF LF | Amount of | SF LF | Color required | | Attic/ Crawl Space |
| t r | On Site Room Name | System Affected | Material Description | Non Suspect ACM | Material | EA | Damage | EA | for VAT | Comments/Description/Notes | Ranking |
| | Building Engineer's Office | N/A | Floor Tile VAT 12" x 12" | NAD | 120 | SF | 0 | SF | Blue | | |
| 1 2 1 2 | Building Engineer's Office Building Engineer's Office | N/A N/A | Ceiling Tile 2' x 4' Concrete Block Wall | Non Suspect ACM Non Suspect ACM | 120 400 | SF SF | 0 | SF SF | | | |
| | TeleCom Room 209 | N/A | Floor Tile VAT 12" x 12" | NAD | 90 | SF | 0 | SF | Blue | | |
| | TeleCom Room 209 | N/A | Ceiling Tile 2' x 4' | Non Suspect ACM | 90 | SF | 0 | SF | | | |
| | TeleCom Room 209 | N/A | Concrete Block Wall | Non Suspect ACM | 300 | SF | 0 | SF | | | |
| | Girl's Restroom | N/A | Ceramic Tile Floors | Non Suspect ACM | 150 | SF | 0 | SF | | | |
| | Girl's Restroom | N/A N/A | Ceiling Tile 2' x 4' Concrete Block Wall | Non Suspect ACM Non Suspect ACM | 150 | SF | 0 | SF | | | |
| | Girl's Restroom Girl's Restroom | N/A N/A | Ceramic Tile Walls | Non Suspect ACM | 200 | SF | 0 | SF | | | |
| | Boy's Restroom | N/A N/A | Ceramic Tile Floors | Non Suspect ACM | 150 | SF | 0 | SF | <u> </u> | | |
| | Boy's Restroom | N/A | Ceiling Tile 2' x 4' | Non Suspect ACM | 150 | SF | 0 | SF | | | |
| 1 2 | Boy's Restroom | N/A | Concrete Block Wall | Non Suspect ACM | 200 | SF | 0 | SF | | | |
| | Boy's Restroom | N/A | Ceramic Tile Walls | Non Suspect ACM | 300 | SF | 0 | SF | | | |
| | Science Room 203 | N/A N/A | Floor Tile VAT 12" x 12" Ceiling Tile 2' x 4' | NAD Non Suspect ACM | 1050 | SF | 0 | SF | Blue | | |
| | Science Room 203 Science Room 203 | N/A | Concrete Block Wall | Non Suspect ACM | 1300 | SF | 0 | SF | | | |
| 1 2 | Science Room 203 Closet | N/A | Floor Tile VAT 12" x 12" | NAD | 120 | SF | 0 | SF | Blue | | |
| 1 2 | Science Room 203 Closet | N/A | Ceiling Tile 2' x 4' | Non Suspect ACM | 120 | SF | 0 | SF | | | |
| 1 2 | Science Room 203 Closet | N/A | Concrete Block Wall | Non Suspect ACM | 300 | SF | 0 | SF | | | |
| | Classroom 201 | N/A | Floor Tile VAT 12" x 12" | NAD | 1050 | SF | 0 | SF | Multi | | |
| | Classroom 201 Classroom 201 | N/A N/A | Ceiling Tile 2' x 4' Concrete Block Wall | Non Suspect ACM Non Suspect ACM | 1050 | SF SF | 0 | SF SF | | | |
| 1 2 1 2 | Classroom 201 Classroom 201 Closet | N/A N/A | Floor Tile VAT 12" x 12" | NAD NAD | 1300 | SF | 0 | SF | Blue | | |
| 1 2 | Classroom 201 Closet | N/A | Ceiling Tile 2' x 4' | Non Suspect ACM | 100 | SF | 0 | SF | Dide | | |
| 1 2 | Classroom 201 Closet | N/A | Concrete Block Wall | Non Suspect ACM | 300 | SF | 0 | SF | | | |
| 1 2 | Stairwell #1 | N/A | Floor Tile VAT 12" x 12" | NAD | 240 | SF | 0 | SF | Blue | | |
| 1 2 | Stairwell #1 | N/A N/A | Ceiling Tile 2' x 4' | Non Suspect ACM | 240 | SF SF | 0 | SF SF | | | |
| 1 2 1 2 | Stairwell #1 Cafeteria | N/A N/A | Concrete Block Wall Floor Tile VAT 12" x 12" | Non Suspect ACM NAD | 600 2000 | SF | 0 | SF | Multi | | |
| 1 2 | Cafeteria | N/A | Ceiling Tile 2' x 4' | Non Suspect ACM | 2000 | SF | 0 | SF | IVIGICI | | |
| 1 2 | Cafeteria | N/A | Concrete Block Wall | Non Suspect ACM | 1800 | SF | 0 | SF | | | |
| 1 2 | Cafeteria Office 200A | N/A | Floor Tile VAT 12" x 12" | NAD | 100 | SF | 0 | SF | Blue | | |
| 1 2 | Cafeteria Office 200A | N/A | Ceiling Tile 2' x 4' | Non Suspect ACM | 100 | SF | 0 | SF | | | |
| 1 2 1 2 | Cafeteria Office 200A Kitchen | N/A N/A | Concrete Block Wall Ceramic Tile Floors | Non Suspect ACM Non Suspect ACM | 300 700 | SF SF | 0 | SF | | | |
| 1 2 | Kitchen | N/A N/A | Ceiling Tile 2' x 4' | Non Suspect ACM | 700 | SF | 0 | SF | | | |
| | Kitchen | N/A | Concrete Block Wall | Non Suspect ACM | 1100 | SF | 0 | SF | | | |
| 1 2 | Dental Classroom 214 | N/A | Floor Tile VAT 12" x 12" | NAD | 900 | SF | 0 | SF | Multi | | |
| | Dental Classroom 214 | N/A | Ceiling Tile 2' x 4' | Non Suspect ACM | 900 | SF | 0 | SF | | | |
| | Dental Classroom 214 Dental Lab 216 | N/A N/A | Concrete Block Wall Floor Tile VAT 12" x 12" | Non Suspect ACM NAD | 1300 2000 | SF | 0 | SF | Multi | | |
| | Dental Lab 216 | N/A N/A | Ceiling Tile 2' x 4' | Non Suspect ACM | 2000 | SF | 0 | SF | iviuiti | | |
| | Dental Lab 216 | N/A | Concrete Block Wall | Non Suspect ACM | 1500 | SF | 0 | SF | | | |
| | Dental Lab 216 | N/A | Sheetrock Wall | Non Suspect ACM | 2000 | SF | 0 | SF | | | |
| | HRT Room 208 | N/A | Floor Tile VAT 12" x 12" | NAD | 2000 | SF | 0 | SF | Multi | | |
| | HRT Room 208 | N/A N/A | Ceiling Tile 2' x 4' Concrete Block Wall | Non Suspect ACM Non Suspect ACM | 2000 | SF SF | 0 | SF SF | | | |
| | HRT Room 208 Teacher's Hallway 210 | N/A N/A | Floor Tile VAT 12" x 12" | Non Suspect ACM NAD | 1800 240 | SF | 0 | SF | Multi | | |
| 1 2 | Teacher's Hallway 210 | N/A | Ceiling Tile 2' x 4' | Non Suspect ACM | 240 | SF | 0 | SF | Walt | | |
| 1 2 | Teacher's Hallway 210 | N/A | Concrete Block Wall | Non Suspect ACM | 500 | SF | 0 | SF | | | |
| | Faculty Lounge 210A | N/A | Floor Tile VAT 12" x 12" | NAD | 400 | SF | 0 | SF | Multi | | |
| | Faculty Lounge 210A | N/A N/A | Ceiling Tile 2' x 4' | Non Suspect ACM | 400 | SF SF | 0 | SF SF | | | |
| 1 2 | Faculty Lounge 210A Office 210B | N/A N/A | Concrete Block Wall Floor Tile VAT 12" x 12" | Non Suspect ACM NAD | 700 | SF | 0 | SF | Blue | | |
| 1 2 | Office 210B | N/A N/A | Ceiling Tile 2' x 4' | Non Suspect ACM | 180 | SF | 0 | SF | Dide | | |
| 1 2 | Office 210B | N/A | Concrete Block Wall | Non Suspect ACM | 400 | SF | 0 | SF | | | |
| 1 2 | Staff Restroom 210D | N/A | Ceramic Tile Floors | Non Suspect ACM | 100 | SF | 0 | SF | | | |
| | Staff Restroom 210D | N/A | Ceiling Tile 2' x 4' | Non Suspect ACM | 100 | SF | 0 | SF | | | |
| | Staff Restroom 210D Staff Restroom 210D | N/A N/A | Concrete Block Wall Ceramic Tile Walls | Non Suspect ACM Non Suspect ACM | 300 | SF | 0 | SF | | | |
| | | 19075 | | | 100 | 0 | U | | I | | |

| | | | School District of Philadelphia | | AHERA Thr | ee-Year Reinspection 2015- | 2016 | | | | F | Reinspection Date: 05/05/2016 | |
|---|-------------|--------|------------------------------------|-----|------------------------------------|----------------------------|------|----|-----------|----|---|----------------------------------|----------|
| | | | | | | - | | | | | E | Building Inspector: James Madden | |
| | | | | | | | | | | | 1 | Number: 030867 | |
| Number 2012 | | | | | | | | | | | ī | Management Planner: M. Causley | |
| F | | | | | | | | | | | , i i i i i i i i i i i i i i i i i i i | Number: 046177 | |
| s / / / / / / / / / / / / / / / / / / / | | | Four Built. 2001 | | | | | | | | | | |
| 1 1 2 Mathematical System Advance Mathematical System < | e m e | 1 0 | | | | | | | Amount of | | Color required | | Space |
| Image: 1 Solit | • | r | | | | | | | | | for VAT | Comments/Description/Notes | Ranking |
| Image Image <th< td=""><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td></th<> | | | | | | | | | | | | | |
| 1 2 Strant St. NA FROM TRAY TY TY NA NA FROM TRAY TY TY NA | | | | | | | | SF | | | | | |
| Image: 1 Image: 2 Strangering No. Constrained with the Support Add No. Strangering No. | | | | | | | | | | | | | |
| Image: Process of the second | | | | | | | | | | | Blue | | |
| Image: 1 2 Descende 24 NAM First Tie VII [27 k2]" NAD Solo Sol Sol Sol Male Image: Control in the control in th | | | | | | | | | | | | | |
| 1 2 Conserve 32 Ava. Gene 72 / 2 Non Suppi Adva Specific Adva | | | | | | | | | | | Multi | | |
| 1 2 Olds 2 3A NAA Fore The V1 * V1 * V1 NAD Solar A NAD | | 2 | Classroom 212 | | | | 500 | | | | | | |
| 1 2 Other 2 (3) Control Rec AM Non Support AAM Space AAM S | | | | | | | | | | | | | |
| 1 2 Concerning Disory NM Concerning Disory NM NM Descention SP 0 <td></td> <td>Blue</td> <td></td> <td></td> | | | | | | | | | | | Blue | | |
| I 2 Classon 314 NA Proot Tree Vir V2 172 NAD 600 85 0 85 0 85 0 85 0 85 0 85 0 85 0 85 0 1 <td></td> <td>+</td> <td></td> <td></td> | | | | | | | | | | | + | | |
| I Distance NA Control Tech Vall Non-Back Vall Open Fer 0 SP 0 SP < | | 2 | | | | | | | | | Multi | | |
| 1 2 Classicon 216 N/A Fiber He VAT 12* 12" N/A Good He // A M/A Month Standard A M/A Month Standard A M/A M/A Month Standard A M/A M/A <th< td=""><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td></th<> | | | | | | | | | | | | | |
| 1 2 Classon 216 NN Control Book Viat Non Nisson? AUM 900 8F 0 8F 1 2 Classon? 216 NN Non Nisson? AUM 1000 8F 0 8F Mate Person Person <td></td> | | | | | | | | | | | | | |
| 1 2 Classion 248 NA Concrete Block Wall Non 100 87 0 0 1 | | | | | | | | | | | Multi | | |
| 1 2 Classon 248 NA File Till Y 1 (2) NAD SQ SF 0 SF Mag 1 2 Classon 248 NA Controls Eox Mal Non Super AAD SO SF No ST No | | | | | | | | | | | | | |
| 1 2 Classon 218 N/A Certing Tip Z + 4" Non Sugged ACM 900 SF 0 SF Image: Control of the control | | | | | | | | | | | Multi | | |
| | | | | | | | | | | | Widiti | | |
| 1 2 Starvell #1 NA Flort The VAT 12* 12" NAD 250 SF 0 SF Blue 1 2 Starvell #1 NA Control Block Wall Non Suspect ACM 700 SF 0 SF <t< td=""><td></td><td>2</td><td></td><td>N/A</td><td>Concrete Block Wall</td><td>Non Suspect ACM</td><td></td><td></td><td>0</td><td></td><td></td><td></td><td></td></t<> | | 2 | | N/A | Concrete Block Wall | Non Suspect ACM | | | 0 | | | | |
| 1 2 Starvell #1 NA Celling Tip 2* 4' Non Sugget ACM 200 SF 0 | | | | | Х | | | | | | | No access this inspection | |
| 1 2 Saved #1 NA Concrete Block Wall Non Suspect ACM 900 SF 0 SF Mulle Mulle 1 2 Classroom 217 NA Control Block Wall Non Suspect ACM 900 SF 0 SF Mulle | | | | | | | | | - | | Blue | | |
| 1 2 Classrom 217 NA Floor Tier VAT 12* 12* NAD 900 SF 0 SF Multi 1 2 Classrom 217 NA Controle Block Wall NOT Suppet ACM 100 SF 0 | | | | | | | | | | | | | |
| 1 2 Classrom 217 NA Concrete Bock Wall Non Suspect ACM 900 SF 0 SF 1 2 Classrom 215 NA Floor Tile VAT 12"x 12" NAD 900 SF 0 SF Mult 1 2 Classrom 215 NA Floor Tile VAT 12"x 12" NAD 900 SF 0 SF Mult 1 2 Classrom 215 NA Controle Block Wall Non Suspect ACM 900 SF 0 SF Mult 1 2 Classrom 215 NA Controle Block Wall Non Suspect ACM 900 SF 0 SF Mult 1 2 Classrom 215 NA Controle Block Wall Non Suspect ACM 900 SF 0 SF Mult 1 2 Classrom 215 NA Controle Block Wall Non Suspect ACM 900 SF 0 SF Mult 1 2 Classrom 215 NA Classrom 216 NA Classrom | | | | | | | | | | | Multi | | |
| 1 2 Olsseon 216 NA Floor Tie VAT 12* 12* NAD 900 SF 0 SF Mulii 1 2 Classoon 216 NA Concrete Block Wall Non Suspect ACM 100 SF 0 SF Mulii Mulii Muliii Muliii Muliii Muliii Muliii Muliii Muliii Muliiii Muliiii Muliiii Muliiii Muliiiiii Muliiiiiiiiiiiiiiiiiiiiiiiiiiiiiiiiiiii | 1 | | | | | | 900 | | 0 | | | | |
| 1 2 Classroom 215 NNA Celling Tile 2'x 4' Nons Suspect ACM 900 SF 0 SF | | | | | | | | | | | | | |
| 1 2 Classroom 215 NA Chorarde Block Wall Non Supped ACM 1100 SF 0 SF Multi Multi 1 2 Classroom 213 NA Celling Tie 2 x 4* Non Supped ACM 900 SF 0 SF Multi Multi< | | | | | | | | | • | | Multi | | |
| 1 2 Classroom 213 NA Floor Tie VAT 12* X12* NAD 900 SF 0 SF Multi 1 2 Classroom 213 NAA Concrete Block Wall Non Suspect ACM 900 SF 0 SF Classroom 211 NAA Concrete Block Wall Non Suspect ACM 900 SF 0 SF Multi Classroom 211 NAA Concrete Block Wall Non Suspect ACM 900 SF 0 SF Multi Classroom 211 NAA Celling Tile 2 x 41 Non Suspect ACM 900 SF 0 SF Multi Classroom 211 0 216 NAA Celling Tile 2 x 41 Non Suspect ACM 900 SF 0 SF Multi Classroom 211 0 216 NAA Celling Tile 2 x 41 Non Suspect ACM 2000 SF 0 SF Multi Na Suspect ACM 2000 SF Multi No Suspect ACM 2000 | | | | | | | | | 0 | | | | |
| 1 2 Classroom 213 N/A Celling Tile 2'', 4'' Non Suspect ACM 900 SF 0 SF | | | | | | | | | | | Multi | | |
| 1 2 Classroom 211 N/A Floor Tile VAT 12* 12* NAD 900 SF 0 SF Multi 1 2 Classroom 211 N/A Colling Tile 2* x4* Non Suspect ACM 100 SF 0 SF 0 <td></td> <td></td> <td></td> <td></td> <td></td> <td>Non Suspect ACM</td> <td></td> <td>SF</td> <td></td> <td>SF</td> <td></td> <td></td> <td></td> | | | | | | Non Suspect ACM | | SF | | SF | | | |
| 1 2 Classroom 211 N/A Celling Tile 2 × 4' Non Suspect ACM 900 SF 0 SF | | | | | | | | | | | | | |
| 1 2 Classroom 211 NA Concrete Block Wall Non Suppert ACM 1100 SF 0 SF Multi 1 2 Hallway from Cafeteria to HRT Froom NA Floor Tile VAT 12* x12* NAD 980 SF 0 SF Multi | | | | | | | | | | | Multi | | |
| 1 2 Halkway from Catebrais to HRT Room NA Floor Tire VAT 12" x 12" NAD 960 SF 0 SF Multi 1 2 Halkway from Catebrais to HRT Room NA Central Block Wall Non Suspect ACM 960 SF 0 SF | | | | | | | | | | | | | |
| 1 2 Hallway from Cafeteria to HRT Room N/A Centre Block Wall Non Suspect ACM 260 SF 0 | | | | | | | | | | | Multi | | |
| 1 2 Hallway from Cafeteria to HRT Room NA Concrete Block Wall Non Suspect ACM 200 SF 0 SF Multi 1 2 Hallway from Classrooms 211 to 218 NA Coling Tile 2* 4' NaD 1120 SF 0 SF Multi SF 0 SF Multi NA Concrete Block Wall Non Suspect ACM 3000 SF 0 SF | 1 | | | | | | | SF | | | | | |
| 1 2 Hallway from Classrooms 211 to 218 N/A Celling Tile 2'x 4'' Non Suspect ACM 1120 SF 0 SF <td></td> <td>2</td> <td>Hallway from Cafeteria to HRT Room</td> <td>N/A</td> <td>Concrete Block Wall</td> <td>Non Suspect ACM</td> <td>2500</td> <td>SF</td> <td>0</td> <td>SF</td> <td></td> <td></td> <td></td> | | 2 | Hallway from Cafeteria to HRT Room | N/A | Concrete Block Wall | Non Suspect ACM | 2500 | SF | 0 | SF | | | |
| 12Halway from Classrooms 211 to 218N/AConcrete Block WallNon Suspect ACM3000SF0SF0SF11Loading Dock #1N/AConcrete FloorNon Suspect ACM600SF0SF0SF11Loading Dock #1N/ASheetrock CeilingNon Suspect ACM600SF0SF0SF011Loading Dock #1N/AConcrete Block WallNon Suspect ACM600SF0SF0SF011Loading Dock #2N/AConcrete FloorNon Suspect ACM600SF0 | | | | | | | | | | | Multi | | |
| 1 1 Loading Dock #1 N/A Concrete Floor Non Suspect ACM 600 SF 0 SF | | | | | | | | | | | + | | |
| 1 1 Loading Dock #1 N/A Sheetrock Celling Non Suspect ACM 600 SF 0 SF 1 1 Loading Dock #1 N/A Concrete Block Wall Non Suspect ACM 1000 SF 0 SF 0 SF 1 1 Loading Dock #2 N/A Concrete Block Wall Non Suspect ACM 600 SF 0 | | | | | | | | | | | + | | |
| 11Loading Dock #1N/AConcrete Block WallNon Suspect ACM1000SF0SF0SF0SF11Loading Dock #2N/AConcrete FloorNon Suspect ACM600SF <td< td=""><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td> </td><td></td><td></td></td<> | | | | | | | | | | | | | |
| 11Loading Dock #2N/AConcrete FloorNon Suspect ACM600SF0SF0SF11Loading Dock #2N/ASheetrock CeilingNon Suspect ACM600SF0< | 1 | | Loading Dock #1 | | | | | | | | | | |
| 1 1 Loading Dock #2 N/A Concrete Block Wall Non Suspect ACM 1000 SF 0 | | | Loading Dock #2 | | | | 600 | | 0 | | | | |
| 1 1 Elevator Machinery Room 112A N/A Concrete Floor Non Suspect ACM 300 SF 0 1 1 | | | | | | | | | | | ┥───┤ | | |
| 1 1 Elevator Machinery Room 112A N/A Metal Deck Celling Non Suspect ACM 300 SF 0 SF | | | | | | | | | | | + | | |
| 1 1 Elevator Machinery Room 112A N/A Concrete Block Wall Non Suspect ACM 700 SF 0 SF | | | | | | | | | | | + + | | |
| 1 1 Loading Dock Office 112 N/A Floor Tile VAT 12" x 12" NAD 300 SF 0 SF Blue Image: Second S | | | | | | | | SF | | SF | | | |
| 1 1 Loading Dock Office 112 N/A Concrete Block Wall Non Suspect ACM 700 SF 0 SF 1 1 1 Exit Hallway adjacent to Gymnasium N/A Floor Tile VAT 12" x 12" NAD 560 SF 20 SF Multi 1 1 Exit Hallway adjacent to Gymnasium N/A Concrete Block Wall Non Suspect ACM 560 SF 20 SF Multi 1 1 Exit Hallway adjacent to Gymnasium N/A Concrete Block Wall Non Suspect ACM 560 SF 0 SF SF SF | 1 | 1 | Loading Dock Office 112 | | Floor Tile VAT 12" x 12" | NAD | 300 | SF | 0 | SF | Blue | | |
| 1 1 Exit Hallway adjacent to Gymnasium N/A Floor Tile VAT 12" x 12" NAD 560 SF 20 SF Multi 1 1 Exit Hallway adjacent to Gymnasium N/A Ceiling Tile 2" x 4" Non Suspect ACM 560 SF 60 SF | · · · | | | | | | | | | | 1 1 | | |
| 1 1 Exit Hallway adjacent to Gymnasium N/A Ceiling Tile 2'x 4' Non Suspect ACM 560 SF 60 SF 1 1 Exit Hallway adjacent to Gymnasium N/A Concrete Block Wall Non Suspect ACM 1500 SF 0 SF 1 1 Exit Hallway adjacent to Gymnasium N/A Fiberglass Pipe Insulation Non Suspect ACM 35 LF 0 LF | | | | | | | | | | | NA. ulti | | |
| 1 1 Exit Hallway adjacent to Gymnasium N/A Concrete Block Wall Non Suspect ACM 1500 SF 0 SF 1 1 Exit Hallway adjacent to Gymnasium N/A Fiberglass Pipe Insulation Non Suspect ACM 35 LF 0 LF | | | | | | | | | | | iviulti | | <u> </u> |
| 1 1 Exit Hallway adjacent to Gymnasium N/A Fiberglass Pipe Insulation Non Suspect ACM 35 LF 0 LF 0 | 1 | | | | | | | | | | | | |
| 1 1 Exit Hallway adjacent to Gymnasium N/A Fiberglass Pipe Fitting Insulation Non Suspect ACM 2 EA 0 EA | 1 | 1 | Exit Hallway adjacent to Gymnasium | N/A | Fiberglass Pipe Insulation | Non Suspect ACM | 35 | LF | 0 | LF | | | |
| | 1 | 1 | Exit Hallway adjacent to Gymnasium | N/A | Fiberglass Pipe Fitting Insulation | Non Suspect ACM | 2 | EA | 0 | EA | | | |

| | | School District of Philadelphia | | AHERA Thr | ee-Year Reinspection 2015-2 | 2016 | | | | | Reinspection Date: 05/05/2016 | |
|---|----------------|------------------------------------|---------|--------------------------|-----------------------------|------|----|-----|----|---------|----------------------------------|-----------------------|
| Like Like Like Magnetic 2011 Magnetic 2011 Magnetic 2017 Magn | | Kensington Health Sciences Academy | | Room b | by Room Location Log Report | | | | | | Building Inspector: James Madden | |
| | | | | | · | | | - | | | Number: 030867 | |
| Unit Unit Operating of the second se | | | | | | | | | | - | Management Planner: M. Causley | |
| F Column MAX F Amount F F Amount F Amo | | | | | | | | | | H | | |
| P P P Data Parameter Space Parameter P Description of the State Parameter Descriparameter Description of the State Pa | = | fear Built: 2001 | | | | 1 | | | | | | |
| 1 1 Number algoed lading box fibes NU Por Tie VII (* 1/2 * 17" NU Out Por Port Tie VII (* 1/2 * 17" NU Por 1 1 Number algoed lading box fibes NU Por Tie VII (* 1/2 * 17" NU South | n n 0 | | | | | | | | | | | Attic/ Crawl Space |
| I I No. Support Jourge Doc. Office NAA Calling Try 7.4 No. Support Add Gall Performance P | | | | | | | | | | | Comments/Description/Notes | Ranking |
| 1 1 Numerical State 1.4 NAME Convert Bios Wall Num Transport AdM N | _ | | | | | | | | | Multi | | |
| I I NAME Proof The XT 17 17 17 NAD See P Jos Bute 1 1 Needings 114 NA Control 116 7 17 17 Na Na Description 117 See See See 1 1 Needings 114 2 area NA Control 117 7 2 area Na See 20 area See 1 1 Needings 114 2 area NA Control 117 7 2 area Na See 20 area See See 1 1 Needings 114 2 area Na Control 117 7 area Na See 20 area See See See See 1 1 Needings 114 2 area Na Control 117 7 area Na See 20 area See See </td <td></td> | | | | | | | | | | | | |
| 1 1 1 Non-Singler Adv 100 87 0 97 1 1 1 Non-Singler Adv 100 67 0 97 1 1 1 Non-Singler Adv 100 67 0 97 1 1 1 Non-Singler Adv 100 67 0 97 1 1 1 Non-Singler Adv 100 67 0 97 1 1 1 Non-Singler Adv Non-Singler Adv 100 67 0 97 1 1 1 Non-Singler Adv Non-Singler Adv 100 67 0 97 1 1 1 Advance Non-Singler Adv Non-Singler Adv 100 67 0 97 1 | | | | | | | | | SF | Blue | | |
| 1 1 1 Near Math 14 Agencom NNA Company 16 Feb Company 97 0 0 97 0 | | | | | | | | | | | | |
| 1 1 Lamb Suin 14 Mathom NM Cells TP 2.4 Non Supper A/M 1000 57 10 </td <td></td> | | | | | | | | | | | | |
| I I Numb Concess Back Wall Non Supper ACM Spin Spin Spin I I Name Strain 14 Reaction N/A Convers, Tier Wall Non Supper ACM Spin | _ | | | | | | | | | | | |
| 1 1 1 1 1 1 0 1 0 1 0 1 0 1 0 1 0 1 0 1 0 1 0 1 0 1 | _ | | | | | | | | | | | |
| 1 1 A Artison 19. NA Free Tire VAT 17 × 17 NAD 600 67 20 87 Mage 1 1 Artison 19. NA Color 19. NA For Tire VAT 17 × 17 NA Nor 5 speet ALM 600 67 60 67 60 67 60 70 10 <td></td> <td></td> <td></td> <td>Ceramic Tile Walls</td> <td></td> <td></td> <td>SF</td> <td></td> <td>SF</td> <td>1</td> <td></td> <td></td> | | | | Ceramic Tile Walls | | | SF | | SF | 1 | | |
| 1 1 ArtSon 1:9 NA Concrete Block Wall New Buy 1200 8F 0 8F 0 1 1 Classroom 166 NNA Control 11/2 x 12" NAD 000 8F 00 | | Art Room 110 | | | | 900 | | | | Multi | | |
| 1 0 Disastorn 100 NA Pior Tie VAT 12' x 12' NAD 000 87 20 87 Mag 1 0 Disastorn 100 NA Config 12' x 14' Non Suppert ALM 900 87 0 87 0 1 1 Disastorn 100 NA Config 12' x 14'' Non Suppert ALM 100 87 0 87 0 87 1 1 Disastorn 100 NA Concrete Block Wat Non Suppert ALM 100 87 0 87 0 87 1 1 Disastorn 100 NA Concrete Block Wat Non Suppert ALM 100 87 0 87 Mag 1 Disastorn 100 NA Concrete Block Wat Non Suppert ALM 100 87 0 87 Mag 1 Disastorn 100 NA Concrete Block Wat Non Suppert ALM 100 87 0 87 Mag 1 Disastorn 100 NA Concrete Block Wat <td></td> | | | | | | | | | | | | |
| I Classrom 106 N/A Centre Bock Viet New Supper A/M 100 SF 00 SF 00 SF 00 1 Classrom 106 N/A Pace Viet Viet Viet Viet Viet Viet Viet Vie | _ | | | | | | | | | N4:-141 | | |
| I Classron 190 NA Concrete Book Wait None May | | | | | | | | | | IVIUITI | | |
| I Classron 104 NA Fibre Tile YAT 12" x 12" NAD 960 87 All 1 Classron 104 NA Coll [16 x 4" Non Suppet ADM 900 87 0.0 87 Mat 1 Classron 104 NA Door Tile YAT 2" x 12" Non Suppet ADM 900 87 0.0 | | | | | | | | | | | | |
| 1 1 Classcon 104 NNA Controls Block Wall NNA 1000 SF 0 SF 0 SF 1 Classcon 102 NAA Coling Tin 2* 4* Non Suppert ACM 900 SF 600 SF 1 Classcon 102 NAA Coling Tin 2* 4* Non Suppert ACM 900 SF 600 SF 1 Classcon 101 NAA Controls Tin 2* 4* Non Suppert ACM 900 SF 600 SF 1 Classcon 101 NA Controls Tin 2* 4* Non Suppert ACM 900 SF 0 SF 1 Classcon 103 NA Floor Tin VA1 ** 1*2* NAD 900 SF 0 SF 1 Classcon 103 NA Floor Tin VA1 ** 1*2* NAD 900 SF 0 SF 1 Classcon 106 NA Coling Tin 2* 4* Non Suppert ACM 1000 SF 0 SF 1 Classcon 106 NA Controte Block Wall <td></td> <td></td> <td>N/A</td> <td></td> <td></td> <td></td> <td>SF</td> <td>20</td> <td></td> <td>Multi</td> <td></td> <td></td> | | | N/A | | | | SF | 20 | | Multi | | |
| 1 1 Classroon 102 NA Floor Tile VAI 12* 12" NAD Sec SF Aug 1 1 Classroon 102 NA Controle Block Wal Non Suspect ACM 1000 SF 0 SF 0 SF 1 Classroon 101 NA Controle Block Wal Non Suspect ACM 1000 SF 0 SF Mad 1 Classroon 101 NA Controle Block Wal Non Suspect ACM 000 SF 0 SF Mad 1 Classroon 103 NA Controle Block Wal Non Suspect ACM 000 SF 0 SF Mad 1 Classroon 103 NA Controle Block Wal Non Suspect ACM 000 SF 0.0 SF Mad 1 Classroon 103 NA Controle Block Wal Non Suspect ACM 1000 SF 0.0 SF Mad 1 Classroon 103 NA Controle Block Wal Non Suspect ACM 1000 SF 0.0 | | | | | | | | | | | | |
| 1 1 Classroom 102 NA Centing The 2 × 4 Non Suspect ACM 960 SF 60 SF 00 1 Classroom 102 NA Control Block Wall Non Suspect ACM 1000 SF 00 SF 00 <td></td> | | | | | | | | | | | | |
| 1 0 | | | | | | | | | | Multi | | |
| 1 1 Classroom 101 NA FFOOT Tile VAT 12* X12" NAD 9900 SF 200 SF Multi 1 1 Classroom 101 NAA Concrete Block Wail Non Suspect ACM 1200 SF 0.0 SF 0.0 SF 1 Classroom 101 NAA Floor IVA 12* X12" NAD 0.00 SF 0.0 SF Multi 1 Classroom 103 NAA Floor IVA 12* X12" NAD 0.00 SF 0.0 SF Multi 1 Classroom 103 NAA Floor IVA 12* X12" NAD 0.00 SF 0.0 SF 1 Classroom 105 NAA Concrete Block Wail Non Suspect ACM 1000 SF 0.0 SF 0 0 0 <t< td=""><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td>-</td><td></td><td></td><td></td></t<> | | | | | | | | | - | | | |
| 1 1 Classroom 101 NAA Concrete Block Wall Non Suspect ACM 1200 SF 0 SF | | | | | | | SF | | SF | Multi | | |
| 1 1 Classroom 103 NAA Floor Tile VAT 12* x 12* NAD 900 SF 20 SF Multi 1 1 Classroom 103 NAA Contropt Block Wall Non Suspect ACM 1200 SF 60 SF 0 SF 1 1 Classroom 103 NAA Contropt Block Wall NAO 900 SF 60 SF 1 1 Classroom 105 NAA Contropt Block Wall NAD 900 SF 60 SF 1 Classroom 105 NAA Contropt Block Wall NAD SF 00 SF 00 SF 1 At Room 110 Restroom NAA Centramto Tife Fors NAD Suspect ACM 100 SF 0 | | Classroom 101 | | | | | | | | | | |
| 1 1 Classroom 103 NAA Concrete Block Wall Nen Suspect ACM 900 SF 60 SF 1 1 Classroom 105 N/A Floor Tire VAT 12" x 12" NAD 600 SF 0.0 | | | | | | | | | | | | |
| 1 1 0lassroom 103 NNA Concrete Block Wall Non Suspect ACM 1200 SF 0 SF Description 1 1 Classroom 105 NNA Celling Tile 2' x 4 Non Suspect ACM 900 SF 60 SF 1 1 Classroom 105 NNA Concrete Block Wall Non Suspect ACM 100 SF 0 SF 1 1 Art Room 110 Restroom NNA Concrete Block Wall Non Suspect ACM 100 SF 0 SF 1 1 Art Room 110 Restroom NNA Celling Tile 2' x 4 Non Suspect ACM 100 SF 0 SF 1 1 Art Room 110 Restroom NNA Celling Tile 2' x 4 Non Suspect ACM 100 SF 0 SF 1 1 Attraction Tile Restroom NAA Celline Walls Non Suspect ACM 100 SF 0 SF 1 1 Classroom 106 Restroom NAA Celline Tile Yalls Non Suspect ACM | | | | | | | | | | Multi | | |
| 1 1 0lassoon 105 NA Flor Tile VAT 12" x 12" NAO Open 4AD Open 5F 620 SF Multi 1 1 Classoon 105 NAA Central Tile 2" x 4" Non Suspect ACM 1200 SF 00 SF 0 SF 1 1 Art Room 110 Restroom NNA Concrete Block Wall Non Suspect ACM 100 SF 0 SF | | | | | | | | | | | | |
| 1 1 Classoon 105 N/A Celling Tile Z * 4" Non Suspect ACM 900 SF 60 SF 1 1 Att Room 110 Restroom N/A Concrete Block Wall Non Suspect ACM 100 SF 0 SF 1 1 Att Room 110 Restroom N/A Ceramic Tile Picors Non Suspect ACM 100 SF 0 SF 1 1 Att Room 110 Restroom N/A Ceramic Tile Yall Non Suspect ACM 100 SF 0 SF 1 1 Att Room 110 Restroom N/A Correcte Block Wall Non Suspect ACM 100 SF 0 SF 1 1 Classroom 106 Restroom N/A Ceramic Tile Valls Non Suspect ACM 100 SF 0 SF 1 1 Classroom 106 Restroom N/A Ceramic Tile Valls Non Suspect ACM 100 SF 0 SF 1 1 Classroom 106 Restroom N/A Ceramic Tile Valls Non Suspect ACM | 1 1 | | | | | | | | | Multi | | |
| 1 1 AR Room 110 Restroom NA Cerrain Tile Flors Non Susped ACM 100 SF 0 SF 1 1 AR Room 110 Restroom NA Celling Tile 2'x 4' Non Susped ACM 100 SF 0 SF 1 1 AR Room 110 Restroom NA Corraree Block Wall Non Susped ACM 100 SF 0 SF 1 1 AR Room 110 Restroom NA Corrare Block Wall Non Susped ACM 100 SF 0 SF 1 1 Classroom 106 Restroom NA Cerrain Tile Flors Non Susped ACM 100 SF 0 SF 1 1 Classroom 106 Restroom NA Cerrain Tile Flors Non Susped ACM 100 SF 0 SF 1 1 Classroom 104 Restroom NA Cerrain Tile Flors Non Susped ACM 100 SF 0 SF 1 1 Classroom 104 Restroom NA Cerrain Tile Flors Non Susped ACM 100 | 1 1 | Classroom 105 | | | | | | | | | | |
| 1 1 Art Room 110 Restroom N/A Ceiling Tile 2 × 4" Non Susped ACM 100 SF 0 SF 1 1 Art Room 110 Restroom N/A Corrant: Tile Valis Non Susped ACM 300 SF 0 SF 1 1 Art Room 110 Restroom N/A Ceramic Tile Valis Non Susped ACM 100 SF 0 SF 1 1 Classroom 106 Restroom N/A Ceramic Tile Valis Non Susped ACM 100 SF 0 SF 1 1 Classroom 106 Restroom N/A Ceramic Tile Valis Non Susped ACM 100 SF 0 SF 1 1 Classroom 106 Restroom N/A Ceramic Tile Valis Non Susped ACM 100 SF 0 SF 1 1 Classroom 106 Restroom N/A Ceramic Tile Valis Non Susped ACM 100 SF 0 SF 1 1 Classroom 106 Restroom N/A Ceramic Tile Valis Non Susped ACM | | | | | | | | , o | | | | |
| 1 1 At Room 110 Restroom N/A Concrete Block Wall Non Suspect ACM 100 SF 0 SF 1 1 At Room 110 Restroom N/A Ceramic Tile Walls Non Suspect ACM 300 SF 0 SF 1 1 Classroom 106 Restroom N/A Ceramic Tile Floors Non Suspect ACM 100 SF 0 SF 1 Classroom 106 Restroom N/A Corracte Block Wall Non Suspect ACM 100 SF 0 SF 1 Classroom 106 Restroom N/A Corracte Block Wall Non Suspect ACM 100 SF 0 SF 1 Classroom 106 Restroom N/A Ceramic Tile Valls Non Suspect ACM 100 SF 0 SF 1 Classroom 104 Restroom N/A Ceramic Tile Valls Non Suspect ACM 100 SF 0 SF 1 Classroom 104 Restroom N/A Ceramic Tile Valls Non Suspect ACM 100 SF 0 SF | | | | | | | | | | - | | |
| 1 1 Art Room 110 Restroom N/A Ceramic Tile Walls Non Supped ACM 300 SF 0 SF 1 1 Classroom 106 Restroom N/A Ceramic Tile Floors Non Supped ACM 100 SF 0 SF 1 1 Classroom 106 Restroom N/A Ceramic Tile Valls Non Supped ACM 100 SF 0 SF 1 1 Classroom 106 Restroom N/A Ceramic Tile Walls Non Susped ACM 300 SF 0 SF 1 1 Classroom 104 Restroom N/A Ceramic Tile Floors Non Susped ACM 100 SF 0 SF 1 1 Classroom 104 Restroom N/A Ceramic Tile Floors Non Susped ACM 100 SF 0 SF 1 1 Classroom 104 Restroom N/A Ceramic Tile Valls Non Susped ACM 100 SF 0 SF 1 1 Classroom 104 Restroom N/A Ceramic Tile Valls Non Susped ACM | | | | | | | | - | | | | |
| 1 1 Classroom 106 Restroom N/A Cerain Tile Floors Non Suspect ACM 100 SF 0 SF 1 1 Classroom 106 Restroom N/A Corrent Dick Vall Non Suspect ACM 100 SF 0 SF 1 1 Classroom 106 Restroom N/A Corrent Dick Vall Non Suspect ACM 100 SF 0 SF 1 1 Classroom 106 Restroom N/A Ceramic Tile Floors Non Suspect ACM 100 SF 0 SF 1 Classroom 104 Restroom N/A Ceramic Tile Floors Non Suspect ACM 100 SF 0 SF 1 Classroom 104 Restroom N/A Ceramic Tile Z x 4' Non Suspect ACM 100 SF 0 SF 1 Classroom 104 Restroom N/A Ceramic Tile Z x 4' Non Suspect ACM 100 SF 0 SF 1 Classroom 104 Restroom N/A Ceramic Tile Valls Non Suspect ACM 100 SF 0 | | | | | | | | | | | | |
| 1 Classroom 106 Restroom NA Concrete Block Wall Non Suspect ACM 100 SF 0 SF 1 1 Classroom 106 Restroom N/A Ceranic Tile Floors Non Suspect ACM 300 SF 0 SF 1 1 Classroom 104 Restroom N/A Ceranic Tile Floors Non Suspect ACM 100 SF 0 SF 1 1 Classroom 104 Restroom N/A Ceranic Tile Floors Non Suspect ACM 100 SF 0 SF 1 1 Classroom 104 Restroom N/A Concrete Block Wall Non Suspect ACM 100 SF 0 SF 1 1 Classroom 102 Restroom N/A Ceranic Tile Floors Non Suspect ACM 100 SF 0 SF 1 1 Classroom 102 Restroom N/A Ceranic Tile Floors Non Suspect ACM 100 SF 0 SF 1 1 Classroom 102 Restroom N/A Ceramic Tile Valls Non Suspect ACM <td< td=""><td>1 1</td><td></td><td></td><td>Ceramic Tile Floors</td><td></td><td></td><td>SF</td><td>0</td><td></td><td></td><td></td><td></td></td<> | 1 1 | | | Ceramic Tile Floors | | | SF | 0 | | | | |
| 1 Classroom 106 Restroom N/A Ceramic Tile Walls Non Suspect ACM 300 SF 0 SF 1 1 Classroom 104 Restroom N/A Ceramic Tile Flors Non Suspect ACM 100 SF 0 SF 1 1 Classroom 104 Restroom N/A Celling Tile 2' x.4' Non Suspect ACM 100 SF 0 SF 1 1 Classroom 104 Restroom N/A Corrant CTile Walls Non Suspect ACM 300 SF 0 SF 1 1 Classroom 104 Restroom N/A Ceramic Tile Walls Non Suspect ACM 300 SF 0 SF 1 1 Classroom 102 Restroom N/A Ceramic Tile Walls Non Suspect ACM 100 SF 0 SF 1 1 Classroom 102 Restroom N/A Ceramic Tile Walls Non Suspect ACM 100 SF 0 SF 1 1 Classroom 102 Restroom N/A Ceramic Tile Walls Non Suspect ACM 10 | | | | | | | | | | | | |
| 1 Classroom 104 Restroom N/A Ceramic Tile Floors Non Suspect ACM 100 SF 0 SF 1 1 Classroom 104 Restroom N/A Ceramic Tile Floors Non Suspect ACM 100 SF 0 SF 1 1 Classroom 104 Restroom N/A Correcte Block Wall Non Suspect ACM 100 SF 0 SF 1 1 Classroom 104 Restroom N/A Ceramic Tile Floors Non Suspect ACM 300 SF 0 SF 1 1 Classroom 102 Restroom N/A Ceramic Tile Floors Non Suspect ACM 100 SF 0 SF 1 1 Classroom 102 Restroom N/A Ceramic Tile Floors Non Suspect ACM 100 SF 0 SF 1 1 Classroom 102 Restroom N/A Ceramic Tile Floors Non Suspect ACM 100 SF 0 SF 1 1 Classroom 101 Restroom N/A Ceramic Tile Valls Non Suspect ACM <t< td=""><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td>-</td><td> </td><td></td><td></td></t<> | | | | | | | | | - | | | |
| 1 1 Classroom 104 Restroom N/A Celling Tile 2'x 4' Non Suspect ACM 100 SF 0 SF 1 1 Classroom 104 Restroom N/A Corarde Block Wall Non Suspect ACM 100 SF 0 SF 1 1 Classroom 102 Restroom N/A Ceramic Tile Valls Non Suspect ACM 100 SF 0 SF 1 1 Classroom 102 Restroom N/A Ceramic Tile Valls Non Suspect ACM 100 SF 0 SF 1 1 Classroom 102 Restroom N/A Ceramic Tile Valls Non Suspect ACM 100 SF 0 SF 1 1 Classroom 102 Restroom N/A Corarcet Block Wall Non Suspect ACM 100 SF 0 SF 1 1 Classroom 102 Restroom N/A Ceramic Tile Floors Non Suspect ACM 100 SF 0 SF 1 1 Classroom 101 Restroom N/A Ceramic Tile Floors Non Suspect ACM | | | | | | | | - | | + | | |
| 1 1 Classroom 104 Restroom N/A Concrete Block Wall Non Suspect ACM 100 SF 0 SF 1 1 Classroom 104 Restroom N/A Ceramic Tile Walls Non Suspect ACM 300 SF 0 SF 1 1 Classroom 102 Restroom N/A Ceramic Tile Floors Non Suspect ACM 100 SF 0 SF 1 1 Classroom 102 Restroom N/A Ceramic Tile Floors Non Suspect ACM 100 SF 0 SF 1 1 Classroom 102 Restroom N/A Ceramic Tile Valls Non Suspect ACM 100 SF 0 SF 1 1 Classroom 102 Restroom N/A Ceramic Tile Valls Non Suspect ACM 100 SF 0 SF 1 1 Classroom 101 Restroom N/A Ceramic Tile Valls Non Suspect ACM 100 SF 0 SF 1 1 Classroom 101 Restroom N/A Ceramic Tile Floors Non Suspect ACM | | | | | | | | | | | | |
| 11Classroom 102 RestroomN/ACeramic Tile FlorsNon Suspect ACM100SF0SF11Classroom 102 RestroomN/ACelining Tile 2' x 4'Non Suspect ACM100SF0SF11Classroom 102 RestroomN/AConcrete Block WallNon Suspect ACM100SF0SF11Classroom 102 RestroomN/ACeramic Tile WallsNon Suspect ACM300SF0SF11Classroom 101 RestroomN/ACeramic Tile FlorsNon Suspect ACM100SF0SF11Classroom 101 RestroomN/ACeramic Tile FlorsNon Suspect ACM100SF0SF11Classroom 101 RestroomN/ACeramic Tile FlorsNon Suspect ACM100SF0SF11Classroom 101 RestroomN/AConcrete Block WallNon Suspect ACM100SF0SF11Classroom 101 RestroomN/ACeramic Tile WallsNon Suspect ACM100SF0SF11Classroom 103 RestroomN/ACeramic Tile WallsNon Suspect ACM100SF0SF11Classroom 103 RestroomN/ACeramic Tile WallsNon Suspect ACM100SF0SF11Classroom 103 RestroomN/ACeramic Tile WallsNon Suspect ACM100SF0SF11C | | | N/A | Concrete Block Wall | | 100 | SF | | SF | | | |
| 11Classroom 102 RestroomN/ACelling Tile 2'x 4'Non Suspect ACM100SF0SF11Classroom 102 RestroomN/AConcrete Block WallNon Suspect ACM100SF0SF11Classroom 102 RestroomN/ACeramic Tile WallsNon Suspect ACM300SF0SF11Classroom 101 RestroomN/ACeramic Tile FloorsNon Suspect ACM100SF0SF11Classroom 101 RestroomN/ACeramic Tile FloorsNon Suspect ACM100SF0SF11Classroom 101 RestroomN/ACeramic Tile VallsNon Suspect ACM100SF0SF11Classroom 101 RestroomN/ACeramic Tile VallsNon Suspect ACM100SF0SF11Classroom 101 RestroomN/ACeramic Tile VallsNon Suspect ACM100SF0SF11Classroom 103 RestroomN/ACeramic Tile FloorsNon Suspect ACM100SF0SF11Classroom 103 RestroomN/ACeramic Tile FloorsNon Suspect ACM100SF0SF11Classroom 103 RestroomN/ACeramic Tile FloorsNon Suspect ACM100SF0SF11Classroom 103 RestroomN/ACeramic Tile VallsNon Suspect ACM100SF0SF11 <td< td=""><td>1 1</td><td>Classroom 104 Restroom</td><td></td><td></td><td>Non Suspect ACM</td><td>300</td><td></td><td>0</td><td></td><td></td><td></td><td></td></td<> | 1 1 | Classroom 104 Restroom | | | Non Suspect ACM | 300 | | 0 | | | | |
| 11Classroom 102 RestroomN/AConcrete Block WallNon Suspect ACM100SF0SF11Classroom 102 RestroomN/ACeramic Tile VallsNon Suspect ACM300SF0SF11Classroom 101 RestroomN/ACeramic Tile FloorsNon Suspect ACM100SF0SF11Classroom 101 RestroomN/ACeling Tile 2' x 4'Non Suspect ACM100SF0SF11Classroom 101 RestroomN/ACeling Tile 2' x 4'Non Suspect ACM100SF0SF11Classroom 101 RestroomN/ACeramic Tile FloorsNon Suspect ACM100SF0SF11Classroom 103 RestroomN/ACeramic Tile FloorsNon Suspect ACM100SF0SF11 <td>_</td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td>1</td> <td></td> <td></td> | _ | | | | | | | | | 1 | | |
| 11Classroom 102 RestroomN/ACeramic Tile WallsNon Suspect ACM300SF0SF11Classroom 101 RestroomN/ACeramic Tile FloorsNon Suspect ACM100SF0SF11Classroom 101 RestroomN/ACeiling Tile 2'x 4'Non Suspect ACM100SF0SF11Classroom 101 RestroomN/ACeiling Tile 2'x 4'Non Suspect ACM100SF0SF11Classroom 101 RestroomN/AConcrete Block WallNon Suspect ACM100SF0SF11Classroom 101 RestroomN/ACeramic Tile VallsNon Suspect ACM300SF0SF11Classroom 103 RestroomN/ACeramic Tile FloorsNon Suspect ACM100SF0SF11Classroom 103 RestroomN/ACeramic Tile FloorsNon Suspect ACM100SF0SF11Classroom 103 RestroomN/ACeiling Tile 2'x 4'Non Suspect ACM100SF0SF11Classroom 103 RestroomN/ACeramic Tile FloorsNon Suspect ACM100SF0SF11Classroom 103 RestroomN/ACeramic Tile WallsNon Suspect ACM100SF0SF11Classroom 103 RestroomN/ACeramic Tile VallsNon Suspect ACM100SF0SF11 <t< td=""><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td>+</td><td></td><td></td></t<> | | | | | | | | | | + | | |
| 11Classroom 101 RestroomN/ACeramic Tile FloorsNon Suspect ACM100SF0SF11Classroom 101 RestroomN/ACeramic Tile FloorsNon Suspect ACM100SF0SF11Classroom 101 RestroomN/AConcrete Block WallNon Suspect ACM100SF0SF11Classroom 101 RestroomN/ACeramic Tile WallsNon Suspect ACM100SF0SF11Classroom 103 RestroomN/ACeramic Tile VallsNon Suspect ACM300SF0SF11Classroom 103 RestroomN/ACeramic Tile FloorsNon Suspect ACM100SF0SF11Classroom 103 RestroomN/ACeramic Tile FloorsNon Suspect ACM100SF0SF11Classroom 103 RestroomN/ACeramic Tile VallNon Suspect ACM100SF0SF11Classroom 103 RestroomN/ACeramic Tile WallsNon Suspect ACM100SF0SF11Classroom 105 RestroomN/ACeramic Tile FloorsNon Suspect ACM100SF0SF11Classroom 105 RestroomN/ACeramic Tile FloorsNon Suspect ACM100SF0SF11Classroom 105 RestroomN/ACeramic Tile FloorsNon Suspect ACM100SF0SF11 <td< td=""><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td>+ +</td><td></td><td></td></td<> | | | | | | | | | | + + | | |
| 11Classroom 101 RestroomN/ACelling Tile 2'x 4'Non Suspect ACM100SF0SF11Classroom 101 RestroomN/AConcrete Block WallNon Suspect ACM100SF0SF11Classroom 103 RestroomN/ACeramic Tile VallsNon Suspect ACM300SF0SF11Classroom 103 RestroomN/ACeramic Tile FloorsNon Suspect ACM300SF0SF11Classroom 103 RestroomN/ACeramic Tile FloorsNon Suspect ACM100SF0SF11Classroom 103 RestroomN/ACeramic Tile FloorsNon Suspect ACM100SF0SF11Classroom 103 RestroomN/AConcrete Block WallNon Suspect ACM100SF0SF11Classroom 103 RestroomN/ACeramic Tile WallsNon Suspect ACM100SF0SF11Classroom 103 RestroomN/ACeramic Tile WallsNon Suspect ACM100SF0SF11Classroom 105 RestroomN/ACeramic Tile FloorsNon Suspect ACM100SF0SF11Classroom 105 RestroomN/ACeramic Tile FloorsNon Suspect ACM100SF0SF11Classroom 105 RestroomN/AConcrete Block WallNon Suspect ACM100SF0SF11< | _ | | | | | | | | | 1 | | |
| 11Classroom 101 RestroomN/ACeramic Tile WallsNon Suspect ACM300SF0SF11Classroom 103 RestroomN/ACeramic Tile FloorsNon Suspect ACM100SF0SF11Classroom 103 RestroomN/ACeiling Tile 2'x 4'Non Suspect ACM100SF0SF11Classroom 103 RestroomN/AConcrete Block WallNon Suspect ACM100SF0SF11Classroom 103 RestroomN/AConcrete Block WallNon Suspect ACM100SF0SF11Classroom 103 RestroomN/ACeramic Tile FloorsNon Suspect ACM300SF0SF11Classroom 105 RestroomN/ACeramic Tile FloorsNon Suspect ACM100SF0SF11Classroom 105 RestroomN/ACeramic Tile FloorsNon Suspect ACM100SF0SF11Classroom 105 RestroomN/ACeramic Tile 2'x 4'Non Suspect ACM100SF0SF11Classroom 105 RestroomN/AConcrete Block WallNon Suspect ACM100SF0SF11Classroom 105 RestroomN/ACeramic Tile 2'x 4'Non Suspect ACM100SF0SF11Classroom 105 RestroomN/ACeramic Tile WallsNon Suspect ACM100SF0SF11 | _ | Classroom 101 Restroom | | | | 100 | | 0 | | | | |
| 11Classroom 103 RestroomN/ACeramic Tile FloorsNon Suspect ACM100SF0SF11Classroom 103 RestroomN/ACeining Tile 2' x 4'Non Suspect ACM100SF0SF11Classroom 103 RestroomN/AConcrete Block WallNon Suspect ACM100SF0SF11Classroom 103 RestroomN/AConcrete Block WallNon Suspect ACM100SF0SF11Classroom 103 RestroomN/ACeramic Tile WallsNon Suspect ACM300SF0SF11Classroom 105 RestroomN/ACeramic Tile FloorsNon Suspect ACM100SF0SF11Classroom 105 RestroomN/ACeramic Tile 2'x 4'Non Suspect ACM100SF0SF11Classroom 105 RestroomN/AConcrete Block WallNon Suspect ACM100SF0SF11Classroom 105 RestroomN/AConcrete Block WallNon Suspect ACM100SF0SF11Classroom 105 RestroomN/AConcrete Block WallNon Suspect ACM100SF0SF11Classroom 105 RestroomN/ACeramic Tile WallsNon Suspect ACM100SF0SF11Classroom 105 RestroomN/ACeramic Tile WallsNon Suspect ACM300SF0SF11 | _ | | | | | | | | | | | |
| 1 1 Classroom 103 Restroom N/A Ceiling Tile 2'x 4' Non Suspect ACM 100 SF 0 SF 1 1 Classroom 103 Restroom N/A Concrete Block Wall Non Suspect ACM 100 SF 0 SF 1 1 Classroom 103 Restroom N/A Concrete Block Wall Non Suspect ACM 100 SF 0 SF 1 1 Classroom 103 Restroom N/A Ceramic Tile Walls Non Suspect ACM 300 SF 0 SF 1 1 Classroom 105 Restroom N/A Ceramic Tile Floors Non Suspect ACM 100 SF 0 SF 1 1 Classroom 105 Restroom N/A Ceramic Tile Floors Non Suspect ACM 100 SF 0 SF 1 1 Classroom 105 Restroom N/A Concrete Block Wall Non Suspect ACM 100 SF 0 SF 1 1 Classroom 105 Restroom N/A Ceramic Tile Walls Non Suspect A | | | | | | | | | | | | |
| 1 1 Classroom 103 Restroom N/A Concrete Block Wall Non Suspect ACM 100 SF 0 SF 1 1 Classroom 103 Restroom N/A Ceramic Tile Walls Non Suspect ACM 300 SF 0 SF 1 1 Classroom 105 Restroom N/A Ceramic Tile Floors Non Suspect ACM 100 SF 0 SF 1 1 Classroom 105 Restroom N/A Ceramic Tile Floors Non Suspect ACM 100 SF 0 SF 1 1 Classroom 105 Restroom N/A Ceiling Tile 2'x 4' Non Suspect ACM 100 SF 0 SF 1 1 Classroom 105 Restroom N/A Concrete Block Wall Non Suspect ACM 100 SF 0 SF 1 1 Classroom 105 Restroom N/A Ceramic Tile Walls Non Suspect ACM 300 SF 0 SF 1 1 Classroom 105 Restroom N/A Ceramic Tile Walls Non Suspect AC | | | | | | | | - | | + + | | |
| 1 1 Classroom 103 Restroom N/A Ceramic Tile Walls Non Suspect ACM 300 SF 0 SF 1 1 Classroom 105 Restroom N/A Ceramic Tile Floors Non Suspect ACM 100 SF 0 SF 1 1 Classroom 105 Restroom N/A Ceramic Tile Floors Non Suspect ACM 100 SF 0 SF 1 1 Classroom 105 Restroom N/A Ceramic Tile Z'x 4' Non Suspect ACM 100 SF 0 SF 1 1 Classroom 105 Restroom N/A Concrete Block Wall Non Suspect ACM 100 SF 0 SF 1 1 Classroom 105 Restroom N/A Ceramic Tile Walls Non Suspect ACM 100 SF 0 SF 1 1 Classroom 105 Restroom N/A Ceramic Tile Walls Non Suspect ACM 300 SF 0 SF | | | | | | | SF | | | 1 1 | | |
| 1 1 Classroom 105 Restroom N/A Ceiling Tile 2'x 4' Non Suspect ACM 100 SF 0 SF 1 1 Classroom 105 Restroom N/A Concrete Block Wall Non Suspect ACM 100 SF 0 SF 1 1 Classroom 105 Restroom N/A Ceramic Tile Walls Non Suspect ACM 300 SF 0 SF | | | N/A | Ceramic Tile Walls | Non Suspect ACM | 300 | SF | | SF | | | |
| 1 1 Classroom 105 Restroom N/A Concrete Block Wall Non Suspect ACM 100 SF 0 SF 1 1 Classroom 105 Restroom N/A Ceramic Tile Walls Non Suspect ACM 300 SF 0 SF | | | | | | | | | | | | |
| 1 1 Classroom 105 Restroom N/A Ceramic Tile Walls Non Suspect ACM 300 SF 0 SF | | | | | | | | | | | | |
| | | | | | | | | - | | | | |
| | | Storage Room 108 | N/A N/A | Floor Tile VAT 12" x 12" | NAD NAD | 60 | SF | 0 | SF | Blue | | |
| 1 1 5 Storage Room 108 N/A Ceiling Tile 2'x 4' Non Suspect ACM 60 SF 0 SF | | | | | | | | | | | | |

| | | School District of Philadelphia | | AHERA Thr | ee-Year Reinspection 2015-2 | 2016 | | | | Re | inspection Date: 05/05/2016 | | | |
|---------|--------|--|---|--|------------------------------------|-------------|----------|-----------|----------------------------------|---------------------------|-----------------------------|------------------|--|--|
| | | Kensington Health Sciences Academy | Room by Room Location Log Report | | | | | | Building Inspector: James Madden | | | | | |
| | | 2463 Emerald Street, Philadelphia, PA 19125 | | | | | | | mber: 030867 | | | | | |
| | | | | Management Planner: M. Causley | | | | | | | | | | |
| | | ULCS# 5011/5550 | Management Planner: M. Causley Number: 046177 | | | | | | | | | | | |
| E | | Year Built: 2001 | | | 1 | 1 | | | - | Nu | mber: 046177 | | | |
| Ī | F | | | | | | | | | | | | | |
| e m | 'i - | | | | | | | | | | | | | |
| e | 0 | | | | Confirmed/Assumed/NAD/ | Amount of | SF LF | Amount of | | | | Attic/ Crawl | | |
| n t | o r | On Site Room Name | System Affected | Material Description | Non Suspect ACM | Material | EA | Damage | SF LF EA | Color required for VAT | Comments/Description/Notes | Space Ranking | | |
| 1 | 1 | Storage Room 108 | N/A | Concrete Block Wall | Non Suspect ACM | 300 | SF | 0 | SF | | | rannig | | |
| 1 | 1 | Office 100 | N/A | Floor Tile VAT 12" x 12" | NAD | 120 | SF | 0 | SF | Blue | | | | |
| 1 | 1 | Office 100 | N/A N/A | Ceiling Tile 2' x 4' | Non Suspect ACM | 120 | SF SF | 0 | SF | | | | | |
| 1 | | Office 100 Stairwell #1 | N/A N/A | Concrete Block Wall Floor Tile VAT 12" x 12" | Non Suspect ACM NAD | 400 300 | SF SF | 0 | SF | Blue | | | | |
| 1 | | Stairwell #1 | N/A | Sheetrock Ceiling | Non Suspect ACM | 300 | SF | 0 | SF | Dide | | | | |
| 1 | 1 | Stairwell #1 | N/A | Concrete Block Wall | Non Suspect ACM | 700 | SF | 0 | SF | | | | | |
| 1 | 1 | Multipurpose Room 107 | N/A | Floor Tile VAT 12" x 12" | NAD | 1200 | SF | 0 | SF | Multi | | | | |
| 1 | 1 | Multipurpose Room 107 | N/A N/A | Sheetrock Ceiling Concrete Block Wall | Non Suspect ACM Non Suspect ACM | 1200 | SF SF | 0 | SF SF | | | | | |
| 1 | | Multipurpose Room 107 Multipurpose Room 107 | N/A N/A | Sheetrock Wall | Non Suspect ACM | 400 | SF | 0 | SF | + | | | | |
| 1 | 1 | Boy's Restroom | N/A | Ceramic Tile Floors | Non Suspect ACM | 144 | SF | 0 | SF | | | | | |
| 1 | 1 | Boy's Restroom | N/A | Ceiling Tile 2' x 4' | Non Suspect ACM | 144 | SF | 0 | SF | | | | | |
| 1 | | Boy's Restroom | N/A | Concrete Block Wall | Non Suspect ACM | 200 | SF | 0 | SF | <u>↓</u> | | | | |
| 1 | 1 | Boy's Restroom Girl's Restroom | N/A N/A | Ceramic Tile Walls Ceramic Tile Floors | Non Suspect ACM Non Suspect ACM | 300 | SF SF | 0 | SF SF | | | | | |
| 1 | 1 | Girl's Restroom | N/A | Ceiling Tile 2' x 4' | Non Suspect ACM | 144 | SF | 0 | SF | | | | | |
| 1 | 1 | Girl's Restroom | N/A | Concrete Block Wall | Non Suspect ACM | 200 | SF | 0 | SF | | | | | |
| 1 | 1 | Girl's Restroom | N/A | Ceramic Tile Walls | Non Suspect ACM | 300 | | 0 | SF | | | | | |
| 1 | 1 | Janitor's Closet 111 | N/A N/A | Ceramic Tile Floors | Non Suspect ACM | 20 | SF SF | 0 | SF SF | | | | | |
| 1 | 1 | Janitor's Closet 111 Janitor's Closet 111 | N/A N/A | Metal Deck Ceiling Concrete Block Wall | Non Suspect ACM Non Suspect ACM | 20 | SF | 0 | SF | | | | | |
| 1 | 1 | Janitor's Closet 111 | N/A | Fiberglass Pipe Insulation | Non Suspect ACM | 175 | LF | 0 | LF | | | | | |
| 1 | 1 | Janitor's Closet 111 | N/A | Fiberglass Pipe Fitting Insulation | Non Suspect ACM | 2 | EA | 0 | EA | | | | | |
| 1 | 1 | LULAC Room 107A | N/A | Floor Tile VAT 12" x 12" | NAD | 600 | SF | 0 | SF | Multi | | | | |
| 1 | 1 | LULAC Room 107A LULAC Room 107A | N/A N/A | Ceiling Tile 2' x 4' Concrete Block Wall | Non Suspect ACM Non Suspect ACM | 600 1000 | SF SF | 0 | SF | | | | | |
| 1 | 1 | PLUS Center 116 | N/A N/A | Carpet | Non Suspect ACM | 1200 | SF | 0 | SF | | | | | |
| 1 | 1 | PLUS Center 116 | N/A | Ceiling Tile 2' x 4' | Non Suspect ACM | 1200 | SF | 0 | SF | | | | | |
| 1 | 1 | PLUS Center 116 | N/A | Concrete Block Wall | Non Suspect ACM | 1400 | SF | 0 | SF | | | | | |
| 1 | 1 | School Office 115 | N/A | Floor Tile VAT 12" x 12" | NAD | 525 | SF | 0 | SF | Blue | | | | |
| 1 | 1 | School Office 115 School Office 115 | N/A N/A | Ceiling Tile 2' x 4' Concrete Block Wall | Non Suspect ACM Non Suspect ACM | 525 | SF SF | 0 | SF | | | | | |
| 1 | 1 | Dean's Office 115A | N/A | Floor Tile VAT 12" x 12" | NAD | 120 | SF | 0 | SF | Blue | | | | |
| 1 | 1 | Dean's Office 115A | N/A | Ceiling Tile 2' x 4' | Non Suspect ACM | 120 | SF | 0 | SF | | | | | |
| 1 | 1 | Dean's Office 115A | N/A | Concrete Block Wall | Non Suspect ACM | 400 | SF | 0 | SF | | | | | |
| 1 | | Princpal's Office Princpal's Office | N/A N/A | Floor Tile VAT 12" x 12" Ceiling Tile 2' x 4' | NAD Non Suspect ACM | 225 | SF SF | 0 | SF SF | Blue | | | | |
| 1 | | Princpal's Office | N/A N/A | Concrete Block Wall | Non Suspect ACM | 600 | SF | 0 | SF | | | | | |
| 1 | | Principal's Restroom | N/A | Ceramic Tile Floors | Non Suspect ACM | 100 | SF | 0 | SF | | | | | |
| 1 | 1 | Principal's Restroom | N/A | Ceiling Tile 2' x 4' | Non Suspect ACM | 100 | SF | 0 | SF | | | | | |
| 1 | | Principal's Restroom | N/A | Concrete Block Wall | Non Suspect ACM | 100 | SF SF | 0 | SF | | | | | |
| 1 | 1 | Principal's Restroom Stairwell #3 | N/A N/A | Ceramic Tile Walls Floor Tile VAT 12" x 12" | Non Suspect ACM NAD | 300 150 | SF SF | 0 | SF SF | Blue | | | | |
| 1 | 1 | Stairwell #3 | N/A | Ceiling Tile 2' x 4' | Non Suspect ACM | 150 | SF | 0 | SF | Diug | | | | |
| 1 | 1 | Stairwell #3 | N/A | Concrete Block Wall | Non Suspect ACM | 500 | SF | 0 | SF | | | | | |
| 1 | 1 | Entrance Hallway Main Office #1 | N/A | Floor Tile VAT 12" x 12" | NAD | 240 | SF | 0 | SF | Multi | | | | |
| 1 | 1 | Entrance Hallway Main Office #1 Entrance Hallway Main Office #1 | N/A N/A | Ceiling Tile 2' x 4' Concrete Block Wall | Non Suspect ACM Non Suspect ACM | 240 500 | SF SF | 0 | SF SF | | | | | |
| 1 | 1 | Entrance Hallway Main Office #1 Entrance Hallway Main Office #2 | N/A N/A | Floor Tile VAT 12" x 12" | NAD NAD | 240 | SF | 0 | SF | Multi | | | | |
| 1 | 1 | Entrance Hallway Main Office #2 | N/A | Ceiling Tile 2' x 4' | Non Suspect ACM | 240 | SF | 0 | SF | | | | | |
| 1 | 1 | Entrance Hallway Main Office #2 | N/A | Concrete Block Wall | Non Suspect ACM | 500 | SF | 0 | SF | | | | | |
| 1 | 1 | Boiler Room | N/A | Concrete Floor | Non Suspect ACM | 1600 | SF | 0 | SF SF | <u>↓</u> | | | | |
| 1 | 1 | Boiler Room Boiler Room | N/A N/A | Metal Deck Ceiling Concrete Block Wall | Non Suspect ACM Non Suspect ACM | 2000 | SF SF | 0 | SF | + | | | | |
| 1 | 1 | Boiler Room | N/A | Fiberglass Pipe Insulation | Non Suspect ACM | 300 | SF | 0 | SF | | | | | |
| 1 | 1 | Boiler Room | N/A | Fiberglass Pipe Fitting Insulation | Non Suspect ACM | 25 | LF | 0 | LF | | | | | |
| 1 | 1 | Boiler Room | N/A | Fiberglass Tank Insulation | Non Suspect ACM | 20 | SF | 0 | SF | | | | | |
| 1 | 1 | Boy's Locker Room | N/A N/A | Floor Tile VAT 12" x 12" Ceiling Tile 2' x 4' | NAD Non Suspect ACM | 400 400 | SF SF | 0 | SF | Multi | | | | |
| 1 | | Boy's Locker Room Boy's Locker Room | N/A N/A | Concrete Block Wall | Non Suspect ACM | 800 | SF | 0 | SF | + | | | | |
| · · · · | · · | 1.7. | | | | | | Ŭ | | | | | | |

| | | School District of Philadelphia | | AHERA Thr | ee-Year Reinspection 2015-20 | 016 | | | | | Reinspection Date: 05/05/2016 | |
|---------------------------------|------------------|--|-----------------|---|---|-----------------------|-------------|---------------------|----------|---------------------------|--|----------------------------------|
| | | Kensington Health Sciences Academy | | Room b | y Room Location Log Report | | | | | | Building Inspector: James Madden | 1 |
| | | 2463 Emerald Street, Philadelphia, PA 19125 | | | · · · · | | | | | | Number: 030867 | 1 |
| | | | | | | | | | | | Management Planner: M. Causley | 1 |
| | | ULCS# 5011/5550 | | | | | | | | | | - 1 |
| _ | | Year Built: 2001 | | | | | 1 1 | | | 6 | Number: 046177 | |
| E I e m e n t | F I o r | On Site Room Name | System Affected | Material Description | Confirmed/Assumed/NAD/ Non Suspect ACM | Amount of Material | SF LF EA | Amount of Damage | EA | Color required for VAT | Comments/Description/Notes | Attic/ Crawl Space Ranking |
| 1 | 1 | Boy's Locker Room Restroom | N/A | Ceramic Tile Floors | Non Suspect ACM | 200 | SF | 0 | SF | | | |
| 1 | | Boy's Locker Room Restroom | N/A | Ceiling Tile 2' x 4' | Non Suspect ACM | 200 | SF | 0 | SF | | | |
| 1 | 1 | Boy's Locker Room Restroom | N/A | Concrete Block Wall | Non Suspect ACM | 100 | SF | 0 | SF | | | |
| 1 | | Boy's Locker Room Restroom | N/A | Ceramic Tile Walls | Non Suspect ACM | 300 | SF | 0 | SF | | | |
| 1 | | Girl's Locker Room | N/A | Floor Tile VAT 12" x 12" | NAD | 400 | SF | 0 | SF | Multi | | |
| 1 | | Girl's Locker Room | N/A N/A | Ceiling Tile 2' x 4' | Non Suspect ACM Non Suspect ACM | 400 | SF SF | 0 | SF SF | | | |
| 1 | | Girl's Locker Room Girl's Locker Room Restroom | N/A N/A | Concrete Block Wall Ceramic Tile Floors | Non Suspect ACM | 800 200 | SF | 0 | SF | | | |
| 1 | 1 | Girl's Locker Room Restroom | N/A N/A | Ceiling Tile 2' x 4' | Non Suspect ACM | 200 | SF | 0 | SF | | | |
| 1 | | Girl's Locker Room Restroom | N/A | Concrete Block Wall | Non Suspect ACM | 100 | SF | 0 | SF | | | |
| 1 | 1 | Girl's Locker Room Restroom | N/A | Ceramic Tile Walls | Non Suspect ACM | 300 | SF | 0 | SF | | | |
| 1 | | Hallway to Gymnasium | N/A | Floor Tile VAT 12" x 12" | NAD | 500 | SF | 0 | SF | Multi | | |
| 1 | 1 | Hallway to Gymnasium | N/A | Ceiling Tile 2' x 4' | Non Suspect ACM | 500 | SF | 0 | SF | ividiti | | |
| 1 | 1 | Hallway to Gymnasium | N/A | Concrete Block Wall | Non Suspect ACM | 1000 | SF | 0 | SF | | | |
| 1 | 1 | Gymnasium | N/A | Wood Floor | Non Suspect ACM | 7500 | SF | 0 | SF | | | |
| 1 | 1 | Gymnasium | N/A | Metal Deck Ceiling | Non Suspect ACM | 7500 | SF | 0 | SF | | | |
| 1 | 1 | Gymnasium | N/A | Concrete Block Wall | Non Suspect ACM | 6000 | SF | 0 | SF | | | |
| 1 | 1 | Gymnasium | N/A | Fiberglass Pipe Insulation | Non Suspect ACM | 200 | LF | 0 | LF | | | |
| 1 | 1 | Gymnasium | N/A | Fiberglass Pipe Fitting Insulation | Non Suspect ACM | 6 | EA | 0 | EA | | | |
| 1 | 1 | Gymnasium Office | N/A | Floor Tile VAT 12" x 12" | NAD | 400 | SF | 0 | SF | Blue | | |
| 1 | 1 | Gymnasium Office | N/A | Ceiling Tile 2' x 4' | Non Suspect ACM | 400 | SF | 0 | SF | | | |
| 1 | 1 | Gymnasium Office | N/A | Concrete Block Wall | Non Suspect ACM | 700 | SF | 0 | SF | | | |
| 1 | | Gymnasium Office | N/A | Fiberglass Pipe Insulation | Non Suspect ACM | 30 | LF | 0 | LF | | | |
| 1 | | Gymnasium Office | N/A | Fiberglass Pipe Fitting Insulation | Non Suspect ACM | 3 | EA | 0 | EA | | | |
| 1 | | Hallway adjacent Multipurpose Room 107 | N/A | Floor Tile VAT 12" x 12" | NAD | 600 | SF | 0 | SF | Multi | | |
| 1 | 1 | Hallway adjacent Multipurpose Room 107 | N/A | Ceiling Tile 2' x 4' | Non Suspect ACM | 600 | SF | 0 | SF | | | |
| 1 | 1 | Hallway adjacent Multipurpose Room 107 | N/A N/A | Concrete Block Wall Floor Tile VAT 12" x 12" | Non Suspect ACM | 1500 | SF SF | 0 | SF SF | N.4. 14 | | |
| 1 | 1 | Hallway from Classrooms 101 to 110 Hallway from Classrooms 101 to 110 | N/A N/A | Ceiling Tile 2' x 4' | NAD Non Suspect ACM | 1120 1120 | SF | 0 | SF | Multi | | |
| 1 | 1 | Hallway from Classrooms 101 to 110 Hallway from Classrooms 101 to 110 | N/A N/A | Concrete Block Wall | Non Suspect ACM | 3000 | SF | 0 | SF | | | |
| 1 | | Throughout | N/A N/A | Fire Doors | NAD | 1 | EA | 0 | - 5F | | Sampled NAD February 2016 Manufacture: Warnock Hersey Oshkosh Architectural Door Company, Oshkosh WI, 54903 Serial #063976 | |
| 1 | | Attic - None | X | X | X | x | X | X | x | | None | None |
| 1 | | Crawl Space - None | X | X | X | x | X | X | X | | None | None |

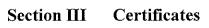

1200

A. Management Planner/Building Inspector Certificates

j. L

۱

Ap.

Management Planner/Building Inspector Certificates

These charts indicate the Name, Course Date, Expiration Date and Corresponding Certificate Number of the Management Planner and Building Inspector of individuals that participated in the AHERA 3 Year Inspection and Management Plan process of 2015/2016.


| Management Planner | Date Granted | Expiration Date | Certificate Number |
|--------------------|--------------|-----------------|--------------------|
| Monique Causley | 2/15/2015 | 2/16/2016 | ACC-0215-8-010 |
| Monique Causley | 2/16/2016 | 2/17/2017 | ACC-0216-8-001 |
| Megan Vala | 5/22/2015 | 6/22/2016 | 740728 |
| Mary Anne Lerro | 4/5/2016 | 4/5/2017 | 742327 |

| Building Inspector | Date Granted | Expiration Date | Certificate Number |
|--------------------|--------------|-----------------|--------------------|
| Scott Magee | 8/15/2015 | 8/15/2016 | 70016699C |
| William Garrity | 8/15/2015 | 8/15/2016 | 70016699A |
| Bernard Brunner | 10/2/2015 | 8/2/2016 | 45397 |
| Mary Anne Lerro | 3/3/2015 | 3/3/2016 | 740092 |
| Mary Anne Lerro | 4/5/2016 | 4/5/2017 | 742322 |
| James Madden | 12/11/2014 | 12/11/2015 | ACC-1214-6-010 |
| James Madden | 12/3/2015 | 12/3/2016 | ACC-1215-6-018 |
| Troy Ray | 3/15/2015 | 3/19/2016 | ACC-0355-6-011 |
| Ananth Vinjamuri | 9/29/2015 | 9/29/2016 | 374 |
| Shelton Williams | 9/29/2015 | 9/29/2016 | 375 |
| Paul Davis | 2/12/2015 | 2/12/2016 | ACC-0215-6-015 |
| Paul Davis | 2/2/2016 | 2/2/2017 | 741836 |
| Bernard Bryson | 2/16/2015 | 2/16/2016 | ACC-0125-6-031 |
| Bernard Bryson | 2/15/2016 | 2/15/2017 | ACC-0216-6-005 |
| Alexander Roman | 9/18/2015 | 9/18/2015 | EHSBIR-150619-008 |
| Norm Harrison | 9/2/2015 | 9/2/2016 | ACC-0915-6-011 |
| Kelly Mayberry | 2/20/2015 | 2/20/2016 | EHSBIR-150220-005 |
| Kelly Mayberry | 2/18/2016 | 2/18/2017 | EHSBIR-160218-006 |
| Andrew Hine | 5/6/2015 | 5/6/2016 | AI05042015-3 |
| Maryellen Leotta | 2/12/2015 | 2/12/2016 | ACC-0215-6-024 |

| Mark K. Schläger Training Director | 2/16/15 N/A 2/16/16 Course Date Exam Date Expiration Date | presented by ACCESS TRAINING SERVICES, INC. 7921 River Road, Pennsauken, NJ 08110 (856) 665-3449 | Pennsylvania Asbestos Management Planner Refresher Course | awarded to Monique Causley for successfully completing the prescribed course of study in | Certificate of Completion | |
|---------------------------------------|---|---|--|--|---------------------------|--|
| | / | | F. Contante | | A LEAN A | |

| Not Provided ACC-0216-8-001 Social Security Number Certificate Number | 2/15/16 N/A Course Date Exam Date | presented by ACCESS TRAINING SERVICES, INC 7921 River Road, Pennsauken, NJ 08110 (856) 665-3449 | under TSCA Title II | Pennsylvania Asbestos Managem | for successfully completing the prescribed course of study | awarded to | Certificate of Comp | |
|---|--------------------------------------|--|---------------------|-------------------------------|--|------------|---------------------|--|
| Mark K. Schläger Training Director | 2/15/17 Expiration Date | n, NJ 08110 | | nagement Planner | SICY ourse of study in | | mpletion | |



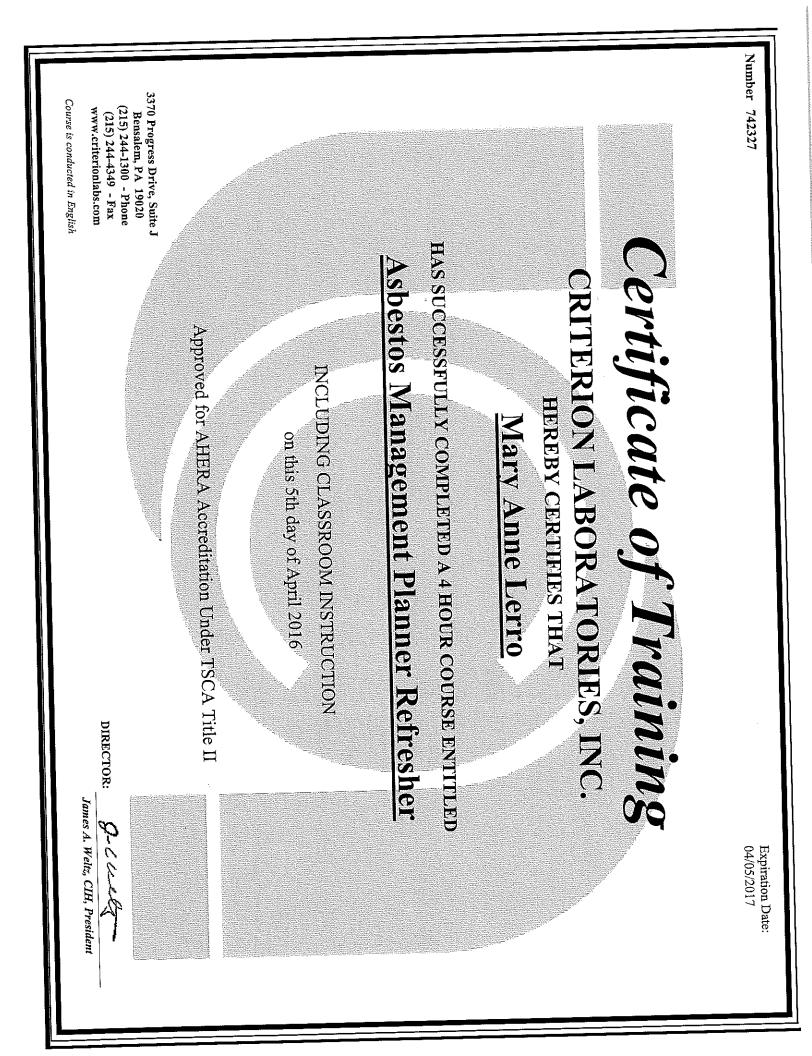

EMSL ANALYTICAL, INC. Certifies that

Scott Magee

has successfully completed the course of study for the

Asbestos Building Inspector Refresher Course

for Accreditation under TSCA Title II

EMSL Certificate No. 70016699C

Accreditation # 137 PA Dept. of Labor and Industry Approved by:

Sponsored by:

Fax: (856) 786-5973 www.emsl.com EMSL Analytical, Inc. 200 Route 130 North Phone: (800) 220-3675 Cinnaminson, NJ 08077



Course Date: 8/15/2015 Expiration Date: 8/15/2016 Granted: 8/15/2015

millem

Training Director Michael P. Menz, CIH

Environmental, Mold, Bacteria, IAQ, Asbestos, Lead, Forensic and Materials Testing Since 1981

EMSL ANALYTICAL, INC. Certifies that

William Garrity

has successfully completed the course of study for the

Asbestos Building Inspector Refresher Course

for Accreditation under TSCA Title $\boldsymbol{\Pi}$

EMSL Certificate No. 70016699A

Approved by: Accreditation #137 PA Dept. of Labor and Industry

Sponsored by:

Cinnaminson, NJ 08077 200 Route 130 North EMSL Analytical, Inc. Fax: (856) 786-5973 Phone: (800) 220-3675 www.emsl.com



Course Date: 8/15/2015 Expiration Date: 8/15/2016 Granted: 8/15/2015

Mull C.M.

Michael P. Menz, CIH **Training Director**

Environmental, Mold, Bacteria, IAQ, Asbestos, Lead, Forensic and Materials Testing Since 1981

45397

National Asbestos & Environmental Training Institute

CERTIFICATE OF COMPLETION

AHERA/EPA Accredited Per 40 CFR Part 763 Asbestos Accreditation under TSCA Title II

This is to certify that •

Bernard Brunner, Jr.

Successfully completed the course entitled

1/2-Day New York State/EPA/AHERA Asbestos Building Inspector Annual Refresher on October 2, 2015

Examination Passed October 2, 2015

Expiration Date on October 2, 2016

President, NAET

Per 10 NYCRR Part 73.2 (L) (1), DOH 2832 Certificate of Completion of Asbestos Safety Training is the only official record of training for N.Y.S. students.

Language: English


ABIH 1/2 CM POINT


Fax (732) 531-5956

www.naeti.com

Phone (732) 531-5571

3321 Doris Avenue, Building B, Ocean, NJ 07712

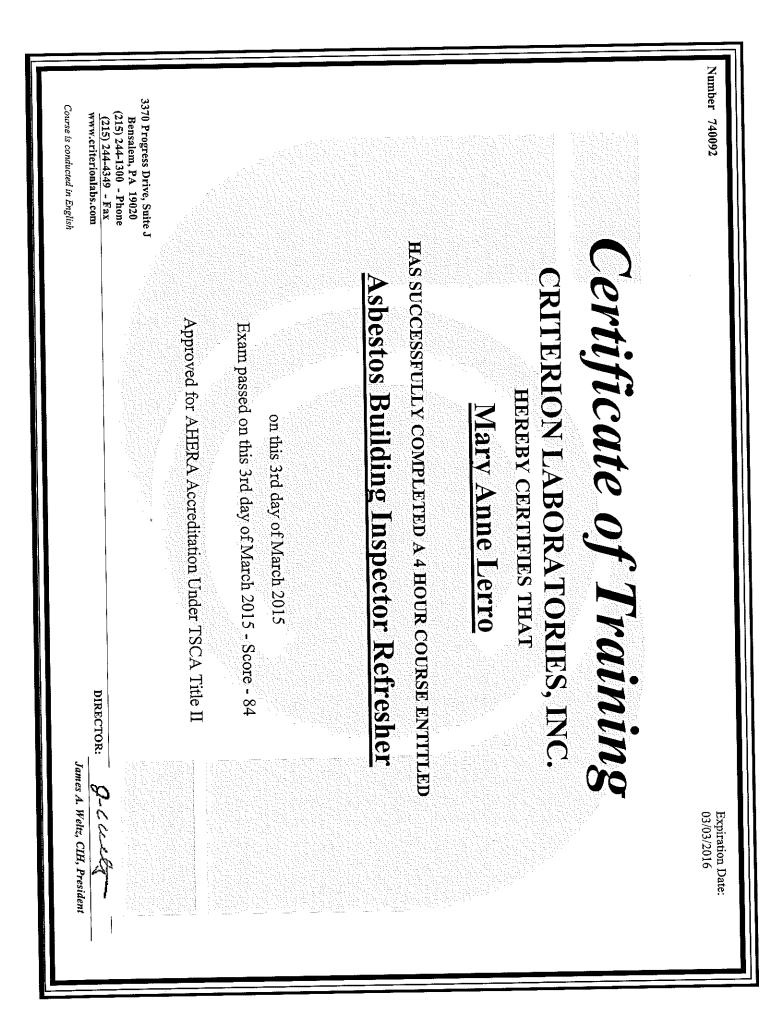

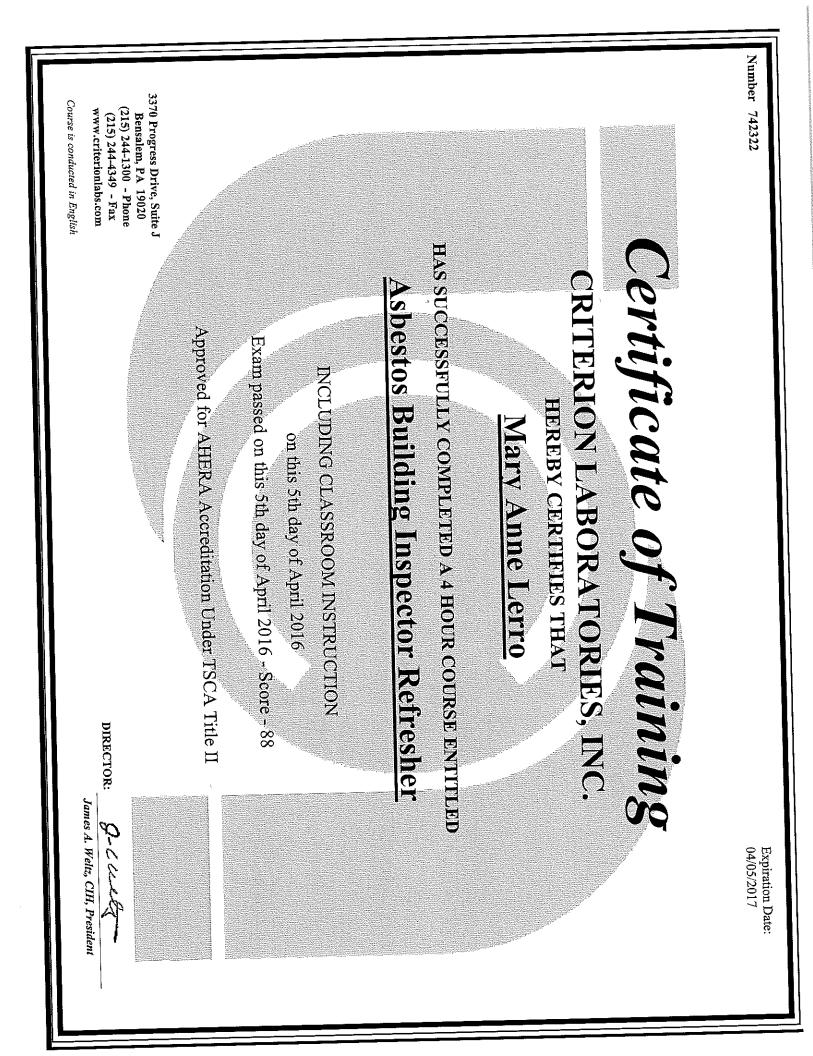

| | | X | | | <u>Au</u> | | | | | | |
|---------------------------------------|----------------|-----------------|----------|---|--|------------------------------|---|---------------------|--------------------|------------|--|
| Social Security Number | Not Provided | Course Date | 12/11/14 | | Buildi | | | | Cert | | |
| Certificate Number | ACC-1214-6-010 | Exam Date | N/A | presented by ACCESS TRAINING SERVICES, INC. 7921 River Road, Pennsauken, NJ 08110 (856) 665-3449 | Building Inspector Refreshe under TSCA Title II | Pennsylvania Asbestos | for successfully completing the prescribed course of study in | James Madden | Certificate of Com | | |
| Mark K. Schläger Training Director | Mar X. S. M. | Expiration Date | 12/11/15 | , RVICES, INC. ^{1ken,} NJ 08110 | efresher Course | Asbestos | ibed course of study in | dden | ompletion | | |
| | , | | | | | | | | | Y Wester . | |

CAMPO AND CANAGO AND CAMPO AND CAMPO AND CAMPO

Social Security Number Not Provided Course Date でしたいというというという 12/3/15 Certificate of Completion **Building Inspector Refresher Course** for successfully completing the prescribed course of study in **Pennsylvania** Asbestos presented by ACCESS TRAINING SERVICES, INC. NOV NOV NOV **James Madden** 7921 River Road, Pennsauken, NJ 08110 Certificate Number ACC-1215-6-018 under TSCA Title II Exam Date NOT NOT ACTIVE SAME AND ACTIVES NIA (856) 665-3449 Mark K. Schläge **Training Director** 12/3/16 Expiration Date h l the No.

| Not Provided Social Security Number | Course Date | 3/19/15 | | Bui | | | Ce | |
|--|-----------------|---------|---|-----------------------------|----------------------|---|--------------------|--|
| uber | | | ACC 792 | Building Inspector Refreshe | Penn | for successfull | Certificate of Com | |
| ACC-0355-6-011 Certificate Number | Exam Date | N/A | presented by ACCESS TRAINING SERVICES, IN 7921 River Road, Pennsauken, NJ 08110 (856) 665-3449 | spector Ref | Pennsvlvania Asbesto | for successfully completing the prescribed course of study in | te of | |
| er | | | ed by 1 SERVICES, IN 1 sauken, NJ 08110 1-3449 | Refresh(Title II | a Asbest | Ray escribed course of s | Comp | |
| Mark K. Schläger Training Director | Expiration Date | 3/19/16 | ů. | er Course | OS S | rudy in | letion | |
| er or | e AM | | | ě | | | D | |
| | 9 .00 | | | Y | | | | |

.

G&C Environmental Services, Inc. (#294) 2 Street Road, Newtown Square, Pennsylvania 19073 Telephone: (610) 993-9202 Facsimile: (610) 993-9232 Email: Training@gcenviro.com www.GCenviro.com

This document certifies that Ananth K. Vinjamuri has successfully completed this

State of New York Department of Health Approved AHERA BUILDING INSPECTOR

REFRESHER COURSE, completed as required for asbestos accreditation under the Toxic

Substances Control Act, Title II. This course was held from $\frac{09/29/2015}{MM DD}$ to $\frac{09/29/2015}{MM DD}$ VR successful completion of the examination ____ The examination date was $\frac{09/29/2015}{MM$ DD YR. This certificate expires one year from the date of 09/29/2016.

The official record of successful training completion is the New York State Department of Health certificate of asbestos safety training completion (DPH 2832).

<u>Gail M. Conner</u> Training Director

Gail M. Corner

CERTIFICATE NO 375

G&C Environmental Services, Inc. (#294) 2 Street Road, Newtown Square, Pennsylvania 19073 Telephone: (610) 993-9202 Facsimile: (610) 993-9232 Email: Training@gcenviro.com www.GCenviro.com

This document certifies that _ Shelton Williams <u>has successfully completed this</u>

State of New York Department of Health Approved AHERA BUILDING INSPECTOR

<u>REFRESHER COURSE</u>, completed as required for asbestos accreditation under the Toxic

Substances Control Act, Title II. This course was held from $\frac{09/29/2015}{MM}$ to $\frac{09/29/2015}{MM}$ to $\frac{09/29/2015}{MM}$ The examination date was $\frac{09/29/2015}{MM$ DD YR. This certificate expires one year from the date of

successful completion of the examination $\frac{09/29/2016}{MM DD YR}$


Health certificate of asbestos safety training completion (DPH 2832). The official record of successful training completion is the New York State Department of

<u>Gail M. Conner</u> Training Director

Hail M. Conner

| Social Security Number | Not Provided | Course Date | | e Buildin | for | Certif | |
|---|----------------|----------------------------|--|---|---|--------------------|------------------|
| Social Security Number Certificate Number | ACC-0215-6-015 | N/A Exam Date | presented by ACCESS TRAINING SERVICES, INC 7921 River Road, Pennsauken, NJ 08110 (856) 665-3449 | Pennsylvania Asbestos Building Inspector Refresher | Paul M. Davis for successfully completing the prescribed course of study in | Certificate of Com | |
| Mark K. Schläger Training Director | Mark & VM | 2/12/16 Expiration Date | CES, INC. NJ 08110 | bestos esher Course | IS <i>Jurse of study in</i> | mpletion | O TO TO TO TO TO |

A ROMONONONONONO

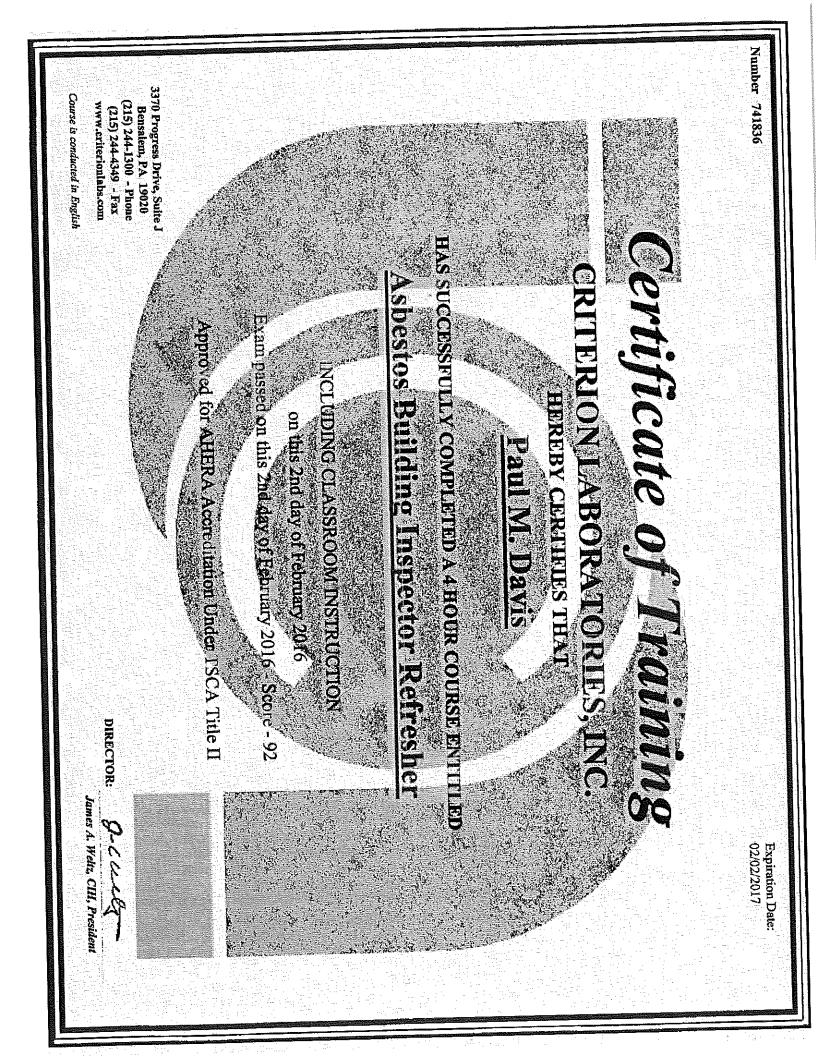

| Soc | | NALC | | | | |
|--|----------------------------|---|---|--|--------------------|--|
| Not Provided Social Security Number | 2/16/15 Course Date | | | 2 | Certi | |
| ACC-0125-6-031 Certificate Number | N/A Exam Date | presented by ACCESS TRAINING SERVICES, INC. 7921 River Road, Pennsauken, NJ 08110 (856) 665-3449 | Pennsylvania Asbesto Building Inspector Refreshe | Bernard J. Bryson for successfully completing the prescribed course of study in | Certificate of Con | |
| Mark K. Schläger Training Director | 2/16/16 Expiration Date | UES, INC. 17 08110 | estos esher Course | SON trse of study in | npletion | |
| <u> </u> | <u> </u> | | | <u>ROMON</u> | | |

Certificate of Completion

2

Bernard J. Bryson

for successfully completing the prescribed course of study in

Building Inspector Refresher Course Pennsylvania Asbestos

under TSCA Title II

ACCESS TRAINING SERVICES, INC. 7921 River Road, Pennsauken, NJ 08110 (856) 665-3449 presented by

Course Date

Social Security Number

Not Provided

Expiration Date 2/15/17

ACC-0216-6-005 Certificate Number


Mark K. Schläger **Training Director**

MY & W

Exam Date

N/A

2/15/16

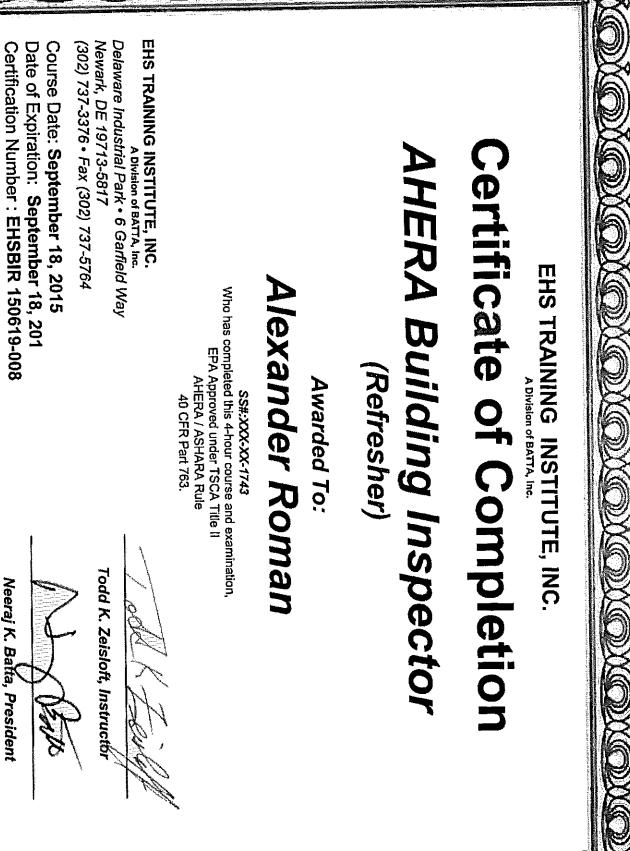

Neeraj K. Bafta, President

Æ

| | 9/2/15 N/A 9/2/16 Course Date Exam Date Expiration Date | presented by ACCESS TRAINING SERVICES, INC. 7921 River Road, Pennsauken, NJ 08109 (856) 665-3449 | Pennsylvania Asbestos Building Inspector Refresher Course | Norman Harrison for successfully completing the prescribed course of study in | Certificate of Completion | |
|--|--|---|--|--|---------------------------|--|
| | | | | | | |

EHS TRAINING INSTITUTE, INC A Division of BATTA, Inc

Certificate of Completion

AHERA Building Inspector (Refresher)

Awarded To:

Kelly Mayberry

Who has completed this 4-hour course and examination, EPA Approved under TSCA Title II AHERA / ASHARA Rule SS#:XXX-XX-1551 40 CFR Part 763

(302) 737-3376 · Fax (302) 737-5764 Newark, DE 19713-5817 Delaware Industrial Park • 6 Garfield Way A Division of BATTA, Inc.


EHS TRAINING INSTITUTE, INC.

Course Date: February 20, 2015 Certification Number : EHSBIR 150220-005 Date of Expiration: February 20, 2016

Todd K. Zeisloft, Instruct6

Neeraj K. Batta, President

| A CARANCIA CONTRACTOR | EHS TRAINING INSTITUTE, INC. A Division of BATTA, Inc. A Division of BATTA, Inc. Delaware Industrial Park • 6 Garfield Way Newark, DE 19713-5817 (302) 737-3376 • Fax (302) 737-5764 Course Date: February 18, 2016 Date of Expiration: February 18, 2017 Certification Number : EHSBIR 160218-006 Neeraj K. Bafta, President | Awarded To: Kelly Mayberry start Start Start Start Start Start Start Start Start Start Start Start Start Start Start Start Start | EHS TRAINING INSTITUTE, INC. <i>Autor of Completion AHERA Building Inspector</i> (Refresher) | A TO |
|-----------------------|---|--|--|--|
| MOIO | fent 8 G | | MONTONIO | |

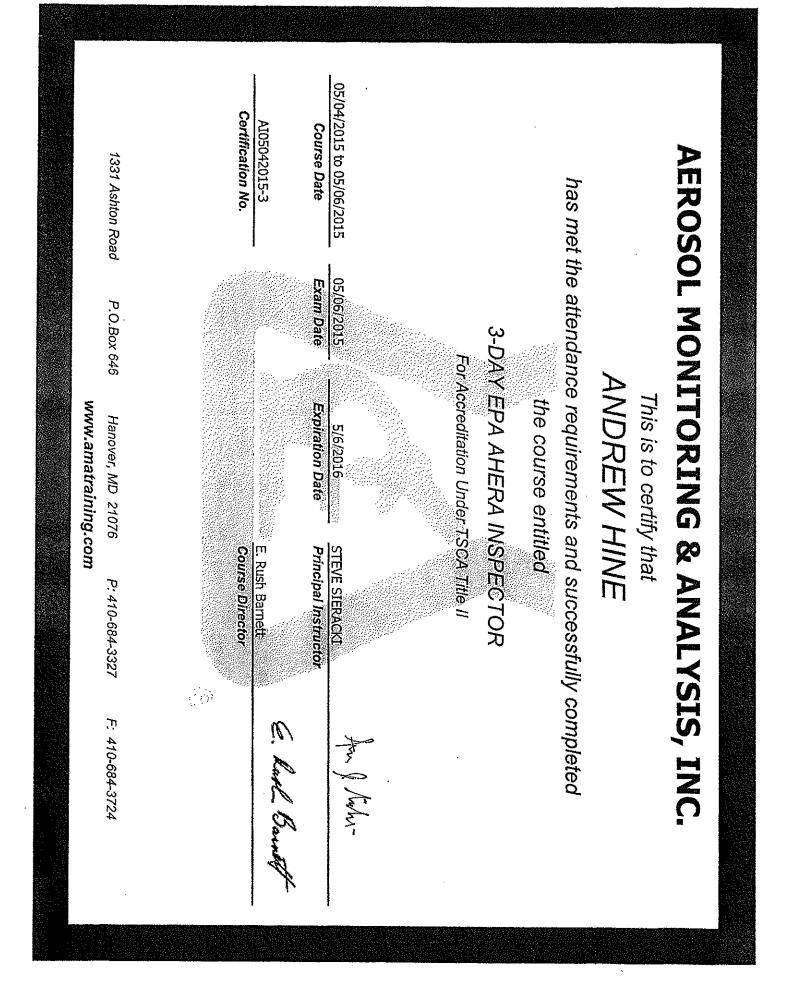

| Not Provided Social Security Number | 2/12/15 Course Date | | Buildin | for | Certif | |
|---------------------------------------|----------------------------|---|---|---|---------------------|--|
| ACC-0215-6-024 Certificate Number | N/A Exam Date | presented by ACCESS TRAINING SERVICES, IN 7921 River Road, Pennsauken, NJ 08110 (856) 665-3449 | Pennsylvania Asbesto Building Inspector Refreshe | Maryellen Leotta for successfully completing the prescribed course of study in | Certificate of Comp | |
| Mark K. Schläger Training Director | 2/12/16 Expiration Date | 08110 | estos sher Course | ta se of study in | npletion | |

Asbestos Hazard Emergency Response Act (AHERA) Environmental Compliance Audit Cross Reference Table

In response to the AHERA Environmental Compliance Audit a Cross Reference Table has been prepared for inclusion into the Environmental Management Plan. The purpose of this Cross Reference Table is to link the following documents to the AHERA Management Plan.

| | Cross Reference Table | | | | | |
|--|---|--|--|--|--|--|
| 3 Year Reinspection | 3 Year Reinspection Report follows this Cross Reference Table documentation. | | | | | |
| Subject Matter | Location of Required Documents | | | | | |
| Designated Person | Pages 1 - 3 | | | | | |
| Annual Notification | Pages 4 - 5 | | | | | |
| 6 Month Periodic Surveillance Outline of Events | Page 6 | | | | | |
| 3 Year Re-inspections Outline of Events | Page 7 | | | | | |
| Asbestos Management Program (operations and maintenance) | Pages 8 - 19 | | | | | |
| Asbestos Investigation Report (AIR) | Attachment 1 Letter Dated August 4, 2006 | | | | | |
| Training (included in the Asbestos Management Program) | The original records are centralized at the School District's Environmental Library. Copies are maintained on staff and are required to be maintained in the latest Reinspection Report. 2 hour awareness training records for all Building Engineers, Custodian Assistants and maintenance personnel 40 hour worker/supervisor training records for the OEMS A-Team and various AST tradesmen. | | | | | |
| Response Actions (monthly mailings if applicable) | The original documents are on file at the School District's Environmenta Library. Copies of the original are mailed to the Schools Main Office for retention with the Management Plan documentation. These documents are typically kept separate from the management plan in an update binder due to the potential volume of response action reports. | | | | | |

SCHOOL DISTRICT OF PHILADELPHIA

ASBESTOS DESIGNATED PERSON

Gerald F Junod Office of Capital Programs Environmental Management & Services 440 N Broad Street, 3rd Floor Philadelphia, PA 19130 Telephone: 215 400 6738 Fax: 215 400 4751

Drexel University- Asbestos Building Inspector CourseJanuary9-11, 1989 24 HoursDrexel University- Asbestos Management Planner CourseJanuary12-13, 1989 16 HoursCriterion Laboratories, Inc. - Asbestos Management Planner CourseOctober 11-12, 2012 16 Hours

Annual Building Inspector Refreshers1990 to Present4 HoursDrexel UniversityCriterion Laboratories, IncAccess Training Services, Inc.Annual Building Management Planner Refreshers4 HoursDrexel UniversityCriterion Laboratories, Inc2013 to Present4 Hours2013 to Present

Environmental Manager, School District of Philadelphia

Manages the design and implementation of asbestos and lead projects for the Capital Improvement Program and other District Departments including Facilities & Operations and Information Technology. Ensures that asbestos abatement and lead remediation projects are expertly designed and executed in accordance with industry best management practice standards and regulations.

Manager, City of Philadelphia Asbestos Control Program

Served as the Asbestos Control Program Manager for the City of Philadelphia, Department of Public Health, Air Management Services, Asbestos Control Unit from August 1, 2003 through October 23, 2006.

Mid Atlantic Regional Environmental Consortium (MAREC)

Former member with attendance and participation commitments of all quarterly EPA Region III and yearly National Asbestos Regulatory Conferences sponsored by the EPA and the National Conference of State Legislators respectively as a representative for the City of Philadelphia Department of Public Health Air Management Services from 1994 through 2006.

Philadelphia Environmental Task Force

Former member of the Philadelphia Environmental Task force as a representative and point of contact for the City of Philadelphia Department of Public Health Air Management Services Asbestos Control Unit from 2002 through 2006.

Asbestos Instructor

Worked as the primary instructor for the initial and annual Asbestos Project Inspector training and licensing program as mandated by City of Philadelphia Department of Pubic Health Asbestos Control Regulations from August 1994 through October 2006.

Worked as a lead instructor with an Environmental Consulting Firm and approved by the US EPA for the initial and annual refresher training courses for various asbestos occupational disciplines such as the Building Inspector, Management Planner and Worker/Supervisor from 1991 through 1994.

I certify that the general, local agency responsibilities as stipulated in Section 763.84 will be met.

Gerald F. Junod

Asbestos Designated Person Environmental Manager Office of Environmental Management and Services

SCHOOL DISTRICT OF PHILADELPHIA

Accreditation Information Statement

All persons who inspect for Asbestos Containing Building Materials (ACBM) and who will design or carry our response actions with respect to assumed and confirmed ACBM, will be accredited by an EPA approved course and/or a State Contractors AccreditationProgram under Sections 206 (c) and 206 (b) of Title II of the ACT.

1 0 Gerald F. Junod

Gerald F. Junod Asbestos Designated Person Environmental Manager Office of Environmental Management and Services

SCHOOL DISTRICT OF PHILADELPHIA OFFICE OF CAPITAL PROGRAMS 440 NORTH BROAD STREET, SUITE 373 PHILADELPHIA, PENNSYLVANIA 19130

OFFICE OF ENVIRONMENTAL MANAGEMENT AND SERVICES

PHONE (215)-400-4750

September 2015

- TO: Principals Building Administrators/Occupants Parents/Guardians
- FROM: Fran Burns Chief Operating Officer

Francine Locke, M.S., Director Office of Environmental Management and Services

SUBJECT: Annual EPA Notification Letter

Pursuant to the Federal Environmental Protection Agency (EPA) mandate, as required by 40 C.F.R. 763.84 (c)(d) of public access to environmental records, this letter is to acknowledge the availability of your facility's Asbestos Hazard Emergency Response Act (AHERA) Management Plan.

Each member of the school staff, parents/guardians, temporary workers and/or contractors, are required to receive a copy of the Notification Letter. At the direction of the Principal, a copy is to be posted on the bulletin boards and an appropriate amount of copies are to be generated for distribution.

<u>Note:</u> The AHERA Three-Year Reinspection reports, in colored binders; White with Pink, Tan, Black, Red, Dark Blue, Green, Yellow and White, are Federal EPA mandated inspection documents. The School District of Philadelphia is subject to severe monetary penalties if the reports and associated paperwork are not <u>available to the EPA and the public</u> upon request.

It is incumbent on designated school personnel to gather and retain this data as it is delivered, in one location for future review. Acceptable locations include the Principal's Office or Main Office for the primary data. The Building Engineer should maintain any secondary or duplicate copies.

If you have any questions, please call 215-400-4750. Thank you for your cooperation.

Fran Burns Chief Operating Officer

c: Danielle Floyd

AHERA-4 8/21/15

Francine Locke, M.S., Director Office of Environmental Management and Services



School District of Philadelphia OFFICIAL NOTICE

PLEASE POST

September 2015

- TO: Principals Building Administrators Building Engineers Building Occupants Parents/Guardians
- FROM: Fran Burns Chief Operating Officer

Francine Locke, M.S., Director Office of Environmental Management and Services

SUBJECT: <u>Annual Notification Letter</u>: Asbestos Hazard Emergency Response Act

The Federal Register published on October 30, 1987, Subpart E, in Schools: Final Rule and Notice, 763.84 (c)(d) states that each local education agency shall ensure that workers and building occupants or guardians are to be informed at least once each school year about inspections, response actions and post-response action activities including re-inspections and periodic surveillance activities. The School District as the Local Education Agency (LEA), retains such reports that are available for public inspection in the Office of the Principal or Building Administrator.

The Principal or Building Administrator is required to do the following with this notification:

- 1) Post in a Public Place or Main Office
- 2) Inform Building Occupants
- 3) Send a copy of this notification to Parents or Guardians

Insert a copy into the latest AHERA Three-Year Reinspection report (white/pink binder) 4) in your office or facility.

Fran Burns ' Chief Operating Officer

runcine hock

Francine Locke, M.S., Director Office of Environmental Management and Services

c: Danielle Floyd

AHERA-4a 8/21/15

SCHOOL DISTRICT OF PHILADELPHIA Education Center 440 North Broad Street Philadelphia, Pennsylvania 19130

Office of Environmental Management and Services

215-400-4750

<u>AHERA</u> <u>Six Month Surveillance</u> <u>Outline of Events</u>

- Pursuant to the Federal Environmental Protection Agency (EPA) mandate, as required by 40 CFR 763.92(b), the following procedure is to be implemented. At least once every six (6) months after a Management Plan is in effect, each Local Education Agency (LEA) shall conduct a periodic surveillance in each building that it owns or leases that contains Asbestos Containing Building Materials (ACBM) or is assumed to contain ACBM.
- The first Bi-Annual Inspection starts in the Spring (March, April, May) and again in the Fall (October, November, December) of each year. The Building Engineer/Assistant should assist the Building Inspector with appropriate access to all areas including (Crawlspaces/Attics) and rooms in the facility. There is no action required of the Principal.
- The Building Inspector shall visually inspect all areas that are identified in the Management Plan as ACBM or assumed ACBM. The date of the surveillance is recorded, the inspectors name and any changes in the conditions of the materials.
- The Building Inspector shall make a copy of the inspection document and insert into the front of the latest Management Plan (AHERA Three Year Reinspection report). The original document is returned to the LEA's Environmental Library and filed.

SCHOOL DISTRICT OF PHILADELPHIA Education Center 440 North Broad Street Philadelphia, Pennsylvania 19130

Office of Environmental Management and Services

215-400-4750

<u>AHERA</u> <u>Three Year Reinspection</u> <u>Outline of Events</u>

- Pursuant to the Federal Environmental Protection Agency (EPA) mandate, as required by 40 CFR 763.85(b) the following procedure is to be implemented. At least once every three (3) years after a Management Plan is in effect, each Local Education Agency (LEA) shall conduct a reinspection of each building that it owns or leases that contains Asbestos Containing Building Material's (ACBM's) or is assumed to contain ACBM.
- Subsequent Three Year Re-inspections (2009, 2012, 2015, etc) shall start in the Fall (October, November, December, January). The Building Engineer/Assistant should assist the Building Inspector with appropriate access to all areas including (Crawlspaces/Attics) and rooms in the facility. There is no action required of the Principal.
- An accredited Building Inspector shall visually inspect and touch to determine friability, all areas that are identified in the Management Plan as ACBM or assumed ACBM. The date of the surveillance is recorded, the inspectors name and any changes in the conditions of the materials. The Building Inspectors state of accreditation and license number is required.
- After the inspection, the Building Inspector shall make a copy of the inspection documents and insert into the front of the latest Management Plan (AHERA Three Year Reinspection report). The original document is returned to the LEA's Environmental Library and filed.
- The Building Inspector shall return the reinspection data to the Management Planner to be assessed and determine appropriate response actions and a report issued (AHERA Three Year Reinspection report). One copy of the report is delivered to the schools Principal to be permanently retained with all previous environmental data. Another copy is retained in the LEA's Environmental Library.



2

School District of Philadelphia Office of Environmental Management & Services 440 North Broad Street Philadelphia, PA 19130 (215) 400-4750

School District of Philadelphia Asbestos Management Program

TABLE OF CONTENTS

| 1. Introduction | De | finitionsPage 9 |
|--|----|---|
| 3. Asbestos Management Plan Execution | 1. | IntroductionPage 10 |
| a. Asbestos Management Plan Execution 5. Responsibilities a. OEMS b. Asbestos Worker/Supervisor "A-TEAM"Page 12 c. Asbestos Designated Person d. Supervisor or Project Manager (Capital, Maintenance & Facilities) e. Employee CapitalPage 13 f. Employee Maintenance g. Employee Facilities and Custodial 6. RequirementsPage 14 a. Employee Exposure Monitoring b. Employee Notification c. Observation of Monitoring d. Training Program e. Access of Information f. Record Kceping 7. AHERA O&M Plan | | Asbestos Management Plan ExecutionPage 11 |
| a. OEMS b. Asbestos Worker/Supervisor "A-TEAM"Page 12 c. Asbestos Designated Person d. Supervisor or Project Manager (Capital, Maintenance & Facilities) e. Employee CapitalPage 13 f. Employee Maintenance g. Employee Maintenance g. Employee Facilities and Custodial 6. RequirementsPage 14 a. Employee Notification c. Observation of Monitoring d. Training Program e. Access of Information f. Record Keeping 7. AHERA O&M PlanPage 15 a. Controls 8. O&M Response ActionsPage 16 a. Facility Maintenance of ACM/PACM d. Planned Disturbance of ACM/PACM d. Planned Disturbance of ACM/PACM e. Miscellaneous ACM/PACMPage 17 f. Vinyl Asbestos Floor Tile g. Mastic/Adhesives h. Woven Vibration Dampers i. Other Work Practices j. Fiber Release Episodes | 4. | |
| a. Employee Exposure Monitoring b. Employee Notification c. Observation of Monitoring d. Training Program e. Access of Information f. Record Keeping 7. AHERA O&M Plan | 5. | a. OEMS b. Asbestos Worker/Supervisor "A-TEAM"Page 12 c. Asbestos Designated Person d. Supervisor or Project Manager (Capital, Maintenance & Facilities) e. Employee CapitalPage 13 f. Employee Maintenance |
| a. Controls 8. O&M Response ActionsPage 16 a. Facility Maintenance Isolation of Area b. Unlikely Contact with ACM/PACM c. Accidental Disturbance of ACM/PACM d. Planned Disturbance of ACM/PACM e. Miscellaneous ACM/PACMPage 17 f. Vinyl Asbestos Floor Tile g. Mastic/Adhesives h. Woven Vibration Dampers i. Other Work Practices j. Fiber Release Episodes | 6. | a. Employee Exposure Monitoring b. Employee Notification c. Observation of Monitoring d. Training Program e. Access of Information |
| a. Facility Maintenance Isolation of Area b. Unlikely Contact with ACM/PACM c. Accidental Disturbance of ACM/PACM d. Planned Disturbance of ACM/PACM e. Miscellaneous ACM/PACMPage 17 f. Vinyl Asbestos Floor Tile g. Mastic/Adhesives h. Woven Vibration Dampers i. Other Work Practices j. Fiber Release Episodes | 7. | |
| 7. References and Resources | 8. | a. Facility Maintenance Isolation of Area b. Unlikely Contact with ACM/PACM c. Accidental Disturbance of ACM/PACM d. Planned Disturbance of ACM/PACM e. Miscellaneous ACM/PACMPage 17 f. Vinyl Asbestos Floor Tile g. Mastic/Adhesives h. Woven Vibration Dampers i. Other Work Practices |

DEFINITIONS / ACRONYMS

.

| ACM/PACM: | Asbestos Containing Material/Potential Asbestos Containing Material |
|------------------------------|---|
| AHERA: | Asbestos Hazard Emergency Response Act |
| AIR FORM: | Asbestos Inspection Report Form |
| Amended Water: | Water to which a surfactant (soap) has been added |
| AMP: | Asbestos Management Program/Asbestos Management Plan |
| Asbestos Designate Person | : Individual assigned by the district to oversee asbestos related issues. |
| Asbestos Regulated Area: | Location that is posted as an asbestos work area in which only approved and accredited personnel are permitted to enter |
| AST: | Asbestos Support Team involving approved and accredited school district tradespersons personnel that are school district person |
| A-TEAM: | School District of Philadelphia asbestos workers |
| CIP: | Capital Improvement Program |
| Consultant: | Asbestos consulting firm hired by the District |
| Demolition Directive: | Memorandum – August 4, 2006 from Patrick Henwood |
| EPA: | Environmental Protection Agency |
| In House Personnel: | School District of Philadelphia asbestos workers |
| LEA: | Local Education Agency |
| O&M: | Operations and Maintenance |
| OEMS: | Office of Environmental Management and Services |
| OSHA: | Occupational Safety and Health Administration |
| PEL: | Permissible Exposure Limit |
| PSD or SDP: | Philadelphia School District/School District of Philadelphia |
| PSIT: | Philadelphia School Improvement Team |
| STEL: | Short Term Exposure Limit 11 |

1. Introduction

The School District of Philadelphia, Asbestos Policy Statement:

"The School District of Philadelphia is dedicated to providing a safe and healthful work environment for its employees, students, faculty, contractors and visitors. In recognition of the potential health problems associated with asbestos, the School District of Philadelphia is committed to a comprehensive asbestos control program. This program is implemented and maintained through the School District of Philadelphia's Office of Environmental Management and Services (OEMS)."

OEMS has the responsibility of establishing procedures for asbestos abatement, asbestos inspection, air monitoring, renovation and demolition activities within all School District of Philadelphia owned or leased facilities.

These procedures are developed to ensure that:

- (1) People are not exposed to significant levels of asbestos fibers
- (2) Asbestos waste is handled and disposed of properly
- (3) Members of the School District of Philadelphia community have access to the Office of Environmental Management and Services for information, assistance, guidance, and interpretation regarding asbestos related matters.
- (4) Members of the School District of Philadelphia community have access to the Asbestos Management Plans as required and outlined in the US EPA AHERA regulations including annual written notification to all parents.
- (5) Compliance with all applicable Federal, State and Local Asbestos Regulations

Requirements outlined in this manual are mandatory in nature where the word "SHALL" is used and are advisory in nature where the word "SHOULD" is used.

2. Summary of Asbestos Management Program

The School District of Philadelphia's Asbestos Management Program was established to meet the requirements of Federal, State, and Local Regulations.

These regulations include, but are not limited to:

- US Environmental Protection Agency Asbestos Hazard Emergency Response Act (US EPA AHERA) and National Emissions Standard for Hazardous Air Pollutants subpart M, Part 61 (NESHAP);
- US Department of Labor, Occupational Safety and Health Administration (OSHA) General Industry Standard (29 CFR 1910.1001) and the OSHA Asbestos Standard for the Construction Industry (29 CFR 1926.1101);
- The Commonwealth of Pennsylvania, Department of Labor and Industry, Asbestos Occupations, Accreditation and Certification Act;
- The City of Philadelphia, Department of Public Health, Asbestos Control Regulations.

3. Asbestos Management Program Execution

a) General Execution

The Office of Environmental Management and Services (OEMS) develops, implements and manages safety and health programs for the School District of Philadelphia faculty, staff and students and assists with ensuring that all contractors comply with Federal, State and Local Environmental Regulations. The OEMS provides the oversight of School District of Philadelphia employees (Asbestos A-Team), environmental consultants, and asbestos abatement contractors for all projects within the School District of Philadelphia concerning Asbestos Containing Materials.

The control of safety and health hazards at the School District of Philadelphia is primarily through the implementation of engineering, work practice and administrative controls. Personal Protective Equipment (PPE) is used to supplement these controls or whenever the controls are not feasible or are in the process of being implemented. PPE is also recommended whenever exposures to chemical, physical or biological agents can be prevented or reduced by its use.

This written program establishes the procedures necessary to:

- 1) meet established standards and federal regulations for occupational exposure to asbestos fibers;
- 2) meet the requirements of the City of Philadelphia Asbestos Control Regulations which encompasses the disturbance and/or abatement of asbestos containing building materials;
- 3) provide the necessary health and safety protection to the School District of Philadelphia staff, faculty, students, contractors and visitors.

This program is strengthened by input and cooperation with the Philadelphia Federation of Teachers (PFT), Health and Welfare Fund.

4. Summary of Program Execution

a) Asbestos Management Program Execution

The Asbestos Management Program is administered by the Office of Environmental Management and Services (OEMS). OEMS provides the following services primarily through professional consultants:

- (1) exposure monitoring services;
- (2) building inspection/surveys (bulk sampling) for the identification of asbestos containing materials;
- (3) asbestos project design services;
- (4) asbestos abatement project and air monitoring services;
- (5) emergency response to fiber release episodes;
- (6) education/information;
- (7) medical monitoring;
- (8) training for School District of Philadelphia personnel

5. Responsibilities

a) Office of Environmental Management and Services

OEMS is responsible for performing the following functions:

- (1) Developing and administering of the Asbestos Management Program.
- (2) Providing asbestos-related services to all School District of Philadelphia departments.
- (3) Conducting required training of the Asbestos Management Program and working jointly with departments to schedule training.
- (4) Identifying and posting areas where labeling/signage are required.
- (5) Medical Monitoring of OEMS "A-TEAM" and other departments "AST" Asbestos Program staff.

- (6) Certification and training as required for OEMS "A-TEAM" and other departments "AST" Asbestos program staff.
- (7) Record keeping as outlined in Section 3.5 and all records as by required by US EPA AHERA regulations.

b) Asbestos Worker/Supervisor - "A-TEAM"

- (1) OEMS shall ensure that all "A-TEAM" workers/supervisors adhere to the following requirements:
 - a) Attend an initial Worker/Supervisor Asbestos Course;
 - b) Maintain the annual re-certification per EPA AHERA requirements and Commonwealth of Pennsylvania Asbestos Occupations, Accreditation and Certifications Act;
 - c) Undergo an annual Asbestos Medical Evaluation;
 - d) Undergo an annual Respirator Medical Clearance;
 - e) Undergo an annual Respirator Fit Testing.

c) Asbestos Designated Person

The Asbestos Designated Person is responsible for:

- (1) Assuring the health and safety of employees, students and visitors in the School District of Philadelphia facilities under his/her control.
- (2) Being kept informed of all areas under his or her jurisdiction where potential asbestos exposures exist and initiating protection programs that adhere to the Asbestos Management Program requirements of this manual.
- (3) Assuring that Asbestos Management Program requirements are adhered to by principal investigators, project managers, supervisors, or division heads, and School District of Philadelphia personnel under their supervision.
- (4) Ensuring that all employees within the Asbestos Management Program comply with (OSHA 1910.1001 (j) (7) (iv)) and the US EPA AHERA regulations by attending the required training.
- (5) Ensure the posting of:
 - a) Warning labels/signage
 - b) Commonwealth of Pennsylvania Asbestos Abatement and Demolition/Renovation Notification form
 - c) Asbestos Inspection Reports (AIR) form (where required)
 - d) Ensuring that Construction Projects follow the Demolition Directive procedures as outlined in the August 4, 2006 letter.

d) Supervisor or Project Manager (Capital, Maintenance and Facilities)

Each person in charge of a project, maintenance/repair, renovation/demolition, or other activity from the Departments of Capital, Maintenance, and/or Facilities, where asbestos containing material may be present is responsible for:

Identifying, with the assistance of OEMS, asbestos containing building materials prior to any disturbance of these materials. Various Federal (EPA and OSHA) and Local (City of Philadelphia Asbestos Control Regulations) require Asbestos Inspections prior to renovation/demolition activities. This shall be accomplished by always following the Asbestos Management Program Procedures as follows:

(1) Ensure that the requirements of the Asbestos Management Program Procedures are followed by all personnel, trades, and contractors who are involved with the project;

- (2) Review of the required Asbestos Inspection Report (AIR) form (Attachment 1) and AHERA Management Plan documents prior to activities that may disturb any Asbestos Containing Materials;
- (3) Perform all project related duties as outlined in the Project Management Responsibilities;
- (4) Keep the department chairperson or director informed on any actions proposed or taken regarding the Asbestos Management Plan;
- (5) Ensuring that Construction Projects follow the Demolition Directive procedure outlined in the August 4, 2006 letter.

e) Employee – Capital

School District of Philadelphia Capital employees and/or consultants shall:

- (1) Ensure that no suspect or asbestos containing building materials are disturbed in the course of the projects they are performing or managing. This shall be accomplished by notifying their supervisor and OEMS by issuance of a work order permit (a.k.a PSIT Service Request Form) and verifying that the materials which may be disturbed are non-asbestos containing. If this information is not available or verification has not been made, these materials should not be disturbed.
- (2) Immediately notify OEMS and their supervisor in the event of a potential fiber release episode upon discovery of visible damage to asbestos containing materials.
- (3) Ensuring that Construction Projects follow the Demolition Directive procedures as outlined in the August 4, 2006 letter.

The types of projects represented as part of the Capital Improvement Program are as follows:

- (1) Complete Renovation of an existing building that addresses all facility component concerns and educational program needs;
- (2) Major Renovation of an existing building addressing significant facility component and educational improvements;
- (3) Addition to an existing building (either as an attachment or stand-alone structure) to accommodate needed program space;
- (4) Conversion of an existing facility to accommodate a change in educational program;
- (5) Facility Component Improvement of specific facility needs (i.e. electrical or HVAC system upgrades, ADA improvements, life safety improvements, exterior renovations, etc.)

f) Employee – Maintenance

School District of Philadelphia Maintenance employees shall:

- (1) Ensure that no suspect or asbestos containing building materials are disturbed in the course of their duties or work they are performing. This shall be accomplished by notifying their supervisor and OEMS by issuance of a work order permit and verifying that the materials which may be disturbed are non-asbestos containing. If this information is not available or verification has not been made, these materials should not be disturbed.
- (2) Immediately notify OEMS and their supervisor in the event of a potential fiber release episode or upon discovery of visible damage to asbestos containing materials.
- (3) All employees involved in maintenance activities shall attend required Asbestos Awareness training program within 60 days of employment.

g) Employee – Facilities & Custodial

School District of Philadelphia Facilities and Custodial employees shall:

- (1) Ensure that no suspect or asbestos containing building materials are disturbed in the course of their duties or work they are performing. This shall be accomplished by notifying their supervisor and OEMS by issuance of a work permit and verifying that the materials which may be disturbed are non-asbestos containing. If this information is not available or verification has not been made, these materials should not be disturbed;
- (2) Immediately notify OEMS and their supervisor in the event of a potential fiber release episode or upon discovery of visible damage to asbestos containing materials.
- (3) All employees involved in Facilities and Custodial activities shall attend require Asbestos Awareness training program within 60 days of employment.

6. Requirements

a) Employee Exposure Monitoring

When information indicates that an employee's exposure to asbestos fibers may equal or exceed an 8-hour time-weighted average of 0.1 f/cc * (per OSHA 1910.1001 & 1926.1101), OEMS shall develop and implement an asbestos exposure monitoring program. The sampling strategy shall be designed to identify employees by work task (job classification) that is exposed to asbestos fibers that exceed an 8-hour time-weighted average of 0.1 f/cc.

b) Employee Notification

OEMS shall notify in writing, each employee exposed to asbestos fibers at or above an 8-hour time weighted average of 0.1 f/cc.

c) Observation and Monitoring

OEMS shall provide employees or their representatives with an opportunity to observe any exposure measurements conducted.

d) Training Program

OEMS shall institute a training program which meets the requirements of AHERA for all employees who perform maintenance operations in a facility/school which contains asbestos containing materials or presumed asbestos containing materials and 1910.1001 (j), and the Commonwealth of Pennsylvania Department of Labor and Industry and the City of Philadelphia Asbestos Control Regulations. The affected departments shall ensure employee participation in this program. The OEMS "A-TEAM" and other departments "AST" Asbestos Program staff training shall be conducted annually for each employee as required by all Federal, State and Local for each asbestos discipline.

All Asbestos Awareness training as required by AHERA shall be performed within 60 days of employment and shall include:

- Health effects of asbestos
- Locations of ACM and PACM in the building/facility
- Recognition of CM and PACM damage and deterioration
- o Requirements of the OSHA 1910.1001 standard relating to maintenance
- Proper response to fiber release episodes
- o Procedure to be followed to isolate areas affected by fiber release

e) Access to Information

OEMS shall make available to affected employees or their representative's copies of the Occupational Safety and Health Administration (OSHA) General Industry Standard Part 1910.1001 and the department shall post a copy in the workplace.

f) Record Keeping

OEMS shall maintain an accurate record of all employee exposure measurements. OEMS and/or the School District of Philadelphia Human Resources Department shall maintain records of employee medical monitoring program. OEMS shall maintain all employee training records. All records shall be provided upon request to employees, former employees, representatives designated by the individual employee.

a) CONTROLS

i. Work Order System

Minimizing disruption of ACM/PACM during maintenance and renovation activities is the primary goal and task encountered by OEMS. Operations and maintenance employees and contractors should be warned to avoid conducting any maintenance work which may disturb ACM/PACM. Initiating a work order system, where all work orders or requests are channeled through the Office of Environmental Management and Services (OEMS), will be the method used to control and minimize disruption of ACM/PACM.

Any work performed by in-house personnel or contractors that could or will impact ACM/PACM shall be coordinated by OEMS. A completed Asbestos Inspection Report Form (Attachment 1) shall be issued to in-house personnel and/or all contractors whose work could impact ACM/PACM. This form should accompany each contract issued to an outside contractor and posted on the jobsite.

All work order requests for maintenance and renovation activities in areas where ACM/PACM is suspected or known to be present are to be submitted to OEMS prior to proceeding with work. OEMS is responsible for reviewing asbestos survey records for information about the presence of ACM/PACM in the area where the work is to be performed. OEMS should physically inspect the area to ensure existing records reflect actual conditions. If no asbestos is present, a work order is not necessary and the planned actions can proceed. If ACM/PACM is found to be present in the area, OEMS will sign the work order application and obtain an approved and accredited asbestos contractor or assign OEMS "A-TEAM" to abate the ACM/PACM.

ii. Regulated Areas

The owner will identify and regulate all areas where airborne concentrations of ACM/PACM exceed the Permissible Exposure Limit (PEL)* (Per OSHA determined to be 0.1 f/cc) and/or short term exposure limit (STEL) (Per OSHA determined to be 0.1 f/cc), or there is reasonable possibility that the (PEL) and/or (STEL) may be exceeded. All ACM/PACM removal activities involving thermal system insulation ACM/PACM (Class I), surfacing ACM/PACM (Class I), and miscellaneous ACM/PACM such as floor tile, roofing, and siding mastic, etc. (Class II), and repair and maintenance operations where thermal system insulation and surfacing ACM/PACM is likely to be disturbed (Class III) will be performed in accordance with federal, state, and local regulations. All asbestos abatement work and activities will be designed and managed as asbestos regulated areas. These areas will be demarcated and labeled.

iii. Warning Signs

Warning signs shall be displayed at all approaches to each asbestos regulated area. The asbestos abatement contractor will provide OSHA warning signs in all regulated areas during removal, repair, and other maintenance activities. OEMS will provide AIRs to all contractors who must inform all employees and supervisors working in locations contiguous to asbestos regulated areas of the potential hazards and work practices required.

iv. Warning Labels

Warning labels and./or signage shall be affixed to all raw materials, mixtures, scrap, waste, debris, and other products containing asbestos fibers, or to their containers. Generally, the asbestos abatement contractor or OEMS A-Team personnel will provide all warning labels for ACM/PACM containment.

8. O & M RESPONSE ACTIONS

The Asbestos Management Program general O&M procedures are outlined in this section. Additional requirements specific to asbestos abatement activities are included in the Project Design documents for all Asbestos Abatement Work. Regular cleaning, inspection, and reporting of ACM/PACM deterioration or other problems must be diligently practiced by all employees including custodial and maintenance personnel.

a) Facility Maintenance Isolation of Area Responsibilities

Maintenance personnel are often required to work in areas where ACM/PACM may potentially be disturbed. Most maintenance activities are conducted by in-house staff, outside contractors, or a combination.

Emergency fiber release episodes, such as pipe fitting or valve breaks, emergency boiler work, or mechanical equipment repair will be responded to by OEMS A-Team personnel or asbestos abatement contractor personnel. The owner's maintenance staff will: (1) isolate the emergency fiber release area; (2) post warning signs to prevent unauthorized access, and (3) notify their supervisor and OEMS. OEMS will ensure that the fiber release area remains isolated and is properly cleaned by and approved and accredited abatement contractor or by OEMS A-TEAM personnel.

b) Unlikely Contact with ACM/PACM

Maintenance activities or repairs which can be performed without contacting or disturbing the ACM/PACM require little more than normal care and good workmanship. For example, valves which are either uncovered or covered with non-asbestos insulation can be packed or repaired without disturbing asbestos insulation on nearby pipes. The major precaution is to ensure that maintenance and custodial personnel are familiar with procedures such as isolating the area, posting warning signs, and notifying OEMS in the event of any accidental ACM/PACM disturbance.

c) Accidental Disturbance of ACM/PACM

Maintenance and facilities personnel shall notify OEMS any time a fiber release is suspected. If friable ACM/PACM becomes airborne in the building,

d) Planned Disturbance of ACM/PACM

Maintenance activities that may impact ACM/PACM include access to a valve, flange, duct, or related system component.

Where asbestos-containing insulation must be removed to maintain or repair the thermal system, the ACM/PACM will imminently be disturbed. ACM/PACM removal work shall be conducted by OEMS A-Team personnel or an approved and accredited asbestos abatement contractor.

If friable ACM/PACM becomes airborne in the building, maintenance and facilities personnel shall secure the area and contact OEMS. OEMS shall respond accordingly.

e) Miscellaneous ACM/PACM

Miscellaneous types of ACM/PACM may include vinyl asbestos floor tiles, mastics/adhesives and woven vibration dampers. Disturbance of these materials should be avoided. Routine maintenance activities involving these materials should not pose a problem if handled properly. Questions on the proper removal and disposal of miscellaneous ACM/PACM should be directed to OEMS. OEMS will contact an approved and accredited asbestos abatement contractor or utilize OEMS A-TEAM personnel to assist with miscellaneous ACM/PACM clean-up activities.

f) Vinyl Asbestos Floor Tile

Asbestos-containing floor tiles in good condition are considered non-friable unless they are crushed, drilled, sawed, sanded or disturbed by any activity that breaks up the material. Routine maintenance of these materials should employ the use of non-abrasive buffers and wet cleaning technique. Broken or loose floor tiles should be removed and disposed of as asbestos waste by OEMS. Remaining debris should be vacuumed with a HEPA vacuum and the area wet mopped using amended water.

g) Mastics/Adhesives

Mastics and adhesives containing asbestos in good condition are considered non-friable and do not pose a potential health concern unless crushed, drilled, sawed, sanded, or otherwise abraded. Questions on the proper removal should be directed to OEMS.

h) Woven Vibration Dampers

Woven vibration dampers in good condition are considered non-friable and do not pose a potential health concern unless cut, crushed, drilled, sawed, sanded, or otherwise abraded. Questions on the proper removal should be directed to OEMS.

i) Other Work Practices

Any special work not included in this section should be addressed to OEMS for review prior to the initiation of work that may involve the disturbance of ACM/PACM.

j) Fiber Release Episodes

Facilities and maintenance staff should report to OEMS the presence of asbestos debris, water or physical damage to ACM/PACM, or any other evidence of possible fiber release. OEMS should have the OEMS A-Team personnel or an approved and accredited abatement contractor respond to the site to clean up debris and make repairs as soon as possible. OEMS will also contact a consultant to conduct air monitoring and prepare a report and submit at project completion to OEMS for each episode. OEMS will forward the reports for each site location AHERA Management Plan accordingly.

9. REFERENCES and RESOURCES

Applicable regulations for asbestos projects impacted by renovation, demolition, and maintenance activities.

• Philadelphia Air Management Services – Asbestos Control Unit

http://www.phila.gov/health/units/ams/Asbestos/asbestos.html

• Pennsylvania Asbestos Occupations, Accreditation and Certification Act

http://www.dli.state.pa.us/landi/cwp/view.asp?a=185&q=56262&landiNav=

- United States Environmental Protection Agency Asbestos Home Page
 http://www.epa.gov/asbestos/
- Occupational Safety and Health Administration (OSHA) Asbestos Home
 http://www.osha.gov/SLTC/asbestos