

SCHOOL DISTRICT OF PHILADELPHIA



Asbestos Hazard Emergency Response Act “AHERA”

THREE-YEAR RE-INSPECTION 2015-2016 and ASBESTOS MANAGEMENT PLAN for the

**New Roberto Clemente Middle School and
The LINC High School**

**ULCS# 7140
Building # B773001-1
122 West Erie Avenue
Philadelphia, Pennsylvania
19140**

Year Built: 1994

May 2016

Conducted By:

Accredited Environmental Technologies, Incorporated
Batta Environmental Associates, Incorporated
Criterion Laboratories, Incorporated
Environmental Testing Consultants, LLC
G & C Environmental Services, Incorporated
KEM Partners, Incorporated
Synertech, Inc.
TTI Environmental, Inc.
USA Environmental Management, Inc.
The Vertex Companies, Inc.

Management Plan Prepared By:

Criterion Labs, Inc and Synertech Inc.

This report must remain in the Main Office as mandated by the US EPA AHERA Regulations.

AHERA THREE-YEAR REINSPECTION VOLUME IX

Table of Contents

Transmittal Letter

Executive Summary

- I. Summary list of Confirmed Asbestos Containing Building Materials
- II. Summary list of Assumed Asbestos Contain Building Materials
- III. Summary list of Non-Asbestos Containing Building Materials
- IV. Summary list of Non Suspect Asbestos Containing Building Materials
- V. Summary List of Auditorium DATA for this location
- VI. Summary list of Attic and/or Crawlspace DATA for this location
- VII. Summary list of Pipe Chase/Pipe Shaft DATA for this location

Section I Report of Re-Inspection

- A. Introduction
- B. Three-Year Re-inspection IX Overview
- C. Post- Management Plan Activities and Changes
 - C.1 - Sampling and Analysis
 - C.2 - New Floor Tile Sampling
 - C.3 - Abatement Activity
 - C.4 - Periodic (Six-Month) Surveillance (Damaged Materials)

Section II Re-Inspection Data

- A. Introduction
- B. Re-Inspection Key Definitions
- C. Room by Room Location Log Report

Section III Certificates

- A. Management Planner/Building Inspector Certificates

Section IV	Cross Reference Table	Page 1-8
	Asbestos Management Program	Page 9-19

SCHOOL DISTRICT OF PHILADELPHIA
EDUCATIONAL CENTER
440 NORTH BROAD STREET
PHILADELPHIA, PENNSYLVANIA 19130

OFFICE OF ENVIRONMENTAL MANAGEMENT AND SERVICES

PHONE (215)-400-4750

January 2016

TO: All Principals
All Building Administrators

FROM: Fran Burns
Chief Operating Officer


Francine Locke, M.S., Director
Office of Environmental Management and Services

SUBJECT: AHERA Three (3) Year Re-inspection IX report

In order to comply with the provisions of the Asbestos Hazard Emergency Response Act (AHERA) the attached report is submitted to you. The law requires that this report be kept in the Main/Principal's office. It cannot be removed from these locations. *If the school (program) is relocated to a different building, these environmental documents are to be safely retained for the next school/building occupants.* All asbestos reports must be available to the public and Federal EPA upon request.



Fran Burns
Chief Operation Officer

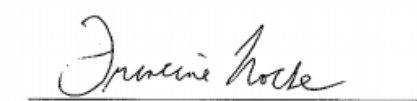

Francine Locke, M.S., Director
Office of Environmental Management
and Services

Executive Summary

This Asbestos Hazard Emergency Response Act (AHERA) Three-Year Re-inspection “Volume # IX” Management Plan at this location, has been completed and the report of re-inspection submitted to the School District of Philadelphia. The re-inspections in all School District of Philadelphia buildings of 2015-2016 were conducted and completed between October 5th, 2015 through March 30th, 2016 as a joint project by Accredited Environmental Technologies, Inc., Batta Environmental Associates, Inc., Criterion Laboratories, Inc., Environmental Testing Consultants, LLC, G & C Environmental Services, Inc., KEM Partners, Inc., Synertech, Inc., TTI Environmental, Inc., USA Environmental Management, Inc. and The Vertex Companies, Inc.

In general, the School District of Philadelphia Office of Environmental Management and Services conducts Environmental Impact Evaluations and provides Asbestos Inspection Reports prior to any renovation, demolition and/or maintenance activities. The AHERA report must be reviewed prior to any renovation, demolition and/or maintenance activities in order to avoid the unknowing disturbance to Asbestos Containing Building Materials identified within this location. In addition, prior to work activities above all drop ceilings this report should be reviewed to avoid potential disturbances to Asbestos Containing Materials. Refer to Section IV of the Cross Reference Table, for additional Asbestos Management Program information. Contact the Office of Environmental Management and Services to have an Environmental Impact Evaluation conducted prior to any renovation, demolition and/or maintenance activities within this facility.

The information contained in this report was obtained from the original Asbestos Management Plan for the school, from update reports on changes and activities since the completion of the 1st Management Plan for each location and from all prior inspections performed and documented in Volume # I through Volume VIII (dated respectively 1992, 1995, 1998, 2001, 2004, 2007, 2010 or 2013) (if applicable)- and by this Three-Year Re-inspection of this school. The re-inspection report/Management Plan of 2015-2016 were reviewed and prepared collectively by Management Planner Megan Vala, Mary Anne Lerro of Criterion Laboratories, Inc. and/or Monique Causley, of Synertech Inc.

The 2015-2016 inspection process included the addition of a comprehensive Room by Room Inventory of all Thermal (T), Surfacing (S) and Miscellaneous (M) Materials specific to each room of this facility. Inspections of each room's thermal, ceilings, walls, floors and miscellaneous items regardless of Asbestos Content are categorized on the Room by Room Location Log Report for this location. Rooms or areas of the facility that were not accessible at the time of the inspection are marked with an "X". The Room by Room Location Log Report is found in Section II C of this Management Plan.

All Presumed or Suspect Asbestos Containing Building Materials (ACBMs), listed in the following summary charts are categorized as Confirmed, Assumed, Non-Asbestos, and/or Non-Suspect (ACBMs) were identified in the original Management Plan, or in the Volume I through Volume VIII AHERA Three-Year Re-inspection reports, and were re-inspected as part of this project.

As mandated by the U S EPA AHERA regulations, periodic Six-Month inspections and Three-Year Re-inspections of this location will be performed and the Inspection Data in this report will be updated accordingly.

Please feel free to contact the School District of Philadelphia's Office of Environmental Management and Services (OEMS) regarding any comments, questions, or concerns regarding this report or any Environmental related topic. OEMS staff can be reached at (215) 400 4750, via fax at (215) 400 4751 or via e-mail at flocke@philasd.org and/or gfunod@philasd.org.

Additional information can be found on our website. Here is the link to the OEMS website.
<http://webgui.phila.k12.pa.us/offices/e/environmental>

I. Summary list of Confirmed Asbestos Containing Building Materials within this facility

These charts are to be used for a quick reference* in order to avoid the unknowing disturbance of Asbestos Containing Materials during any and all Operations, Maintenance, Renovation, and/or Demolition activities at this location. *These materials have been sampled and Laboratory Analysis has CONFIRMED the presence of Asbestos. Contact OEMS prior to the disturbance of any of the following materials.*

Confirmed Asbestos Containing Building Materials for this location

Since this facility was fully renovated and/or built after December 31, 1980 all suspect friable asbestos containing building materials do not exist in this facility.

II. Summary list of Assumed Asbestos Containing Building Materials within this facility

These charts are to be used for a quick reference* in order to avoid the unknowing disturbance of Asbestos Containing Materials during any and all Operations, Maintenance, Renovation, and/or Demolition activities at this location. These materials have not been sampled and should not be disturbed until verification of Asbestos Content. Contact OEMS for assessment and sampling prior to the disturbance of these materials.

Assumed Asbestos Containing Building Materials for this location

Since this facility was fully renovated and/or built after December 31, 1980 all suspect friable asbestos containing building materials do not exist in this facility.

III. Summary list of Non-Asbestos Containing Building Materials within this facility

These charts are to be used for a quick reference* in order to avoid the unknowing disturbance of Asbestos Containing Materials during any and all Operations, Maintenance, Renovation, and/or Demolition activities at this location. *These materials have been sampled and Laboratory Analysis has indicated NO Asbestos present or NO ASBESTOS DETECTED (NAD).*

Non- Asbestos Containing Building Materials for this location

Floor Tile VAT 12" x 12"		
--------------------------	--	--

** Always refer to the Room by Room Logs for each specific material classification as the material classification findings may be different in various rooms throughout this facility.*

*** Some Materials may have multiple classifications (Confirmed, Assumed, NAD and Non Suspect) within this facility.*

IV. Summary list of Non-Suspect Asbestos Containing Building Materials within this facility

These charts are to be used for a quick reference* in order to avoid the unknowing disturbance of Asbestos Containing Materials during any and all Operations, Maintenance, Renovation, and/or Demolition activities at this location. These materials are not typically known to contain Asbestos.

Non-Suspect Asbestos Containing Building Materials for this location

Black Foam Pipe Insulation	Carpet	Ceiling Tile 2' x 4'
Ceramic Tile Floors	Ceramic Tile Walls	Concrete Block Wall
Concrete Ceiling	Concrete Floor	Concrete Walls
Fiberglass Ceiling Tile 2' x 4'	Fiberglass Pipe Fitting Insulation	Fiberglass Pipe Insulation
Fireproofing	Metal Ceiling	Rubber Floor Mats
Sheetrock Ceiling	Sheetrock Wall	Sink Undercoat Mastic
Sprayed-on Fluffy Ceiling Surface	Vinyl Vibration Damper Cloth	

** Always refer to the Room by Room Logs for each specific material classification as the material classification findings may be different in various rooms throughout this facility.*

*** Some Materials may have multiple classifications (Confirmed, Assumed, NAD and Non Suspect) within this facility.*

V. Summary list of Auditorium DATA for this location

These charts are to be used for a quick reference of the Auditorium DATA within this facility. Sampling of the Auditorium Ceilings throughout the District is more difficult because of the various ceiling heights. As sampling occurs this information is updated on a case by case basis for each specific location and facility.

This is a list of known materials for this location's Auditorium

Auditorium	Metal Ceiling	Non Suspect ACM
Auditorium	Ceiling Tile 2' x 4'	Non Suspect ACM
Auditorium	Concrete Block Wall	Non Suspect ACM
Auditorium	Concrete Floor	Non Suspect ACM
Auditorium	Floor Tile VAT 12" x 12"	NAD
Auditorium Stage	Fiberglass Pipe Insulation	Non Suspect ACM
Auditorium Stage	Fiberglass Pipe Fitting Insulation	Non Suspect ACM
Auditorium Stage	Metal Ceiling	Non Suspect ACM
Auditorium Stage	Concrete Block Wall	Non Suspect ACM
Auditorium Stage	Floor Tile VAT 12" x 12"	NAD

** Always refer to the Room by Room Logs for each specific material classification as the material classification findings may be different in various rooms throughout this facility.*

*** Some Materials may have multiple classifications (Confirmed, Assumed, NAD and Non Suspect) within this facility.*

VI. Summary list of Attic and/or Crawlspace DATA for this location

These charts are to be used for a quick reference regarding the Attics and/or Crawlspaces inspection DATA within this facility. Contact OEMS prior to entering any attic or crawlspace within this facility and refer to the below chart and legend for Category Rank determination. The Data relative to these spaces is updated as conditions change regarding Abatement or Renovation activity on a case by case basis for each specific location and facility. In general, Crawlspaces are below the basement or 1st floor and Attics are above the floor space.

Category Rank Legend

"A" - No Asbestos Containing Materials - Sample Results indicate NO ACM on pipes, fittings, elbows, or equipment located within this functional space, and NO VISIBLE DEBRIS or DAMAGE observed at time of this inspection.
"B" - Asbestos Containing Materials Exist - Sample Results indicate ACM on pipes, fittings, elbows, or equipment located within this functional space, HOWEVER, NO VISIBLE DEBRIS or DAMAGE observed at time of this inspection.
"C" - Asbestos Containing Materials Exist - Sample Results indicate ACM on pipes, fittings, elbows, or equipment located within this functional space, and LOCALIZED VISIBLE DEBRIS or DAMAGE observed at time of this inspection.
"D" - Asbestos Containing Materials Exist - Sample Results indicate ACM on pipes, fittings, elbows, or equipment located within this functional space and DISTRIBUTED VISIBLE DEBRIS or SIGNIFICANT DAMAGE observed at time of this inspection.
"E" - No Bulk Sample Results Available SUSPECT ACM OBSERVED. Contact OEMS immediately for additional instructions.

Attic/Crawlspace	Access Area	Floor Surface	Category Rank	Comments
Attic	X	X	X	No Attic
Crawlspace	X	X	X	No Crawlspace

VII. Summary list of Pipe Chase/Pipe Shaft DATA for this location

These charts are to be used for a quick reference regarding the information known about the Pipe Chases and/or Pipe Shafts inspection DATA within this facility. Contact OEMS prior to performing renovation activities any Pipe Chase and/or Pipe Shaft within this facility and refer to the below chart and legend for Asbestos Content of various materials identified within each space. The Data relative to these spaces is updated as conditions change regarding Inspection, Abatement and/or Renovation activity on a case by case basis for each specific location and facility. In general, Pipe Chases are horizontal spaces and Pipe Shafts are vertical spaces.

<i>Floor</i>	<i>On site Room Name</i>	<i>Material</i>	<i>Confirmed Assumed NAD Non Suspect</i>	<i>Amount of Material</i>	<i>Amount of Damage</i>	<i>Color</i>	<i>Comments</i>
1	Pipe Chase in Custodial Closet between Boy's and Girl's Restrooms	X	X	X	X		No access
1	Pipe Chase in Classroom 107	X	X	X	X		No access
1	Pipe Chase in Classroom 108	X	X	X	X		No access
1	Pipe Chase in Maintenance Storage Room next to Breakroom	X	X	X	X		No access
1	Pipe Chase in Gymnasium Office Locker Room	X	X	X	X		No access
1	Pipe Chase in Hallway between Boy's and Girl's Restrooms by Gymnasium	X	X	X	X		No access
1	Pipe Chase in Custodial Closet near Classroom S09	X	X	X	X		No access
1	Pipe Chase in Copy Room in Music Practice Suite - Second Room on Left	X	X	X	X		No access
2	Pipe Chase in Classroom 215	X	X	X	X		No access
2	Pipe Chase in Custodial Closet between Boy's and Girl's Restrooms	X	X	X	X		No access
3	Pipe Chase in Custodial Closet between Boy's and Girl's Restrooms	X	X	X	X		No access
3	Pipe Chase in Counselor's Office 315	X	X	X	X		No access

Section I Report of Re-Inspection

A. Introduction

B. Three-Year Re-Inspection IX Overview

C. Post-Management Plan Activities and Changes

C.1 Sampling and Analysis

C.2 New Floor Tile Sampling

C.3 Abatement Activity

C.4 Periodic Six-Month Surveillance (Damaged Materials)

Section I - A

Report of Re-inspection

Introduction

The Three-Year Re-inspection IX was performed to fulfill the requirements of 40 CFR Part 763 - the Asbestos Hazard Emergency Response Act (AHERA). As required by AHERA, each Local Education Agency (LEA) must re-inspect all known confirmed or assumed Asbestos Containing Building Material (ACBM) located in the LEA's facilities. This re-inspection is intended to update the original Asbestos Management Plan for the LEA's facilities.

Multiple Building Inspectors of several firms performed the 2015/2016 re-inspection. The re-inspection report/Management Plan of 2015-2016 were reviewed and prepared collectively by Management Planner Megan Vala, Mary Anne Lerro of Criterion Laboratories, Inc. and Monique Causley, of Synertech Inc.

All of the certificates can be found in Section III.

During the re-inspection of each School District of Philadelphia facility, all of the Management Plans for that facility were reviewed. Information from the conclusions section of that report is included in this report. Additionally, information on activities such as abatements, cleanings, sampling and inspections, which have taken place since the completion of the original Management Plan, were reviewed during the re-inspection. Information on those activities are included in this report.

As mandated by the U S EPA AHERA regulations, all future periodic Six-Month inspections and Three-Year Re-inspections of this location will be performed and the Inspection Data in this report will be updated accordingly.

Section I - B

Three-Year Re-inspection IX Overview

Each homogeneous area of Asbestos Containing Building Material (ACBM) listed in the original Management Plan or in the 1992, 1995, 1998, 2001, etc., Three-Year Re-inspection reports were inspected for the AHERA Three-Year Re-inspection Volume IX, and the information for that material verified. Any changes to a homogeneous area listed in the updates to the Management Plans were verified. Any area of suspected ACBM found in the course of the re-inspection, and not listed in the Management Plan or updates, were either assumed to contain asbestos or sampled and analyzed to determine their asbestos content. Any such new areas either assumed to contain asbestos or determined through analysis to contain asbestos were included in the report of the Three-Year Re-inspection. The results of the AHERA Three-Year Re-inspection IX are tabulated in the Room by Room log reports located in *Section II-C* of this report.

As previously noted, all future periodic Six-Month inspections and Three-Year Re-inspections of this location will be performed and the Inspection Data in this report will be updated accordingly.

Section I – C.1

Post Management Plan Activities/Changes

Information on activities affecting Asbestos Containing Building Materials (ACBMs) at this location is contained in updates to the Management Plan. These updates are kept on file by the School District of Philadelphia and were reviewed for this project. Updates to the Management Plan include the following: *Sampling and Analysis, New Tile Installation, Abatement Activity and Periodic Six-Month Surveillance Data.*

Sampling and Analysis

In the event Sampling occurs, data will be listed here.

Section I – C.2

Information on the installation of new floor tiles/renovation activities affecting Asbestos Containing Building Materials (ACBMs) at this location is contained in updates to the Management Plan. These updates are kept on file by the School District of Philadelphia and were reviewed for this project. Updates to the Management Plan include the following:

New Floor Tile Sampling

In the event that new tile is installed, the material must be tested prior to installation.

Section I – C.3

Information on the Asbestos Abatement and renovation activities affecting Asbestos Containing Building Materials (ACBMs) at this location is contained in updates to the Management Plan. These updates are kept on file by the School District of Philadelphia and were reviewed for this project. Updates to the Management Plan include the following:

Abatement Activity

In the event that Abatement occurs, data will be listed here.

Section I – C.4

Information on the AHERA inspection that noted damage to various Building Materials at this location is contained in updates to the Management Plan. These updates are kept on file by the School District of Philadelphia and were reviewed for this project. Work orders are created for Corrective Action responses and tracked for completion. Updates to the Management Plan include the following:

Periodic (Six-Month) Surveillance (Damaged Materials)

This building is excluded from having any asbestos-containing materials via sampling data. However, our inspections may, if observed, report findings of damaged materials in order for work orders to be issued for material repairs/corrective action as necessary.

Damaged materials reported in this section will be forwarded to maintenance for repairs.

<i>Date</i>	<i>Element</i>	<i>Floor</i>	<i>On Site Room Name</i>	<i>Material</i>	<i>Amount of Material</i>	<i>Amount of Damage</i>
4/26/2017	1	1	Storage Room 109	Ceiling Tile 2' x 4'	672 SF	4 SF
4/26/2017	1	1	Classroom 112 (Computer Lab)	Ceiling Tile 2' x 4'	936 SF	2 SF
4/26/2017	1	1	Classroom 113	Ceiling Tile 2' x 4'	96 SF	2 SF
4/26/2017	1	1	Classroom 114	Ceiling Tile 2' x 4'	96 SF	2 SF
4/26/2017	1	1	Building Engineer's Office	Ceiling Tile 2' x 4'	143 SF	1 SF
4/26/2017	1	1	Building Engineer's Office Restroom	Ceiling Tile 2' x 4'	48 SF	2 SF
4/26/2017	1	1	Maintenance Area near Building Engineer's Office	Fiberglass Pipe Insulation	20 LF	2 LF
4/26/2017	1	1	Maintenance Staff Breakroom	Ceiling Tile 2' x 4'	192 SF	2 SF
4/26/2017	1	1	Maintenance Storage Room next to Breakroom	Ceiling Tile 2' x 4'	448 SF	2 SF
4/26/2017	1	1	Cafeteria	Ceiling Tile 2' x 4'	3000 SF	10 SF
4/26/2017	1	1	Kitchen	Sheetrock Ceiling	56 SF	1 SF
4/26/2017	1	1	Classroom S08	Concrete Block Wall	2160 SF	1 SF
4/26/2017	1	1	Classroom S08	Sink Undercoat Mastic	7 SF	1 SF
4/26/2017	1	1	The LINC Principal's Office S03	Floor Tile VAT 12" x 12"	700 SF	1 SF

Section II

Re-Inspection Data

A. Introduction

B. Re-Inspection Key Definitions

C. Room by Room Location Log Report

Section II - A

Re-inspection Data

Introduction

The following information documents the Three-Year Re-inspection IX of the subject school/facility. The Homogeneous Area Reports were produced using the building inspector's field data on the facility. The key to the Homogeneous Area Report is outlined in the following pages of this report.

Section II - B
(page 1 of 4)

SCHOOL DISTRICT OF PHILADELPHIA
AHERA THREE YEAR RE-INSPECTION IX

ITEM	DEFINITION
ULCS#	Individual identification number assigned to each school within the School District of Philadelphia.
HOMOGENEOUS AREA ID#	Identification number assigned to each homogeneous area in a school/facility. Each section of the homogeneous area ID is significant. 1010/01/01/01 A B C D A. Is the ULCS# for the school. B. Designates the specific building/building area within the school. C. Designates the floor or level within the building/building area. D. Designates the homogeneous material within that floor or level. Note: Item D may be a number or a letter.
SYSTEM AFFECTED	Corresponds to the AHERA system for classifying materials. T : Thermal System S : Surfacing System M : Miscellaneous
ITEM AFFECTED	Is a description of the homogeneous material.
ORIGINAL INSPECTION DATA	This section contains the information found in the original Management Plan (1988-1989).
AMOUNT OF MATERIAL/ UNIT	Quantity of material, and measuring unit. Units include: Square Feet (SF) Each (EA) Linear Feet (LF) Cubic Feet (CF).

**SCHOOL DISTRICT OF PHILADELPHIA
AHERA THREE YEAR RE-INSPECTION IX**

RE-INSPECTION FORM KEY

ITEM	DEFINITION
CND Condition	Corresponds to AHERA condition rating for materials. 0 : No Damage 1 : Damage 2 : Significant Damage
DP Damage Potential	Corresponds to the AHERA material assessment system. 1 : Potential for Damage 2 : Potential for Significant Damage
ASMD Assumed Asbestos	This means that a material was not sampled for asbestos content during the original Management Plan inspection.
RA Response Action	This corresponds to the AHERA system of response action rating for materials. 1 : Establish O&M Program 2 : Repair and Establish O&M Program 3 : Enclose 4 : Encapsulate 5 : Remove 6 : Partial Removal and Establish O&M Program
CHANGES	This section describes changes to the homogeneous material in the twenty-four years since the original AHERA inspection. The abbreviations are defined below. RMVD : Removed ENCL : Enclosed ENCP : Encapsulated DMGD : Damaged SMPLD : Sampled MTRL : Material RPRD : Repaired N/L : None Located RPLCD : Replaced

**SCHOOL DISTRICT OF PHILADELPHIA
AHERA THREE-YEAR RE-INSPECTION IX**

RE-INSPECTION FORM KEY

ITEM	DEFINITION												
THREE YEAR RE-INSPECTION	<p>This section contains the information obtained from the Three-Year Re-inspection IX. With three exceptions, the information categories are identical in format and meaning to those found in the original inspection data section. The three exceptions are defined below.</p>												
DMGD AMT Amount Damaged	<p>This section gives the quantity of damaged material in a homogeneous area. The quantity is shown in the same format as the amount of material/unit section.</p>												
NF Newly Friable	<p>This section identifies materials in the original Management Plan which have since become friable.</p>												
RA Response Action	<p>This rating is based on the AHERA regulations, and is comparable to the RA rating found in the "Original Inspection Data" section. The following table details the response actions.</p> <table><tr><td>1.</td><td>Establish O&M Program</td></tr><tr><td>2.</td><td>Repair and Establish O&M Program</td></tr><tr><td>3.</td><td>Enclose</td></tr><tr><td>4.</td><td>Encapsulate</td></tr><tr><td>5.</td><td>Remove</td></tr><tr><td>6.</td><td>Partial Removal and Establish O&M Program</td></tr></table> <p>a. High Priority Response The homogeneous material has been scheduled for abatement or other response action.</p> <p>b. Medium Priority Response The homogeneous material will be scheduled for abatement or other response action as soon as the high priority responses have been addressed.</p> <p>c. Low Priority Response The homogeneous material will be scheduled for abatement or other response action as soon as the medium priority responses have been addressed.</p> <p>d. On-Going Response/Operations and Maintenance The homogeneous material does not require abatement or other response action at present, and should be included in the facility's on-going operations and maintenance program.</p>	1.	Establish O&M Program	2.	Repair and Establish O&M Program	3.	Enclose	4.	Encapsulate	5.	Remove	6.	Partial Removal and Establish O&M Program
1.	Establish O&M Program												
2.	Repair and Establish O&M Program												
3.	Enclose												
4.	Encapsulate												
5.	Remove												
6.	Partial Removal and Establish O&M Program												

**SCHOOL DISTRICT OF PHILADELPHIA
AHERA THREE-YEAR RE-INSPECTION IX**

RE-INSPECTION FORM KEY

The information presented in the changes section has been compiled from a variety of sources, including the Re-inspection and the following:

- * Quality Control/Quality Assurance Reports of asbestos abatement projects, prepared by consultants to the School District.
- * Permit and Notification Forms for asbestos abatement projects.
- * Periodic Surveillance Forms
- * Operations and Maintenance activities performed by School District personnel.
- * Verbal information from School District personnel.
- * Reports of sampling and analysis of suspected materials by both School District personnel and outside consultants.

**ROOM BY
ROOM
LOCATION LOG
REPORT**

This section gives information, including damage amount and location, for a specific homogeneous material on a room-by-room basis and follows the Re-inspection form.

NOTE: The disparate nature of the above sources of information prohibits the verification of much information within the scope of the AHERA Three-Year Re-inspection. Discrepancies and omissions may exist in this information, and therefore is included on an "as is" basis. The inspectors for the Three-Year Re-inspection IX evaluated homogeneous areas based on the materials current condition and location, as evidenced during the inspector's site visit.

Section II - C

Room by Room Location Log Report

These charts are to be used for a quick reference* in order to avoid the unknowing disturbance of Asbestos Containing Materials during any and all Operations, Maintenance, Renovation, and/or Demolition activities at this location.

NOTE:

*Contact OEMS prior to the disturbance of any of the materials that are listed as **Confirmed and/or Assumed**.*

The quantities listed for (NAD) non-asbestos containing materials and/or Non-Suspect Materials are only estimated and were not measured for the purpose of this report. Field verification of quantities for renovation purposes would be necessary.

7140 New Roberto Clemente/The LINC 2015 2016 AHERA Three-Year Report

		School District of Philadelphia New Roberto Clemente Middle School and The LINC High School 122 West Erie Avenue, Philadelphia, PA 19140 ULCS# 7140 Year Built: 1994	AHERA Three-Year Reinspection 2015-2016 Room by Room Location Log Report								Reinspection Date: 5/3/2016 through 5/6/2016 Building Inspector: Paul Davis Number: 050368 Management Planner: Megan Vala Number: 740728			
E l e m e n t	F l o o r	On Site Room Name	System Affected	Material Description	Confirmed/Assumed/NAD/ Non Suspect ACM	Amount of Material	SF LF EA	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic/ Crawl Space Ranking		
1	BS	Boiler Room	N/A	Fiberglass Pipe Insulation	Non Suspect ACM	800	LF	0	LF					
1	BS	Boiler Room	N/A	Fiberglass Pipe Fitting Insulation	Non Suspect ACM	100	EA	0	EA					
1	BS	Boiler Room	N/A	Vinyl Vibration Damper Cloth	Non Suspect ACM	20	SF	0	SF					
1	BS	Boiler Room	N/A	Concrete Ceiling	Non Suspect ACM	5270	SF	0	SF					
1	BS	Boiler Room	N/A	Concrete Walls	Non Suspect ACM	5160	SF	0	SF					
1	BS	Boiler Room	N/A	Concrete Floor	Non Suspect ACM	5270	SF	0	SF					
1	BS	Electrical/Transformer Area in Boiler Room	N/A	Fiberglass Pipe Insulation	Non Suspect ACM	200	LF	0	LF					
1	BS	Electrical/Transformer Area in Boiler Room	N/A	Fiberglass Pipe Fitting Insulation	Non Suspect ACM	20	EA	0	EA					
1	BS	Electrical/Transformer Area in Boiler Room	N/A	Concrete Ceiling	Non Suspect ACM	665	SF	0	SF					
1	BS	Electrical/Transformer Area in Boiler Room	N/A	Concrete Walls	Non Suspect ACM	1335	SF	0	SF					
1	BS	Electrical/Transformer Area in Boiler Room	N/A	Concrete Floor	Non Suspect ACM	665	SF	0	SF					
1	BS	Elevator Mechanical Room in Boiler Room	N/A	Concrete Ceiling	Non Suspect ACM	56	SF	0	SF					
1	BS	Elevator Mechanical Room in Boiler Room	N/A	Concrete Block Wall	Non Suspect ACM	225	SF	0	SF					
1	BS	Elevator Mechanical Room in Boiler Room	N/A	Concrete Walls	Non Suspect ACM	225	SF	0	SF					
1	BS	Elevator Mechanical Room in Boiler Room	N/A	Concrete Floor	Non Suspect ACM	56	SF	0	SF					
1	BS	Stairwell to Boiler Room Area from Maintenance Area	N/A	Concrete Ceiling	Non Suspect ACM	175	SF	0	SF					
1	BS	Stairwell to Boiler Room Area from Maintenance Area	N/A	Concrete Walls	Non Suspect ACM	1500	SF	0	SF					
1	BS	Stairwell to Boiler Room Area from Maintenance Area	N/A	Concrete Floor	Non Suspect ACM	175	SF	0	SF					
1	BS	Rear Stairwell to Boiler Room Area from next to Garage Area	N/A	Concrete Ceiling	Non Suspect ACM	120	SF	0	SF					
1	BS	Rear Stairwell to Boiler Room Area from next to Garage Area	N/A	Concrete Walls	Non Suspect ACM	1500	SF	0	SF					
1	BS	Rear Stairwell to Boiler Room Area from next to Garage Area	N/A	Concrete Floor	Non Suspect ACM	120	SF	0	SF					
1	1	Stairwell 2 near Main Office	N/A	Concrete Ceiling	Non Suspect ACM	544	SF	0	SF					
1	1	Stairwell 2 near Main Office	N/A	Concrete Block Wall	Non Suspect ACM	2000	SF	0	SF					
1	1	Stairwell 2 near Main Office	N/A	Floor Tile VAT 12" x 12"	NAD	280	SF	0	SF	Grey				
1	1	Stairwell 2 near Main Office	N/A	Concrete Floor	Non Suspect ACM	136	SF	0	SF					
1	1	Stairwell 2 near Main Office	N/A	Carpet	Non Suspect ACM	64	SF	0	SF		Carpeted Drainage Slats			
1	1	Main Office Storage/Workroom	N/A	Fiberglass Pipe Insulation	Non Suspect ACM	50	LF	0	LF					
1	1	Main Office Storage/Workroom	N/A	Fiberglass Pipe Fitting Insulation	Non Suspect ACM	7	EA	0	EA					
1	1	Main Office Storage/Workroom	N/A	Concrete Ceiling	Non Suspect ACM	96	SF	0	SF					
1	1	Main Office Storage/Workroom	N/A	Concrete Block Wall	Non Suspect ACM	360	SF	0	SF					
1	1	Main Office Storage/Workroom	N/A	Floor Tile VAT 12" x 12"	NAD	96	SF	0	SF	White				
1	1	Clemente MS Main Office 120	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	816	SF	0	SF					
1	1	Clemente MS Main Office 120	N/A	Concrete Block Wall	Non Suspect ACM	1276	SF	0	SF					
1	1	Clemente MS Main Office 120	N/A	Floor Tile VAT 12" x 12"	NAD	816	SF	0	SF	White				
1	1	Clemente MS Principal's Office 121	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	252	SF	0	SF					
1	1	Clemente MS Principal's Office 121	N/A	Concrete Block Wall	Non Suspect ACM	363	SF	0	SF					
1	1	Clemente MS Principal's Office 121	N/A	Sheetrock Wall	Non Suspect ACM	363	SF	0	SF					
1	1	Clemente MS Principal's Office 121	N/A	Sink Undercoat Mastic	Non Suspect ACM	3	SF	0	SF	Grey				
1	1	Clemente MS Principal's Office 121	N/A	Floor Tile VAT 12" x 12"	NAD	126	SF	0	SF	White				
1	1	Clemente MS Principal's Office 121	N/A	Floor Tile VAT 12" x 12"	NAD	126	SF	0	SF	Grey				
1	1	Clemente MS Principal's Office 121 Closet	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	8	SF	0	SF					
1	1	Clemente MS Principal's Office 121 Closet	N/A	Concrete Block Wall	Non Suspect ACM	48	SF	0	SF					
1	1	Clemente MS Principal's Office 121 Closet	N/A	Sheetrock Wall	Non Suspect ACM	16	SF	0	SF					
1	1	Clemente MS Principal's Office 121 Closet	N/A	Floor Tile VAT 12" x 12"	NAD	8	SF	0	SF	White				
1	1	Clemente MS Principal's Office 121 Restroom	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	24	SF	0	SF					
1	1	Clemente MS Principal's Office 121 Restroom	N/A	Concrete Block Wall	Non Suspect ACM	64	SF	0	SF					
1	1	Clemente MS Principal's Office 121 Restroom	N/A	Sheetrock Wall	Non Suspect ACM	112	SF	0	SF					
1	1	Clemente MS Principal's Office 121 Restroom	N/A	Floor Tile VAT 12" x 12"	NAD	24	SF	0	SF	Grey				
1	1	Files/Records Room across from Clemente MS Principal's Office 121	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	84	SF	0	SF					
1	1	Files/Records Room across from Clemente MS Principal's Office 121	N/A	Concrete Block Wall	Non Suspect ACM	66	SF	0	SF					
1	1	Files/Records Room across from Clemente MS Principal's Office 121	N/A	Sheetrock Wall	Non Suspect ACM	340	SF	0	SF					
1	1	Files/Records Room across from Clemente MS Principal's Office 121	N/A	Floor Tile VAT 12" x 12"	NAD	84	SF	0	SF	White				
1	1	Mail Room across from Clemente MS Principal's Office 121	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	144	SF	0	SF					
1	1	Mail Room across from Clemente MS Principal's Office 121	N/A	Concrete Block Wall	Non Suspect ACM	250	SF	0	SF					
1	1	Mail Room across from Clemente MS Principal's Office 121	N/A	Sheetrock Wall	Non Suspect ACM	250	SF	0	SF					
1	1	Mail Room across from Clemente MS Principal's Office 121	N/A	Sink Undercoat Mastic	Non Suspect ACM	3	SF	0	SF	Grey				
1	1	Mail Room across from Clemente MS Principal's Office 121	N/A	Floor Tile VAT 12" x 12"	NAD	144	SF	0	SF	White				

7140 New Roberto Clemente/The LINC 2015 2016 AHERA Three-Year Report

		School District of Philadelphia New Roberto Clemente Middle School and The LINC High School 122 West Erie Avenue, Philadelphia, PA 19140 ULCS# 7140 Year Built: 1994	AHERA Three-Year Reinspection 2015-2016 Room by Room Location Log Report								Reinspection Date: 5/3/2016 through 5/6/2016 Building Inspector: Paul Davis Number: 050368 Management Planner: Megan Vala Number: 740728			
E l e m e n t	F l o o r	On Site Room Name	System Affected	Material Description	Confirmed/Assumed/NAD/ Non Suspect ACM	Amount of Material	SF LF EA	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic/ Crawl Space Ranking		
1	1	Office 125	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	120	SF	0	SF					
1	1	Office 125	N/A	Concrete Block Wall	Non Suspect ACM	220	SF	0	SF					
1	1	Office 125	N/A	Sheetrock Wall	Non Suspect ACM	220	SF	0	SF					
1	1	Office 125	N/A	Floor Tile VAT 12" x 12"	NAD	120	SF	0	SF	White				
1	1	Office 126	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	120	SF	0	SF					
1	1	Office 126	N/A	Concrete Block Wall	Non Suspect ACM	220	SF	0	SF					
1	1	Office 126	N/A	Sheetrock Wall	Non Suspect ACM	220	SF	0	SF					
1	1	Office 126	N/A	Floor Tile VAT 12" x 12"	NAD	120	SF	0	SF	White				
1	1	Clerical/Cubical Area across from Offices 125 and 126	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	456	SF	0	SF					
1	1	Clerical/Cubical Area across from Offices 125 and 126	N/A	Concrete Block Wall	Non Suspect ACM	558	SF	0	SF					
1	1	Clerical/Cubical Area across from Offices 125 and 126	N/A	Sheetrock Wall	Non Suspect ACM	600	SF	0	SF		Cubical Partitions			
1	1	Clerical/Cubical Area across from Offices 125 and 126	N/A	Floor Tile VAT 12" x 12"	NAD	456	SF	0	SF	White				
1	1	Clerical/Cubical Area across from Offices 128 and 129	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	456	SF	0	SF					
1	1	Clerical/Cubical Area across from Offices 128 and 129	N/A	Concrete Block Wall	Non Suspect ACM	558	SF	0	SF					
1	1	Clerical/Cubical Area across from Offices 128 and 129	N/A	Sheetrock Wall	Non Suspect ACM	600	SF	0	SF		Cubical Partitions			
1	1	Clerical/Cubical Area across from Offices 128 and 129	N/A	Floor Tile VAT 12" x 12"	NAD	456	SF	0	SF	White				
1	1	Office 128	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	120	SF	0	SF					
1	1	Office 128	N/A	Concrete Block Wall	Non Suspect ACM	220	SF	0	SF					
1	1	Office 128	N/A	Sheetrock Wall	Non Suspect ACM	220	SF	0	SF					
1	1	Office 128	N/A	Floor Tile VAT 12" x 12"	NAD	120	SF	0	SF	White				
1	1	Office 129	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	120	SF	0	SF					
1	1	Office 129	N/A	Concrete Block Wall	Non Suspect ACM	220	SF	0	SF					
1	1	Office 129	N/A	Sheetrock Wall	Non Suspect ACM	220	SF	0	SF					
1	1	Office 129	N/A	Floor Tile VAT 12" x 12"	NAD	120	SF	0	SF	White				
1	1	Office 131	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	120	SF	0	SF					
1	1	Office 131	N/A	Concrete Block Wall	Non Suspect ACM	220	SF	0	SF					
1	1	Office 131	N/A	Sheetrock Wall	Non Suspect ACM	220	SF	0	SF					
1	1	Office 131	N/A	Floor Tile VAT 12" x 12"	NAD	120	SF	0	SF	White				
1	1	Office 132	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	120	SF	0	SF					
1	1	Office 132	N/A	Concrete Block Wall	Non Suspect ACM	220	SF	0	SF					
1	1	Office 132	N/A	Sheetrock Wall	Non Suspect ACM	220	SF	0	SF					
1	1	Office 132	N/A	Floor Tile VAT 12" x 12"	NAD	120	SF	0	SF	White				
1	1	Women's Restroom across from Office 132	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	42	SF	0	SF					
1	1	Women's Restroom across from Office 132	N/A	Sheetrock Wall	Non Suspect ACM	208	SF	0	SF					
1	1	Women's Restroom across from Office 132	N/A	Floor Tile VAT 12" x 12"	NAD	42	SF	0	SF	White				
1	1	Men's Restroom across from Office 131	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	42	SF	0	SF					
1	1	Men's Restroom across from Office 131	N/A	Sheetrock Wall	Non Suspect ACM	208	SF	0	SF					
1	1	Men's Restroom across from Office 131	N/A	Floor Tile VAT 12" x 12"	NAD	42	SF	0	SF	White				
1	1	Hallway along 133 Roster Room	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	80	SF	0	SF					
1	1	Hallway along 133 Roster Room	N/A	Concrete Block Wall	Non Suspect ACM	168	SF	0	SF					
1	1	Hallway along 133 Roster Room	N/A	Sheetrock Wall	Non Suspect ACM	144	SF	0	SF					
1	1	Hallway along 133 Roster Room	N/A	Floor Tile VAT 12" x 12"	NAD	80	SF	0	SF	White				
1	1	Hallway from Clemente MS Principal's Office 121 to Office 132	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	460	SF	0	SF					
1	1	Hallway from Clemente MS Principal's Office 121 to Office 132	N/A	Sheetrock Wall	Non Suspect ACM	1688	SF	0	SF					
1	1	Hallway from Clemente MS Principal's Office 121 to Office 132	N/A	Floor Tile VAT 12" x 12"	NAD	460	SF	0	SF	White				
1	1	Roster Room 133	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	280	SF	0	SF					
1	1	Roster Room 133	N/A	Concrete Block Wall	Non Suspect ACM	380	SF	0	SF					
1	1	Roster Room 133	N/A	Sheetrock Wall	Non Suspect ACM	380	SF	0	SF					
1	1	Roster Room 133	N/A	Floor Tile VAT 12" x 12"	NAD	280	SF	0	SF	White				
1	1	Storage Room next to Office 132 and Women's Restroom	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	91	SF	0	SF					
1	1	Storage Room next to Office 132 and Women's Restroom	N/A	Concrete Block Wall	Non Suspect ACM	130	SF	0	SF					
1	1	Storage Room next to Office 132 and Women's Restroom	N/A	Sheetrock Wall	Non Suspect ACM	270	SF	0	SF					
1	1	Storage Room next to Office 132 and Women's Restroom	N/A	Floor Tile VAT 12" x 12"	NAD	91	SF	0	SF	White				
1	1	Lobby next to Main Office	N/A	Sprayed-on Fluffy Ceiling Surface	Non Suspect ACM	1566	SF	0	SF					
1	1	Lobby next to Main Office	N/A	Concrete Block Wall	Non Suspect ACM	1105	SF	0	SF					
1	1	Lobby next to Main Office	N/A	Sheetrock Wall	Non Suspect ACM	363	SF	0	SF					
1	1	Lobby next to Main Office	N/A	Floor Tile VAT 12" x 12"	NAD	783	SF	0	SF	White				
1	1	Lobby next to Main Office	N/A	Floor Tile VAT 12" x 12"	NAD	783	SF	0	SF	Blue				
1	1	School Police Office near Main Office	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	140	SF	0	SF					
1	1	School Police Office near Main Office	N/A	Concrete Block Wall	Non Suspect ACM	240	SF	0	SF					
1	1	School Police Office near Main Office	N/A	Sheetrock Wall	Non Suspect ACM	240	SF	0	SF					

7140 New Roberto Clemente/The LINC 2015 2016 AHERA Three-Year Report

		School District of Philadelphia New Roberto Clemente Middle School and The LINC High School 122 West Erie Avenue, Philadelphia, PA 19140 ULCS# 7140 Year Built: 1994	AHERA Three-Year Reinspection 2015-2016 Room by Room Location Log Report							Reinspection Date: 5/3/2016 through 5/6/2016 Building Inspector: Paul Davis Number: 050368 Management Planner: Megan Vala Number: 740728			Attic/ Crawl Space Ranking
<i>E l e m e n t</i>	<i>F l o o r</i>	On Site Room Name	System Affected	Material Description	Confirmed/Assumed/NAD/ Non Suspect ACM	Amount of Material	SF LF EA	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes		
1	1	School Police Office near Main Office	N/A	Floor Tile VAT 12" x 12"	NAD	140	SF	0	SF	White			
1	1	Main Entrance Vestibule near Main Office	N/A	Sheetrock Ceiling	Non Suspect ACM	80	SF	0	SF				
1	1	Main Entrance Vestibule near Main Office	N/A	Concrete Block Wall	Non Suspect ACM	160	SF	0	SF				
1	1	Main Entrance Vestibule near Main Office	N/A	Carpet	Non Suspect ACM	80	SF	0	SF		Carpeted Drainage Slats		
1	1	Classroom 101	N/A	Fiberglass Pipe Insulation	Non Suspect ACM	100	LF	0	LF				
1	1	Classroom 101	N/A	Fiberglass Pipe Fitting Insulation	Non Suspect ACM	6	EA	0	EA				
1	1	Classroom 101	N/A	Sprayed-on Fluffy Ceiling Surface	Non Suspect ACM	720	SF	0	SF				
1	1	Classroom 101	N/A	Concrete Block Wall	Non Suspect ACM	1404	SF	0	SF				
1	1	Classroom 101	N/A	Floor Tile VAT 12" x 12"	NAD	720	SF	0	SF	White			
1	1	Classroom 101 Closet	N/A	Concrete Ceiling	Non Suspect ACM	6	SF	0	SF				
1	1	Classroom 101 Closet	N/A	Concrete Block Wall	Non Suspect ACM	130	SF	0	SF				
1	1	Classroom 101 Closet	N/A	Floor Tile VAT 12" x 12"	NAD	6	SF	0	SF	White			
1	1	Classroom 102	N/A	Fiberglass Pipe Insulation	Non Suspect ACM	48	LF	0	LF				
1	1	Classroom 102	N/A	Sprayed-on Fluffy Ceiling Surface	Non Suspect ACM	720	SF	0	SF				
1	1	Classroom 102	N/A	Concrete Block Wall	Non Suspect ACM	1404	SF	0	SF				
1	1	Classroom 102	N/A	Floor Tile VAT 12" x 12"	NAD	720	SF	0	SF	White			
1	1	Classroom 102 Closet	N/A	Concrete Ceiling	Non Suspect ACM	6	SF	0	SF				
1	1	Classroom 102 Closet	N/A	Concrete Block Wall	Non Suspect ACM	130	SF	0	SF				
1	1	Classroom 102 Closet	N/A	Floor Tile VAT 12" x 12"	NAD	6	SF	0	SF	White			
1	1	Guidance Office 103	N/A	Fiberglass Pipe Insulation	Non Suspect ACM	50	LF	0	LF				
1	1	Guidance Office 103	N/A	Fiberglass Pipe Fitting Insulation	Non Suspect ACM	4	EA	0	EA				
1	1	Guidance Office 103	N/A	Sprayed-on Fluffy Ceiling Surface	Non Suspect ACM	720	SF	0	SF				
1	1	Guidance Office 103	N/A	Concrete Block Wall	Non Suspect ACM	1404	SF	0	SF				
1	1	Guidance Office 103	N/A	Floor Tile VAT 12" x 12"	NAD	720	SF	0	SF	White			
1	1	Guidance Office 103 Closet	N/A	Concrete Ceiling	Non Suspect ACM	6	SF	0	SF				
1	1	Guidance Office 103 Closet	N/A	Concrete Block Wall	Non Suspect ACM	130	SF	0	SF				
1	1	Guidance Office 103 Closet	N/A	Floor Tile VAT 12" x 12"	NAD	6	SF	0	SF	White			
1	1	Classroom 104 (Used for Book Storage)	N/A	Fiberglass Pipe Insulation	Non Suspect ACM	135	LF	0	LF				
1	1	Classroom 104 (Used for Book Storage)	N/A	Fiberglass Pipe Fitting Insulation	Non Suspect ACM	8	EA	0	EA				
1	1	Classroom 104 (Used for Book Storage)	N/A	Sprayed-on Fluffy Ceiling Surface	Non Suspect ACM	720	SF	0	SF				
1	1	Classroom 104 (Used for Book Storage)	N/A	Concrete Block Wall	Non Suspect ACM	1404	SF	0	SF				
1	1	Classroom 104 (Used for Book Storage)	N/A	Floor Tile VAT 12" x 12"	NAD	720	SF	0	SF	White			
1	1	Classroom 104 (Used for Book Storage) Closet	N/A	Concrete Ceiling	Non Suspect ACM	6	SF	0	SF				
1	1	Classroom 104 (Used for Book Storage) Closet	N/A	Concrete Block Wall	Non Suspect ACM	130	SF	0	SF				
1	1	Classroom 104 (Used for Book Storage) Closet	N/A	Floor Tile VAT 12" x 12"	NAD	6	SF	0	SF	White			
1	1	Math Book Closet across from Classroom 104	N/A	Concrete Ceiling	Non Suspect ACM	56	SF	0	SF				
1	1	Math Book Closet across from Classroom 104	N/A	Concrete Block Wall	Non Suspect ACM	390	SF	0	SF				
1	1	Math Book Closet across from Classroom 104	N/A	Floor Tile VAT 12" x 12"	NAD	56	SF	0	SF	White			
1	1	Electrical Closet across from Classroom 104	N/A	Concrete Ceiling	Non Suspect ACM	15	SF	0	SF				
1	1	Electrical Closet across from Classroom 104	N/A	Concrete Block Wall	Non Suspect ACM	208	SF	0	SF				
1	1	Electrical Closet across from Classroom 104	N/A	Concrete Floor	Non Suspect ACM	15	SF	0	SF				
1	1	Classroom 105	N/A	Fiberglass Pipe Insulation	Non Suspect ACM	50	LF	0	LF				
1	1	Classroom 105	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	144	SF	0	SF				
1	1	Classroom 105	N/A	Sprayed-on Fluffy Ceiling Surface	Non Suspect ACM	480	SF	0	SF				
1	1	Classroom 105	N/A	Concrete Block Wall	Non Suspect ACM	1200	SF	0	SF				
1	1	Classroom 105	N/A	Sheetrock Wall	Non Suspect ACM	96	SF	0	SF				
1	1	Classroom 105	N/A	Floor Tile VAT 12" x 12"	NAD	624	SF	0	SF	White			
1	1	Classroom 105 Storage Closet	N/A	Concrete Ceiling	Non Suspect ACM	96	SF	0	SF				
1	1	Classroom 105 Storage Closet	N/A	Concrete Block Wall	Non Suspect ACM	520	SF	0	SF				
1	1	Classroom 105 Storage Closet	N/A	Floor Tile VAT 12" x 12"	NAD	96	SF	0	SF	White			
1	1	Classroom 106	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	263	SF	0	SF				
1	1	Classroom 106	N/A	Concrete Block Wall	Non Suspect ACM	700	SF	0	SF				
1	1	Classroom 106	N/A	Floor Tile VAT 12" x 12"	NAD	263	SF	0	SF	White			
1	1	Nurse's Office 144	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	138	SF	0	SF				
1	1	Nurse's Office 144	N/A	Concrete Block Wall	Non Suspect ACM	350	SF	0	SF				
1	1	Nurse's Office 144	N/A	Sheetrock Wall	Non Suspect ACM	160	SF	0	SF				
1	1	Nurse's Office 144	N/A	Floor Tile VAT 12" x 12"	NAD	138	SF	0	SF	White			
1	1	Exam Room in 144 Nurse's Office	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	70	SF	0	SF				
1	1	Exam Room in 144 Nurse's Office	N/A	Concrete Block Wall	Non Suspect ACM	170	SF	0	SF				
1	1	Exam Room in 144 Nurse's Office	N/A	Sheetrock Wall	Non Suspect ACM	170	SF	0	SF				
1	1	Exam Room in 144 Nurse's Office	N/A	Sink Undercoat Mastic	Non Suspect ACM	3	SF	0	SF	Grey			
1	1	Exam Room in 144 Nurse's Office	N/A	Floor Tile VAT 12" x 12"	NAD	70	SF	0	SF	White			
1	1	Nurse's Office 144 Storage Closet next to Exam Room	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	8	SF	0	SF				

7140 New Roberto Clemente/The LINC 2015 2016 AHERA Three-Year Report

		School District of Philadelphia New Roberto Clemente Middle School and The LINC High School 122 West Erie Avenue, Philadelphia, PA 19140 ULCS# 7140 Year Built: 1994	AHERA Three-Year Reinspection 2015-2016 Room by Room Location Log Report							Reinspection Date: 5/3/2016 through 5/6/2016 Building Inspector: Paul Davis Number: 050368 Management Planner: Megan Vala Number: 740728			
E l e m e n t	F l o o r	On Site Room Name	System Affected	Material Description	Confirmed/Assumed/NAD/ Non Suspect ACM	Amount of Material	SF LF EA	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic/ Crawl Space Ranking	
1	1	Nurse's Office 144 Storage Closet next to Exam Room	N/A	Concrete Block Wall	Non Suspect ACM	54	SF	0	SF				
1	1	Nurse's Office 144 Storage Closet next to Exam Room	N/A	Sheetrock Wall	Non Suspect ACM	33	SF	0	SF				
1	1	Nurse's Office 144 Storage Closet next to Exam Room	N/A	Floor Tile VAT 12" x 12"	NAD	8	SF	0	SF	White			
1	1	After School Program Office next to 144 Nurse's Office	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	110	SF	0	SF				
1	1	After School Program Office next to 144 Nurse's Office	N/A	Concrete Block Wall	Non Suspect ACM	210	SF	0	SF				
1	1	After School Program Office next to 144 Nurse's Office	N/A	Sheetrock Wall	Non Suspect ACM	210	SF	0	SF				
1	1	After School Program Office next to 144 Nurse's Office	N/A	Floor Tile VAT 12" x 12"	NAD	110	SF	0	SF	White			
1	1	Nurse Suite Restroom	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	35	SF	0	SF				
1	1	Nurse Suite Restroom	N/A	Sheetrock Wall	Non Suspect ACM	192	SF	0	SF				
1	1	Nurse Suite Restroom	N/A	Floor Tile VAT 12" x 12"	NAD	35	SF	0	SF	White			
1	1	Nurse Suite Storage Room next to Restroom	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	40	SF	0	SF				
1	1	Nurse Suite Storage Room next to Restroom	N/A	Sheetrock Wall	Non Suspect ACM	210	SF	0	SF				
1	1	Nurse Suite Storage Room next to Restroom	N/A	Concrete Block Wall	Non Suspect ACM	50	SF	0	SF				
1	1	Nurse Suite Storage Room next to Restroom	N/A	Floor Tile VAT 12" x 12"	NAD	40	SF	0	SF	White			
1	1	Nurse Suite Hallway from Room 144 to Room 147	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	80	SF	0	SF				
1	1	Nurse Suite Hallway from Room 144 to Room 147	N/A	Concrete Block Wall	Non Suspect ACM	210	SF	0	SF				
1	1	Nurse Suite Hallway from Room 144 to Room 147	N/A	Sheetrock Wall	Non Suspect ACM	150	SF	0	SF				
1	1	Nurse Suite Hallway from Room 144 to Room 147	N/A	Floor Tile VAT 12" x 12"	NAD	80	SF	0	SF	White			
1	1	Nurse Suite Hallway from Storage Room to Rest Room	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	65	SF	0	SF				
1	1	Nurse Suite Hallway from Storage Room to Rest Room	N/A	Sheetrock Wall	Non Suspect ACM	226	SF	0	SF				
1	1	Nurse Suite Hallway from Storage Room to Rest Room	N/A	Floor Tile VAT 12" x 12"	NAD	65	SF	0	SF	White			
1	1	Conference Room 147 in SDS Suite	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	160	SF	0	SF				
1	1	Conference Room 147 in SDS Suite	N/A	Concrete Block Wall	Non Suspect ACM	468	SF	0	SF				
1	1	Conference Room 147 in SDS Suite	N/A	Floor Tile VAT 12" x 12"	NAD	160	SF	0	SF	White			
1	1	Conference Room 147 Closet	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	21	SF	0	SF				
1	1	Conference Room 147 Closet	N/A	Concrete Block Wall	Non Suspect ACM	117	SF	0	SF				
1	1	Conference Room 147 Closet	N/A	Floor Tile VAT 12" x 12"	NAD	21	SF	0	SF	White			
1	1	Exam Room 148 in SDS Suite	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	80	SF	0	SF				
1	1	Exam Room 148 in SDS Suite	N/A	Concrete Block Wall	Non Suspect ACM	81	SF	0	SF				
1	1	Exam Room 148 in SDS Suite	N/A	Sheetrock Wall	Non Suspect ACM	243	SF	0	SF				
1	1	Exam Room 148 in SDS Suite	N/A	Sink Undercoat Mastic	Non Suspect ACM	3	SF	0	SF	Grey			
1	1	Exam Room 148 in SDS Suite	N/A	Floor Tile VAT 12" x 12"	NAD	80	SF	0	SF	White			
1	1	Exam Room 149 in SDS Suite	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	100	SF	0	SF				
1	1	Exam Room 149 in SDS Suite	N/A	Concrete Block Wall	Non Suspect ACM	90	SF	0	SF				
1	1	Exam Room 149 in SDS Suite	N/A	Sheetrock Wall	Non Suspect ACM	270	SF	0	SF				
1	1	Exam Room 149 in SDS Suite	N/A	Sink Undercoat Mastic	Non Suspect ACM	3	SF	0	SF	Grey			
1	1	Exam Room 149 in SDS Suite	N/A	Floor Tile VAT 12" x 12"	NAD	100	SF	0	SF	White			
1	1	Exam Room 150 in SDS Suite	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	72	SF	0	SF				
1	1	Exam Room 150 in SDS Suite	N/A	Concrete Block Wall	Non Suspect ACM	153	SF	0	SF				
1	1	Exam Room 150 in SDS Suite	N/A	Sheetrock Wall	Non Suspect ACM	153	SF	0	SF				
1	1	Exam Room 150 in SDS Suite	N/A	Sink Undercoat Mastic	Non Suspect ACM	3	SF	0	SF	Grey			
1	1	Exam Room 150 in SDS Suite	N/A	Floor Tile VAT 12" x 12"	NAD	72	SF	0	SF	White			
1	1	Lab Room 151 in SDS Suite	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	54	SF	0	SF				
1	1	Lab Room 151 in SDS Suite	N/A	Concrete Block Wall	Non Suspect ACM	54	SF	0	SF				
1	1	Lab Room 151 in SDS Suite	N/A	Sheetrock Wall	Non Suspect ACM	216	SF	0	SF				
1	1	Lab Room 151 in SDS Suite	N/A	Floor Tile VAT 12" x 12"	NAD	54	SF	0	SF	White			
1	1	Office 153 in SDS Suite	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	90	SF	0	SF				
1	1	Office 153 in SDS Suite	N/A	Concrete Block Wall	Non Suspect ACM	171	SF	0	SF				
1	1	Office 153 in SDS Suite	N/A	Sheetrock Wall	Non Suspect ACM	171	SF	0	SF				
1	1	Office 153 in SDS Suite	N/A	Floor Tile VAT 12" x 12"	NAD	90	SF	0	SF	White			
1	1	Staff Restroom in SDS Suite	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	42	SF	0	SF				
1	1	Staff Restroom in SDS Suite	N/A	Concrete Block Wall	Non Suspect ACM	52	SF	0	SF				
1	1	Staff Restroom in SDS Suite	N/A	Sheetrock Wall	Non Suspect ACM	156	SF	0	SF				
1	1	Staff Restroom in SDS Suite	N/A	Floor Tile VAT 12" x 12"	NAD	42	SF	0	SF	White			
1	1	Hallway in SDS Suite from Room 150 to Room 153	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	162	SF	0	SF				
1	1	Hallway in SDS Suite from Room 150 to Room 153	N/A	Sheetrock Wall	Non Suspect ACM	405	SF	0	SF				
1	1	Hallway in SDS Suite from Room 150 to Room 153	N/A	Floor Tile VAT 12" x 12"	NAD	162	SF	0	SF	White			
1	1	Storage Closet next to Exam Room 150	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	10	SF	0	SF				
1	1	Storage Closet next to Exam Room 150	N/A	Concrete Block Wall	Non Suspect ACM	45	SF	0	SF				
1	1	Storage Closet next to Exam Room 150	N/A	Sheetrock Wall	Non Suspect ACM	36	SF	0	SF				
1	1	Storage Closet next to Exam Room 150	N/A	Floor Tile VAT 12" x 12"	NAD	10	SF	0	SF	White			
1	1	Hallway in SDS Suite between Exam Rooms 148 and 149	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	55	SF	0	SF				
1	1	Hallway in SDS Suite between Exam Rooms 148 and 149	N/A	Sheetrock Wall	Non Suspect ACM	156	SF	0	SF				

7140 New Roberto Clemente/The LINC 2015 2016 AHERA Three-Year Report

		School District of Philadelphia New Roberto Clemente Middle School and The LINC High School 122 West Erie Avenue, Philadelphia, PA 19140 ULCS# 7140 Year Built: 1994	AHERA Three-Year Reinspection 2015-2016 Room by Room Location Log Report							Reinspection Date: 5/3/2016 through 5/6/2016 Building Inspector: Paul Davis Number: 050368 Management Planner: Megan Vala Number: 740728			
E l e m e n t	F l o o r	On Site Room Name	System Affected	Material Description	Confirmed/Assumed/NAD/ Non Suspect ACM	Amount of Material	SF LF EA	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic/ Crawl Space Ranking	
1	1	Hallway in SDS Suite between Exam Rooms 148 and 149	N/A	Floor Tile VAT 12" x 12"	NAD	55	SF	0	SF	White			
1	1	SDS Suite Reception Area	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	250	SF	0	SF				
1	1	SDS Suite Reception Area	N/A	Concrete Block Wall	Non Suspect ACM	472	SF	0	SF				
1	1	SDS Suite Reception Area	N/A	Sheetrock Wall	Non Suspect ACM	120	SF	0	SF				
1	1	SDS Suite Reception Area	N/A	Floor Tile VAT 12" x 12"	NAD	250	SF	0	SF	White			
1	1	Vestibule next to SDS Suite	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	101	SF	0	SF				
1	1	Vestibule next to SDS Suite	N/A	Concrete Block Wall	Non Suspect ACM	360	SF	0	SF				
1	1	Vestibule next to SDS Suite	N/A	Floor Tile VAT 12" x 12"	NAD	24	SF	0	SF	White			
1	1	Vestibule next to SDS Suite	N/A	Carpet	Non Suspect ACM	77	SF	0	SF		Carpeted Drainage Slats		
1	1	Hallway from Lobby to Vestibule by SDS Suite	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	1360	SF	0	SF				
1	1	Hallway from Lobby to Vestibule by SDS Suite	N/A	Concrete Block Wall	Non Suspect ACM	2900	SF	0	SF				
1	1	Hallway from Lobby to Vestibule by SDS Suite	N/A	Floor Tile VAT 12" x 12"	NAD	1360	SF	0	SF	White			
1	1	Girl's Restroom	N/A	Fiberglass Ceiling Tile 2' x 4'	Non Suspect ACM	300	SF	0	SF				
1	1	Girl's Restroom	N/A	Concrete Block Wall	Non Suspect ACM	650	SF	0	SF				
1	1	Girl's Restroom	N/A	Ceramic Tile Floors	Non Suspect ACM	300	SF	0	SF				
1	1	Boy's Restroom	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	300	SF	0	SF				
1	1	Boy's Restroom	N/A	Concrete Block Wall	Non Suspect ACM	650	SF	0	SF				
1	1	Boy's Restroom	N/A	Ceramic Tile Floors	Non Suspect ACM	300	SF	0	SF				
1	1	Custodial Closet between Boy's and Girl's Restrooms	N/A	Fiberglass Pipe Insulation	Non Suspect ACM	25	LF	0	LF		Pipe Chase Access in this Room		
1	1	Custodial Closet between Boy's and Girl's Restrooms	N/A	Fiberglass Pipe Fitting Insulation	Non Suspect ACM	3	EA	0	EA		Pipe Chase Access in this Room		
1	1	Custodial Closet between Boy's and Girl's Restrooms	N/A	Concrete Ceiling	Non Suspect ACM	72	SF	0	SF		Pipe Chase Access in this Room		
1	1	Custodial Closet between Boy's and Girl's Restrooms	N/A	Concrete Block Wall	Non Suspect ACM	442	SF	0	SF		Pipe Chase Access in this Room		
1	1	Custodial Closet between Boy's and Girl's Restrooms	N/A	Concrete Floor	Non Suspect ACM	72	SF	0	SF		Pipe Chase Access in this Room		
1	1	Vestibule and Stairwell 3	N/A	Concrete Ceiling	Non Suspect ACM	428	SF	0	SF				
1	1	Vestibule and Stairwell 3	N/A	Sheetrock Ceiling	Non Suspect ACM	233	SF	0	SF				
1	1	Vestibule and Stairwell 3	N/A	Concrete Block Wall	Non Suspect ACM	910	SF	0	SF				
1	1	Vestibule and Stairwell 3	N/A	Ceramic Tile Walls	Non Suspect ACM	216	SF	0	SF				
1	1	Vestibule and Stairwell 3	N/A	Sheetrock Wall	Non Suspect ACM	124	SF	0	SF				
1	1	Vestibule and Stairwell 3	N/A	Floor Tile VAT 12" x 12"	NAD	368	SF	0	SF	Blue			
1	1	Vestibule and Stairwell 3	N/A	Concrete Floor	Non Suspect ACM	121	SF	0	SF				
1	1	Vestibule and Stairwell 3	N/A	Carpet	Non Suspect ACM	63	SF	0	SF		Carpeted Drainage Slats		
1	1	Classroom 107	N/A	Fiberglass Pipe Insulation	Non Suspect ACM	80	LF	0	LF		Pipe Chase Access in this Room		
1	1	Classroom 107	N/A	Fiberglass Pipe Fitting Insulation	Non Suspect ACM	17	EA	0	EA		Pipe Chase Access in this Room		
1	1	Classroom 107	N/A	Sprayed-on Fluffy Ceiling Surface	Non Suspect ACM	675	SF	0	SF		Pipe Chase Access in this Room		
1	1	Classroom 107	N/A	Concrete Block Wall	Non Suspect ACM	1352	SF	0	SF		Pipe Chase Access in this Room		
1	1	Classroom 107	N/A	Sink Undercoat Mastic	Non Suspect ACM	6	SF	0	SF	Grey	Pipe Chase Access in this Room		
1	1	Classroom 107	N/A	Floor Tile VAT 12" x 12"	NAD	337	SF	0	SF	Grey	Pipe Chase Access in this Room		
1	1	Classroom 107	N/A	Floor Tile VAT 12" x 12"	NAD	338	SF	0	SF	White	Pipe Chase Access in this Room		
1	1	Classroom 107 Storage Closet	N/A	Fiberglass Pipe Insulation	Non Suspect ACM	35	LF	0	LF				
1	1	Classroom 107 Storage Closet	N/A	Fiberglass Pipe Fitting Insulation	Non Suspect ACM	6	EA	0	EA				
1	1	Classroom 107 Storage Closet	N/A	Concrete Ceiling	Non Suspect ACM	72	SF	0	SF				
1	1	Classroom 107 Storage Closet	N/A	Concrete Block Wall	Non Suspect ACM	442	SF	0	SF				
1	1	Classroom 107 Storage Closet	N/A	Floor Tile VAT 12" x 12"	NAD	72	SF	0	SF	White			
1	1	Classroom 107 Restroom	N/A	Fiberglass Pipe Insulation	Non Suspect ACM	14	LF	0	LF				
1	1	Classroom 107 Restroom	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	72	SF	0	SF				
1	1	Classroom 107 Restroom	N/A	Concrete Block Wall	Non Suspect ACM	272	SF	0	SF				
1	1	Classroom 107 Restroom	N/A	Floor Tile VAT 12" x 12"	NAD	72	SF	0	SF	Blue			
1	1	Classroom 108	N/A	Fiberglass Pipe Insulation	Non Suspect ACM	60	LF	0	LF		Pipe Chase Access in this Room		
1	1	Classroom 108	N/A	Fiberglass Pipe Fitting Insulation	Non Suspect ACM	7	EA	0	EA		Pipe Chase Access in this Room		
1	1	Classroom 108	N/A	Sprayed-on Fluffy Ceiling Surface	Non Suspect ACM	675	SF	0	SF		Pipe Chase Access in this Room		
1	1	Classroom 108	N/A	Concrete Block Wall	Non Suspect ACM	1352	SF	0	SF		Pipe Chase Access in this Room		
1	1	Classroom 108	N/A	Floor Tile VAT 12" x 12"	NAD	337	SF	0	SF	Blue	Pipe Chase Access in this Room		
1	1	Classroom 108	N/A	Floor Tile VAT 12" x 12"	NAD	338	SF	0	SF	White	Pipe Chase Access in this Room		
1	1	Classroom 108 Storage Closet	N/A	Concrete Ceiling	Non Suspect ACM	72	SF	0	SF				
1	1	Classroom 108 Storage Closet	N/A	Concrete Block Wall	Non Suspect ACM	442	SF	0	SF				
1	1	Classroom 108 Storage Closet	N/A	Floor Tile VAT 12" x 12"	NAD	72	SF	0	SF	White			
1	1	Electrical Closet near Classroom 108	N/A	Concrete Ceiling	Non Suspect ACM	20	SF	0	SF				
1	1	Electrical Closet near Classroom 108	N/A	Concrete Block Wall	Non Suspect ACM	234	SF	0	SF				
1	1	Electrical Closet near Classroom 108	N/A	Concrete Floor	Non Suspect ACM	20	SF	0	SF				
1	1	Book Closet across IMC next to Electrical Closet	N/A	Concrete Ceiling	Non Suspect ACM	80	SF	0	SF				
1	1	Book Closet across IMC next to Electrical Closet	N/A	Concrete Block Wall	Non Suspect ACM	468	SF	0	SF				
1	1	Book Closet across IMC next to Electrical Closet	N/A	Floor Tile VAT 12" x 12"	NAD	80	SF	0	SF	White			
1	1	Book Closet across IMC near Classroom 109	N/A	Concrete Ceiling	Non Suspect ACM	54	SF	0	SF				

7140 New Roberto Clemente/The LINC 2015 2016 AHERA Three-Year Report

		School District of Philadelphia New Roberto Clemente Middle School and The LINC High School 122 West Erie Avenue, Philadelphia, PA 19140 ULCS# 7140 Year Built: 1994	AHERA Three-Year Reinspection 2015-2016 Room by Room Location Log Report							Reinspection Date: 5/3/2016 through 5/6/2016			
										Building Inspector: Paul Davis			
										Number: 050368			
										Management Planner: Megan Vala			
										Number: 740728			
E l e m e n t	F l o o r	On Site Room Name	System Affected	Material Description	Confirmed/Assumed/NAD/ Non Suspect ACM	Amount of Material	SF LF EA	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic/ Crawl Space Ranking	
1	1	Book Closet across IMC near Classroom 109	N/A	Concrete Block Wall	Non Suspect ACM	390	SF	0	SF				
1	1	Book Closet across IMC near Classroom 109	N/A	Floor Tile VAT 12" x 12"	NAD	54	SF	0	SF	White			
1	1	IMC/Library	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	2050	SF	0	SF				
1	1	IMC/Library	N/A	Sheetrock Ceiling	Non Suspect ACM	2050	SF	0	SF				
1	1	IMC/Library	N/A	Concrete Block Wall	Non Suspect ACM	3168	SF	0	SF				
1	1	IMC/Library	N/A	Floor Tile VAT 12" x 12"	NAD	4100	SF	0	SF	Grey			
1	1	IMC Office	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	128	SF	0	SF				
1	1	IMC Office	N/A	Concrete Block Wall	Non Suspect ACM	360	SF	0	SF				
1	1	IMC Office	N/A	Floor Tile VAT 12" x 12"	NAD	128	SF	0	SF	White			
1	1	IMC Workroom next to IMC Office	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	153	SF	0	SF				
1	1	IMC Workroom next to IMC Office	N/A	Concrete Block Wall	Non Suspect ACM	468	SF	0	SF				
1	1	IMC Workroom next to IMC Office	N/A	Sink Undercoat Mastic	Non Suspect ACM	6	SF	0	SF	Grey			
1	1	IMC Workroom next to IMC Office	N/A	Floor Tile VAT 12" x 12"	NAD	153	SF	0	SF	White			
1	1	IMC Storage Room near Entrance to IMC	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	150	SF	0	SF				
1	1	IMC Storage Room near Entrance to IMC	N/A	Concrete Block Wall	Non Suspect ACM	450	SF	0	SF				
1	1	IMC Storage Room near Entrance to IMC	N/A	Floor Tile VAT 12" x 12"	NAD	150	SF	0	SF	White			
1	1	IMC Poster Maker/Laminate Room	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	120	SF	0	SF				
1	1	IMC Poster Maker/Laminate Room	N/A	Concrete Block Wall	Non Suspect ACM	400	SF	0	SF				
1	1	IMC Poster Maker/Laminate Room	N/A	Floor Tile VAT 12" x 12"	NAD	120	SF	0	SF	White			
1	1	Storage Room 109	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	672	SF	4	SF				
1	1	Storage Room 109	N/A	Concrete Block Wall	Non Suspect ACM	1248	SF	0	SF				
1	1	Storage Room 109	N/A	Floor Tile VAT 12" x 12"	NAD	672	SF	0	SF	White			
1	1	Storage Room 109 Closet	N/A	X	X	X	X	X	X	X	No Access/ Not Inspected		
1	1	Storage Room 110	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	300	SF	0	SF				
1	1	Storage Room 110	N/A	Concrete Block Wall	Non Suspect ACM	900	SF	0	SF				
1	1	Storage Room 110	N/A	Floor Tile VAT 12" x 12"	NAD	300	SF	0	SF	White			
1	1	Storage Room 110 Closet	N/A	X	X	X	X	X	X	X	No Access/ Not Inspected		
1	1	Custodial Storage and Office across from Room 110	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	120	SF	0	SF				
1	1	Custodial Storage and Office across from Room 110	N/A	Concrete Block Wall	Non Suspect ACM	400	SF	0	SF				
1	1	Custodial Storage and Office across from Room 110	N/A	Floor Tile VAT 12" x 12"	NAD	120	SF	0	SF	White			
1	1	Book Closet across from Custodial Storage and Office	N/A	Concrete Ceiling	Non Suspect ACM	60	SF	0	SF				
1	1	Book Closet across from Custodial Storage and Office	N/A	Concrete Block Wall	Non Suspect ACM	416	SF	0	SF				
1	1	Book Closet across from Custodial Storage and Office	N/A	Floor Tile VAT 12" x 12"	NAD	60	SF	0	SF	White			
1	1	Classroom 111 (Computer Lab)	N/A	Fiberglass Pipe Insulation	Non Suspect ACM	10	LF	0	LF				
1	1	Classroom 111 (Computer Lab)	N/A	Fiberglass Pipe Fitting Insulation	Non Suspect ACM	2	EA	0	EA				
1	1	Classroom 111 (Computer Lab)	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	936	SF	0	SF				
1	1	Classroom 111 (Computer Lab)	N/A	Sheetrock Ceiling	Non Suspect ACM	24	SF	0	SF				
1	1	Classroom 111 (Computer Lab)	N/A	Concrete Block Wall	Non Suspect ACM	1536	SF	0	SF				
1	1	Classroom 111 (Computer Lab)	N/A	Sheetrock Wall	Non Suspect ACM	48	SF	0	SF				
1	1	Classroom 111 (Computer Lab)	N/A	Floor Tile VAT 12" x 12"	NAD	960	SF	0	SF	White			
1	1	Classroom 111 (Computer Lab) Closet	N/A	Concrete Ceiling	Non Suspect ACM	6	SF	0	SF				
1	1	Classroom 111 (Computer Lab) Closet	N/A	Concrete Block Wall	Non Suspect ACM	130	SF	0	SF				
1	1	Classroom 111 (Computer Lab) Closet	N/A	Floor Tile VAT 12" x 12"	NAD	6	SF	0	SF	White			
1	1	Classroom 112 (Computer Lab)	N/A	Fiberglass Pipe Insulation	Non Suspect ACM	5	LF	0	LF				
1	1	Classroom 112 (Computer Lab)	N/A	Fiberglass Pipe Fitting Insulation	Non Suspect ACM	3	EA	0	EA				
1	1	Classroom 112 (Computer Lab)	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	936	SF	2	SF				
1	1	Classroom 112 (Computer Lab)	N/A	Sheetrock Ceiling	Non Suspect ACM	24	SF	0	SF				
1	1	Classroom 112 (Computer Lab)	N/A	Concrete Block Wall	Non Suspect ACM	1536	SF	0	SF				
1	1	Classroom 112 (Computer Lab)	N/A	Sheetrock Wall	Non Suspect ACM	48	SF	0	SF				
1	1	Classroom 112 (Computer Lab)	N/A	Floor Tile VAT 12" x 12"	NAD	960	SF	0	SF	White			
1	1	Classroom 112 (Computer Lab) Closet	N/A	Concrete Ceiling	Non Suspect ACM	6	SF	0	SF				
1	1	Classroom 112 (Computer Lab) Closet	N/A	Concrete Block Wall	Non Suspect ACM	130	SF	0	SF				
1	1	Classroom 112 (Computer Lab) Closet	N/A	Floor Tile VAT 12" x 12"	NAD	6	SF	0	SF	White			
1	1	Classroom 113	N/A	Fiberglass Pipe Insulation	Non Suspect ACM	60	LF	0	LF				
1	1	Classroom 113	N/A	Fiberglass Pipe Fitting Insulation	Non Suspect ACM	6	EA	0	EA				
1	1	Classroom 113	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	96	SF	2	SF				
1	1	Classroom 113	N/A	Sprayed-on Fluffy Ceiling Surface	Non Suspect ACM	864	SF	0	SF				
1	1	Classroom 113	N/A	Sheetrock Ceiling	Non Suspect ACM	24	SF	0	SF				
1	1	Classroom 113	N/A	Concrete Block Wall	Non Suspect ACM	1664	SF	0	SF				
1	1	Classroom 113	N/A	Sheetrock Wall	Non Suspect ACM	96	SF	0	SF				
1	1	Classroom 113	N/A	Floor Tile VAT 12" x 12"	NAD	960	SF	0	SF	White			
1	1	Classroom 114	N/A	Fiberglass Pipe Insulation	Non Suspect ACM	150	LF	0	LF				
1	1	Classroom 114	N/A	Fiberglass Pipe Fitting Insulation	Non Suspect ACM	6	EA	0	EA				
1	1	Classroom 114	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	96	SF	2	SF				
1	1	Classroom 114	N/A	Spraved-on Fluffy Ceiling Surface	Non Suspect ACM	864	SF	0	SF				

7140 New Roberto Clemente/The LINC 2015 2016 AHERA Three-Year Report

		School District of Philadelphia New Roberto Clemente Middle School and The LINC High School 122 West Erie Avenue, Philadelphia, PA 19140 ULCS# 7140 Year Built: 1994	AHERA Three-Year Reinspection 2015-2016 Room by Room Location Log Report								Reinspection Date: 5/3/2016 through 5/6/2016		
											Building Inspector: Paul Davis		
											Number: 050368		
											Management Planner: Megan Vala		
											Number: 740728		
E l e m e n t	F l o o r	On Site Room Name	System Affected	Material Description	Confirmed/Assumed/NAD/ Non Suspect ACM	Amount of Material	SF LF EA	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic/ Crawl Space Ranking	
1	1	Classroom 114	N/A	Sheetrock Ceiling	Non Suspect ACM	24	SF	0	SF				
1	1	Classroom 114	N/A	Concrete Block Wall	Non Suspect ACM	1664	SF	0	SF				
1	1	Classroom 114	N/A	Sheetrock Wall	Non Suspect ACM	96	SF	0	SF				
1	1	Classroom 114	N/A	Floor Tile VAT 12" x 12"	NAD	960	SF	0	SF	White			
1	1	Classroom 114 Closet	N/A	Concrete Ceiling	Non Suspect ACM	6	SF	0	SF				
1	1	Classroom 114 Closet	N/A	Concrete Block Wall	Non Suspect ACM	130	SF	0	SF				
1	1	Classroom 114 Closet	N/A	Floor Tile VAT 12" x 12"	NAD	6	SF	0	SF	White			
1	1	Classroom 116	N/A	Fiberglass Pipe Insulation	Non Suspect ACM	125	LF	0	LF				
1	1	Classroom 116	N/A	Fiberglass Pipe Fitting Insulation	Non Suspect ACM	7	EA	0	EA				
1	1	Classroom 116	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	96	SF	0	SF				
1	1	Classroom 116	N/A	Sprayed-on Fluffy Ceiling Surface	Non Suspect ACM	864	SF	0	SF				
1	1	Classroom 116	N/A	Sheetrock Ceiling	Non Suspect ACM	24	SF	0	SF				
1	1	Classroom 116	N/A	Concrete Block Wall	Non Suspect ACM	1664	SF	0	SF				
1	1	Classroom 116	N/A	Sheetrock Wall	Non Suspect ACM	96	SF	0	SF				
1	1	Classroom 116	N/A	Floor Tile VAT 12" x 12"	NAD	960	SF	0	SF	White			
1	1	Classroom 116 Closet	N/A	Fiberglass Pipe Insulation	Non Suspect ACM	12	LF	0	LF				
1	1	Classroom 116 Closet	N/A	Concrete Ceiling	Non Suspect ACM	6	SF	0	SF				
1	1	Classroom 116 Closet	N/A	Concrete Block Wall	Non Suspect ACM	130	SF	0	SF				
1	1	Classroom 116 Closet	N/A	Floor Tile VAT 12" x 12"	NAD	6	SF	0	SF	White			
1	1	Classroom 115	N/A	Fiberglass Pipe Insulation	Non Suspect ACM	200	LF	0	LF				
1	1	Classroom 115	N/A	Fiberglass Pipe Fitting Insulation	Non Suspect ACM	10	EA	0	EA				
1	1	Classroom 115	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	96	SF	0	SF				
1	1	Classroom 115	N/A	Sprayed-on Fluffy Ceiling Surface	Non Suspect ACM	864	SF	0	SF				
1	1	Classroom 115	N/A	Sheetrock Ceiling	Non Suspect ACM	24	SF	0	SF				
1	1	Classroom 115	N/A	Concrete Block Wall	Non Suspect ACM	1664	SF	0	SF				
1	1	Classroom 115	N/A	Sheetrock Wall	Non Suspect ACM	96	SF	0	SF				
1	1	Classroom 115	N/A	Floor Tile VAT 12" x 12"	NAD	960	SF	0	SF	White			
1	1	Stairwell 4 near the Maintenance Area	N/A	Concrete Ceiling	Non Suspect ACM	240	SF	0	SF				
1	1	Stairwell 4 near the Maintenance Area	N/A	Concrete Block Wall	Non Suspect ACM	1344	SF	0	SF				
1	1	Stairwell 4 near the Maintenance Area	N/A	Floor Tile VAT 12" x 12"	NAD	347	SF	0	SF	Grey			
1	1	Stairwell 4 near the Maintenance Area	N/A	Concrete Floor	Non Suspect ACM	128	SF	0	SF				
1	1	Stairwell 4 near the Maintenance Area	N/A	Carpet	Non Suspect ACM	60	SF	0	SF		Carpeted Drainage Slats		
1	1	Building Engineer's Office	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	143	SF	1	SF				
1	1	Building Engineer's Office	N/A	Concrete Block Wall	Non Suspect ACM	432	SF	0	SF				
1	1	Building Engineer's Office	N/A	Floor Tile VAT 12" x 12"	NAD	143	SF	0	SF	White			
1	1	Building Engineer's Office Restroom	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	48	SF	2	SF				
1	1	Building Engineer's Office Restroom	N/A	Concrete Block Wall	Non Suspect ACM	252	SF	0	SF				
1	1	Building Engineer's Office Restroom	N/A	Floor Tile VAT 12" x 12"	NAD	48	SF	0	SF	White			
1	1	Maintenance Area near Building Engineer's Office	N/A	Fiberglass Pipe Insulation	Non Suspect ACM	20	LF	2	LF				
1	1	Maintenance Area near Building Engineer's Office	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	648	SF	0	SF				
1	1	Maintenance Area near Building Engineer's Office	N/A	Concrete Block Wall	Non Suspect ACM	972	SF	0	SF				
1	1	Maintenance Area near Building Engineer's Office	N/A	Concrete Floor	Non Suspect ACM	648	SF	0	SF				
1	1	Maintenance Staff Men's Locker Room S44	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	48	SF	0	SF				
1	1	Maintenance Staff Men's Locker Room S44	N/A	Concrete Block Wall	Non Suspect ACM	224	SF	0	SF				
1	1	Maintenance Staff Men's Locker Room S44	N/A	Concrete Floor	Non Suspect ACM	48	SF	0	SF				
1	1	Maintenance Staff Women's Locker Room S43	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	70	SF	0	SF				
1	1	Maintenance Staff Women's Locker Room S43	N/A	Concrete Block Wall	Non Suspect ACM	272	SF	0	SF				
1	1	Maintenance Staff Women's Locker Room S43	N/A	Concrete Floor	Non Suspect ACM	70	SF	0	SF				
1	1	Maintenance Staff Restroom	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	25	SF	0	SF				
1	1	Maintenance Staff Restroom	N/A	Concrete Block Wall	Non Suspect ACM	160	SF	0	SF				
1	1	Maintenance Staff Restroom	N/A	Floor Tile VAT 12" x 12"	NAD	25	SF	0	SF	Blue			
1	1	Maintenance Staff Breakroom	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	192	SF	2	SF				
1	1	Maintenance Staff Breakroom	N/A	Concrete Block Wall	Non Suspect ACM	504	SF	0	SF				
1	1	Maintenance Staff Breakroom	N/A	Concrete Floor	Non Suspect ACM	192	SF	0	SF				
1	1	Maintenance Storage Room next to Breakroom	N/A	Fiberglass Pipe Insulation	Non Suspect ACM	20	LF	0	LF		Pipe Chase Access in this Room		
1	1	Maintenance Storage Room next to Breakroom	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	448	SF	2	SF		Pipe Chase Access in this Room		
1	1	Maintenance Storage Room next to Breakroom	N/A	Concrete Block Wall	Non Suspect ACM	792	SF	0	SF		Pipe Chase Access in this Room		
1	1	Maintenance Storage Room next to Breakroom	N/A	Concrete Floor	Non Suspect ACM	448	SF	0	SF		Pipe Chase Access in this Room		
1	1	Hallway from Girl's Restroom to Maintenance Area	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	2620	SF	0	SF				
1	1	Hallway from Girl's Restroom to Maintenance Area	N/A	Concrete Block Wall	Non Suspect ACM	4100	SF	0	SF				
1	1	Hallway from Girl's Restroom to Maintenance Area	N/A	Floor Tile VAT 12" x 12"	NAD	2620	SF	0	SF	White			
1	1	Cafeteria	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	3000	SF	10	SF				
1	1	Cafeteria	N/A	Sheetrock Ceiling	Non Suspect ACM	240	SF	0	SF				
1	1	Cafeteria	N/A	Metal Ceiling	Non Suspect ACM	3000	SF	0	SF				
1	1	Cafeteria	N/A	Concrete Block Wall	Non Suspect ACM	2952	SF	0	SF				
1	1	Cafeteria	N/A	Sheetrock Wall	Non Suspect ACM	2300	SF	0	SF				
1	1	Cafeteria	N/A	Floor Tile VAT 12" x 12"	NAD	6400	SF	0	SF	Blue			

7140 New Roberto Clemente/The LINC 2015 2016 AHERA Three-Year Report

		School District of Philadelphia New Roberto Clemente Middle School and The LINC High School 122 West Erie Avenue, Philadelphia, PA 19140 ULCS# 7140 Year Built: 1994	AHERA Three-Year Reinspection 2015-2016 Room by Room Location Log Report										Reinspection Date: 5/3/2016 through 5/6/2016	
													Building Inspector: Paul Davis	
													Number: 050368	
													Management Planner: Megan Vala	
													Number: 740728	
E l e m e n t	F l o o r	On Site Room Name	System Affected	Material Description	Confirmed/Assumed/NAD/ Non Suspect ACM	Amount of Material	SF LF EA	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic/ Crawl Space Ranking		
1	1	Hallway along Cafeteria from Boy's Restroom to end of Cafeteria	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	1172	SF	0	SF					
1	1	Hallway along Cafeteria from Boy's Restroom to end of Cafeteria	N/A	Concrete Block Wall	Non Suspect ACM	2300	SF	0	SF					
1	1	Hallway along Cafeteria from Boy's Restroom to end of Cafeteria	N/A	Floor Tile VAT 12" x 12"	NAD	1172	SF	0	SF	White				
1	1	Vestibule next to Loading Dock between Kitchen and Maintenance Area	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	100	SF	0	SF					
1	1	Vestibule next to Loading Dock between Kitchen and Maintenance Area	N/A	Concrete Block Wall	Non Suspect ACM	400	SF	0	SF					
1	1	Vestibule next to Loading Dock between Kitchen and Maintenance Area	N/A	Concrete Floor	Non Suspect ACM	100	SF	0	SF					
1	1	Kitchen Staff Men's Locker Room S50	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	108	SF	0	SF					
1	1	Kitchen Staff Men's Locker Room S50	N/A	Concrete Block Wall	Non Suspect ACM	378	SF	0	SF					
1	1	Kitchen Staff Men's Locker Room S50	N/A	Ceramic Tile Floors	Non Suspect ACM	108	SF	0	SF					
1	1	Kitchen Staff Women's Locker Room S51	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	120	SF	0	SF					
1	1	Kitchen Staff Women's Locker Room S51	N/A	Concrete Block Wall	Non Suspect ACM	400	SF	0	SF					
1	1	Kitchen Staff Women's Locker Room S51	N/A	Ceramic Tile Floors	Non Suspect ACM	120	SF	0	SF					
1	1	Dry Storage Pantry in Kitchen	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	332	SF	0	SF					
1	1	Dry Storage Pantry in Kitchen	N/A	Concrete Block Wall	Non Suspect ACM	650	SF	0	SF					
1	1	Dry Storage Pantry in Kitchen	N/A	Ceramic Tile Floors	Non Suspect ACM	332	SF	0	SF					
1	1	Custodial Closet in Kitchen	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	45	SF	0	SF					
1	1	Custodial Closet in Kitchen	N/A	Concrete Block Wall	Non Suspect ACM	252	SF	0	SF					
1	1	Custodial Closet in Kitchen	N/A	Ceramic Tile Floors	Non Suspect ACM	45	SF	0	SF					
1	1	Kitchen Office	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	100	SF	0	SF					
1	1	Kitchen Office	N/A	Concrete Block Wall	Non Suspect ACM	360	SF	0	SF					
1	1	Kitchen Office	N/A	Ceramic Tile Floors	Non Suspect ACM	100	SF	0	SF					
1	1	Kitchen Office Closet	N/A	X	X	X	X	X	X		No Access; Not Inspected			
1	1	Kitchen	N/A	Fiberglass Pipe Insulation	Non Suspect ACM	40	LF	0	LF					
1	1	Kitchen	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	1500	SF	0	SF					
1	1	Kitchen	N/A	Sheetrock Ceiling	Non Suspect ACM	56	SF	1	SF					
1	1	Kitchen	N/A	Concrete Block Wall	Non Suspect ACM	1700	SF	0	SF					
1	1	Kitchen	N/A	Ceramic Tile Floors	Non Suspect ACM	1550	SF	0	SF					
1	1	Staff Dining Room	N/A	Fiberglass Pipe Insulation	Non Suspect ACM	70	LF	0	LF					
1	1	Staff Dining Room	N/A	Fiberglass Pipe Fitting Insulation	Non Suspect ACM	9	EA	0	EA					
1	1	Staff Dining Room	N/A	Metal Ceiling	Non Suspect ACM	621	SF	0	SF					
1	1	Staff Dining Room	N/A	Concrete Block Wall	Non Suspect ACM	2500	SF	0	SF					
1	1	Staff Dining Room	N/A	Floor Tile VAT 12" x 12"	NAD	621	SF	0	SF	Blue				
1	1	Maintenance Equipment Garage	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	294	SF	0	SF					
1	1	Maintenance Equipment Garage	N/A	Concrete Block Wall	Non Suspect ACM	1260	SF	0	SF					
1	1	Maintenance Equipment Garage	N/A	Concrete Floor	Non Suspect ACM	294	SF	0	SF					
1	1	Boy's Restroom next to Cafeteria	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	120	SF	0	SF		Pipe Chase between Boy's and Girl's Restrooms			
1	1	Boy's Restroom next to Cafeteria	N/A	Concrete Block Wall	Non Suspect ACM	350	SF	0	SF		Pipe Chase between Boy's and Girl's Restrooms			
1	1	Boy's Restroom next to Cafeteria	N/A	Ceramic Tile Floors	Non Suspect ACM	120	SF	0	SF		Pipe Chase between Boy's and Girl's Restrooms			
1	1	Girl's Restroom next to Cafeteria	N/A	Fiberglass Ceiling Tile 2' x 4'	Non Suspect ACM	104	SF	0	SF		Pipe Chase between Boy's and Girl's Restrooms			
1	1	Girl's Restroom next to Cafeteria	N/A	Concrete Block Wall	Non Suspect ACM	336	SF	0	SF					
1	1	Girl's Restroom next to Cafeteria	N/A	Ceramic Tile Floors	Non Suspect ACM	104	SF	0	SF					
1	1	Gymnasium	N/A	Fiberglass Pipe Insulation	Non Suspect ACM	300	LF	0	LF		The LINC HS also Uses this			
1	1	Gymnasium	N/A	Fiberglass Pipe Fitting Insulation	Non Suspect ACM	20	EA	0	EA		The LINC HS also Uses this			
1	1	Gymnasium	N/A	Metal Ceiling	Non Suspect ACM	7770	SF	0	SF		The LINC HS also Uses this			
1	1	Gymnasium	N/A	Concrete Block Wall	Non Suspect ACM	10860	SF	0	SF		The LINC HS also Uses this			
1	1	Gymnasium	N/A	Concrete Floor	Non Suspect ACM	7770	SF	0	SF		The LINC HS also Uses this			
1	1	Gymnasium Storage Room (Cafeteria Side)	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	192	SF	0	SF		The LINC HS also Uses this			
1	1	Gymnasium Storage Room (Cafeteria Side)	N/A	Concrete Block Wall	Non Suspect ACM	768	SF	0	SF		The LINC HS also Uses this			
1	1	Gymnasium Storage Room (Cafeteria Side)	N/A	Concrete Floor	Non Suspect ACM	192	SF	0	SF		The LINC HS also Uses this			
1	1	Boy's Locker Room Restroom Area	N/A	Sheetrock Ceiling	Non Suspect ACM	285	SF	0	SF		The LINC HS also Uses this			
1	1	Boy's Locker Room Restroom Area	N/A	Concrete Block Wall	Non Suspect ACM	530	SF	0	SF		The LINC HS also Uses this			
1	1	Boy's Locker Room Restroom Area	N/A	Ceramic Tile Floors	Non Suspect ACM	285	SF	0	SF		The LINC HS also Uses this			
1	1	Boy's Locker Room in Gymnasium	N/A	Sheetrock Ceiling	Non Suspect ACM	434	SF	0	SF		The LINC HS also Uses this			
1	1	Boy's Locker Room in Gymnasium	N/A	Concrete Block Wall	Non Suspect ACM	900	SF	0	SF		The LINC HS also Uses this			
1	1	Boy's Locker Room in Gymnasium	N/A	Concrete Floor	Non Suspect ACM	434	SF	0	SF		The LINC HS also Uses this			
1	1	Gymnasium Storage Room between Boy's Locker Room and Gym Office	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	128	SF	0	SF		The LINC HS also Uses this			
1	1	Gymnasium Storage Room between Boy's Locker Room and Gym Office	N/A	Concrete Block Wall	Non Suspect ACM	360	SF	0	SF		The LINC HS also Uses this			
1	1	Gymnasium Storage Room between Boy's Locker Room and Gym Office	N/A	Concrete Floor	Non Suspect ACM	128	SF	0	SF		The LINC HS also Uses this			
1	1	Gymnasium Office	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	332	SF	0	SF		The LINC HS also Uses this			

7140 New Roberto Clemente/The LINC 2015 2016 AHERA Three-Year Report

		School District of Philadelphia New Roberto Clemente Middle School and The LINC High School 122 West Erie Avenue, Philadelphia, PA 19140 ULCS# 7140 Year Built: 1994	AHERA Three-Year Reinspection 2015-2016 Room by Room Location Log Report								Reinspection Date: 5/3/2016 through 5/6/2016			
											Building Inspector: Paul Davis			
											Number: 050368			
											Management Planner: Megan Vala			
											Number: 740728			
E l e m e n t	F l o o r	On Site Room Name	System Affected	Material Description	Confirmed/Assumed/NAD/ Non Suspect ACM	Amount of Material	SF LF EA	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic/ Crawl Space Ranking		
1	1	Gymnasium Office	N/A	Concrete Block Wall	Non Suspect ACM	775	SF	0	SF		The LINC HS also Uses this			
1	1	Gymnasium Office	N/A	Floor Tile VAT 12" x 12"	NAD	332	SF	0	SF	White	The LINC HS also Uses this			
1	1	Gymnasium Office Restroom	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	30	SF	0	SF		The LINC HS also Uses this			
1	1	Gymnasium Office Restroom	N/A	Concrete Block Wall	Non Suspect ACM	176	SF	0	SF		The LINC HS also Uses this			
1	1	Gymnasium Office Restroom	N/A	Floor Tile VAT 12" x 12"	NAD	30	SF	0	SF	White	The LINC HS also Uses this			
1	1	Gymnasium Office Locker Room	N/A	Fiberglass Pipe Insulation	Non Suspect ACM	8	LF	0	LF		Pipe Chase Access in Room. The LINC HS also uses this.			
1	1	Gymnasium Office Locker Room	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	88	SF	0	SF		Pipe Chase Access in Room. The LINC HS also uses this.			
1	1	Gymnasium Office Locker Room	N/A	Concrete Block Wall	Non Suspect ACM	342	SF	0	SF		Pipe Chase Access in Room. The LINC HS also uses this.			
1	1	Gymnasium Office Locker Room	N/A	Floor Tile VAT 12" x 12"	NAD	88	SF	0	SF	White	Pipe Chase Access in Room. The LINC HS also uses this.			
1	1	Gymnasium Office Storage Room	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	60	SF	0	SF		The LINC HS also Uses this			
1	1	Gymnasium Office Storage Room	N/A	Concrete Block Wall	Non Suspect ACM	306	SF	0	SF		The LINC HS also Uses this			
1	1	Gymnasium Office Storage Room	N/A	Concrete Floor	Non Suspect ACM	60	SF	0	SF		The LINC HS also Uses this			
1	1	Girl's Locker Room in Gymnasium	N/A	Sheetrock Ceiling	Non Suspect ACM	322	SF	0	SF		The LINC HS also Uses this			
1	1	Girl's Locker Room in Gymnasium	N/A	Concrete Block Wall	Non Suspect ACM	740	SF	0	SF		The LINC HS also Uses this			
1	1	Girl's Locker Room in Gymnasium	N/A	Concrete Floor	Non Suspect ACM	322	SF	0	SF		The LINC HS also Uses this			
1	1	Girl's Locker Room Restroom Area	N/A	Sheetrock Ceiling	Non Suspect ACM	230	SF	0	SF		The LINC HS also Uses this			
1	1	Girl's Locker Room Restroom Area	N/A	Concrete Block Wall	Non Suspect ACM	560	SF	0	SF		The LINC HS also Uses this			
1	1	Girl's Locker Room Restroom Area	N/A	Ceramic Tile Floors	Non Suspect ACM	230	SF	0	SF		The LINC HS also Uses this			
1	1	Hallway along Gymnasium	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	1630	SF	0	SF		The LINC HS also Uses this			
1	1	Hallway along Gymnasium	N/A	Sheetrock Ceiling	Non Suspect ACM	36	SF	0	SF		The LINC HS also Uses this			
1	1	Hallway along Gymnasium	N/A	Concrete Block Wall	Non Suspect ACM	2660	SF	0	SF		The LINC HS also Uses this			
1	1	Hallway along Gymnasium	N/A	Floor Tile VAT 12" x 12"	NAD	1666	SF	0	SF	Grey	The LINC HS also Uses this			
1	1	Hallway from Storage Room next to Gymnasium to Boy's Restroom	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	304	SF	0	SF		The LINC HS			
1	1	Hallway from Storage Room next to Gymnasium to Boy's Restroom	N/A	Concrete Block Wall	Non Suspect ACM	684	SF	0	SF		The LINC HS			
1	1	Hallway from Storage Room next to Gymnasium to Boy's Restroom	N/A	Floor Tile VAT 12" x 12"	NAD	304	SF	0	SF	White	The LINC HS			
1	1	Storage Room in Hallway between Gymnasium and Girl's Restroom	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	27	SF	0	SF		The LINC HS			
1	1	Storage Room in Hallway between Gymnasium and Girl's Restroom	N/A	Concrete Block Wall	Non Suspect ACM	216	SF	0	SF		The LINC HS			
1	1	Storage Room in Hallway between Gymnasium and Girl's Restroom	N/A	Floor Tile VAT 12" x 12"	NAD	27	SF	0	SF	White	The LINC HS			
1	1	Girl's Restroom between Storage Room and Boy's Restroom	N/A	Fiberglass Ceiling Tile 2' x 4'	Non Suspect ACM	208	SF	0	SF		Access to Pipe Chase located between Girl's and Boy's Restrooms in Hallway. The LINC HS			
1	1	Girl's Restroom between Storage Room and Boy's Restroom	N/A	Concrete Block Wall	Non Suspect ACM	522	SF	0	SF		Access to Pipe Chase located between Girl's and Boy's Restrooms in Hallway. The LINC HS			
1	1	Girl's Restroom between Storage Room and Boy's Restroom	N/A	Ceramic Tile Floors	Non Suspect ACM	208	SF	0	SF		Access to Pipe Chase located between Girl's and Boy's Restrooms in Hallway. The LINC HS			
1	1	Boy's Restroom located near Classroom S09	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	180	SF	0	SF		Access to Pipe Chase located between Girl's and Boy's Restrooms in Hallway. The LINC HS			
1	1	Boy's Restroom located near Classroom S09	N/A	Concrete Block Wall	Non Suspect ACM	486	SF	0	SF		Access to Pipe Chase located between Girl's and Boy's Restrooms in Hallway. The LINC HS			
1	1	Boy's Restroom located near Classroom S09	N/A	Ceramic Tile Floors	Non Suspect ACM	180	SF	0	SF		Access to Pipe Chase located between Girl's and Boy's Restrooms in Hallway. The LINC HS			
1	1	Custodial Closet near Classroom S09	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	56	SF	0	SF		Access to Pipe Chase in Room. The LINC HS			
1	1	Custodial Closet near Classroom S09	N/A	Concrete Block Wall	Non Suspect ACM	270	SF	0	SF		Access to Pipe Chase in Room. The LINC HS			
1	1	Custodial Closet near Classroom S09	N/A	Concrete Floor	Non Suspect ACM	56	SF	0	SF		Access to Pipe Chase in Room. The LINC HS			
1	1	Fan Room across from Classroom S11	N/A	Fiberglass Pipe Insulation	Non Suspect ACM	60	LF	0	LF		The LINC HS			
1	1	Fan Room across from Classroom S11	N/A	Fiberglass Pipe Fitting Insulation	Non Suspect ACM	15	EA	0	EA		The LINC HS			
1	1	Fan Room across from Classroom S11	N/A	Metal Ceiling	Non Suspect ACM	195	SF	0	SF		The LINC HS			
1	1	Fan Room across from Classroom S11	N/A	Concrete Block Wall	Non Suspect ACM	728	SF	0	SF		The LINC HS			
1	1	Fan Room across from Classroom S11	N/A	Fireproofing	Non Suspect ACM	195	SF	0	SF	Grey	The LINC HS			
1	1	Fan Room across from Classroom S11	N/A	Vinyl Vibration Damper Cloth	Non Suspect ACM	8	SF	0	SF		The LINC HS			
1	1	Fan Room across from Classroom S11	N/A	Concrete Floor	Non Suspect ACM	195	SF	0	SF		The LINC HS			
1	1	Rear Vestibule near Classroom S12	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	64	SF	0	SF		The LINC HS			
1	1	Rear Vestibule near Classroom S12	N/A	Concrete Block Wall	Non Suspect ACM	144	SF	0	SF		The LINC HS			
1	1	Rear Vestibule near Classroom S12	N/A	Carpet	Non Suspect ACM	64	SF	0	SF		Carpeted Drainage Slats. The LINC HS			
1	1	Classroom S12	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	816	SF	0	SF		The LINC HS			
1	1	Classroom S12	N/A	Concrete Block Wall	Non Suspect ACM	1392	SF	0	SF		The LINC HS			
1	1	Classroom S12	N/A	Floor Tile VAT 12" x 12"	NAD	816	SF	0	SF	White	The LINC HS			
1	1	Classroom S12 Closet	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	6	SF	0	SF		The LINC HS			
1	1	Classroom S12 Closet	N/A	Concrete Block Wall	Non Suspect ACM	90	SF	0	SF		The LINC HS			
1	1	Classroom S12 Closet	N/A	Floor Tile VAT 12" x 12"	NAD	6	SF	0	SF	White	The LINC HS			
1	1	Classroom S11	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	816	SF	0	SF		The LINC HS			
1	1	Classroom S11	N/A	Concrete Block Wall	Non Suspect ACM	1392	SF	0	SF		The LINC HS			
1	1	Classroom S11	N/A	Floor Tile VAT 12" x 12"	NAD	816	SF	0	SF	White	The LINC HS			

7140 New Roberto Clemente/The LINC 2015 2016 AHERA Three-Year Report

		School District of Philadelphia New Roberto Clemente Middle School and The LINC High School 122 West Erie Avenue, Philadelphia, PA 19140 ULCS# 7140 Year Built: 1994	AHERA Three-Year Reinspection 2015-2016 Room by Room Location Log Report								Reinspection Date: 5/3/2016 through 5/6/2016	
											Building Inspector: Paul Davis	
											Number: 050368	
											Management Planner: Megan Vala	
											Number: 740728	
E l e m e n t	F l o o r	On Site Room Name	System Affected	Material Description	Confirmed/Assumed/NAD/ Non Suspect ACM	Amount of Material	SF LF EA	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic/ Crawl Space Ranking
1	1	Classroom S11 Closet	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	6	SF	0	SF		The LINC HS	
1	1	Classroom S11 Closet	N/A	Concrete Block Wall	Non Suspect ACM	90	SF	0	SF		The LINC HS	
1	1	Classroom S11 Closet	N/A	Floor Tile VAT 12" x 12"	NAD	6	SF	0	SF	White	The LINC HS	
1	1	Classroom S09	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	816	SF	0	SF		The LINC HS	
1	1	Classroom S09	N/A	Concrete Block Wall	Non Suspect ACM	1392	SF	0	SF		The LINC HS	
1	1	Classroom S09	N/A	Floor Tile VAT 12" x 12"	NAD	816	SF	0	SF	White	The LINC HS	
1	1	Classroom S09 Closet	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	6	SF	0	SF		The LINC HS	
1	1	Classroom S09 Closet	N/A	Concrete Block Wall	Non Suspect ACM	90	SF	0	SF		The LINC HS	
1	1	Classroom S09 Closet	N/A	Floor Tile VAT 12" x 12"	NAD	6	SF	0	SF	White	The LINC HS	
1	1	Fitness/Weight Room S10	N/A	Fiberglass Pipe Insulation	Non Suspect ACM	130	LF	0	LF		The LINC HS	
1	1	Fitness/Weight Room S10	N/A	Fiberglass Pipe Fitting Insulation	Non Suspect ACM	13	EA	0	EA		The LINC HS	
1	1	Fitness/Weight Room S10	N/A	Metal Ceiling	Non Suspect ACM	864	SF	0	SF		The LINC HS	
1	1	Fitness/Weight Room S10	N/A	Concrete Block Wall	Non Suspect ACM	2160	SF	0	SF		The LINC HS	
1	1	Fitness/Weight Room S10	N/A	Rubber Floor Mats	Non Suspect ACM	864	SF	0	SF		The LINC HS	
1	1	Fitness/Weight Room S10 - Left Side Closet	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	27	SF	0	SF		The LINC HS	
1	1	Fitness/Weight Room S10 - Left Side Closet	N/A	Concrete Block Wall	Non Suspect ACM	150	SF	0	SF		The LINC HS	
1	1	Fitness/Weight Room S10 - Left Side Closet	N/A	Floor Tile VAT 12" x 12"	NAD	27	SF	0	SF	White	The LINC HS	
1	1	Fitness/Weight Room S10 - Closet next to Entrance	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	24	SF	0	SF		The LINC HS	
1	1	Fitness/Weight Room S10 - Closet next to Entrance	N/A	Concrete Block Wall	Non Suspect ACM	126	SF	0	SF		The LINC HS	
1	1	Fitness/Weight Room S10 - Closet next to Entrance	N/A	Floor Tile VAT 12" x 12"	NAD	24	SF	0	SF	White	The LINC HS	
1	1	Classroom S08	N/A	Fiberglass Pipe Insulation	Non Suspect ACM	130	LF	0	LF		The LINC HS	
1	1	Classroom S08	N/A	Fiberglass Pipe Fitting Insulation	Non Suspect ACM	13	EA	0	EA		The LINC HS	
1	1	Classroom S08	N/A	Metal Ceiling	Non Suspect ACM	864	SF	0	SF		The LINC HS	
1	1	Classroom S08	N/A	Concrete Block Wall	Non Suspect ACM	2160	SF	1	SF		The LINC HS	
1	1	Classroom S08	N/A	Sink Undercoat Mastic	Non Suspect ACM	7	SF	1	SF	Grey	The LINC HS	
1	1	Classroom S08	N/A	Floor Tile VAT 12" x 12"	NAD	864	SF	0	SF	White	The LINC HS	
1	1	Classroom S08 - Right Side Closet	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	27	SF	0	SF		The LINC HS	
1	1	Classroom S08 - Right Side Closet	N/A	Concrete Block Wall	Non Suspect ACM	135	SF	0	SF		The LINC HS	
1	1	Classroom S08 - Right Side Closet	N/A	Floor Tile VAT 12" x 12"	NAD	27	SF	0	SF	White	The LINC HS	
1	1	Classroom S08 - Closet next to Entrance	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	24	SF	0	SF		The LINC HS	
1	1	Classroom S08 - Closet next to Entrance	N/A	Concrete Block Wall	Non Suspect ACM	140	SF	0	SF		The LINC HS	
1	1	Classroom S08 - Closet next to Entrance	N/A	Floor Tile VAT 12" x 12"	NAD	24	SF	0	SF	White	The LINC HS	
1	1	Classroom S07 - Art	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	1482	SF	0	SF		The LINC HS	
1	1	Classroom S07 - Art	N/A	Concrete Block Wall	Non Suspect ACM	1850	SF	0	SF		The LINC HS	
1	1	Classroom S07 - Art	N/A	Floor Tile VAT 12" x 12"	NAD	1482	SF	0	SF	Grey	The LINC HS	
1	1	Classroom S07 - Art - Storage Room near Entrance	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	126	SF	0	SF		The LINC HS	
1	1	Classroom S07 - Art - Storage Room near Entrance	N/A	Concrete Block Wall	Non Suspect ACM	460	SF	0	SF		The LINC HS	
1	1	Classroom S07 - Art - Storage Room near Entrance	N/A	Floor Tile VAT 12" x 12"	NAD	126	SF	0	SF	White	The LINC HS	
1	1	Main Office for The LINC High School Area	N/A	Fiberglass Pipe Insulation	Non Suspect ACM	130	LF	0	LF		The LINC HS	
1	1	Main Office for The LINC High School Area	N/A	Fiberglass Pipe Fitting Insulation	Non Suspect ACM	13	EA	0	EA		The LINC HS	
1	1	Main Office for The LINC High School Area	N/A	Metal Ceiling	Non Suspect ACM	864	SF	0	SF		The LINC HS	
1	1	Main Office for The LINC High School Area	N/A	Concrete Block Wall	Non Suspect ACM	2160	SF	0	SF		The LINC HS	
1	1	Main Office for The LINC High School Area	N/A	Floor Tile VAT 12" x 12"	NAD	864	SF	0	SF	White	The LINC HS	
1	1	Main Office for The LINC HS - Left Side Closet	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	27	SF	0	SF		The LINC HS	
1	1	Main Office for The LINC HS - Left Side Closet	N/A	Concrete Block Wall	Non Suspect ACM	135	SF	0	SF		The LINC HS	
1	1	Main Office for The LINC HS - Left Side Closet	N/A	Floor Tile VAT 12" x 12"	NAD	27	SF	0	SF	White	The LINC HS	
1	1	Main Office for The LINC HS - Closet next to Entrance	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	24	SF	0	SF		The LINC HS	
1	1	Main Office for The LINC HS - Closet next to Entrance	N/A	Concrete Block Wall	Non Suspect ACM	126	SF	0	SF		The LINC HS	
1	1	Main Office for The LINC HS - Closet next to Entrance	N/A	Floor Tile VAT 12" x 12"	NAD	24	SF	0	SF	White	The LINC HS	
1	1	Classroom S05	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	1482	SF	0	SF		The LINC HS	
1	1	Classroom S05	N/A	Concrete Block Wall	Non Suspect ACM	1850	SF	0	SF		The LINC HS	
1	1	Classroom S05	N/A	Floor Tile VAT 12" x 12"	NAD	1482	SF	0	SF	Grey	The LINC HS	
1	1	Classroom S05 Storage Closet	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	150	SF	0	SF		The LINC HS	
1	1	Classroom S05 Storage Closet	N/A	Concrete Block Wall	Non Suspect ACM	500	SF	0	SF		The LINC HS	
1	1	Classroom S05 Storage Closet	N/A	Floor Tile VAT 12" x 12"	NAD	150	SF	0	SF	White	The LINC HS	
1	1	Shop Room between Classrooms S05 and S07	N/A	Fiberglass Pipe Insulation	Non Suspect ACM	48	LF	0	LF		The LINC HS	
1	1	Shop Room between Classrooms S05 and S07	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	460	SF	0	SF		The LINC HS	
1	1	Shop Room between Classrooms S05 and S07	N/A	Concrete Block Wall	Non Suspect ACM	1032	SF	0	SF		The LINC HS	
1	1	Shop Room between Classrooms S05 and S07	N/A	Sink Undercoat Mastic	Non Suspect ACM	7	SF	0	SF	Grey	The LINC HS	
1	1	Shop Room between Classrooms S05 and S07	N/A	Floor Tile VAT 12" x 12"	NAD	460	SF	0	SF	White	The LINC HS	
1	1	Teacher Lounge S04	N/A	Fiberglass Pipe Insulation	Non Suspect ACM	160	LF	0	LF		The LINC HS	
1	1	Teacher Lounge S04	N/A	Fiberglass Pipe Fitting Insulation	Non Suspect ACM	18	EA	0	EA		The LINC HS	
1	1	Teacher Lounge S04	N/A	Metal Ceiling	Non Suspect ACM	864	SF	0	SF		The LINC HS	
1	1	Teacher Lounge S04	N/A	Concrete Block Wall	Non Suspect ACM	2160	SF	0	SF		The LINC HS	
1	1	Teacher Lounge S04	N/A	Sink Undercoat Mastic	Non Suspect ACM	14	SF	0	SF	Grey	The LINC HS	
1	1	Teacher Lounge S04	N/A	Floor Tile VAT 12" x 12"	NAD	864	SF	0	SF	White	The LINC HS	
1	1	Klin Room adjacent to Teacher Lounge S04	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	72	SF	0	SF		The LINC HS	

7140 New Roberto Clemente/The LINC 2015 2016 AHERA Three-Year Report

		School District of Philadelphia New Roberto Clemente Middle School and The LINC High School 122 West Erie Avenue, Philadelphia, PA 19140 ULCS# 7140 Year Built: 1994	AHERA Three-Year Reinspection 2015-2016 Room by Room Location Log Report							Reinspection Date: 5/3/2016 through 5/6/2016			
										Building Inspector: Paul Davis			
										Number: 050368			
										Management Planner: Megan Vala			
										Number: 740728			
E l e m e n t	F l o o r	On Site Room Name	System Affected	Material Description	Confirmed/Assumed/NAD/ Non Suspect ACM	Amount of Material	SF LF EA	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic/ Crawl Space Ranking	
1	1	Kiln Room adjacent to Teacher Lounge S04	N/A	Concrete Block Wall	Non Suspect ACM	300	SF	0	SF		The LINC HS		
1	1	Kiln Room adjacent to Teacher Lounge S04	N/A	Floor Tile VAT 12" x 12"	NAD	72	SF	0	SF	White	The LINC HS		
1	1	Teacher Lounge S04 - Right Side Closet	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	27	SF	0	SF		The LINC HS		
1	1	Teacher Lounge S04 - Right Side Closet	N/A	Concrete Block Wall	Non Suspect ACM	135	SF	0	SF		The LINC HS		
1	1	Teacher Lounge S04 - Right Side Closet	N/A	Floor Tile VAT 12" x 12"	NAD	27	SF	0	SF	White	The LINC HS		
1	1	Teacher Lounge S04 - Closet next to Entrance	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	24	SF	0	SF		The LINC HS		
1	1	Teacher Lounge S04 - Closet next to Entrance	N/A	Concrete Block Wall	Non Suspect ACM	126	SF	0	SF		The LINC HS		
1	1	Teacher Lounge S04 - Closet next to Entrance	N/A	Floor Tile VAT 12" x 12"	NAD	24	SF	0	SF	White	The LINC HS		
1	1	Music Practice Room S02 Entrance Area	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	60	SF	0	SF		The LINC HS		
1	1	Music Practice Room S02 Entrance Area	N/A	Concrete Block Wall	Non Suspect ACM	200	SF	0	SF		The LINC HS		
1	1	Music Practice Room S02 Entrance Area	N/A	Floor Tile VAT 12" x 12"	NAD	60	SF	0	SF	White	The LINC HS		
1	1	Music Practice Room First Office on Left	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	77	SF	0	SF		The LINC HS		
1	1	Music Practice Room First Office on Left	N/A	Concrete Block Wall	Non Suspect ACM	324	SF	0	SF		The LINC HS		
1	1	Music Practice Room First Office on Left	N/A	Floor Tile VAT 12" x 12"	NAD	77	SF	0	SF	White	The LINC HS		
1	1	Copy Room in Music Practice Suite - Second Room on Left	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	88	SF	0	SF		Pipe Chase Acces in this Room. The LINC HS		
1	1	Copy Room in Music Practice Suite - Second Room on Left	N/A	Concrete Block Wall	Non Suspect ACM	342	SF	0	SF		Pipe Chase Acces in this Room. The LINC HS		
1	1	Copy Room in Music Practice Suite - Second Room on Left	N/A	Floor Tile VAT 12" x 12"	NAD	88	SF	0	SF	White	Pipe Chase Acces in this Room. The LINC HS		
1	1	Music Practice Room Office at End	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	48	SF	0	SF		The LINC HS		
1	1	Music Practice Room Office at End	N/A	Concrete Block Wall	Non Suspect ACM	250	SF	0	SF		The LINC HS		
1	1	Music Practice Room Office at End	N/A	Floor Tile VAT 12" x 12"	NAD	48	SF	0	SF	White	The LINC HS		
1	1	The LINC Principal's Office S03	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	700	SF	0	SF		The LINC HS		
1	1	The LINC Principal's Office S03	N/A	Concrete Block Wall	Non Suspect ACM	1320	SF	0	SF		The LINC HS		
1	1	The LINC Principal's Office S03	N/A	Floor Tile VAT 12" x 12"	NAD	700	SF	1	SF	White	The LINC HS		
1	1	The LINC Principal's Office S03 - Left Side Closet	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	24	SF	0	SF		The LINC HS		
1	1	The LINC Principal's Office S03 - Left Side Closet	N/A	Concrete Block Wall	Non Suspect ACM	126	SF	0	SF		The LINC HS		
1	1	The LINC Principal's Office S03 - Left Side Closet	N/A	Floor Tile VAT 12" x 12"	NAD	24	SF	0	SF	White	The LINC HS		
1	1	The LINC Principal's Office S03 - Closet next to Entrance	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	24	SF	0	SF		The LINC HS		
1	1	The LINC Principal's Office S03 - Closet next to Entrance	N/A	Concrete Block Wall	Non Suspect ACM	126	SF	0	SF		The LINC HS		
1	1	The LINC Principal's Office S03 - Closet next to Entrance	N/A	Floor Tile VAT 12" x 12"	NAD	24	SF	0	SF	White	The LINC HS		
1	1	Music Room S01	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	850	SF	0	SF		The LINC HS		
1	1	Music Room S01	N/A	Concrete Block Wall	Non Suspect ACM	1416	SF	0	SF		The LINC HS		
1	1	Music Room S01	N/A	Floor Tile VAT 12" x 12"	NAD	850	SF	0	SF	White	The LINC HS		
1	1	Music Room S01 Storage Room in Rear	N/A	X	X	X	X	X	X	X	No Access; Not Inspected. The LINC HS		
1	1	Music Room Storage Room S01 on Rear Left Side	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	32	SF	0	SF		The LINC HS		
1	1	Music Room Storage Room S01 on Rear Left Side	N/A	Concrete Block Wall	Non Suspect ACM	216	SF	0	SF		The LINC HS		
1	1	Music Room Storage Room S01 on Rear Left Side	N/A	Floor Tile VAT 12" x 12"	NAD	32	SF	0	SF	White	The LINC HS		
1	1	Hallway from Music Room S01 to Classroom S12	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	1895	SF	0	SF		The LINC HS		
1	1	Hallway from Music Room S01 to Classroom S12	N/A	Concrete Block Wall	Non Suspect ACM	3500	SF	0	SF		The LINC HS		
1	1	Hallway from Music Room S01 to Classroom S12	N/A	Floor Tile VAT 12" x 12"	NAD	1895	SF	0	SF	White	The LINC HS		
1	1	LINC High School Entrance Lobby	N/A	Fiberglass Pipe Insulation	Non Suspect ACM	30	LF	0	LF		The LINC HS		
1	1	LINC High School Entrance Lobby	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	288	SF	0	SF		The LINC HS		
1	1	LINC High School Entrance Lobby	N/A	Metal Ceiling	Non Suspect ACM	1310	SF	0	SF		The LINC HS		
1	1	LINC High School Entrance Lobby	N/A	Concrete Block Wall	Non Suspect ACM	2400	SF	0	SF		The LINC HS		
1	1	LINC High School Entrance Lobby	N/A	Ceramic Tile Walls	Non Suspect ACM	1260	SF	0	SF		The LINC HS		
1	1	LINC High School Entrance Lobby	N/A	Sheetrock Wall	Non Suspect ACM	560	SF	0	SF		The LINC HS		
1	1	LINC High School Entrance Lobby	N/A	Floor Tile VAT 12" x 12"	NAD	1600	SF	0	SF	Blue	The LINC HS		
1	1	Staff Men's Restroom in LINC HS Lobby	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	120	SF	0	SF		The LINC HS		
1	1	Staff Men's Restroom in LINC HS Lobby	N/A	Concrete Block Wall	Non Suspect ACM	400	SF	0	SF		The LINC HS		
1	1	Staff Men's Restroom in LINC HS Lobby	N/A	Ceramic Tile Floors	Non Suspect ACM	120	SF	0	SF		The LINC HS		
1	1	Staff Women's Restroom in LINC HS Lobby	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	130	SF	0	SF		The LINC HS		
1	1	Staff Women's Restroom in LINC HS Lobby	N/A	Concrete Block Wall	Non Suspect ACM	420	SF	0	SF		The LINC HS		
1	1	Staff Women's Restroom in LINC HS Lobby	N/A	Ceramic Tile Floors	Non Suspect ACM	130	SF	0	SF		The LINC HS		
1	1	Auditorium	N/A	Metal Ceiling	Non Suspect ACM	5400	SF	0	SF		The LINC HS		
1	1	Auditorium	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	640	SF	0	SF		Suspended (floating) from Ceiling. The LINC HS		
1	1	Auditorium	N/A	Concrete Block Wall	Non Suspect ACM	6200	SF	0	SF		The LINC HS		
1	1	Auditorium	N/A	Concrete Floor	Non Suspect ACM	2124	SF	0	SF		The LINC HS		
1	1	Auditorium	N/A	Floor Tile VAT 12" x 12"	NAD	3276	SF	0	SF	Blue	The LINC HS		
1	1	Auditorium Stage	N/A	Fiberglass Pipe Insulation	Non Suspect ACM	30	LF	0	LF		The LINC HS		
1	1	Auditorium Stage	N/A	Fiberglass Pipe Fitting Insulation	Non Suspect ACM	6	EA	0	EA		The LINC HS		
1	1	Auditorium Stage	N/A	Metal Ceiling	Non Suspect ACM	1800	SF	0	SF		The LINC HS		
1	1	Auditorium Stage	N/A	Concrete Block Wall	Non Suspect ACM	3000	SF	0	SF		The LINC HS		
1	1	Auditorium Stage	N/A	Floor Tile VAT 12" x 12"	NAD	1800	SF	0	SF	White	The LINC HS		
1	1	Stage Storage Room	N/A	Fiberglass Pipe Insulation	Non Suspect ACM	18	LF	0	LF		The LINC HS		
1	1	Stage Storage Room	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	154	SF	0	SF		The LINC HS		
1	1	Stage Storage Room	N/A	Concrete Block Wall	Non Suspect ACM	350	SF	0	SF		The LINC HS		
1	1	Stage Storage Room	N/A	Concrete Floor	Non Suspect ACM	154	SF	0	SF		The LINC HS		
1	2	Second Floor Connection Hallway between School Buildings	N/A	Metal Ceiling	Non Suspect ACM	561	SF	0	SF		The LINC HS		

7140 New Roberto Clemente/The LINC 2015 2016 AHERA Three-Year Report

		School District of Philadelphia New Roberto Clemente Middle School and The LINC High School 122 West Erie Avenue, Philadelphia, PA 19140 ULCS# 7140 Year Built: 1994	AHERA Three-Year Reinspection 2015-2016 Room by Room Location Log Report								Reinspection Date: 5/3/2016 through 5/6/2016	
											Building Inspector: Paul Davis	
											Number: 050368	
											Management Planner: Megan Vala	
											Number: 740728	
E l e m e n t	F l o o r	On Site Room Name	System Affected	Material Description	Confirmed/Assumed/NAD/ Non Suspect ACM	Amount of Material	SF LF EA	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic/ Crawl Space Ranking
1	2	Second Floor Connection Hallway between School Buildings	N/A	Concrete Block Wall	Non Suspect ACM	150	SF	0	SF		The LINC HS	
1	2	Second Floor Connection Hallway between School Buildings	N/A	Ceramic Tile Walls	Non Suspect ACM	150	SF	0	SF		The LINC HS	
1	2	Second Floor Connection Hallway between School Buildings	N/A	Floor Tile VAT 12" x 12"	NAD	561	SF	0	SF	White	The LINC HS	
1	2	Stairwell 4 on Second Floor	N/A	Fiberglass Pipe Insulation	Non Suspect ACM	30	LF	0	LF			
1	2	Stairwell 4 on Second Floor	N/A	Fiberglass Pipe Fitting Insulation	Non Suspect ACM	4	EA	0	EA			
1	2	Stairwell 4 on Second Floor	N/A	Concrete Ceiling	Non Suspect ACM	560	SF	0	SF			
1	2	Stairwell 4 on Second Floor	N/A	Concrete Block Wall	Non Suspect ACM	2040	SF	0	SF			
1	2	Stairwell 4 on Second Floor	N/A	Concrete Floor	Non Suspect ACM	192	SF	0	SF			
1	2	Stairwell 4 on Second Floor	N/A	Floor Tile VAT 12" x 12"	NAD	321	SF	0	SF	Grey		
1	2	Classroom 227	N/A	Fiberglass Pipe Insulation	Non Suspect ACM	44	LF	0	LF			
1	2	Classroom 227	N/A	Fiberglass Pipe Fitting Insulation	Non Suspect ACM	4	EA	0	EA			
1	2	Classroom 227	N/A	Sprayed-on Fluffy Ceiling Surface	Non Suspect ACM	816	SF	0	SF			
1	2	Classroom 227	N/A	Concrete Block Wall	Non Suspect ACM	1392	SF	0	SF			
1	2	Classroom 227	N/A	Floor Tile VAT 12" x 12"	NAD	816	SF	0	SF	White		
1	2	Classroom 227 Closet	N/A	Concrete Ceiling	Non Suspect ACM	6	SF	0	SF			
1	2	Classroom 227 Closet	N/A	Concrete Block Wall	Non Suspect ACM	120	SF	0	SF			
1	2	Classroom 227 Closet	N/A	Floor Tile VAT 12" x 12"	NAD	6	SF	0	SF	White		
1	2	Classroom 228	N/A	Fiberglass Pipe Insulation	Non Suspect ACM	40	LF	0	LF			
1	2	Classroom 228	N/A	Fiberglass Pipe Fitting Insulation	Non Suspect ACM	7	EA	0	EA			
1	2	Classroom 228	N/A	Sprayed-on Fluffy Ceiling Surface	Non Suspect ACM	816	SF	0	SF			
1	2	Classroom 228	N/A	Concrete Block Wall	Non Suspect ACM	1392	SF	0	SF			
1	2	Classroom 228	N/A	Floor Tile VAT 12" x 12"	NAD	816	SF	0	SF	White		
1	2	Classroom 228 Closet	N/A	Concrete Ceiling	Non Suspect ACM	6	SF	0	SF			
1	2	Classroom 228 Closet	N/A	Concrete Block Wall	Non Suspect ACM	120	SF	0	SF			
1	2	Classroom 228 Closet	N/A	Floor Tile VAT 12" x 12"	NAD	6	SF	0	SF	White		
1	2	Classroom 225	N/A	Fiberglass Pipe Insulation	Non Suspect ACM	52	LF	0	LF			
1	2	Classroom 225	N/A	Fiberglass Pipe Fitting Insulation	Non Suspect ACM	4	EA	0	EA			
1	2	Classroom 225	N/A	Sprayed-on Fluffy Ceiling Surface	Non Suspect ACM	816	SF	0	SF			
1	2	Classroom 225	N/A	Concrete Block Wall	Non Suspect ACM	1392	SF	0	SF			
1	2	Classroom 225	N/A	Floor Tile VAT 12" x 12"	NAD	816	SF	0	SF	White		
1	2	Classroom 225 Closet	N/A	Concrete Ceiling	Non Suspect ACM	6	SF	0	SF			
1	2	Classroom 225 Closet	N/A	Concrete Block Wall	Non Suspect ACM	120	SF	0	SF			
1	2	Classroom 225 Closet	N/A	Floor Tile VAT 12" x 12"	NAD	6	SF	0	SF	White		
1	2	Classroom 226	N/A	Fiberglass Pipe Insulation	Non Suspect ACM	52	LF	0	LF			
1	2	Classroom 226	N/A	Fiberglass Pipe Fitting Insulation	Non Suspect ACM	7	EA	0	EA			
1	2	Classroom 226	N/A	Sprayed-on Fluffy Ceiling Surface	Non Suspect ACM	816	SF	0	SF			
1	2	Classroom 226	N/A	Concrete Block Wall	Non Suspect ACM	1392	SF	0	SF			
1	2	Classroom 226	N/A	Floor Tile VAT 12" x 12"	NAD	816	SF	0	SF	White		
1	2	Classroom 226 Closet	N/A	Concrete Ceiling	Non Suspect ACM	6	SF	0	SF			
1	2	Classroom 226 Closet	N/A	Concrete Block Wall	Non Suspect ACM	120	SF	0	SF			
1	2	Classroom 226 Closet	N/A	Floor Tile VAT 12" x 12"	NAD	6	SF	0	SF	White		
1	2	Classroom 223	N/A	Fiberglass Pipe Insulation	Non Suspect ACM	52	LF	0	LF			
1	2	Classroom 223	N/A	Fiberglass Pipe Fitting Insulation	Non Suspect ACM	7	EA	0	EA			
1	2	Classroom 223	N/A	Sprayed-on Fluffy Ceiling Surface	Non Suspect ACM	816	SF	0	SF			
1	2	Classroom 223	N/A	Concrete Block Wall	Non Suspect ACM	1392	SF	0	SF			
1	2	Classroom 223	N/A	Floor Tile VAT 12" x 12"	NAD	816	SF	0	SF	White		
1	2	Classroom 223 Closet	N/A	Concrete Ceiling	Non Suspect ACM	6	SF	0	SF			
1	2	Classroom 223 Closet	N/A	Concrete Block Wall	Non Suspect ACM	120	SF	0	SF			
1	2	Classroom 223 Closet	N/A	Floor Tile VAT 12" x 12"	NAD	6	SF	0	SF	White		
1	2	Classroom 224	N/A	Fiberglass Pipe Insulation	Non Suspect ACM	52	LF	0	LF			
1	2	Classroom 224	N/A	Fiberglass Pipe Fitting Insulation	Non Suspect ACM	7	EA	0	EA			
1	2	Classroom 224	N/A	Sprayed-on Fluffy Ceiling Surface	Non Suspect ACM	816	SF	0	SF			
1	2	Classroom 224	N/A	Concrete Block Wall	Non Suspect ACM	1392	SF	0	SF			
1	2	Classroom 224	N/A	Floor Tile VAT 12" x 12"	NAD	816	SF	0	SF	White		
1	2	Classroom 224 Closet	N/A	Concrete Ceiling	Non Suspect ACM	6	SF	0	SF			
1	2	Classroom 224 Closet	N/A	Concrete Block Wall	Non Suspect ACM	120	SF	0	SF			
1	2	Classroom 224 Closet	N/A	Floor Tile VAT 12" x 12"	NAD	6	SF	0	SF	White		
1	2	Classroom 221	N/A	Fiberglass Pipe Insulation	Non Suspect ACM	52	LF	0	LF			
1	2	Classroom 221	N/A	Fiberglass Pipe Fitting Insulation	Non Suspect ACM	7	EA	0	EA			
1	2	Classroom 221	N/A	Sprayed-on Fluffy Ceiling Surface	Non Suspect ACM	816	SF	0	SF			
1	2	Classroom 221	N/A	Concrete Block Wall	Non Suspect ACM	1392	SF	0	SF			
1	2	Classroom 221	N/A	Floor Tile VAT 12" x 12"	NAD	816	SF	0	SF	White		
1	2	Classroom 221 Closet	N/A	Concrete Ceiling	Non Suspect ACM	6	SF	0	SF			

7140 New Roberto Clemente/The LINC 2015 2016 AHERA Three-Year Report

School District of Philadelphia New Roberto Clemente Middle School and The LINC High School 122 West Erie Avenue, Philadelphia, PA 19140 ULCS# 7140 Year Built: 1994			AHERA Three-Year Reinspection 2015-2016 Room by Room Location Log Report								Reinspection Date: 5/3/2016 through 5/6/2016 Building Inspector: Paul Davis Number: 050368 Management Planner: Megan Vala Number: 740728		
E l e m e n t	F l o o r	On Site Room Name	System Affected	Material Description	Confirmed/Assumed/NAD/ Non Suspect ACM	Amount of Material	SF LF EA	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic/ Crawl Space Ranking	
1	2	Classroom 221 Closet	N/A	Concrete Block Wall	Non Suspect ACM	120	SF	0	SF				
1	2	Classroom 221 Closet	N/A	Floor Tile VAT 12" x 12"	NAD	6	SF	0	SF	White			
1	2	Classroom 222	N/A	Fiberglass Pipe Insulation	Non Suspect ACM	56	LF	0	LF				
1	2	Classroom 222	N/A	Fiberglass Pipe Fitting Insulation	Non Suspect ACM	6	EA	0	EA				
1	2	Classroom 222	N/A	Sprayed-on Fluffy Ceiling Surface	Non Suspect ACM	816	SF	0	SF				
1	2	Classroom 222	N/A	Concrete Block Wall	Non Suspect ACM	1392	SF	0	SF				
1	2	Classroom 222	N/A	Floor Tile VAT 12" x 12"	NAD	816	SF	0	SF	White			
1	2	Classroom 222 Closet	N/A	Concrete Ceiling	Non Suspect ACM	6	SF	0	SF				
1	2	Classroom 222 Closet	N/A	Concrete Block Wall	Non Suspect ACM	120	SF	0	SF				
1	2	Classroom 222 Closet	N/A	Floor Tile VAT 12" x 12"	NAD	6	SF	0	SF	White			
1	2	Classroom 219	N/A	Fiberglass Pipe Insulation	Non Suspect ACM	52	LF	0	LF				
1	2	Classroom 219	N/A	Fiberglass Pipe Fitting Insulation	Non Suspect ACM	7	EA	0	EA				
1	2	Classroom 219	N/A	Sprayed-on Fluffy Ceiling Surface	Non Suspect ACM	816	SF	0	SF				
1	2	Classroom 219	N/A	Concrete Block Wall	Non Suspect ACM	1392	SF	0	SF				
1	2	Classroom 219	N/A	Floor Tile VAT 12" x 12"	NAD	816	SF	0	SF	White			
1	2	Classroom 219 Closet	N/A	Concrete Ceiling	Non Suspect ACM	6	SF	0	SF				
1	2	Classroom 219 Closet	N/A	Concrete Block Wall	Non Suspect ACM	120	SF	0	SF				
1	2	Classroom 219 Closet	N/A	Floor Tile VAT 12" x 12"	NAD	6	SF	0	SF	White			
1	2	Classroom 220	N/A	Fiberglass Pipe Insulation	Non Suspect ACM	72	LF	0	LF				
1	2	Classroom 220	N/A	Fiberglass Pipe Fitting Insulation	Non Suspect ACM	8	EA	0	EA				
1	2	Classroom 220	N/A	Sprayed-on Fluffy Ceiling Surface	Non Suspect ACM	816	SF	0	SF				
1	2	Classroom 220	N/A	Concrete Block Wall	Non Suspect ACM	1392	SF	0	SF				
1	2	Classroom 220	N/A	Floor Tile VAT 12" x 12"	NAD	816	SF	0	SF	White			
1	2	Classroom 220 Closet	N/A	Concrete Ceiling	Non Suspect ACM	6	SF	0	SF				
1	2	Classroom 220 Closet	N/A	Concrete Block Wall	Non Suspect ACM	120	SF	0	SF				
1	2	Classroom 220 Closet	N/A	Floor Tile VAT 12" x 12"	NAD	6	SF	0	SF	White			
1	2	Book Closet next to Classroom 219	N/A	Concrete Ceiling	Non Suspect ACM	56	SF	0	SF				
1	2	Book Closet next to Classroom 219	N/A	Concrete Block Wall	Non Suspect ACM	360	SF	0	SF				
1	2	Book Closet next to Classroom 219	N/A	Floor Tile VAT 12" x 12"	NAD	56	SF	0	SF	White			
1	2	Electrical Closet next to Classroom 217	N/A	Concrete Ceiling	Non Suspect ACM	20	SF	0	SF				
1	2	Electrical Closet next to Classroom 217	N/A	Concrete Block Wall	Non Suspect ACM	216	SF	0	SF				
1	2	Electrical Closet next to Classroom 217	N/A	Concrete Floor	Non Suspect ACM	20	SF	0	SF				
1	2	Classroom 218	N/A	Fiberglass Pipe Insulation	Non Suspect ACM	54	LF	0	LF				
1	2	Classroom 218	N/A	Fiberglass Pipe Fitting Insulation	Non Suspect ACM	6	EA	0	EA				
1	2	Classroom 218	N/A	Sprayed-on Fluffy Ceiling Surface	Non Suspect ACM	675	SF	0	SF				
1	2	Classroom 218	N/A	Concrete Block Wall	Non Suspect ACM	1248	SF	0	SF				
1	2	Classroom 218	N/A	Floor Tile VAT 12" x 12"	NAD	675	SF	0	SF	White			
1	2	Classroom 218 Closet	N/A	Concrete Ceiling	Non Suspect ACM	6	SF	0	SF				
1	2	Classroom 218 Closet	N/A	Concrete Block Wall	Non Suspect ACM	120	SF	0	SF				
1	2	Classroom 218 Closet	N/A	Floor Tile VAT 12" x 12"	NAD	6	SF	0	SF	White			
1	2	Classroom 217	N/A	Fiberglass Pipe Insulation	Non Suspect ACM	54	LF	0	LF				
1	2	Classroom 217	N/A	Fiberglass Pipe Fitting Insulation	Non Suspect ACM	7	EA	0	EA				
1	2	Classroom 217	N/A	Sprayed-on Fluffy Ceiling Surface	Non Suspect ACM	675	SF	0	SF				
1	2	Classroom 217	N/A	Concrete Block Wall	Non Suspect ACM	1248	SF	0	SF				
1	2	Classroom 217	N/A	Floor Tile VAT 12" x 12"	NAD	675	SF	0	SF	White			
1	2	Classroom 217 Closet	N/A	Concrete Ceiling	Non Suspect ACM	49	SF	0	SF				
1	2	Classroom 217 Closet	N/A	Concrete Block Wall	Non Suspect ACM	336	SF	0	SF				
1	2	Classroom 217 Closet	N/A	Floor Tile VAT 12" x 12"	NAD	49	SF	0	SF	White			
1	2	Teacher Lounge 216	N/A	Fiberglass Pipe Insulation	Non Suspect ACM	100	LF	0	LF				
1	2	Teacher Lounge 216	N/A	Fiberglass Pipe Fitting Insulation	Non Suspect ACM	6	EA	0	EA				
1	2	Teacher Lounge 216	N/A	Sprayed-on Fluffy Ceiling Surface	Non Suspect ACM	675	SF	0	SF				
1	2	Teacher Lounge 216	N/A	Concrete Block Wall	Non Suspect ACM	1248	SF	0	SF				
1	2	Teacher Lounge 216	N/A	Floor Tile VAT 12" x 12"	NAD	675	SF	0	SF	White			
1	2	Teacher Lounge 216 Closet	N/A	Concrete Ceiling	Non Suspect ACM	6	SF	0	SF				
1	2	Teacher Lounge 216 Closet	N/A	Concrete Block Wall	Non Suspect ACM	120	SF	0	SF				
1	2	Teacher Lounge 216 Closet	N/A	Floor Tile VAT 12" x 12"	NAD	6	SF	0	SF	White			
1	2	Classroom 215	N/A	Fiberglass Pipe Insulation	Non Suspect ACM	85	LF	0	LF		Pipe Chase Access in Room		
1	2	Classroom 215	N/A	Fiberglass Pipe Fitting Insulation	Non Suspect ACM	8	EA	0	EA		Pipe Chase Access in Room		
1	2	Classroom 215	N/A	Sprayed-on Fluffy Ceiling Surface	Non Suspect ACM	675	SF	0	SF		Pipe Chase Access in Room		
1	2	Classroom 215	N/A	Concrete Block Wall	Non Suspect ACM	1248	SF	0	SF		Pipe Chase Access in Room		
1	2	Classroom 215	N/A	Floor Tile VAT 12" x 12"	NAD	675	SF	0	SF	White	Pipe Chase Access in Room		
1	2	Classroom 215 Closet	N/A	Fiberglass Pipe Insulation	Non Suspect ACM	35	LF	0	LF				
1	2	Classroom 215 Closet	N/A	Fiberglass Pipe Fitting Insulation	Non Suspect ACM	6	EA	0	EA				

7140 New Roberto Clemente/The LINC 2015 2016 AHERA Three-Year Report

School District of Philadelphia New Roberto Clemente Middle School and The LINC High School 122 West Erie Avenue, Philadelphia, PA 19140 ULCS# 7140 Year Built: 1994			AHERA Three-Year Reinspection 2015-2016 Room by Room Location Log Report							Reinspection Date: 5/3/2016 through 5/6/2016 Building Inspector: Paul Davis Number: 050368 Management Planner: Megan Vala Number: 740728		
E l e m e n t	F l o o r	On Site Room Name	System Affected	Material Description	Confirmed/Assumed/NAD/ Non Suspect ACM	Amount of Material	SF LF EA	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic/ Crawl Space Ranking
1	2	Classroom 215 Closet	N/A	Concrete Ceiling	Non Suspect ACM	49	SF	0	SF			
1	2	Classroom 215 Closet	N/A	Concrete Block Wall	Non Suspect ACM	336	SF	0	SF			
1	2	Classroom 215 Closet	N/A	Floor Tile VAT 12" x 12"	NAD	49	SF	0	SF	White		
1	2	Custodial Closet next to Classroom 215	N/A	Fiberglass Pipe Insulation	Non Suspect ACM	8	LF	0	LF			
1	2	Custodial Closet next to Classroom 215	N/A	Concrete Ceiling	Non Suspect ACM	16	SF	0	SF			
1	2	Custodial Closet next to Classroom 215	N/A	Concrete Block Wall	Non Suspect ACM	192	SF	0	SF			
1	2	Custodial Closet next to Classroom 215	N/A	Floor Tile VAT 12" x 12"	NAD	16	SF	0	SF	White		
1	2	Staff Restroom next to Custodial Closet	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	56	SF	0	SF			
1	2	Staff Restroom next to Custodial Closet	N/A	Concrete Block Wall	Non Suspect ACM	240	SF	0	SF			
1	2	Staff Restroom next to Custodial Closet	N/A	Ceramic Tile Floors	Non Suspect ACM	56	SF	0	SF			
1	2	Boy's Restroom	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	300	SF	0	SF			
1	2	Boy's Restroom	N/A	Concrete Block Wall	Non Suspect ACM	650	SF	0	SF			
1	2	Boy's Restroom	N/A	Ceramic Tile Floors	Non Suspect ACM	300	SF	0	SF			
1	2	Custodial Closet between Boy's and Girl's Restrooms	N/A	Fiberglass Pipe Insulation	Non Suspect ACM	10	LF	0	LF		Pipe Chase Access in Room	
1	2	Custodial Closet between Boy's and Girl's Restrooms	N/A	Concrete Ceiling	Non Suspect ACM	72	SF	0	SF		Pipe Chase Access in Room	
1	2	Custodial Closet between Boy's and Girl's Restrooms	N/A	Concrete Block Wall	Non Suspect ACM	408	SF	0	SF		Pipe Chase Access in Room	
1	2	Custodial Closet between Boy's and Girl's Restrooms	N/A	Concrete Floor	Non Suspect ACM	72	SF	0	SF		Pipe Chase Access in Room	
1	2	Girl's Restroom	N/A	Fiberglass Ceiling Tile 2' x 4'	Non Suspect ACM	300	SF	0	SF			
1	2	Girl's Restroom	N/A	Concrete Block Wall	Non Suspect ACM	650	SF	0	SF			
1	2	Girl's Restroom	N/A	Ceramic Tile Floors	Non Suspect ACM	300	SF	0	SF			
1	2	Hallway from Girl's Restroom to Elevator	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	2480	SF	0	SF			
1	2	Hallway from Girl's Restroom to Elevator	N/A	Concrete Block Wall	Non Suspect ACM	4176	SF	0	SF			
1	2	Hallway from Girl's Restroom to Elevator	N/A	Sheetrock Wall	Non Suspect ACM	180	SF	0	SF			
1	2	Hallway from Girl's Restroom to Elevator	N/A	Floor Tile VAT 12" x 12"	NAD	2480	SF	0	SF	White		
1	2	Stairwell 3 on Second Floor	N/A	Concrete Ceiling	Non Suspect ACM	720	SF	0	SF			
1	2	Stairwell 3 on Second Floor	N/A	Concrete Block Wall	Non Suspect ACM	2240	SF	0	SF			
1	2	Stairwell 3 on Second Floor	N/A	Concrete Floor	Non Suspect ACM	140	SF	0	SF			
1	2	Stairwell 3 on Second Floor	N/A	Floor Tile VAT 12" x 12"	NAD	580	SF	0	SF	Grey		
1	2	LINC HS Counselor's Office 233	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	140	SF	0	SF		The LINC HS	
1	2	LINC HS Counselor's Office 233	N/A	Concrete Block Wall	Non Suspect ACM	432	SF	0	SF		The LINC HS	
1	2	LINC HS Counselor's Office 233	N/A	Floor Tile VAT 12" x 12"	NAD	140	SF	0	SF	White	The LINC HS	
1	2	Classroom 214	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	775	SF	0	SF		The LINC HS	
1	2	Classroom 214	N/A	Concrete Block Wall	Non Suspect ACM	1120	SF	0	SF		The LINC HS	
1	2	Classroom 214	N/A	Floor Tile VAT 12" x 12"	NAD	775	SF	0	SF	White	The LINC HS	
1	2	Classroom 214 Closet	N/A	X	X	X	X	X	X	X	No Access; Not Inspected. The LINC HS	
1	2	The LINC HS Vice Principal's Office 232	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	410	SF	0	SF		The LINC HS	
1	2	The LINC HS Vice Principal's Office 232	N/A	Concrete Block Wall	Non Suspect ACM	950	SF	0	SF		The LINC HS	
1	2	The LINC HS Vice Principal's Office 232	N/A	Floor Tile VAT 12" x 12"	NAD	410	SF	0	SF	White	The LINC HS	
1	2	Fan Room next to Room 232	N/A	Fiberglass Pipe Insulation	Non Suspect ACM	80	LF	0	LF		The LINC HS	
1	2	Fan Room next to Room 232	N/A	Fiberglass Pipe Fitting Insulation	Non Suspect ACM	10	EA	0	EA		The LINC HS	
1	2	Fan Room next to Room 232	N/A	Concrete Ceiling	Non Suspect ACM	285	SF	0	SF		The LINC HS	
1	2	Fan Room next to Room 232	N/A	Concrete Block Wall	Non Suspect ACM	610	SF	0	SF		The LINC HS	
1	2	Fan Room next to Room 232	N/A	Vinyl Vibration Damper Cloth	Non Suspect ACM	16	SF	0	SF		The LINC HS	
1	2	Fan Room next to Room 232	N/A	Concrete Floor	Non Suspect ACM	285	SF	0	SF		The LINC HS	
1	2	Staff Restroom next to Fan Room	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	48	SF	0	SF		The LINC HS	
1	2	Staff Restroom next to Fan Room	N/A	Concrete Block Wall	Non Suspect ACM	224	SF	0	SF		The LINC HS	
1	2	Staff Restroom next to Fan Room	N/A	Ceramic Tile Floors	Non Suspect ACM	48	SF	0	SF		The LINC HS	
1	2	Closet between Staff Restroom and Classroom 213	N/A	Fiberglass Pipe Insulation	Non Suspect ACM	10	LF	0	LF		The LINC HS	
1	2	Closet between Staff Restroom and Classroom 213	N/A	Concrete Ceiling	Non Suspect ACM	15	SF	0	SF		The LINC HS	
1	2	Closet between Staff Restroom and Classroom 213	N/A	Concrete Block Wall	Non Suspect ACM	192	SF	0	SF		The LINC HS	
1	2	Closet between Staff Restroom and Classroom 213	N/A	Floor Tile VAT 12" x 12"	NAD	15	SF	0	SF	White	The LINC HS	
1	2	Classroom 213	N/A	Fiberglass Pipe Insulation	Non Suspect ACM	54	LF	0	LF		The LINC HS	
1	2	Classroom 213	N/A	Fiberglass Pipe Fitting Insulation	Non Suspect ACM	6	EA	0	EA		The LINC HS	
1	2	Classroom 213	N/A	Sprayed-on Fluffy Ceiling Surface	Non Suspect ACM	675	SF	0	SF		The LINC HS	
1	2	Classroom 213	N/A	Concrete Block Wall	Non Suspect ACM	1248	SF	0	SF		The LINC HS	
1	2	Classroom 213	N/A	Floor Tile VAT 12" x 12"	NAD	675	SF	0	SF	White	The LINC HS	
1	2	Classroom 213 Closet	N/A	Fiberglass Pipe Insulation	Non Suspect ACM	35	LF	0	LF		The LINC HS	
1	2	Classroom 213 Closet	N/A	Fiberglass Pipe Fitting Insulation	Non Suspect ACM	10	EA	0	EA		The LINC HS	
1	2	Classroom 213 Closet	N/A	Concrete Ceiling	Non Suspect ACM	49	SF	0	SF		The LINC HS	
1	2	Classroom 213 Closet	N/A	Concrete Block Wall	Non Suspect ACM	336	SF	0	SF		The LINC HS	
1	2	Classroom 213 Closet	N/A	Floor Tile VAT 12" x 12"	NAD	49	SF	0	SF	White	The LINC HS	
1	2	Classroom 211	N/A	Fiberglass Pipe Insulation	Non Suspect ACM	54	LF	0	LF		The LINC HS	
1	2	Classroom 211	N/A	Fiberglass Pipe Fitting Insulation	Non Suspect ACM	6	EA	0	EA		The LINC HS	

7140 New Roberto Clemente/The LINC 2015 2016 AHERA Three-Year Report

		School District of Philadelphia New Roberto Clemente Middle School and The LINC High School 122 West Erie Avenue, Philadelphia, PA 19140 ULCS# 7140 Year Built: 1994	AHERA Three-Year Reinspection 2015-2016 Room by Room Location Log Report								Reinspection Date: 5/3/2016 through 5/6/2016		
											Building Inspector: Paul Davis		
											Number: 050368		
											Management Planner: Megan Vala		
											Number: 740728		
E l e m e n t	F l o o r	On Site Room Name	System Affected	Material Description	Confirmed/Assumed/NAD/ Non Suspect ACM	Amount of Material	SF LF EA	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic/ Crawl Space Ranking	
1	2	Classroom 211	N/A	Sprayed-on Fluffy Ceiling Surface	Non Suspect ACM	675	SF	0	SF		The LINC HS		
1	2	Classroom 211	N/A	Concrete Block Wall	Non Suspect ACM	1248	SF	0	SF		The LINC HS		
1	2	Classroom 211	N/A	Floor Tile VAT 12" x 12"	NAD	675	SF	0	SF	White	The LINC HS		
1	2	Classroom 211 Closet	N/A	Concrete Ceiling	Non Suspect ACM	49	SF	0	SF		The LINC HS		
1	2	Classroom 211 Closet	N/A	Concrete Block Wall	Non Suspect ACM	336	SF	0	SF		The LINC HS		
1	2	Classroom 211 Closet	N/A	Floor Tile VAT 12" x 12"	NAD	49	SF	0	SF	White	The LINC HS		
1	2	Electrical Closet next to Classroom 211	N/A	Concrete Ceiling	Non Suspect ACM	15	SF	0	SF		The LINC HS		
1	2	Electrical Closet next to Classroom 211	N/A	Concrete Block Wall	Non Suspect ACM	192	SF	0	SF		The LINC HS		
1	2	Electrical Closet next to Classroom 211	N/A	Concrete Floor	Non Suspect ACM	15	SF	0	SF		The LINC HS		
1	2	Book Closet next to Classroom 209	N/A	Concrete Ceiling	Non Suspect ACM	56	SF	0	SF		The LINC HS		
1	2	Book Closet next to Classroom 209	N/A	Concrete Block Wall	Non Suspect ACM	360	SF	0	SF		The LINC HS		
1	2	Book Closet next to Classroom 209	N/A	Floor Tile VAT 12" x 12"	NAD	56	SF	0	SF	White	The LINC HS		
1	2	Classroom 212	N/A	Fiberglass Pipe Insulation	Non Suspect ACM	100	LF	0	LF		The LINC HS		
1	2	Classroom 212	N/A	Fiberglass Pipe Fitting Insulation	Non Suspect ACM	4	EA	0	EA		The LINC HS		
1	2	Classroom 212	N/A	Sprayed-on Fluffy Ceiling Surface	Non Suspect ACM	675	SF	0	SF		The LINC HS		
1	2	Classroom 212	N/A	Concrete Block Wall	Non Suspect ACM	1248	SF	0	SF		The LINC HS		
1	2	Classroom 212	N/A	Floor Tile VAT 12" x 12"	NAD	675	SF	0	SF	White	The LINC HS		
1	2	Classroom 212 Closet	N/A	Fiberglass Pipe Insulation	Non Suspect ACM	5	LF	0	LF		The LINC HS		
1	2	Classroom 212 Closet	N/A	Fiberglass Pipe Fitting Insulation	Non Suspect ACM	1	EA	0	EA		The LINC HS		
1	2	Classroom 212 Closet	N/A	Concrete Ceiling	Non Suspect ACM	6	SF	0	SF		The LINC HS		
1	2	Classroom 212 Closet	N/A	Concrete Block Wall	Non Suspect ACM	120	SF	0	SF		The LINC HS		
1	2	Classroom 212 Closet	N/A	Floor Tile VAT 12" x 12"	NAD	6	SF	0	SF	White	The LINC HS		
1	2	Classroom 210	N/A	Fiberglass Pipe Insulation	Non Suspect ACM	75	LF	0	LF		The LINC HS		
1	2	Classroom 210	N/A	Fiberglass Pipe Fitting Insulation	Non Suspect ACM	10	EA	0	EA		The LINC HS		
1	2	Classroom 210	N/A	Sprayed-on Fluffy Ceiling Surface	Non Suspect ACM	816	SF	0	SF		The LINC HS		
1	2	Classroom 210	N/A	Concrete Block Wall	Non Suspect ACM	1392	SF	0	SF		The LINC HS		
1	2	Classroom 210	N/A	Floor Tile VAT 12" x 12"	NAD	816	SF	0	SF	White	The LINC HS		
1	2	Classroom 210 Closet	N/A	Concrete Ceiling	Non Suspect ACM	6	SF	0	SF		The LINC HS		
1	2	Classroom 210 Closet	N/A	Concrete Block Wall	Non Suspect ACM	120	SF	0	SF		The LINC HS		
1	2	Classroom 210 Closet	N/A	Floor Tile VAT 12" x 12"	NAD	6	SF	0	SF	White	The LINC HS		
1	2	Classroom 209	N/A	Fiberglass Pipe Insulation	Non Suspect ACM	52	LF	0	LF		The LINC HS		
1	2	Classroom 209	N/A	Fiberglass Pipe Fitting Insulation	Non Suspect ACM	6	EA	0	EA		The LINC HS		
1	2	Classroom 209	N/A	Sprayed-on Fluffy Ceiling Surface	Non Suspect ACM	816	SF	0	SF		The LINC HS		
1	2	Classroom 209	N/A	Concrete Block Wall	Non Suspect ACM	1392	SF	0	SF		The LINC HS		
1	2	Classroom 209	N/A	Floor Tile VAT 12" x 12"	NAD	816	SF	0	SF	White	The LINC HS		
1	2	Classroom 209 Closet	N/A	Concrete Ceiling	Non Suspect ACM	6	SF	0	SF		The LINC HS		
1	2	Classroom 209 Closet	N/A	Concrete Block Wall	Non Suspect ACM	120	SF	0	SF		The LINC HS		
1	2	Classroom 209 Closet	N/A	Floor Tile VAT 12" x 12"	NAD	6	SF	0	SF	White	The LINC HS		
1	2	Classroom 207	N/A	Fiberglass Pipe Insulation	Non Suspect ACM	52	LF	0	LF		The LINC HS		
1	2	Classroom 207	N/A	Fiberglass Pipe Fitting Insulation	Non Suspect ACM	6	EA	0	EA		The LINC HS		
1	2	Classroom 207	N/A	Sprayed-on Fluffy Ceiling Surface	Non Suspect ACM	816	SF	0	SF		The LINC HS		
1	2	Classroom 207	N/A	Concrete Block Wall	Non Suspect ACM	1392	SF	0	SF		The LINC HS		
1	2	Classroom 207	N/A	Floor Tile VAT 12" x 12"	NAD	816	SF	0	SF	White	The LINC HS		
1	2	Classroom 207 Closet	N/A	Concrete Ceiling	Non Suspect ACM	6	SF	0	SF		The LINC HS		
1	2	Classroom 207 Closet	N/A	Concrete Block Wall	Non Suspect ACM	120	SF	0	SF		The LINC HS		
1	2	Classroom 207 Closet	N/A	Floor Tile VAT 12" x 12"	NAD	6	SF	0	SF	White	The LINC HS		
1	2	Classroom 208	N/A	Fiberglass Pipe Insulation	Non Suspect ACM	52	LF	0	LF		The LINC HS		
1	2	Classroom 208	N/A	Fiberglass Pipe Fitting Insulation	Non Suspect ACM	6	EA	0	EA		The LINC HS		
1	2	Classroom 208	N/A	Sprayed-on Fluffy Ceiling Surface	Non Suspect ACM	816	SF	0	SF		The LINC HS		
1	2	Classroom 208	N/A	Concrete Block Wall	Non Suspect ACM	1392	SF	0	SF		The LINC HS		
1	2	Classroom 208	N/A	Floor Tile VAT 12" x 12"	NAD	816	SF	0	SF	White	The LINC HS		
1	2	Classroom 208 Closet	N/A	Concrete Ceiling	Non Suspect ACM	6	SF	0	SF		The LINC HS		
1	2	Classroom 208 Closet	N/A	Concrete Block Wall	Non Suspect ACM	120	SF	0	SF		The LINC HS		
1	2	Classroom 208 Closet	N/A	Floor Tile VAT 12" x 12"	NAD	6	SF	0	SF	White	The LINC HS		
1	2	Classroom 206	N/A	Fiberglass Pipe Insulation	Non Suspect ACM	54	LF	0	LF		The LINC HS		
1	2	Classroom 206	N/A	Fiberglass Pipe Fitting Insulation	Non Suspect ACM	6	EA	0	EA		The LINC HS		
1	2	Classroom 206	N/A	Sprayed-on Fluffy Ceiling Surface	Non Suspect ACM	816	SF	0	SF		The LINC HS		
1	2	Classroom 206	N/A	Concrete Block Wall	Non Suspect ACM	1392	SF	0	SF		The LINC HS		
1	2	Classroom 206	N/A	Floor Tile VAT 12" x 12"	NAD	816	SF	0	SF	White	The LINC HS		
1	2	Classroom 206 Closet	N/A	Concrete Ceiling	Non Suspect ACM	6	SF	0	SF		The LINC HS		
1	2	Classroom 206 Closet	N/A	Concrete Block Wall	Non Suspect ACM	120	SF	0	SF		The LINC HS		
1	2	Classroom 206 Closet	N/A	Floor Tile VAT 12" x 12"	NAD	6	SF	0	SF	White	The LINC HS		
1	2	Classroom 205	N/A	Fiberglass Pipe Insulation	Non Suspect ACM	54	LF	0	LF		The LINC HS		

7140 New Roberto Clemente/The LINC 2015 2016 AHERA Three-Year Report

School District of Philadelphia New Roberto Clemente Middle School and The LINC High School 122 West Erie Avenue, Philadelphia, PA 19140 ULCS# 7140 Year Built: 1994			AHERA Three-Year Reinspection 2015-2016 Room by Room Location Log Report							Reinspection Date: 5/3/2016 through 5/6/2016 Building Inspector: Paul Davis Number: 050368 Management Planner: Megan Vala Number: 740728			
E l e m e n t	F l o o r	On Site Room Name	System Affected	Material Description	Confirmed/Assumed/NAD/ Non Suspect ACM	Amount of Material	SF LF EA	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic/ Crawl Space Ranking	
1	2	Classroom 205	N/A	Fiberglass Pipe Fitting Insulation	Non Suspect ACM	6	EA	0	EA		The LINC HS		
1	2	Classroom 205	N/A	Sprayed-on Fluffy Ceiling Surface	Non Suspect ACM	816	SF	0	SF		The LINC HS		
1	2	Classroom 205	N/A	Concrete Block Wall	Non Suspect ACM	1392	SF	0	SF		The LINC HS		
1	2	Classroom 205	N/A	Floor Tile VAT 12" x 12"	NAD	816	SF	0	SF	White	The LINC HS		
1	2	Classroom 205 Closet	N/A	Concrete Ceiling	Non Suspect ACM	6	SF	0	SF		The LINC HS		
1	2	Classroom 205 Closet	N/A	Concrete Block Wall	Non Suspect ACM	120	SF	0	SF		The LINC HS		
1	2	Classroom 205 Closet	N/A	Floor Tile VAT 12" x 12"	NAD	6	SF	0	SF	White	The LINC HS		
1	2	Classroom 203	N/A	Fiberglass Pipe Insulation	Non Suspect ACM	54	LF	0	LF		The LINC HS		
1	2	Classroom 203	N/A	Fiberglass Pipe Fitting Insulation	Non Suspect ACM	6	EA	0	EA		The LINC HS		
1	2	Classroom 203	N/A	Sprayed-on Fluffy Ceiling Surface	Non Suspect ACM	816	SF	0	SF		The LINC HS		
1	2	Classroom 203	N/A	Concrete Block Wall	Non Suspect ACM	1392	SF	0	SF		The LINC HS		
1	2	Classroom 203	N/A	Floor Tile VAT 12" x 12"	NAD	816	SF	0	SF	White	The LINC HS		
1	2	Classroom 203 Closet	N/A	Concrete Ceiling	Non Suspect ACM	6	SF	0	SF		The LINC HS		
1	2	Classroom 203 Closet	N/A	Concrete Block Wall	Non Suspect ACM	120	SF	0	SF		The LINC HS		
1	2	Classroom 203 Closet	N/A	Floor Tile VAT 12" x 12"	NAD	6	SF	0	SF	White	The LINC HS		
1	2	Classroom 201	N/A	Fiberglass Pipe Insulation	Non Suspect ACM	140	LF	0	LF		The LINC HS		
1	2	Classroom 201	N/A	Fiberglass Pipe Fitting Insulation	Non Suspect ACM	6	EA	0	EA		The LINC HS		
1	2	Classroom 201	N/A	Sprayed-on Fluffy Ceiling Surface	Non Suspect ACM	816	SF	0	SF		The LINC HS		
1	2	Classroom 201	N/A	Concrete Block Wall	Non Suspect ACM	1392	SF	0	SF		The LINC HS		
1	2	Classroom 201	N/A	Floor Tile VAT 12" x 12"	NAD	816	SF	0	SF	White	The LINC HS		
1	2	Classroom 201 Closet	N/A	Black Foam Pipe Insulation	Non Suspect ACM	45	LF	0	LF		The LINC HS		
1	2	Classroom 201 Closet	N/A	Concrete Ceiling	Non Suspect ACM	6	SF	0	SF		The LINC HS		
1	2	Classroom 201 Closet	N/A	Concrete Block Wall	Non Suspect ACM	120	SF	0	SF		The LINC HS		
1	2	Classroom 201 Closet	N/A	Floor Tile VAT 12" x 12"	NAD	6	SF	0	SF	White	The LINC HS		
1	2	Classroom 202	N/A	Fiberglass Pipe Insulation	Non Suspect ACM	140	LF	0	LF		The LINC HS		
1	2	Classroom 202	N/A	Fiberglass Pipe Fitting Insulation	Non Suspect ACM	6	EA	0	EA		The LINC HS		
1	2	Classroom 202	N/A	Sprayed-on Fluffy Ceiling Surface	Non Suspect ACM	816	SF	0	SF		The LINC HS		
1	2	Classroom 202	N/A	Concrete Block Wall	Non Suspect ACM	1392	SF	0	SF		The LINC HS		
1	2	Classroom 202	N/A	Floor Tile VAT 12" x 12"	NAD	816	SF	0	SF	White	The LINC HS		
1	2	Classroom 202 Closet	N/A	Concrete Ceiling	Non Suspect ACM	6	SF	0	SF		The LINC HS		
1	2	Classroom 202 Closet	N/A	Concrete Block Wall	Non Suspect ACM	120	SF	0	SF		The LINC HS		
1	2	Classroom 202 Closet	N/A	Floor Tile VAT 12" x 12"	NAD	6	SF	0	SF	White	The LINC HS		
1	2	Classroom 204	N/A	Fiberglass Pipe Insulation	Non Suspect ACM	54	LF	0	LF		The LINC HS		
1	2	Classroom 204	N/A	Fiberglass Pipe Fitting Insulation	Non Suspect ACM	6	EA	0	EA		The LINC HS		
1	2	Classroom 204	N/A	Sprayed-on Fluffy Ceiling Surface	Non Suspect ACM	816	SF	0	SF		The LINC HS		
1	2	Classroom 204	N/A	Concrete Block Wall	Non Suspect ACM	1392	SF	0	SF		The LINC HS		
1	2	Classroom 204	N/A	Floor Tile VAT 12" x 12"	NAD	816	SF	0	SF	White	The LINC HS		
1	2	Classroom 204 Closet	N/A	Concrete Ceiling	Non Suspect ACM	6	SF	0	SF		The LINC HS		
1	2	Classroom 204 Closet	N/A	Concrete Block Wall	Non Suspect ACM	120	SF	0	SF		The LINC HS		
1	2	Classroom 204 Closet	N/A	Floor Tile VAT 12" x 12"	NAD	6	SF	0	SF	White	The LINC HS		
1	2	Hallway from Classroom 201 to Office Room 233	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	2415	SF	0	SF		The LINC HS		
1	2	Hallway from Classroom 201 to Office Room 233	N/A	Concrete Block Wall	Non Suspect ACM	3942	SF	0	SF		The LINC HS		
1	2	Hallway from Classroom 201 to Office Room 233	N/A	Sheetrock Wall	Non Suspect ACM	200	SF	0	SF		The LINC HS		
1	2	Hallway from Classroom 201 to Office Room 233	N/A	Floor Tile VAT 12" x 12"	NAD	2415	SF	0	SF	White	The LINC HS		
1	2	Stairwell 2 on Second Floor near Classroom 201	N/A	Concrete Ceiling	Non Suspect ACM	595	SF	0	SF		The LINC HS		
1	2	Stairwell 2 on Second Floor near Classroom 201	N/A	Concrete Block Wall	Non Suspect ACM	2080	SF	0	SF		The LINC HS		
1	2	Stairwell 2 on Second Floor near Classroom 201	N/A	Concrete Floor	Non Suspect ACM	144	SF	0	SF		The LINC HS		
1	2	Stairwell 2 on Second Floor near Classroom 201	N/A	Floor Tile VAT 12" x 12"	NAD	384	SF	0	SF	Grey	The LINC HS		
1	3	Stairwell 2 on Third Floor near Classroom 301	N/A	Concrete Ceiling	Non Suspect ACM	595	SF	0	SF				
1	3	Stairwell 2 on Third Floor near Classroom 301	N/A	Concrete Block Wall	Non Suspect ACM	2080	SF	0	SF				
1	3	Stairwell 2 on Third Floor near Classroom 301	N/A	Concrete Floor	Non Suspect ACM	80	SF	0	SF				
1	3	Stairwell 2 on Third Floor near Classroom 301	N/A	Floor Tile VAT 12" x 12"	NAD	515	SF	0	SF	Grey			
1	3	Classroom 301	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	632	SF	0	SF				
1	3	Classroom 301	N/A	Concrete Ceiling	Non Suspect ACM	184	SF	0	SF				
1	3	Classroom 301	N/A	Concrete Block Wall	Non Suspect ACM	1276	SF	0	SF				
1	3	Classroom 301	N/A	Floor Tile VAT 12" x 12"	NAD	816	SF	0	SF	White			
1	3	Classroom 301 Closet	N/A	Concrete Ceiling	Non Suspect ACM	6	SF	0	SF				
1	3	Classroom 301 Closet	N/A	Concrete Block Wall	Non Suspect ACM	110	SF	0	SF				
1	3	Classroom 301 Closet	N/A	Floor Tile VAT 12" x 12"	NAD	6	SF	0	SF	White			
1	3	Classroom 302	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	632	SF	0	SF				
1	3	Classroom 302	N/A	Concrete Ceiling	Non Suspect ACM	184	SF	0	SF				
1	3	Classroom 302	N/A	Concrete Block Wall	Non Suspect ACM	1276	SF	0	SF				
1	3	Classroom 302	N/A	Floor Tile VAT 12" x 12"	NAD	816	SF	0	SF	White			

7140 New Roberto Clemente/The LINC 2015 2016 AHERA Three-Year Report

		School District of Philadelphia New Roberto Clemente Middle School and The LINC High School 122 West Erie Avenue, Philadelphia, PA 19140 ULCS# 7140 Year Built: 1994	AHERA Three-Year Reinspection 2015-2016 Room by Room Location Log Report								Reinspection Date: 5/3/2016 through 5/6/2016		
		Building Inspector: Paul Davis											
		Number: 050368											
		Management Planner: Megan Vala											
		Number: 740728											
E l e m e n t	F l o o r	On Site Room Name	System Affected	Material Description	Confirmed/Assumed/NAD/ Non Suspect ACM	Amount of Material	SF LF EA	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic/ Crawl Space Ranking	
1	3	Classroom 302 Closet	N/A	Concrete Ceiling	Non Suspect ACM	6	SF	0	SF				
1	3	Classroom 302 Closet	N/A	Concrete Block Wall	Non Suspect ACM	110	SF	0	SF				
1	3	Classroom 302 Closet	N/A	Floor Tile VAT 12" x 12"	NAD	6	SF	0	SF	White			
1	3	Classroom 303	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	632	SF	0	SF				
1	3	Classroom 303	N/A	Concrete Ceiling	Non Suspect ACM	184	SF	0	SF				
1	3	Classroom 303	N/A	Concrete Block Wall	Non Suspect ACM	1276	SF	0	SF				
1	3	Classroom 303	N/A	Floor Tile VAT 12" x 12"	NAD	816	SF	0	SF	White			
1	3	Classroom 303 Closet	N/A	Concrete Ceiling	Non Suspect ACM	6	SF	0	SF				
1	3	Classroom 303 Closet	N/A	Concrete Block Wall	Non Suspect ACM	110	SF	0	SF				
1	3	Classroom 303 Closet	N/A	Floor Tile VAT 12" x 12"	NAD	6	SF	0	SF	White			
1	3	Classroom 304	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	632	SF	0	SF				
1	3	Classroom 304	N/A	Concrete Ceiling	Non Suspect ACM	184	SF	0	SF				
1	3	Classroom 304	N/A	Concrete Block Wall	Non Suspect ACM	1276	SF	0	SF				
1	3	Classroom 304	N/A	Floor Tile VAT 12" x 12"	NAD	816	SF	0	SF	White			
1	3	Classroom 304 Closet	N/A	Concrete Ceiling	Non Suspect ACM	6	SF	0	SF				
1	3	Classroom 304 Closet	N/A	Concrete Block Wall	Non Suspect ACM	110	SF	0	SF				
1	3	Classroom 304 Closet	N/A	Floor Tile VAT 12" x 12"	NAD	6	SF	0	SF	White			
1	3	Classroom 305	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	632	SF	0	SF				
1	3	Classroom 305	N/A	Concrete Ceiling	Non Suspect ACM	184	SF	0	SF				
1	3	Classroom 305	N/A	Concrete Block Wall	Non Suspect ACM	1276	SF	0	SF				
1	3	Classroom 305	N/A	Floor Tile VAT 12" x 12"	NAD	816	SF	0	SF	White			
1	3	Classroom 305 Closet	N/A	Concrete Ceiling	Non Suspect ACM	6	SF	0	SF				
1	3	Classroom 305 Closet	N/A	Concrete Block Wall	Non Suspect ACM	110	SF	0	SF				
1	3	Classroom 305 Closet	N/A	Floor Tile VAT 12" x 12"	NAD	6	SF	0	SF	White			
1	3	Classroom 307	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	632	SF	0	SF				
1	3	Classroom 307	N/A	Concrete Ceiling	Non Suspect ACM	184	SF	0	SF				
1	3	Classroom 307	N/A	Concrete Block Wall	Non Suspect ACM	1276	SF	0	SF				
1	3	Classroom 307	N/A	Floor Tile VAT 12" x 12"	NAD	816	SF	0	SF	White			
1	3	Classroom 307 Closet	N/A	Concrete Ceiling	Non Suspect ACM	6	SF	0	SF				
1	3	Classroom 307 Closet	N/A	Concrete Block Wall	Non Suspect ACM	110	SF	0	SF				
1	3	Classroom 307 Closet	N/A	Floor Tile VAT 12" x 12"	NAD	6	SF	0	SF	White			
1	3	Classroom 308	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	632	SF	0	SF				
1	3	Classroom 308	N/A	Concrete Ceiling	Non Suspect ACM	184	SF	0	SF				
1	3	Classroom 308	N/A	Concrete Block Wall	Non Suspect ACM	1276	SF	0	SF				
1	3	Classroom 308	N/A	Floor Tile VAT 12" x 12"	NAD	816	SF	0	SF	White			
1	3	Classroom 308 Closet	N/A	Concrete Ceiling	Non Suspect ACM	6	SF	0	SF				
1	3	Classroom 308 Closet	N/A	Concrete Block Wall	Non Suspect ACM	110	SF	0	SF				
1	3	Classroom 308 Closet	N/A	Floor Tile VAT 12" x 12"	NAD	6	SF	0	SF	White			
1	3	Classroom 306	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	632	SF	0	SF				
1	3	Classroom 306	N/A	Concrete Ceiling	Non Suspect ACM	184	SF	0	SF				
1	3	Classroom 306	N/A	Concrete Block Wall	Non Suspect ACM	1276	SF	0	SF				
1	3	Classroom 306	N/A	Floor Tile VAT 12" x 12"	NAD	816	SF	0	SF	White			
1	3	Classroom 306 Closet	N/A	Concrete Ceiling	Non Suspect ACM	6	SF	0	SF				
1	3	Classroom 306 Closet	N/A	Concrete Block Wall	Non Suspect ACM	110	SF	0	SF				
1	3	Classroom 306 Closet	N/A	Floor Tile VAT 12" x 12"	NAD	6	SF	0	SF	White			
1	3	Classroom 310	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	632	SF	0	SF				
1	3	Classroom 310	N/A	Concrete Ceiling	Non Suspect ACM	184	SF	0	SF				
1	3	Classroom 310	N/A	Concrete Block Wall	Non Suspect ACM	1276	SF	0	SF				
1	3	Classroom 310	N/A	Floor Tile VAT 12" x 12"	NAD	816	SF	0	SF	White			
1	3	Classroom 310 Closet	N/A	Concrete Ceiling	Non Suspect ACM	6	SF	0	SF				
1	3	Classroom 310 Closet	N/A	Concrete Block Wall	Non Suspect ACM	110	SF	0	SF				
1	3	Classroom 310 Closet	N/A	Floor Tile VAT 12" x 12"	NAD	6	SF	0	SF	White			
1	3	Classroom 309	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	632	SF	0	SF				
1	3	Classroom 309	N/A	Concrete Ceiling	Non Suspect ACM	184	SF	0	SF				
1	3	Classroom 309	N/A	Concrete Block Wall	Non Suspect ACM	1276	SF	0	SF				
1	3	Classroom 309	N/A	Floor Tile VAT 12" x 12"	NAD	816	SF	0	SF	White			
1	3	Classroom 309 Closet	N/A	Concrete Ceiling	Non Suspect ACM	6	SF	0	SF				
1	3	Classroom 309 Closet	N/A	Concrete Block Wall	Non Suspect ACM	110	SF	0	SF				
1	3	Classroom 309 Closet	N/A	Floor Tile VAT 12" x 12"	NAD	6	SF	0	SF	White			
1	3	Classroom 312	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	520	SF	0	SF				
1	3	Classroom 312	N/A	Concrete Ceiling	Non Suspect ACM	158	SF	0	SF				
1	3	Classroom 312	N/A	Concrete Block Wall	Non Suspect ACM	1144	SF	0	SF				
1	3	Classroom 312	N/A	Floor Tile VAT 12" x 12"	NAD	675	SF	0	SF	White			

7140 New Roberto Clemente/The LINC 2015 2016 AHERA Three-Year Report

		School District of Philadelphia New Roberto Clemente Middle School and The LINC High School 122 West Erie Avenue, Philadelphia, PA 19140 ULCS# 7140 Year Built: 1994	AHERA Three-Year Reinspection 2015-2016 Room by Room Location Log Report							Reinspection Date: 5/3/2016 through 5/6/2016			
										Building Inspector: Paul Davis			
										Number: 050368			
										Management Planner: Megan Vala			
										Number: 740728			
E l e m e n t	F l o o r	On Site Room Name	System Affected	Material Description	Confirmed/Assumed/NAD/ Non Suspect ACM	Amount of Material	SF LF EA	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic/ Crawl Space Ranking	
1	3	Classroom 312 Closet	N/A	Concrete Ceiling	Non Suspect ACM	6	SF	0	SF				
1	3	Classroom 312 Closet	N/A	Concrete Block Wall	Non Suspect ACM	110	SF	0	SF				
1	3	Classroom 312 Closet	N/A	Floor Tile VAT 12" x 12"	NAD	6	SF	0	SF	White			
1	3	Book Closet across from Classroom 312	N/A	Concrete Ceiling	Non Suspect ACM	49	SF	0	SF				
1	3	Book Closet across from Classroom 312	N/A	Concrete Block Wall	Non Suspect ACM	308	SF	0	SF				
1	3	Book Closet across from Classroom 312	N/A	Floor Tile VAT 12" x 12"	NAD	49	SF	0	SF	White			
1	3	Electrical Closet next to Classroom 311	N/A	Concrete Ceiling	Non Suspect ACM	15	SF	0	SF				
1	3	Electrical Closet next to Classroom 311	N/A	Concrete Block Wall	Non Suspect ACM	176	SF	0	SF				
1	3	Electrical Closet next to Classroom 311	N/A	Concrete Floor	Non Suspect ACM	15	SF	0	SF				
1	3	Classroom 311	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	520	SF	0	SF				
1	3	Classroom 311	N/A	Concrete Ceiling	Non Suspect ACM	158	SF	0	SF				
1	3	Classroom 311	N/A	Concrete Block Wall	Non Suspect ACM	1144	SF	0	SF				
1	3	Classroom 311	N/A	Floor Tile VAT 12" x 12"	NAD	675	SF	0	SF	White			
1	3	Classroom 311 Closet	N/A	Concrete Ceiling	Non Suspect ACM	42	SF	0	SF				
1	3	Classroom 311 Closet	N/A	Concrete Block Wall	Non Suspect ACM	280	SF	0	SF				
1	3	Classroom 311 Closet	N/A	Floor Tile VAT 12" x 12"	NAD	42	SF	0	SF	White			
1	3	Classroom 313	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	520	SF	0	SF				
1	3	Classroom 313	N/A	Concrete Ceiling	Non Suspect ACM	158	SF	0	SF				
1	3	Classroom 313	N/A	Concrete Block Wall	Non Suspect ACM	1144	SF	0	SF				
1	3	Classroom 313	N/A	Floor Tile VAT 12" x 12"	NAD	675	SF	0	SF	White			
1	3	Classroom 313 Closet	N/A	Concrete Ceiling	Non Suspect ACM	42	SF	0	SF				
1	3	Classroom 313 Closet	N/A	Concrete Block Wall	Non Suspect ACM	280	SF	0	SF				
1	3	Classroom 313 Closet	N/A	Floor Tile VAT 12" x 12"	NAD	42	SF	0	SF	White			
1	3	Closet in Hallway next to Classroom 313	N/A	Concrete Ceiling	Non Suspect ACM	15	SF	0	SF				
1	3	Closet in Hallway next to Classroom 313	N/A	Concrete Block Wall	Non Suspect ACM	176	SF	0	SF				
1	3	Closet in Hallway next to Classroom 313	N/A	Floor Tile VAT 12" x 12"	NAD	15	SF	0	SF	White			
1	3	Staff Restroom near Classroom 313	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	42	SF	0	SF				
1	3	Staff Restroom near Classroom 313	N/A	Concrete Block Wall	Non Suspect ACM	208	SF	0	SF				
1	3	Staff Restroom near Classroom 313	N/A	Ceramic Tile Floors	Non Suspect ACM	42	SF	0	SF				
1	3	Fan Room next to Room 332	N/A	Fiberglass Pipe Insulation	Non Suspect ACM	40	LF	0	LF				
1	3	Fan Room next to Room 332	N/A	Fiberglass Pipe Fitting Insulation	Non Suspect ACM	15	EA	0	EA				
1	3	Fan Room next to Room 332	N/A	Concrete Ceiling	Non Suspect ACM	285	SF	0	SF				
1	3	Fan Room next to Room 332	N/A	Concrete Block Wall	Non Suspect ACM	610	SF	0	SF				
1	3	Fan Room next to Room 332	N/A	Vinyl Vibration Damper Cloth	Non Suspect ACM	16	SF	0	SF				
1	3	Fan Room next to Room 332	N/A	Concrete Floor	Non Suspect ACM	285	SF	0	SF				
1	3	Teacher Copy Room 333	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	140	SF	0	SF				
1	3	Teacher Copy Room 333	N/A	Concrete Block Wall	Non Suspect ACM	432	SF	0	SF				
1	3	Teacher Copy Room 333	N/A	Floor Tile VAT 12" x 12"	NAD	140	SF	0	SF	White			
1	3	Custodial Closet between Boy's and Girl's Restrooms	N/A	Fiberglass Pipe Insulation	Non Suspect ACM	8	LF	0	LF		Pipe Chase Access in Room		
1	3	Custodial Closet between Boy's and Girl's Restrooms	N/A	Concrete Ceiling	Non Suspect ACM	72	SF	0	SF		Pipe Chase Access in Room		
1	3	Custodial Closet between Boy's and Girl's Restrooms	N/A	Concrete Block Wall	Non Suspect ACM	374	SF	0	SF		Pipe Chase Access in Room		
1	3	Custodial Closet between Boy's and Girl's Restrooms	N/A	Concrete Floor	Non Suspect ACM	72	SF	0	SF		Pipe Chase Access in Room		
1	3	Stairwell 3 on the Third Floor near Boy's and Girl's Restrooms	N/A	Concrete Ceiling	Non Suspect ACM	720	SF	0	SF				
1	3	Stairwell 3 on the Third Floor near Boy's and Girl's Restrooms	N/A	Concrete Block Wall	Non Suspect ACM	2240	SF	0	SF				
1	3	Stairwell 3 on the Third Floor near Boy's and Girl's Restrooms	N/A	Concrete Floor	Non Suspect ACM	140	SF	0	SF				
1	3	Stairwell 3 on the Third Floor near Boy's and Girl's Restrooms	N/A	Floor Tile VAT 12" x 12"	NAD	580	SF	0	SF	Grey			
1	3	Closet in Hallway next to Classroom 315	N/A	Concrete Ceiling	Non Suspect ACM	15	SF	0	SF				
1	3	Closet in Hallway next to Classroom 315	N/A	Concrete Block Wall	Non Suspect ACM	121	SF	0	SF				
1	3	Closet in Hallway next to Classroom 315	N/A	Floor Tile VAT 12" x 12"	NAD	15	SF	0	SF	White			
1	3	Counselor's Office 315	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	520	SF	0	SF		Pipe Chase Access in Room		
1	3	Counselor's Office 315	N/A	Concrete Ceiling	Non Suspect ACM	158	SF	0	SF		Pipe Chase Access in Room		
1	3	Counselor's Office 315	N/A	Concrete Block Wall	Non Suspect ACM	1144	SF	0	SF		Pipe Chase Access in Room		
1	3	Counselor's Office 315	N/A	Floor Tile VAT 12" x 12"	NAD	675	SF	0	SF	White	Pipe Chase Access in Room		
1	3	Counselor's Office 315 Closet	N/A	Fiberglass Pipe Insulation	Non Suspect ACM	2	LF	0	LF				
1	3	Counselor's Office 315 Closet	N/A	Fiberglass Pipe Fitting Insulation	Non Suspect ACM	2	EA	0	EA				
1	3	Counselor's Office 315 Closet	N/A	Concrete Ceiling	Non Suspect ACM	49	SF	0	SF				
1	3	Counselor's Office 315 Closet	N/A	Concrete Block Wall	Non Suspect ACM	308	SF	0	SF				
1	3	Counselor's Office 315 Closet	N/A	Floor Tile VAT 12" x 12"	NAD	49	SF	0	SF	White			
1	3	Classroom 317	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	520	SF	0	SF				
1	3	Classroom 317	N/A	Concrete Ceiling	Non Suspect ACM	158	SF	0	SF				

7140 New Roberto Clemente/The LINC 2015 2016 AHERA Three-Year Report

		School District of Philadelphia New Roberto Clemente Middle School and The LINC High School 122 West Erie Avenue, Philadelphia, PA 19140 ULCS# 7140 Year Built: 1994	AHERA Three-Year Reinspection 2015-2016 Room by Room Location Log Report							Reinspection Date: 5/3/2016 through 5/6/2016			
										Building Inspector: Paul Davis			
										Number: 050368			
										Management Planner: Megan Vala			
										Number: 740728			
E l e m e n t	F l o o r	On Site Room Name	System Affected	Material Description	Confirmed/Assumed/NAD/ Non Suspect ACM	Amount of Material	SF LF EA	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic/ Crawl Space Ranking	
1	3	Classroom 317	N/A	Concrete Block Wall	Non Suspect ACM	1144	SF	0	SF				
1	3	Classroom 317	N/A	Floor Tile VAT 12" x 12"	NAD	675	SF	0	SF	White			
1	3	Classroom 317 Closet	N/A	Concrete Ceiling	Non Suspect ACM	49	SF	0	SF				
1	3	Classroom 317 Closet	N/A	Concrete Block Wall	Non Suspect ACM	308	SF	0	SF				
1	3	Classroom 317 Closet	N/A	Floor Tile VAT 12" x 12"	NAD	49	SF	0	SF	White			
1	3	Classroom 318	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	520	SF	0	SF				
1	3	Classroom 318	N/A	Concrete Ceiling	Non Suspect ACM	158	SF	0	SF				
1	3	Classroom 318	N/A	Concrete Block Wall	Non Suspect ACM	1144	SF	0	SF				
1	3	Classroom 318	N/A	Floor Tile VAT 12" x 12"	NAD	675	SF	0	SF	White			
1	3	Classroom 318 Closet	N/A	Concrete Ceiling	Non Suspect ACM	6	SF	0	SF				
1	3	Classroom 318 Closet	N/A	Concrete Block Wall	Non Suspect ACM	110	SF	0	SF				
1	3	Classroom 318 Closet	N/A	Floor Tile VAT 12" x 12"	NAD	6	SF	0	SF	White			
1	3	Classroom 316	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	520	SF	0	SF				
1	3	Classroom 316	N/A	Concrete Ceiling	Non Suspect ACM	158	SF	0	SF				
1	3	Classroom 316	N/A	Concrete Block Wall	Non Suspect ACM	1144	SF	0	SF				
1	3	Classroom 316	N/A	Floor Tile VAT 12" x 12"	NAD	675	SF	0	SF	White			
1	3	Classroom 316 Closet	N/A	Concrete Ceiling	Non Suspect ACM	6	SF	0	SF				
1	3	Classroom 316 Closet	N/A	Concrete Block Wall	Non Suspect ACM	110	SF	0	SF				
1	3	Classroom 316 Closet	N/A	Floor Tile VAT 12" x 12"	NAD	6	SF	0	SF	White			
1	3	Electrical Closet next to Classroom 317	N/A	Concrete Ceiling	Non Suspect ACM	15	SF	0	SF				
1	3	Electrical Closet next to Classroom 317	N/A	Concrete Block Wall	Non Suspect ACM	121	SF	0	SF				
1	3	Electrical Closet next to Classroom 317	N/A	Concrete Floor	Non Suspect ACM	15	SF	0	SF				
1	3	Book Closet near Classroom 317	N/A	Concrete Ceiling	Non Suspect ACM	56	SF	0	SF				
1	3	Book Closet near Classroom 317	N/A	Concrete Block Wall	Non Suspect ACM	330	SF	0	SF				
1	3	Book Closet near Classroom 317	N/A	Floor Tile VAT 12" x 12"	NAD	56	SF	0	SF	White			
1	3	Classroom 319	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	632	SF	0	SF				
1	3	Classroom 319	N/A	Concrete Ceiling	Non Suspect ACM	184	SF	0	SF				
1	3	Classroom 319	N/A	Concrete Block Wall	Non Suspect ACM	1276	SF	0	SF				
1	3	Classroom 319	N/A	Floor Tile VAT 12" x 12"	NAD	816	SF	0	SF	White			
1	3	Classroom 319 Closet	N/A	Concrete Ceiling	Non Suspect ACM	6	SF	0	SF				
1	3	Classroom 319 Closet	N/A	Concrete Block Wall	Non Suspect ACM	110	SF	0	SF				
1	3	Classroom 319 Closet	N/A	Floor Tile VAT 12" x 12"	NAD	6	SF	0	SF	White			
1	3	Classroom 320	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	632	SF	0	SF				
1	3	Classroom 320	N/A	Concrete Ceiling	Non Suspect ACM	184	SF	0	SF				
1	3	Classroom 320	N/A	Concrete Block Wall	Non Suspect ACM	1276	SF	0	SF				
1	3	Classroom 320	N/A	Floor Tile VAT 12" x 12"	NAD	816	SF	0	SF	White			
1	3	Classroom 320 Closet	N/A	Concrete Ceiling	Non Suspect ACM	6	SF	0	SF				
1	3	Classroom 320 Closet	N/A	Concrete Block Wall	Non Suspect ACM	110	SF	0	SF				
1	3	Classroom 320 Closet	N/A	Floor Tile VAT 12" x 12"	NAD	6	SF	0	SF	White			
1	3	Classroom 322	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	632	SF	0	SF				
1	3	Classroom 322	N/A	Concrete Ceiling	Non Suspect ACM	184	SF	0	SF				
1	3	Classroom 322	N/A	Concrete Block Wall	Non Suspect ACM	1276	SF	0	SF				
1	3	Classroom 322	N/A	Floor Tile VAT 12" x 12"	NAD	816	SF	0	SF	White			
1	3	Classroom 322 Closet	N/A	Concrete Ceiling	Non Suspect ACM	6	SF	0	SF				
1	3	Classroom 322 Closet	N/A	Concrete Block Wall	Non Suspect ACM	110	SF	0	SF				
1	3	Classroom 322 Closet	N/A	Floor Tile VAT 12" x 12"	NAD	6	SF	0	SF	White			
1	3	Classroom 321	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	632	SF	0	SF				
1	3	Classroom 321	N/A	Concrete Ceiling	Non Suspect ACM	184	SF	0	SF				
1	3	Classroom 321	N/A	Concrete Block Wall	Non Suspect ACM	1276	SF	0	SF				
1	3	Classroom 321	N/A	Floor Tile VAT 12" x 12"	NAD	816	SF	0	SF	White			
1	3	Classroom 321 Closet	N/A	Concrete Ceiling	Non Suspect ACM	6	SF	0	SF				
1	3	Classroom 321 Closet	N/A	Concrete Block Wall	Non Suspect ACM	110	SF	0	SF				
1	3	Classroom 321 Closet	N/A	Floor Tile VAT 12" x 12"	NAD	6	SF	0	SF	White			
1	3	Classroom 324	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	632	SF	0	SF				
1	3	Classroom 324	N/A	Concrete Ceiling	Non Suspect ACM	184	SF	0	SF				
1	3	Classroom 324	N/A	Concrete Block Wall	Non Suspect ACM	1276	SF	0	SF				
1	3	Classroom 324	N/A	Floor Tile VAT 12" x 12"	NAD	816	SF	0	SF	White			
1	3	Classroom 324 Closet	N/A	Concrete Ceiling	Non Suspect ACM	6	SF	0	SF				
1	3	Classroom 324 Closet	N/A	Concrete Block Wall	Non Suspect ACM	110	SF	0	SF				
1	3	Classroom 324 Closet	N/A	Floor Tile VAT 12" x 12"	NAD	6	SF	0	SF	White			
1	3	Classroom 323	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	632	SF	0	SF				
1	3	Classroom 323	N/A	Concrete Ceiling	Non Suspect ACM	184	SF	0	SF				
1	3	Classroom 323	N/A	Concrete Block Wall	Non Suspect ACM	1276	SF	0	SF				

7140 New Roberto Clemente/The LINC 2015 2016 AHERA Three-Year Report

School District of Philadelphia New Roberto Clemente Middle School and The LINC High School 122 West Erie Avenue, Philadelphia, PA 19140 ULCS# 7140 Year Built: 1994			AHERA Three-Year Reinspection 2015-2016 Room by Room Location Log Report								Reinspection Date: 5/3/2016 through 5/6/2016 Building Inspector: Paul Davis Number: 050368 Management Planner: Megan Vala Number: 740728				
E l e m e n t	F l o o r	On Site Room Name	System Affected	Material Description	Confirmed/Assumed/NAD/ Non Suspect ACM	Amount of Material	SF LF EA	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic/ Crawl Space Ranking			
1	3	Classroom 323	N/A	Floor Tile VAT 12" x 12"	NAD	816	SF	0	SF	White					
1	3	Classroom 323 Closet	N/A	Concrete Ceiling	Non Suspect ACM	6	SF	0	SF						
1	3	Classroom 323 Closet	N/A	Concrete Block Wall	Non Suspect ACM	110	SF	0	SF						
1	3	Classroom 323 Closet	N/A	Floor Tile VAT 12" x 12"	NAD	6	SF	0	SF	White					
1	3	Classroom 325	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	632	SF	0	SF						
1	3	Classroom 325	N/A	Concrete Ceiling	Non Suspect ACM	184	SF	0	SF						
1	3	Classroom 325	N/A	Concrete Block Wall	Non Suspect ACM	1276	SF	0	SF						
1	3	Classroom 325	N/A	Floor Tile VAT 12" x 12"	NAD	816	SF	0	SF	White					
1	3	Classroom 325 Closet	N/A	Concrete Ceiling	Non Suspect ACM	6	SF	0	SF						
1	3	Classroom 325 Closet	N/A	Concrete Block Wall	Non Suspect ACM	110	SF	0	SF						
1	3	Classroom 325 Closet	N/A	Floor Tile VAT 12" x 12"	NAD	6	SF	0	SF	White					
1	3	Classroom 326	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	632	SF	0	SF						
1	3	Classroom 326	N/A	Concrete Ceiling	Non Suspect ACM	184	SF	0	SF						
1	3	Classroom 326	N/A	Concrete Block Wall	Non Suspect ACM	1276	SF	0	SF						
1	3	Classroom 326	N/A	Floor Tile VAT 12" x 12"	NAD	816	SF	0	SF	White					
1	3	Classroom 326 Closet	N/A	Concrete Ceiling	Non Suspect ACM	6	SF	0	SF						
1	3	Classroom 326 Closet	N/A	Concrete Block Wall	Non Suspect ACM	110	SF	0	SF						
1	3	Classroom 326 Closet	N/A	Floor Tile VAT 12" x 12"	NAD	6	SF	0	SF	White					
1	3	Classroom 327	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	632	SF	0	SF						
1	3	Classroom 327	N/A	Concrete Ceiling	Non Suspect ACM	184	SF	0	SF						
1	3	Classroom 327	N/A	Concrete Block Wall	Non Suspect ACM	1276	SF	0	SF						
1	3	Classroom 327	N/A	Floor Tile VAT 12" x 12"	NAD	816	SF	0	SF	White					
1	3	Classroom 327 Closet	N/A	Concrete Ceiling	Non Suspect ACM	6	SF	0	SF						
1	3	Classroom 327 Closet	N/A	Concrete Block Wall	Non Suspect ACM	110	SF	0	SF						
1	3	Classroom 327 Closet	N/A	Floor Tile VAT 12" x 12"	NAD	6	SF	0	SF	White					
1	3	Classroom 328	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	632	SF	0	SF						
1	3	Classroom 328	N/A	Concrete Ceiling	Non Suspect ACM	184	SF	0	SF						
1	3	Classroom 328	N/A	Concrete Block Wall	Non Suspect ACM	1276	SF	0	SF						
1	3	Classroom 328	N/A	Floor Tile VAT 12" x 12"	NAD	816	SF	0	SF	White					
1	3	Classroom 328 Closet	N/A	Concrete Ceiling	Non Suspect ACM	6	SF	0	SF						
1	3	Classroom 328 Closet	N/A	Concrete Block Wall	Non Suspect ACM	110	SF	0	SF						
1	3	Classroom 328 Closet	N/A	Floor Tile VAT 12" x 12"	NAD	6	SF	0	SF	White					
1	3	Stairwell 4 near Classroom 327	N/A	Fiberglass Pipe Insulation	Non Suspect ACM	16	LF	0	LF						
1	3	Stairwell 4 near Classroom 327	N/A	Fiberglass Pipe Fitting Insulation	Non Suspect ACM	2	EA	0	EA						
1	3	Stairwell 4 near Classroom 327	N/A	Concrete Ceiling	Non Suspect ACM	595	SF	0	SF						
1	3	Stairwell 4 near Classroom 327	N/A	Concrete Block Wall	Non Suspect ACM	2080	SF	0	SF						
1	3	Stairwell 4 near Classroom 327	N/A	Concrete Floor	Non Suspect ACM	88	SF	0	SF						
1	3	Stairwell 4 near Classroom 327	N/A	Floor Tile VAT 12" x 12"	NAD	328	SF	0	SF	Grey					
1	3	Girl's Restroom	N/A	Fiberglass Ceiling Tile 2' x 4'	Non Suspect ACM	322	SF	0	SF						
1	3	Girl's Restroom	N/A	Concrete Block Wall	Non Suspect ACM	666	SF	0	SF						
1	3	Girl's Restroom	N/A	Ceramic Tile Floors	Non Suspect ACM	322	SF	0	SF						
1	3	Boy's Restroom	N/A	Fiberglass Ceiling Tile 2' x 4'	Non Suspect ACM	300	SF	0	SF						
1	3	Boy's Restroom	N/A	Concrete Block Wall	Non Suspect ACM	650	SF	0	SF						
1	3	Boy's Restroom	N/A	Ceramic Tile Floors	Non Suspect ACM	300	SF	0	SF						
1	3	Clemente MS Vice Principal's Office 332	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	410	SF	0	SF						
1	3	Clemente MS Vice Principal's Office 332	N/A	Concrete Block Wall	Non Suspect ACM	950	SF	0	SF						
1	3	Clemente MS Vice Principal's Office 332	N/A	Floor Tile VAT 12" x 12"	NAD	410	SF	0	SF	White					
1	3	Classroom 314	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	775	SF	0	SF						
1	3	Classroom 314	N/A	Concrete Block Wall	Non Suspect ACM	1000	SF	0	SF						
1	3	Classroom 314	N/A	Floor Tile VAT 12" x 12"	NAD	775	SF	0	SF	White					
1	3	Classroom 314 Closet	N/A	Concrete Ceiling	Non Suspect ACM	12	SF	0	SF						
1	3	Classroom 314 Closet	N/A	Concrete Block Wall	Non Suspect ACM	150	SF	0	SF						
1	3	Classroom 314 Closet	N/A	Floor Tile VAT 12" x 12"	NAD	12	SF	0	SF	White					
1	3	Hallway from Classroom 301 to Room 333	N/A	Ceiling Tile 2' x 4'	Non Suspect ACM	182	SF	0	SF						
1	3	Hallway from Classroom 301 to Room 333	N/A	Concrete Ceiling	Non Suspect ACM	2200	SF	0	SF						
1	3	Hallway from Classroom 301 to Room 333	N/A	Concrete Block Wall	Non Suspect ACM	8200	SF	0	SF						
1	3	Hallway from Classroom 301 to Room 333	N/A	Floor Tile VAT 12" x 12"	NAD	2385	SF	0	SF	White					
1	3	Hallway from Girl's Restroom to Stairwell 4 & Elevator	N/A	Concrete Ceiling	Non Suspect ACM	2480	SF	0	SF						
1	3	Hallway from Girl's Restroom to Stairwell 4 & Elevator	N/A	Concrete Block Wall	Non Suspect ACM	8350	SF	0	SF						
1	3	Hallway from Girl's Restroom to Stairwell 4 & Elevator	N/A	Floor Tile VAT 12" x 12"	NAD	2480	SF	0	SF	White					
1	A	Attic - None	X	X	X	X	X	X	X		None				
1	C	Crawl Space - None	X	X	X	X	X	X	X		None				

Section III Certificates

A. Management Planner/Building Inspector Certificates

Section III – A

Management Planner/Building Inspector Certificates

These charts indicate the Name, Course Date, Expiration Date and Corresponding Certificate Number of the Management Planner and Building Inspector of individuals that participated in the AHERA 3 Year Inspection and Management Plan process of 2015/2016.

Management Planner	Date Granted	Expiration Date	Certificate Number
Monique Causley	2/15/2015	2/16/2016	ACC-0215-8-010
Monique Causley	2/16/2016	2/17/2017	ACC-0216-8-001
Megan Vala	5/22/2015	6/22/2016	740728
Mary Anne Lerro	4/5/2016	4/5/2017	742327

Building Inspector	Date Granted	Expiration Date	Certificate Number
Scott Magee	8/15/2015	8/15/2016	70016699C
William Garrity	8/15/2015	8/15/2016	70016699A
Bernard Brunner	10/2/2015	8/2/2016	45397
Mary Anne Lerro	3/3/2015	3/3/2016	740092
Mary Anne Lerro	4/5/2016	4/5/2017	742322
James Madden	12/11/2014	12/11/2015	ACC-1214-6-010
James Madden	12/3/2015	12/3/2016	ACC-1215-6-018
Troy Ray	3/15/2015	3/19/2016	ACC-0355-6-011
Ananth Vinjamuri	9/29/2015	9/29/2016	374
Shelton Williams	9/29/2015	9/29/2016	375
Paul Davis	2/12/2015	2/12/2016	ACC-0215-6-015
Paul Davis	2/2/2016	2/2/2017	741836
Bernard Bryson	2/16/2015	2/16/2016	ACC-0125-6-031
Bernard Bryson	2/15/2016	2/15/2017	ACC-0216-6-005
Alexander Roman	9/18/2015	9/18/2016	EHSBIR-150619-008
Norm Harrison	9/2/2015	9/2/2016	ACC-0915-6-011
Kelly Mayberry	2/20/2015	2/20/2016	EHSBIR-150220-005
Kelly Mayberry	2/18/2016	2/18/2017	EHSBIR-160218-006
Andrew Hine	5/6/2015	5/6/2016	AI05042015-3
Maryellen Leotta	2/12/2015	2/12/2016	ACC-0215-6-024

Certificate of Completion

awarded to

Monique Causley

for successfully completing the prescribed course of study in

Pennsylvania Asbestos Management Planner Refresher Course

under TSCA Title II

presented by

ACCESS TRAINING SERVICES, INC.
7921 River Road, Pennsauken, NJ 08110
(856) 665-3449

2/16/15

Course Date

N/A

Exam Date

2/16/16

Expiration Date

Not Provided

Social Security Number

ACC-0215-8-010

Certificate Number

Mark K. Schlager
Training Director

Certificate of Completion

awarded to

Monique Causley

for successfully completing the prescribed course of study in

Pennsylvania Asbestos Management Planner Refresher Course

under TSCA Title II

presented by

ACCESS TRAINING SERVICES, INC.
7921 River Road, Pennsauken, NJ 08110
(856) 665-3449

2/15/16

Course Date

N/A

Exam Date

2/15/17

Expiration Date

Not Provided

Social Security Number

ACC-0216-8-001

Certificate Number

Mark K. Schlüger
Training Director

Certificate of Training

CRITERION LABORATORIES, INC.

HEREBY CERTIFIES THAT

Megan Vala

HAS SUCCESSFULLY COMPLETED A 16 HOUR COURSE ENTITLED

Asbestos Management Planner Initial

INCLUDING CLASSROOM INSTRUCTION

05/21/2015 to 05/22/2015


Exam passed on this 22nd day of May 2015 - Score - 94

Approved for AHERA Accreditation Under TSCA Title II

3370 Progress Drive, Suite J
Bensalem, PA 19020
(215) 244-1300 - Phone
(215) 244-4349 - Fax
www.criterionlabs.com

Course is conducted in English

DIRECTOR:


James A. Welte, CIH, President

Certificate of Training

CRITERION LABORATORIES, INC.

HEREBY CERTIFIES THAT

Mary Anne Lerro

HAS SUCCESSFULLY COMPLETED A 4 HOUR COURSE ENTITLED

Asbestos Management Planner Refresher

INCLUDING CLASSROOM INSTRUCTION

on this 5th day of April 2016

Approved for AHERA Accreditation Under TSCA Title II

3370 Progress Drive, Suite J
Bensalem, PA 19020
(215) 244-1300 - Phone
(215) 244-4349 - Fax
www.criterionlabs.com

Course is conducted in English

DIRECTOR:

James A. Welts

James A. Welts, CIH, President

EMSL ANALYTICAL, INC.

Certifies that

Scott Magee

has successfully completed the course of study for the

Asbestos Building Inspector Refresher Course

for Accreditation under TSCA Title II

EMSL Certificate No. 70016699C


Approved by:

PA Dept. of Labor and Industry
Accreditation # 137

Course Date: 8/15/2015
Granted: 8/15/2015
Expiration Date: 8/15/2016

Sponsored by:

EMSL Analytical, Inc.
200 Route 130 North
Cinnaminson, NJ 08077
Phone: (800) 220-3675
Fax: (856) 786-5973
www.emsl.com

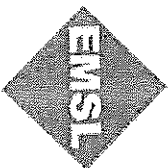

Michael P. Menz

Michael P. Menz, CIH
Training Director

Environmental, Mold, Bacteria, IAQ, Asbestos, Lead, Forensic and Materials Testing Since 1981

EMSL ANALYTICAL, INC.

Certifies that

William Garrity

has successfully completed the course of study for the

Asbestos Building Inspector Refresher Course

for Accreditation under TSCA Title II

EMSL Certificate No. 70016699A


Approved by:

PA Dept. of Labor and Industry
Accreditation # 137

Course Date: 8/15/2015
Granted: 8/15/2015
Expiration Date: 8/15/2016

Sponsored by:

EMSL Analytical, Inc.
200 Route 130 North
Cinnaminson, NJ 08077
Phone: (800) 220-3675
Fax: (856) 786-5973
www.emsl.com

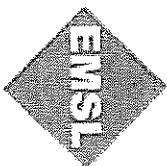

Michael P. Menz

Michael P. Menz, CIH
Training Director

Environmental, Mold, Bacteria, IAQ, Asbestos, Lead, Forensic and Materials Testing Since 1981

45397

National Asbestos & Environmental Training Institute

CERTIFICATE OF COMPLETION

AHERA/EPA Accredited Per 40 CFR Part 763
Asbestos Accreditation under TSCA Title II

This is to certify that


Bernard Brunner, Jr.

Successfully completed the course entitled

**1/2-Day New York State/EP A/AHERA Asbestos Building Inspector Annual Refresher on
October 2, 2015**

Examination Passed October 2, 2015

Expiration Date on October 2, 2016

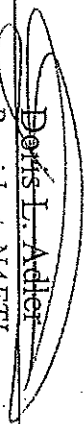
Doris L. Adler
President, NAEETI

Per 10 NYCRR Part 73.2 (L) (1), DOH 2832 Certificate of Completion of Asbestos
Safety Training is the only official record of training for N.Y.S. students.

Language: English

ABIH 1/2 CM POINT

3321 Doris Avenue, Building B, Ocean, NJ 07712

Phone (732) 531-5571

Fax (732) 531-5956

www.naeti.com

Number 740092

Expiration Date:
03/03/2016

Certificate of Training

CRITERION LABORATORIES, INC.

HEREBY CERTIFIES THAT

Mary Anne Lerro

HAS SUCCESSFULLY COMPLETED A 4 HOUR COURSE ENTITLED

Asbestos Building Inspector Refresher

on this 3rd day of March 2015

Exam passed on this 3rd day of March 2015 - Score - 84

Approved for AHERA Accreditation Under TSCA Title II

3370 Progress Drive, Suite J
Bensalem, PA 19020
(215) 244-1300 - Phone
(215) 244-4349 - Fax
www.criterionlabs.com

Course is conducted in English

DIRECTOR:

James A. Welts

James A. Welts, CIH, President

Number 742322

Expiration Date:
04/05/2017

Certificate of Training

CRITERION LABORATORIES, INC.

HEREBY CERTIFIES THAT

Mary Anne Lerro

HAS SUCCESSFULLY COMPLETED A 4 HOUR COURSE ENTITLED

Asbestos Building Inspector Refresher

INCLUDING CLASSROOM INSTRUCTION

on this 5th day of April 2016

Exam passed on this 5th day of April 2016 - Score - 88

Approved for AHERA Accreditation Under TSCA Title II

3370 Progress Drive, Suite J
Bensalem, PA 19020
(215) 244-1300 - Phone
(215) 244-4349 - Fax
www.criterionlabs.com

Course is conducted in English

DIRECTOR:

James A. Welts

James A. Welts, CIH, President

Certificate of Completion

James Madden

for successfully completing the prescribed course of study in

Pennsylvania Asbestos Building Inspector Refresher Course

under TSCA Title II

presented by

ACCESS TRAINING SERVICES, INC.
7921 River Road, Pennsauken, NJ 08110
(856) 665-3449

12/11/14

Course Date

N/A

Exam Date

12/11/15


Expiration Date

Not Provided

Social Security Number

ACC-1214-6-010

Certificate Number


Mark K. Schlager
Training Director

Certificate of Completion

James Madden

for successfully completing the prescribed course of study in

Pennsylvania Asbestos Building Inspector Refresher Course

under TSCA Title II

presented by

ACCESS TRAINING SERVICES, INC.
7921 River Road, Pennsauken, NJ 08110
(856) 665-3449

12/3/15

Course Date

N/A

Exam Date

12/3/16

Expiration Date

Not Provided

Social Security Number

ACC-1215-6-018

Certificate Number

Mark K. Schlager
Training Director

Certificate of Completion

Troy A. Ray

for successfully completing the prescribed course of study in

Pennsylvania Asbestos Building Inspector Refresher Course

under TSCA Title II

presented by

ACCESS TRAINING SERVICES, INC.
7921 River Road, Pennsauken, NJ 08110
(856) 665-3449

3/19/15

Course Date

N/A

Exam Date

3/19/16

Expiration Date

Not Provided

Social Security Number

ACC-0355-6-011

Certificate Number

Mark K. Schlager
Training Director

CERTIFICATE NO 374

G&C Environmental Services, Inc. (#294)

2 Street Road, Newtown Square, Pennsylvania 19073

Telephone: (610) 993-9202 Facsimile: (610) 993-9232

Email: Training@gcenviro.com

www.GCenviro.com

This document certifies that Ananth K. Vinjamuri has successfully completed this State of New York Department of Health Approved AHERA BUILDING INSPECTOR

REFRESHER COURSE, completed as required for asbestos accreditation under the Toxic

Substances Control Act, Title II. This course was held from 09/29/2015 to 09/29/2015.

The examination date was 09/29/2015. This certificate expires one year from the date of
successful completion of the examination 09/29/2016.

The official record of successful training completion is the New York State Department of Health certificate of asbestos safety training completion (DPH 2832).

Gail M. Conner
Training Director

Gail M. Conner

CERTIFICATE NO 375

G&C Environmental Services, Inc. (#294)

2 Street Road, Newtown Square, Pennsylvania 19073

Telephone: (610) 993-9202 Facsimile: (610) 993-9232

Email: Training@gcenviro.com

www.GCenviro.com

This document certifies that Shelton Williams has successfully completed this

State of New York Department of Health Approved AHERA BUILDING INSPECTOR

REFRESHER COURSE, completed as required for asbestos accreditation under the Toxic

Substances Control Act, Title II. This course was held from 09/29/2015 to 09/29/2015.

MM DD YR MM DD YR

The examination date was 09/29/2015. This certificate expires one year from the date of

MM DD YR

successful completion of the examination 09/29/2016.

MM DD YR

The official record of successful training completion is the New York State Department of Health certificate of asbestos safety training completion (DPH 2832).

Gail M. Conner

Training Director

Gail M. Conner

Certificate of Completion

Paul M. Davis

for successfully completing the prescribed course of study in

Pennsylvania Asbestos Building Inspector Refresher Course

under TSCA Title II

presented by

ACCESS TRAINING SERVICES, INC.
7921 River Road, Pennsauken, NJ 08110
(856) 665-3449

2/12/15

Course Date

N/A

Exam Date

2/12/16


Expiration Date

Not Provided

Social Security Number

ACC-0215-6-015

Certificate Number


Mark K. Schlager
Training Director

Certificate of Training

CRITERION LABORATORIES, INC.

HEREBY CERTIFIES THAT

Paul M. Davis

HAS SUCCESSFULLY COMPLETED A 4 HOUR COURSE ENTITLED
Asbestos Building Inspector Refresher

INCLUDING CLASSROOM INSTRUCTION

on this 2nd day of February 2016

Exam passed on this 2nd day of February 2016 - Score - 92

Approved for AHERA Accreditation Under ISCA Title II

3370 Progress Drive, Suite J
Bensalem, PA 19020
(215) 244-1300 - Phone
(215) 244-4349 - Fax
www.criterionlabs.com

Course is conducted in English

DIRECTOR:

James A. Wells

James A. Wells, CIH, President

Certificate of Completion

Bernard J. Bryson

for successfully completing the prescribed course of study in

Pennsylvania Asbestos Building Inspector Refresher Course

under TSCA Title II

presented by

ACCESS TRAINING SERVICES, INC.
7921 River Road, Pennsauken, NJ 08110
(856) 665-3449

2/16/15
Course Date

N/A

Exam Date

2/16/16

Expiration Date

Not Provided

Social Security Number

ACC-0125-6-031

Certificate Number

Mark K. Schlager
Training Director

Certificate of Completion

Bernard J. Bryson

for successfully completing the prescribed course of study in

Pennsylvania Asbestos Building Inspector Refresher Course

under TSCA Title II

presented by

ACCESS TRAINING SERVICES, INC.
7921 River Road, Pennsauken, NJ 08110
(856) 665-3449

2/15/16

Course Date

N/A

Exam Date

2/15/17

Expiration Date

Not Provided

Social Security Number

ACC-0216-6-005

Certificate Number

Mark K. Schläger
Training Director

EHS TRAINING INSTITUTE, INC.

A Division of BATTI, Inc.

Certificate of Completion

AHERA Building Inspector

(Refresher)

Awarded To:

Alexander Roman

SS#:XXX-XX-1743

Who has completed this 4-hour course and examination,

EPA Approved under TSCA Title II

AHERA / ASHARA Rule

40 CFR Part 763.

EHS TRAINING INSTITUTE, INC.

A Division of BATTI, Inc.

Delaware Industrial Park • 6 Garfield Way

Newark, DE 19713-5817

(302) 737-3376 • Fax (302) 737-5764

Course Date: September 18, 2015

Date of Expiration: September 18, 201

Certification Number : EHSBIR 150619-008


Todd K. Zeisloff, Instructor


Neeraj K. Batta, President

Certificate of Completion

Norman Harrison

for successfully completing the prescribed course of study in

Pennsylvania Asbestos Building Inspector Refresher Course

under TSCA Title II

presented by

ACCESS TRAINING SERVICES, INC.
7921 River Road, Pennsauken, NJ 08109
(856) 665-3449

9/2/15

Course Date

N/A

Exam Date

9/2/16


Expiration Date

Not Provided

Social Security Number

ACC-0915-6-011

Certificate Number

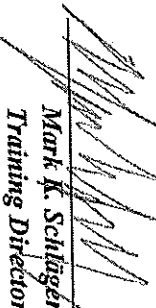
Mark A. Schlenger
Training Director

EHS TRAINING INSTITUTE, INC.
A Division of BATTI, Inc.

Certificate of Completion

AHERA Building Inspector

(Refresher)

Awarded To:

Kelly Mayberry

SS#:XXX-XX-1551

Who has completed this 4-hour course and examination,
EPA Approved under TSCA Title II
AHERA / ASHARA Rule
40 CFR Part 763.

EHS TRAINING INSTITUTE, INC.

A Division of BATTI, Inc.

Delaware Industrial Park • 6 Garfield Way

Newark, DE 19713-5817

(302) 737-3376 • Fax (302) 737-5764

Course Date: February 20, 2015

Date of Expiration: February 20, 2016

Certification Number : EHSBIR 150220-005


Todd K. Zeisloft, Instructor


Neeraj K. Batta, President

EHS TRAINING INSTITUTE, INC.
A Division of BATTI, Inc.

Certificate of Completion

AHERA Building Inspector

(Refresher)

Awarded To:

Kelly Mayberry

SS#:XXX-XX-1551

Who has completed this 4-hour course and examination,

EPA Approved under TSCA Title II

AHERA / ASHARA Rule

40 CFR Part 763.

EHS TRAINING INSTITUTE, INC.

A Division of BATTI, Inc.

Delaware Industrial Park • 6 Garfield Way

Newark, DE 19713-5817

(302) 737-3376 • Fax (302) 737-5764

Course Date: February 18, 2016

Date of Expiration: February 18, 2017

Certification Number : EHSBIR 160218-006



Todd K. Zeisloft, Instructor



Neeraj K. Batta, President

AEROSOL MONITORING & ANALYSIS, INC.

This is to certify that
ANDREW HINE

*has met the attendance requirements and successfully completed
the course entitled*

3-DAY EPA AHERA INSPECTOR

For Accreditation Under TSCA Title II

05/04/2015 to 05/06/2015

Course Date

05/06/2015

Exam Date

5/6/2016

Expiration Date

STEVE SIERAGI

Principal Instructor

Steve Sieragi

A105042015-3

Certification No.

E. Rush Barnett

Course Director

E. Rush Barnett

1331 Ashton Road

P.O.Box 646

Hanover, MD 21076

P: 410-684-3327

F: 410-684-3724

www.amatraining.com

Certificate of Completion

Maryellen Leotta

for successfully completing the prescribed course of study in

Pennsylvania Asbestos Building Inspector Refresher Course

under TSCA Title II

presented by

ACCESS TRAINING SERVICES, INC.
7921 River Road, Pennsauken, NJ 08110
(856) 665-3449

2/12/15

Course Date

N/A

Exam Date

2/12/16

Expiration Date

Not Provided

Social Security Number

ACC-0215-6-024

Certificate Number

Mark K. Schlüger
Training Director

Asbestos Hazard Emergency Response Act (AHERA) Environmental Compliance Audit Cross Reference Table

In response to the AHERA Environmental Compliance Audit a Cross Reference Table has been prepared for inclusion into the Environmental Management Plan. The purpose of this Cross Reference Table is to link the following documents to the AHERA Management Plan.

Cross Reference Table	
3 Year Reinspection Report follows this Cross Reference Table documentation.	
Subject Matter	Location of Required Documents
Designated Person	Pages 1 - 3
Annual Notification	Pages 4 - 5
6 Month Periodic Surveillance Outline of Events	Page 6
3 Year Re-inspections Outline of Events	Page 7
Asbestos Management Program (operations and maintenance)	Pages 8 - 19
Asbestos Investigation Report (AIR)	Attachment 1 Letter Dated August 4, 2006
Training (included in the Asbestos Management Program)	<p>The original records are centralized at the School District's Environmental Library. Copies are maintained on staff and are required to be maintained in the latest Reinspection Report.</p> <p>2 hour awareness training records for all Building Engineers, Custodian Assistants and maintenance personnel</p> <p>40 hour worker/supervisor training records for the OEMS A-Team and various AST tradesmen.</p>
Response Actions (monthly mailings if applicable)	<p>The original documents are on file at the School District's Environmental Library.</p> <p>Copies of the original are mailed to the Schools Main Office for retention with the Management Plan documentation. These documents are typically kept separate from the management plan in an update binder due to the potential volume of response action reports.</p>

SCHOOL DISTRICT OF PHILADELPHIA

ASBESTOS DESIGNATED PERSON

Gerald F Junod
Office of Capital Programs
Environmental Management & Services
440 N Broad Street, 3rd Floor
Philadelphia, PA 19130
Telephone: 215 400 6738
Fax: 215 400 4751

Drexel University- Asbestos Building Inspector Course	January 9-11, 1989 24 Hours
Drexel University- Asbestos Management Planner Course	January 12-13, 1989 16 Hours
Criterion Laboratories, Inc. - Asbestos Management Planner Course	October 11-12, 2012 16 Hours

<u>Annual Building Inspector Refreshers</u>	1990 to Present
4 Hours	
Drexel University	
Criterion Laboratories, Inc	
Access Training Services, Inc.	

<u>Annual Building Management Planner Refreshers</u>	1990 to 1994
4 Hours	
Drexel University	
Criterion Laboratories, Inc	2013 to Present
4 Hours	

Environmental Manager, School District of Philadelphia

Manages the design and implementation of asbestos and lead projects for the Capital Improvement Program and other District Departments including Facilities & Operations and Information Technology. Ensures that asbestos abatement and lead remediation projects are expertly designed and executed in accordance with industry best management practice standards and regulations.

Manager, City of Philadelphia Asbestos Control Program

Served as the Asbestos Control Program Manager for the City of Philadelphia, Department of Public Health, Air Management Services, Asbestos Control Unit from August 1, 2003 through October 23, 2006.

Mid Atlantic Regional Environmental Consortium (MAREC)

Former member with attendance and participation commitments of all quarterly EPA Region III and yearly National Asbestos Regulatory Conferences sponsored by the EPA and the National Conference of State Legislators respectively as a representative for the City of Philadelphia Department of Public Health Air Management Services from 1994 through 2006.

Philadelphia Environmental Task Force

Former member of the Philadelphia Environmental Task force as a representative and point of contact for the City of Philadelphia Department of Public Health Air Management Services Asbestos Control Unit from 2002 through 2006.

Asbestos Instructor

Worked as the primary instructor for the initial and annual Asbestos Project Inspector training and licensing program as mandated by City of Philadelphia Department of Public Health Asbestos Control Regulations from August 1994 through October 2006.

Worked as a lead instructor with an Environmental Consulting Firm and approved by the US EPA for the initial and annual refresher training courses for various asbestos occupational disciplines such as the Building Inspector, Management Planner and Worker/Supervisor from 1991 through 1994.

I certify that the general, local agency responsibilities as stipulated in Section 763.84 will be met.




Gerald F. Junod
Asbestos Designated Person
Environmental Manager
Office of Environmental Management and Services

SCHOOL DISTRICT OF PHILADELPHIA

Accreditation Information Statement

All persons who inspect for Asbestos Containing Building Materials (ACBM) and who will design or carry out response actions with respect to assumed and confirmed ACBM, will be accredited by an EPA approved course and/or a State Contractors Accreditation Program under Sections 206 (c) and 206 (b) of Title II of the ACT.

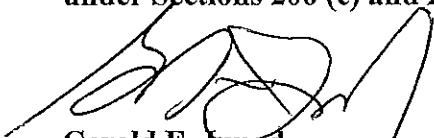

Gerald F. Junod
Asbestos Designated Person
Environmental Manager
Office of Environmental Management and Services

SCHOOL DISTRICT OF PHILADELPHIA
OFFICE OF CAPITAL PROGRAMS
440 NORTH BROAD STREET, SUITE 373
PHILADELPHIA, PENNSYLVANIA 19130

OFFICE OF ENVIRONMENTAL MANAGEMENT AND SERVICES

PHONE (215)-400-4750

September 2015

TO: Principals
Building Administrators/Occupants
Parents/Guardians

FROM: Fran Burns
Chief Operating Officer

Francine Locke, M.S., Director
Office of Environmental Management and Services

SUBJECT: Annual EPA Notification Letter

Pursuant to the Federal Environmental Protection Agency (EPA) mandate, as required by 40 C.F.R. 763.84 (c)(d) of public access to environmental records, this letter is to acknowledge the availability of your facility's Asbestos Hazard Emergency Response Act (AHERA) Management Plan.

Each member of the school staff, parents/guardians, temporary workers and/or contractors, are required to receive a copy of the Notification Letter. At the direction of the Principal, a copy is to be posted on the bulletin boards and an appropriate amount of copies are to be generated for distribution.


Note: The AHERA Three-Year Reinspection reports, in colored binders; White with Pink, Tan, Black, Red, Dark Blue, Green, Yellow and White, are Federal EPA mandated inspection documents. The School District of Philadelphia is subject to severe monetary penalties if the reports and associated paperwork are not available to the EPA and the public upon request.

It is incumbent on designated school personnel to gather and retain this data as it is delivered, in one location for future review. Acceptable locations include the Principal's Office or Main Office for the primary data. The Building Engineer should maintain any secondary or duplicate copies.

If you have any questions, please call 215-400-4750. Thank you for your cooperation.



Fran Burns
Chief Operating Officer

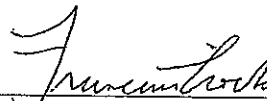

Francine Locke, M.S., Director
Office of Environmental Management
and Services

c: Danielle Floyd

AHERA-4
8/21/15



School District of Philadelphia
OFFICIAL NOTICE

PLEASE POST

September 2015

TO: Principals
Building Administrators
Building Engineers
Building Occupants
Parents/Guardians

FROM: Fran Burns
Chief Operating Officer

Francine Locke, M.S., Director
Office of Environmental Management and Services

SUBJECT: Annual Notification Letter: Asbestos Hazard Emergency Response Act

The Federal Register published on October 30, 1987, Subpart E, in Schools: Final Rule and Notice, 763.84 (c)(d) states that each local education agency shall ensure that workers and building occupants or guardians are to be informed at least once each school year about inspections, response actions and post-response action activities including re-inspections and periodic surveillance activities. The School District as the Local Education Agency (LEA), retains such reports that are available for public inspection in the Office of the Principal or Building Administrator.

The Principal or Building Administrator is required to do the following with this notification:

- 1) Post in a Public Place or Main Office
- 2) Inform Building Occupants
- 3) Send a copy of this notification to Parents or Guardians
- 4) Insert a copy into the latest AHERA Three-Year Reinspection report (white/pink binder) in your office or facility.

Handwritten signature of Fran Burns in black ink.

Fran Burns
Chief Operating Officer

Handwritten signature of Francine Locke in black ink.

Francine Locke, M.S., Director
Office of Environmental Management
and Services

c: Danielle Floyd

AHERA-4a
8/21/15

SCHOOL DISTRICT OF PHILADELPHIA
Education Center
440 North Broad Street
Philadelphia, Pennsylvania 19130

Office of Environmental Management and Services

215-400-4750

AHERA
Six Month Surveillance
Outline of Events

- Pursuant to the Federal Environmental Protection Agency (EPA) mandate, as required by 40 CFR 763.92(b), the following procedure is to be implemented. At least once every six (6) months after a Management Plan is in effect, each Local Education Agency (LEA) shall conduct a periodic surveillance in each building that it owns or leases that contains Asbestos Containing Building Materials (ACBM) or is assumed to contain ACBM.
- The first Bi-Annual Inspection starts in the Spring (March, April, May) and again in the Fall (October, November, December) of each year. The Building Engineer/Assistant should assist the Building Inspector with appropriate access to all areas including (Crawlspaces/Attics) and rooms in the facility. There is no action required of the Principal.
- The Building Inspector shall visually inspect all areas that are identified in the Management Plan as ACBM or assumed ACBM. The date of the surveillance is recorded, the inspectors name and any changes in the conditions of the materials.
- The Building Inspector shall make a copy of the inspection document and insert into the front of the latest Management Plan (AHERA Three Year Reinspection report). The original document is returned to the LEA's Environmental Library and filed.

SCHOOL DISTRICT OF PHILADELPHIA
Education Center
440 North Broad Street
Philadelphia, Pennsylvania 19130

Office of Environmental Management and Services

215-400-4750

AHERA
Three Year Reinspection
Outline of Events

- Pursuant to the Federal Environmental Protection Agency (EPA) mandate, as required by 40 CFR 763.85(b) the following procedure is to be implemented. At least once every three (3) years after a Management Plan is in effect, each Local Education Agency (LEA) shall conduct a reinspection of each building that it owns or leases that contains Asbestos Containing Building Material's (ACBM's) or is assumed to contain ACBM.
- Subsequent Three Year Re-inspections (2009, 2012, 2015, etc) shall start in the Fall (October, November, December, January). The Building Engineer/Assistant should assist the Building Inspector with appropriate access to all areas including (Crawlspaces/Attics) and rooms in the facility. There is no action required of the Principal.
- An accredited Building Inspector shall visually inspect and touch to determine friability, all areas that are identified in the Management Plan as ACBM or assumed ACBM. The date of the surveillance is recorded, the inspectors name and any changes in the conditions of the materials. The Building Inspectors state of accreditation and license number is required.
- After the inspection, the Building Inspector shall make a copy of the inspection documents and insert into the front of the latest Management Plan (AHERA Three Year Reinspection report). The original document is returned to the LEA's Environmental Library and filed.
- The Building Inspector shall return the reinspection data to the Management Planner to be assessed and determine appropriate response actions and a report issued (AHERA Three Year Reinspection report). One copy of the report is delivered to the schools Principal to be permanently retained with all previous environmental data. Another copy is retained in the LEA's Environmental Library.



School District of Philadelphia
Office of Environmental Management & Services
440 North Broad Street
Philadelphia, PA 19130
(215) 400-4750

**School District of Philadelphia
Asbestos Management Program**

TABLE OF CONTENTS

Definitions.....	Page 9
1. Introduction.....	Page 10
2. Summary of Asbestos Management Plan	
3. Asbestos Management Plan Execution.....	Page 11
a. General Execution	
4. Summary of Program Execution	
a. Asbestos Management Plan Execution	
5. Responsibilities	
a. OEMS	
b. Asbestos Worker/Supervisor “A-TEAM”.....	Page 12
c. Asbestos Designated Person	
d. Supervisor or Project Manager (Capital, Maintenance & Facilities)	
e. Employee Capital.....	Page 13
f. Employee Maintenance	
g. Employee Facilities and Custodial	
6. Requirements.....	Page 14
a. Employee Exposure Monitoring	
b. Employee Notification	
c. Observation of Monitoring	
d. Training Program	
e. Access of Information	
f. Record Keeping	
7. AHERA O&M Plan.....	Page 15
a. Controls	
8. O&M Response Actions.....	Page 16
a. Facility Maintenance Isolation of Area	
b. Unlikely Contact with ACM/PACM	
c. Accidental Disturbance of ACM/PACM	
d. Planned Disturbance of ACM/PACM	
e. Miscellaneous ACM/PACM.....	Page 17
f. Vinyl Asbestos Floor Tile	
g. Mastic/Adhesives	
h. Woven Vibration Dampers	
i. Other Work Practices	
j. Fiber Release Episodes	
9. References and Resources.....	Page 18

DEFINITIONS / ACRONYMS

ACM/PACM:	Asbestos Containing Material/Potential Asbestos Containing Material
AHERA:	Asbestos Hazard Emergency Response Act
AIR FORM:	Asbestos Inspection Report Form
Amended Water:	Water to which a surfactant (soap) has been added
AMP:	Asbestos Management Program/Asbestos Management Plan
Asbestos Designate Person:	Individual assigned by the district to oversee asbestos related issues.
Asbestos Regulated Area:	Location that is posted as an asbestos work area in which only approved and accredited personnel are permitted to enter
AST:	Asbestos Support Team involving approved and accredited school district tradespersons personnel that are school district person
A-TEAM:	School District of Philadelphia asbestos workers
CIP:	Capital Improvement Program
Consultant:	Asbestos consulting firm hired by the District
Demolition Directive:	Memorandum – August 4, 2006 from Patrick Henwood
EPA:	Environmental Protection Agency
In House Personnel:	School District of Philadelphia asbestos workers
LEA:	Local Education Agency
O&M:	Operations and Maintenance
OEMS:	Office of Environmental Management and Services
OSHA:	Occupational Safety and Health Administration
PEL:	Permissible Exposure Limit
PSD or SDP:	Philadelphia School District/School District of Philadelphia
PSIT:	Philadelphia School Improvement Team
STEL:	Short Term Exposure Limit

1. Introduction

The School District of Philadelphia, Asbestos Policy Statement:

“The School District of Philadelphia is dedicated to providing a safe and healthful work environment for its employees, students, faculty, contractors and visitors. In recognition of the potential health problems associated with asbestos, the School District of Philadelphia is committed to a comprehensive asbestos control program. This program is implemented and maintained through the School District of Philadelphia's Office of Environmental Management and Services (OEMS).”

OEMS has the responsibility of establishing procedures for asbestos abatement, asbestos inspection, air monitoring, renovation and demolition activities within all School District of Philadelphia owned or leased facilities.

These procedures are developed to ensure that:

- (1) People are not exposed to significant levels of asbestos fibers
- (2) Asbestos waste is handled and disposed of properly
- (3) Members of the School District of Philadelphia community have access to the Office of Environmental Management and Services for information, assistance, guidance, and interpretation regarding asbestos related matters.
- (4) Members of the School District of Philadelphia community have access to the Asbestos Management Plans as required and outlined in the US EPA AHERA regulations including annual written notification to all parents.
- (5) Compliance with all applicable Federal, State and Local Asbestos Regulations

Requirements outlined in this manual are mandatory in nature where the word “SHALL” is used and are advisory in nature where the word “SHOULD” is used.

2. Summary of Asbestos Management Program

The School District of Philadelphia's Asbestos Management Program was established to meet the requirements of Federal, State, and Local Regulations.

These regulations include, but are not limited to:

- US Environmental Protection Agency Asbestos Hazard Emergency Response Act (US EPA AHERA) and National Emissions Standard for Hazardous Air Pollutants subpart M, Part 61 (NESHAP);
- US Department of Labor, Occupational Safety and Health Administration (OSHA) General Industry Standard (29 CFR 1910.1001) and the OSHA Asbestos Standard for the Construction Industry (29 CFR 1926.1101);
- The Commonwealth of Pennsylvania, Department of Labor and Industry, Asbestos Occupations, Accreditation and Certification Act;
- The City of Philadelphia, Department of Public Health, Asbestos Control Regulations.

3. Asbestos Management Program Execution

a) General Execution

The Office of Environmental Management and Services (OEMS) develops, implements and manages safety and health programs for the School District of Philadelphia faculty, staff and students and assists with ensuring that all contractors comply with Federal, State and Local Environmental Regulations. The OEMS provides the oversight of School District of Philadelphia employees (Asbestos A-Team), environmental consultants, and asbestos abatement contractors for all projects within the School District of Philadelphia concerning Asbestos Containing Materials.

The control of safety and health hazards at the School District of Philadelphia is primarily through the implementation of engineering, work practice and administrative controls. Personal Protective Equipment (PPE) is used to supplement these controls or whenever the controls are not feasible or are in the process of being implemented. PPE is also recommended whenever exposures to chemical, physical or biological agents can be prevented or reduced by its use.

This written program establishes the procedures necessary to:

- 1) meet established standards and federal regulations for occupational exposure to asbestos fibers;
- 2) meet the requirements of the City of Philadelphia Asbestos Control Regulations which encompasses the disturbance and/or abatement of asbestos containing building materials;
- 3) provide the necessary health and safety protection to the School District of Philadelphia staff, faculty, students, contractors and visitors.

This program is strengthened by input and cooperation with the Philadelphia Federation of Teachers (PFT), Health and Welfare Fund.

4. Summary of Program Execution

a) Asbestos Management Program Execution

The Asbestos Management Program is administered by the Office of Environmental Management and Services (OEMS). OEMS provides the following services primarily through professional consultants:

- (1) exposure monitoring services;
- (2) building inspection/surveys (bulk sampling) for the identification of asbestos containing materials;
- (3) asbestos project design services;
- (4) asbestos abatement project and air monitoring services;
- (5) emergency response to fiber release episodes;
- (6) education/information;
- (7) medical monitoring;
- (8) training for School District of Philadelphia personnel

5. Responsibilities

a) Office of Environmental Management and Services

OEMS is responsible for performing the following functions:

- (1) Developing and administering of the Asbestos Management Program.
- (2) Providing asbestos-related services to all School District of Philadelphia departments.
- (3) Conducting required training of the Asbestos Management Program and working jointly with departments to schedule training.
- (4) Identifying and posting areas where labeling/signage are required.
- (5) Medical Monitoring of OEMS "A-TEAM" and other departments "AST" Asbestos Program staff.

- (6) Certification and training as required for OEMS "A-TEAM" and other departments "AST" Asbestos program staff.
- (7) Record keeping as outlined in Section 3.5 and all records as by required by US EPA AHERA regulations.

b) Asbestos Worker/Supervisor - "A-TEAM"

- (1) OEMS shall ensure that all "A-TEAM" workers/supervisors adhere to the following requirements:
 - a) Attend an initial Worker/Supervisor Asbestos Course;
 - b) Maintain the annual re-certification per EPA AHERA requirements and Commonwealth of Pennsylvania Asbestos Occupations, Accreditation and Certifications Act;
 - c) Undergo an annual Asbestos Medical Evaluation;
 - d) Undergo an annual Respirator Medical Clearance;
 - e) Undergo an annual Respirator Fit Testing.

c) Asbestos Designated Person

The Asbestos Designated Person is responsible for:

- (1) Assuring the health and safety of employees, students and visitors in the School District of Philadelphia facilities under his/her control.
- (2) Being kept informed of all areas under his or her jurisdiction where potential asbestos exposures exist and initiating protection programs that adhere to the Asbestos Management Program requirements of this manual.
- (3) Assuring that Asbestos Management Program requirements are adhered to by principal investigators, project managers, supervisors, or division heads, and School District of Philadelphia personnel under their supervision.
- (4) Ensuring that all employees within the Asbestos Management Program comply with (OSHA 1910.1001 (j) (7) (iv)) and the US EPA AHERA regulations by attending the required training.
- (5) Ensure the posting of:
 - a) Warning labels/signage
 - b) Commonwealth of Pennsylvania Asbestos Abatement and Demolition/Renovation Notification form
 - c) Asbestos Inspection Reports (AIR) form (where required)
 - d) Ensuring that Construction Projects follow the Demolition Directive procedures as outlined in the August 4, 2006 letter.

d) Supervisor or Project Manager (Capital, Maintenance and Facilities)

Each person in charge of a project, maintenance/repair, renovation/demolition, or other activity from the Departments of Capital, Maintenance, and/or Facilities, where asbestos containing material may be present is responsible for:

Identifying, with the assistance of OEMS, asbestos containing building materials prior to any disturbance of these materials. Various Federal (EPA and OSHA) and Local (City of Philadelphia Asbestos Control Regulations) require Asbestos Inspections prior to renovation/demolition activities. This shall be accomplished by always following the Asbestos Management Program Procedures as follows:

- (1) Ensure that the requirements of the Asbestos Management Program Procedures are followed by all personnel, trades, and contractors who are involved with the project;

- (2) Review of the required Asbestos Inspection Report (AIR) form (Attachment 1) and AHERA Management Plan documents prior to activities that may disturb any Asbestos Containing Materials;
- (3) Perform all project related duties as outlined in the Project Management Responsibilities;
- (4) Keep the department chairperson or director informed on any actions proposed or taken regarding the Asbestos Management Plan;
- (5) Ensuring that Construction Projects follow the Demolition Directive procedure outlined in the August 4, 2006 letter.

e) Employee – Capital

School District of Philadelphia Capital employees and/or consultants shall:

- (1) Ensure that no suspect or asbestos containing building materials are disturbed in the course of the projects they are performing or managing. This shall be accomplished by notifying their supervisor and OEMS by issuance of a work order permit (a.k.a PSIT Service Request Form) and verifying that the materials which may be disturbed are non-asbestos containing. If this information is not available or verification has not been made, these materials should not be disturbed.
- (2) Immediately notify OEMS and their supervisor in the event of a potential fiber release episode upon discovery of visible damage to asbestos containing materials.
- (3) Ensuring that Construction Projects follow the Demolition Directive procedures as outlined in the August 4, 2006 letter.

The types of projects represented as part of the Capital Improvement Program are as follows:

- (1) Complete Renovation of an existing building that addresses all facility component concerns and educational program needs;
- (2) Major Renovation of an existing building addressing significant facility component and educational improvements;
- (3) Addition to an existing building (either as an attachment or stand-alone structure) to accommodate needed program space;
- (4) Conversion of an existing facility to accommodate a change in educational program;
- (5) Facility Component Improvement of specific facility needs (i.e. electrical or HVAC system upgrades, ADA improvements, life safety improvements, exterior renovations, etc.)

f) Employee – Maintenance

School District of Philadelphia Maintenance employees shall:

- (1) Ensure that no suspect or asbestos containing building materials are disturbed in the course of their duties or work they are performing. This shall be accomplished by notifying their supervisor and OEMS by issuance of a work order permit and verifying that the materials which may be disturbed are non-asbestos containing. If this information is not available or verification has not been made, these materials should not be disturbed.
- (2) Immediately notify OEMS and their supervisor in the event of a potential fiber release episode or upon discovery of visible damage to asbestos containing materials.
- (3) All employees involved in maintenance activities shall attend required Asbestos Awareness training program within 60 days of employment.

g) Employee – Facilities & Custodial

School District of Philadelphia Facilities and Custodial employees shall:

- (1) Ensure that no suspect or asbestos containing building materials are disturbed in the course of their duties or work they are performing. This shall be accomplished by notifying their supervisor and OEMS by issuance of a work permit and verifying that the materials which may be disturbed are non-asbestos containing. If this information is not available or verification has not been made, these materials should not be disturbed;
- (2) Immediately notify OEMS and their supervisor in the event of a potential fiber release episode or upon discovery of visible damage to asbestos containing materials.
- (3) All employees involved in Facilities and Custodial activities shall attend require Asbestos Awareness training program within 60 days of employment.

6. Requirements

a) Employee Exposure Monitoring

When information indicates that an employee's exposure to asbestos fibers may equal or exceed an 8-hour time-weighted average of 0.1 f/cc * (per OSHA 1910.1001 & 1926.1101), OEMS shall develop and implement an asbestos exposure monitoring program. The sampling strategy shall be designed to identify employees by work task (job classification) that is exposed to asbestos fibers that exceed an 8-hour time-weighted average of 0.1 f/cc.

b) Employee Notification

OEMS shall notify in writing, each employee exposed to asbestos fibers at or above an 8-hour time weighted average of 0.1 f/cc.

c) Observation and Monitoring

OEMS shall provide employees or their representatives with an opportunity to observe any exposure measurements conducted.

d) Training Program

OEMS shall institute a training program which meets the requirements of AHERA for all employees who perform maintenance operations in a facility/school which contains asbestos containing materials or presumed asbestos containing materials and 1910.1001 (j), and the Commonwealth of Pennsylvania Department of Labor and Industry and the City of Philadelphia Asbestos Control Regulations. The affected departments shall ensure employee participation in this program. The OEMS "A-TEAM" and other departments "AST" Asbestos Program staff training shall be conducted annually for each employee as required by all Federal, State and Local for each asbestos discipline.

All Asbestos Awareness training as required by AHERA shall be performed within 60 days of employment and shall include:

- Health effects of asbestos
- Locations of ACM and PACM in the building/facility
- Recognition of CM and PACM damage and deterioration
- Requirements of the OSHA 1910.1001 standard relating to maintenance
- Proper response to fiber release episodes
- Procedure to be followed to isolate areas affected by fiber release

e) Access to Information

OEMS shall make available to affected employees or their representative's copies of the Occupational Safety and Health Administration (OSHA) General Industry Standard Part 1910.1001 and the department shall post a copy in the workplace.

f) Record Keeping

OEMS shall maintain an accurate record of all employee exposure measurements. OEMS and/or the School District of Philadelphia Human Resources Department shall maintain records of employee medical monitoring program. OEMS shall maintain all employee training records. All records shall be provided upon request to employees, former employees, representatives designated by the individual employee.

7. AHERA OPERATIONS AND MAINTENANCE PLAN

a) CONTROLS

i. Work Order System

Minimizing disruption of ACM/PACM during maintenance and renovation activities is the primary goal and task encountered by OEMS. Operations and maintenance employees and contractors should be warned to avoid conducting any maintenance work which may disturb ACM/PACM. Initiating a work order system, where all work orders or requests are channeled through the Office of Environmental Management and Services (OEMS), will be the method used to control and minimize disruption of ACM/PACM.

Any work performed by in-house personnel or contractors that could or will impact ACM/PACM shall be coordinated by OEMS. A completed Asbestos Inspection Report Form (Attachment 1) shall be issued to in-house personnel and/or all contractors whose work could impact ACM/PACM. This form should accompany each contract issued to an outside contractor and posted on the jobsite.

All work order requests for maintenance and renovation activities in areas where ACM/PACM is suspected or known to be present are to be submitted to OEMS prior to proceeding with work. OEMS is responsible for reviewing asbestos survey records for information about the presence of ACM/PACM in the area where the work is to be performed. OEMS should physically inspect the area to ensure existing records reflect actual conditions. If no asbestos is present, a work order is not necessary and the planned actions can proceed. If ACM/PACM is found to be present in the area, OEMS will sign the work order application and obtain an approved and accredited asbestos contractor or assign OEMS "A-TEAM" to abate the ACM/PACM.

ii. Regulated Areas

The owner will identify and regulate all areas where airborne concentrations of ACM/PACM exceed the Permissible Exposure Limit (PEL)* (Per OSHA determined to be 0.1 f/cc) and/or short term exposure limit (STEL) (Per OSHA determined to be 0.1 f/cc), or there is reasonable possibility that the (PEL) and/or (STEL) may be exceeded. All ACM/PACM removal activities involving thermal system insulation ACM/PACM (Class I), surfacing ACM/PACM (Class I), and miscellaneous ACM/PACM such as floor tile, roofing, and siding mastic, etc. (Class II), and repair and maintenance operations where thermal system insulation and surfacing ACM/PACM is likely to be disturbed (Class III) will be performed in accordance with federal, state, and local regulations. All asbestos abatement work and activities will be designed and managed as asbestos regulated areas. These areas will be demarcated and labeled.

iii. Warning Signs

Warning signs shall be displayed at all approaches to each asbestos regulated area. The asbestos abatement contractor will provide OSHA warning signs in all regulated areas during removal, repair, and other maintenance activities. OEMS will provide AIRs to all contractors who must inform all employees and supervisors working in locations contiguous to asbestos regulated areas of the potential hazards and work practices required.

iv. Warning Labels

Warning labels and/or signage shall be affixed to all raw materials, mixtures, scrap, waste, debris, and other products containing asbestos fibers, or to their containers. Generally, the asbestos abatement contractor or OEMS A-Team personnel will provide all warning labels for ACM/PACM containment.

8. O & M RESPONSE ACTIONS

The Asbestos Management Program general O&M procedures are outlined in this section. Additional requirements specific to asbestos abatement activities are included in the Project Design documents for all Asbestos Abatement Work. Regular cleaning, inspection, and reporting of ACM/PACM deterioration or other problems must be diligently practiced by all employees including custodial and maintenance personnel.

a) Facility Maintenance Isolation of Area Responsibilities

Maintenance personnel are often required to work in areas where ACM/PACM may potentially be disturbed. Most maintenance activities are conducted by in-house staff, outside contractors, or a combination.

Emergency fiber release episodes, such as pipe fitting or valve breaks, emergency boiler work, or mechanical equipment repair will be responded to by OEMS A-Team personnel or asbestos abatement contractor personnel. The owner's maintenance staff will: (1) isolate the emergency fiber release area; (2) post warning signs to prevent unauthorized access, and (3) notify their supervisor and OEMS. OEMS will ensure that the fiber release area remains isolated and is properly cleaned by and approved and accredited abatement contractor or by OEMS A-TEAM personnel.

b) Unlikely Contact with ACM/PACM

Maintenance activities or repairs which can be performed without contacting or disturbing the ACM/PACM require little more than normal care and good workmanship. For example, valves which are either uncovered or covered with non-asbestos insulation can be packed or repaired without disturbing asbestos insulation on nearby pipes. The major precaution is to ensure that maintenance and custodial personnel are familiar with procedures such as isolating the area, posting warning signs, and notifying OEMS in the event of any accidental ACM/PACM disturbance.

c) Accidental Disturbance of ACM/PACM

Maintenance and facilities personnel shall notify OEMS any time a fiber release is suspected. If friable ACM/PACM becomes airborne in the building,

d) Planned Disturbance of ACM/PACM

Maintenance activities that may impact ACM/PACM include access to a valve, flange, duct, or related system component.

Where asbestos-containing insulation must be removed to maintain or repair the thermal system, the ACM/PACM will imminently be disturbed. ACM/PACM removal work shall be conducted by OEMS A-Team personnel or an approved and accredited asbestos abatement contractor.

If friable ACM/PACM becomes airborne in the building, maintenance and facilities personnel shall secure the area and contact OEMS. OEMS shall respond accordingly.

e) Miscellaneous ACM/PACM

Miscellaneous types of ACM/PACM may include vinyl asbestos floor tiles, mastics/adhesives and woven vibration dampers. Disturbance of these materials should be avoided. Routine maintenance activities involving these materials should not pose a problem if handled properly. Questions on the proper removal and disposal of miscellaneous ACM/PACM should be directed to OEMS. OEMS will contact an approved and accredited asbestos abatement contractor or utilize OEMS A-TEAM personnel to assist with miscellaneous ACM/PACM clean-up activities.

f) Vinyl Asbestos Floor Tile

Asbestos-containing floor tiles in good condition are considered non-friable unless they are crushed, drilled, sawed, sanded or disturbed by any activity that breaks up the material. Routine maintenance of these materials should employ the use of non-abrasive buffers and wet cleaning technique. Broken or loose floor tiles should be removed and disposed of as asbestos waste by OEMS. Remaining debris should be vacuumed with a HEPA vacuum and the area wet mopped using amended water.

g) Mastics/Adhesives

Mastics and adhesives containing asbestos in good condition are considered non-friable and do not pose a potential health concern unless crushed, drilled, sawed, sanded, or otherwise abraded. Questions on the proper removal should be directed to OEMS.

h) Woven Vibration Dampers

Woven vibration dampers in good condition are considered non-friable and do not pose a potential health concern unless cut, crushed, drilled, sawed, sanded, or otherwise abraded. Questions on the proper removal should be directed to OEMS.

i) Other Work Practices

Any special work not included in this section should be addressed to OEMS for review prior to the initiation of work that may involve the disturbance of ACM/PACM.

j) Fiber Release Episodes

Facilities and maintenance staff should report to OEMS the presence of asbestos debris, water or physical damage to ACM/PACM, or any other evidence of possible fiber release. OEMS should have the OEMS A-Team personnel or an approved and accredited abatement contractor respond to the site to clean up debris and make repairs as soon as possible. OEMS will also contact a consultant to conduct air monitoring and prepare a report and submit at project completion to OEMS for each episode. OEMS will forward the reports for each site location AHERA Management Plan accordingly.

9. REFERENCES and RESOURCES

Applicable regulations for asbestos projects impacted by renovation, demolition, and maintenance activities.

- **Philadelphia Air Management Services – Asbestos Control Unit**
<http://www.phila.gov/health/units/ams/Asbestos/asbestos.html>
- **Pennsylvania Asbestos Occupations, Accreditation and Certification Act**
<http://www.dli.state.pa.us/landi/cwp/view.asp?a=185&q=56262&landiNav=>
- **United States Environmental Protection Agency Asbestos Home Page**
<http://www.epa.gov/asbestos/>
- **Occupational Safety and Health Administration (OSHA) Asbestos Home**
<http://www.osha.gov/SLTC/asbestos>