

LEAD SAFE STABILIZATION  
MAYFAIR ELEMENTARY SCHOOL

3001 Princeton Avenue  
Philadelphia, Pennsylvania 19149  
ULCS # 8300  
EP2022-0004-8300

*prepared for:*

THE SCHOOL DISTRICT OF PHILADELPHIA  
OFFICE OF ENVIRONMENTAL MANAGEMENT

440 North Broad Street  
3rd Floor  
Philadelphia, Pennsylvania 19130

*prepared by:*

SYNERTECH ENVIRONMENTAL LLC

228 Moore Street  
Philadelphia, Pennsylvania 19148  
Project # 010-4799

January 18, 2023  
*Revised 01/26/2023*

Prepared by:



Ryan Hutsell  
Project Manager

## TABLE OF CONTENTS

### I. Introduction

### II. Methods Executive Summary

#### A. Preliminary Steps

- i. Parent and Staff Notifications
- ii. Decluttering
- iii. Wall Hangings
- iv. Swing Space
- v. Facilities Building Cleaning Staff Training

#### B. Pre-Cleaning

#### C. Paint and Plaster Stabilization Procedures

- i. Work Practices
- ii. Oversight

#### D. Cleanup and Completion

- i. Cleanup
- ii. Testing

### III. Oversight

#### A. Scope of Work

#### B. EPA Checklist

#### C. Oversight

#### D. Sample Results

#### Appendix A. Lead Safe Assessment Table

#### Appendix B. Scope of Work Table

#### Appendix C. EPA Checklist Form

#### Appendix D. Oversight Table

#### Appendix E. Lead Safe Certificate

#### Appendix F. Environmental Firm Certifications

#### Appendix G. Paint Contractor Certifications or Documentation of Training

#### Appendix H. Documentation of Parent and Staff Notifications



**Summary of Lead Safe Stabilization Activities  
Mayfair Elementary School  
3001 Princeton Avenue  
Philadelphia, PA 19149  
UCLS #: 8300**

**I. Introduction**

This report outlines the lead safe stabilization work performed by *the School District of Philadelphia* in various areas of the Mayfair Elementary School located at 3001 Princeton Avenue, Philadelphia, Pennsylvania 19149. *Synertech Environmental LLC* provided environmental oversight and documentation of work areas, and verified they were done correctly in accordance with the EPA Renovation, Repair, and Painting Rule (RRP) *EPA-740-R-09-002*.

**II. Methods Executive Summary**

**A. Preliminary Steps**

*i. Detailed Work Scope Determination*

*Synertech Environmental LLC* generated a school-specific scope determination report which detailed the location and quantity of paint and plaster to be stabilized. This report was made available to the school's main office.

*ii. Parent and Staff Notifications*

A letter announcing the paint stabilization project and the EPA Lead RRP pamphlet was provided to the Principal to share with parents and staff. The letter is attached in *Appendix H*.

An email to the principal was sent by the Operations Division in advance of the start of work to announce the commencement of the project. This email was to determine logistical issues such as the school calendar, work schedule, storage and/or swing space, etc.

*iii. Decluttering*

Classrooms, closets, and other storage areas were decluttered prior to commencing stabilization work.

*iv. Wall Hangings*

Posters, bulletin boards, framed art, and other wall hangings were removed in order for the paint stabilization project to commence.

v. *Swing Space*

The identification of swing space was required to ensure that classrooms were available during the school year. A plan was created on a school-specific basis to relocate students and teachers from classrooms during the course of this work. All work areas were scheduled for cleaning by facilities staff after the paint stabilization work by Maintenance.

vi. *Facilities Building Cleaning Staff Training*

Cleaning staff was provided with information about this project and expectations for post-cleaning.

**B. Pre-Cleaning**

On an as-needed basis for areas such as cluttered storage closets that required extensive movement of materials as well as HEPA vacuuming and wet wiping prior to paint and plaster stabilization, the Maintenance Environmental staff performed a pre-cleaning. This process provided a clean work area prior to decluttering and stabilization.

**C. Paint and Plaster Stabilization Procedures**

i. *Work Practices*

Paint and plaster stabilization work complied with the EPA's Lead RRP Rule. All staff conducting this work was trained and/or certified as Lead RRP Workers. The following procedures were followed:

- Work areas were isolated to restrict dust from impacting adjacent areas.
- Signs/notifications were posted as per EPA Lead RRP.
- "Walk-off" pads were placed at all access points into/out of work area.
- All openings (windows, doors, HVAC system registers/grilles) inside work areas were sealed as per direction from on-site environmental monitors and consisted with the EPA Lead RRP Rules & Guidelines.
- Workers wore disposable clothing and foot coverings while inside work areas.
- All remaining objects in work areas were moved to the center and covered with plastic.
- Portable dust containment barrier systems were erected to limit the size of work areas requiring post-cleaning and limit testing and exposure.
- Plastic floor coverings were extended at least 6 feet out from vertical surfaces being stabilized unless utilizing vertical barriers/containment systems.
- All paint stabilization work was performed in compliance with the EPA Lead RRP Rules & Guidelines, and as per the directions of on-site environmental monitors to minimize dust contamination.

- The contractor took all steps necessary to ensure that no dust or debris left the work area while the work was being performed.
- The contractor took all precautions to ensure that all employees, tools, and other items, including the exteriors of waste containers, were free of dust and debris before leaving the work area.
- The contractor collected all paint chips and debris, folded up plastic floor coverings and any other plastic sheeting used on horizontal surfaces, without dispersing dust or debris and disposed of the material in heavy duty plastic waste bags.
- No power tools were used.
- No dry sweeping with brooms was allowed.
- Water and misting were used to minimize dust.
- HEPA vacuums and wet-wiping/cleaning techniques were employed

*ii. Oversight*

An environmental technician was on-site to oversee paint and plaster stabilization work to ensure compliance with lead safe work practices. An EPA RRP compliance checklist (*Appendix B*) and an oversight checklist (*Appendix C*) were completed at the end of every shift to record the work areas that were stabilized. The following tasks were verified and recorded:

- Pre-cleaning
- Contents moved
- Work area prepped
- Surfaces stabilized
- Contents put back in place
- Final inspection approval and photos

**D. Cleanup & Completion**

*i. Cleanup*

- Upon completion of stabilization, there were no signs of loose, peeling, flaking, bubbling, or crumbling paint or plaster visible on walls or ceilings or on any other painted surfaces.
- There were no visible signs of paint chips, debris or dust of any kind on surfaces with “contained” and isolated work areas NOR outside of the contained and isolated work areas.
- Window sills, floors, baseboards, shelving units, tops of cabinets, desks, chairs, tables, and all other horizontal surfaces were observed to be free of any visible signs of paint and plaster dust and/or debris.
- There were no visible signs of paint chips, and/or paint/plaster dust or debris on academic/educational materials, including books, bins, toys, desks, chairs, carpets, papers, etc., after each work shift and to allow for re-occupancy the next day.
- Any remaining paint and plaster were observed to be tightly adhered to wall and ceiling surfaces such that it could not be further damaged, pried off, or disturbed by “simple fingernail pressure.”

*ii. Testing*

- Qualitative testing was conducted to verify that stabilization work was performed in accordance with lead safe work practices, and that classrooms were safe for re-occupancy by children and staff.

**E. Testing Protocol**

*i. EPA RRP Verification Wipes*

*Synertech Environmental LLC*, an environmental consulting firm, and the painter foreman coordinated the EPA RRP Verification Test Wipe in rooms/areas that had been stabilized and cleaned, and where plastic work area coverings were removed and visually inspected.

*ii. Response to Failed Tests*

If an RRP Verification Wipe “fails,” then the 40 SF area will be re-wiped by EPA RRP Wipes. The process will continue until both testing methods confirm a “pass.”

*iii. Release of Spaces Back to School/Operations*

Once it was determined that EPA RRP wipes were acceptable as determined on-site by the environmental technician, and if work was completed in accordance with this procedure, the room was turned over to the District’s Operationsteam for “deep cleaning” and then for re-occupancy.

### **III. Oversight**

#### **A. Scope of Work**

A comprehensive Paint and Plaster Scope of Work (*Appendix A*) was determined on January 18<sup>th</sup>-21<sup>st</sup>, 2022. This working scope identified room-by-room locations and quantities of paint and plaster stabilization needed throughout the Mayfair School, and was made available to the school's main office.

#### **B. EPA Checklist**

The on-site environmental technician updated a checklist provided by the EPA (*Appendix B*) in an effort to contain and minimize dust within a work area. In addition to work area cleanliness, the EPA checklist accounts for visual inspections of the work area as well as qualitative and quantitative testing records.

#### **C. Oversight**

*Synertech Environmental LLC* was dispatched to the Mayfair School at 3pm on Tuesday January 3<sup>rd</sup>, 2023 to provide renovation oversight. An on-site environmental technician was present through the entirety of the project to oversee paint and plaster stabilization work to ensure compliance with lead safe work practices. Each shift, an oversight report was updated, in which the following tasks were verified and recorded:

- Pre-cleaning
- Contents Moved
- Work Area Prepped
- Surfaces Stabilized
- Contents Back in Place
- Final Inspection Approval

#### **D. Sample Results**

*Synertech Environmental LLC* used qualitative testing techniques in accordance with the EPA's RRP Protocol to ensure that each work area was safe to turn back over to the school for re-occupancy, as detailed in Section II. E.

Thank you for allowing *Synertech Environmental LLC* to continue to provide The School District of Philadelphia with our professional environmental services. If you have any questions please do not hesitate to contact *Synertech Environmental LLC* at 215-755-2305.

Sincerely,

*Synertech Environmental LLC*



Ryan Hutsell  
Project Manager

**Appendix A**

**Lead Safe Assessment Table**



					Inspection Dates: 01/19/22									
					Inspector Name and Certificate Number: Ryan Hutsell PA RA:059512			Lead Safe Certification Assessment Report						
					Inspection Company: Synertech			Mayfair School						
ULCS #	Element	BldgElmt ID	Floor	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
8300	1	B830001-1	1	112B	Storage	Closet across from Classroom 100	yes	W1	CMU	Tan	Chipping	2	0	Negative
8300	1	B830001-1	1	112B	Storage	Closet across from Classroom 100	yes	W2	CMU	Tan	Chipping	2	0	Negative
8300	1	B830001-1	1	112B	Storage	Closet across from Classroom 100	yes	W3	CMU	Tan	Chipping	1	0	Negative
8300	1	B830001-1	1	112B	Storage	Closet across from Classroom 100	yes	W4	Sheetrock	Tan	Chipping	2	0	Negative
8300	1	B830001-1	1	112B	Storage	Closet across from Classroom 100	yes	Ceiling	Concrete	White	Cracking	1	0	Negative
8300	1	B830001-1	1	112B	Storage	Closet across from Classroom 100	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	101	Music	Classroom 100	yes	W1	CMU	Tan	None	0	0	Negative
8300	1	B830001-1	1	101	Music	Classroom 100	yes	W2	CMU	Tan	None	0	0	Negative
8300	1	B830001-1	1	101	Music	Classroom 100	yes	W3	CMU	Tan	None	0	0.06	Negative
8300	1	B830001-1	1	101	Music	Classroom 100	yes	Pipe	Metal	White	Chipping	1	0.4	Negative
8300	1	B830001-1	1	101	Music	Classroom 100	yes	Radiator	Metal	Tan	Chipping	2	0.12	Negative
8300	1	B830001-1	1	101	Music	Classroom 100	yes	W4	Drywall	Tan	None	0	0	Negative
8300	1	B830001-1	1	101	Music	Classroom 100	yes	Ceiling	Concrete	White	Chipping	2	0	Negative
8300	1	B830001-1	1	101	Music	Classroom 100	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	101	Music	Classroom 100	yes	Baseboard	Transite	Tan	Chipping	10	0	Negative
8300	1	B830001-1	1	101C	Storage	Classroom 100 Closet	yes	W1	CMU	White	None	0	N/A	N/A
8300	1	B830001-1	1	101C	Storage	Classroom 100 Closet	yes	W2	CMU	Tan	None	0	0	Negative
8300	1	B830001-1	1	101C	Storage	Classroom 100 Closet	yes	W3	CMU	Tan	Friction	1	0	Negative
8300	1	B830001-1	1	101C	Storage	Classroom 100 Closet	yes	Shelf	Wood	Green	Friction	2	0.04	Negative
8300	1	B830001-1	1	101C	Storage	Classroom 100 Closet	yes	W4	CMU	Tan	None	0	0	Negative
8300	1	B830001-1	1	101C	Storage	Classroom 100 Closet	yes	Ceiling	Concrete	White	None	0	0	Negative
8300	1	B830001-1	1	101C	Storage	Classroom 100 Closet	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	112	Primary	Classroom 116	yes	W1	CMU	Tan	Chipping	1	0	Negative
8300	1	B830001-1	1	112	Primary	Classroom 116	yes	Coat Rack	Metal	White	Friction	1	0	Negative
8300	1	B830001-1	1	112	Primary	Classroom 116	yes	W2	Vinyl	Tan	None	0	N/A	N/A
8300	1	B830001-1	1	112	Primary	Classroom 116	yes	White Board Frame	Wood	White	Chipping	1	0.04	Negative
8300	1	B830001-1	1	112	Primary	Classroom 116	yes	W3	CMU	Tan	Chipping	1	0	Negative
8300	1	B830001-1	1	112	Primary	Classroom 116	yes	Univent	Metal	Tan	Chipping	2	0.1	Negative
8300	1	B830001-1	1	112	Primary	Classroom 116	yes	W4	CMU	Tan	Chipping	1	0	Negative
8300	1	B830001-1	1	112	Primary	Classroom 116	yes	Ceiling	Concrete	White	None	0	0	Negative
8300	1	B830001-1	1	112	Primary	Classroom 116	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	112	Primary	Classroom 116	yes	Baseboard	Transite	Tan	Chipping	10	0	Negative
8300	1	B830001-1	1	112A	Student Restrooms - Male/Female (Classroom)	Classroom 116 Restroom	yes	W1	CMU	Green	Chipping	1	0.2	Negative

					Inspection Dates: 01/19/22									
					Inspector Name and Certificate Number: Ryan Hutsell PA RA:059512			Lead Safe Certification Assessment Report						
					Inspection Company: Synertech			Mayfair School						
ULCS #	Element	BldgElmt ID	Floor	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
8300	1	B830001-1	1	112A	Student Restrooms - Male/Female (Classroom)	Classroom 116 Restroom	yes	W2	CMU	Green	Chipping	1	0.25	Negative
8300	1	B830001-1	1	112A	Student Restrooms - Male/Female (Classroom)	Classroom 116 Restroom	yes	Radiator	Metal	Green	Flaking	2	0.14	Negative
8300	1	B830001-1	1	112A	Student Restrooms - Male/Female (Classroom)	Classroom 116 Restroom	yes	Pipe	Metal	Green	Chipping	1	0.15	Negative
8300	1	B830001-1	1	112A	Student Restrooms - Male/Female (Classroom)	Classroom 116 Restroom	yes	W3	CMU	Green	Chipping	1	0.1	Negative
8300	1	B830001-1	1	112A	Student Restrooms - Male/Female (Classroom)	Classroom 116 Restroom	yes	W4	CMU	Green	Chipping	1	0.2	Negative
8300	1	B830001-1	1	112A	Student Restrooms - Male/Female (Classroom)	Classroom 116 Restroom	yes	Ceiling	Concrete	White	Chipping	4	0.05	Negative
8300	1	B830001-1	1	112A	Student Restrooms - Male/Female (Classroom)	Classroom 116 Restroom	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	112C	Storage	Classroom 116 Left Closet	yes	W1	CMU	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	112C	Storage	Classroom 116 Left Closet	yes	W2	Transite	White	None	0	0	Negative
8300	1	B830001-1	1	112C	Storage	Classroom 116 Left Closet	yes	W3	CMU	Tan	Chipping	1	0	Negative
8300	1	B830001-1	1	112C	Storage	Classroom 116 Left Closet	yes	W4	Transite	White	None	0	0	Negative
8300	1	B830001-1	1	112C	Storage	Classroom 116 Left Closet	yes	Ceiling	Transite	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	112C	Storage	Classroom 116 Left Closet	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	112D	Storage	Classroom 116 Right Closet	yes	W1	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	112D	Storage	Classroom 116 Right Closet	yes	W2	Transite	White	None	0	0	Negative
8300	1	B830001-1	1	112D	Storage	Classroom 116 Right Closet	yes	W3	CMU	Tan	Chipping	1	0	Negative
8300	1	B830001-1	1	112D	Storage	Classroom 116 Right Closet	yes	W4	Transite	White	None	0	0	Negative
8300	1	B830001-1	1	112D	Storage	Classroom 116 Right Closet	yes	Ceiling	Transite	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	112D	Storage	Classroom 116 Right Closet	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	101A	Primary	Classroom 101	yes	W1	CMU	Tan	Chipping	4	0.04	Negative
8300	1	B830001-1	1	101A	Primary	Classroom 101	yes	Coat Rack	Metal	White	Friction	1	0	Negative
8300	1	B830001-1	1	101A	Primary	Classroom 101	yes	Coat Rack	Metal	Tan	Friction	2	0.12	Negative
8300	1	B830001-1	1	101A	Primary	Classroom 101	yes	W2	Vinyl	Tan	None	0	N/A	N/A
8300	1	B830001-1	1	101A	Primary	Classroom 101	yes	W3	CMU	Tan	Chipping	1	0	Negative
8300	1	B830001-1	1	101A	Primary	Classroom 101	yes	Univent	Metal	Tan	Chipping	4	0.1	Negative
8300	1	B830001-1	1	101A	Primary	Classroom 101	yes	Pipe	Metal	White	Chipping	1	0.32	Negative
8300	1	B830001-1	1	101A	Primary	Classroom 101	yes	W4	Vinyl	Tan	None	0	N/A	N/A
8300	1	B830001-1	1	101A	Primary	Classroom 101	yes	White Board Frame	Wood	White	Chipping	1	0	Negative
8300	1	B830001-1	1	101A	Primary	Classroom 101	yes	Ceiling	Concrete	White	None	0	N/A	N/A

					Inspection Dates: 01/19/22									
					Inspector Name and Certificate Number: Ryan Hutsell PA RA:059512			Lead Safe Certification Assessment Report						
					Inspection Company: Synertech			Mayfair School						
ULCS #	Element	BldgElmt ID	Floor	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
8300	1	B830001-1	1	101A	Primary	Classroom 101	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	101A	Primary	Classroom 101	yes	Cove Base	Transite	Tan	Chipping	20	0	Negative
8300	1	B830001-1	1	101A	Primary	Classroom 101	yes	Baseboard	Wood	White	Chipping	5	0	Negative
8300	1	B830001-1	1	101B	Storage	Classroom 101 Closet (Left)	yes	W1	CMU	Tan	None	0	N/A	N/A
8300	1	B830001-1	1	101B	Storage	Classroom 101 Closet (Left)	yes	W2	CMU	Tan	None	0	N/A	N/A
8300	1	B830001-1	1	101B	Storage	Classroom 101 Closet (Left)	yes	Shelf	Wood	White	Friction	5	3.2	Positive
8300	1	B830001-1	1	101B	Storage	Classroom 101 Closet (Left)	yes	W3	CMU	Tan	None	0	N/A	N/A
8300	1	B830001-1	1	101B	Storage	Classroom 101 Closet (Left)	yes	Shelf	Wood	White	Friction	5	3.5	Positive
8300	1	B830001-1	1	101B	Storage	Classroom 101 Closet (Left)	yes	W4	CMU	Tan	None	0	N/A	N/A
8300	1	B830001-1	1	101B	Storage	Classroom 101 Closet (Left)	yes	Ceiling	Plaster	White	None	0	N/A	N/A
8300	1	B830001-1	1	101B	Storage	Classroom 101 Closet (Left)	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	101B	Storage	Classroom 101 Closet (Right)	yes	W1	CMU	Tan	None	0	N/A	N/A
8300	1	B830001-1	1	101B	Storage	Classroom 101 Closet (Right)	yes	W2	CMU	Tan	None	0	N/A	N/A
8300	1	B830001-1	1	101B	Storage	Classroom 101 Closet (Right)	yes	Shelf	Wood	White	Friction	5	3.2	Positive
8300	1	B830001-1	1	101B	Storage	Classroom 101 Closet (Right)	yes	W3	CMU	Tan	None	0	N/A	N/A
8300	1	B830001-1	1	101B	Storage	Classroom 101 Closet (Right)	yes	Shelf	Wood	White	Friction	5	3.5	Positive
8300	1	B830001-1	1	101B	Storage	Classroom 101 Closet (Right)	yes	W4	CMU	Tan	None	0	N/A	N/A
8300	1	B830001-1	1	101B	Storage	Classroom 101 Closet (Right)	yes	Ceiling	Plaster	White	None	0	N/A	N/A
8300	1	B830001-1	1	101B	Storage	Classroom 101 Closet (Right)	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	111A	Primary	Classroom 115	yes	W1	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	111A	Primary	Classroom 115	yes	Coat Rack	Metal	White	Friction	1	0	Negative
8300	1	B830001-1	1	111A	Primary	Classroom 115	yes	W2	Sheetrock	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	111A	Primary	Classroom 115	yes	W3	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	111A	Primary	Classroom 115	yes	W4	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	111A	Primary	Classroom 115	yes	Ceiling	Concrete	White	None	0	N/A	N/A
8300	1	B830001-1	1	111A	Primary	Classroom 115	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	111C	Storage	Classroom 115 Left Closet	yes	W1	CMU	Tan	None	0	N/A	N/A
8300	1	B830001-1	1	111C	Storage	Classroom 115 Left Closet	yes	W2	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	111C	Storage	Classroom 115 Left Closet	yes	Shelves	Wood	White	Friction	5	4.1	Positive
8300	1	B830001-1	1	111C	Storage	Classroom 115 Left Closet	yes	W3	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	111C	Storage	Classroom 115 Left Closet	yes	Shelves	Wood	White	Friction	5	3.6	Positive
8300	1	B830001-1	1	111C	Storage	Classroom 115 Left Closet	yes	W4	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	111C	Storage	Classroom 115 Left Closet	yes	Ceiling	Plaster	White	None	0	N/A	N/A
8300	1	B830001-1	1	111C	Storage	Classroom 115 Left Closet	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	111D	Storage	Classroom 115 Right Closet	yes	W1	CMU	Tan	None	0	N/A	N/A
8300	1	B830001-1	1	111D	Storage	Classroom 115 Right Closet	yes	W2	CMU	Tan	Partially Inaccessible	0	0	Negative

					Inspection Dates: 01/19/22									
					Inspector Name and Certificate Number: Ryan Hutsell PA RA:059512			Lead Safe Certification Assessment Report						
					Inspection Company: Synertech			Mayfair School						
ULCS #	Element	BldgElmt ID	Floor	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
8300	1	B830001-1	1	111D	Storage	Classroom 115 Right Closet	yes	W3	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	111D	Storage	Classroom 115 Right Closet	yes	W4	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	111D	Storage	Classroom 115 Right Closet	yes	Ceiling	Plaster	White	None	0	N/A	N/A
8300	1	B830001-1	1	111D	Storage	Classroom 115 Right Closet	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	127	Storage	Storage Closet Across from Classroom 115	yes	W1	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	127	Storage	Storage Closet Across from Classroom 115	yes	W2	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	127	Storage	Storage Closet Across from Classroom 115	yes	W3	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	127	Storage	Storage Closet Across from Classroom 115	yes	W4	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	127	Storage	Storage Closet Across from Classroom 115	yes	Ceiling	Plaster	White	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	127	Storage	Storage Closet Across from Classroom 115	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	127	Storage	Storage Closet Adjacent to Classroom 115	yes	W1	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	127	Storage	Storage Closet Adjacent to Classroom 115	yes	W2	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	127	Storage	Storage Closet Adjacent to Classroom 115	yes	W3	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	127	Storage	Storage Closet Adjacent to Classroom 115	yes	W4	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	127	Storage	Storage Closet Adjacent to Classroom 115	yes	Ceiling	Plaster	White	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	127	Storage	Storage Closet Adjacent to Classroom 115	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	102	Primary	Classroom 102	yes	W1	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	102	Primary	Classroom 102	yes	Coat Rack	Metal	White	Friction	1	0	Negative
8300	1	B830001-1	1	102	Primary	Classroom 102	yes	W2	Vinyl	N/A	None	0	N/A	N/A
8300	1	B830001-1	1	102	Primary	Classroom 102	yes	W3	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	102	Primary	Classroom 102	yes	Univent	Metal	Tan	Chipping	4	0.2	Negative
8300	1	B830001-1	1	102	Primary	Classroom 102	yes	W4	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	102	Primary	Classroom 102	yes	Ceiling	Concrete	White	None	0	N/A	N/A
8300	1	B830001-1	1	102	Primary	Classroom 102	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	102	Primary	Classroom 102	yes	Cove Base	Transite	Tan	Chipping	20	0	Negative
8300	1	B830001-1	1	102	Primary	Classroom 102	yes	Baseboard	Wood	White	Chipping	5	0	Negative
8300	1	B830001-1	1	102A	Storage	Classroom 102 Left Closet	yes	W1	CMU	Tan	None	0	N/A	N/A

					Inspection Dates: 01/19/22									
					Inspector Name and Certificate Number: Ryan Hutsell PA RA:059512			Lead Safe Certification Assessment Report						
					Inspection Company: Synertech			Mayfair School						
ULCS #	Element	BldgElmt ID	Floor	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
8300	1	B830001-1	1	102A	Storage	Classroom 102 Left Closet	yes	W2	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	102A	Storage	Classroom 102 Left Closet	yes	Shelves	Wood	White	Friction	5	6.1	Positive
8300	1	B830001-1	1	102A	Storage	Classroom 102 Left Closet	yes	W3	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	102A	Storage	Classroom 102 Left Closet	yes	Shelves	Wood	White	Friction	5	4.5	Positive
8300	1	B830001-1	1	102A	Storage	Classroom 102 Left Closet	yes	W4	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	102A	Storage	Classroom 102 Left Closet	yes	Ceiling	Plaster	White	None	0	N/A	N/A
8300	1	B830001-1	1	102A	Storage	Classroom 102 Left Closet	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	102B	Storage	Classroom 102 Right Closet	yes	W1	CMU	Tan	None	0	N/A	N/A
8300	1	B830001-1	1	102B	Storage	Classroom 102 Right Closet	yes	W2	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	102B	Storage	Classroom 102 Right Closet	yes	W3	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	102B	Storage	Classroom 102 Right Closet	yes	W4	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	102B	Storage	Classroom 102 Right Closet	yes	Ceiling	Plaster	White	None	0	N/A	N/A
8300	1	B830001-1	1	102B	Storage	Classroom 102 Right Closet	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	111	Primary	Classroom 114	yes	W1	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	111	Primary	Classroom 114	yes	Coat Rack	Metal	White	Friction	1	0	Negative
8300	1	B830001-1	1	111	Primary	Classroom 114	yes	W2	Sheetrock	Tan	Chipping	0	0	Negative
8300	1	B830001-1	1	111	Primary	Classroom 114	yes	W3	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	111	Primary	Classroom 114	yes	Univent	Metal	Tan	Chipping	4	0.15	Negative
8300	1	B830001-1	1	111	Primary	Classroom 114	yes	Pipe	Metal	White	Chipping	2	0.18	Negative
8300	1	B830001-1	1	111	Primary	Classroom 114	yes	W4	Sheetrock	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	111	Primary	Classroom 114	yes	Ceiling	Concrete	White	None	0	N/A	N/A
8300	1	B830001-1	1	111	Primary	Classroom 114	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	111	Primary	Classroom 114	yes	Cove Base	Transite	Tan	Chipping	10	0	Negative
8300	1	B830001-1	1	111B	Storage	Classroom 114 Closet	yes	W1	CMU	Tan	None	0	N/A	N/A
8300	1	B830001-1	1	111B	Storage	Classroom 114 Closet	yes	W2	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	111B	Storage	Classroom 114 Closet	yes	Shelves	Wood	White	Friction	4	3.5	Positive
8300	1	B830001-1	1	111B	Storage	Classroom 114 Closet	yes	W3	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	111B	Storage	Classroom 114 Closet	yes	Shelves	Wood	White	Friction	4	4.1	Positive
8300	1	B830001-1	1	111B	Storage	Classroom 114 Closet	yes	W4	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	111B	Storage	Classroom 114 Closet	yes	Ceiling	Plaster	White	None	0	0	Negative
8300	1	B830001-1	1	111B	Storage	Classroom 114 Closet	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A

					Inspection Dates: 01/19/22									
					Inspector Name and Certificate Number: Ryan Hutsell PA RA:059512			Lead Safe Certification Assessment Report						
					Inspection Company: Synertech			Mayfair School						
ULCS #	Element	BldgElmt ID	Floor	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
8300	1	B830001-1	1	102A	Service Closets	Custodial Closet across from Classroom 114	no	W1	CMU	White	Flaking	4	0	Negative
8300	1	B830001-1	1	102A	Service Closets	Custodial Closet across from Classroom 114	no	W1	CMU	Green	Flaking	4	0	Negative
8300	1	B830001-1	1	102A	Service Closets	Custodial Closet across from Classroom 114	no	Pipe	Metal	White	Flaking	6	0.2	Negative
8300	1	B830001-1	1	102A	Service Closets	Custodial Closet across from Classroom 114	no	W2	CMU	White	Flaking	4	0	Negative
8300	1	B830001-1	1	102A	Service Closets	Custodial Closet across from Classroom 114	no	W2	CMU	Green	Flaking	4	0	Negative
8300	1	B830001-1	1	102A	Service Closets	Custodial Closet across from Classroom 114	no	Shelf	Wood	White	Friction	4	0.1	Negative
8300	1	B830001-1	1	102A	Service Closets	Custodial Closet across from Classroom 114	no	W3	CMU	White	Flaking	4	0	Negative
8300	1	B830001-1	1	102A	Service Closets	Custodial Closet across from Classroom 114	no	W3	CMU	Green	Flaking	4	0	Negative
8300	1	B830001-1	1	102A	Service Closets	Custodial Closet across from Classroom 114	no	Shelf	Wood	White	Friction	4	0.13	Negative
8300	1	B830001-1	1	102A	Service Closets	Custodial Closet across from Classroom 114	no	W4	CMU	White	Flaking	4	0	Negative
8300	1	B830001-1	1	102A	Service Closets	Custodial Closet across from Classroom 114	no	W4	CMU	Green	Flaking	4	0	Negative
8300	1	B830001-1	1	102A	Service Closets	Custodial Closet across from Classroom 114	no	Ceiling	Concrete	White	None	0	N/A	N/A
8300	1	B830001-1	1	102A	Service Closets	Custodial Closet across from Classroom 114	no	Pipe	Metal	Green	Flaking	6	0.2	Negative
8300	1	B830001-1	1	102A	Service Closets	Custodial Closet across from Classroom 114	no	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	102C PC	Pipe Chase	Pipe Chase in Custodial Closet across from Classroom 114	no	W1	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	102C PC	Pipe Chase	Pipe Chase in Custodial Closet across from Classroom 114	no	W2	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	102C PC	Pipe Chase	Pipe Chase in Custodial Closet across from Classroom 114	no	W3	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	102C PC	Pipe Chase	Pipe Chase in Custodial Closet across from Classroom 114	no	W4	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	102C PC	Pipe Chase	Pipe Chase in Custodial Closet across from Classroom 114	no	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	102C PC	Pipe Chase	Pipe Chase in Custodial Closet across from Classroom 114	no	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	102B	Student Restrooms - Female (4-12)	Girl's Restroom next to Classroom 103	yes	W1	CMU	Green	None	0	N/A	N/A
8300	1	B830001-1	1	102B	Student Restrooms - Female (4-12)	Girl's Restroom next to Classroom 103	yes	W2	CMU	Green	None	0	N/A	N/A

					Inspection Dates: 01/19/22									
					Inspector Name and Certificate Number: Ryan Hutsell PA RA:059512			Lead Safe Certification Assessment Report						
					Inspection Company: Synertech			Mayfair School						
ULCS #	Element	BldgElmt ID	Floor	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
8300	1	B830001-1	1	102B	Student Restrooms - Female (4-12)	Girl's Restroom next to Classroom 103	yes	W3	CMU	Green	None	0	N/A	N/A
8300	1	B830001-1	1	102B	Student Restrooms - Female (4-12)	Girl's Restroom next to Classroom 103	yes	W4	CMU	Green	None	0	N/A	N/A
8300	1	B830001-1	1	102B	Student Restrooms - Female (4-12)	Girl's Restroom next to Classroom 103	yes	Ceiling	Concrete	White	None	0	N/A	N/A
8300	1	B830001-1	1	102B	Student Restrooms - Female (4-12)	Girl's Restroom next to Classroom 103	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	103B	Primary	Classroom 103 "WHYY" Room	yes	W1	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	103B	Primary	Classroom 103 "WHYY" Room	yes	Coat Rack	Metal	White	Friction	1	0	Negative
8300	1	B830001-1	1	103B	Primary	Classroom 103 "WHYY" Room	yes	Door Frame	Metal	Tan	Friction	2	0.14	Negative
8300	1	B830001-1	1	103B	Primary	Classroom 103 "WHYY" Room	yes	W2	CMU	Tan	Partially Inaccessible	0	0.04	Negative
8300	1	B830001-1	1	103B	Primary	Classroom 103 "WHYY" Room	yes	W3	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	103B	Primary	Classroom 103 "WHYY" Room	yes	Univent	Metal	Tan	Chipping	5	0.2	Negative
8300	1	B830001-1	1	103B	Primary	Classroom 103 "WHYY" Room	yes	Pipe	Metal	White	Chipping	1	0.3	Negative
8300	1	B830001-1	1	103B	Primary	Classroom 103 "WHYY" Room	yes	W4	Vinyl	Tan	None	0	N/A	N/A
8300	1	B830001-1	1	103B	Primary	Classroom 103 "WHYY" Room	yes	White Board Frame	Wood	White	Chipping	1	0	Negative
8300	1	B830001-1	1	103B	Primary	Classroom 103 "WHYY" Room	yes	Ceiling	Concrete	White	None	0	N/A	N/A
8300	1	B830001-1	1	103B	Primary	Classroom 103 "WHYY" Room	yes	Pipe	Metal	White	Chipping	2	0.15	Negative
8300	1	B830001-1	1	103B	Primary	Classroom 103 "WHYY" Room	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	103B	Primary	Classroom 103 "WHYY" Room	yes	Cove Base	Transite	Tan	Chipping	20	0	Negative
8300	1	B830001-1	1	103B	Primary	Classroom 103 "WHYY" Room	yes	Baseboard	Wood	White	Chipping	2	0	Negative
8300	1	B830001-1	1	103C	Storage	Classroom 103 Closet (Left)	yes	W1	CMU	White	None	0	N/A	N/A
8300	1	B830001-1	1	103C	Storage	Classroom 103 Closet (Left)	yes	W2	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	103C	Storage	Classroom 103 Closet (Left)	yes	W3	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	103C	Storage	Classroom 103 Closet (Left)	yes	Shelves	Wood	White	Friction	4	4.9	Positive
8300	1	B830001-1	1	103C	Storage	Classroom 103 Closet (Left)	yes	W4	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	103C	Storage	Classroom 103 Closet (Left)	yes	Ceiling	Plaster	White	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	103C	Storage	Classroom 103 Closet (Left)	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	103C	Storage	Classroom 103 Closet (Right)	yes	W1	CMU	Tan	None	0	N/A	N/A
8300	1	B830001-1	1	103C	Storage	Classroom 103 Closet (Right)	yes	W2	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	103C	Storage	Classroom 103 Closet (Right)	yes	W3	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	103C	Storage	Classroom 103 Closet (Right)	yes	Shelves	Wood	White	Friction	4	5.2	Positive

					Inspection Dates: 01/19/22									
					Inspector Name and Certificate Number: Ryan Hutsell PA RA:059512			Lead Safe Certification Assessment Report						
					Inspection Company: Synertech			Mayfair School						
ULCS #	Element	BldgElmt ID	Floor	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
8300	1	B830001-1	1	103C	Storage	Classroom 103 Closet (Right)	yes	W4	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	103C	Storage	Classroom 103 Closet (Right)	yes	Ceiling	Plaster	White	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	103C	Storage	Classroom 103 Closet (Right)	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	110	Primary	Classroom 113	yes	W1	CMU	Tan	Partially Inaccessible	0	N/A	N/A
8300	1	B830001-1	1	110	Primary	Classroom 113	yes	Coat Rack	Metal	White	Friction	1	0	Negative
8300	1	B830001-1	1	110	Primary	Classroom 113	yes	W2	CMU	Tan	Partially Inaccessible	0	N/A	N/A
8300	1	B830001-1	1	110	Primary	Classroom 113	yes	W3	CMU	Tan	Partially Inaccessible	0	N/A	N/A
8300	1	B830001-1	1	110	Primary	Classroom 113	yes	Univent	Metal	Tan	Chipping	2	0.2	Negative
8300	1	B830001-1	1	110	Primary	Classroom 113	yes	W4	Sheetrock	Tan	Partially Inaccessible	0	N/A	N/A
8300	1	B830001-1	1	110	Primary	Classroom 113	yes	Ceiling	Concrete	White	Cracking	2	0	Negative
8300	1	B830001-1	1	110	Primary	Classroom 113	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	110	Primary	Classroom 113	yes	Cove Base	Transite	Tan	Chipping	20	0	Negative
8300	1	B830001-1	1	110A	Storage	Classroom 113 Closet	yes	W1	CMU	Tan	None	0	N/A	N/A
8300	1	B830001-1	1	110A	Storage	Classroom 113 Closet	yes	W2	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	110A	Storage	Classroom 113 Closet	yes	W3	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	110A	Storage	Classroom 113 Closet	yes	Shelves	Wood	White	Friction	2	2.5	Positive
8300	1	B830001-1	1	110A	Storage	Classroom 113 Closet	yes	W4	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	110A	Storage	Classroom 113 Closet	yes	Ceiling	Plaster	White	None	0	N/A	N/A
8300	1	B830001-1	1	110A	Storage	Classroom 113 Closet	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	103	Primary	Classroom 104	yes	W1	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	103	Primary	Classroom 104	yes	Coat Rack	Metal	White	Friction	1	0	Negative
8300	1	B830001-1	1	103	Primary	Classroom 104	yes	W2	Vinyl	Tan	None	0	N/A	N/A
8300	1	B830001-1	1	103	Primary	Classroom 104	yes	W3	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	103	Primary	Classroom 104	yes	Univent	Metal	Tan	Chipping	4	0.11	Negative
8300	1	B830001-1	1	103	Primary	Classroom 104	yes	Pipe	Metal	White	Chipping	1	0.15	Negative
8300	1	B830001-1	1	103	Primary	Classroom 104	yes	W4	Vinyl	Tan	None	0	N/A	N/A
8300	1	B830001-1	1	103	Primary	Classroom 104	yes	Ceiling	Concrete	White	Flaking	2	0.02	Negative
8300	1	B830001-1	1	103	Primary	Classroom 104	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	103A	Storage	Classroom 104 Closet (Left)	yes	W1	CMU	Tan	None	0	N/A	N/A
8300	1	B830001-1	1	103A	Storage	Classroom 104 Closet (Left)	yes	W2	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	103A	Storage	Classroom 104 Closet (Left)	yes	W3	CMU	Tan	Partially Inaccessible	0	0	Negative



					Inspection Dates: 01/19/22									
					Inspector Name and Certificate Number: Ryan Hutsell PA RA:059512			Lead Safe Certification Assessment Report						
					Inspection Company: Synertech			Mayfair School						
ULCS #	Element	BldgElmt ID	Floor	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
8300	1	B830001-1	1	103A	Storage	Classroom 104 Closet (Left)	yes	Shelves	Wood	White	Friction	4	3.8	Positive
8300	1	B830001-1	1	103A	Storage	Classroom 104 Closet (Left)	yes	W4	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	103A	Storage	Classroom 104 Closet (Left)	yes	Ceiling	Plaster	White	None	0	N/A	N/A
8300	1	B830001-1	1	103A	Storage	Classroom 104 Closet (Left)	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	103A	Storage	Classroom 104 Closet (Right)	yes	W1	CMU	Tan	None	0	N/A	N/A
8300	1	B830001-1	1	103A	Storage	Classroom 104 Closet (Right)	yes	W2	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	103A	Storage	Classroom 104 Closet (Right)	yes	W3	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	103A	Storage	Classroom 104 Closet (Right)	yes	W4	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	103A	Storage	Classroom 104 Closet (Right)	yes	Ceiling	Plaster	White	None	0	N/A	N/A
8300	1	B830001-1	1	103A	Storage	Classroom 104 Closet (Right)	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	109A	Student Restrooms - Male (4-12)	Boy's Restroom next to Classroom 112	yes	W1	CMU	Blue	Flaking	2	0	Negative
8300	1	B830001-1	1	109A	Student Restrooms - Male (4-12)	Boy's Restroom next to Classroom 112	yes	W1	CMU	White	None	0	N/A	N/A
8300	1	B830001-1	1	109A	Student Restrooms - Male (4-12)	Boy's Restroom next to Classroom 112	yes	W2	CMU	Blue	None	0	N/A	N/A
8300	1	B830001-1	1	109A	Student Restrooms - Male (4-12)	Boy's Restroom next to Classroom 112	yes	W2	CMU	White	None	0	N/A	N/A
8300	1	B830001-1	1	109A	Student Restrooms - Male (4-12)	Boy's Restroom next to Classroom 112	yes	W3	CMU	Blue	Chipping	1	0	Negative
8300	1	B830001-1	1	109A	Student Restrooms - Male (4-12)	Boy's Restroom next to Classroom 112	yes	W3	CMU	White	None	0	N/A	N/A
8300	1	B830001-1	1	109A	Student Restrooms - Male (4-12)	Boy's Restroom next to Classroom 112	yes	Radiator	Metal	Black	Chipping	4	0.25	Negative
8300	1	B830001-1	1	109A	Student Restrooms - Male (4-12)	Boy's Restroom next to Classroom 112	yes	W4	CMU	Blue	Chipping	1	0	Negative
8300	1	B830001-1	1	109A	Student Restrooms - Male (4-12)	Boy's Restroom next to Classroom 112	yes	W4	CMU	White	None	0	N/A	N/A
8300	1	B830001-1	1	109A	Student Restrooms - Male (4-12)	Boy's Restroom next to Classroom 112	yes	Ceiling	Concrete	White	Flaking	6	0	Negative
8300	1	B830001-1	1	109A	Student Restrooms - Male (4-12)	Boy's Restroom next to Classroom 112	yes	Floor	Terrazzo	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	109D	Storage	Book Closet across from Classroom 104	yes	W1	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	109D	Storage	Book Closet across from Classroom 104	yes	W2	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	109D	Storage	Book Closet across from Classroom 104	yes	W3	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	109D	Storage	Book Closet across from Classroom 104	yes	Shelves	Wood	White	Friction	5	2.5	Positive

					Inspection Dates: 01/19/22									
					Inspector Name and Certificate Number: Ryan Hutsell PA RA:059512			Lead Safe Certification Assessment Report						
					Inspection Company: Synertech			Mayfair School						
ULCS #	Element	BldgElmt ID	Floor	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
8300	1	B830001-1	1	109D	Storage	Book Closet across from Classroom 104	yes	W4	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	109D	Storage	Book Closet across from Classroom 104	yes	Ceiling	Concrete	White	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	109D	Storage	Book Closet across from Classroom 104	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	109 PC	Pipe Chase	Book Closet across from Classroom 104: Pipe Chase	no	W1	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	109 PC	Pipe Chase	Book Closet across from Classroom 104: Pipe Chase	no	W2	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	109 PC	Pipe Chase	Book Closet across from Classroom 104: Pipe Chase	no	W3	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	109 PC	Pipe Chase	Book Closet across from Classroom 104: Pipe Chase	no	W4	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	109 PC	Pipe Chase	Book Closet across from Classroom 104: Pipe Chase	no	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	109 PC	Pipe Chase	Book Closet across from Classroom 104: Pipe Chase	no	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	109	Primary	Classroom 112	yes	W1	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	109	Primary	Classroom 112	yes	Coat Rack	Metal	White	Friction	1	0	Negative
8300	1	B830001-1	1	109	Primary	Classroom 112	yes	W2	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	109	Primary	Classroom 112	yes	W3	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	109	Primary	Classroom 112	yes	Univent	Metal	Tan	Chipping	4	0.13	Negative
8300	1	B830001-1	1	109	Primary	Classroom 112	yes	W4	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	109	Primary	Classroom 112	yes	Ceiling	Concrete	White	None	0	N/A	N/A
8300	1	B830001-1	1	109	Primary	Classroom 112	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	109	Primary	Classroom 112	yes	Cove Base	Transite	Tan	Chipping	20	0.04	Negative
8300	1	B830001-1	1	109C	Storage	Classroom 112 Left Closet	yes	W1	CMU	Tan	None	0	N/A	N/A
8300	1	B830001-1	1	109C	Storage	Classroom 112 Left Closet	yes	W2	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	109C	Storage	Classroom 112 Left Closet	yes	Shelves	Wood	White	Friction	3	5.2	Positive
8300	1	B830001-1	1	109C	Storage	Classroom 112 Left Closet	yes	W3	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	109C	Storage	Classroom 112 Left Closet	yes	Shelves	Wood	White	Friction	3	3.9	Positive
8300	1	B830001-1	1	109C	Storage	Classroom 112 Left Closet	yes	W4	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	109C	Storage	Classroom 112 Left Closet	yes	Ceiling	Plaster	White	None	0	N/A	N/A
8300	1	B830001-1	1	109C	Storage	Classroom 112 Left Closet	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	109B	Storage	Classroom 112 Right Closet	yes	W1	CMU	Tan	None	0	N/A	N/A

					Inspection Dates: 01/19/22									
					Inspector Name and Certificate Number: Ryan Hutsell PA RA:059512			Lead Safe Certification Assessment Report						
					Inspection Company: Synertech			Mayfair School						
ULCS #	Element	BldgElmt ID	Floor	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
8300	1	B830001-1	1	109B	Storage	Classroom 112 Right Closet	yes	W2	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	109B	Storage	Classroom 112 Right Closet	yes	W3	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	109B	Storage	Classroom 112 Right Closet	yes	W4	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	109B	Storage	Classroom 112 Right Closet	yes	Ceiling	Plaster	White	Flaking	1	0	Negative
8300	1	B830001-1	1	109B	Storage	Classroom 112 Right Closet	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	104	Primary	Classroom 105	yes	W1	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	104	Primary	Classroom 105	yes	Coat Rack	Metal	White	Friction	1	0	Negative
8300	1	B830001-1	1	104	Primary	Classroom 105	yes	W2	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	104	Primary	Classroom 105	yes	W3	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	104	Primary	Classroom 105	yes	Univent	Metal	Tan	Chipping	5	0.17	Negative
8300	1	B830001-1	1	104	Primary	Classroom 105	yes	Pipe	Metal	White	Chipping	1	0.35	Negative
8300	1	B830001-1	1	104	Primary	Classroom 105	yes	W4	Sheetrock	Tan	Chipping	10	0	Negative
8300	1	B830001-1	1	104	Primary	Classroom 105	yes	Ceiling	Concrete	White	None	0	N/A	N/A
8300	1	B830001-1	1	104	Primary	Classroom 105	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	104	Primary	Classroom 105	yes	Cove Base	Transite	Tan	Chipping	20	0	Negative
8300	1	B830001-1	1	104A	Storage	Classroom 105 Left Closet	yes	W1	CMU	Tan	None	0	N/A	N/A
8300	1	B830001-1	1	104A	Storage	Classroom 105 Left Closet	yes	W2	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	104A	Storage	Classroom 105 Left Closet	yes	W3	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	104A	Storage	Classroom 105 Left Closet	yes	Shelves	Wood	White	Friction	2	4.1	Positive
8300	1	B830001-1	1	104A	Storage	Classroom 105 Left Closet	yes	W4	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	104A	Storage	Classroom 105 Left Closet	yes	Ceiling	Plaster	White	None	0	N/A	N/A
8300	1	B830001-1	1	104A	Storage	Classroom 105 Left Closet	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	104B	Storage	Classroom 105 Right Closet	yes	W1	CMU	Tan	None	0	N/A	N/A
8300	1	B830001-1	1	104B	Storage	Classroom 105 Right Closet	yes	W2	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	104B	Storage	Classroom 105 Right Closet	yes	W3	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	104B	Storage	Classroom 105 Right Closet	yes	W4	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	104B	Storage	Classroom 105 Right Closet	yes	Ceiling	Plaster	White	None	0	N/A	N/A
8300	1	B830001-1	1	104B	Storage	Classroom 105 Right Closet	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	108	Primary	Classroom 111	yes	W1	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	108	Primary	Classroom 111	yes	Coat Rack	Metal	White	Friction	1	0	Negative

					Inspection Dates: 01/19/22									
					Inspector Name and Certificate Number: Ryan Hutsell PA RA:059512			Lead Safe Certification Assessment Report						
					Inspection Company: Synertech			Mayfair School						
ULCS #	Element	BldgElmt ID	Floor	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
8300	1	B830001-1	1	108	Primary	Classroom 111	yes	Louvered Vent Door	Metal	White	Flaking	1	0.2	Negative
8300	1	B830001-1	1	108	Primary	Classroom 111	yes	W2	Sheetrock	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	108	Primary	Classroom 111	yes	W3	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	108	Primary	Classroom 111	yes	Univent	Metal	Tan	Chipping	3	0.2	Negative
8300	1	B830001-1	1	108	Primary	Classroom 111	yes	Pipe	Metal	White	Chipping	1	0.18	Negative
8300	1	B830001-1	1	108	Primary	Classroom 111	yes	W4	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	108	Primary	Classroom 111	yes	Ceiling	Concrete	White	None	0	N/A	N/A
8300	1	B830001-1	1	108	Primary	Classroom 111	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	108	Primary	Classroom 111	yes	Cove Base	Transite	Tan	Chipping	20	0	Negative
8300	1	B830001-1	1	108A	Primary	Classroom 111 Left Closet	yes	W1	CMU	Tan	None	0	N/A	N/A
8300	1	B830001-1	1	108A	Primary	Classroom 111 Left Closet	yes	W2	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	108A	Primary	Classroom 111 Left Closet	yes	W3	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	108A	Primary	Classroom 111 Left Closet	yes	Shelves	Wood	White	Friction	4	5.2	Positive
8300	1	B830001-1	1	108A	Primary	Classroom 111 Left Closet	yes	W4	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	108A	Primary	Classroom 111 Left Closet	yes	Ceiling	Plaster	White	None	0	N/A	N/A
8300	1	B830001-1	1	108A	Primary	Classroom 111 Left Closet	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	108B	Primary	Classroom 111 Right Closet	yes	W1	CMU	Tan	None	0	N/A	N/A
8300	1	B830001-1	1	108B	Primary	Classroom 111 Right Closet	yes	W2	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	108B	Primary	Classroom 111 Right Closet	yes	W3	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	108B	Primary	Classroom 111 Right Closet	yes	W4	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	108B	Primary	Classroom 111 Right Closet	yes	Ceiling	Plaster	White	None	0	N/A	N/A
8300	1	B830001-1	1	108B	Primary	Classroom 111 Right Closet	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	105	Primary	Classroom 106	yes	W1	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	105	Primary	Classroom 106	yes	Coat Rack	Metal	White	Friction	1	0	Negative
8300	1	B830001-1	1	105	Primary	Classroom 106	yes	W2	Vinyl	Tan	None	0	N/A	N/A
8300	1	B830001-1	1	105	Primary	Classroom 106	yes	White Board Frame	Wood	White	Chipping	2	0.17	Negative
8300	1	B830001-1	1	105	Primary	Classroom 106	yes	W3	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	105	Primary	Classroom 106	yes	Univent	Metal	Tan	Chipping	5	0.26	Negative
8300	1	B830001-1	1	105	Primary	Classroom 106	yes	Pipe	Metal	White	Chipping	1	0.2	Negative
8300	1	B830001-1	1	105	Primary	Classroom 106	yes	W4	CMU	Tan	Partially Inaccessible	0	0	Negative

					Inspection Dates: 01/19/22									
					Inspector Name and Certificate Number: Ryan Hutsell PA RA:059512			Lead Safe Certification Assessment Report						
					Inspection Company: Synertech			Mayfair School						
ULCS #	Element	BldgElmt ID	Floor	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
8300	1	B830001-1	1	105	Primary	Classroom 106	yes	Ceiling	Concrete	White	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	105	Primary	Classroom 106	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	105	Primary	Classroom 106	yes	Cove Base	Transite	Tan	Chipping	20	0	Negative
8300	1	B830001-1	1	105	Primary	Classroom 106	yes	Baseboard	Wood	White	Chipping	5	0	Negative
8300	1	B830001-1	1	105C	Storage	Classroom 106 Closet (Left)	yes	W1	CMU	Tan	None	0	N/A	N/A
8300	1	B830001-1	1	105C	Storage	Classroom 106 Closet (Left)	yes	W2	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	105C	Storage	Classroom 106 Closet (Left)	yes	W3	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	105C	Storage	Classroom 106 Closet (Left)	yes	Shelves	Wood	White	Friction	4	6.4	Positive
8300	1	B830001-1	1	105C	Storage	Classroom 106 Closet (Left)	yes	W4	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	105C	Storage	Classroom 106 Closet (Left)	yes	Ceiling	Plaster	White	None	0	N/A	N/A
8300	1	B830001-1	1	105C	Storage	Classroom 106 Closet (Left)	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	105C	Storage	Classroom 106 Closet (Right)	yes	W1	CMU	White	None	0	N/A	N/A
8300	1	B830001-1	1	105C	Storage	Classroom 106 Closet (Right)	yes	W2	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	105C	Storage	Classroom 106 Closet (Right)	yes	W3	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	105C	Storage	Classroom 106 Closet (Right)	yes	Coat Rack	Metal	White	Friction	2	0.1	Negative
8300	1	B830001-1	1	105C	Storage	Classroom 106 Closet (Right)	yes	W4	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	105C	Storage	Classroom 106 Closet (Right)	yes	Ceiling	Plaster	White	None	0	N/A	N/A
8300	1	B830001-1	1	105C	Storage	Classroom 106 Closet (Right)	yes	Louvered Vent Door	Metal	Blue	Chipping	1	0.15	Negative
8300	1	B830001-1	1	105C	Storage	Classroom 106 Closet (Right)	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	105A	Primary	Classroom 107	yes	W1	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	105A	Primary	Classroom 107	yes	Coat Rack	Metal	White	Friction	1	0	Negative
8300	1	B830001-1	1	105A	Primary	Classroom 107	yes	W2	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	105A	Primary	Classroom 107	yes	W3	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	105A	Primary	Classroom 107	yes	Univent	Metal	Tan	Chipping	3	0.25	Negative
8300	1	B830001-1	1	105A	Primary	Classroom 107	yes	W4	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	105A	Primary	Classroom 107	yes	Ceiling	Concrete	White	None	0	N/A	N/A
8300	1	B830001-1	1	105A	Primary	Classroom 107	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	105A	Primary	Classroom 107	yes	Cove Base	Transite	Tan	Chipping	10	0	Negative
8300	1	B830001-1	1	105A	Primary	Classroom 107	yes	Cove Base	Transite	Black	Chipping	10	0	Negative
8300	1	B830001-1	1	105C	Storage	Classroom 107 Closet	yes	W1	CMU	White	None	0	N/A	N/A
8300	1	B830001-1	1	105C	Storage	Classroom 107 Closet	yes	W2	CMU	Blue	Partially Inaccessible	0	0	Negative

					Inspection Dates: 01/19/22									
					Inspector Name and Certificate Number: Ryan Hutsell PA RA:059512			Lead Safe Certification Assessment Report						
					Inspection Company: Synertech			Mayfair School						
ULCS #	Element	BldgElmt ID	Floor	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
8300	1	B830001-1	1	105C	Storage	Classroom 107 Closet	yes	W3	CMU	Blue	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	105C	Storage	Classroom 107 Closet	yes	Shelves	Wood	Blue	Friction	2	4.5	Positive
8300	1	B830001-1	1	105C	Storage	Classroom 107 Closet	yes	W4	CMU	Blue	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	105C	Storage	Classroom 107 Closet	yes	Ceiling	Plaster	White	None	0	N/A	N/A
8300	1	B830001-1	1	105C	Storage	Classroom 107 Closet	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	107AB	Primary	Classroom 110	yes	W1	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	107AB	Primary	Classroom 110	yes	Coat Rack	Metal	White	Friction	1	0	Negative
8300	1	B830001-1	1	107AB	Primary	Classroom 110	yes	Louvered Vent Door	Metal	Tan	Chipping	1	0.29	Negative
8300	1	B830001-1	1	107AB	Primary	Classroom 110	yes	W2	Sheetrock	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	107AB	Primary	Classroom 110	yes	W3	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	107AB	Primary	Classroom 110	yes	Univent	Metal	Tan	Chipping	4	0.14	Negative
8300	1	B830001-1	1	107AB	Primary	Classroom 110	yes	Pipe	Metal	White	Chipping	1	0.29	Negative
8300	1	B830001-1	1	107AB	Primary	Classroom 110	yes	W4	Sheetrock	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	107AB	Primary	Classroom 110	yes	Ceiling	Concrete	White	Flaking	2	0	Negative
8300	1	B830001-1	1	107AB	Primary	Classroom 110	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	107AB	Primary	Classroom 110	yes	Cove Base	Transite	Black	Chipping	10	0	Negative
8300	1	B830001-1	1	107C	Storage	Classroom 110 Closet	yes	W1	CMU	Tan	None	0	N/A	N/A
8300	1	B830001-1	1	107C	Storage	Classroom 110 Closet	yes	W2	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	107C	Storage	Classroom 110 Closet	yes	W3	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	107C	Storage	Classroom 110 Closet	yes	Shelves	Wood	White	Friction	4	5.2	Positive
8300	1	B830001-1	1	107C	Storage	Classroom 110 Closet	yes	W4	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	107C	Storage	Classroom 110 Closet	yes	Ceiling	Concrete	White	None	0	N/A	N/A
8300	1	B830001-1	1	107C	Storage	Classroom 110 Closet	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	107	Primary	Classroom 109	yes	W1	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	107	Primary	Classroom 109	yes	Coat Rack	Metal	White	Friction	1	0	Negative
8300	1	B830001-1	1	107	Primary	Classroom 109	yes	W2	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	107	Primary	Classroom 109	yes	W3	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	107	Primary	Classroom 109	yes	Univent	Metal	Tan	Chipping	2	0.15	Negative
8300	1	B830001-1	1	107	Primary	Classroom 109	yes	W4	Sheetrock	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	107	Primary	Classroom 109	yes	Ceiling	Concrete	White	None	0	N/A	N/A

					Inspection Dates: 01/19/22									
					Inspector Name and Certificate Number: Ryan Hutsell PA RA:059512			Lead Safe Certification Assessment Report						
					Inspection Company: Synertech			Mayfair School						
ULCS #	Element	BldgElmt ID	Floor	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
8300	1	B830001-1	1	107	Primary	Classroom 109	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	107	Primary	Classroom 109	yes	Cove Base	Transite	Tan	Chipping	10	0	Negative
8300	1	B830001-1	1	107	Primary	Classroom 109	yes	Cove Base	Transite	Black	Chipping	10	0	Negative
8300	1	B830001-1	1	107B	Storage	Classroom 109 Closet	yes	W1	CMU	Tan	None	0	N/A	N/A
8300	1	B830001-1	1	107B	Storage	Classroom 109 Closet	yes	W2	CMU	Tan	None	0	N/A	N/A
8300	1	B830001-1	1	107B	Storage	Classroom 109 Closet	yes	W3	CMU	Tan	None	0	N/A	N/A
8300	1	B830001-1	1	107B	Storage	Classroom 109 Closet	yes	W4	CMU	Tan	None	0	N/A	N/A
8300	1	B830001-1	1	107B	Storage	Classroom 109 Closet	yes	Ceiling	Plaster	White	None	0	N/A	N/A
8300	1	B830001-1	1	107B	Storage	Classroom 109 Closet	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	106	Primary	Classroom 108	yes	W1	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	106	Primary	Classroom 108	yes	Coat Rack	Metal	White	Friction	1	0	Negative
8300	1	B830001-1	1	106	Primary	Classroom 108	yes	W2	Sheetrock	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	106	Primary	Classroom 108	yes	W3	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	106	Primary	Classroom 108	yes	Univent	Metal	Tan	Chipping	2	0.1	Negative
8300	1	B830001-1	1	106	Primary	Classroom 108	yes	W4	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	106	Primary	Classroom 108	yes	Ceiling	Concrete	White	None	0	N/A	N/A
8300	1	B830001-1	1	106	Primary	Classroom 108	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	106	Primary	Classroom 108	yes	Cove Base	Transite	Black	Chipping	10	0	Negative
8300	1	B830001-1	1	106B	Storage	Classroom 108 Left Closet	yes	W1	CMU	Tan	None	0	N/A	N/A
8300	1	B830001-1	1	106B	Storage	Classroom 108 Left Closet	yes	W2	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	106B	Storage	Classroom 108 Left Closet	yes	W3	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	106B	Storage	Classroom 108 Left Closet	yes	Shelves	Wood	White	Friction	4	3.9	Positive
8300	1	B830001-1	1	106B	Storage	Classroom 108 Left Closet	yes	W4	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	106B	Storage	Classroom 108 Left Closet	yes	Ceiling	Plaster	White	None	0	N/A	N/A
8300	1	B830001-1	1	106B	Storage	Classroom 108 Left Closet	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	106C	Storage	Classroom 108 Right Closet	yes	W1	CMU	Tan	None	0	N/A	N/A
8300	1	B830001-1	1	106C	Storage	Classroom 108 Right Closet	yes	W2	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	106C	Storage	Classroom 108 Right Closet	yes	W3	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	106C	Storage	Classroom 108 Right Closet	yes	W4	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	106C	Storage	Classroom 108 Right Closet	yes	Ceiling	Plaster	White	None	0	N/A	N/A
8300	1	B830001-1	1	106C	Storage	Classroom 108 Right Closet	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	106A	Administrative Office	Storage Closet D Office	yes	W1	CMU	Tan	None	0	N/A	N/A

					Inspection Dates: 01/19/22									
					Inspector Name and Certificate Number: Ryan Hutsell PA RA:059512			Lead Safe Certification Assessment Report						
					Inspection Company: Synertech			Mayfair School						
ULCS #	Element	BldgElmt ID	Floor	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
8300	1	B830001-1	1	106A	Administrative Office	Storage Closet D Office	yes	W2	CMU	Tan	None	0	N/A	N/A
8300	1	B830001-1	1	106A	Administrative Office	Storage Closet D Office	yes	W3	CMU	Tan	None	0	N/A	N/A
8300	1	B830001-1	1	106A	Administrative Office	Storage Closet D Office	yes	W4	CMU	Tan	Flaking	6	0	Negative
8300	1	B830001-1	1	106A	Administrative Office	Storage Closet D Office	yes	Radiator	Metal	White	Chipping	2	0.15	Negative
8300	1	B830001-1	1	106A	Administrative Office	Storage Closet D Office	yes	Ceiling	Concrete	White	None	0	N/A	N/A
8300	1	B830001-1	1	106A	Administrative Office	Storage Closet D Office	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	106A	Administrative Office	Storage Closet D Office	yes	Cove Base	Transite	White	Chipping	5	0	Negative
8300	1	B830001-1	1	113	Primary	Classroom 117	yes	W1	CMU	Tan	Chipping	1	0	Negative
8300	1	B830001-1	1	113	Primary	Classroom 117	yes	Coat Rack	Metal	White	Friction	1	0	Negative
8300	1	B830001-1	1	113	Primary	Classroom 117	yes	Pipe	Metal	Blue	Flaking	1	0.1	Negative
8300	1	B830001-1	1	113	Primary	Classroom 117	yes	Pipe	Metal	Black	Flaking	1	0.1	Negative
8300	1	B830001-1	1	113	Primary	Classroom 117	yes	W2	Vinyl	Tan	None	0	N/A	N/A
8300	1	B830001-1	1	113	Primary	Classroom 117	yes	W3	CMU	Tan	Chipping	1	0.1	Negative
8300	1	B830001-1	1	113	Primary	Classroom 117	yes	Univent	Metal	Tan	Chipping	2	0.3	Negative
8300	1	B830001-1	1	113	Primary	Classroom 117	yes	Cabinet	Wood	Tan	Chipping	2	0.1	Negative
8300	1	B830001-1	1	113	Primary	Classroom 117	yes	W4	CMU	Tan	Chipping	1	0	Negative
8300	1	B830001-1	1	113	Primary	Classroom 117	yes	Ceiling	Concrete	White	Chipping	1	0	Negative
8300	1	B830001-1	1	113	Primary	Classroom 117	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	113	Primary	Classroom 117	yes	Baseboard	Transite	Tan	Chipping	10	0	Negative
8300	1	B830001-1	1	113A	Student Restrooms - Male (4-12)	Restroom in Classroom 117	yes	W1	CMU	Tan	Chipping	1	0	Negative
8300	1	B830001-1	1	113A	Student Restrooms - Male (4-12)	Restroom in Classroom 117	yes	W2	CMU	Tan	Chipping	1	0.1	Negative
8300	1	B830001-1	1	113A	Student Restrooms - Male (4-12)	Restroom in Classroom 117	yes	W3	CMU	Tan	Chipping	1	0.08	Negative
8300	1	B830001-1	1	113A	Student Restrooms - Male (4-12)	Restroom in Classroom 117	yes	W4	CMU	Tan	Chipping	1	0	Negative
8300	1	B830001-1	1	113A	Student Restrooms - Male (4-12)	Restroom in Classroom 117	yes	Ceiling	Concrete	White	None	0	0	Negative
8300	1	B830001-1	1	113A	Student Restrooms - Male (4-12)	Restroom in Classroom 117	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	114	Primary	Classroom 118	yes	W1	CMU	Tan	Chipping	1	0	Negative
8300	1	B830001-1	1	114	Primary	Classroom 118	yes	Coat Rack	Metal	White	Friction	1	0	Negative
8300	1	B830001-1	1	114	Primary	Classroom 118	yes	W2	Vinyl	Tan	None	0	N/A	N/A
8300	1	B830001-1	1	114	Primary	Classroom 118	yes	W3	CMU	Tan	Chipping	1	0	Negative
8300	1	B830001-1	1	114	Primary	Classroom 118	yes	Univent	Metal	Tan	Flaking	2	0.13	Negative
8300	1	B830001-1	1	114	Primary	Classroom 118	yes	W4	Vinyl	Tan	None	0	N/A	N/A



					Inspection Dates: 01/19/22									
					Inspector Name and Certificate Number: Ryan Hutsell PA RA:059512			Lead Safe Certification Assessment Report						
					Inspection Company: Synertech			Mayfair School						
ULCS #	Element	BldgElmt ID	Floor	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
8300	1	B830001-1	1	114	Primary	Classroom 118	yes	Ceiling	Concrete	White	Chipping	2	0	Negative
8300	1	B830001-1	1	114	Primary	Classroom 118	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	114A	Student Restrooms - Male (4-12)	Boys Restroom in Classroom 118	yes	W1	CMU	Tan	None	0	0	Negative
8300	1	B830001-1	1	114A	Student Restrooms - Male (4-12)	Boys Restroom in Classroom 118	yes	W2	CMU	Tan	None	0	0	Negative
8300	1	B830001-1	1	114A	Student Restrooms - Male (4-12)	Boys Restroom in Classroom 118	yes	W3	CMU	Tan	None	0	0	Negative
8300	1	B830001-1	1	114A	Student Restrooms - Male (4-12)	Boys Restroom in Classroom 118	yes	W4	CMU	Tan	None	0	0	Negative
8300	1	B830001-1	1	114A	Student Restrooms - Male (4-12)	Boys Restroom in Classroom 118	yes	Ceiling	Concrete	White	None	0	0	Negative
8300	1	B830001-1	1	114A	Student Restrooms - Male (4-12)	Boys Restroom in Classroom 118	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	114B	Student Restrooms - Female (4-12)	Girl's Restroom in Classroom 118	yes	W1	CMU	Tan	None	0	N/A	N/A
8300	1	B830001-1	1	114B	Student Restrooms - Female (4-12)	Girl's Restroom in Classroom 118	yes	W2	CMU	Tan	None	0	N/A	N/A
8300	1	B830001-1	1	114B	Student Restrooms - Female (4-12)	Girl's Restroom in Classroom 118	yes	W3	CMU	Tan	None	0	N/A	N/A
8300	1	B830001-1	1	114B	Student Restrooms - Female (4-12)	Girl's Restroom in Classroom 118	yes	W4	CMU	Tan	None	0	N/A	N/A
8300	1	B830001-1	1	114B	Student Restrooms - Female (4-12)	Girl's Restroom in Classroom 118	yes	Ceiling	Concrete	White	None	0	0	Negative
8300	1	B830001-1	1	114B	Student Restrooms - Female (4-12)	Girl's Restroom in Classroom 118	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	114	Primary	Classroom 118	yes	Baseboard	Transite	Tan	Chipping	10	0	Negative
8300	1	B830001-1	1	116	Primary	Classroom 119	yes	W1	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	116	Primary	Classroom 119	yes	Coat Rack	Metal	White	Friction	1	0	Negative
8300	1	B830001-1	1	116	Primary	Classroom 119	yes	W2	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	116	Primary	Classroom 119	yes	W3	CMU	Tan	Chipping	4	0.1	Negative
8300	1	B830001-1	1	116	Primary	Classroom 119	yes	Radiator	Metal	Tan	Chipping	1	0.1	Negative
8300	1	B830001-1	1	116	Primary	Classroom 119	yes	W4	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	116	Primary	Classroom 119	yes	Ceiling	Concrete	White	None	0	N/A	N/A
8300	1	B830001-1	1	116	Primary	Classroom 119	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	116A	Student Restrooms - Male/Female (Classroom)	Classroom 119 Girls Restroom	yes	W1	CMU	Tan	None	0	0	Negative
8300	1	B830001-1	1	116A	Student Restrooms - Male/Female (Classroom)	Classroom 119 Girls Restroom	yes	W2	CMU	Tan	None	0	0	Negative

					Inspection Dates: 01/19/22									
					Inspector Name and Certificate Number: Ryan Hutsell PA RA:059512			Lead Safe Certification Assessment Report						
					Inspection Company: Synertech			Mayfair School						
ULCS #	Element	BldgElmt ID	Floor	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
8300	1	B830001-1	1	116A	Student Restrooms - Male/Female (Classroom)	Classroom 119 Girls Restroom	yes	W3	CMU	Tan	None	0	0	Negative
8300	1	B830001-1	1	116A	Student Restrooms - Male/Female (Classroom)	Classroom 119 Girls Restroom	yes	W4	CMU	Tan	None	0	0	Negative
8300	1	B830001-1	1	116A	Student Restrooms - Male/Female (Classroom)	Classroom 119 Girls Restroom	yes	Ceiling	Concrete	White	None	0	N/A	N/A
8300	1	B830001-1	1	116A	Student Restrooms - Male/Female (Classroom)	Classroom 119 Girls Restroom	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	116B	Student Restrooms - Male/Female (Classroom)	Classroom 119 Boy's Restroom	yes	W1	CMU	Tan	None	0	0	Negative
8300	1	B830001-1	1	116B	Student Restrooms - Male/Female (Classroom)	Classroom 119 Boy's Restroom	yes	W2	CMU	Tan	None	0	0	Negative
8300	1	B830001-1	1	116B	Student Restrooms - Male/Female (Classroom)	Classroom 119 Boy's Restroom	yes	W3	CMU	Tan	None	0	0	Negative
8300	1	B830001-1	1	116B	Student Restrooms - Male/Female (Classroom)	Classroom 119 Boy's Restroom	yes	W4	CMU	Tan	None	0	0	Negative
8300	1	B830001-1	1	116B	Student Restrooms - Male/Female (Classroom)	Classroom 119 Boy's Restroom	yes	Ceiling	Concrete	White	None	0	N/A	N/A
8300	1	B830001-1	1	116B	Student Restrooms - Male/Female (Classroom)	Classroom 119 Boy's Restroom	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	114C	Cafeteria (Dining Area)	Classroom 128	yes	W1	CMU	Tan	Chipping	1	0	Negative
8300	1	B830001-1	1	114C	Cafeteria (Dining Area)	Classroom 128	yes	Door Frame	Metal	Grey	Friction	1	0.1	Negative
8300	1	B830001-1	1	114C	Cafeteria (Dining Area)	Classroom 128	yes	W2	Vinyl	Tan	None	0	N/A	N/A
8300	1	B830001-1	1	114C	Cafeteria (Dining Area)	Classroom 128	yes	W3	CMU	Tan	Chipping	1	0	Negative
8300	1	B830001-1	1	114C	Cafeteria (Dining Area)	Classroom 128	yes	W4	CMU	Tan	None	0	0	Negative
8300	1	B830001-1	1	114C	Cafeteria (Dining Area)	Classroom 128	yes	Ceiling	Concrete	White	None	0	0	Negative
8300	1	B830001-1	1	114C	Cafeteria (Dining Area)	Classroom 128	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A

					Inspection Dates: 01/19/22									
					Inspector Name and Certificate Number: Ryan Hutsell PA RA:059512			Lead Safe Certification Assessment Report						
					Inspection Company: Synertech			Mayfair School						
ULCS #	Element	BldgElmt ID	Floor	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
8300	1	B830001-1	1	114C	Cafeteria (Dining Area)	Classroom 128	yes	Baseboard	Transite	Tan	Chipping	10	0	Negative
8300	1	B830001-1	1	114F	Service Closets	Custodial Closet Next to Classroom 119	no	W1	CMU	Tan	Flaking	10	0	Negative
8300	1	B830001-1	1	114F	Service Closets	Custodial Closet Next to Classroom 119	no	Pipe	Metal	White	Flaking	2	0.17	Negative
8300	1	B830001-1	1	114F	Service Closets	Custodial Closet Next to Classroom 119	no	W2	CMU	Tan	Flaking	10	0	Negative
8300	1	B830001-1	1	114F	Service Closets	Custodial Closet Next to Classroom 119	no	Shelf	Wood	White	Friction	2	0.1	Negative
8300	1	B830001-1	1	114F	Service Closets	Custodial Closet Next to Classroom 119	no	W3	CMU	Tan	Flaking	10	0	Negative
8300	1	B830001-1	1	114F	Service Closets	Custodial Closet Next to Classroom 119	no	Shelf	Wood	White	Friction	2	0.2	Negative
8300	1	B830001-1	1	114F	Service Closets	Custodial Closet Next to Classroom 119	no	W4	CMU	Tan	Flaking	10	0	Negative
8300	1	B830001-1	1	114F	Service Closets	Custodial Closet Next to Classroom 119	no	Ceiling	Concrete	White	Flaking	5	0	Negative
8300	1	B830001-1	1	114F	Service Closets	Custodial Closet Next to Classroom 119	no	Pipe	Metal	White	Flaking	3	0.32	Negative
8300	1	B830001-1	1	114F	Service Closets	Custodial Closet Next to Classroom 119	no	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	114E	Pipe Chase	Pipe Chase in Custodial Closet Next to Classroom 119	no	W1	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	114E	Pipe Chase	Pipe Chase in Custodial Closet Next to Classroom 119	no	W2	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	114E	Pipe Chase	Pipe Chase in Custodial Closet Next to Classroom 119	no	W3	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	114E	Pipe Chase	Pipe Chase in Custodial Closet Next to Classroom 119	no	W4	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	114E	Pipe Chase	Pipe Chase in Custodial Closet Next to Classroom 119	no	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	114E	Pipe Chase	Pipe Chase in Custodial Closet Next to Classroom 119	no	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	114G	Storage	Book Closet next to Classroom 119	yes	W1	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	114G	Storage	Book Closet next to Classroom 119	yes	W2	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	114G	Storage	Book Closet next to Classroom 119	yes	W3	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	114G	Storage	Book Closet next to Classroom 119	yes	W4	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	114G	Storage	Book Closet next to Classroom 119	yes	Shelves	Wood	White	Friction	2	2	Positive

					Inspection Dates: 01/19/22									
					Inspector Name and Certificate Number: Ryan Hutsell PA RA:059512			Lead Safe Certification Assessment Report						
					Inspection Company: Synertech			Mayfair School						
ULCS #	Element	BldgElmt ID	Floor	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
8300	1	B830001-1	1	114G	Storage	Book Closet next to Classroom 119	yes	Ceiling	Concrete	White	None	0	N/A	N/A
8300	1	B830001-1	1	114G	Storage	Book Closet next to Classroom 119	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	114D	Storage	Storage in Stairs Next to Kindergarten Wing	no	W1	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	114D	Storage	Storage in Stairs Next to Kindergarten Wing	no	W2	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	114D	Storage	Storage in Stairs Next to Kindergarten Wing	no	W3	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	114D	Storage	Storage in Stairs Next to Kindergarten Wing	no	W4	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	114D	Storage	Storage in Stairs Next to Kindergarten Wing	no	Ceiling	Concrete	White	None	0	N/A	N/A
8300	1	B830001-1	1	114D	Storage	Storage in Stairs Next to Kindergarten Wing	no	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	S14	Stairs	Exterior Stairs Next to Kindergarten Wing	yes	W1	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	S14	Stairs	Exterior Stairs Next to Kindergarten Wing	yes	W2	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	S14	Stairs	Exterior Stairs Next to Kindergarten Wing	yes	W3	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	S14	Stairs	Exterior Stairs Next to Kindergarten Wing	yes	W4	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	S14	Stairs	Exterior Stairs Next to Kindergarten Wing	yes	Ceiling	Concrete	White	None	0	N/A	N/A
8300	1	B830001-1	1	S14	Stairs	Exterior Stairs Next to Kindergarten Wing	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	120	Primary	Classroom 120	yes	W1	CMU	Tan	Chipping	1	0	Negative
8300	1	B830001-1	1	120	Primary	Classroom 120	yes	Coat Rack	Metal	White	Friction	1	0	Negative
8300	1	B830001-1	1	120	Primary	Classroom 120	yes	W2	CMU	Tan	Chipping	1	0	Negative
8300	1	B830001-1	1	120	Primary	Classroom 120	yes	Shelf	Wood	Tan	Chipping	2	1.2	Positive
8300	1	B830001-1	1	120	Primary	Classroom 120	yes	W3	CMU	Tan	Chipping	1	0	Negative
8300	1	B830001-1	1	120	Primary	Classroom 120	yes	Bench	Wood	White	Chipping	1	1	Positive
8300	1	B830001-1	1	120	Primary	Classroom 120	yes	W4	CMU	Tan	Chipping	1	0.08	Negative
8300	1	B830001-1	1	120	Primary	Classroom 120	yes	Shelf	Wood	Tan	Chipping	2	0.9	Positive
8300	1	B830001-1	1	120	Primary	Classroom 120	yes	Ceiling	Concrete	White	None	0	0	Negative
8300	1	B830001-1	1	120	Primary	Classroom 120	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	120	Primary	Classroom 120	yes	Baseboard	Transite	Tan	Chipping	20	0.04	Negative
8300	1	B830001-1	1	120A	Storage	Classroom 120 Closet by Entrance	yes	W1	CMU	White	None	0	N/A	N/A
8300	1	B830001-1	1	120A	Storage	Classroom 120 Closet by Entrance	yes	W2	CMU	Tan	Chipping	1	0	Negative

					Inspection Dates: 01/19/22									
					Inspector Name and Certificate Number: Ryan Hutsell PA RA:059512			Lead Safe Certification Assessment Report						
					Inspection Company: Synertech			Mayfair School						
ULCS #	Element	BldgElmt ID	Floor	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
8300	1	B830001-1	1	120A	Storage	Classroom 120 Closet by Entrance	yes	W3	CMU	Tan	None	0	0	Negative
8300	1	B830001-1	1	120A	Storage	Classroom 120 Closet by Entrance	yes	W4	CMU	Tan	None	0	0	Negative
8300	1	B830001-1	1	120A	Storage	Classroom 120 Closet by Entrance	yes	Ceiling	Concrete	White	None	0	0	Negative
8300	1	B830001-1	1	120A	Storage	Classroom 120 Closet by Entrance	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	120B	Restroom - Female	Classroom 120 Girls Restroom	yes	W1	CMU	Tan	None	0	0	Negative
8300	1	B830001-1	1	120B	Restroom - Female	Classroom 120 Girls Restroom	yes	W2	CMU	Tan	None	0	0	Negative
8300	1	B830001-1	1	120B	Restroom - Female	Classroom 120 Girls Restroom	yes	W3	CMU	Tan	None	0	0	Negative
8300	1	B830001-1	1	120B	Restroom - Female	Classroom 120 Girls Restroom	yes	W4	CMU	Tan	None	0	0	Negative
8300	1	B830001-1	1	120B	Restroom - Female	Classroom 120 Girls Restroom	yes	Ceiling	Concrete	White	None	0	0	Negative
8300	1	B830001-1	1	120B	Restroom - Female	Classroom 120 Girls Restroom	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	120C	Restroom - Male	Classroom 120 Boys Restroom	yes	W1	CMU	Tan	None	0	0	Negative
8300	1	B830001-1	1	120C	Restroom - Male	Classroom 120 Boys Restroom	yes	W2	CMU	Tan	None	0	0	Negative
8300	1	B830001-1	1	120C	Restroom - Male	Classroom 120 Boys Restroom	yes	W3	CMU	Tan	None	0	0	Negative
8300	1	B830001-1	1	120C	Restroom - Male	Classroom 120 Boys Restroom	yes	W4	CMU	Tan	None	0	0	Negative
8300	1	B830001-1	1	120C	Restroom - Male	Classroom 120 Boys Restroom	yes	Ceiling	Concrete	White	None	0	0	Negative
8300	1	B830001-1	1	120C	Restroom - Male	Classroom 120 Boys Restroom	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	120C PC	Pipe Chase	Classroom 120 Boys Restroom Pipe Chase	no	W1	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	120C PC	Pipe Chase	Classroom 120 Boys Restroom Pipe Chase	no	W2	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	120C PC	Pipe Chase	Classroom 120 Boys Restroom Pipe Chase	no	W3	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	120C PC	Pipe Chase	Classroom 120 Boys Restroom Pipe Chase	no	W4	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	120C PC	Pipe Chase	Classroom 120 Boys Restroom Pipe Chase	no	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	120C PC	Pipe Chase	Classroom 120 Boys Restroom Pipe Chase	no	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	H20	Circulation (Hallway)	Hallway between Classroom 119 and Classroom 120	yes	W1	CMU	Tan	None	0	0	Negative
8300	1	B830001-1	1	H20	Circulation (Hallway)	Hallway between Classroom 119 and Classroom 120	yes	W2	CMU	Tan	None	0	0	Negative
8300	1	B830001-1	1	H20	Circulation (Hallway)	Hallway between Classroom 119 and Classroom 120	yes	W3	CMU	Tan	None	0	0	Negative
8300	1	B830001-1	1	H20	Circulation (Hallway)	Hallway between Classroom 119 and Classroom 120	yes	W4	CMU	Tan	None	0	0.02	Negative
8300	1	B830001-1	1	H20	Circulation (Hallway)	Hallway between Classroom 119 and Classroom 120	yes	Ceiling	Plaster	White	None	0	0.05	Negative
8300	1	B830001-1	1	H20	Circulation (Hallway)	Hallway between Classroom 119 and Classroom 120	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A

					Inspection Dates: 01/19/22									
					Inspector Name and Certificate Number: Ryan Hutsell PA RA:059512			Lead Safe Certification Assessment Report						
					Inspection Company: Synertech			Mayfair School						
ULCS #	Element	BldgElmt ID	Floor	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
8300	1	B830001-1	1	NP1A	Primary	Classroom 123: "IBS Teacher Leader Office"	yes	W1	CMU	White	Chipping	8	0	Negative
8300	1	B830001-1	1	NP1A	Primary	Classroom 123: "IBS Teacher Leader Office"	yes	W1	Plaster	White	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	NP1A	Primary	Classroom 123: "IBS Teacher Leader Office"	yes	W2	CMU	White	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	NP1A	Primary	Classroom 123: "IBS Teacher Leader Office"	yes	W2	Plaster	White	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	NP1A	Primary	Classroom 123: "IBS Teacher Leader Office"	yes	W3	CMU	White	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	NP1A	Primary	Classroom 123: "IBS Teacher Leader Office"	yes	W3	Plaster	White	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	NP1A	Primary	Classroom 123: "IBS Teacher Leader Office"	yes	Radiator	Metal	Tan	Chipping	4	0.17	Negative
8300	1	B830001-1	1	NP1A	Primary	Classroom 123: "IBS Teacher Leader Office"	yes	W4	CMU	White	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	NP1A	Primary	Classroom 123: "IBS Teacher Leader Office"	yes	W4	Plaster	White	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	NP1A	Primary	Classroom 123: "IBS Teacher Leader Office"	yes	Ceiling	Concrete	White	Flaking	2	0	Negative
8300	1	B830001-1	1	NP1A	Primary	Classroom 123: "IBS Teacher Leader Office"	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	NP1A	Primary	Classroom 123: "IBS Teacher Leader Office"	yes	Cove Base	Transite	Tan	Chipping	20	0	Negative
8300	1	B830001-1	1	117A	Storage	Classroom 123-Bathroom By Windows	yes	W1	CMU	Tan	None	0	N/A	N/A
8300	1	B830001-1	1	117A	Storage	Classroom 123-Bathroom By Windows	yes	W2	CMU	Tan	None	0	N/A	N/A
8300	1	B830001-1	1	117A	Storage	Classroom 123-Bathroom By Windows	yes	W3	CMU	Tan	None	0	N/A	N/A
8300	1	B830001-1	1	117A	Storage	Classroom 123-Bathroom By Windows	yes	W4	CMU	Tan	None	0	N/A	N/A
8300	1	B830001-1	1	117A	Storage	Classroom 123-Bathroom By Windows	yes	Ceiling	Concrete	White	None	0	N/A	N/A
8300	1	B830001-1	1	117A	Storage	Classroom 123-Bathroom By Windows	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	117B	Storage	Classroom 123-Middle Closet	yes	W1	CMU	Tan	None	0	N/A	N/A
8300	1	B830001-1	1	117B	Storage	Classroom 123-Middle Closet	yes	W2	CMU	Tan	None	0	N/A	N/A
8300	1	B830001-1	1	117B	Storage	Classroom 123-Middle Closet	yes	W3	CMU	Tan	None	0	N/A	N/A
8300	1	B830001-1	1	117B	Storage	Classroom 123-Middle Closet	yes	W4	CMU	Tan	None	0	N/A	N/A
8300	1	B830001-1	1	117B	Storage	Classroom 123-Middle Closet	yes	Ceiling	Concrete	White	None	0	N/A	N/A
8300	1	B830001-1	1	117B	Storage	Classroom 123-Middle Closet	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A

					Inspection Dates: 01/19/22									
					Inspector Name and Certificate Number: Ryan Hutsell PA RA:059512			Lead Safe Certification Assessment Report						
					Inspection Company: Synertech			Mayfair School						
ULCS #	Element	BldgElmt ID	Floor	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
8300	1	B830001-1	1	117C	Student Restrooms - Male/Female (Classroom)	Classroom 123-Restroom	yes	W1	CMU	Tan	None	0	N/A	N/A
8300	1	B830001-1	1	117C	Student Restrooms - Male/Female (Classroom)	Classroom 123-Restroom	yes	W2	CMU	Tan	None	0	N/A	N/A
8300	1	B830001-1	1	117C	Student Restrooms - Male/Female (Classroom)	Classroom 123-Restroom	yes	W3	CMU	Tan	None	0	N/A	N/A
8300	1	B830001-1	1	117C	Student Restrooms - Male/Female (Classroom)	Classroom 123-Restroom	yes	W4	CMU	Tan	None	0	N/A	N/A
8300	1	B830001-1	1	117C	Student Restrooms - Male/Female (Classroom)	Classroom 123-Restroom	yes	Ceiling	Concrete	White	None	0	N/A	N/A
8300	1	B830001-1	1	117C	Student Restrooms - Male/Female (Classroom)	Classroom 123-Restroom	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	117	Health Service Room	Nurse's Office 122	yes	W1	Plaster	White	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	117	Health Service Room	Nurse's Office 122	yes	W2	Plaster	White	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	117	Health Service Room	Nurse's Office 122	yes	W3	Plaster	White	Flaking	4	0	Negative
8300	1	B830001-1	1	117	Health Service Room	Nurse's Office 122	yes	W4	Plaster	White	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	117	Health Service Room	Nurse's Office 122	yes	Ceiling	Concrete	White	None	0	N/A	N/A
8300	1	B830001-1	1	117	Health Service Room	Nurse's Office 122	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	117	Health Service Room	Nurse's Office 122	yes	Cove Base	Transite	Tan	Chipping	10	0.04	Negative
8300	1	B830001-1	1	117A	Storage	Nurse's Office Closet	yes	W1	Plaster	White	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	117A	Storage	Nurse's Office Closet	yes	W2	Plaster	White	Flaking	2	0	Negative
8300	1	B830001-1	1	117A	Storage	Nurse's Office Closet	yes	Radiator	Metal	Tan	Flaking	2	0.14	Negative
8300	1	B830001-1	1	117A	Storage	Nurse's Office Closet	yes	W3	Plaster	White	Flaking	2	0	Negative
8300	1	B830001-1	1	117A	Storage	Nurse's Office Closet	yes	W4	Plaster	White	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	117A	Storage	Nurse's Office Closet	yes	Ceiling	Concrete	White	None	0	N/A	N/A
8300	1	B830001-1	1	117A	Storage	Nurse's Office Closet	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	117PC	Pipe Chase	Nurses Office Pipe Chase	no	W1	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	117PC	Pipe Chase	Nurses Office Pipe Chase	no	W2	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	117PC	Pipe Chase	Nurses Office Pipe Chase	no	W3	N/A	N/A	N/A	N/A	N/A	N/A

					Inspection Dates: 01/19/22									
					Inspector Name and Certificate Number: Ryan Hutsell PA RA:059512			Lead Safe Certification Assessment Report						
					Inspection Company: Synertech			Mayfair School						
ULCS #	Element	BldgElmt ID	Floor	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
8300	1	B830001-1	1	117PC	Pipe Chase	Nurses Office Pipe Chase	no	W4	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	117PC	Pipe Chase	Nurses Office Pipe Chase	no	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	117PC	Pipe Chase	Nurses Office Pipe Chase	no	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	117AB	Primary	Classroom 121	yes	W1	CMU	White	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	117AB	Primary	Classroom 121	yes	W2	CMU	White	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	117AB	Primary	Classroom 121	yes	W3	CMU	White	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	117AB	Primary	Classroom 121	yes	Univent	Metal	Tan	Flaking	2	0.23	Negative
8300	1	B830001-1	1	117AB	Primary	Classroom 121	yes	W4	CMU	White	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	117AB	Primary	Classroom 121	yes	Ceiling	Concrete	White	None	0	N/A	N/A
8300	1	B830001-1	1	117AB	Primary	Classroom 121	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	117AB	Primary	Classroom 121	yes	Cove Base	Transite	Tan	Chipping	10	0	Negative
8300	1	B830001-1	1	127A	Restrooms, Staff - Male	Men's Restroom near 1st Floor Copy Room	yes	W1	CMU	Tan	None	0	N/A	N/A
8300	1	B830001-1	1	127A	Restrooms, Staff - Male	Men's Restroom near 1st Floor Copy Room	yes	W2	CMU	Tan	None	0	N/A	N/A
8300	1	B830001-1	1	127A	Restrooms, Staff - Male	Men's Restroom near 1st Floor Copy Room	yes	W3	CMU	Tan	None	0	N/A	N/A
8300	1	B830001-1	1	127A	Restrooms, Staff - Male	Men's Restroom near 1st Floor Copy Room	yes	W4	CMU	Tan	None	0	N/A	N/A
8300	1	B830001-1	1	127A	Restrooms, Staff - Male	Men's Restroom near 1st Floor Copy Room	yes	Ceiling	Concrete	White	None	0	N/A	N/A
8300	1	B830001-1	1	127A	Restrooms, Staff - Male	Men's Restroom near 1st Floor Copy Room	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	127B	Restrooms, Staff - Female	Women's Restroom near 1st Floor Copy Room	yes	W1	CMU	Tan	None	0	N/A	N/A
8300	1	B830001-1	1	127B	Restrooms, Staff - Female	Women's Restroom near 1st Floor Copy Room	yes	W2	CMU	Tan	None	0	N/A	N/A
8300	1	B830001-1	1	127B	Restrooms, Staff - Female	Women's Restroom near 1st Floor Copy Room	yes	W3	CMU	Tan	None	0	N/A	N/A
8300	1	B830001-1	1	127B	Restrooms, Staff - Female	Women's Restroom near 1st Floor Copy Room	yes	W4	CMU	Tan	None	0	N/A	N/A
8300	1	B830001-1	1	127B	Restrooms, Staff - Female	Women's Restroom near 1st Floor Copy Room	yes	Ceiling	Concrete	White	None	0	N/A	N/A
8300	1	B830001-1	1	127B	Restrooms, Staff - Female	Women's Restroom near 1st Floor Copy Room	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	127C	Pipe Chase	Pipe Chase in Men's Restroom by Main Office	no	W1	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	127C	Pipe Chase	Pipe Chase in Men's Restroom by Main Office	no	W2	N/A	N/A	N/A	N/A	N/A	N/A



					Inspection Dates: 01/19/22									
					Inspector Name and Certificate Number: Ryan Hutsell PA RA:059512			Lead Safe Certification Assessment Report						
					Inspection Company: Synertech			Mayfair School						
ULCS #	Element	BldgElmt ID	Floor	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
8300	1	B830001-1	1	127C	Pipe Chase	Pipe Chase in Men's Restroom by Main Office	no	W3	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	127C	Pipe Chase	Pipe Chase in Men's Restroom by Main Office	no	W4	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	127C	Pipe Chase	Pipe Chase in Men's Restroom by Main Office	no	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	127C	Pipe Chase	Pipe Chase in Men's Restroom by Main Office	no	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	130	Copying Room	Copy Room to Faculty Lounge	yes	W1	Plaster	Tan	None	0	N/A	N/A
8300	1	B830001-1	1	130	Copying Room	Copy Room to Faculty Lounge	yes	Chair Rail	Wood	White	Chipping	6	0	Negative
8300	1	B830001-1	1	130	Copying Room	Copy Room to Faculty Lounge	yes	W2	Plaster	Tan	Chipping	20	0	Negative
8300	1	B830001-1	1	130	Copying Room	Copy Room to Faculty Lounge	yes	Chair Rail	Wood	White	Chipping	6	0	Negative
8300	1	B830001-1	1	130	Copying Room	Copy Room to Faculty Lounge	yes	W3	Plaster	Tan	None	0	N/A	N/A
8300	1	B830001-1	1	130	Copying Room	Copy Room to Faculty Lounge	yes	Chair Rail	Wood	White	Chipping	6	0	Negative
8300	1	B830001-1	1	130	Copying Room	Copy Room to Faculty Lounge	yes	Univent	Metal	Tan	Chipping	3	0	Negative
8300	1	B830001-1	1	130	Copying Room	Copy Room to Faculty Lounge	yes	W4	Plaster	Tan	Cracking	4	0.02	Negative
8300	1	B830001-1	1	130	Copying Room	Copy Room to Faculty Lounge	yes	Chair Rail	Wood	White	Chipping	6	0	Negative
8300	1	B830001-1	1	130	Copying Room	Copy Room to Faculty Lounge	yes	Ceiling	Concrete	White	None	0	N/A	N/A
8300	1	B830001-1	1	130	Copying Room	Copy Room to Faculty Lounge	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	130	Copying Room	Copy Room to Faculty Lounge	yes	Cove Base	Transite	Tan	Chipping	10	0	Negative
8300	1	B830001-1	1	130A	Restrooms, Staff - Male/Female	Staff Restroom in Copy Lounge	yes	W1	CMU	Tan	None	0	N/A	N/A
8300	1	B830001-1	1	130A	Restrooms, Staff - Male/Female	Staff Restroom in Copy Lounge	yes	W2	CMU	Tan	None	0	N/A	N/A
8300	1	B830001-1	1	130A	Restrooms, Staff - Male/Female	Staff Restroom in Copy Lounge	yes	W3	CMU	Tan	None	0	N/A	N/A
8300	1	B830001-1	1	130A	Restrooms, Staff - Male/Female	Staff Restroom in Copy Lounge	yes	W4	CMU	Tan	None	0	N/A	N/A
8300	1	B830001-1	1	130A	Restrooms, Staff - Male/Female	Staff Restroom in Copy Lounge	yes	Ceiling	Concrete	White	None	0	N/A	N/A
8300	1	B830001-1	1	130A	Restrooms, Staff - Male/Female	Staff Restroom in Copy Lounge	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	130B	Telecommunication Equipment Room	Server Closet in Copy Room	yes	W1	CMU	Tan	None	0	N/A	N/A
8300	1	B830001-1	1	130B	Telecommunication Equipment Room	Server Closet in Copy Room	yes	W2	CMU	Tan	None	0	N/A	N/A
8300	1	B830001-1	1	130B	Telecommunication Equipment Room	Server Closet in Copy Room	yes	W3	CMU	Tan	None	0	N/A	N/A
8300	1	B830001-1	1	130B	Telecommunication Equipment Room	Server Closet in Copy Room	yes	W4	CMU	Tan	None	0	N/A	N/A
8300	1	B830001-1	1	130B	Telecommunication Equipment Room	Server Closet in Copy Room	yes	Ceiling	Concrete	White	None	0	N/A	N/A
8300	1	B830001-1	1	130B	Telecommunication Equipment Room	Server Closet in Copy Room	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A

					Inspection Dates: 01/19/22									
					Inspector Name and Certificate Number: Ryan Hutsell PA RA:059512			Lead Safe Certification Assessment Report						
					Inspection Company: Synertech			Mayfair School						
ULCS #	Element	BldgElmt ID	Floor	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
8300	1	B830001-1	1	131	Administrative Office	Faculty Room by Main Office	yes	W1	Plaster	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	131	Administrative Office	Faculty Room by Main Office	yes	W2	Plaster	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	131	Administrative Office	Faculty Room by Main Office	yes	W3	Plaster	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	131	Administrative Office	Faculty Room by Main Office	yes	Univent	Metal	Tan	Chipping	2	0.15	Negative
8300	1	B830001-1	1	131	Administrative Office	Faculty Room by Main Office	yes	W4	Plaster	Tan	Cracking	3	0	Negative
8300	1	B830001-1	1	131	Administrative Office	Faculty Room by Main Office	yes	Ceiling	Concrete	White	None	0	N/A	N/A
8300	1	B830001-1	1	131	Administrative Office	Faculty Room by Main Office	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	131	Administrative Office	Faculty Room by Main Office	yes	Cove Base	Transite	Black	Chipping	10	0	Negative
8300	1	B830001-1	1	126	Auditorium	Auditorium	yes	W1	Plaster	White	Chipping	8	0.06	Negative
8300	1	B830001-1	1	126	Auditorium	Auditorium	yes	Vent	Metal	Brown	Chipping	2	0.1	Negative
8300	1	B830001-1	1	126	Auditorium	Auditorium	yes	W2	Plaster	White	Chipping	10	0	Negative
8300	1	B830001-1	1	126	Auditorium	Auditorium	yes	W3	Plaster	White	None	0	N/A	N/A
8300	1	B830001-1	1	126	Auditorium	Auditorium	yes	W4	Plaster	White	Chipping	16	0.04	Negative
8300	1	B830001-1	1	126	Auditorium	Auditorium	yes	Door Frame	Metal	Brown	Friction	4	0.1	Negative
8300	1	B830001-1	1	126	Auditorium	Auditorium	yes	Door	Metal	Brown	Chipping	6	0	Negative
8300	1	B830001-1	1	126	Auditorium	Auditorium	yes	Ceiling	Plaster	White	None	0	N/A	N/A
8300	1	B830001-1	1	126	Auditorium	Auditorium	yes	Floor	Linoleum	Brown	Friction	20	0	Negative
8300	1	B830001-1	1	126	Auditorium	Auditorium	yes	Floor	Concrete	Brown	Chipping	2	0	Negative
8300	1	B830001-1	1	126	Auditorium	Auditorium	yes	Seats	Metal	Brown	Chipping	2	0	Negative
8300	1	B830001-1	1	126A	Stage	Auditorium Stage	yes	W1	CMU	Blue	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	126A	Stage	Auditorium Stage	yes	W2	CMU	White	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	126A	Stage	Auditorium Stage	yes	W3	CMU	White	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	126A	Stage	Auditorium Stage	yes	W4	CMU	White	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	126A	Stage	Auditorium Stage	yes	Ceiling	Plaster	White	Concrete	36	0	Negative
8300	1	B830001-1	1	126A	Stage	Auditorium Stage	yes	Ceiling Beams	Wood	White	Flaking	15	0	Negative
8300	1	B830001-1	1	126A	Stage	Auditorium Stage	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	126B	Storage	Auditorium Stage closet	yes	W1	CMU	Blue	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	126B	Storage	Auditorium Stage closet	yes	W2	CMU	Blue	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	126B	Storage	Auditorium Stage closet	yes	W3	CMU	Blue	Chipping	3	0	Negative

					Inspection Dates: 01/19/22									
					Inspector Name and Certificate Number: Ryan Hutsell PA RA:059512			Lead Safe Certification Assessment Report						
					Inspection Company: Synertech			Mayfair School						
ULCS #	Element	BldgElmt ID	Floor	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
8300	1	B830001-1	1	126B	Storage	Auditorium Stage closet	yes	W4	CMU	Blue	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	126B	Storage	Auditorium Stage closet	yes	Ceiling	Concrete	White	None	0	N/A	N/A
8300	1	B830001-1	1	126B	Storage	Auditorium Stage closet	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	126B PC	Pipe Chase	Auditorium Stage closet Pipe Chase	no	W1	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	126B PC	Pipe Chase	Auditorium Stage closet Pipe Chase	no	W2	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	126B PC	Pipe Chase	Auditorium Stage closet Pipe Chase	no	W3	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	126B PC	Pipe Chase	Auditorium Stage closet Pipe Chase	no	W4	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	126B PC	Pipe Chase	Auditorium Stage closet Pipe Chase	no	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	126B PC	Pipe Chase	Auditorium Stage closet Pipe Chase	no	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	125	Teacher Lounge/Dining	Faculty Room/ former Costume change on right rear of Stage	yes	W1	CMU	Blue	None	0	N/A	N/A
8300	1	B830001-1	1	125	Teacher Lounge/Dining	Faculty Room/ former Costume change on right rear of Stage	yes	W2	CMU	Blue	None	0	N/A	N/A
8300	1	B830001-1	1	125	Teacher Lounge/Dining	Faculty Room/ former Costume change on right rear of Stage	yes	W3	CMU	Blue	None	0	N/A	N/A
8300	1	B830001-1	1	125	Teacher Lounge/Dining	Faculty Room/ former Costume change on right rear of Stage	yes	Radiator	Metal	Blue	Flaking	2	0.12	Negative
8300	1	B830001-1	1	125	Teacher Lounge/Dining	Faculty Room/ former Costume change on right rear of Stage	yes	W4	CMU	Blue	None	0	N/A	N/A
8300	1	B830001-1	1	125	Teacher Lounge/Dining	Faculty Room/ former Costume change on right rear of Stage	yes	Ceiling	Concrete	White	None	0	N/A	N/A
8300	1	B830001-1	1	125	Teacher Lounge/Dining	Faculty Room/ former Costume change on right rear of Stage	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	124	Restrooms, Staff - Female	Faculty Room/ former Costume Room on left rear of Stage	yes	W1	CMU	Blue	None	0	N/A	N/A
8300	1	B830001-1	1	124	Restrooms, Staff - Female	Faculty Room/ former Costume Room on left rear of Stage	yes	W2	CMU	Blue	None	0	N/A	N/A
8300	1	B830001-1	1	124	Restrooms, Staff - Female	Faculty Room/ former Costume Room on left rear of Stage	yes	W3	CMU	Blue	None	0	N/A	N/A
8300	1	B830001-1	1	124	Restrooms, Staff - Female	Faculty Room/ former Costume Room on left rear of Stage	yes	Radiator	Metal	Blue	Flaking	2	0.1	Negative
8300	1	B830001-1	1	124	Restrooms, Staff - Female	Faculty Room/ former Costume Room on left rear of Stage	yes	W4	CMU	Blue	None	0	N/A	N/A
8300	1	B830001-1	1	124	Restrooms, Staff - Female	Faculty Room/ former Costume Room on left rear of Stage	yes	Ceiling	Concrete	White	None	0	N/A	N/A
8300	1	B830001-1	1	124	Restrooms, Staff - Female	Faculty Room/ former Costume Room on left rear of Stage	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A

					Inspection Dates: 01/19/22									
					Inspector Name and Certificate Number: Ryan Hutsell PA RA:059512			Lead Safe Certification Assessment Report						
					Inspection Company: Synertech			Mayfair School						
ULCS #	Element	BldgElmt ID	Floor	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
8300	1	B830001-1	1	123	Restrooms, Staff - Female	Restroom in Classroom behind Stage adjacent to Nurse's Wing Hallway	yes	W1	CMU	Blue	None	0	N/A	N/A
8300	1	B830001-1	1	123	Restrooms, Staff - Female	Restroom in Classroom behind Stage adjacent to Nurse's Wing Hallway	yes	W2	CMU	Blue	None	0	N/A	N/A
8300	1	B830001-1	1	123	Restrooms, Staff - Female	Restroom in Classroom behind Stage adjacent to Nurse's Wing Hallway	yes	Vent	Metal	Blue	Flaking	1	0.15	Negative
8300	1	B830001-1	1	123	Restrooms, Staff - Female	Restroom in Classroom behind Stage adjacent to Nurse's Wing Hallway	yes	W3	CMU	Blue	None	0	N/A	N/A
8300	1	B830001-1	1	123	Restrooms, Staff - Female	Restroom in Classroom behind Stage adjacent to Nurse's Wing Hallway	yes	W4	CMU	Blue	None	0	N/A	N/A
8300	1	B830001-1	1	123	Restrooms, Staff - Female	Restroom in Classroom behind Stage adjacent to Nurse's Wing Hallway	yes	Ceiling	Concrete	White	None	0	N/A	N/A
8300	1	B830001-1	1	123	Restrooms, Staff - Female	Restroom in Classroom behind Stage adjacent to Nurse's Wing Hallway	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	123A	Storage	Sink Closet in Classroom behind Stage adjacent to Nurse's Wing	yes	W1	CMU	White	None	0	N/A	N/A
8300	1	B830001-1	1	123A	Storage	Sink Closet in Classroom behind Stage adjacent to Nurse's Wing	yes	W2	CMU	Blue	Chipping	5	0.12	Negative
8300	1	B830001-1	1	123A	Storage	Sink Closet in Classroom behind Stage adjacent to Nurse's Wing	yes	W3	CMU	Blue	Chipping	10	0.16	Negative
8300	1	B830001-1	1	123A	Storage	Sink Closet in Classroom behind Stage adjacent to Nurse's Wing	yes	W4	CMU	Blue	Chipping	5	0.1	Negative
8300	1	B830001-1	1	123A	Storage	Sink Closet in Classroom behind Stage adjacent to Nurse's Wing	yes	Ceiling	Concrete	White	None	0	N/A	Negative
8300	1	B830001-1	1	123A	Storage	Sink Closet in Classroom behind Stage adjacent to Nurse's Wing	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	122	Primary	Classroom behind Stage adjacent to Nurse's Wing Hallway	yes	W1	CMU	Tan	Flaking	2	0	Negative
8300	1	B830001-1	1	122	Primary	Classroom behind Stage adjacent to Nurse's Wing Hallway	yes	W2	CMU	Tan	Flaking	4	0	Negative
8300	1	B830001-1	1	122	Primary	Classroom behind Stage adjacent to Nurse's Wing Hallway	yes	W2	Concrete	Tan	Chipping	24	0.1	Negative
8300	1	B830001-1	1	122	Primary	Classroom behind Stage adjacent to Nurse's Wing Hallway	yes	W3	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	122	Primary	Classroom behind Stage adjacent to Nurse's Wing Hallway	yes	W3	Concrete	Tan	Flaking	8	0.1	Negative
8300	1	B830001-1	1	122	Primary	Classroom behind Stage adjacent to Nurse's Wing Hallway	yes	Radiator	Metal	Brown	Flaking	2	0.06	Negative

					Inspection Dates: 01/19/22									
					Inspector Name and Certificate Number: Ryan Hutsell PA RA:059512			Lead Safe Certification Assessment Report						
					Inspection Company: Synertech			Mayfair School						
ULCS #	Element	BldgElmt ID	Floor	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
8300	1	B830001-1	1	122	Primary	Classroom behind Stage adjacent to Nurse's Wing Hallway	yes	W4	CMU	Tan	None	0	N/A	N/A
8300	1	B830001-1	1	122	Primary	Classroom behind Stage adjacent to Nurse's Wing Hallway	yes	Ceiling	Concrete	White	Flaking	4	0.06	Negative
8300	1	B830001-1	1	122	Primary	Classroom behind Stage adjacent to Nurse's Wing Hallway	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	122A	Mechanical Room	Auditorium Fan Room	no	W1	CMU	Green	Chipping	12	0	Negative
8300	1	B830001-1	1	122A	Mechanical Room	Auditorium Fan Room	no	Door Frame	Metal	Brown	Friction	1	0	Negative
8300	1	B830001-1	1	122A	Mechanical Room	Auditorium Fan Room	no	Door	Metal	Brown	Friction	2	0.1	Negative
8300	1	B830001-1	1	122A	Mechanical Room	Auditorium Fan Room	no	Hand Rail	Metal	Silver	Friction	2	0.04	Negative
8300	1	B830001-1	1	122A	Mechanical Room	Auditorium Fan Room	no	Stair Treads	Metal	Silver	Friction	2	0.1	Negative
8300	1	B830001-1	1	122A	Mechanical Room	Auditorium Fan Room	no	Ladder	Metal	Silver	Friction	2	0.05	Negative
8300	1	B830001-1	1	122A	Mechanical Room	Auditorium Fan Room	no	Door Frame	Metal	Green	Flaking	1	0.12	Negative
8300	1	B830001-1	1	122A	Mechanical Room	Auditorium Fan Room	yes	Door	Wood	Green	Flaking	2	6.7	Positive
8300	1	B830001-1	1	122A	Mechanical Room	Auditorium Fan Room	no	W2	CMU	Green	Chipping	20	0	Negative
8300	1	B830001-1	1	122A	Mechanical Room	Auditorium Fan Room	no	W2	Concrete	Green	Flaking	6	0.08	Negative
8300	1	B830001-1	1	122A	Mechanical Room	Auditorium Fan Room	no	Radiator	Metal	Tan	Chipping	1	0.5	Negative
8300	1	B830001-1	1	122A	Mechanical Room	Auditorium Fan Room	no	W3	CMU	Green	Chipping	10	0	Negative
8300	1	B830001-1	1	122A	Mechanical Room	Auditorium Fan Room	no	W4	CMU	Green	Chipping	10	0	Negative
8300	1	B830001-1	1	122A	Mechanical Room	Auditorium Fan Room	no	Ceiling	Concrete	White	Flaking	20	0.08	Negative
8300	1	B830001-1	1	122A	Mechanical Room	Auditorium Fan Room	no	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	122A	Mechanical Room	Auditorium Fan Room	yes	Ductwork	Metal	Tan	Flaking	40	3.7	Positive
8300	1	B830001-1	1	122A	Mechanical Room	Auditorium Fan Room	no	Heating Coil	Metal	Silver	Flaking	4	0	Negative
8300	1	B830001-1	1	122A-1	Mechanical Room	Air Intake Room	no	W1	CMU	Green	Cracking	5	0	Negative
8300	1	B830001-1	1	122A-1	Mechanical Room	Air Intake Room	no	Door Frame	Metal	Green	Flaking	2	0.1	Negative
8300	1	B830001-1	1	122A-1	Mechanical Room	Air Intake Room	yes	Door	Wood	Green	Flaking	2	3.7	Positive
8300	1	B830001-1	1	122A-1	Mechanical Room	Air Intake Room	no	W2	CMU	Green	Cracking	5	0	Negative
8300	1	B830001-1	1	122A-1	Mechanical Room	Air Intake Room	no	W3	CMU	Green	Cracking	5	0	Negative
8300	1	B830001-1	1	122A-1	Mechanical Room	Air Intake Room	no	W4	CMU	Green	Cracking	5	0	Negative
8300	1	B830001-1	1	122A-1	Mechanical Room	Air Intake Room	no	Ceiling	Concrete	White	None	0	0	Negative
8300	1	B830001-1	1	122A-1	Mechanical Room	Air Intake Room	no	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	122A-2	Mechanical Room	Lofted Entrance to Attic (Entrance to Fan Room Side)	no	W1	CMU	Brown	Chipping	4	0	Negative
8300	1	B830001-1	1	122A-2	Mechanical Room	Lofted Entrance to Attic (Entrance to Fan Room Side)	no	W2	CMU	Brown	Chipping	2	0	Negative
8300	1	B830001-1	1	122A-2	Mechanical Room	Lofted Entrance to Attic (Entrance to Fan Room Side)	no	Door	Metal	Brown	Flaking	1	5.5	Positive
8300	1	B830001-1	1	122A-2	Mechanical Room	Lofted Entrance to Attic (Entrance to Fan Room Side)	no	W3	CMU	Brown	Chipping	3	0.06	Negative
8300	1	B830001-1	1	122A-2	Mechanical Room	Lofted Entrance to Attic (Entrance to Fan Room Side)	no	W4	CMU	Brown	Chipping	5	0	Negative
8300	1	B830001-1	1	122A-2	Mechanical Room	Lofted Entrance to Attic (Entrance to Fan Room Side)	no	Ceiling	Concrete	White	Flaking	10	0	Negative

					Inspection Dates: 01/19/22									
					Inspector Name and Certificate Number: Ryan Hutsell PA RA:059512			Lead Safe Certification Assessment Report						
					Inspection Company: Synertech			Mayfair School						
ULCS #	Element	BldgElmt ID	Floor	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
8300	1	B830001-1	1	122A-2	Mechanical Room	Lofted Entrance to Attic (Entrance to Fan Room Side)	no	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	122A-3	Mechanical Room	Lofted Entrance to Attic (Opposite of Entrance to Fan Room Side)	no	W1	CMU	Brown	Chipping	2	0.04	Negative
8300	1	B830001-1	1	122A-3	Mechanical Room	Lofted Entrance to Attic (Opposite of Entrance to Fan Room Side)	no	W2	CMU	Brown	Chipping	2	0	Negative
8300	1	B830001-1	1	122A-3	Mechanical Room	Lofted Entrance to Attic (Opposite of Entrance to Fan Room Side)	no	W3	CMU	Brown	Chipping	4	0	Negative
8300	1	B830001-1	1	122A-3	Mechanical Room	Lofted Entrance to Attic (Opposite of Entrance to Fan Room Side)	no	W4	CMU	Brown	Chipping	2	0	Negative
8300	1	B830001-1	1	122A-3	Mechanical Room	Lofted Entrance to Attic (Opposite of Entrance to Fan Room Side)	no	Door	Metal	Green	Flaking	2	5.2	Positive
8300	1	B830001-1	1	122A-3	Mechanical Room	Lofted Entrance to Attic (Opposite of Entrance to Fan Room Side)	no	Ceiling	Concrete	White	Flaking	10	0	Negative
8300	1	B830001-1	1	122A-3	Mechanical Room	Lofted Entrance to Attic (Opposite of Entrance to Fan Room Side)	no	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	134	General Administrative Space	Main Office	yes	W1	Plaster	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	134	General Administrative Space	Main Office	yes	W2	Plaster	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	134	General Administrative Space	Main Office	yes	W3	Plaster	Tan	Cracking	2	0	Negative
8300	1	B830001-1	1	134	General Administrative Space	Main Office	yes	Radiator	Metal	Tan	Flaking	8	0.11	Negative
8300	1	B830001-1	1	134	General Administrative Space	Main Office	yes	W4	Plaster	Tan	Chipping	1	0	Negative
8300	1	B830001-1	1	134	General Administrative Space	Main Office	yes	Ceiling	Concrete	White	None	0	N/A	N/A
8300	1	B830001-1	1	134	General Administrative Space	Main Office	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	134	General Administrative Space	Main Office	yes	Chair Rail	Wood	White	Chipping	10	0.05	Negative
8300	1	B830001-1	1	134	General Administrative Space	Main Office	yes	Baseboard	Transite	Black	Chipping	10	0	Negative

					Inspection Dates: 01/19/22									
					Inspector Name and Certificate Number: Ryan Hutsell PA RA:059512			Lead Safe Certification Assessment Report						
					Inspection Company: Synertech			Mayfair School						
ULCS #	Element	BldgElmt ID	Floor	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
8300	1	B830001-1	1	134A	General Administrative Space	Main Office-Small Closet	yes	W1	Plaster	Green	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	134A	General Administrative Space	Main Office-Small Closet	yes	W2	Plaster	Green	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	134A	General Administrative Space	Main Office-Small Closet	yes	W3	Plaster	Green	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	134A	General Administrative Space	Main Office-Small Closet	yes	Coat Rack	Wood	Green	Friction	5	0.2	Negative
8300	1	B830001-1	1	134A	General Administrative Space	Main Office-Small Closet	yes	W4	Plaster	Green	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	134A	General Administrative Space	Main Office-Small Closet	yes	Ceiling	Plaster	White	None	0	N/A	N/A
8300	1	B830001-1	1	134A	General Administrative Space	Main Office-Small Closet	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	134B	General Administrative Space	Main Office-Large Closet	yes	W1	Plaster	Green	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	134B	General Administrative Space	Main Office-Large Closet	yes	W2	Plaster	Green	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	134B	General Administrative Space	Main Office-Large Closet	yes	W3	Plaster	Green	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	134B	General Administrative Space	Main Office-Large Closet	yes	W4	Plaster	Green	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	134B	General Administrative Space	Main Office-Large Closet	yes	Ceiling	Plaster	White	None	0	N/A	N/A
8300	1	B830001-1	1	134B	General Administrative Space	Main Office-Large Closet	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	134 PC	Pipe Chase	Pipe Chase-Main Office	no	W1	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	134 PC	Pipe Chase	Pipe Chase-Main Office	no	W2	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	134 PC	Pipe Chase	Pipe Chase-Main Office	no	W3	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	134 PC	Pipe Chase	Pipe Chase-Main Office	no	W4	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	134 PC	Pipe Chase	Pipe Chase-Main Office	yes	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	134 PC	Pipe Chase	Pipe Chase-Main Office	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A

					Inspection Dates: 01/19/22									
					Inspector Name and Certificate Number: Ryan Hutsell PA RA:059512			Lead Safe Certification Assessment Report						
					Inspection Company: Synertech			Mayfair School						
ULCS #	Element	BldgElmt ID	Floor	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
8300	1	B830001-1	1	132	Administrative Office	Office next to Principal's Office/Conference Room	yes	W1	Plaster	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	132	Administrative Office	Office next to Principal's Office/Conference Room	yes	W2	Plaster	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	132	Administrative Office	Office next to Principal's Office/Conference Room	yes	W3	Plaster	Tan	Efflorescence	2	0	Negative
8300	1	B830001-1	1	132	Administrative Office	Office next to Principal's Office/Conference Room	yes	Radiator	Metal	Tan	Chipping	1	0.1	Negative
8300	1	B830001-1	1	132	Administrative Office	Office next to Principal's Office/Conference Room	yes	W4	Plaster	Tan	Flaking	2	0	Negative
8300	1	B830001-1	1	132	Administrative Office	Office next to Principal's Office/Conference Room	yes	Conduit	Metal	Tan	Chipping	1	0.1	Negative
8300	1	B830001-1	1	132	Administrative Office	Office next to Principal's Office/Conference Room	yes	Ceiling	Concrete	White	None	0	N/A	N/A
8300	1	B830001-1	1	132	Administrative Office	Office next to Principal's Office/Conference Room	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	133	Principal/Directors Office	Principal's Office	yes	W1	Plaster	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	133	Principal/Directors Office	Principal's Office	yes	W2	Plaster	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	133	Principal/Directors Office	Principal's Office	yes	W3	Plaster	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	133	Principal/Directors Office	Principal's Office	yes	W4	Plaster	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	133	Principal/Directors Office	Principal's Office	yes	Ceiling	Plaster	White	None	0	N/A	N/A
8300	1	B830001-1	1	133	Principal/Directors Office	Principal's Office	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	133A	Storage	Principal's Office Closet	yes	W1	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	133A	Storage	Principal's Office Closet	yes	W2	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	133A	Storage	Principal's Office Closet	yes	W3	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	133A	Storage	Principal's Office Closet	yes	W4	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	133A	Storage	Principal's Office Closet	yes	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	133A	Storage	Principal's Office Closet	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	133B	Storage	Principal's Office Restroom	yes	W1	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	133B	Storage	Principal's Office Restroom	yes	W2	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	133B	Storage	Principal's Office Restroom	yes	W3	CMU	Tan	Partially Inaccessible	0	0	Negative



					Inspection Dates: 01/19/22									
					Inspector Name and Certificate Number: Ryan Hutsell PA RA:059512			Lead Safe Certification Assessment Report						
					Inspection Company: Synertech			Mayfair School						
ULCS #	Element	BldgElmt ID	Floor	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
8300	1	B830001-1	1	133B	Storage	Principal's Office Restroom	yes	W4	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	133B	Storage	Principal's Office Restroom	yes	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	133B	Storage	Principal's Office Restroom	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	135	Administrative Office	Counselor's Office	yes	W1	Plaster	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	135	Administrative Office	Counselor's Office	yes	W2	Plaster	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	135	Administrative Office	Counselor's Office	yes	W3	Plaster	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	135	Administrative Office	Counselor's Office	yes	Radiator	Metal	Tan	Chipping	2	0.1	Negative
8300	1	B830001-1	1	135	Administrative Office	Counselor's Office	yes	W4	Plaster	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	135	Administrative Office	Counselor's Office	yes	Ceiling	Plaster	White	None	0	N/A	N/A
8300	1	B830001-1	1	135	Administrative Office	Counselor's Office	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	135	Administrative Office	Counselor's Office	yes	Cove Base	Transite	Black	Chipping	10	0	Negative
8300	1	B830001-1	1	135A	Administrative Office	School Police Office	yes	W1	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	135A	Administrative Office	School Police Office	yes	W2	Plaster	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	135A	Administrative Office	School Police Office	yes	W3	Plaster	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	135A	Administrative Office	School Police Office	yes	W4	Plaster	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	135A	Administrative Office	School Police Office	yes	Ceiling	Plaster	White	None	0	N/A	N/A
8300	1	B830001-1	1	135A	Administrative Office	School Police Office	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	136	Administrative Office	Office 126	yes	W1	CMU	White	None	0	N/A	N/A
8300	1	B830001-1	1	136	Administrative Office	Office 126	yes	W2	Plaster	White	Flaking	4	0	Negative
8300	1	B830001-1	1	136	Administrative Office	Office 126	yes	W3	Plaster	White	Flaking	1	0	Negative
8300	1	B830001-1	1	136	Administrative Office	Office 126	yes	W4	Plaster	White	None	0	N/A	N/A
8300	1	B830001-1	1	136	Administrative Office	Office 126	yes	Ceiling	Plaster	White	Cracking	2	0	Negative
8300	1	B830001-1	1	136	Administrative Office	Office 126	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A

					Inspection Dates: 01/19/22									
					Inspector Name and Certificate Number: Ryan Hutsell PA RA:059512			Lead Safe Certification Assessment Report						
					Inspection Company: Synertech			Mayfair School						
ULCS #	Element	BldgElmt ID	Floor	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
8300	1	B830001-1	1	137	Principal/Directors Office	Office of Assistant Principal	yes	W1	Plaster	Tan	Chipping	5	0	Negative
8300	1	B830001-1	1	137	Principal/Directors Office	Office of Assistant Principal	yes	W2	Plaster	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	137	Principal/Directors Office	Office of Assistant Principal	yes	W3	Plaster	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	137	Principal/Directors Office	Office of Assistant Principal	yes	Radiator	Metal	White	Flaking	2	0.07	Negative
8300	1	B830001-1	1	137	Principal/Directors Office	Office of Assistant Principal	yes	W4	Plaster	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	137	Principal/Directors Office	Office of Assistant Principal	yes	Ceiling	Plaster	White	None	0	N/A	N/A
8300	1	B830001-1	1	137	Principal/Directors Office	Office of Assistant Principal	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	137A	Storage	Office of Assistant Principal Closet	yes	W1	Plaster	Blue	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	137A	Storage	Office of Assistant Principal Closet	yes	W2	Plaster	Blue	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	137A	Storage	Office of Assistant Principal Closet	yes	W3	Plaster	Blue	Chipping	8	0	Negative
8300	1	B830001-1	1	137A	Storage	Office of Assistant Principal Closet	yes	W4	Plaster	Blue	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	137A	Storage	Office of Assistant Principal Closet	yes	Ceiling	Plaster	White	None	0	N/A	N/A
8300	1	B830001-1	1	137A	Storage	Office of Assistant Principal Closet	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	137B	Principal/Directors Office	Office of Assistant Principal Restroom	yes	W1	Plaster	Tan	None	0	N/A	N/A
8300	1	B830001-1	1	137B	Principal/Directors Office	Office of Assistant Principal Restroom	yes	W2	Plaster	Tan	None	0	N/A	N/A
8300	1	B830001-1	1	137B	Principal/Directors Office	Office of Assistant Principal Restroom	yes	W3	Plaster	Tan	None	0	N/A	N/A
8300	1	B830001-1	1	137B	Principal/Directors Office	Office of Assistant Principal Restroom	yes	W4	Plaster	Tan	None	0	N/A	N/A
8300	1	B830001-1	1	137B	Principal/Directors Office	Office of Assistant Principal Restroom	yes	Ceiling	Plaster	White	None	0	N/A	N/A
8300	1	B830001-1	1	137B	Principal/Directors Office	Office of Assistant Principal Restroom	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	137 PC	Pipe Chase	Office of Assistant Principal Pipe Chase	no	W1	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	137 PC	Pipe Chase	Office of Assistant Principal Pipe Chase	no	W2	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	137 PC	Pipe Chase	Office of Assistant Principal Pipe Chase	no	W3	N/A	N/A	N/A	N/A	N/A	N/A

					Inspection Dates: 01/19/22									
					Inspector Name and Certificate Number: Ryan Hutsell PA RA:059512			Lead Safe Certification Assessment Report						
					Inspection Company: Synertech			Mayfair School						
ULCS #	Element	BldgElmt ID	Floor	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
8300	1	B830001-1	1	137 PC	Pipe Chase	Office of Assistant Principal Pipe Chase	no	W4	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	137 PC	Pipe Chase	Office of Assistant Principal Pipe Chase	no	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	137 PC	Pipe Chase	Office of Assistant Principal Pipe Chase	no	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	138	Administrative Office	Kitchen Storage Room across from Gym	yes	W1	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	138	Administrative Office	Kitchen Storage Room across from Gym	yes	W2	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	138	Administrative Office	Kitchen Storage Room across from Gym	yes	W3	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	138	Administrative Office	Kitchen Storage Room across from Gym	yes	W4	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	138	Administrative Office	Kitchen Storage Room across from Gym	yes	Ceiling	Plaster	White	None	0	N/A	N/A
8300	1	B830001-1	1	138	Administrative Office	Kitchen Storage Room across from Gym	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	138 PC	Pipe Chase	Kitchen Storage Room across from Gym-Pipe Chase	no	W1	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	138 PC	Pipe Chase	Kitchen Storage Room across from Gym-Pipe Chase	no	W2	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	138 PC	Pipe Chase	Kitchen Storage Room across from Gym-Pipe Chase	no	W3	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	138 PC	Pipe Chase	Kitchen Storage Room across from Gym-Pipe Chase	no	W4	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	138 PC	Pipe Chase	Kitchen Storage Room across from Gym-Pipe Chase	no	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	138 PC	Pipe Chase	Kitchen Storage Room across from Gym-Pipe Chase	no	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	141	Gymnasium - Intermediate Middle	Gym	yes	W1	CMU	Tan	None	0	0	Negative
8300	1	B830001-1	1	141	Gymnasium - Intermediate Middle	Gym	yes	W1	CMU	White	None	0	0	Negative
8300	1	B830001-1	1	141	Gymnasium - Intermediate Middle	Gym	yes	W2	CMU	Tan	None	0	0	Negative
8300	1	B830001-1	1	141	Gymnasium - Intermediate Middle	Gym	yes	W2	CMU	White	None	4	0	Negative
8300	1	B830001-1	1	141	Gymnasium - Intermediate Middle	Gym	yes	Radiator	Metal	Brown	Chipping	4	0.1	Negative

					Inspection Dates: 01/19/22									
					Inspector Name and Certificate Number: Ryan Hutsell PA RA:059512			Lead Safe Certification Assessment Report						
					Inspection Company: Synertech			Mayfair School						
ULCS #	Element	BldgElmt ID	Floor	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
8300	1	B830001-1	1	141	Gymnasium - Intermediate Middle	Gym	yes	Vent	Metal	Brown	Chipping	1	0.1	Negative
8300	1	B830001-1	1	141	Gymnasium - Intermediate Middle	Gym	yes	Door Frame	Metal	Brown	Chipping	2	0	Negative
8300	1	B830001-1	1	141	Gymnasium - Intermediate Middle	Gym	yes	Door	Metal	Brown	Chipping	5	0	Negative
8300	1	B830001-1	1	141	Gymnasium - Intermediate Middle	Gym	yes	W3	CMU	Tan	None	0	0	Negative
8300	1	B830001-1	1	141	Gymnasium - Intermediate Middle	Gym	yes	W3	CMU	White	None	0	0	Negative
8300	1	B830001-1	1	141	Gymnasium - Intermediate Middle	Gym	yes	Radiator	Metal	Brown	Chipping	2	0.12	Negative
8300	1	B830001-1	1	141	Gymnasium - Intermediate Middle	Gym	yes	W4	CMU	Tan	None	0	0	Negative
8300	1	B830001-1	1	141	Gymnasium - Intermediate Middle	Gym	yes	W4	CMU	White	None	0	0	Negative
8300	1	B830001-1	1	141	Gymnasium - Intermediate Middle	Gym	yes	Radiator	Metal	Brown	Chipping	3	0.15	Negative
8300	1	B830001-1	1	141	Gymnasium - Intermediate Middle	Gym	yes	Vent	Metal	Brown	Chipping	3	0.1	Negative
8300	1	B830001-1	1	141	Gymnasium - Intermediate Middle	Gym	yes	Door Frame	Metal	Brown	Chipping	3	0.14	Negative
8300	1	B830001-1	1	141	Gymnasium - Intermediate Middle	Gym	yes	Door	Metal	Brown	Chipping	4	0	Negative
8300	1	B830001-1	1	141	Gymnasium - Intermediate Middle	Gym	yes	Push Bar	Metal	Grey	Friction	2	0	Negative
8300	1	B830001-1	1	141	Gymnasium - Intermediate Middle	Gym	yes	Ceiling	Concrete	White	None	0	N/A	N/A
8300	1	B830001-1	1	141	Gymnasium - Intermediate Middle	Gym	yes	Floor	Wood	N/A	N/A	N/A	N/A	N/A

					Inspection Dates: 01/19/22									
					Inspector Name and Certificate Number: Ryan Hutsell PA RA:059512			Lead Safe Certification Assessment Report						
					Inspection Company: Synertech			Mayfair School						
ULCS #	Element	BldgElmt ID	Floor	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
8300	1	B830001-1	1	141	Gymnasium - Intermediate Middle	Gym	yes	Baseboard	Metal	Black	Chipping	100	0.5	Negative
8300	1	B830001-1	1	145	Gymnasium Storage	Gym Storage at Right of Gym	yes	W1	CMU	Tan	Flaking	80	0	Negative
8300	1	B830001-1	1	145	Gymnasium Storage	Gym Storage at Right of Gym	yes	W1	CMU	White	Flaking	40	0	Negative
8300	1	B830001-1	1	145	Gymnasium Storage	Gym Storage at Right of Gym	yes	W2	CMU	Tan	Flaking	40	0	Negative
8300	1	B830001-1	1	145	Gymnasium Storage	Gym Storage at Right of Gym	yes	W2	CMU	White	Flaking	20	0	Negative
8300	1	B830001-1	1	145	Gymnasium Storage	Gym Storage at Right of Gym	yes	W3	CMU	Tan	Flaking	80	0	Negative
8300	1	B830001-1	1	145	Gymnasium Storage	Gym Storage at Right of Gym	yes	W3	CMU	White	Flaking	40	0	Negative
8300	1	B830001-1	1	145	Gymnasium Storage	Gym Storage at Right of Gym	yes	W4	CMU	Tan	Flaking	40	0	Negative
8300	1	B830001-1	1	145	Gymnasium Storage	Gym Storage at Right of Gym	yes	W4	CMU	White	Flaking	20	0	Negative
8300	1	B830001-1	1	145	Gymnasium Storage	Gym Storage at Right of Gym	yes	Ceiling	Concrete	White	Flaking	120	0	Negative
8300	1	B830001-1	1	145	Gymnasium Storage	Gym Storage at Right of Gym	yes	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	143	Student Restrooms - Male (4-12)	Boy's Restroom next to Gym	yes	W1	CMU	Green	None	0	N/A	N/A
8300	1	B830001-1	1	143	Student Restrooms - Male (4-12)	Boy's Restroom next to Gym	yes	Door Frame	Metal	Brown	Chipping	2	0.1	Negative
8300	1	B830001-1	1	143	Student Restrooms - Male (4-12)	Boy's Restroom next to Gym	yes	Door	Metal	Brown	Chipping	4	0	Negative
8300	1	B830001-1	1	143	Student Restrooms - Male (4-12)	Boy's Restroom next to Gym	yes	Radiator	Metal	Brown	Chipping	4	0.1	Negative
8300	1	B830001-1	1	143	Student Restrooms - Male (4-12)	Boy's Restroom next to Gym	yes	W2	CMU	Green	None	0	N/A	N/A
8300	1	B830001-1	1	143	Student Restrooms - Male (4-12)	Boy's Restroom next to Gym	yes	W3	CMU	Green	Cracking	2	0	Negative
8300	1	B830001-1	1	143	Student Restrooms - Male (4-12)	Boy's Restroom next to Gym	yes	W4	CMU	Green	Flaking	2	0	Negative
8300	1	B830001-1	1	143	Student Restrooms - Male (4-12)	Boy's Restroom next to Gym	yes	Ceiling	Concrete	White	Flaking	20	0.1	Negative
8300	1	B830001-1	1	143	Student Restrooms - Male (4-12)	Boy's Restroom next to Gym	yes	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	143A	Pipe Chase	Pipe Chase at Boy's Restroom in Gym area	no	W1	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	143A	Pipe Chase	Pipe Chase at Boy's Restroom in Gym area	no	W2	N/A	N/A	N/A	N/A	N/A	N/A

					Inspection Dates: 01/19/22									
					Inspector Name and Certificate Number: Ryan Hutsell PA RA:059512			Lead Safe Certification Assessment Report						
					Inspection Company: Synertech			Mayfair School						
ULCS #	Element	BldgElmt ID	Floor	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
8300	1	B830001-1	1	143A	Pipe Chase	Pipe Chase at Boy's Restroom in Gym area	no	W3	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	143A	Pipe Chase	Pipe Chase at Boy's Restroom in Gym area	no	W4	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	143A	Pipe Chase	Pipe Chase at Boy's Restroom in Gym area	no	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	143A	Pipe Chase	Pipe Chase at Boy's Restroom in Gym area	no	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	143B	Circulation	Hallway to Gym Restrooms	yes	W1	CMU	Tan	None	0	N/A	N/A
8300	1	B830001-1	1	143B	Circulation	Hallway to Gym Restrooms	yes	W1	CMU	White	None	0	N/A	N/A
8300	1	B830001-1	1	143B	Circulation	Hallway to Gym Restrooms	yes	Door Frame	Metal	Brown	Chipping	1	0	Negative
8300	1	B830001-1	1	143B	Circulation	Hallway to Gym Restrooms	yes	Door	Metal	Brown	Chipping	2	0.1	Negative
8300	1	B830001-1	1	143B	Circulation	Hallway to Gym Restrooms	yes	W2	CMU	Tan	None	0	N/A	N/A
8300	1	B830001-1	1	143B	Circulation	Hallway to Gym Restrooms	yes	W2	CMU	White	None	0	N/A	N/A
8300	1	B830001-1	1	143B	Circulation	Hallway to Gym Restrooms	yes	Door Frame	Wood	Brown	Chipping	2	0	Negative
8300	1	B830001-1	1	143B	Circulation	Hallway to Gym Restrooms	yes	Door	Wood	Brown	Chipping	2	0.1	Negative
8300	1	B830001-1	1	143B	Circulation	Hallway to Gym Restrooms	yes	Door Frame	Metal	White	Chipping	1	0	Negative
8300	1	B830001-1	1	143B	Circulation	Hallway to Gym Restrooms	yes	Door	Metal	Brown	Chipping	4	0	Negative
8300	1	B830001-1	1	143B	Circulation	Hallway to Gym Restrooms	yes	W3	CMU	Tan	None	0	N/A	N/A
8300	1	B830001-1	1	143B	Circulation	Hallway to Gym Restrooms	yes	W3	CMU	White	None	0	N/A	N/A
8300	1	B830001-1	1	143B	Circulation	Hallway to Gym Restrooms	yes	W4	CMU	Tan	None	0	N/A	N/A
8300	1	B830001-1	1	143B	Circulation	Hallway to Gym Restrooms	yes	W4	CMU	White	None	0	N/A	N/A
8300	1	B830001-1	1	143B	Circulation	Hallway to Gym Restrooms	yes	Door Frame	Metal	White	Chipping	2	0	Negative
8300	1	B830001-1	1	143B	Circulation	Hallway to Gym Restrooms	yes	Door	Metal	Brown	Chipping	4	0	Negative
8300	1	B830001-1	1	143B	Circulation	Hallway to Gym Restrooms	yes	Ceiling	Concrete	White	Flaking	32	0.08	Negative
8300	1	B830001-1	1	143B	Circulation	Hallway to Gym Restrooms	yes	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	144	Student Restrooms - Female (4-12)	Girl's Restroom next to Gymnasium	yes	W1	CMU	Green	None	0	N/A	N/A
8300	1	B830001-1	1	144	Student Restrooms - Female (4-12)	Girl's Restroom next to Gymnasium	yes	Door Frame	Metal	Brown	Chipping	2	0.1	Negative
8300	1	B830001-1	1	144	Student Restrooms - Female (4-12)	Girl's Restroom next to Gymnasium	yes	Door	Metal	Brown	Chipping	4	0	Negative
8300	1	B830001-1	1	144	Student Restrooms - Female (4-12)	Girl's Restroom next to Gymnasium	yes	W2	CMU	Green	None	0	N/A	N/A
8300	1	B830001-1	1	144	Student Restrooms - Female (4-12)	Girl's Restroom next to Gymnasium	yes	W3	CMU	Green	Cracking	2	0	Negative
8300	1	B830001-1	1	144	Student Restrooms - Female (4-12)	Girl's Restroom next to Gymnasium	yes	Radiator	Metal	Brown	Chipping	4	0.1	Negative
8300	1	B830001-1	1	144	Student Restrooms - Female (4-12)	Girl's Restroom next to Gymnasium	yes	W4	CMU	Green	Flaking	2	0	Negative
8300	1	B830001-1	1	144	Student Restrooms - Female (4-12)	Girl's Restroom next to Gymnasium	yes	Ceiling	Concrete	White	Flaking	20	0.1	Negative
8300	1	B830001-1	1	144	Student Restrooms - Female (4-12)	Girl's Restroom next to Gymnasium	yes	Floor	Concrete	N/A	N/A	N/A	N/A	N/A

					Inspection Dates: 01/19/22									
					Inspector Name and Certificate Number: Ryan Hutsell PA RA:059512			Lead Safe Certification Assessment Report						
					Inspection Company: Synertech			Mayfair School						
ULCS #	Element	BldgElmt ID	Floor	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
8300	1	B830001-1	1	143B	Storage	Storage outside girl's restroom near gym	yes	W1	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	143B	Storage	Storage outside girl's restroom near gym	yes	W2	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	143B	Storage	Storage outside girl's restroom near gym	yes	W3	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	143B	Storage	Storage outside girl's restroom near gym	yes	W4	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	143B	Storage	Storage outside girl's restroom near gym	yes	Ceiling	Plaster	White	None	0	N/A	N/A
8300	1	B830001-1	1	143B	Storage	Storage outside girl's restroom near gym	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	142A	Administrative Office	Gym Office	yes	W1	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	142A	Administrative Office	Gym Office	yes	W2	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	142A	Administrative Office	Gym Office	yes	W3	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	142A	Administrative Office	Gym Office	yes	W4	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	142A	Administrative Office	Gym Office	yes	Ceiling	Plaster	White	None	0	N/A	N/A
8300	1	B830001-1	1	142A	Administrative Office	Gym Office	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	142B	Restrooms, Staff - Male/Female	Gym Office-Restroom	yes	W1	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	142B	Restrooms, Staff - Male/Female	Gym Office-Restroom	yes	W2	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	142B	Restrooms, Staff - Male/Female	Gym Office-Restroom	yes	W3	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	142B	Restrooms, Staff - Male/Female	Gym Office-Restroom	yes	W4	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	142B	Restrooms, Staff - Male/Female	Gym Office-Restroom	yes	Ceiling	Plaster	White	None	0	N/A	N/A
8300	1	B830001-1	1	142B	Restrooms, Staff - Male/Female	Gym Office-Restroom	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	142	Gymnasium Storage	Storage at Left rear of Gym	yes	W1	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	142	Gymnasium Storage	Storage at Left rear of Gym	yes	W2	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	142	Gymnasium Storage	Storage at Left rear of Gym	yes	W3	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	1	142	Gymnasium Storage	Storage at Left rear of Gym	yes	W4	CMU	Tan	Partially Inaccessible	0	0	Negative

					Inspection Dates: 01/19/22									
					Inspector Name and Certificate Number: Ryan Hutsell PA RA:059512			Lead Safe Certification Assessment Report						
					Inspection Company: Synertech			Mayfair School						
ULCS #	Element	BldgElmt ID	Floor	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
8300	1	B830001-1	1	142	Gymnasium Storage	Storage at Left rear of Gym	yes	Ceiling	Plaster	White	None	0	N/A	N/A
8300	1	B830001-1	1	142	Gymnasium Storage	Storage at Left rear of Gym	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	139	Cafeteria (Dining Area)	Cafeteria	yes	W1	Sheetrock	White	None	0	N/A	N/A
8300	1	B830001-1	1	139	Cafeteria (Dining Area)	Cafeteria	yes	W2	Sheetrock	White	None	0	N/A	N/A
8300	1	B830001-1	1	139	Cafeteria (Dining Area)	Cafeteria	yes	W3	Sheetrock	White	None	0	N/A	N/A
8300	1	B830001-1	1	139	Cafeteria (Dining Area)	Cafeteria	yes	W4	CMU	Orange	Chipping	2	0	Negative
8300	1	B830001-1	1	139	Cafeteria (Dining Area)	Cafeteria	yes	Ceiling	Sheetrock	White	None	0	N/A	N/A
8300	1	B830001-1	1	139	Cafeteria (Dining Area)	Cafeteria	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	140	Kitchen	Kitchen	no	W1	CMU	White	None	0	N/A	N/A
8300	1	B830001-1	1	140	Kitchen	Kitchen	no	W2	Sheetrock	White	None	0	N/A	N/A
8300	1	B830001-1	1	140	Kitchen	Kitchen	no	W3	Sheetrock	White	None	0	N/A	N/A
8300	1	B830001-1	1	140	Kitchen	Kitchen	no	W4	CMU	White	None	0	N/A	N/A
8300	1	B830001-1	1	140	Kitchen	Kitchen	no	W4	Sheetrock	White	Chipping	1	0	Negative
8300	1	B830001-1	1	140	Kitchen	Kitchen	no	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	140	Kitchen	Kitchen	no	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	140A	Restrooms, Staff - Male/Female	Kitchen Restroom	no	W1	CMU	Orange	None	0	N/A	N/A
8300	1	B830001-1	1	140A	Restrooms, Staff - Male/Female	Kitchen Restroom	no	W2	CMU	Orange	None	0	N/A	N/A
8300	1	B830001-1	1	140A	Restrooms, Staff - Male/Female	Kitchen Restroom	no	W3	Sheetrock	Orange	None	0	N/A	N/A
8300	1	B830001-1	1	140A	Restrooms, Staff - Male/Female	Kitchen Restroom	no	W4	Sheetrock	Orange	None	0	N/A	N/A
8300	1	B830001-1	1	140A	Restrooms, Staff - Male/Female	Kitchen Restroom	no	Ceiling	Sheetrock	Orange	None	0	N/A	N/A
8300	1	B830001-1	1	140A	Restrooms, Staff - Male/Female	Kitchen Restroom	no	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	140B	Storage	Kitchen Storage	no	W1	CMU	Orange	None	0	N/A	N/A
8300	1	B830001-1	1	140B	Storage	Kitchen Storage	no	W2	CMU	Orange	None	0	N/A	N/A
8300	1	B830001-1	1	140B	Storage	Kitchen Storage	no	W3	CMU	Orange	None	0	N/A	N/A
8300	1	B830001-1	1	140B	Storage	Kitchen Storage	no	W4	CMU	Orange	None	0	N/A	N/A
8300	1	B830001-1	1	140B	Storage	Kitchen Storage	no	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	140B	Storage	Kitchen Storage	no	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	H19A	Exit Foyer	Kitchen Exit Foyer	no	W1	CMU	White	None	0	N/A	N/A
8300	1	B830001-1	1	H19A	Exit Foyer	Kitchen Exit Foyer	no	W2	CMU	White	None	0	N/A	N/A
8300	1	B830001-1	1	H19A	Exit Foyer	Kitchen Exit Foyer	no	W3	CMU	White	None	0	N/A	N/A



					Inspection Dates: 01/19/22									
					Inspector Name and Certificate Number: Ryan Hutsell PA RA:059512			Lead Safe Certification Assessment Report						
					Inspection Company: Synertech			Mayfair School						
ULCS #	Element	BldgElmt ID	Floor	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
8300	1	B830001-1	1	H19A	Exit Foyer	Kitchen Exit Foyer	no	Pipe	Metal	White	Chipping	1	0	Negative
8300	1	B830001-1	1	H19A	Exit Foyer	Kitchen Exit Foyer	no	Door	Metal	Grey	Chipping	2	0	Negative
8300	1	B830001-1	1	H19A	Exit Foyer	Kitchen Exit Foyer	no	W4	CMU	White	None	0	N/A	N/A
8300	1	B830001-1	1	H19A	Exit Foyer	Kitchen Exit Foyer	no	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	H19A	Exit Foyer	Kitchen Exit Foyer	no	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	H12	Circulation (Hallway)	Hallway next to Main Office	yes	W1	Plaster	Tan	Flaking	60	0	Negative
8300	1	B830001-1	1	H12	Circulation (Hallway)	Hallway next to Main Office	yes	Door Frame	Metal	Brown	Chipping	2	0	Negative
8300	1	B830001-1	1	H12	Circulation (Hallway)	Hallway next to Main Office	yes	Door	Metal	Brown	Chipping	2	0	Negative
8300	1	B830001-1	1	H12	Circulation (Hallway)	Hallway next to Main Office	yes	W2	Plaster	Tan	None	0	N/A	N/A
8300	1	B830001-1	1	H12	Circulation (Hallway)	Hallway next to Main Office	yes	Gate	Metal	Tan	Chipping	1	0.1	Negative
8300	1	B830001-1	1	H12	Circulation (Hallway)	Hallway next to Main Office	yes	W3	Plaster	Tan	Flaking	44	0	Negative
8300	1	B830001-1	1	H12	Circulation (Hallway)	Hallway next to Main Office	yes	W3	Plaster	Tan	Flaking	125	0.08	Negative
8300	1	B830001-1	1	H12	Circulation (Hallway)	Hallway next to Main Office	yes	Crown Moulding	Wood	White	Chipping	2	3.2	Positive
8300	1	B830001-1	1	H12	Circulation (Hallway)	Hallway next to Main Office	yes	W4	Plaster	Tan	None	0	N/A	N/A
8300	1	B830001-1	1	H12	Circulation (Hallway)	Hallway next to Main Office	yes	Ceiling	Plaster	White	Efflorescence	4	0	Negative
8300	1	B830001-1	1	H12	Circulation (Hallway)	Hallway next to Main Office	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	H13	Circulation (Hallway)	Hallway near Classrooms 101 through 107	yes	W1	CMU	Tan	None	0	0	Negative
8300	1	B830001-1	1	H13	Circulation (Hallway)	Hallway near Classrooms 101 through 107	yes	W2	CMU	Tan	None	0	0.04	Negative
8300	1	B830001-1	1	H13	Circulation (Hallway)	Hallway near Classrooms 101 through 107	yes	W3	CMU	Tan	None	0	0.06	Negative
8300	1	B830001-1	1	H13	Circulation (Hallway)	Hallway near Classrooms 101 through 107	yes	W4	CMU	Tan	None	0	0	Negative
8300	1	B830001-1	1	H13	Circulation (Hallway)	Hallway near Classrooms 101 through 107	yes	Ceiling	Plaster	White	None	0	0	Negative
8300	1	B830001-1	1	H13	Circulation (Hallway)	Hallway near Classrooms 101 through 107	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	H14	Circulation (Hallway)	Hallway next to Classrooms 116 through 118	yes	W1	CMU	Tan	None	0	0	Negative
8300	1	B830001-1	1	H14	Circulation (Hallway)	Hallway next to Classrooms 116 through 118	yes	Bulletin Bar Strip	Wood	White	Holes	1	0.35	Negative

					Inspection Dates: 01/19/22									
					Inspector Name and Certificate Number: Ryan Hutsell PA RA:059512			Lead Safe Certification Assessment Report						
					Inspection Company: Synertech			Mayfair School						
ULCS #	Element	BldgElmt ID	Floor	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
8300	1	B830001-1	1	H14	Circulation (Hallway)	Hallway next to Classrooms 116 through 118	yes	W2	CMU	Tan	None	0	0	Negative
8300	1	B830001-1	1	H14	Circulation (Hallway)	Hallway next to Classrooms 116 through 118	yes	W3	CMU	Tan	None	0	0	Negative
8300	1	B830001-1	1	H14	Circulation (Hallway)	Hallway next to Classrooms 116 through 118	yes	Door Frame	Metal	Grey	Friction	1	0.08	Negative
8300	1	B830001-1	1	H14	Circulation (Hallway)	Hallway next to Classrooms 116 through 118	yes	W4	CMU	Tan	None	0	0	Negative
8300	1	B830001-1	1	H14	Circulation (Hallway)	Hallway next to Classrooms 116 through 118	yes	Ceiling	Plaster	White	None	0	N/A	N/A
8300	1	B830001-1	1	H14	Circulation (Hallway)	Hallway next to Classrooms 116 through 118	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	H16	Circulation (Hallway)	Hallway next to Classrooms 121 to Classroom 123	yes	W1	Plaster	Tan	None	0	N/A	N/A
8300	1	B830001-1	1	H16	Circulation (Hallway)	Hallway next to Classrooms 121 to Classroom 123	yes	Door Frame	Metal	Brown	Friction	2	0.1	Negative
8300	1	B830001-1	1	H16	Circulation (Hallway)	Hallway next to Classrooms 121 to Classroom 123	yes	Door	Metal	Brown	Friction	2	0.05	Negative
8300	1	B830001-1	1	H16	Circulation (Hallway)	Hallway next to Classrooms 121 to Classroom 123	yes	W2	Plaster	Tan	Cracking	4	0	Negative
8300	1	B830001-1	1	H16	Circulation (Hallway)	Hallway next to Classrooms 121 to Classroom 123	yes	Univent	Metal	Brown	Chipping	2	0.2	Negative
8300	1	B830001-1	1	H16	Circulation (Hallway)	Hallway next to Classrooms 121 to Classroom 123	yes	W3	Plaster	Tan	None	0	N/A	N/A
8300	1	B830001-1	1	H16	Circulation (Hallway)	Hallway next to Classrooms 121 to Classroom 123	yes	W4	Plaster	Tan	Cracking	4	0	Negative
8300	1	B830001-1	1	H16	Circulation (Hallway)	Hallway next to Classrooms 121 to Classroom 123	yes	Ceiling	Concrete	White	None	0	N/A	N/A
8300	1	B830001-1	1	H16	Circulation (Hallway)	Hallway next to Classrooms 121 to Classroom 123	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	H19	Circulation (Hallway)	Hallway next to Cafeteria at exterior doors	yes	W1	CMU	White	None	0	N/A	N/A
8300	1	B830001-1	1	H19	Circulation (Hallway)	Hallway next to Cafeteria at exterior doors	yes	W2	CMU	White	None	0	N/A	N/A
8300	1	B830001-1	1	H19	Circulation (Hallway)	Hallway next to Cafeteria at exterior doors	yes	W3	CMU	White	None	0	N/A	N/A
8300	1	B830001-1	1	H19	Circulation (Hallway)	Hallway next to Cafeteria at exterior doors	yes	W4	CMU	White	None	0	N/A	N/A
8300	1	B830001-1	1	H19	Circulation (Hallway)	Hallway next to Cafeteria at exterior doors	yes	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	H19	Circulation (Hallway)	Hallway next to Cafeteria at exterior doors	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	S11	Stairs	Stairs Next to Kindergarten Wing	yes	W1	CMU	White	None	0	N/A	N/A
8300	1	B830001-1	1	S11	Stairs	Stairs Next to Kindergarten Wing	yes	W2	CMU	White	None	0	N/A	N/A

					Inspection Dates: 01/19/22									
					Inspector Name and Certificate Number: Ryan Hutsell PA RA:059512			Lead Safe Certification Assessment Report						
					Inspection Company: Synertech			Mayfair School						
ULCS #	Element	BldgElmt ID	Floor	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
8300	1	B830001-1	1	S11	Stairs	Stairs Next to Kindergarten Wing	yes	W3	CMU	White	None	0	N/A	N/A
8300	1	B830001-1	1	S11	Stairs	Stairs Next to Kindergarten Wing	yes	W4	CMU	White	None	0	N/A	N/A
8300	1	B830001-1	1	S11	Stairs	Stairs Next to Kindergarten Wing	yes	Ceiling	Concrete	White	None	0	N/A	N/A
8300	1	B830001-1	1	S11	Stairs	Stairs Next to Kindergarten Wing	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	S11	Stairs	Stairs Next to Kindergarten Wing	yes	Baluster	Metal	Black	Friction	10	0.3	Negative
8300	1	B830001-1	1	S11	Stairs	Stairs Next to Kindergarten Wing	yes	Newel Post	Metal	Black	Friction	2	0.25	Negative
8300	1	B830001-1	1	S11	Stairs	Stairs Next to Kindergarten Wing	yes	Hand Rail	Metal	Black	Friction	2	0.2	Negative
8300	1	B830001-1	1	S11	Stairs	Stairs Next to Kindergarten Wing	yes	Stair Risers	Metal	Black	Friction	10	0.31	Negative
8300	1	B830001-1	1	S11	Stairs	Stairs Next to Kindergarten Wing	yes	Stair Stringer	Metal	Black	Friction	5	0.19	Negative
8300	1	B830001-1	1	S11	Stairs	Stairs Next to Kindergarten Wing	yes	Stair Soffit	Metal	Black	Friction	4	0.2	Negative
8300	1	B830001-1	1	S11	Stairs	Stairs Next to Kindergarten Wing	yes	Radiator	Metal	Black	Friction	2	0.1	Negative
8300	1	B830001-1	1	S12	Stairs	Stairs Near Classroom 102	yes	W1	CMU	Tan	Chipping	2	0	Negative
8300	1	B830001-1	1	S12	Stairs	Stairs Near Classroom 102	yes	W2	CMU	Tan	Chipping	2	0	Negative
8300	1	B830001-1	1	S12	Stairs	Stairs Near Classroom 102	yes	W3	CMU	Tan	Chipping	2	0	Negative
8300	1	B830001-1	1	S12	Stairs	Stairs Near Classroom 102	yes	W4	CMU	Tan	Chipping	2	0	Negative
8300	1	B830001-1	1	S12	Stairs	Stairs Near Classroom 102	yes	Door Frame	Metal	Brown	Chipping	1	0.12	Negative
8300	1	B830001-1	1	S12	Stairs	Stairs Near Classroom 102	yes	Door	Metal	Brown	Chipping	2	0	Negative
8300	1	B830001-1	1	S12	Stairs	Stairs Near Classroom 102	yes	Ceiling	Concrete	White	None	0	N/A	N/A
8300	1	B830001-1	1	S12	Stairs	Stairs Near Classroom 102	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	S12	Stairs	Stairs Near Classroom 102	yes	Baluster	Metal	Brown	Friction	10	0.15	Negative
8300	1	B830001-1	1	S12	Stairs	Stairs Near Classroom 102	yes	Newel Post	Metal	Brown	Friction	2	0.3	Negative
8300	1	B830001-1	1	S12	Stairs	Stairs Near Classroom 102	yes	Hand Rail	Metal	Brown	Friction	1	0.1	Negative
8300	1	B830001-1	1	S12	Stairs	Stairs Near Classroom 102	yes	Stair Risers	Metal	Brown	Friction	20	0.16	Negative
8300	1	B830001-1	1	S12	Stairs	Stairs Near Classroom 102	yes	Stair Stringer	Metal	Brown	Chipping	5	0.2	Negative
8300	1	B830001-1	1	S12	Stairs	Stairs Near Classroom 102	yes	Stair Soffit	Metal	Brown	Chipping	2	0.25	Negative
8300	1	B830001-1	1	S13	Stairs	Stairs Next to Classroom 109	yes	W1	CMU	White	None	0	N/A	N/A
8300	1	B830001-1	1	S13	Stairs	Stairs Next to Classroom 109	yes	W2	CMU	White	None	0	N/A	N/A
8300	1	B830001-1	1	S13	Stairs	Stairs Next to Classroom 109	yes	W3	CMU	White	None	0	N/A	N/A
8300	1	B830001-1	1	S13	Stairs	Stairs Next to Classroom 109	yes	W4	CMU	White	None	0	N/A	N/A
8300	1	B830001-1	1	S13	Stairs	Stairs Next to Classroom 109	yes	Ceiling	Concrete	White	None	0	N/A	N/A
8300	1	B830001-1	1	S13	Stairs	Stairs Next to Classroom 109	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	S13	Stairs	Stairs Next to Classroom 109	yes	Stair Treads	Metal	Tan	Friction	5	0.05	Negative
8300	1	B830001-1	1	S15	Stairs	Stairs next to Classroom 123	yes	W1	Plaster	White	None	0	N/A	N/A
8300	1	B830001-1	1	S15	Stairs	Stairs next to Classroom 123	yes	Door Frame	Metal	Brown	Chipping	2	0	Negative
8300	1	B830001-1	1	S15	Stairs	Stairs next to Classroom 123	yes	Door	Metal	Brown	Chipping	2	0	Negative
8300	1	B830001-1	1	S15	Stairs	Stairs next to Classroom 123	yes	W2	Plaster	White	Flaking	4	0	Negative
8300	1	B830001-1	1	S15	Stairs	Stairs next to Classroom 123	yes	W3	Plaster	White	None	0	N/A	N/A
8300	1	B830001-1	1	S15	Stairs	Stairs next to Classroom 123	yes	Radiator	Metal	Tan	Chipping	1	0.1	Negative
8300	1	B830001-1	1	S15	Stairs	Stairs next to Classroom 123	yes	W4	Plaster	White	None	0	N/A	N/A
8300	1	B830001-1	1	S15	Stairs	Stairs next to Classroom 123	yes	Ceiling	Plaster	White	Chipping	2	0.14	Negative
8300	1	B830001-1	1	S15	Stairs	Stairs next to Classroom 123	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	S15	Stairs	Stairs next to Classroom 123	yes	Stair Stringer	Metal	Black	Chipping	4	0.23	Negative
8300	1	B830001-1	1	S15	Stairs	Stairs next to Classroom 123	yes	Stair Risers	Metal	Black	Chipping	4	0.15	Negative

					Inspection Dates: 01/19/22									
					Inspector Name and Certificate Number: Ryan Hutsell PA RA:059512			Lead Safe Certification Assessment Report						
					Inspection Company: Synertech			Mayfair School						
ULCS #	Element	BldgElmt ID	Floor	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
8300	1	B830001-1	1	S15	Stairs	Stairs next to Classroom 123	yes	Baluster	Metal	Black	Chipping	8	0.26	Negative
8300	1	B830001-1	1	S15	Stairs	Stairs next to Classroom 123	yes	Newel Post	Metal	Black	Chipping	2	0.19	Negative
8300	1	B830001-1	1	S19	Stairs	Main Entrance Stairs	yes	W1	Plaster	White	Chipping	4	0	Negative
8300	1	B830001-1	1	S19	Stairs	Main Entrance Stairs	yes	Door Frame	Metal	Brown	Chipping	1	0	Negative
8300	1	B830001-1	1	S19	Stairs	Main Entrance Stairs	yes	Door	Metal	Brown	Chipping	1	0	Negative
8300	1	B830001-1	1	S19	Stairs	Main Entrance Stairs	yes	W2	Plaster	White	Flaking	5	0	Negative
8300	1	B830001-1	1	S19	Stairs	Main Entrance Stairs	yes	W3	Plaster	White	Chipping	2	0	Negative
8300	1	B830001-1	1	S19	Stairs	Main Entrance Stairs	yes	W4	Plaster	White	None	0	N/A	N/A
8300	1	B830001-1	1	S19	Stairs	Main Entrance Stairs	yes	Ceiling	Plaster	White	None	0	N/A	N/A
8300	1	B830001-1	1	S19	Stairs	Main Entrance Stairs	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	S12	Stairs	Stairwell next to Classroom 114	yes	W1	CMU	White	None	0	N/A	N/A
8300	1	B830001-1	1	S12	Stairs	Stairwell next to Classroom 114	yes	W2	CMU	White	None	0	N/A	N/A
8300	1	B830001-1	1	S12	Stairs	Stairwell next to Classroom 114	yes	W3	CMU	White	None	0	N/A	N/A
8300	1	B830001-1	1	S12	Stairs	Stairwell next to Classroom 114	yes	W4	CMU	White	None	0	N/A	N/A
8300	1	B830001-1	1	S12	Stairs	Stairwell next to Classroom 114	yes	Ceiling	Concrete	White	None	0	N/A	N/A
8300	1	B830001-1	1	S12	Stairs	Stairwell next to Classroom 114	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	1	S12	Stairs	Stairwell next to Classroom 114	yes	Stair Stringer	Metal	Black	Chipping	2	0.2	Negative
8300	1	B830001-1	1	S12	Stairs	Stairwell next to Classroom 114	yes	Stair Risers	Metal	Black	Chipping	2	0.1	Negative
8300	1	B830001-1	1	S12	Stairs	Stairwell next to Classroom 114	yes	Baluster	Metal	Black	Chipping	2	0.16	Negative
8300	1	B830001-1	1	S12	Stairs	Stairwell next to Classroom 114	yes	Newel Post	Metal	Black	Chipping	2	0.23	Negative
8300	1	B830001-1	1	S12	Stairs	Stairwell next to Classroom 114	yes	Door Frame	Metal	Brown	Chipping	1	0.14	Negative
8300	1	B830001-1	1	S12	Stairs	Stairwell next to Classroom 114	yes	Door	Metal	Brown	Chipping	1	0.08	Negative
8300	1	B830001-1	2	206A	Primary	Office 200	yes	W1	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	206A	Primary	Office 200	yes	W2	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	206A	Primary	Office 200	yes	W3	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	206A	Primary	Office 200	yes	W4	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	206A	Primary	Office 200	yes	W4	Concrete	Tan	Chipping	1	0.1	Negative
8300	1	B830001-1	2	206A	Primary	Office 200	yes	Radiator	Metal	Tan	Chipping	1	0.15	Negative
8300	1	B830001-1	2	206A	Primary	Office 200	yes	Ceiling	Concrete	White	Chipping	2	0	Negative
8300	1	B830001-1	2	206A	Primary	Office 200	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	2	206	Primary	Classroom 201	yes	W1	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	206	Primary	Classroom 201	yes	Door Frame	Wood	White	Cracking	1	0.05	Negative
8300	1	B830001-1	2	206	Primary	Classroom 201	yes	W2	Vinyl	N/A	None	0	N/A	N/A
8300	1	B830001-1	2	206	Primary	Classroom 201	yes	White Board Frame	Wood	White	Friction	2	0	Negative
8300	1	B830001-1	2	206	Primary	Classroom 201	yes	W3	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	206	Primary	Classroom 201	yes	Univent	Metal	Tan	Chipping	10	0.2	Negative

					Inspection Dates: 01/19/22									
					Inspector Name and Certificate Number: Ryan Hutsell PA RA:059512			Lead Safe Certification Assessment Report						
					Inspection Company: Synertech			Mayfair School						
ULCS #	Element	BldgElmt ID	Floor	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
8300	1	B830001-1	2	206	Primary	Classroom 201	yes	W4	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	206	Primary	Classroom 201	yes	Ceiling	Concrete	White	None	0	N/A	N/A
8300	1	B830001-1	2	206	Primary	Classroom 201	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	2	206	Primary	Classroom 201	yes	Baseboard	Wood	White	Chipping	5	0	Negative
8300	1	B830001-1	2	206E	Storage	Classroom 201 Left Closet	yes	W1	CMU	White	None	0	N/A	N/A
8300	1	B830001-1	2	206E	Storage	Classroom 201 Left Closet	yes	W2	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	206E	Storage	Classroom 201 Left Closet	yes	W3	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	206E	Storage	Classroom 201 Left Closet	yes	Shelves	Wood	White	Friction	5	4.2	Positive
8300	1	B830001-1	2	206E	Storage	Classroom 201 Left Closet	yes	W4	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	206E	Storage	Classroom 201 Left Closet	yes	Ceiling	Plaster	White	None	0	N/A	N/A
8300	1	B830001-1	2	206E	Storage	Classroom 201 Left Closet	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	2	206F	Storage	Classroom 201 Right Closet	yes	W1	CMU	Tan	None	0	N/A	N/A
8300	1	B830001-1	2	206F	Storage	Classroom 201 Right Closet	yes	W2	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	206F	Storage	Classroom 201 Right Closet	yes	W3	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	206F	Storage	Classroom 201 Right Closet	yes	Shelves	Wood	White	Friction	2	4.2	Positive
8300	1	B830001-1	2	206F	Storage	Classroom 201 Right Closet	yes	W4	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	206F	Storage	Classroom 201 Right Closet	yes	Ceiling	Plaster	White	None	0	N/A	N/A
8300	1	B830001-1	2	206F	Storage	Classroom 201 Right Closet	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	2	206AB	Primary	Classroom 203	yes	W1	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	206AB	Primary	Classroom 203	yes	Door Frame	Metal	Tan	Chipping	4	0.12	Negative
8300	1	B830001-1	2	206AB	Primary	Classroom 203	yes	Door Frame	Wood	White	Chipping	1	0	Negative
8300	1	B830001-1	2	206AB	Primary	Classroom 203	yes	W1	Sheetrock	White	Chipping	1	0	Negative
8300	1	B830001-1	2	206AB	Primary	Classroom 203	yes	W2	Vinyl	N/A	None	0	N/A	N/A
8300	1	B830001-1	2	206AB	Primary	Classroom 203	yes	Crown Moulding	Wood	White	Chipping	2	0.1	Negative
8300	1	B830001-1	2	206AB	Primary	Classroom 203	yes	W3	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	206AB	Primary	Classroom 203	yes	Univent	Metal	Tan	Chipping	10	0.18	Negative
8300	1	B830001-1	2	206AB	Primary	Classroom 203	yes	W4	Vinyl	N/A	None	0	N/A	N/A
8300	1	B830001-1	2	206AB	Primary	Classroom 203	yes	Crown Moulding	Wood	White	Chipping	2	0.1	Negative
8300	1	B830001-1	2	206AB	Primary	Classroom 203	yes	Ceiling	Concrete	White	Flaking	8	0	Negative
8300	1	B830001-1	2	206AB	Primary	Classroom 203	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	2	206AB	Primary	Classroom 203	yes	Cove Base	Transite	Black	Chipping	10	0	Negative
8300	1	B830001-1	2	206AB	Primary	Classroom 203	yes	Baseboard	Wood	White	Chipping	4	0	Negative
8300	1	B830001-1	2	206ABC	Primary	Classroom 203 Closet (Left)	yes	W1	CMU	Tan	None	0	N/A	N/A

					Inspection Dates: 01/19/22									
					Inspector Name and Certificate Number: Ryan Hutsell PA RA:059512			Lead Safe Certification Assessment Report						
					Inspection Company: Synertech			Mayfair School						
ULCS #	Element	BldgElmt ID	Floor	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
8300	1	B830001-1	2	206ABC	Primary	Classroom 203 Closet (Left)	yes	W2	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	206ABC	Primary	Classroom 203 Closet (Left)	yes	W3	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	206ABC	Primary	Classroom 203 Closet (Left)	yes	Shelves	Wood	White	Friction	4	3.9	Positive
8300	1	B830001-1	2	206ABC	Primary	Classroom 203 Closet (Left)	yes	W4	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	206ABC	Primary	Classroom 203 Closet (Left)	yes	Ceiling	Plaster	White	None	0	N/A	N/A
8300	1	B830001-1	2	206ABC	Primary	Classroom 203 Closet (Left)	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	2	206ABC-1	Primary	Classroom 203 Closet (Right)	yes	W1	CMU	Tan	None	0	N/A	N/A
8300	1	B830001-1	2	206ABC-1	Primary	Classroom 203 Closet (Right)	yes	W2	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	206ABC-1	Primary	Classroom 203 Closet (Right)	yes	W3	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	206ABC-1	Primary	Classroom 203 Closet (Right)	yes	Shelves	Wood	White	Friction	4	3.9	Positive
8300	1	B830001-1	2	206ABC-1	Primary	Classroom 203 Closet (Right)	yes	W4	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	206ABC-1	Primary	Classroom 203 Closet (Right)	yes	Ceiling	Plaster	White	None	0	N/A	N/A
8300	1	B830001-1	2	206ABC-1	Primary	Classroom 203 Closet (Right)	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	2	207	Primary	Classroom 202	yes	W1	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	207	Primary	Classroom 202	yes	W2	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	207	Primary	Classroom 202	yes	W3	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	207	Primary	Classroom 202	yes	Univent	Metal	Tan	Chipping	2	0.24	Negative
8300	1	B830001-1	2	207	Primary	Classroom 202	yes	W4	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	207	Primary	Classroom 202	yes	Ceiling	Concrete	White	Chipping	4	0.12	Negative
8300	1	B830001-1	2	207	Primary	Classroom 202	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	2	207B	Storage	Classroom 202 Left Closet	yes	W1	CMU	Tan	None	0	N/A	N/A
8300	1	B830001-1	2	207B	Storage	Classroom 202 Left Closet	yes	W2	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	207B	Storage	Classroom 202 Left Closet	yes	W3	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	207B	Storage	Classroom 202 Left Closet	yes	Shelves	Wood	White	Friction	5	5.2	Positive
8300	1	B830001-1	2	207B	Storage	Classroom 202 Left Closet	yes	W4	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	207B	Storage	Classroom 202 Left Closet	yes	Ceiling	Plaster	White	None	0	N/A	N/A
8300	1	B830001-1	2	207B	Storage	Classroom 202 Left Closet	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	2	207A	Storage	Classroom 202 Right Closet	yes	W1	CMU	Tan	None	0	N/A	N/A
8300	1	B830001-1	2	207A	Storage	Classroom 202 Right Closet	yes	W2	CMU	Tan	Partially Inaccessible	0	0	Negative

					Inspection Dates: 01/19/22									
					Inspector Name and Certificate Number: Ryan Hutsell PA RA:059512			Lead Safe Certification Assessment Report						
					Inspection Company: Synertech			Mayfair School						
ULCS #	Element	BldgElmt ID	Floor	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
8300	1	B830001-1	2	207A	Storage	Classroom 202 Right Closet	yes	W3	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	207A	Storage	Classroom 202 Right Closet	yes	Sink Cabinet	Metal	Tan	Chipping	2	0.1	Negative
8300	1	B830001-1	2	207A	Storage	Classroom 202 Right Closet	yes	Cabinet	Metal	Tan	Chipping	2	0.1	Negative
8300	1	B830001-1	2	207A	Storage	Classroom 202 Right Closet	yes	W4	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	207A	Storage	Classroom 202 Right Closet	yes	Ceiling	Plaster	White	None	0	N/A	N/A
8300	1	B830001-1	2	207A	Storage	Classroom 202 Right Closet	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	2	205	Primary	Classroom 205	yes	W1	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	205	Primary	Classroom 205	yes	W2	CMU	Tan	Partially Inaccessible	0	0.04	Negative
8300	1	B830001-1	2	205	Primary	Classroom 205	yes	W3	CMU	Tan	Partially Inaccessible	0	0.02	Negative
8300	1	B830001-1	2	205	Primary	Classroom 205	yes	Univent	Metal	Tan	Chipping	2	0.17	Negative
8300	1	B830001-1	2	205	Primary	Classroom 205	yes	W4	Vinyl	Tan	Chipping	2	0	Negative
8300	1	B830001-1	2	205	Primary	Classroom 205	yes	White Board Frame	Wood	White	Friction	2	0	Negative
8300	1	B830001-1	2	205	Primary	Classroom 205	yes	Ceiling	Concrete	White	Flaking	5	0	Negative
8300	1	B830001-1	2	205	Primary	Classroom 205	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	2	205	Primary	Classroom 205	yes	Cove Base	Transite	Black	Chipping	10	0	Negative
8300	1	B830001-1	2	205A	Storage	Classroom 205 Closet (Left)	yes	W1	CMU	Tan	None	0	N/A	N/A
8300	1	B830001-1	2	205A	Storage	Classroom 205 Closet (Left)	yes	W2	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	205A	Storage	Classroom 205 Closet (Left)	yes	W3	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	205A	Storage	Classroom 205 Closet (Left)	yes	Shelves	Wood	White	Friction	4	4.8	Positive
8300	1	B830001-1	2	205A	Storage	Classroom 205 Closet (Left)	yes	W4	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	205A	Storage	Classroom 205 Closet (Left)	yes	Ceiling	Plaster	White	None	0	N/A	N/A
8300	1	B830001-1	2	205A	Storage	Classroom 205 Closet (Left)	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	2	205B	Storage	Classroom 205 Closet (Right)	yes	W1	CMU	Tan	None	0	N/A	N/A
8300	1	B830001-1	2	205B	Storage	Classroom 205 Closet (Right)	yes	W2	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	205B	Storage	Classroom 205 Closet (Right)	yes	W3	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	205B	Storage	Classroom 205 Closet (Right)	yes	Shelves	Wood	White	Friction	4	3.5	Positive
8300	1	B830001-1	2	205B	Storage	Classroom 205 Closet (Right)	yes	W4	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	205B	Storage	Classroom 205 Closet (Right)	yes	Ceiling	Plaster	White	None	0	N/A	N/A
8300	1	B830001-1	2	205B	Storage	Classroom 205 Closet (Right)	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	2	208	Primary	Classroom 204	yes	W1	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	208	Primary	Classroom 204	yes	W1	Sheetrock	Tan	Chipping	2	0	Negative

					Inspection Dates: 01/19/22									
					Inspector Name and Certificate Number: Ryan Hutsell PA RA:059512			Lead Safe Certification Assessment Report						
					Inspection Company: Synertech			Mayfair School						
ULCS #	Element	BldgElmt ID	Floor	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
8300	1	B830001-1	2	208	Primary	Classroom 204	yes	Door Frame	Wood	White	Chipping	2	0.1	Negative
8300	1	B830001-1	2	208	Primary	Classroom 204	yes	W2	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	208	Primary	Classroom 204	yes	W3	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	208	Primary	Classroom 204	yes	Univent	Metal	Tan	Chipping	2	0.14	Negative
8300	1	B830001-1	2	208	Primary	Classroom 204	yes	W4	Sheetrock	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	208	Primary	Classroom 204	yes	Ceiling	Concrete	White	Flaking	4	0	Negative
8300	1	B830001-1	2	208	Primary	Classroom 204	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	2	208	Primary	Classroom 204	yes	Cove Base	Transite	Black	Chipping	10	0	Negative
8300	1	B830001-1	2	208A	Storage	Classroom 204 RightCloset	yes	W1	CMU	Tan	None	0	N/A	N/A
8300	1	B830001-1	2	208A	Storage	Classroom 204 RightCloset	yes	W2	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	208A	Storage	Classroom 204 RightCloset	yes	W3	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	208A	Storage	Classroom 204 RightCloset	yes	W4	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	208A	Storage	Classroom 204 RightCloset	yes	Ceiling	Plaster	White	None	0	N/A	N/A
8300	1	B830001-1	2	208A	Storage	Classroom 204 RightCloset	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	2	208B	Storage	Classroom 204 Left Closet	yes	W1	CMU	Tan	None	0	N/A	N/A
8300	1	B830001-1	2	208B	Storage	Classroom 204 Left Closet	yes	W2	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	208B	Storage	Classroom 204 Left Closet	yes	W3	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	208B	Storage	Classroom 204 Left Closet	yes	W4	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	208B	Storage	Classroom 204 Left Closet	yes	Ceiling	Plaster	White	None	0	N/A	N/A
8300	1	B830001-1	2	208B	Storage	Classroom 204 Left Closet	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	2	209C	Primary	Classroom 206	yes	W1	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	209C	Primary	Classroom 206	yes	W1	Sheetrock	Tan	Chipping	5	0	Negative
8300	1	B830001-1	2	209C	Primary	Classroom 206	yes	W2	Sheetrock	Tan	Chipping	2	0	Negative
8300	1	B830001-1	2	209C	Primary	Classroom 206	yes	Door Frame	Metal	Tan	Friction	2	0.15	Negative
8300	1	B830001-1	2	209C	Primary	Classroom 206	yes	W3	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	209C	Primary	Classroom 206	yes	Radiator	Metal	Tan	Chipping	2	0.16	Negative
8300	1	B830001-1	2	209C	Primary	Classroom 206	yes	Univent	Metal	Tan	Chipping	2	0.21	Negative
8300	1	B830001-1	2	209C	Primary	Classroom 206	yes	W4	Sheetrock	Tan	Chipping	2	0	Negative
8300	1	B830001-1	2	209C	Primary	Classroom 206	yes	Ceiling	Concrete	White	Chipping	2	0	Negative
8300	1	B830001-1	2	209C	Primary	Classroom 206	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	2	209C	Primary	Classroom 206	yes	Cove Base	Transite	Black	Chipping	10	0	Negative
8300	1	B830001-1	2	209D	Storage	Classroom 206 Closet	yes	W1	CMU	Tan	None	0	N/A	N/A



					Inspection Dates: 01/19/22									
					Inspector Name and Certificate Number: Ryan Hutsell PA RA:059512			Lead Safe Certification Assessment Report						
					Inspection Company: Synertech			Mayfair School						
ULCS #	Element	BldgElmt ID	Floor	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
8300	1	B830001-1	2	209D	Storage	Classroom 206 Closet	yes	W2	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	209D	Storage	Classroom 206 Closet	yes	W3	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	209D	Storage	Classroom 206 Closet	yes	Shelves	Wood	White	Friction	4	2.5	Positive
8300	1	B830001-1	2	209D	Storage	Classroom 206 Closet	yes	W4	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	209D	Storage	Classroom 206 Closet	yes	Ceiling	Plaster	White	None	0	N/A	N/A
8300	1	B830001-1	2	209D	Storage	Classroom 206 Closet	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	2	204	Primary	Classroom 207	yes	W1	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	204	Primary	Classroom 207	yes	W2	Vinyl	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	204	Primary	Classroom 207	yes	Crown Moulding	Wood	White	Chipping	2	0	Negative
8300	1	B830001-1	2	204	Primary	Classroom 207	yes	W3	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	204	Primary	Classroom 207	yes	Univent	Metal	Tan	Chipping	2	0.04	Negative
8300	1	B830001-1	2	204	Primary	Classroom 207	yes	W4	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	204	Primary	Classroom 207	yes	Ceiling	Concrete	White	Flaking	4	0	Negative
8300	1	B830001-1	2	204	Primary	Classroom 207	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	2	204A	Storage	Classroom 207 Left Closet	yes	W1	CMU	Tan	None	0	N/A	N/A
8300	1	B830001-1	2	204A	Storage	Classroom 207 Left Closet	yes	W2	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	204A	Storage	Classroom 207 Left Closet	yes	W3	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	204A	Storage	Classroom 207 Left Closet	yes	Shelves	Wood	White	Friction	4	3.6	Positive
8300	1	B830001-1	2	204A	Storage	Classroom 207 Left Closet	yes	W4	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	204A	Storage	Classroom 207 Left Closet	yes	Ceiling	Plaster	White	None	0	N/A	N/A
8300	1	B830001-1	2	204A	Storage	Classroom 207 Left Closet	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	2	204B	Storage	Classroom 207 Right Closet	yes	W1	CMU	Tan	None	0	N/A	N/A
8300	1	B830001-1	2	204B	Storage	Classroom 207 Right Closet	yes	W2	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	204B	Storage	Classroom 207 Right Closet	yes	W3	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	204B	Storage	Classroom 207 Right Closet	yes	W4	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	204B	Storage	Classroom 207 Right Closet	yes	Ceiling	Plaster	White	None	0	N/A	N/A
8300	1	B830001-1	2	204B	Storage	Classroom 207 Right Closet	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	2	204AB	Principal/Directors Office	Vice Principal office	yes	W1	Plaster	Tan	Chipping	5	0	Negative

					Inspection Dates: 01/19/22									
					Inspector Name and Certificate Number: Ryan Hutsell PA RA:059512			Lead Safe Certification Assessment Report						
					Inspection Company: Synertech			Mayfair School						
ULCS #	Element	BldgElmt ID	Floor	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
8300	1	B830001-1	2	204AB	Principal/Directors Office	Vice Principal office	yes	W2	Plaster	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	204AB	Principal/Directors Office	Vice Principal office	yes	W3	Plaster	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	204AB	Principal/Directors Office	Vice Principal office	yes	Radiator	Metal	White	Flaking	2	0	Negative
8300	1	B830001-1	2	204AB	Principal/Directors Office	Vice Principal office	yes	W4	Plaster	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	204AB	Principal/Directors Office	Vice Principal office	yes	Ceiling	Plaster	White	None	0	N/A	N/A
8300	1	B830001-1	2	209	Primary	Classroom 208	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	2	209	Primary	Classroom 208	yes	W1	CMU	Tan	Partially Inaccessible	0	0.05	Negative
8300	1	B830001-1	2	209	Primary	Classroom 208	yes	Sink Cabinet	Metal	Tan	Chipping	1	0	Negative
8300	1	B830001-1	2	209	Primary	Classroom 208	yes	W2	Sheetrock	Tan	Chipping	8	0	Negative
8300	1	B830001-1	2	209	Primary	Classroom 208	yes	W3	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	209	Primary	Classroom 208	yes	Univent	Metal	Tan	Chipping	3	0.17	Negative
8300	1	B830001-1	2	209	Primary	Classroom 208	yes	W4	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	209	Primary	Classroom 208	yes	Ceiling	Concrete	White	None	0	N/A	N/A
8300	1	B830001-1	2	209	Primary	Classroom 208	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	2	209A	Storage	Classroom 208 Closet (Left)	yes	W1	CMU	Tan	None	0	N/A	N/A
8300	1	B830001-1	2	209A	Storage	Classroom 208 Closet (Left)	yes	W2	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	209A	Storage	Classroom 208 Closet (Left)	yes	W3	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	209A	Storage	Classroom 208 Closet (Left)	yes	Shelves	Wood	White	Friction	4	3.9	Positive
8300	1	B830001-1	2	209A	Storage	Classroom 208 Closet (Left)	yes	W4	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	209A	Storage	Classroom 208 Closet (Left)	yes	Ceiling	Plaster	White	None	0	0	Negative
8300	1	B830001-1	2	209A	Storage	Classroom 208 Closet (Left)	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	2	209B	Storage	Classroom 208 Closet (Right)	yes	W1	CMU	Tan	None	0	N/A	N/A
8300	1	B830001-1	2	209B	Storage	Classroom 208 Closet (Right)	yes	W2	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	209B	Storage	Classroom 208 Closet (Right)	yes	W3	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	209B	Storage	Classroom 208 Closet (Right)	yes	W4	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	209B	Storage	Classroom 208 Closet (Right)	yes	Ceiling	Plaster	White	None	0	0	Negative
8300	1	B830001-1	2	209B	Storage	Classroom 208 Closet (Right)	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	2	203	Primary	Classroom 209	yes	W1	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	203	Primary	Classroom 209	yes	W2	Sheetrock	White	Chipping	6	0	Negative

					Inspection Dates: 01/19/22									
					Inspector Name and Certificate Number: Ryan Hutsell PA RA:059512			Lead Safe Certification Assessment Report						
					Inspection Company: Synertech			Mayfair School						
ULCS #	Element	BldgElmt ID	Floor	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
8300	1	B830001-1	2	203	Primary	Classroom 209	yes	W3	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	203	Primary	Classroom 209	yes	Univent	Metal	Tan	Chipping	2	0.2	Negative
8300	1	B830001-1	2	203	Primary	Classroom 209	yes	W4	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	203	Primary	Classroom 209	yes	Ceiling	Concrete	White	None	0	N/A	N/A
8300	1	B830001-1	2	203	Primary	Classroom 209	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	2	203	Primary	Classroom 209	yes	Cove Base	Transite	Black	Chipping	10	0	Negative
8300	1	B830001-1	2	203D	Storage	Classroom 209 Left Closet	yes	W1	CMU	Tan	None	0	N/A	N/A
8300	1	B830001-1	2	203D	Storage	Classroom 209 Left Closet	yes	W2	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	203D	Storage	Classroom 209 Left Closet	yes	W3	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	203D	Storage	Classroom 209 Left Closet	yes	Shelves	Wood	White	Friction	5	4.3	Positive
8300	1	B830001-1	2	203D	Storage	Classroom 209 Left Closet	yes	W4	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	203D	Storage	Classroom 209 Left Closet	yes	Ceiling	Plaster	White	None	0	N/A	N/A
8300	1	B830001-1	2	203D	Storage	Classroom 209 Left Closet	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	2	203E	Storage	Classroom 209 Right Closet	yes	W1	CMU	Tan	None	0	N/A	N/A
8300	1	B830001-1	2	203E	Storage	Classroom 209 Right Closet	yes	W2	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	203E	Storage	Classroom 209 Right Closet	yes	W3	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	203E	Storage	Classroom 209 Right Closet	yes	W4	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	203E	Storage	Classroom 209 Right Closet	yes	Ceiling	Plaster	White	None	0	N/A	N/A
8300	1	B830001-1	2	203E	Storage	Classroom 209 Right Closet	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	2	209A	Restrooms, Staff - Female	Women's Staff Restroom 209A	yes	W1	CMU	Green	None	0	N/A	N/A
8300	1	B830001-1	2	209A	Restrooms, Staff - Female	Women's Staff Restroom 209A	yes	W1	CMU	White	None	0	N/A	N/A
8300	1	B830001-1	2	209A	Restrooms, Staff - Female	Women's Staff Restroom 209A	yes	W2	CMU	Green	None	0	N/A	N/A
8300	1	B830001-1	2	209A	Restrooms, Staff - Female	Women's Staff Restroom 209A	yes	W2	CMU	White	None	0	N/A	N/A
8300	1	B830001-1	2	209A	Restrooms, Staff - Female	Women's Staff Restroom 209A	yes	Stall Dividers	Metal	Green	Holes	1	0	Negative
8300	1	B830001-1	2	209A	Restrooms, Staff - Female	Women's Staff Restroom 209A	yes	W3	CMU	Green	None	0	N/A	N/A
8300	1	B830001-1	2	209A	Restrooms, Staff - Female	Women's Staff Restroom 209A	yes	W3	CMU	White	None	0	N/A	N/A
8300	1	B830001-1	2	209A	Restrooms, Staff - Female	Women's Staff Restroom 209A	yes	Radiator	Metal	Black	Chipping	4	0.2	Negative

					Inspection Dates: 01/19/22									
					Inspector Name and Certificate Number: Ryan Hutsell PA RA:059512			Lead Safe Certification Assessment Report						
					Inspection Company: Synertech			Mayfair School						
ULCS #	Element	BldgElmt ID	Floor	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
8300	1	B830001-1	2	209A	Restrooms, Staff - Female	Women's Staff Restroom 209A	yes	W4	CMU	Green	None	0	N/A	N/A
8300	1	B830001-1	2	209A	Restrooms, Staff - Female	Women's Staff Restroom 209A	yes	W4	CMU	White	None	0	N/A	N/A
8300	1	B830001-1	2	209A	Restrooms, Staff - Female	Women's Staff Restroom 209A	yes	Ceiling	Concrete	White	Flaking	24	0	Negative
8300	1	B830001-1	2	209A	Restrooms, Staff - Female	Women's Staff Restroom 209A	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	2	209B	Restrooms, Staff - Male	Staff Men's Restroom next to Classroom 208	yes	W1	CMU	Blue	None	0	N/A	N/A
8300	1	B830001-1	2	209B	Restrooms, Staff - Male	Staff Men's Restroom next to Classroom 208	yes	W2	CMU	Blue	Chipping	2	0	Negative
8300	1	B830001-1	2	209B	Restrooms, Staff - Male	Staff Men's Restroom next to Classroom 208	yes	W3	CMU	Blue	None	0	N/A	N/A
8300	1	B830001-1	2	209B	Restrooms, Staff - Male	Staff Men's Restroom next to Classroom 208	yes	W4	CMU	Blue	None	0	N/A	N/A
8300	1	B830001-1	2	209B	Restrooms, Staff - Male	Staff Men's Restroom next to Classroom 208	yes	Ceiling	Concrete	White	None	0	N/A	N/A
8300	1	B830001-1	2	209B	Restrooms, Staff - Male	Staff Men's Restroom next to Classroom 208	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	2	209E	Pipe Chase	Pipe Chase in 2nd Floor Men's Restroom	no	W1	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	2	209E	Pipe Chase	Pipe Chase in 2nd Floor Men's Restroom	no	W2	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	2	209E	Pipe Chase	Pipe Chase in 2nd Floor Men's Restroom	no	W3	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	2	209E	Pipe Chase	Pipe Chase in 2nd Floor Men's Restroom	no	W4	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	2	209E	Pipe Chase	Pipe Chase in 2nd Floor Men's Restroom	no	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	2	209E	Pipe Chase	Pipe Chase in 2nd Floor Men's Restroom	no	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	2	203B	Student Restrooms - Female (4-12)	Girl's Restroom Across from Classroom 210	yes	W1	CMU	Green	None	0	N/A	N/A
8300	1	B830001-1	2	203B	Student Restrooms - Female (4-12)	Girl's Restroom Across from Classroom 210	yes	W2	CMU	Green	None	0	N/A	N/A
8300	1	B830001-1	2	203B	Student Restrooms - Female (4-12)	Girl's Restroom Across from Classroom 210	yes	W3	CMU	Green	Efflorescence	4	0	Negative
8300	1	B830001-1	2	203B	Student Restrooms - Female (4-12)	Girl's Restroom Across from Classroom 210	yes	Radiator	Metal	Black	Chipping	4	0.18	Negative
8300	1	B830001-1	2	203B	Student Restrooms - Female (4-12)	Girl's Restroom Across from Classroom 210	yes	W4	CMU	Green	None	0	N/A	N/A
8300	1	B830001-1	2	203B	Student Restrooms - Female (4-12)	Girl's Restroom Across from Classroom 210	yes	Ceiling	Concrete	White	None	0	N/A	N/A

					Inspection Dates: 01/19/22									
					Inspector Name and Certificate Number: Ryan Hutsell PA RA:059512			Lead Safe Certification Assessment Report						
					Inspection Company: Synertech			Mayfair School						
ULCS #	Element	BldgElmt ID	Floor	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
8300	1	B830001-1	2	203B	Student Restrooms - Female (4-12)	Girl's Restroom Across from Classroom 210	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	2	203C	Service Closets	Custodial Closet next to 2nd Floor Restrooms	no	W1	CMU	Tan	Flaking	10	0	Negative
8300	1	B830001-1	2	203C	Service Closets	Custodial Closet next to 2nd Floor Restrooms	no	W2	CMU	Tan	Flaking	12	0	Negative
8300	1	B830001-1	2	203C	Service Closets	Custodial Closet next to 2nd Floor Restrooms	no	W3	CMU	Tan	Flaking	8	0	Negative
8300	1	B830001-1	2	203C	Service Closets	Custodial Closet next to 2nd Floor Restrooms	no	Shelf	Wood	White	Friction	3	0.25	Negative
8300	1	B830001-1	2	203C	Service Closets	Custodial Closet next to 2nd Floor Restrooms	no	W4	CMU	Tan	Flaking	10	0	Negative
8300	1	B830001-1	2	203C	Service Closets	Custodial Closet next to 2nd Floor Restrooms	no	Ceiling	Concrete	Tan	Flaking	4	0	Negative
8300	1	B830001-1	2	203C	Service Closets	Custodial Closet next to 2nd Floor Restrooms	no	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	2	203F	Pipe Chase	Pipe Chase for 2nd Floor Girls' Restroom in Custodial Closet	no	W1	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	2	203F	Pipe Chase	Pipe Chase for 2nd Floor Girls' Restroom in Custodial Closet	no	W2	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	2	203F	Pipe Chase	Pipe Chase for 2nd Floor Girls' Restroom in Custodial Closet	no	W3	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	2	203F	Pipe Chase	Pipe Chase for 2nd Floor Girls' Restroom in Custodial Closet	no	W4	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	2	203F	Pipe Chase	Pipe Chase for 2nd Floor Girls' Restroom in Custodial Closet	no	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	2	203F	Pipe Chase	Pipe Chase for 2nd Floor Girls' Restroom in Custodial Closet	no	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	2	203A	Student Restrooms - Male (4-12)	Boy's Restroom across from Classroom 210	yes	W1	CMU	Green	None	0	N/A	N/A
8300	1	B830001-1	2	203A	Student Restrooms - Male (4-12)	Boy's Restroom across from Classroom 210	yes	W2	CMU	Green	None	0	N/A	N/A
8300	1	B830001-1	2	203A	Student Restrooms - Male (4-12)	Boy's Restroom across from Classroom 210	yes	W3	CMU	Green	Chipping	4	0	Negative
8300	1	B830001-1	2	203A	Student Restrooms - Male (4-12)	Boy's Restroom across from Classroom 210	yes	Radiator	Metal	Black	Chipping	4	0.12	Negative
8300	1	B830001-1	2	203A	Student Restrooms - Male (4-12)	Boy's Restroom across from Classroom 210	yes	W4	CMU	Green	None	0	N/A	N/A
8300	1	B830001-1	2	203A	Student Restrooms - Male (4-12)	Boy's Restroom across from Classroom 210	yes	Ceiling	Concrete	White	None	0	N/A	N/A
8300	1	B830001-1	2	203A	Student Restrooms - Male (4-12)	Boy's Restroom across from Classroom 210	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	2	210	Primary	Classroom 210	yes	W1	CMU	Tan	Partially Inaccessible	0	0	Negative

					Inspection Dates: 01/19/22									
					Inspector Name and Certificate Number: Ryan Hutsell PA RA:059512			Lead Safe Certification Assessment Report						
					Inspection Company: Synertech			Mayfair School						
ULCS #	Element	BldgElmt ID	Floor	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
8300	1	B830001-1	2	210	Primary	Classroom 210	yes	W2	Vinyl	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	210	Primary	Classroom 210	yes	W3	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	210	Primary	Classroom 210	yes	Univent	Metal	Tan	Chipping	5	0.17	Negative
8300	1	B830001-1	2	210	Primary	Classroom 210	yes	W4	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	210	Primary	Classroom 210	yes	Ceiling	Concrete	White	None	0	N/A	N/A
8300	1	B830001-1	2	210	Primary	Classroom 210	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	2	210	Primary	Classroom 210	yes	Cove Base	Transite	Black	Chipping	10	0	Negative
8300	1	B830001-1	2	210A	Storage	Classroom 210 Closet (Left)	yes	W1	CMU	Tan	None	0	N/A	N/A
8300	1	B830001-1	2	210A	Storage	Classroom 210 Closet (Left)	yes	W2	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	210A	Storage	Classroom 210 Closet (Left)	yes	W3	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	210A	Storage	Classroom 210 Closet (Left)	yes	Shelves	Wood	White	Friction	4	2.9	Positive
8300	1	B830001-1	2	210A	Storage	Classroom 210 Closet (Left)	yes	W4	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	210A	Storage	Classroom 210 Closet (Left)	yes	Ceiling	Plaster	White	None	0	0	Negative
8300	1	B830001-1	2	210A	Storage	Classroom 210 Closet (Left)	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	2	210C	Storage	Classroom 210 Closet (Right)	yes	W1	CMU	Tan	None	0	N/A	N/A
8300	1	B830001-1	2	210C	Storage	Classroom 210 Closet (Right)	yes	W2	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	210C	Storage	Classroom 210 Closet (Right)	yes	W3	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	210C	Storage	Classroom 210 Closet (Right)	yes	W4	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	210C	Storage	Classroom 210 Closet (Right)	yes	Ceiling	Plaster	White	None	0	0	Negative
8300	1	B830001-1	2	210C	Storage	Classroom 210 Closet (Right)	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	2	210B	Storage	Classroom 207 Middle Closet	yes	W1	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	210B	Storage	Classroom 207 Middle Closet	yes	W2	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	210B	Storage	Classroom 207 Middle Closet	yes	W3	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	210B	Storage	Classroom 207 Middle Closet	yes	W4	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	210B	Storage	Classroom 207 Middle Closet	yes	Ceiling	Plaster	White	None	0	N/A	N/A
8300	1	B830001-1	2	210B	Storage	Classroom 207 Middle Closet	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	2	211D	Primary	Classroom 212	yes	W1	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	211D	Primary	Classroom 212	yes	W2	Sheetrock	Tan	Partially Inaccessible	0	0	Negative

					Inspection Dates: 01/19/22									
					Inspector Name and Certificate Number: Ryan Hutsell PA RA:059512			Lead Safe Certification Assessment Report						
					Inspection Company: Synertech			Mayfair School						
ULCS #	Element	BldgElmt ID	Floor	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
8300	1	B830001-1	2	211D	Primary	Classroom 212	yes	W3	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	211D	Primary	Classroom 212	yes	Univent	Metal	Tan	Chipping	4	0.26	Negative
8300	1	B830001-1	2	211D	Primary	Classroom 212	yes	W4	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	211D	Primary	Classroom 212	yes	Ceiling	Concrete	White	None	0	N/A	N/A
8300	1	B830001-1	2	211D	Primary	Classroom 212	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	2	211D	Primary	Classroom 212	yes	Cove Base	Transite	Black	Chipping	10	0	Negative
8300	1	B830001-1	2	202	Primary	Classroom 211	yes	W1	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	202	Primary	Classroom 211	yes	W2	Sheetrock	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	202	Primary	Classroom 211	yes	W3	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	202	Primary	Classroom 211	yes	Univent	Metal	Tan	Chipping	4	0.18	Negative
8300	1	B830001-1	2	202	Primary	Classroom 211	yes	W4	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	202	Primary	Classroom 211	yes	Ceiling	Concrete	White	None	0	N/A	N/A
8300	1	B830001-1	2	202	Primary	Classroom 211	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	2	202	Primary	Classroom 211	yes	Cove Base	Transite	Black	Chipping	10	0	Negative
8300	1	B830001-1	2	202C	Storage	Classroom 211 Right Closet	yes	W1	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	202C	Storage	Classroom 211 Right Closet	yes	W2	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	202C	Storage	Classroom 211 Right Closet	yes	W3	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	202C	Storage	Classroom 211 Right Closet	yes	Shelves	Wood	White	Friction	4	4	Positive
8300	1	B830001-1	2	202C	Storage	Classroom 211 Right Closet	yes	W4	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	202C	Storage	Classroom 211 Right Closet	yes	Ceiling	Plaster	White	None	0	N/A	N/A
8300	1	B830001-1	2	202C	Storage	Classroom 211 Right Closet	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	2	202B	Storage	Classroom 211 Left Closet	yes	W1	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	202B	Storage	Classroom 211 Left Closet	yes	W2	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	202B	Storage	Classroom 211 Left Closet	yes	W3	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	202B	Storage	Classroom 211 Left Closet	yes	Shelves	Wood	White	Friction	4	4	Positive
8300	1	B830001-1	2	202B	Storage	Classroom 211 Left Closet	yes	W4	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	202B	Storage	Classroom 211 Left Closet	yes	Ceiling	Plaster	White	None	0	N/A	N/A
8300	1	B830001-1	2	202B	Storage	Classroom 211 Left Closet	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	2	211	Primary	Classroom 214	yes	W1	CMU	Tan	Partially Inaccessible	0	0	Negative

					Inspection Dates: 01/19/22									
					Inspector Name and Certificate Number: Ryan Hutsell PA RA:059512			Lead Safe Certification Assessment Report						
					Inspection Company: Synertech			Mayfair School						
ULCS #	Element	BldgElmt ID	Floor	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
8300	1	B830001-1	2	211	Primary	Classroom 214	yes	W2	Sheetrock	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	211	Primary	Classroom 214	yes	W3	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	211	Primary	Classroom 214	yes	Univent	Metal	Tan	Chipping	2	0.1	Negative
8300	1	B830001-1	2	211	Primary	Classroom 214	yes	W4	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	211	Primary	Classroom 214	yes	Ceiling	Concrete	White	None	0	N/A	N/A
8300	1	B830001-1	2	211	Primary	Classroom 214	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	2	211	Primary	Classroom 214	yes	Cove Base	Transite	Black	Chipping	10	0	Negative
8300	1	B830001-1	2	211A	Primary	Classroom 214 Right Closet	yes	W1	CMU	Tan	None	0	N/A	N/A
8300	1	B830001-1	2	211A	Primary	Classroom 214 Right Closet	yes	W2	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	211A	Primary	Classroom 214 Right Closet	yes	W3	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	211A	Primary	Classroom 214 Right Closet	yes	Shelves	Wood	White	Partially Inaccessible	0	1	Positive
8300	1	B830001-1	2	211A	Primary	Classroom 214 Right Closet	yes	W4	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	211A	Primary	Classroom 214 Right Closet	yes	Ceiling	Plaster	White	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	211A	Primary	Classroom 214 Right Closet	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	2	211B	Primary	Classroom 214 Left Closet	yes	W1	CMU	Tan	None	0	N/A	N/A
8300	1	B830001-1	2	211B	Primary	Classroom 214 Left Closet	yes	W2	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	211B	Primary	Classroom 214 Left Closet	yes	W3	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	211B	Primary	Classroom 214 Left Closet	yes	Shelves	Wood	White	Partially Inaccessible	0	1	Positive
8300	1	B830001-1	2	211B	Primary	Classroom 214 Left Closet	yes	W4	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	211B	Primary	Classroom 214 Left Closet	yes	Ceiling	Plaster	White	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	211B	Primary	Classroom 214 Left Closet	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	2	202A	Primary	Classroom 213	yes	W1	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	202A	Primary	Classroom 213	yes	W2	Sheetrock	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	202A	Primary	Classroom 213	yes	W3	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	202A	Primary	Classroom 213	yes	Univent	Metal	Tan	Chipping	3	0.1	Negative
8300	1	B830001-1	2	202A	Primary	Classroom 213	yes	W4	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	202A	Primary	Classroom 213	yes	Ceiling	Concrete	White	None	0	N/A	N/A



					Inspection Dates: 01/19/22									
					Inspector Name and Certificate Number: Ryan Hutsell PA RA:059512			Lead Safe Certification Assessment Report						
					Inspection Company: Synertech			Mayfair School						
ULCS #	Element	BldgElmt ID	Floor	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
8300	1	B830001-1	2	202A	Primary	Classroom 213	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	2	202A	Primary	Classroom 213	yes	Cove Base	Transite	Black	Chipping	10	0	Negative
8300	1	B830001-1	2	202AB	Storage	Classroom 213 Right Closet	yes	W1	CMU	Tan	None	0	N/A	N/A
8300	1	B830001-1	2	202AB	Storage	Classroom 213 Right Closet	yes	W2	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	202AB	Storage	Classroom 213 Right Closet	yes	W3	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	202AB	Storage	Classroom 213 Right Closet	yes	Shelves	Wood	White	Partially Inaccessible	0	1	Positive
8300	1	B830001-1	2	202AB	Storage	Classroom 213 Right Closet	yes	W4	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	202AB	Storage	Classroom 213 Right Closet	yes	Ceiling	Plaster	White	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	202AB	Storage	Classroom 213 Right Closet	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	2	202BB	Storage	Classroom 213 Left Closet	yes	W1	CMU	Tan	None	0	N/A	N/A
8300	1	B830001-1	2	202BB	Storage	Classroom 213 Left Closet	yes	W2	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	202BB	Storage	Classroom 213 Left Closet	yes	W3	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	202BB	Storage	Classroom 213 Left Closet	yes	Shelves	Wood	White	Partially Inaccessible	0	1	Positive
8300	1	B830001-1	2	202BB	Storage	Classroom 213 Left Closet	yes	W4	CMU	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	202BB	Storage	Classroom 213 Left Closet	yes	Ceiling	Plaster	White	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	202BB	Storage	Classroom 213 Left Closet	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	2	212	Primary	Classroom 216	yes	W1	CMU	Tan	Chipping	1	0	Negative
8300	1	B830001-1	2	212	Primary	Classroom 216	yes	W2	Drywall	Tan	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	212	Primary	Classroom 216	yes	W3	CMU	Tan	Chipping	1	0	Negative
8300	1	B830001-1	2	212	Primary	Classroom 216	yes	Univent	Metal	Tan	Flaking	2	0.15	Negative
8300	1	B830001-1	2	212	Primary	Classroom 216	yes	W4	CMU	Tan	Chipping	1	0	Negative
8300	1	B830001-1	2	212	Primary	Classroom 216	yes	Ceiling	Concrete	White	None	0	0	Negative
8300	1	B830001-1	2	212	Primary	Classroom 216	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	2	212	Primary	Classroom 216	yes	Baseboard	Transite	Black	Chipping	10	0	Negative
8300	1	B830001-1	2	212A	Primary	Classroom 216 Left Closet	yes	W1	CMU	Tan	None	0	N/A	N/A
8300	1	B830001-1	2	212A	Primary	Classroom 216 Left Closet	yes	W2	CMU	Tan	None	0	0	Negative
8300	1	B830001-1	2	212A	Primary	Classroom 216 Left Closet	yes	W3	CMU	Tan	None	0	0	Negative
8300	1	B830001-1	2	212A	Primary	Classroom 216 Left Closet	yes	W4	CMU	Tan	None	0	0	Negative
8300	1	B830001-1	2	212A	Primary	Classroom 216 Left Closet	yes	Ceiling	Concrete	White	None	0	0	Negative
8300	1	B830001-1	2	212A	Primary	Classroom 216 Left Closet	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	2	212B	Primary	Classroom 216 Right Closet	yes	W1	CMU	Tan	None	0	N/A	N/A
8300	1	B830001-1	2	212B	Primary	Classroom 216 Right Closet	yes	W2	CMU	Tan	None	0	0	Negative
8300	1	B830001-1	2	212B	Primary	Classroom 216 Right Closet	yes	W3	CMU	Tan	None	0	0	Negative

					Inspection Dates: 01/19/22									
					Inspector Name and Certificate Number: Ryan Hutsell PA RA:059512			Lead Safe Certification Assessment Report						
					Inspection Company: Synertech			Mayfair School						
ULCS #	Element	BldgElmt ID	Floor	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
8300	1	B830001-1	2	212B	Primary	Classroom 216 Right Closet	yes	W4	CMU	Tan	None	0	0	Negative
8300	1	B830001-1	2	212B	Primary	Classroom 216 Right Closet	yes	Ceiling	Concrete	White	None	0	0	Negative
8300	1	B830001-1	2	212B	Primary	Classroom 216 Right Closet	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	2	201	Primary	Classroom 215	yes	W1	CMU	Tan	Chipping	1	0.05	Negative
8300	1	B830001-1	2	201	Primary	Classroom 215	yes	W2	CMU	Tan	Chipping	1	0	Negative
8300	1	B830001-1	2	201	Primary	Classroom 215	yes	W3	CMU	Tan	Chipping	1	0	Negative
8300	1	B830001-1	2	201	Primary	Classroom 215	yes	Univent	Metal	Tan	Chipping	2	0.2	Negative
8300	1	B830001-1	2	201	Primary	Classroom 215	yes	W4	Drywall	Tan	Chipping	10	0	Negative
8300	1	B830001-1	2	201	Primary	Classroom 215	yes	Ceiling	Concrete	White	Chipping	2	0	Negative
8300	1	B830001-1	2	201	Primary	Classroom 215	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	2	201	Primary	Classroom 215	yes	Baseboard	Transite	Black	Chipping	10	0	Negative
8300	1	B830001-1	2	201A	Storage	Classroom 215 Closet	yes	W1	CMU	Tan	None	0	N/A	N/A
8300	1	B830001-1	2	201A	Storage	Classroom 215 Closet	yes	W2	CMU	Tan	None	0	0	Negative
8300	1	B830001-1	2	201A	Storage	Classroom 215 Closet	yes	W3	CMU	Tan	None	0	0	Negative
8300	1	B830001-1	2	201A	Storage	Classroom 215 Closet	yes	Shelf	Wood	Blue	Friction	2	0.08	Negative
8300	1	B830001-1	2	201A	Storage	Classroom 215 Closet	yes	W4	CMU	Tan	None	0	0	Negative
8300	1	B830001-1	2	201A	Storage	Classroom 215 Closet	yes	Ceiling	Concrete	White	None	0	0	Negative
8300	1	B830001-1	2	201A	Storage	Classroom 215 Closet	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	2	212C	Storage	Storage Closet E in 2nd Floor Hall next to Classroom 216	yes	W1	CMU	White	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	212C	Storage	Storage Closet E in 2nd Floor Hall next to Classroom 216	yes	W2	CMU	White	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	212C	Storage	Storage Closet E in 2nd Floor Hall next to Classroom 216	yes	W3	CMU	White	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	212C	Storage	Storage Closet E in 2nd Floor Hall next to Classroom 216	yes	W4	CMU	White	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	2	212C	Storage	Storage Closet E in 2nd Floor Hall next to Classroom 216	yes	Radiator	Metal	Tan	Chipping	2	0	Negative
8300	1	B830001-1	2	212C	Storage	Storage Closet E in 2nd Floor Hall next to Classroom 216	yes	Ceiling	Concrete	White	None	0	N/A	N/A
8300	1	B830001-1	2	212C	Storage	Storage Closet E in 2nd Floor Hall next to Classroom 216	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	2	200	Primary	Classroom 217	yes	W1	CMU	Tan	Chipping	1	0	Negative
8300	1	B830001-1	2	200	Primary	Classroom 217	yes	Built-in Shelving	Wood	White	Friction	40	3.2	Positive
8300	1	B830001-1	2	200	Primary	Classroom 217	yes	W2	CMU	Tan	Chipping	3	0	Negative
8300	1	B830001-1	2	200	Primary	Classroom 217	yes	Built-in Shelving	Wood	White	Friction	40	4.6	Positive
8300	1	B830001-1	2	200	Primary	Classroom 217	yes	Bench	Wood	White	Friction	5	4.2	Positive
8300	1	B830001-1	2	200	Primary	Classroom 217	yes	W3	CMU	Tan	Chipping	1	0	Negative
8300	1	B830001-1	2	200	Primary	Classroom 217	yes	Built-in Shelving	Wood	White	Friction	40	2.9	Positive
8300	1	B830001-1	2	200	Primary	Classroom 217	yes	Univent	Metal	Tan	Chipping	2	0.12	Negative
8300	1	B830001-1	2	200	Primary	Classroom 217	yes	W4	CMU	Tan	Chipping	1	0	Negative

					Inspection Dates: 01/19/22									
					Inspector Name and Certificate Number: Ryan Hutsell PA RA:059512			Lead Safe Certification Assessment Report						
					Inspection Company: Synertech			Mayfair School						
ULCS #	Element	BldgElmt ID	Floor	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
8300	1	B830001-1	2	200	Primary	Classroom 217	yes	Ceiling	Concrete	White	Flaking	3	0	Negative
8300	1	B830001-1	2	200	Primary	Classroom 217	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	2	216B	Restrooms, Staff - Male/Female	Office 218 Restroom	yes	W1	CMU	White	None	0	N/A	N/A
8300	1	B830001-1	2	216B	Restrooms, Staff - Male/Female	Office 218 Restroom	yes	W2	CMU	White	None	0	N/A	N/A
8300	1	B830001-1	2	216B	Restrooms, Staff - Male/Female	Office 218 Restroom	yes	W3	CMU	White	None	0	N/A	N/A
8300	1	B830001-1	2	216B	Restrooms, Staff - Male/Female	Office 218 Restroom	yes	W4	CMU	White	None	0	N/A	N/A
8300	1	B830001-1	2	216B	Restrooms, Staff - Male/Female	Office 218 Restroom	yes	Ceiling	Plaster	White	None	0	N/A	N/A
8300	1	B830001-1	2	216B	Restrooms, Staff - Male/Female	Office 218 Restroom	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	2	216A	Pipe Chase	Pipe Chase in Clasroom 218	no	W1	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	2	216A	Pipe Chase	Pipe Chase in Classroom 218	no	W2	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	2	216A	Pipe Chase	Pipe Chase in Clasroom 218	no	W3	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	2	216A	Pipe Chase	Pipe Chase in Clasroom 218	no	W4	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	2	216A	Pipe Chase	Pipe Chase in Clasroom 218	no	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	2	216A	Pipe Chase	Pipe Chase in Classroom 218	no	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	2	200	Primary	Classroom 217	yes	Baseboard	Transite	Tan	Chipping	12	0	Negative
8300	1	B830001-1	2	216	Primary	Classroom 218	yes	W1	CMU	Tan	Chipping	1	0	Negative
8300	1	B830001-1	2	216	Primary	Classroom 218	yes	W2	Drywall	Tan	None	0	0	Negative
8300	1	B830001-1	2	216	Primary	Classroom 218	yes	W3	CMU	Tan	None	0	0	Negative
8300	1	B830001-1	2	216	Primary	Classroom 218	yes	Univent	Wood	Green	Friction	2	0.1	Negative
8300	1	B830001-1	2	216	Primary	Classroom 218	yes	W4	Drywall	Tan	None	0	0	Negative
8300	1	B830001-1	2	216	Primary	Classroom 218	yes	Ceiling	Concrete	White	None	0	0	Negative
8300	1	B830001-1	2	216	Primary	Classroom 218	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	2	216	Primary	Classroom 218	yes	Baseboard	Transite	Tan	Chipping	10	0	Negative
8300	1	B830001-1	2	216A	Storage	Classroom 218 Right Closet	yes	W1	CMU	Tan	None	0	N/A	N/A
8300	1	B830001-1	2	216A	Storage	Classroom 218 Right Closet	yes	W2	CMU	Tan	None	0	0	Negative
8300	1	B830001-1	2	216A	Storage	Classroom 218 Right Closet	yes	W3	CMU	Tan	None	0	0	Negative
8300	1	B830001-1	2	216A	Storage	Classroom 218 Right Closet	yes	Shelf	Wood	Green	Friction	2	0.08	Negative
8300	1	B830001-1	2	216A	Storage	Classroom 218 Right Closet	yes	W4	CMU	Tan	None	0	0.05	Negative
8300	1	B830001-1	2	216A	Storage	Classroom 218 Right Closet	yes	Ceiling	Concrete	White	None	0	0	Negative
8300	1	B830001-1	2	216A	Storage	Classroom 218 Right Closet	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	2	216B	Storage	Classroom 218 Left Closet	yes	W1	CMU	Tan	None	0	N/A	N/A
8300	1	B830001-1	2	216B	Storage	Classroom 218 Left Closet	yes	W2	CMU	Tan	None	0	0.02	Negative
8300	1	B830001-1	2	216B	Storage	Classroom 218 Left Closet	yes	W3	CMU	Tan	None	0	0	Negative
8300	1	B830001-1	2	216B	Storage	Classroom 218 Left Closet	yes	Shelf	Wood	Green	Friction	2	0	Negative
8300	1	B830001-1	2	216B	Storage	Classroom 218 Left Closet	yes	W4	CMU	Tan	None	0	0	Negative
8300	1	B830001-1	2	216B	Storage	Classroom 218 Left Closet	yes	Ceiling	Concrete	White	None	0	0	Negative
8300	1	B830001-1	2	216B	Storage	Classroom 218 Left Closet	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	2	213	Primary	Classroom 219	yes	W1	CMU	Tan	None	1	0	Negative

					Inspection Dates: 01/19/22									
					Inspector Name and Certificate Number: Ryan Hutsell PA RA:059512			Lead Safe Certification Assessment Report						
					Inspection Company: Synertech			Mayfair School						
ULCS #	Element	BldgElmt ID	Floor	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
8300	1	B830001-1	2	213	Primary	Classroom 219	yes	W2	Drywall	Tan	None	1	0	Negative
8300	1	B830001-1	2	213	Primary	Classroom 219	yes	W3	CMU	Tan	None	1	0	Negative
8300	1	B830001-1	2	213	Primary	Classroom 219	yes	Univent	Wood	Green	Friction	2	0.1	Negative
8300	1	B830001-1	2	213	Primary	Classroom 219	yes	W4	Vinyl	N/A	None	0	N/A	N/A
8300	1	B830001-1	2	213	Primary	Classroom 219	yes	Ceiling	Concrete	White	None	0	0	Negative
8300	1	B830001-1	2	213	Primary	Classroom 219	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	2	213	Primary	Classroom 219	yes	Baseboard	Transite	Tan	Chipping	10	0	Negative
8300	1	B830001-1	2	214	Primary	Classroom 220	yes	W1	CMU	Tan	None	1	0	Negative
8300	1	B830001-1	2	214	Primary	Classroom 220	yes	W2	Drywall	Tan	None	1	0	Negative
8300	1	B830001-1	2	214	Primary	Classroom 220	yes	W3	CMU	Tan	None	1	0	Negative
8300	1	B830001-1	2	214	Primary	Classroom 220	yes	Univent	Wood	Green	Friction	2	0.1	Negative
8300	1	B830001-1	2	214	Primary	Classroom 220	yes	W4	Vinyl	N/A	None	0	N/A	N/A
8300	1	B830001-1	2	214	Primary	Classroom 220	yes	Ceiling	Concrete	White	None	0	0	Negative
8300	1	B830001-1	2	214	Primary	Classroom 220	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	2	214	Primary	Classroom 220	yes	Baseboard	Transite	Tan	Chipping	10	0	Negative
8300	1	B830001-1	2	214A	Primary	Classroom 220 Left Closet	yes	W1	CMU	Tan	None	0	N/A	N/A
8300	1	B830001-1	2	214A	Primary	Classroom 220 Left Closet	yes	W2	CMU	Tan	None	0	0	Negative
8300	1	B830001-1	2	214A	Primary	Classroom 220 Left Closet	yes	W3	CMU	Tan	None	0	0.06	Negative
8300	1	B830001-1	2	214A	Primary	Classroom 220 Left Closet	yes	Shelf	Wood	Green	Friction	2	0.08	Negative
8300	1	B830001-1	2	214A	Primary	Classroom 220 Left Closet	yes	W4	CMU	Tan	None	0	0	Negative
8300	1	B830001-1	2	214A	Primary	Classroom 220 Left Closet	yes	Ceiling	Concrete	White	None	0	0	Negative
8300	1	B830001-1	2	214A	Primary	Classroom 220 Left Closet	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	2	214B	Primary	Classroom 220 Right Closet	yes	W1	CMU	Tan	None	0	N/A	N/A
8300	1	B830001-1	2	214B	Primary	Classroom 220 Right Closet	yes	W2	CMU	Tan	None	0	0.05	Negative
8300	1	B830001-1	2	214B	Primary	Classroom 220 Right Closet	yes	W3	CMU	Tan	None	0	0	Negative
8300	1	B830001-1	2	214B	Primary	Classroom 220 Right Closet	yes	Shelf	Wood	Green	Friction	2	0	Negative
8300	1	B830001-1	2	214B	Primary	Classroom 220 Right Closet	yes	W4	CMU	Tan	None	0	0	Negative
8300	1	B830001-1	2	214B	Primary	Classroom 220 Right Closet	yes	Ceiling	Concrete	White	None	0	0	Negative
8300	1	B830001-1	2	214B	Primary	Classroom 220 Right Closet	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	2	215	Primary	Classroom 221	yes	W1	CMU	Tan	Chipping	1	0.08	Negative
8300	1	B830001-1	2	215	Primary	Classroom 221	yes	W2	Drywall	Tan	Chipping	2	0	Negative
8300	1	B830001-1	2	215	Primary	Classroom 221	yes	W3	CMU	Tan	Chipping	2	0	Negative
8300	1	B830001-1	2	215	Primary	Classroom 221	yes	Univent	Metal	Tan	Chipping	2	0.14	Negative
8300	1	B830001-1	2	215	Primary	Classroom 221	yes	W4	Drywall	Tan	Chipping	5	0	Negative
8300	1	B830001-1	2	215	Primary	Classroom 221	yes	Ceiling	Concrete	White	None	0	0	Negative
8300	1	B830001-1	2	215	Primary	Classroom 221	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	2	215	Primary	Classroom 221	yes	Baseboard	Transite	Tan	Chipping	10	0.05	Negative
8300	1	B830001-1	2	215B	Storage	Classroom 221 Closet	yes	W1	CMU	Tan	None	0	N/A	N/A
8300	1	B830001-1	2	215B	Storage	Classroom 221 Closet	yes	W2	CMU	Tan	None	0	0	Negative
8300	1	B830001-1	2	215B	Storage	Classroom 221 Closet	yes	W3	CMU	Tan	None	0	0	Negative
8300	1	B830001-1	2	215B	Storage	Classroom 221 Closet	yes	Shelf	Wood	White	Friction	2	0.1	Negative
8300	1	B830001-1	2	215B	Storage	Classroom 221 Closet	yes	W4	CMU	Tan	None	0	0	Negative
8300	1	B830001-1	2	215B	Storage	Classroom 221 Closet	yes	Ceiling	Concrete	White	None	0	0.05	Negative

					Inspection Dates: 01/19/22									
					Inspector Name and Certificate Number: Ryan Hutsell PA RA:059512			Lead Safe Certification Assessment Report						
					Inspection Company: Synertech			Mayfair School						
ULCS #	Element	BldgElmt ID	Floor	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
8300	1	B830001-1	2	215B	Storage	Classroom 221 Closet	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	2	215A	Primary	Classroom 222	yes	W1	Drywall	Tan	Chipping	3	0	Negative
8300	1	B830001-1	2	215A	Primary	Classroom 222	yes	W1	CMU	Tan	Chipping	3	0.02	Negative
8300	1	B830001-1	2	215A	Primary	Classroom 222	yes	W2	CMU	Tan	Chipping	2	0	Negative
8300	1	B830001-1	2	215A	Primary	Classroom 222	yes	W3	CMU	Tan	Chipping	2	0.06	Negative
8300	1	B830001-1	2	215A	Primary	Classroom 222	yes	Univent	Metal	Tan	Chipping	3	0.12	Negative
8300	1	B830001-1	2	215A	Primary	Classroom 222	yes	W4	Drywall	Tan	Chipping	2	0	Negative
8300	1	B830001-1	2	215A	Primary	Classroom 222	yes	Ceiling	Concrete	White	Flaking	10	0.06	Negative
8300	1	B830001-1	2	215A	Primary	Classroom 222	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	2	H23	Circulation (Hallway)	Hallway from Office 200 to Classroom 217	yes	W1	CMU	Tan	None	0	N/A	N/A
8300	1	B830001-1	2	H23	Circulation (Hallway)	Hallway from Office 200 to Classroom 217	yes	W2	CMU	Tan	Chipping	6	0	Negative
8300	1	B830001-1	2	H23	Circulation (Hallway)	Hallway from Office 200 to Classroom 217	yes	Door Frame	Metal	Tan	Friction	1	0.2	Negative
8300	1	B830001-1	2	H23	Circulation (Hallway)	Hallway from Office 200 to Classroom 217	yes	Door Frame	Metal	Black	Friction	1	0.23	Negative
8300	1	B830001-1	2	H23	Circulation (Hallway)	Hallway from Office 200 to Classroom 217	yes	Door Frame	Metal	Tan	Friction	1	0.15	Negative
8300	1	B830001-1	2	H23	Circulation (Hallway)	Hallway from Office 200 to Classroom 217	yes	Electric Panel	Metal	Grey	Chipping	1	0	Negative
8300	1	B830001-1	2	H23	Circulation (Hallway)	Hallway from Office 200 to Classroom 217	yes	Fire Extinguisher Bracket	Wood	White	Chipping	1	0	Negative
8300	1	B830001-1	2	H23	Circulation (Hallway)	Hallway from Office 200 to Classroom 217	yes	Door Frame	Metal	Tan	Chipping	1	0.26	Negative
8300	1	B830001-1	2	H23	Circulation (Hallway)	Hallway from Office 200 to Classroom 217	yes	W3	CMU	Tan	Chipping	8	0	Negative
8300	1	B830001-1	2	H23	Circulation (Hallway)	Hallway from Office 200 to Classroom 217	yes	W4	CMU	Tan	Chipping	1	0	Negative
8300	1	B830001-1	2	H23	Circulation (Hallway)	Hallway from Office 200 to Classroom 217	yes	Door Frame	Metal	Brown	Chipping	1	0.12	Negative
8300	1	B830001-1	2	H23	Circulation (Hallway)	Hallway from Office 200 to Classroom 217	yes	Door	Metal	Brown	Chipping	1	0	Negative
8300	1	B830001-1	2	H23	Circulation (Hallway)	Hallway from Office 200 to Classroom 217	yes	Water Fountain	Metal	Tan	Chipping	1	0	Negative
8300	1	B830001-1	2	H23	Circulation (Hallway)	Hallway from Office 200 to Classroom 217	yes	Door Frame	Metal	Tan	Chipping	1	0.17	Negative
8300	1	B830001-1	2	H23	Circulation (Hallway)	Hallway from Office 200 to Classroom 217	yes	Fire Extinguisher Bracket	Wood	White	Chipping	1	0	Negative
8300	1	B830001-1	2	H23	Circulation (Hallway)	Hallway from Office 200 to Classroom 217	yes	Ceiling	Plaster	White	None	0	N/A	N/A

					Inspection Dates: 01/19/22									
					Inspector Name and Certificate Number: Ryan Hutsell PA RA:059512			Lead Safe Certification Assessment Report						
					Inspection Company: Synertech			Mayfair School						
ULCS #	Element	BldgElmt ID	Floor	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
8300	1	B830001-1	2	H23	Circulation (Hallway)	Hallway from Office 200 to Classroom 217	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	2	215A	Primary	Classroom 222	yes	Baseboard	Transite	Tan	Chipping	10	0	Negative
8300	1	B830001-1	2	H24	Circulation (Hallway)	Hallway near Classrooms 218 to 222	yes	W1	CMU	Tan	None	0	0	Negative
8300	1	B830001-1	2	H24	Circulation (Hallway)	Hallway near Classrooms 218 to 222	yes	Door Frame	Metal	Grey	Friction	1	0.12	Negative
8300	1	B830001-1	2	H24	Circulation (Hallway)	Hallway near Classrooms 218 to 222	yes	Bulletin Board Frame	Wood	White	Chipping	1	0.15	Negative
8300	1	B830001-1	2	H24	Circulation (Hallway)	Hallway near Classrooms 218 to 222	yes	W2	CMU	Tan	None	0	0	Negative
8300	1	B830001-1	2	H24	Circulation (Hallway)	Hallway near Classrooms 218 to 222	yes	W3	CMU	Tan	None	0	0.04	Negative
8300	1	B830001-1	2	H24	Circulation (Hallway)	Hallway near Classrooms 218 to 222	yes	W4	CMU	Tan	None	0	0	Negative
8300	1	B830001-1	2	H24	Circulation (Hallway)	Hallway near Classrooms 218 to 222	yes	Door Frame	Metal	Brown	Chipping	3	0	Negative
8300	1	B830001-1	2	H24	Circulation (Hallway)	Hallway near Classrooms 218 to 222	yes	Door	Metal	Brown	Chipping	5	0	Negative
8300	1	B830001-1	2	H24	Circulation (Hallway)	Hallway near Classrooms 218 to 222	yes	Push Bar	Metal	Grey	Friction	2	0	Negative
8300	1	B830001-1	2	H24	Circulation (Hallway)	Hallway near Classrooms 218 to 222	yes	Ceiling	Plaster	White	None	0	0.02	Negative
8300	1	B830001-1	2	H24	Circulation (Hallway)	Hallway near Classrooms 218 to 222	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	2	S22	Stairs	Stairs next to Classroom 211	yes	W1	CMU	White	Chipping	2	0.15	Negative
8300	1	B830001-1	2	S22	Stairs	Stairs next to Classroom 211	yes	W2	CMU	White	Chipping	2	0	Negative
8300	1	B830001-1	2	S22	Stairs	Stairs next to Classroom 211	yes	W3	CMU	White	Chipping	2	0.06	Negative
8300	1	B830001-1	2	S22	Stairs	Stairs next to Classroom 211	yes	W4	CMU	White	Chipping	2	0.2	Negative
8300	1	B830001-1	2	S22	Stairs	Stairs next to Classroom 211	yes	Ceiling	Concrete	White	None	0	N/A	N/A
8300	1	B830001-1	2	S22	Stairs	Stairs next to Classroom 211	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	2	S22	Stairs	Stairs next to Classroom 211	yes	Baluster	Metal	Black	Friction	5	0.15	Negative
8300	1	B830001-1	2	S22	Stairs	Stairs next to Classroom 211	yes	Stair Stringer	Metal	Black	Friction	2	0.16	Negative
8300	1	B830001-1	2	S22	Stairs	Stairs next to Classroom 211	yes	Stair Risers	Metal	Black	Friction	6	0.34	Negative
8300	1	B830001-1	2	S22	Stairs	Stairs next to Classroom 211	yes	Newel Post	Metal	Black	Friction	2	0.28	Negative
8300	1	B830001-1	2	S23	Stairs	Stairs near Classroom 203	yes	W1	CMU	White	Chipping	2	0.1	Negative
8300	1	B830001-1	2	S23	Stairs	Stairs near Classroom 203	yes	W2	CMU	White	Chipping	2	0.04	Negative
8300	1	B830001-1	2	S23	Stairs	Stairs near Classroom 203	yes	W3	CMU	White	Chipping	2	0	Negative
8300	1	B830001-1	2	S23	Stairs	Stairs near Classroom 203	yes	W4	CMU	White	Chipping	2	0	Negative
8300	1	B830001-1	2	S23	Stairs	Stairs near Classroom 203	yes	Ceiling	Concrete	White	None	0	N/A	N/A
8300	1	B830001-1	2	S23	Stairs	Stairs near Classroom 203	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	2	S23	Stairs	Stairs near Classroom 203	yes	Baluster	Metal	Black	Friction	2	0.35	Negative
8300	1	B830001-1	2	S23	Stairs	Stairs near Classroom 203	yes	Stair Stringer	Metal	Black	Friction	4	0.24	Negative
8300	1	B830001-1	2	S23	Stairs	Stairs near Classroom 203	yes	Stair Risers	Metal	Black	Friction	10	0.2	Negative

					Inspection Dates: 01/19/22			Lead Safe Certification Assessment Report						
					Inspector Name and Certificate Number: Ryan Hutsell PA RA:059512			Mayfair School						
					Inspection Company: Synertech									
ULCS #	Element	BldgElmt ID	Floor	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
8300	1	B830001-1	2	S23	Stairs	Stairs near Classroom 203	yes	Newel Post	Metal	Black	Friction	2	0.18	Negative
8300	1	B830001-1	2	S24	Stairs	Stairs next to Classroom 222	yes	W1	CMU	White	Chipping	2	0	Negative
8300	1	B830001-1	2	S24	Stairs	Stairs next to Classroom 222	yes	W2	CMU	White	Chipping	2	0	Negative
8300	1	B830001-1	2	S24	Stairs	Stairs next to Classroom 222	yes	W3	CMU	White	Chipping	2	0.08	Negative
8300	1	B830001-1	2	S24	Stairs	Stairs next to Classroom 222	yes	W4	CMU	White	Chipping	2	0.12	Negative
8300	1	B830001-1	2	S24	Stairs	Stairs next to Classroom 222	yes	Ceiling	Concrete	White	None	0	N/A	N/A
8300	1	B830001-1	2	S24	Stairs	Stairs next to Classroom 222	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	B	B830001-1	1	FR1	Fan Room	Fan Room accessed from Main Office Hallway	no	W1	CMU	White	None	0	0	Negative
8300	B	B830001-1	1	FR1	Fan Room	Fan Room accessed from Main Office Hallway	no	Door Frame	Metal	Green	Chipping	1	0.4	Negative
8300	B	B830001-1	1	FR1	Fan Room	Fan Room accessed from Main Office Hallway	yes	Door	Metal	Green	Chipping	1	5.2	Positive
8300	B	B830001-1	1	FR1	Fan Room	Fan Room accessed from Main Office Hallway	no	W2	CMU	White	None	0	0	Negative
8300	B	B830001-1	1	FR1	Fan Room	Fan Room accessed from Main Office Hallway	no	W3	CMU	White	None	0	0	Negative
8300	B	B830001-1	1	FR1	Fan Room	Fan Room accessed from Main Office Hallway	no	W4	CMU	White	None	0	0	Negative
8300	B	B830001-1	1	FR1	Fan Room	Fan Room accessed from Main Office Hallway	no	Ceiling	Concrete	White	None	0	N/A	N/A
8300	B	B830001-1	1	FR1	Fan Room	Fan Room accessed from Main Office Hallway	no	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	2	S24	Stairs	Stairs next to Classroom 222	yes	Baluster	Metal	Black	Friction	3	0.16	Negative
8300	1	B830001-1	2	S24	Stairs	Stairs next to Classroom 222	yes	Stair Stringer	Metal	Black	Friction	2	0.19	Negative
8300	1	B830001-1	2	S24	Stairs	Stairs next to Classroom 222	yes	Stair Risers	Metal	Black	Friction	2	0.24	Negative
8300	1	B830001-1	2	S24	Stairs	Stairs next to Classroom 222	yes	Newel Post	Metal	Black	Friction	2	0.25	Negative
8300	1	B830001-1	B	3	Boiler Room	Boiler Room	no	W1	Brick	White	Flaking	200	0.1	Negative
8300	1	B830001-1	B	3	Boiler Room	Boiler Room	no	W1	Brick	Grey	Flaking	100	0.06	Negative
8300	1	B830001-1	B	3	Boiler Room	Boiler Room	no	W1	Concrete	White	Flaking	200	0	Negative
8300	1	B830001-1	B	3	Boiler Room	Boiler Room	no	W1	Concrete	Grey	Flaking	100	0.12	Negative
8300	1	B830001-1	B	3	Boiler Room	Boiler Room	no	Door Frame	Metal	Green	Flaking	3	0.25	Negative
8300	1	B830001-1	B	3	Boiler Room	Boiler Room	no	Door	Metal	Green	Flaking	3	6.2	Positive
8300	1	B830001-1	B	3	Boiler Room	Boiler Room	no	Sink	Metal	White	Flaking	2	0.2	Negative
8300	1	B830001-1	B	3	Boiler Room	Boiler Room	no	Hand Rail	Metal	Grey	Flaking	8	0.4	Negative
8300	1	B830001-1	B	3	Boiler Room	Boiler Room	no	W2	Brick	White	Flaking	200	0	Negative
8300	1	B830001-1	B	3	Boiler Room	Boiler Room	no	W2	Brick	Grey	Flaking	100	0.15	Negative
8300	1	B830001-1	B	3	Boiler Room	Boiler Room	no	W2	Concrete	White	Flaking	200	0.06	Negative
8300	1	B830001-1	B	3	Boiler Room	Boiler Room	no	W2	Concrete	Grey	Flaking	100	0	Negative
8300	1	B830001-1	B	3	Boiler Room	Boiler Room	no	Door Frame	Metal	Green	Flaking	3	0.32	Negative
8300	1	B830001-1	B	3	Boiler Room	Boiler Room	no	Door	Metal	Green	Flaking	3	4.5	Positive
8300	1	B830001-1	B	3	Boiler Room	Boiler Room	no	W3	Brick	White	Flaking	200	0	Negative
8300	1	B830001-1	B	3	Boiler Room	Boiler Room	no	W3	Brick	Grey	Flaking	100	0.23	Negative
8300	1	B830001-1	B	3	Boiler Room	Boiler Room	no	W3	Concrete	White	Flaking	200	0.08	Negative

					Inspection Dates: 01/19/22									
					Inspector Name and Certificate Number: Ryan Hutsell PA RA:059512			Lead Safe Certification Assessment Report						
					Inspection Company: Synertech			Mayfair School						
ULCS #	Element	BldgElmt ID	Floor	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
8300	1	B830001-1	B	3	Boiler Room	Boiler Room	no	W3	Concrete	Grey	Flaking	100	0.15	Negative
8300	1	B830001-1	B	3	Boiler Room	Boiler Room	no	Door Frame	Metal	Green	Flaking	3	0.3	Negative
8300	1	B830001-1	B	3	Boiler Room	Boiler Room	no	Door	Metal	Green	Flaking	3	5.1	Positive
8300	1	B830001-1	B	3	Boiler Room	Boiler Room	no	W4	Brick	White	Flaking	200	0.16	Negative
8300	1	B830001-1	B	3	Boiler Room	Boiler Room	no	W4	Brick	Grey	Flaking	100	0.1	Negative
8300	1	B830001-1	B	3	Boiler Room	Boiler Room	no	W4	Concrete	White	Flaking	200	0	Negative
8300	1	B830001-1	B	3	Boiler Room	Boiler Room	no	W4	Concrete	Grey	Flaking	100	0.21	Negative
8300	1	B830001-1	B	3	Boiler Room	Boiler Room	no	Door Frame	Metal	Green	Flaking	3	0.2	Negative
8300	1	B830001-1	B	3	Boiler Room	Boiler Room	no	Door	Metal	Green	Flaking	3	3.9	Positive
8300	1	B830001-1	B	3	Boiler Room	Boiler Room	no	Ceiling	Concrete	White	Flaking	400	0.24	Negative
8300	1	B830001-1	B	3	Boiler Room	Boiler Room	no	Ductwork	Metal	Silver	Chipping	20	0.4	Negative
8300	1	B830001-1	B	3	Boiler Room	Boiler Room	no	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	B	3	Boiler Room	Boiler Room	no	Columns	Concrete	White	Flaking	50	0.4	Negative
8300	1	B830001-1	B	3	Boiler Room	Boiler Room	no	Columns	Concrete	Green	Flaking	50	3.2	Positive
8300	1	B830001-1	B	3	Boiler Room	Boiler Room	no	Boiler	Metal	Silver	Chipping	20	0.2	Negative
8300	1	B830001-1	B	3	Boiler Room	Boiler Room	no	Tank	Metal	Blue	Flaking	8	0.28	Negative
8300	1	B830001-1	B	4	Mechanical Room	Incinerator Room	no	W1	Brick	Green	Chipping	6	0	Negative
8300	1	B830001-1	B	4	Mechanical Room	Incinerator Room	no	W2	Concrete	Green	Chipping	10	0	Negative
8300	1	B830001-1	B	4	Mechanical Room	Incinerator Room	no	W3	Brick	Green	Chipping	12	0	Negative
8300	1	B830001-1	B	3	Boiler Room	Boiler Room	no	Door Frame	Metal	Grey	Chipping	2	0.31	Negative
8300	1	B830001-1	B	3	Boiler Room	Boiler Room	no	Door	Metal	Grey	Chipping	2	5.5	Positive
8300	1	B830001-1	B	4	Mechanical Room	Incinerator Room	no	W4	Concrete	Green	Chipping	8	0	Negative
8300	1	B830001-1	B	4	Mechanical Room	Incinerator Room	no	Ceiling	Concrete	White	Flaking	10	0	Negative
8300	1	B830001-1	B	4	Mechanical Room	Incinerator Room	no	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	B	5	Electrical Room	Electrical Room	no	W1	Brick	White	Chipping	10	0.1	Negative
8300	1	B830001-1	B	5	Electrical Room	Electrical Room	no	Door Frame	Metal	Green	Chipping	2	0.3	Negative
8300	1	B830001-1	B	5	Electrical Room	Electrical Room	no	Door	Metal	Green	Chipping	2	6.1	Positive
8300	1	B830001-1	B	5	Electrical Room	Electrical Room	no	W2	Concrete	White	Chipping	10	0	Negative
8300	1	B830001-1	B	5	Electrical Room	Electrical Room	no	W3	Concrete	White	Chipping	10	0.12	Negative
8300	1	B830001-1	B	5	Electrical Room	Electrical Room	no	Panel	Wood	White	Cracking	8	0	Negative
8300	1	B830001-1	B	5	Electrical Room	Electrical Room	no	W4	Brick	White	Chipping	10	0.08	Negative
8300	1	B830001-1	B	5	Electrical Room	Electrical Room	no	Ceiling	Concrete	White	Holes	5	0	Negative
8300	1	B830001-1	B	5	Electrical Room	Electrical Room	no	Transformer Box	Metal	Black	Chipping	5	0.2	Negative
8300	1	B830001-1	B	5	Electrical Room	Electrical Room	no	Conduit	Metal	White	Chipping	5	0.1	Negative
8300	1	B830001-1	B	5	Electrical Room	Electrical Room	no	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	B	6	Administrative Office	Building Engineer's Office	no	W1	Brick	White	Chipping	5	0.05	Negative
8300	1	B830001-1	B	6	Administrative Office	Building Engineer's Office	no	Door Frame	Metal	Green	Chipping	2	0.25	Negative
8300	1	B830001-1	B	6	Administrative Office	Building Engineer's Office	no	Door	Metal	Green	Chipping	2	4.8	Positive
8300	1	B830001-1	B	6	Administrative Office	Building Engineer's Office	no	W2	Brick	White	Chipping	4	0	Negative



					Inspection Dates: 01/19/22									
					Inspector Name and Certificate Number: Ryan Hutsell PA RA:059512			Lead Safe Certification Assessment Report						
					Inspection Company: Synertech			Mayfair School						
ULCS #	Element	BldgElmt ID	Floor	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
8300	1	B830001-1	B	6	Administrative Office	Building Engineer's Office	no	Coat Rack	Wood	White	Friction	1	0.1	Negative
8300	1	B830001-1	B	6	Administrative Office	Building Engineer's Office	no	W3	CMU	White	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	B	6	Administrative Office	Building Engineer's Office	no	W3	Concrete	White	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	B	6	Administrative Office	Building Engineer's Office	no	W4	Brick	White	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	B	6	Administrative Office	Building Engineer's Office	no	Ceiling	Concrete	White	Holes	4	0	Negative
8300	1	B830001-1	B	6	Administrative Office	Building Engineer's Office	no	Floor	Concrete	Grey	Chipping	100	0	Negative
8300	1	B830001-1	B	6A	Restrooms, Staff - Male/Female	Building Engineer's Office Restroom	no	W1	CMU	White	None	0	N/A	N/A
8300	1	B830001-1	B	6A	Restrooms, Staff - Male/Female	Building Engineer's Office Restroom	no	W2	CMU	White	None	0	N/A	N/A
8300	1	B830001-1	B	6A	Restrooms, Staff - Male/Female	Building Engineer's Office Restroom	no	W3	Brick	White	None	0	N/A	N/A
8300	1	B830001-1	B	6A	Restrooms, Staff - Male/Female	Building Engineer's Office Restroom	no	W4	Concrete	White	Flaking	2	0	Negative
8300	1	B830001-1	B	6A	Restrooms, Staff - Male/Female	Building Engineer's Office Restroom	no	Ceiling	Concrete	White	None	0	N/A	N/A
8300	1	B830001-1	B	6A	Restrooms, Staff - Male/Female	Building Engineer's Office Restroom	no	Floor	Concrete	Grey	Chipping	40	0.04	Negative
8300	1	B830001-1	B	7	Storage	Storage Room / Staff Lounge at Basement Stair to Exterior	no	W1	Brick	Green	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	B	7	Storage	Storage Room / Staff Lounge at Basement Stair to Exterior	no	Door Frame	Metal	Green	Chipping	2	0.23	Negative
8300	1	B830001-1	B	7	Storage	Storage Room / Staff Lounge at Basement Stair to Exterior	no	Door	Metal	Green	Chipping	2	6.1	Positive
8300	1	B830001-1	B	7	Storage	Storage Room / Staff Lounge at Basement Stair to Exterior	no	W2	Brick	Green	Partially Inaccessible	0	0	Negative
8300	1	B830001-1	B	7	Storage	Storage Room / Staff Lounge at Basement Stair to Exterior	no	W3	Concrete	Green	Partially Inaccessible	0	0.1	Negative
8300	1	B830001-1	B	7	Storage	Storage Room / Staff Lounge at Basement Stair to Exterior	no	W4	Brick	Green	Partially Inaccessible	0	0.04	Negative
8300	1	B830001-1	B	7	Storage	Storage Room / Staff Lounge at Basement Stair to Exterior	no	Ceiling	Concrete	White	None	0	N/A	N/A
8300	1	B830001-1	B	7	Storage	Storage Room / Staff Lounge at Basement Stair to Exterior	no	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	B	H001	Circulation (Hallway)	Hallway from Storage Room to Ash Room	no	W1	Concrete	White	Chipping	10	0	Negative
8300	1	B830001-1	B	H001	Circulation (Hallway)	Hallway from Storage Room to Ash Room	no	W2	Brick	White	Chipping	10	0	Negative

					Inspection Dates: 01/19/22									
					Inspector Name and Certificate Number: Ryan Hutsell PA RA:059512			Lead Safe Certification Assessment Report						
					Inspection Company: Synertech			Mayfair School						
ULCS #	Element	BldgElmt ID	Floor	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
8300	1	B830001-1	B	H001	Circulation (Hallway)	Hallway from Storage Room to Ash Room	no	W3	Concrete	White	Chipping	10	0	Negative
8300	1	B830001-1	B	H001	Circulation (Hallway)	Hallway from Storage Room to Ash Room	no	Door Frame	Metal	Green	Chipping	2	0.23	Negative
8300	1	B830001-1	B	H001	Circulation (Hallway)	Hallway from Storage Room to Ash Room	no	Door	Metal	Green	Chipping	2	6.1	Positive
8300	1	B830001-1	B	H001	Circulation (Hallway)	Hallway from Storage Room to Ash Room	no	W4	Brick	White	Chipping	10	0	Negative
8300	1	B830001-1	B	H001	Circulation (Hallway)	Hallway from Storage Room to Ash Room	no	Ceiling	Concrete	White	None	0	N/A	N/A
8300	1	B830001-1	B	H001	Circulation (Hallway)	Hallway from Storage Room to Ash Room	no	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	B	S001	Stairs	Stairs next to Ash Room leading to Outside	no	W1	Concrete	White	Chipping	10	0.1	Negative
8300	1	B830001-1	B	S001	Stairs	Stairs next to Ash Room leading to Outside	no	Door Frame	Metal	Green	Chipping	2	0.18	Negative
8300	1	B830001-1	B	S001	Stairs	Stairs next to Ash Room leading to Outside	no	Door	Metal	Green	Chipping	2	6.2	Positive
8300	1	B830001-1	B	S001	Stairs	Stairs next to Ash Room leading to Outside	no	W2	Concrete	White	Chipping	12	0	Negative
8300	1	B830001-1	B	S001	Stairs	Stairs next to Ash Room leading to Outside	no	W3	Concrete	White	Chipping	20	0.08	Negative
8300	1	B830001-1	B	S001	Stairs	Stairs next to Ash Room leading to Outside	no	Door Frame	Metal	Brown	Chipping	2	0	Negative
8300	1	B830001-1	B	S001	Stairs	Stairs next to Ash Room leading to Outside	no	Door	Metal	Brown	Chipping	2	0	Negative
8300	1	B830001-1	B	S001	Stairs	Stairs next to Ash Room leading to Outside	no	W4	Concrete	White	Chipping	10	0	Negative
8300	1	B830001-1	B	S001	Stairs	Stairs next to Ash Room leading to Outside	no	Ceiling	Concrete	White	None	0	N/A	N/A
8300	1	B830001-1	B	S001	Stairs	Stairs next to Ash Room leading to Outside	no	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	B	S004	Stairs	Stairs Next to Boiler Storage Room	no	W1	Brick	White	Flaking	30	0	Negative
8300	1	B830001-1	B	S004	Stairs	Stairs Next to Boiler Storage Room	no	Hand Rail	Metal	Black	Friction	4	0.4	Negative
8300	1	B830001-1	B	S004	Stairs	Stairs Next to Boiler Storage Room	no	Door Frame	Metal	Green	Chipping	2	0.2	Negative
8300	1	B830001-1	B	S004	Stairs	Stairs Next to Boiler Storage Room	no	Door	Metal	Green	Chipping	2	1	Positive
8300	1	B830001-1	B	S004	Stairs	Stairs Next to Boiler Storage Room	no	W2	Concrete	White	Flaking	25	0.1	Negative
8300	1	B830001-1	B	S004	Stairs	Stairs Next to Boiler Storage Room	no	Door Frame	Metal	Brown	Chipping	2	0.08	Negative

					Inspection Dates: 01/19/22									
					Inspector Name and Certificate Number: Ryan Hutsell PA RA:059512			Lead Safe Certification Assessment Report						
					Inspection Company: Synertech			Mayfair School						
ULCS #	Element	BldgElmt ID	Floor	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
8300	1	B830001-1	B	S004	Stairs	Stairs Next to Boiler Storage Room	no	Door	Metal	Brown	Chipping	2	0.08	Negative
8300	1	B830001-1	B	S004	Stairs	Stairs Next to Boiler Storage Room	no	W3	Concrete	White	Flaking	20	0.06	Negative
8300	1	B830001-1	B	S004	Stairs	Stairs Next to Boiler Storage Room	no	Hand Rail	Metal	Black	Chipping	2	0.45	Negative
8300	1	B830001-1	B	S004	Stairs	Stairs Next to Boiler Storage Room	no	Door Frame	Metal	Brown	Flaking	4	0.28	Negative
8300	1	B830001-1	B	S004	Stairs	Stairs Next to Boiler Storage Room	no	Door	Metal	White	Flaking	12	4.2	Positive
8300	1	B830001-1	B	S004	Stairs	Stairs Next to Boiler Storage Room	no	W4	Concrete	White	Flaking	20	0	Negative
8300	1	B830001-1	B	S004	Stairs	Stairs Next to Boiler Storage Room	no	Ceiling	Concrete	White	None	0	0	Negative
8300	1	B830001-1	B	S004	Stairs	Stairs Next to Boiler Storage Room	no	Stair Soffit	Metal	White	Flaking	50	0.21	Negative
8300	1	B830001-1	B	S004	Stairs	Stairs Next to Boiler Storage Room	no	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	B	H009	Circulation (Hallway)	Hallway from Custodial Break Room to Boiler Room	no	W1	Brick	White	None	0	N/A	N/A
8300	1	B830001-1	B	H009	Circulation (Hallway)	Hallway from Custodial Break Room to Boiler Room	no	Door Frame	Metal	Green	Chipping	4	0.25	Negative
8300	1	B830001-1	B	H009	Circulation (Hallway)	Hallway from Custodial Break Room to Boiler Room	no	Door	Metal	Green	Chipping	4	5.1	Positive
8300	1	B830001-1	B	H009	Circulation (Hallway)	Hallway from Custodial Break Room to Boiler Room	no	W2	Brick	White	Flaking	80	0.15	Negative
8300	1	B830001-1	B	H009	Circulation (Hallway)	Hallway from Custodial Break Room to Boiler Room	no	Door Frame	Metal	Green	Chipping	4	0.2	Negative
8300	1	B830001-1	B	H009	Circulation (Hallway)	Hallway from Custodial Break Room to Boiler Room	no	Door	Metal	Green	Chipping	4	5.6	Positive
8300	1	B830001-1	B	H009	Circulation (Hallway)	Hallway from Custodial Break Room to Boiler Room	no	W3	Brick	White	None	0	N/A	N/A
8300	1	B830001-1	B	H009	Circulation (Hallway)	Hallway from Custodial Break Room to Boiler Room	no	Door Frame	Metal	Green	Chipping	4	0.26	Negative
8300	1	B830001-1	B	H009	Circulation (Hallway)	Hallway from Custodial Break Room to Boiler Room	no	Door	Metal	Green	Chipping	4	5.8	Positive
8300	1	B830001-1	B	H009	Circulation (Hallway)	Hallway from Custodial Break Room to Boiler Room	no	W4	Concrete	White	Flaking	60	0.12	Negative
8300	1	B830001-1	B	H009	Circulation (Hallway)	Hallway from Custodial Break Room to Boiler Room	no	Ceiling	Concrete	White	None	0	N/A	N/A
8300	1	B830001-1	B	H009	Circulation (Hallway)	Hallway from Custodial Break Room to Boiler Room	no	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	A	AT	Attic	Attic- Fan Room Behind stage	no	W1	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	A	AT	Attic	Attic- Fan Room Behind stage	no	W2	N/A	N/A	N/A	N/A	N/A	N/A

					Inspection Dates: 01/19/22									
					Inspector Name and Certificate Number: Ryan Hutsell PA RA:059512			Lead Safe Certification Assessment Report						
					Inspection Company: Synertech			Mayfair School						
ULCS #	Element	BldgElmt ID	Floor	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
8300	1	B830001-1	A	AT	Attic	Attic- Fan Room Behind stage	no	W3	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	A	AT	Attic	Attic- Fan Room Behind stage	no	W4	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	A	AT	Attic	Attic- Fan Room Behind stage	no	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	A	AT	Attic	Attic- Fan Room Behind stage	no	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	C	CS1	Crawl Space	Crawl Space-Fan Room in Main Office Hallway along back wall	no	W1	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	C	CS1	Crawl Space	Crawl Space-Fan Room in Main Office Hallway along back wall	no	W2	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	C	CS1	Crawl Space	Crawl Space-Fan Room in Main Office Hallway along back wall	no	W3	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	C	CS1	Crawl Space	Crawl Space-Fan Room in Main Office Hallway along back wall	no	W4	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	C	CS1	Crawl Space	Crawl Space-Fan Room in Main Office Hallway along back wall	no	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	C	CS1	Crawl Space	Crawl Space-Fan Room in Main Office Hallway along back wall	no	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	C	CS2	Crawl Space	Crawl Space- Boiler Room Exit to Parkng Lot	no	W1	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	C	CS2	Crawl Space	Crawl Space- Boiler Room Exit to Parkng Lot	no	W2	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	C	CS2	Crawl Space	Crawl Space- Boiler Room Exit to Parkng Lot	no	W3	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	C	CS2	Crawl Space	Crawl Space- Boiler Room Exit to Parkng Lot	no	W4	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	C	CS2	Crawl Space	Crawl Space- Boiler Room Exit to Parkng Lot	no	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	C	CS2	Crawl Space	Crawl Space- Boiler Room Exit to Parkng Lot	no	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	C	CS3	Crawl Space	Crawl Space-Boiler Room Above Sump	no	W1	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	C	CS3	Crawl Space	Crawl Space-Boiler Room Above Sump	no	W2	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	C	CS3	Crawl Space	Crawl Space-Boiler Room Above Sump	no	W3	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	C	CS3	Crawl Space	Crawl Space-Boiler Room Above Sump	no	W4	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	C	CS3	Crawl Space	Crawl Space-Boiler Room Above Sump	no	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	C	CS3	Crawl Space	Crawl Space-Boiler Room Above Sump	no	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	C	CS4	Crawl Space	Crawl Space -Entrance to Basement	no	W1	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	C	CS4	Crawl Space	Crawl Space -Entrance to Basement	no	W2	N/A	N/A	N/A	N/A	N/A	N/A

					Inspection Dates: 01/19/22									
					Inspector Name and Certificate Number: Ryan Hutsell PA RA:059512			Lead Safe Certification Assessment Report						
					Inspection Company: Synertech			Mayfair School						
ULCS #	Element	BldgElmt ID	Floor	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
8300	1	B830001-1	C	CS4	Crawl Space	Crawl Space -Entrance to Basement	no	W3	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	C	CS4	Crawl Space	Crawl Space -Entrance to Basement	no	W4	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	C	CS4	Crawl Space	Crawl Space -Entrance to Basement	no	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
8300	1	B830001-1	C	CS4	Crawl Space	Crawl Space -Entrance to Basement	no	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	1	H1	Circulation (Hallway)	1st Floor Hallway next to Classrooms 303 to Staff Restroom	yes	W1	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	1	H1	Circulation (Hallway)	1st Floor Hallway next to Classrooms 303 to Staff Restroom	yes	W2	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	1	H1	Circulation (Hallway)	1st Floor Hallway next to Classrooms 303 to Staff Restroom	yes	W3	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	1	H1	Circulation (Hallway)	1st Floor Hallway next to Classrooms 303 to Staff Restroom	yes	W4	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	1	H1	Circulation (Hallway)	1st Floor Hallway next to Classrooms 303 to Staff Restroom	yes	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	1	H1	Circulation (Hallway)	1st Floor Hallway next to Classrooms 303 to Staff Restroom	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	1	13	Restrooms, Staff - Male/Female	Staff Restroom next to Elevator	yes	W1	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	1	13	Restrooms, Staff - Male/Female	Staff Restroom next to Elevator	yes	W2	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	1	13	Restrooms, Staff - Male/Female	Staff Restroom next to Elevator	yes	W3	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	1	13	Restrooms, Staff - Male/Female	Staff Restroom next to Elevator	yes	W4	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	1	13	Restrooms, Staff - Male/Female	Staff Restroom next to Elevator	yes	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	1	13	Restrooms, Staff - Male/Female	Staff Restroom next to Elevator	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	1	X	Elevators, Passenger	Elevator	yes	W1	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	1	X	Elevators, Passenger	Elevator	yes	W2	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	1	X	Elevators, Passenger	Elevator	yes	W3	N/A	N/A	N/A	N/A	N/A	N/A

					Inspection Dates: 01/19/22									
					Inspector Name and Certificate Number: Ryan Hutsell PA RA:059512			Lead Safe Certification Assessment Report						
					Inspection Company: Synertech			Mayfair School						
ULCS #	Element	BldgElmt ID	Floor	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
8300	2	B830001-2	1	X	Elevators, Passenger	Elevator	yes	W4	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	1	X	Elevators, Passenger	Elevator	yes	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	1	X	Elevators, Passenger	Elevator	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	1	S10	Stairs	Stairwell next to Classroom 306	yes	W1	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	1	S10	Stairs	Stairwell next to Classroom 306	yes	W2	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	1	S10	Stairs	Stairwell next to Classroom 306	yes	W3	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	1	S10	Stairs	Stairwell next to Classroom 306	yes	W4	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	1	S10	Stairs	Stairwell next to Classroom 306	yes	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	1	S10	Stairs	Stairwell next to Classroom 306	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	1	12	Student Restrooms - Female (4-12)	Girl's Restroom near Classroom 306	yes	W1	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	1	12	Student Restrooms - Female (4-12)	Girl's Restroom near Classroom 306	yes	W2	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	1	12	Student Restrooms - Female (4-12)	Girl's Restroom near Classroom 306	yes	W3	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	1	12	Student Restrooms - Female (4-12)	Girl's Restroom near Classroom 306	yes	W4	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	1	12	Student Restrooms - Female (4-12)	Girl's Restroom near Classroom 306	yes	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	1	12	Student Restrooms - Female (4-12)	Girl's Restroom near Classroom 306	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	1	PC0011	Pipe Chase	Girl's Restroom Pipe Chase	no	W1	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	1	PC0011	Pipe Chase	Girl's Restroom Pipe Chase	no	W2	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	1	PC0011	Pipe Chase	Girl's Restroom Pipe Chase	no	W3	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	1	PC0011	Pipe Chase	Girl's Restroom Pipe Chase	no	W4	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	1	PC0011	Pipe Chase	Girl's Restroom Pipe Chase	no	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	1	PC0011	Pipe Chase	Girl's Restroom Pipe Chase	no	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	1	11	Student Restrooms - Male (4-12)	Boy's Restroom near Classroom 306	yes	W1	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	1	11	Student Restrooms - Male (4-12)	Boy's Restroom near Classroom 306	yes	W2	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	1	11	Student Restrooms - Male (4-12)	Boy's Restroom near Classroom 306	yes	W3	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	1	11	Student Restrooms - Male (4-12)	Boy's Restroom near Classroom 306	yes	W4	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	1	11	Student Restrooms - Male (4-12)	Boy's Restroom near Classroom 306	yes	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	1	11	Student Restrooms - Male (4-12)	Boy's Restroom near Classroom 306	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	1	PC001	Pipe Chase	Boy's Restroom Pipe Chase	no	W1	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	1	PC001	Pipe Chase	Boy's Restroom Pipe Chase	no	W2	N/A	N/A	N/A	N/A	N/A	N/A

					Inspection Dates: 01/19/22									
					Inspector Name and Certificate Number: Ryan Hutsell PA RA:059512			Lead Safe Certification Assessment Report						
					Inspection Company: Synertech			Mayfair School						
ULCS #	Element	BldgElmt ID	Floor	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
8300	2	B830001-2	1	PC001	Pipe Chase	Boy's Restroom Pipe Chase	no	W3	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	1	PC001	Pipe Chase	Boy's Restroom Pipe Chase	no	W4	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	1	PC001	Pipe Chase	Boy's Restroom Pipe Chase	no	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	1	PC001	Pipe Chase	Boy's Restroom Pipe Chase	no	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	1	306	Primary	Classroom 306	yes	W1	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	1	306	Primary	Classroom 306	yes	W2	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	1	306	Primary	Classroom 306	yes	W3	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	1	306	Primary	Classroom 306	yes	W4	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	1	306	Primary	Classroom 306	yes	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	1	306	Primary	Classroom 306	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	1	300A	Electrical Room	Electrical Room across from Classroom 306	no	W1	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	1	300A	Electrical Room	Electrical Room across from Classroom 306	no	W2	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	1	300A	Electrical Room	Electrical Room across from Classroom 306	no	W3	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	1	300A	Electrical Room	Electrical Room across from Classroom 306	no	W4	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	1	300A	Electrical Room	Electrical Room across from Classroom 306	no	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	1	300A	Electrical Room	Electrical Room across from Classroom 306	no	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	1	300	Service Closets	Custodial Closet across from Classroom 305	no	W1	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	1	300	Service Closets	Custodial Closet across from Classroom 305	no	W2	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	1	300	Service Closets	Custodial Closet across from Classroom 305	no	W3	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	1	300	Service Closets	Custodial Closet across from Classroom 305	no	W4	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	1	300	Service Closets	Custodial Closet across from Classroom 305	no	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	1	300	Service Closets	Custodial Closet across from Classroom 305	no	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	1	305	Primary	Classroom 305	yes	W1	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	1	305	Primary	Classroom 305	yes	W2	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	1	305	Primary	Classroom 305	yes	W3	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	1	305	Primary	Classroom 305	yes	W4	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	1	305	Primary	Classroom 305	yes	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	1	305	Primary	Classroom 305	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	1	301	Primary	Classroom 301	yes	W1	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	1	301	Primary	Classroom 301	yes	W2	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	1	301	Primary	Classroom 301	yes	W3	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	1	301	Primary	Classroom 301	yes	W4	N/A	N/A	N/A	N/A	N/A	N/A

					Inspection Dates: 01/19/22									
					Inspector Name and Certificate Number: Ryan Hutsell PA RA:059512			Lead Safe Certification Assessment Report						
					Inspection Company: Synertech			Mayfair School						
ULCS #	Element	BldgElmt ID	Floor	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
8300	2	B830001-2	1	301	Primary	Classroom 301	yes	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	1	301	Primary	Classroom 301	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	1	302	Primary	Classroom 302	yes	W1	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	1	302	Primary	Classroom 302	yes	W2	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	1	302	Primary	Classroom 302	yes	W3	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	1	302	Primary	Classroom 302	yes	W4	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	1	302	Primary	Classroom 302	yes	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	1	302	Primary	Classroom 302	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	1	304	Primary	Classroom 304	yes	W1	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	1	304	Primary	Classroom 304	yes	W2	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	1	304	Primary	Classroom 304	yes	W3	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	1	304	Primary	Classroom 304	yes	W4	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	1	304	Primary	Classroom 304	yes	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	1	304	Primary	Classroom 304	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	1	303	Primary	Classroom 303	yes	W1	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	1	303	Primary	Classroom 303	yes	W2	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	1	303	Primary	Classroom 303	yes	W3	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	1	303	Primary	Classroom 303	yes	W4	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	1	303	Primary	Classroom 303	yes	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	1	303	Primary	Classroom 303	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	1	S20	Stairs	Stairwell next to Classroom 303	yes	W1	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	1	S20	Stairs	Stairwell next to Classroom 303	yes	W2	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	1	S20	Stairs	Stairwell next to Classroom 303	yes	W3	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	1	S20	Stairs	Stairwell next to Classroom 303	yes	W4	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	1	S20	Stairs	Stairwell next to Classroom 303	yes	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	1	S20	Stairs	Stairwell next to Classroom 303	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	2	E2	Mechanical Room	Elevator Machine Room	no	W1	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	2	E2	Mechanical Room	Elevator Machine Room	no	W2	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	2	E2	Mechanical Room	Elevator Machine Room	no	W3	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	2	E2	Mechanical Room	Elevator Machine Room	no	W4	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	2	E2	Mechanical Room	Elevator Machine Room	no	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	2	E2	Mechanical Room	Elevator Machine Room	no	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	2	S10	Stairs	Stairwell next to Classroom 406	yes	W1	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	2	S10	Stairs	Stairwell next to Classroom 406	yes	W2	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	2	S10	Stairs	Stairwell next to Classroom 406	yes	W3	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	2	S10	Stairs	Stairwell next to Classroom 406	yes	W4	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	2	S10	Stairs	Stairwell next to Classroom 406	yes	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	2	S10	Stairs	Stairwell next to Classroom 406	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	2	H2	Circulation (Hallway)	2nd Floor Hallway next to Classrooms 403 to Staff Restroom	yes	W1	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	2	H2	Circulation (Hallway)	2nd Floor Hallway next to Classrooms 403 to Staff Restroom	yes	W2	N/A	N/A	N/A	N/A	N/A	N/A



					Inspection Dates: 01/19/22									
					Inspector Name and Certificate Number: Ryan Hutsell PA RA:059512			Lead Safe Certification Assessment Report						
					Inspection Company: Synertech			Mayfair School						
ULCS #	Element	BldgElmt ID	Floor	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
8300	2	B830001-2	2	H2	Circulation (Hallway)	2nd Floor Hallway next to Classrooms 403 to Staff Restroom	yes	W3	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	2	H2	Circulation (Hallway)	2nd Floor Hallway next to Classrooms 403 to Staff Restroom	yes	W4	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	2	H2	Circulation (Hallway)	2nd Floor Hallway next to Classrooms 403 to Staff Restroom	yes	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	2	H2	Circulation (Hallway)	2nd Floor Hallway next to Classrooms 403 to Staff Restroom	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	2	22	Student Restrooms - Female (4-12)	Girl's Restroom near Classroom 406	yes	W1	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	2	22	Student Restrooms - Female (4-12)	Girl's Restroom near Classroom 406	yes	W2	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	2	22	Student Restrooms - Female (4-12)	Girl's Restroom near Classroom 406	yes	W3	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	2	22	Student Restrooms - Female (4-12)	Girl's Restroom near Classroom 406	yes	W4	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	2	22	Student Restrooms - Female (4-12)	Girl's Restroom near Classroom 406	yes	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	2	22	Student Restrooms - Female (4-12)	Girl's Restroom near Classroom 406	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	2	20	Student Restrooms - Male (4-12)	Boy's Restroom near Classroom 406	yes	W1	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	2	20	Student Restrooms - Male (4-12)	Boy's Restroom near Classroom 406	yes	W2	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	2	20	Student Restrooms - Male (4-12)	Boy's Restroom near Classroom 406	yes	W3	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	2	20	Student Restrooms - Male (4-12)	Boy's Restroom near Classroom 406	yes	W4	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	2	20	Student Restrooms - Male (4-12)	Boy's Restroom near Classroom 406	yes	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	2	20	Student Restrooms - Male (4-12)	Boy's Restroom near Classroom 406	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	2	406	Primary	Classroom 406	yes	W1	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	2	406	Primary	Classroom 406	yes	W2	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	2	406	Primary	Classroom 406	yes	W3	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	2	406	Primary	Classroom 406	yes	W4	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	2	406	Primary	Classroom 406	yes	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	2	406	Primary	Classroom 406	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	2	400A	Electrical Room	Maintenance Room across from Classroom 406	no	W1	N/A	N/A	N/A	N/A	N/A	N/A

					Inspection Dates: 01/19/22									
					Inspector Name and Certificate Number: Ryan Hutsell PA RA:059512			Lead Safe Certification Assessment Report						
					Inspection Company: Synertech			Mayfair School						
ULCS #	Element	BldgElmt ID	Floor	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
8300	2	B830001-2	2	400A	Electrical Room	Maintenance Room across from Classroom 406	no	W2	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	2	400A	Electrical Room	Maintenance Room across from Classroom 406	no	W3	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	2	400A	Electrical Room	Maintenance Room across from Classroom 406	no	W4	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	2	400A	Electrical Room	Maintenance Room across from Classroom 406	no	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	2	400A	Electrical Room	Maintenance Room across from Classroom 406	no	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	2	405	Primary	Classroom 405	yes	W1	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	2	405	Primary	Classroom 405	yes	W2	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	2	405	Primary	Classroom 405	yes	W3	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	2	405	Primary	Classroom 405	yes	W4	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	2	405	Primary	Classroom 405	yes	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	2	405	Primary	Classroom 405	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	2	401	Primary	Classroom 401	yes	W1	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	2	401	Primary	Classroom 401	yes	W2	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	2	401	Primary	Classroom 401	yes	W3	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	2	401	Primary	Classroom 401	yes	W4	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	2	401	Primary	Classroom 401	yes	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	2	401	Primary	Classroom 401	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	2	402	Primary	Classroom 402	yes	W1	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	2	402	Primary	Classroom 402	yes	W2	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	2	402	Primary	Classroom 402	yes	W3	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	2	402	Primary	Classroom 402	yes	W4	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	2	402	Primary	Classroom 402	yes	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	2	402	Primary	Classroom 402	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	2	404	Primary	Classroom 404	yes	W1	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	2	404	Primary	Classroom 404	yes	W2	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	2	404	Primary	Classroom 404	yes	W3	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	2	404	Primary	Classroom 404	yes	W4	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	2	404	Primary	Classroom 404	yes	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	2	404	Primary	Classroom 404	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	2	403	Primary	Classroom 403	yes	W1	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	2	403	Primary	Classroom 403	yes	W2	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	2	403	Primary	Classroom 403	yes	W3	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	2	403	Primary	Classroom 403	yes	W4	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	2	403	Primary	Classroom 403	yes	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	2	403	Primary	Classroom 403	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	2	S20	Stairs	Stairwell next to Classroom 403	yes	W1	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	2	S20	Stairs	Stairwell next to Classroom 403	yes	W2	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	2	S20	Stairs	Stairwell next to Classroom 403	yes	W3	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	2	S20	Stairs	Stairwell next to Classroom 403	yes	W4	N/A	N/A	N/A	N/A	N/A	N/A

					Inspection Dates: 01/19/22									
					Inspector Name and Certificate Number: Ryan Hutsell PA RA:059512			Lead Safe Certification Assessment Report						
					Inspection Company: Synertech			Mayfair School						
ULCS #	Element	BldgElmt ID	Floor	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
8300	2	B830001-2	2	S20	Stairs	Stairwell next to Classroom 403	yes	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
8300	2	B830001-2	2	S20	Stairs	Stairwell next to Classroom 403	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	528	Student Restrooms - Male (4-12)	Boy's Restroom near Classroom 527	yes	W1	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	528	Student Restrooms - Male (4-12)	Boy's Restroom near Classroom 527	yes	W2	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	528	Student Restrooms - Male (4-12)	Boy's Restroom near Classroom 527	yes	W3	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	528	Student Restrooms - Male (4-12)	Boy's Restroom near Classroom 527	yes	W4	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	528	Student Restrooms - Male (4-12)	Boy's Restroom near Classroom 527	yes	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	528	Student Restrooms - Male (4-12)	Boy's Restroom near Classroom 527	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	529	Restrooms, Staff - Male/Female	Staff Restroom near Classroom 527	yes	W1	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	529	Restrooms, Staff - Male/Female	Staff Restroom near Classroom 527	yes	W2	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	529	Restrooms, Staff - Male/Female	Staff Restroom near Classroom 527	yes	W3	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	529	Restrooms, Staff - Male/Female	Staff Restroom near Classroom 527	yes	W4	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	529	Restrooms, Staff - Male/Female	Staff Restroom near Classroom 527	yes	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	529	Restrooms, Staff - Male/Female	Staff Restroom near Classroom 527	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	S12	Stairs	Stairwell next to Assistant Principals Office 514	yes	W1	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	S12	Stairs	Stairwell next to Assistant Principals Office 514	yes	W2	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	S12	Stairs	Stairwell next to Assistant Principals Office 514	yes	W3	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	S12	Stairs	Stairwell next to Assistant Principals Office 514	yes	W4	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	S12	Stairs	Stairwell next to Assistant Principals Office 514	yes	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	S12	Stairs	Stairwell next to Assistant Principals Office 514	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	H12	Circulation (Hallway)	1st Floor Hallway from Assistant Principals Office to Men's Restroom	yes	W1	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	H12	Circulation (Hallway)	1st Floor Hallway from Assistant Principals Office to Men's Restroom	yes	W2	N/A	N/A	N/A	N/A	N/A	N/A

					Inspection Dates: 01/19/22									
					Inspector Name and Certificate Number: Ryan Hutsell PA RA:059512			Lead Safe Certification Assessment Report						
					Inspection Company: Synertech			Mayfair School						
ULCS #	Element	BldgElmt ID	Floor	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
8300	3	B830001-2	1	H12	Circulation (Hallway)	1st Floor Hallway from Assistant Principals Office to Men's Restroom	yes	W3	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	H12	Circulation (Hallway)	1st Floor Hallway from Assistant Principals Office to Men's Restroom	yes	W4	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	H12	Circulation (Hallway)	1st Floor Hallway from Assistant Principals Office to Men's Restroom	yes	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	H12	Circulation (Hallway)	1st Floor Hallway from Assistant Principals Office to Men's Restroom	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	514	Administrative Office	Assistant Principals Office 514	yes	W1	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	514	Administrative Office	Assistant Principals Office 514	yes	W2	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	514	Administrative Office	Assistant Principals Office 514	yes	W3	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	514	Administrative Office	Assistant Principals Office 514	yes	W4	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	514	Administrative Office	Assistant Principals Office 514	yes	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	514	Administrative Office	Assistant Principals Office 514	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	513	Primary	Classroom 513	yes	W1	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	513	Primary	Classroom 513	yes	W2	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	513	Primary	Classroom 513	yes	W3	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	513	Primary	Classroom 513	yes	W4	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	513	Primary	Classroom 513	yes	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	513	Primary	Classroom 513	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	513A	Storage	Classroom 513 Closet	yes	W1	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	513A	Storage	Classroom 513 Closet	yes	W2	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	513A	Storage	Classroom 513 Closet	yes	W3	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	513A	Storage	Classroom 513 Closet	yes	W4	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	513A	Storage	Classroom 513 Closet	yes	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	513A	Storage	Classroom 513 Closet	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	512	Primary	Classroom 512	yes	W1	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	512	Primary	Classroom 512	yes	W2	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	512	Primary	Classroom 512	yes	W3	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	512	Primary	Classroom 512	yes	W4	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	512	Primary	Classroom 512	yes	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	512	Primary	Classroom 512	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	512A	Storage	Classroom 512 Closet	yes	W1	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	512A	Storage	Classroom 512 Closet	yes	W2	N/A	N/A	N/A	N/A	N/A	N/A

					Inspection Dates: 01/19/22									
					Inspector Name and Certificate Number: Ryan Hutsell PA RA:059512			Lead Safe Certification Assessment Report						
					Inspection Company: Synertech			Mayfair School						
ULCS #	Element	BldgElmt ID	Floor	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
8300	3	B830001-2	1	512A	Storage	Classroom 512 Closet	yes	W3	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	512A	Storage	Classroom 512 Closet	yes	W4	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	512A	Storage	Classroom 512 Closet	yes	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	512A	Storage	Classroom 512 Closet	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	515	Primary	Classroom 515	yes	W1	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	515	Primary	Classroom 515	yes	W2	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	515	Primary	Classroom 515	yes	W3	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	515	Primary	Classroom 515	yes	W4	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	515	Primary	Classroom 515	yes	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	515	Primary	Classroom 515	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	515A	Storage	Classroom 515 Closet	yes	W1	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	515A	Storage	Classroom 515 Closet	yes	W2	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	515A	Storage	Classroom 515 Closet	yes	W3	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	515A	Storage	Classroom 515 Closet	yes	W4	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	515A	Storage	Classroom 515 Closet	yes	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	515A	Storage	Classroom 515 Closet	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	511	Primary	Classroom 511	yes	W1	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	511	Primary	Classroom 511	yes	W2	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	511	Primary	Classroom 511	yes	W3	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	511	Primary	Classroom 511	yes	W4	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	511	Primary	Classroom 511	yes	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	511	Primary	Classroom 511	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	511A	Storage	Classroom 511 Closet	yes	W1	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	511A	Storage	Classroom 511 Closet	yes	W2	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	511A	Storage	Classroom 511 Closet	yes	W3	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	511A	Storage	Classroom 511 Closet	yes	W4	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	511A	Storage	Classroom 511 Closet	yes	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	511A	Storage	Classroom 511 Closet	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	516	Primary	Classroom 516	yes	W1	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	516	Primary	Classroom 516	yes	W2	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	516	Primary	Classroom 516	yes	W3	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	516	Primary	Classroom 516	yes	W4	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	516	Primary	Classroom 516	yes	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	516	Primary	Classroom 516	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	516A	Storage	Classroom 516 Closet	yes	W1	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	516A	Storage	Classroom 516 Closet	yes	W2	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	516A	Storage	Classroom 516 Closet	yes	W3	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	516A	Storage	Classroom 516 Closet	yes	W4	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	516A	Storage	Classroom 516 Closet	yes	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	516A	Storage	Classroom 516 Closet	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	510	Primary	Classroom 510	yes	W1	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	510	Primary	Classroom 510	yes	W2	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	510	Primary	Classroom 510	yes	W3	N/A	N/A	N/A	N/A	N/A	N/A

					Inspection Dates: 01/19/22									
					Inspector Name and Certificate Number: Ryan Hutsell PA RA:059512			Lead Safe Certification Assessment Report						
					Inspection Company: Synertech			Mayfair School						
ULCS #	Element	BldgElmt ID	Floor	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
8300	3	B830001-2	1	510	Primary	Classroom 510	yes	W4	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	510	Primary	Classroom 510	yes	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	510	Primary	Classroom 510	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	510A	Storage	Classroom 510 Closet	yes	W1	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	510A	Storage	Classroom 510 Closet	yes	W2	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	510A	Storage	Classroom 510 Closet	yes	W3	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	510A	Storage	Classroom 510 Closet	yes	W4	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	510A	Storage	Classroom 510 Closet	yes	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	510A	Storage	Classroom 510 Closet	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	517	Primary	Classroom 517	yes	W1	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	517	Primary	Classroom 517	yes	W2	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	517	Primary	Classroom 517	yes	W3	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	517	Primary	Classroom 517	yes	W4	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	517	Primary	Classroom 517	yes	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	517	Primary	Classroom 517	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	517A	Storage	Classroom 517 Closet	yes	W1	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	517A	Storage	Classroom 517 Closet	yes	W2	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	517A	Storage	Classroom 517 Closet	yes	W3	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	517A	Storage	Classroom 517 Closet	yes	W4	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	517A	Storage	Classroom 517 Closet	yes	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	517A	Storage	Classroom 517 Closet	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	518	Student Restrooms - Female (4-12)	Girl's Restroom near Classroom 517	yes	W1	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	518	Student Restrooms - Female (4-12)	Girl's Restroom near Classroom 517	yes	W2	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	518	Student Restrooms - Female (4-12)	Girl's Restroom near Classroom 517	yes	W3	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	518	Student Restrooms - Female (4-12)	Girl's Restroom near Classroom 517	yes	W4	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	518	Student Restrooms - Female (4-12)	Girl's Restroom near Classroom 517	yes	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	518	Student Restrooms - Female (4-12)	Girl's Restroom near Classroom 517	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	519	Student Restrooms - Male (4-12)	Boy's Restroom near Classroom 517	yes	W1	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	519	Student Restrooms - Male (4-12)	Boy's Restroom near Classroom 517	yes	W2	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	519	Student Restrooms - Male (4-12)	Boy's Restroom near Classroom 517	yes	W3	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	519	Student Restrooms - Male (4-12)	Boy's Restroom near Classroom 517	yes	W4	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	519	Student Restrooms - Male (4-12)	Boy's Restroom near Classroom 517	yes	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A

					Inspection Dates: 01/19/22									
					Inspector Name and Certificate Number: Ryan Hutsell PA RA:059512			Lead Safe Certification Assessment Report						
					Inspection Company: Synertech			Mayfair School						
ULCS #	Element	BldgElmt ID	Floor	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
8300	3	B830001-2	1	519	Student Restrooms - Male (4-12)	Boy's Restroom near Classroom 517	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	519A	Restrooms, Staff - Male/Female	Staff Restroom near Classroom 517	yes	W1	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	519A	Restrooms, Staff - Male/Female	Staff Restroom near Classroom 517	yes	W2	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	519A	Restrooms, Staff - Male/Female	Staff Restroom near Classroom 517	yes	W3	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	519A	Restrooms, Staff - Male/Female	Staff Restroom near Classroom 517	yes	W4	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	519A	Restrooms, Staff - Male/Female	Staff Restroom near Classroom 517	yes	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	519A	Restrooms, Staff - Male/Female	Staff Restroom near Classroom 517	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	507	Mechanical Room	IDF Room 507	yes	W1	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	507	Mechanical Room	IDF Room 507	yes	W2	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	507	Mechanical Room	IDF Room 507	yes	W3	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	507	Mechanical Room	IDF Room 507	yes	W4	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	507	Mechanical Room	IDF Room 507	yes	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	507	Mechanical Room	IDF Room 507	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	528	Mechanical Room	Maintenance Room 528	no	W1	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	528	Mechanical Room	Maintenance Room 528	no	W2	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	528	Mechanical Room	Maintenance Room 528	no	W3	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	528	Mechanical Room	Maintenance Room 528	no	W4	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	528	Mechanical Room	Maintenance Room 528	no	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	528	Mechanical Room	Maintenance Room 528	no	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	H17	Circulation (Hallway)	1st Floor Connecting Hallway from Old Wing to New Wing	yes	W1	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	H17	Circulation (Hallway)	1st Floor Connecting Hallway from Old Wing to New Wing	yes	W2	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	H17	Circulation (Hallway)	1st Floor Connecting Hallway from Old Wing to New Wing	yes	W3	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	H17	Circulation (Hallway)	1st Floor Connecting Hallway from Old Wing to New Wing	yes	W4	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	H17	Circulation (Hallway)	1st Floor Connecting Hallway from Old Wing to New Wing	yes	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	1	H17	Circulation (Hallway)	1st Floor Connecting Hallway from Old Wing to New Wing	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	2	S22	Stairs	Stairwell next to Assistant Principals Office 524	yes	W1	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	2	S22	Stairs	Stairwell next to Assistant Principals Office 524	yes	W2	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	2	S22	Stairs	Stairwell next to Assistant Principals Office 524	yes	W3	N/A	N/A	N/A	N/A	N/A	N/A

					Inspection Dates: 01/19/22									
					Inspector Name and Certificate Number: Ryan Hutsell PA RA:059512			Lead Safe Certification Assessment Report						
					Inspection Company: Synertech			Mayfair School						
ULCS #	Element	BldgElmt ID	Floor	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
8300	3	B830001-2	2	S22	Stairs	Stairwell next to Assistant Principals Office 524	yes	W4	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	2	S22	Stairs	Stairwell next to Assistant Principals Office 524	yes	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	2	S22	Stairs	Stairwell next to Assistant Principals Office 524	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	2	H22	Circulation (Hallway)	2nd Floor Hallway from Assistant Principals Office to Men's Restroom	yes	W1	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	2	H22	Circulation (Hallway)	2nd Floor Hallway from Assistant Principals Office to Men's Restroom	yes	W2	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	2	H22	Circulation (Hallway)	2nd Floor Hallway from Assistant Principals Office to Men's Restroom	yes	W3	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	2	H22	Circulation (Hallway)	2nd Floor Hallway from Assistant Principals Office to Men's Restroom	yes	W4	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	2	H22	Circulation (Hallway)	2nd Floor Hallway from Assistant Principals Office to Men's Restroom	yes	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	2	H22	Circulation (Hallway)	2nd Floor Hallway from Assistant Principals Office to Men's Restroom	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	2	524	Administrative Office	Assistant Principals Office 524	yes	W1	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	2	524	Administrative Office	Assistant Principals Office 524	yes	W2	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	2	524	Administrative Office	Assistant Principals Office 524	yes	W3	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	2	524	Administrative Office	Assistant Principals Office 524	yes	W4	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	2	524	Administrative Office	Assistant Principals Office 524	yes	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	2	524	Administrative Office	Assistant Principals Office 524	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	2	523	Primary	Classroom 523	yes	W1	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	2	523	Primary	Classroom 523	yes	W2	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	2	523	Primary	Classroom 523	yes	W3	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	2	523	Primary	Classroom 523	yes	W4	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	2	523	Primary	Classroom 523	yes	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	2	523	Primary	Classroom 523	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	2	523A	Storage	Classroom 523 Closet	yes	W1	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	2	523A	Storage	Classroom 523 Closet	yes	W2	N/A	N/A	N/A	N/A	N/A	N/A



					Inspection Dates: 01/19/22									
					Inspector Name and Certificate Number: Ryan Hutsell PA RA:059512			Lead Safe Certification Assessment Report						
					Inspection Company: Synertech			Mayfair School						
ULCS #	Element	BldgElmt ID	Floor	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
8300	3	B830001-2	2	523A	Storage	Classroom 523 Closet	yes	W3	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	2	523A	Storage	Classroom 523 Closet	yes	W4	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	2	523A	Storage	Classroom 523 Closet	yes	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	2	523A	Storage	Classroom 523 Closet	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	2	522	Primary	Classroom 522	yes	W1	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	2	522	Primary	Classroom 522	yes	W2	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	2	522	Primary	Classroom 522	yes	W3	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	2	522	Primary	Classroom 522	yes	W4	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	2	522	Primary	Classroom 522	yes	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	2	522	Primary	Classroom 522	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	2	522A	Storage	Classroom 522 Closet	yes	W1	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	2	522A	Storage	Classroom 522 Closet	yes	W2	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	2	522A	Storage	Classroom 522 Closet	yes	W3	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	2	522A	Storage	Classroom 522 Closet	yes	W4	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	2	522A	Storage	Classroom 522 Closet	yes	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	2	522A	Storage	Classroom 522 Closet	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	2	525	Primary	Classroom 525	yes	W1	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	2	525	Primary	Classroom 525	yes	W2	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	2	525	Primary	Classroom 525	yes	W3	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	2	525	Primary	Classroom 525	yes	W4	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	2	525	Primary	Classroom 525	yes	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	2	525	Primary	Classroom 525	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	2	525A	Storage	Classroom 525 Closet	yes	W1	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	2	525A	Storage	Classroom 525 Closet	yes	W2	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	2	525A	Storage	Classroom 525 Closet	yes	W3	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	2	525A	Storage	Classroom 525 Closet	yes	W4	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	2	525A	Storage	Classroom 525 Closet	yes	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	2	525A	Storage	Classroom 525 Closet	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	2	521	Primary	Classroom 521	yes	W1	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	2	521	Primary	Classroom 521	yes	W2	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	2	521	Primary	Classroom 521	yes	W3	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	2	521	Primary	Classroom 521	yes	W4	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	2	521	Primary	Classroom 521	yes	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	2	521	Primary	Classroom 521	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	2	521A	Storage	Classroom 521 Closet	yes	W1	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	2	521A	Storage	Classroom 521 Closet	yes	W2	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	2	521A	Storage	Classroom 521 Closet	yes	W3	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	2	521A	Storage	Classroom 521 Closet	yes	W4	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	2	521A	Storage	Classroom 521 Closet	yes	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	2	521A	Storage	Classroom 521 Closet	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	2	526	Primary	Classroom 526	yes	W1	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	2	526	Primary	Classroom 526	yes	W2	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	2	526	Primary	Classroom 526	yes	W3	N/A	N/A	N/A	N/A	N/A	N/A

					Inspection Dates: 01/19/22									
					Inspector Name and Certificate Number: Ryan Hutsell PA RA:059512			Lead Safe Certification Assessment Report						
					Inspection Company: Synertech			Mayfair School						
ULCS #	Element	BldgElmt ID	Floor	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
8300	3	B830001-2	2	526	Primary	Classroom 526	yes	W4	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	2	526	Primary	Classroom 526	yes	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	2	526	Primary	Classroom 526	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	2	526A	Storage	Classroom 526 Closet	yes	W1	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	2	526A	Storage	Classroom 526 Closet	yes	W2	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	2	526A	Storage	Classroom 526 Closet	yes	W3	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	2	526A	Storage	Classroom 526 Closet	yes	W4	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	2	526A	Storage	Classroom 526 Closet	yes	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	2	526A	Storage	Classroom 526 Closet	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	2	520	Primary	Classroom 520	yes	W1	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	2	520	Primary	Classroom 520	yes	W2	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	2	520	Primary	Classroom 520	yes	W3	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	2	520	Primary	Classroom 520	yes	W4	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	2	520	Primary	Classroom 520	yes	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	2	520	Primary	Classroom 520	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	2	520A	Storage	Classroom 520 Closet	yes	W1	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	2	520A	Storage	Classroom 520 Closet	yes	W2	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	2	520A	Storage	Classroom 520 Closet	yes	W3	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	2	520A	Storage	Classroom 520 Closet	yes	W4	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	2	520A	Storage	Classroom 520 Closet	yes	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	2	520A	Storage	Classroom 520 Closet	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	2	527	Primary	Classroom 527	yes	W1	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	2	527	Primary	Classroom 527	yes	W2	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	2	527	Primary	Classroom 527	yes	W3	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	2	527	Primary	Classroom 527	yes	W4	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	2	527	Primary	Classroom 527	yes	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	2	527	Primary	Classroom 527	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	2	527A	Storage	Classroom 527 Closet	yes	W1	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	2	527A	Storage	Classroom 527 Closet	yes	W2	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	2	527A	Storage	Classroom 527 Closet	yes	W3	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	2	527A	Storage	Classroom 527 Closet	yes	W4	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	2	527A	Storage	Classroom 527 Closet	yes	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	2	527A	Storage	Classroom 527 Closet	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	2	527B	Student Restrooms - Female (4-12)	Girl's Restroom near Classroom 527	yes	W1	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	2	527B	Student Restrooms - Female (4-12)	Girl's Restroom near Classroom 527	yes	W2	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	2	527B	Student Restrooms - Female (4-12)	Girl's Restroom near Classroom 527	yes	W3	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	2	527B	Student Restrooms - Female (4-12)	Girl's Restroom near Classroom 527	yes	W4	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	2	527B	Student Restrooms - Female (4-12)	Girl's Restroom near Classroom 527	yes	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A

					Inspection Dates: 01/19/22									
					Inspector Name and Certificate Number: Ryan Hutsell PA RA:059512			Lead Safe Certification Assessment Report						
					Inspection Company: Synertech			Mayfair School						
ULCS #	Element	BldgElmt ID	Floor	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
8300	3	B830001-2	2	527B	Student Restrooms - Female (4-12)	Girl's Restroom near Classroom 527	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	2	H27	Circulation (Hallway)	2nd Floor Connecting Hallway from Old Wing to New Wing	yes	W1	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	2	H27	Circulation (Hallway)	2nd Floor Connecting Hallway from Old Wing to New Wing	yes	W2	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	2	H27	Circulation (Hallway)	2nd Floor Connecting Hallway from Old Wing to New Wing	yes	W3	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	2	H27	Circulation (Hallway)	2nd Floor Connecting Hallway from Old Wing to New Wing	yes	W4	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	2	H27	Circulation (Hallway)	2nd Floor Connecting Hallway from Old Wing to New Wing	yes	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
8300	3	B830001-2	2	H27	Circulation (Hallway)	2nd Floor Connecting Hallway from Old Wing to New Wing	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	4	B830001-2	1	PRT1	Portable	Mobile Portable 1	yes	W1	N/A	N/A	N/A	N/A	N/A	N/A
8300	4	B830001-2	1	PRT1	Portable	Mobile Portable 1	yes	W2	N/A	N/A	N/A	N/A	N/A	N/A
8300	4	B830001-2	1	PRT1	Portable	Mobile Portable 1	yes	W3	N/A	N/A	N/A	N/A	N/A	N/A
8300	4	B830001-2	1	PRT1	Portable	Mobile Portable 1	yes	W4	N/A	N/A	N/A	N/A	N/A	N/A
8300	4	B830001-2	1	PRT1	Portable	Mobile Portable 1	yes	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
8300	4	B830001-2	1	PRT1	Portable	Mobile Portable 1	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	4	B830001-2	1	PRT2	Portable	Mobile Portable 2	yes	W1	N/A	N/A	N/A	N/A	N/A	N/A
8300	4	B830001-2	1	PRT2	Portable	Mobile Portable 2	yes	W2	N/A	N/A	N/A	N/A	N/A	N/A
8300	4	B830001-2	1	PRT2	Portable	Mobile Portable 2	yes	W3	N/A	N/A	N/A	N/A	N/A	N/A
8300	4	B830001-2	1	PRT2	Portable	Mobile Portable 2	yes	W4	N/A	N/A	N/A	N/A	N/A	N/A
8300	4	B830001-2	1	PRT2	Portable	Mobile Portable 2	yes	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
8300	4	B830001-2	1	PRT2	Portable	Mobile Portable 2	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	4	B830001-2	1	PRT3	Portable	Mobile Portable 3	yes	W1	N/A	N/A	N/A	N/A	N/A	N/A
8300	4	B830001-2	1	PRT3	Portable	Mobile Portable 3	yes	W2	N/A	N/A	N/A	N/A	N/A	N/A
8300	4	B830001-2	1	PRT3	Portable	Mobile Portable 3	yes	W3	N/A	N/A	N/A	N/A	N/A	N/A
8300	4	B830001-2	1	PRT3	Portable	Mobile Portable 3	yes	W4	N/A	N/A	N/A	N/A	N/A	N/A
8300	4	B830001-2	1	PRT3	Portable	Mobile Portable 3	yes	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
8300	4	B830001-2	1	PRT3	Portable	Mobile Portable 3	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	4	B830001-2	1	PRT4	Portable	Mobile Portable 4	yes	W1	N/A	N/A	N/A	N/A	N/A	N/A
8300	4	B830001-2	1	PRT4	Portable	Mobile Portable 4	yes	W2	N/A	N/A	N/A	N/A	N/A	N/A
8300	4	B830001-2	1	PRT4	Portable	Mobile Portable 4	yes	W3	N/A	N/A	N/A	N/A	N/A	N/A
8300	4	B830001-2	1	PRT4	Portable	Mobile Portable 4	yes	W4	N/A	N/A	N/A	N/A	N/A	N/A
8300	4	B830001-2	1	PRT4	Portable	Mobile Portable 4	yes	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
8300	4	B830001-2	1	PRT4	Portable	Mobile Portable 4	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	4	B830001-2	1	PRT5	Portable	Mobile Portable 5	yes	W1	N/A	N/A	N/A	N/A	N/A	N/A
8300	4	B830001-2	1	PRT5	Portable	Mobile Portable 5	yes	W2	N/A	N/A	N/A	N/A	N/A	N/A
8300	4	B830001-2	1	PRT5	Portable	Mobile Portable 5	yes	W3	N/A	N/A	N/A	N/A	N/A	N/A
8300	4	B830001-2	1	PRT5	Portable	Mobile Portable 5	yes	W4	N/A	N/A	N/A	N/A	N/A	N/A
8300	4	B830001-2	1	PRT5	Portable	Mobile Portable 5	yes	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
8300	4	B830001-2	1	PRT5	Portable	Mobile Portable 5	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A

					Inspection Dates: 01/19/22									
					Inspector Name and Certificate Number: Ryan Hutsell PA RA:059512			Lead Safe Certification Assessment Report						
					Inspection Company: Synertech			Mayfair School						
ULCS #	E l e m e n t	BldgElmt ID	F l o o r	Space #	Space Type	On-Site Room Name	Student/ Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/ negative)
8300	4	B830001-2	1	PRT6	Portable	Mobile Portable 6	yes	W1	N/A	N/A	N/A	N/A	N/A	N/A
8300	4	B830001-2	1	PRT6	Portable	Mobile Portable 6	yes	W2	N/A	N/A	N/A	N/A	N/A	N/A
8300	4	B830001-2	1	PRT6	Portable	Mobile Portable 6	yes	W3	N/A	N/A	N/A	N/A	N/A	N/A
8300	4	B830001-2	1	PRT6	Portable	Mobile Portable 6	yes	W4	N/A	N/A	N/A	N/A	N/A	N/A
8300	4	B830001-2	1	PRT6	Portable	Mobile Portable 6	yes	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
8300	4	B830001-2	1	PRT6	Portable	Mobile Portable 6	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	4	B830001-2	1	PRT7	Portable	Mobile Portable 7	yes	W1	N/A	N/A	N/A	N/A	N/A	N/A
8300	4	B830001-2	1	PRT7	Portable	Mobile Portable 7	yes	W2	N/A	N/A	N/A	N/A	N/A	N/A
8300	4	B830001-2	1	PRT7	Portable	Mobile Portable 7	yes	W3	N/A	N/A	N/A	N/A	N/A	N/A
8300	4	B830001-2	1	PRT7	Portable	Mobile Portable 7	yes	W4	N/A	N/A	N/A	N/A	N/A	N/A
8300	4	B830001-2	1	PRT7	Portable	Mobile Portable 7	yes	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
8300	4	B830001-2	1	PRT7	Portable	Mobile Portable 7	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
8300	4	B830001-2	1	PRT8	Portable	Mobile Portable 8	yes	W1	N/A	N/A	N/A	N/A	N/A	N/A
8300	4	B830001-2	1	PRT8	Portable	Mobile Portable 8	yes	W2	N/A	N/A	N/A	N/A	N/A	N/A
8300	4	B830001-2	1	PRT8	Portable	Mobile Portable 8	yes	W3	N/A	N/A	N/A	N/A	N/A	N/A
8300	4	B830001-2	1	PRT8	Portable	Mobile Portable 8	yes	W4	N/A	N/A	N/A	N/A	N/A	N/A
8300	4	B830001-2	1	PRT8	Portable	Mobile Portable 8	yes	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
8300	4	B830001-2	1	PRT8	Portable	Mobile Portable 8	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A

## **Appendix B**

### **Scope of Work Table**

					Inspection Dates: 01/19/22									
					Inspector Name and Certificate Number: Ryan Hutsell PA RA:059512			Lead Safe Certification Assessment Report						
					Inspection Company: Synertech			Mayfair School						
ULCS #	Element	BldgElmt ID	Floor	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
8300	1	B830001-1	1	101B	Storage	Classroom 101 Closet (Left)	yes	Shelf	Wood	White	Friction	5	3.2	Positive
8300	1	B830001-1	1	101B	Storage	Classroom 101 Closet (Left)	yes	Shelf	Wood	White	Friction	5	3.5	Positive
8300	1	B830001-1	1	101B	Storage	Classroom 101 Closet (Right)	yes	Shelf	Wood	White	Friction	5	3.2	Positive
8300	1	B830001-1	1	101B	Storage	Classroom 101 Closet (Right)	yes	Shelf	Wood	White	Friction	5	3.5	Positive
8300	1	B830001-1	1	111C	Storage	Classroom 115 Left Closet	yes	Shelves	Wood	White	Friction	5	4.1	Positive
8300	1	B830001-1	1	111C	Storage	Classroom 115 Left Closet	yes	Shelves	Wood	White	Friction	5	3.6	Positive
8300	1	B830001-1	1	102A	Storage	Classroom 102 Left Closet	yes	Shelves	Wood	White	Friction	5	6.1	Positive
8300	1	B830001-1	1	102A	Storage	Classroom 102 Left Closet	yes	Shelves	Wood	White	Friction	5	4.5	Positive
8300	1	B830001-1	1	111B	Storage	Classroom 114 Closet	yes	Shelves	Wood	White	Friction	4	3.5	Positive
8300	1	B830001-1	1	111B	Storage	Classroom 114 Closet	yes	Shelves	Wood	White	Friction	4	4.1	Positive
8300	1	B830001-1	1	103C	Storage	Classroom 103 Closet (Left)	yes	Shelves	Wood	White	Friction	4	4.9	Positive
8300	1	B830001-1	1	103C	Storage	Classroom 103 Closet (Right)	yes	Shelves	Wood	White	Friction	4	5.2	Positive
8300	1	B830001-1	1	110A	Storage	Classroom 113 Closet	yes	Shelves	Wood	White	Friction	2	2.5	Positive
8300	1	B830001-1	1	103A	Storage	Classroom 104 Closet (Left)	yes	Shelves	Wood	White	Friction	4	3.8	Positive
8300	1	B830001-1	1	109D	Storage	Book Closet across from Classroom 104	yes	Shelves	Wood	White	Friction	5	2.5	Positive
8300	1	B830001-1	1	109C	Storage	Classroom 112 Left Closet	yes	Shelves	Wood	White	Friction	3	5.2	Positive
8300	1	B830001-1	1	109C	Storage	Classroom 112 Left Closet	yes	Shelves	Wood	White	Friction	3	3.9	Positive
8300	1	B830001-1	1	104A	Storage	Classroom 105 Left Closet	yes	Shelves	Wood	White	Friction	2	4.1	Positive
8300	1	B830001-1	1	108A	Primary	Classroom 111 Left Closet	yes	Shelves	Wood	White	Friction	4	5.2	Positive
8300	1	B830001-1	1	105C	Storage	Classroom 106 Closet (Left)	yes	Shelves	Wood	White	Friction	4	6.4	Positive
8300	1	B830001-1	1	105C	Storage	Classroom 107 Closet	yes	Shelves	Wood	Blue	Friction	2	4.5	Positive
8300	1	B830001-1	1	107C	Storage	Classroom 110 Closet	yes	Shelves	Wood	White	Friction	4	5.2	Positive
8300	1	B830001-1	1	106B	Storage	Classroom 108 Left Closet	yes	Shelves	Wood	White	Friction	4	3.9	Positive
8300	1	B830001-1	1	114G	Storage	Book Closet next to Classroom 119	yes	Shelves	Wood	White	Friction	2	2	Positive
8300	1	B830001-1	1	120	Primary	Classroom 120	yes	Shelf	Wood	Tan	Chipping	2	1.2	Positive
8300	1	B830001-1	1	120	Primary	Classroom 120	yes	Bench	Wood	White	Chipping	1	1	Positive
8300	1	B830001-1	1	120	Primary	Classroom 120	yes	Shelf	Wood	Tan	Chipping	2	0.9	Positive
8300	1	B830001-1	1	122A	Mechanical Room	Auditorium Fan Room	yes	Door	Wood	Green	Flaking	2	6.7	Positive
8300	1	B830001-1	1	122A	Mechanical Room	Auditorium Fan Room	yes	Ductwork	Metal	Tan	Flaking	40	3.7	Positive
8300	1	B830001-1	1	122A-1	Mechanical Room	Air Intake Room	yes	Door	Wood	Green	Flaking	2	3.7	Positive
8300	1	B830001-1	1	H12	Circulation (Hallway)	Hallway next to Main Office	yes	Crown Moulding	Wood	White	Chipping	2	3.2	Positive
8300	1	B830001-1	2	206E	Storage	Classroom 201 Left Closet	yes	Shelves	Wood	White	Friction	5	4.2	Positive
8300	1	B830001-1	2	206F	Storage	Classroom 201 Right Closet	yes	Shelves	Wood	White	Friction	2	4.2	Positive
8300	1	B830001-1	2	206ABC	Primary	Classroom 203 Closet (Left)	yes	Shelves	Wood	White	Friction	4	3.9	Positive
8300	1	B830001-1	2	206ABC-1	Primary	Classroom 203 Closet (Right)	yes	Shelves	Wood	White	Friction	4	3.9	Positive
8300	1	B830001-1	2	207B	Storage	Classroom 202 Left Closet	yes	Shelves	Wood	White	Friction	5	5.2	Positive
8300	1	B830001-1	2	205A	Storage	Classroom 205 Closet (Left)	yes	Shelves	Wood	White	Friction	4	4.8	Positive
8300	1	B830001-1	2	205B	Storage	Classroom 205 Closet (Right)	yes	Shelves	Wood	White	Friction	4	3.5	Positive
8300	1	B830001-1	2	209D	Storage	Classroom 206 Closet	yes	Shelves	Wood	White	Friction	4	2.5	Positive
8300	1	B830001-1	2	204A	Storage	Classroom 207 Left Closet	yes	Shelves	Wood	White	Friction	4	3.6	Positive
8300	1	B830001-1	2	209A	Storage	Classroom 208 Closet (Left)	yes	Shelves	Wood	White	Friction	4	3.9	Positive

					Inspection Dates: 01/19/22									
					Inspector Name and Certificate Number: Ryan Hutsell PA RA:059512			Lead Safe Certification Assessment Report						
					Inspection Company: Synertech			Mayfair School						
ULCS #	E l e m e n t	BldgElmt ID	F l o o r	Space #	Space Type	On-Site Room Name	Student/ Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/ negative)
8300	1	B830001-1	2	203D	Storage	Classroom 209 Left Closet	yes	Shelves	Wood	White	Friction	5	4.3	Positive
8300	1	B830001-1	2	210A	Storage	Classroom 210 Closet (Left)	yes	Shelves	Wood	White	Friction	4	2.9	Positive
8300	1	B830001-1	2	202C	Storage	Classroom 211 Right Closet	yes	Shelves	Wood	White	Friction	4	4	Positive
8300	1	B830001-1	2	202B	Storage	Classroom 211 Left Closet	yes	Shelves	Wood	White	Friction	4	4	Positive
8300	1	B830001-1	2	200	Primary	Classroom 217	yes	Built-in Shelving	Wood	White	Friction	40	3.2	Positive
8300	1	B830001-1	2	200	Primary	Classroom 217	yes	Built-in Shelving	Wood	White	Friction	40	4.6	Positive
8300	1	B830001-1	2	200	Primary	Classroom 217	yes	Bench	Wood	White	Friction	5	4.2	Positive
8300	1	B830001-1	2	200	Primary	Classroom 217	yes	Built-in Shelving	Wood	White	Friction	40	2.9	Positive
8300	B	B830001-1	1	FR1	Fan Room	Fan Room accessed from Main Office Hallway	yes	Door	Metal	Green	Chipping	1	5.2	Positive

**Appendix C**

**EPA Checklist Form**



# Sample Renovation Recordkeeping Checklist

Form Approved OMB No. 2070-0195 Expires 2/29/24

Name of Firm: SymTech

Date and Location of Renovation: 1-3-23 Mayfair E.S.

Brief Description of Renovation: RRP

Name of Assigned Renovator: S.D.P

Name(s) of Trained Worker(s), if used: S.D.P

Name of Dust Sampling Technician,  
Inspector, or Risk Assessor, if used: HAROLD SANTIAGO

☒ Copies of renovator and dust sampling technician qualifications (training certificates, certifications) on file.

☒ Certified renovator provided training to workers on (check all that apply):

☒ Posting warning signs

☒ Setting up plastic containment barriers

☒ Maintaining containment ☒ Avoiding spread of dust to adjacent areas

☒ Waste handling

☒ Post-renovation cleaning

☐ Test kit or test results from an EPA-recognized laboratory on collected paint chip sample, used by certified renovator to determine whether lead was present on components affected by renovation (identify method used, type of test kit used (if applicable), laboratory used to conduct paint chip analysis, describe sampling locations and results):

☒ Warning signs posted at entrance to work area.

☒ Work area contained to prevent spread of dust and debris

☒ All objects in the work area removed or covered (interiors)

☒ HVAC ducts in the work area closed and covered (interiors)

☒ Windows in the work area closed (interiors)

☒ Windows in and within 20 feet of the work area closed (exteriors)

☒ Doors in the work area closed and sealed (interiors)

☒ Doors in and within 20 feet of the work area closed and sealed (exteriors)

☒ Doors that must be used in the work area covered to allow passage but prevent spread of dust

☒ Floors in the work area covered with taped-down plastic (interiors)

☒ Ground covered by plastic extending 10 feet from work area—plastic anchored to building and weighed down by heavy objects (exteriors)

☒ Vertical containment installed if property line prevents 10 feet of ground covering, or if necessary to prevent migration of dust and debris to adjacent property (exteriors)

☒ Waste contained on-site and while being transported off-site.

☒ Work site properly cleaned after renovation

☒ All chips and debris picked up, protective sheeting misted, folded dirty side inward, and taped for removal

☒ Work area surfaces and objects cleaned using HEPA vacuum and/or wet cloths or mops (interiors)

☒ Certified renovator performed post-renovation cleaning verification (describe results, including the number of wet and dry cloths used):

☐ If dust clearance testing was performed instead, attach a copy of report

☒ I certify under penalty of law that the above information is true and complete.

Name and title

Harold Santiago  
Lead Tech

Date

1-3-23

**Appendix D**

**Oversight Table**

Task ID	ULCS#	Element	Floor	On Site Room Name	Student/Teacher Occupied	Component	Description of Paint and Plaster Damage	XRF (positive/negative)	Pre-Cleaning Completed (date)	Contents Moved (date)	Work Area Prepped (date)	Surfaces Stabilized (date)	Contents Back in Place (date)	Final Inspection Approval and Photos (date)	Square Footage of Work Area	Number of Required RRP Wipes	Number of Colorimetric Wipes Used to Pass	Final Colorimetric Wipe Submitted for AAS Analysis (yes/no)	AAS Analysis Results	Comments from Assessment	Comments from Oversight
1	8300	1	1	Classroom 101 Closet (Left)	yes	Shelf	Friction	Positive	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	Representative PLM sampling; HMID NAD	Contact paper installed by maintenance; Confirmed 01/03/2023 Synertech H. Santiago
2	8300	1	1	Classroom 101 Closet (Left)	yes	Shelf	Friction	Positive	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	Representative PLM sampling; HMID NAD	Contact paper installed by maintenance; Confirmed 01/03/2023 Synertech H. Santiago
3	8300	1	1	Classroom 101 Closet (Right)	yes	Shelf	Friction	Positive	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	Representative PLM sampling; HMID NAD	Contact paper installed by maintenance; Confirmed 01/03/2023 Synertech H. Santiago
4	8300	1	1	Classroom 101 Closet (Right)	yes	Shelf	Friction	Positive	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	Representative PLM sampling; HMID NAD	Contact paper installed by maintenance; Confirmed 01/03/2023 Synertech H. Santiago
5	8300	1	1	Classroom 115 Left Closet	yes	Shelves	Friction	Positive	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	Representative PLM sampling; HMID NAD	Contact paper installed by maintenance; Confirmed 01/03/2023 Synertech H. Santiago
6	8300	1	1	Classroom 115 Left Closet	yes	Shelves	Friction	Positive	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	Representative PLM sampling; HMID NAD	Contact paper installed by maintenance; Confirmed 01/03/2023 Synertech H. Santiago
7	8300	1	1	Classroom 102 Left Closet	yes	Shelves	Friction	Positive	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	Representative PLM sampling; HMID NAD	Contact paper installed by maintenance; Confirmed 01/03/2023 Synertech H. Santiago
8	8300	1	1	Classroom 102 Left Closet	yes	Shelves	Friction	Positive	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	Representative PLM sampling; HMID NAD	Contact paper installed by maintenance; Confirmed 01/03/2023 Synertech H. Santiago
9	8300	1	1	Classroom 114 Closet	yes	Shelves	Friction	Positive	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	Representative PLM sampling; HMID NAD	Contact paper installed by maintenance; Confirmed 01/03/2023 Synertech H. Santiago
10	8300	1	1	Classroom 114 Closet	yes	Shelves	Friction	Positive	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	Representative PLM sampling; HMID NAD	Contact paper installed by maintenance; Confirmed 01/03/2023 Synertech H. Santiago
11	8300	1	1	Classroom 103 Closet (Left)	yes	Shelves	Friction	Positive	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	Representative PLM sampling; HMID NAD	Contact paper installed by maintenance; Confirmed 01/03/2023 Synertech H. Santiago
12	8300	1	1	Classroom 103 Closet (Right)	yes	Shelves	Friction	Positive	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	Representative PLM sampling; HMID NAD	Contact paper installed by maintenance; Confirmed 01/03/2023 Synertech H. Santiago
13	8300	1	1	Classroom 113 Closet	yes	Shelves	Friction	Positive	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	Representative PLM sampling; HMID NAD	Contact paper installed by maintenance; Confirmed 01/03/2023 Synertech H. Santiago
14	8300	1	1	Classroom 104 Closet (Left)	yes	Shelves	Friction	Positive	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	Representative PLM sampling; HMID NAD	Contact paper installed by maintenance; Confirmed 01/03/2023 Synertech H. Santiago
15	8300	1	1	Book Closet across from Classroom 104	yes	Shelves	Friction	Positive	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	Representative PLM sampling; HMID NAD	Contact paper installed by maintenance; Confirmed 01/03/2023 Synertech H. Santiago
16	8300	1	1	Classroom 112 Left Closet	yes	Shelves	Friction	Positive	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	Representative PLM sampling; HMID NAD	Contact paper installed by maintenance; Confirmed 01/03/2023 Synertech H. Santiago
17	8300	1	1	Classroom 112 Left Closet	yes	Shelves	Friction	Positive	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	Representative PLM sampling; HMID NAD	Contact paper installed by maintenance; Confirmed 01/03/2023 Synertech H. Santiago
18	8300	1	1	Classroom 105 Left Closet	yes	Shelves	Friction	Positive	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	Representative PLM sampling; HMID NAD	Contact paper installed by maintenance; Confirmed 01/03/2023 Synertech H. Santiago
19	8300	1	1	Classroom 111 Left Closet	yes	Shelves	Friction	Positive	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	Representative PLM sampling; HMID NAD	Contact paper installed by maintenance; Confirmed 01/03/2023 Synertech H. Santiago
20	8300	1	1	Classroom 106 Closet (Left)	yes	Shelves	Friction	Positive	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	Representative PLM sampling; HMID NAD	Contact paper installed by maintenance; Confirmed 01/03/2023 Synertech H. Santiago
21	8300	1	1	Classroom 107 Closet	yes	Shelves	Friction	Positive	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	Representative PLM sampling; HMID NAD	Contact paper installed by maintenance; Confirmed 01/03/2023 Synertech H. Santiago
22	8300	1	1	Classroom 110 Closet	yes	Shelves	Friction	Positive	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	Representative PLM sampling; HMID NAD	Contact paper installed by maintenance; Confirmed 01/03/2023 Synertech H. Santiago

Task ID	ULCS#	E l e m e n t	F l o o r	On Site Room Name	Student/ Teacher Occupied	Component	Description of Paint and Plaster Damage	XRF (positive/ negative)	Pre-Cleaning Completed (date)	Contents Moved (date)	Work Area Prepped (date)	Surfaces Stabilized (date)	Contents Back in Place (date)	Final Inspection Approval and Photos (date)	Square Footage of Work Area	Number of Required RRP Wipes	Number of Colorimetric Wipes Used to Pass	Final Colorimetric Wipe Submitted for AAS Analysis (yes/no)	AAS Analysis Results	Comments from Assessment	Comments from Oversight
23	8300	1	1	Classroom 108 Left Closet	yes	Shelves	Friction	Positive	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	Representative PLM sampling; HMID NAD	Contact paper installed by maintenance; Confirmed 01/03/2023 Synertech H. Santiago
24	8300	1	1	Book Closet next to Classroom 119	yes	Shelves	Friction	Positive	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	Representative PLM sampling; HMID NAD	Contact paper installed by maintenance; Confirmed 01/03/2023 Synertech H. Santiago
25	8300	1	1	Classroom 120	yes	Shelf	Chipping	Positive	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	Representative PLM sampling; HMID NAD	Contact paper installed by maintenance; Confirmed 01/03/2023 Synertech H. Santiago
26	8300	1	1	Classroom 120	yes	Bench	Chipping	Positive	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	Representative PLM sampling; HMID NAD	Benches removed as part of classroom modernization
27	8300	1	1	Classroom 120	yes	Shelf	Chipping	Positive	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	Representative PLM sampling; HMID NAD	Contact paper installed by maintenance; Confirmed 01/03/2023 Synertech H. Santiago
28	8300	1	1	Auditorium Fan Room	yes	Door	Flaking	Positive	01/03/2023	01/03/2023	01/03/2023	01/03/2023	01/03/2023	01/03/2023	800	20	N/A	no	N/A	Representative PLM sampling; HMID NAD	
29	8300	1	1	Auditorium Fan Room	yes	Ductwork	Flaking	Positive	01/03/2023	01/03/2023	01/03/2023	01/03/2023	01/03/2023	01/03/2023	800	20	N/A	no	N/A	Representative PLM sampling; HMID NAD; Inside of fan unit not painted	
30	8300	1	1	Air Intake Room	yes	Door	Flaking	Positive	01/03/2023	01/03/2023	01/03/2023	01/03/2023	01/03/2023	01/03/2023	12	2	N/A	no	N/A	Representative PLM sampling; HMID NAD; Same door as in fan room	
31	8300	1	1	Hallway next to Main Office	yes	Crown Moulding	Chipping	Positive	01/03/2023	01/03/2023	01/03/2023	01/03/2023	01/03/2023	01/03/2023	18	3	N/A	no	N/A	Representative PLM sampling; HMID NAD	
32	8300	1	2	Classroom 201 Left Closet	yes	Shelves	Friction	Positive	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	Representative PLM sampling; HMID NAD	Contact paper installed by maintenance; Confirmed 01/03/2023 Synertech H. Santiago
33	8300	1	2	Classroom 201 Right Closet	yes	Shelves	Friction	Positive	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	Representative PLM sampling; HMID NAD	Contact paper installed by maintenance; Confirmed 01/03/2023 Synertech H. Santiago
34	8300	1	2	Classroom 203 Closet (Left)	yes	Shelves	Friction	Positive	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	Representative PLM sampling; HMID NAD	Contact paper installed by maintenance; Confirmed 01/03/2023 Synertech H. Santiago
35	8300	1	2	Classroom 203 Closet (Right)	yes	Shelves	Friction	Positive	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	Representative PLM sampling; HMID NAD	Contact paper installed by maintenance; Confirmed 01/03/2023 Synertech H. Santiago
36	8300	1	2	Classroom 202 Left Closet	yes	Shelves	Friction	Positive	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	Representative PLM sampling; HMID NAD	Contact paper installed by maintenance; Confirmed 01/03/2023 Synertech H. Santiago
37	8300	1	2	Classroom 205 Closet (Left)	yes	Shelves	Friction	Positive	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	Representative PLM sampling; HMID NAD	Contact paper installed by maintenance; Confirmed 01/03/2023 Synertech H. Santiago
38	8300	1	2	Classroom 205 Closet (Right)	yes	Shelves	Friction	Positive	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	Representative PLM sampling; HMID NAD	Contact paper installed by maintenance; Confirmed 01/03/2023 Synertech H. Santiago
39	8300	1	2	Classroom 206 Closet	yes	Shelves	Friction	Positive	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	Representative PLM sampling; HMID NAD	Contact paper installed by maintenance; Confirmed 01/03/2023 Synertech H. Santiago
40	8300	1	2	Classroom 207 Left Closet	yes	Shelves	Friction	Positive	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	Representative PLM sampling; HMID NAD	Contact paper installed by maintenance; Confirmed 01/03/2023 Synertech H. Santiago
41	8300	1	2	Classroom 208 Closet (Left)	yes	Shelves	Friction	Positive	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	Representative PLM sampling; HMID NAD	Contact paper installed by maintenance; Confirmed 01/03/2023 Synertech H. Santiago
42	8300	1	2	Classroom 209 Left Closet	yes	Shelves	Friction	Positive	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	Representative PLM sampling; HMID NAD	Contact paper installed by maintenance; Confirmed 01/03/2023 Synertech H. Santiago
43	8300	1	2	Classroom 210 Closet (Left)	yes	Shelves	Friction	Positive	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	Representative PLM sampling; HMID NAD	Contact paper installed by maintenance; Confirmed 01/03/2023 Synertech H. Santiago
44	8300	1	2	Classroom 211 Right Closet	yes	Shelves	Friction	Positive	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	Representative PLM sampling; HMID NAD	Contact paper installed by maintenance; Confirmed 01/03/2023 Synertech H. Santiago
45	8300	1	2	Classroom 211 Left Closet	yes	Shelves	Friction	Positive	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	Representative PLM sampling; HMID NAD	Contact paper installed by maintenance; Confirmed 01/03/2023 Synertech H. Santiago

Task ID	ULCS#	E l e m e n t	F l o o r	On Site Room Name	Student/ Teacher Occupied	Component	Description of Paint and Plaster Damage	XRF (positive/ negative)	Pre-Cleaning Completed (date)	Contents Moved (date)	Work Area Prepped (date)	Surfaces Stabilized (date)	Contents Back in Place (date)	Final Inspection Approval and Photos (date)	Square Footage of Work Area	Number of Required RRP Wipes	Number of Colorimetric Wipes Used to Pass	Final Colorimetric Wipe Submitted for AAS Analysis (yes/no)	AAS Analysis Results	Comments from Assessment	Comments from Oversight
46	8300	1	2	Classroom 214 Right Closet	yes	Shelves	Partially Inaccessible	Positive	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A		Contact paper installed by maintenance; Confirmed 01/03/2023 Synertech H. Santiago
47	8300	1	2	Classroom 214 Left Closet	yes	Shelves	Partially Inaccessible	Positive	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A		Contact paper installed by maintenance; Confirmed 01/03/2023 Synertech H. Santiago
48	8300	1	2	Classroom 213 Right Closet	yes	Shelves	Partially Inaccessible	Positive	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A		Contact paper installed by maintenance; Confirmed 01/03/2023 Synertech H. Santiago
49	8300	1	2	Classroom 213 Left Closet	yes	Shelves	Partially Inaccessible	Positive	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A		Contact paper installed by maintenance; Confirmed 01/03/2023 Synertech H. Santiago
50	8300	1	2	Classroom 217	yes	Built-in Shelving	Friction	Positive	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	Representative PLM sampling; HMID NAD	Contact paper installed by maintenance; Confirmed 01/03/2023 Synertech H. Santiago
51	8300	1	2	Classroom 217	yes	Built-in Shelving	Friction	Positive	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	Representative PLM sampling; HMID NAD	Contact paper installed by maintenance; Confirmed 01/03/2023 Synertech H. Santiago
52	8300	1	2	Classroom 217	yes	Bench	Friction	Positive	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	Representative PLM sampling; HMID NAD	Benches removed as part of classroom modernization
53	8300	1	2	Classroom 217	yes	Built-in Shelving	Friction	Positive	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	Representative PLM sampling; HMID NAD	Contact paper installed by maintenance; Confirmed 01/03/2023 Synertech H. Santiago
54	8300	B	1	Fan Room accessed from Main Office Hallway	yes	Door	Chipping	Positive	01/03/2023	01/03/2023	01/03/2023	01/03/2023	01/03/2023	01/03/2023	12	2	N/A	no	N/A		

**Appendix E**

**Lead Safe Certificate**



## Philadelphia Department of Public Health Certification of School Lead Safe Status

By signing this certificate, I confirm that I have done a visual inspection of the areas where children have access, including contact surfaces where children store their equipment or materials, and confirm these areas do not have deteriorated lead-based paint. A certified risk assessor or lead dust sampling technician completed verification wipe tests in accordance with the EPA's RRP guidelines and confirms they meet the EPA's cleanliness standard. A certified risk assessor or lead dust sampling technician collected interior dust wipe samples in compliance with EPA regulations in work areas and confirms they did not contain lead contaminated dust in excess of EPA dust lead standards in Pre-K, Kindergarten, and 1<sup>st</sup> Grade classrooms as well as the restrooms, offices, cafeterias, gymnasiums, and auditoriums these children routinely occupy. This certificate is valid for 4 years from date of verification.

**Mayfair Elementary School**

School Name

**3001 Princeton Avenue, Philadelphia, PA 19149**

Street Address

**Synertech Environmental LLC**

Certifying Company (print)

**NAT-F199601-1**

Risk Assessor, Lead Inspector PA Lic. #, EPA Firm Cert or Lead Dust Sampling Technician Cert #

Inspector/Risk Assessor or Dust Wipe Sampling Technician Name (Signature)

**01/04/2023**

Date of Verification

**Stephen Link, 215-400-5768, slink@philasd.org**

School Official Name, Telephone and E-mail Address

## **Appendix F**

### **Environmental Firm Certifications**



# United States Environmental Protection Agency

This is to certify that



Synertech, Inc.

has fulfilled the requirements of the Toxic Substances Control Act (TSCA) Section 402, and has received certification to conduct lead-based paint renovation, repair, and painting activities pursuant to 40 CFR Part 745.89

In the Jurisdiction of:

All EPA Administered States, Tribes, and Territories

This certification is valid from the date of issuance and expires April 11, 2024

NAT-F199601-1

Certification #

March 28, 2019

Issued On



A handwritten signature in black ink, appearing to read "Michelle Price".

Michelle Price, Chief

Lead, Heavy Metals, and Inorganics Branch

# CERTIFICATE OF COMPLETION

*THIS CERTIFICATE IS AWARDED TO*

**HAROLD SANTIAGO**

228 MOORE STREET, PHILADELPHIA, PA 19148

*FOR SUCCESSFULLY COMPLETING THE PRESCRIBED COURSE OF STUDY IN*

**RENOVATOR INITIAL— ENGLISH**

PER 40 CFR 745.225, LEAD RRP RULE

PRESENTED BY

ACCESS TRAINING SERVICES, INC.


7921 RIVER ROAD, PENNSAUKEN, NEW JERSEY 08110

CERTIFICATE NUMBER: R-I-18846-19-00050

COURSE DATE 5/24/19

EXPIRATION DATE 5/24/24

Mark Schlager  
Training Manager

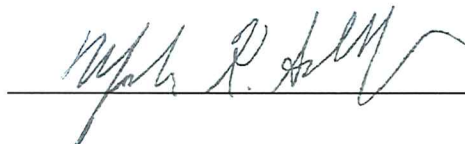



# CERTIFICATE OF COMPLETION

*THIS CERTIFICATE IS AWARDED TO*

**HAROLD SANTIAGO**

228 MOORE STREET, PHILADELPHIA, PA 19148

*FOR SUCCESSFULLY COMPLETING THE PRESCRIBED COURSE OF STUDY IN*

**DUST SAMPLING TECHNICIAN INITIAL- ENGLISH**

PRESENTED BY

ACCESS TRAINING SERVICES, INC.

7925 RIVER ROAD, PENNSAUKEN, NEW JERSEY 08110  
(856) 665-3449


CERTIFICATE NUMBER: D-I-18846-19-00060

COURSE DATE 5/22/19

EXAM DATE 5/22/19

EXPIRATION DATE 5/22/24

Mark Schlager  
Training Manager

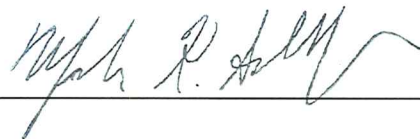

## **Appendix G**

### **Paint Contractor Certifications**

# United States Environmental Protection Agency

This is to certify that



School District of Philadelphia Office of  
Environmental Management Services

has fulfilled the requirements of the Toxic Substances Control Act (TSCA) Section 402, and has  
received certification to conduct lead-based paint renovation, repair, and painting activities  
pursuant to 40 CFR Part 745.89

In the Jurisdiction of:

All EPA Administered States, Tribes, and Territories

This certification is valid from the date of issuance and expires January 25, 2027

NAT-50914-3

Certification #

January 11, 2022

Issued On



A handwritten signature in black ink that reads "Michelle Price".

Michelle Price, Chief

Lead, Heavy Metals, and Inorganics Branch

# ***CRITERION LABORATORIES, INC.***

400 STREET ROAD, BENSALEM, PA 19020  
PHONE: (215) 244-1300, FAX: (215) 244-4349  
WWW.CRITERIONLABS.COM

## ***Certificate of Attendance and Successful Completion***

**Lead RRP Initial – English**  
**Per 40 CFR Part 745.225**

***John Petrucci***

**4610 Smick St., Philadelphia, PA 19127**

**Certificate Number: R-I-19014-22-753594**



***Course Date: 2/2/2022***  
***Examination Date: 2/2/2022***  
***Expiration Date: 2/2/2027***



---

**JAMES A. WELTZ, CIH**  
***Training Manager / Principal Instructor***



# CERTIFICATE OF COMPLETION

*THIS CERTIFICATE IS AWARDED TO*

**JOHN JORDAN**

6812 HENRY AVENUE, PHILADELPHIA, PA 19128

*FOR SUCCESSFULLY COMPLETING THE PRESCRIBED COURSE OF STUDY IN*

**RENOVATOR INITIAL- ENGLISH**

PER 40 CFR 745.225, LEAD RRP RULE

PRESENTED BY  
ACCESS TRAINING SERVICES, INC.  
7921 RIVER ROAD, PENNSAUKEN, NEW JERSEY 08110

CERTIFICATE NUMBER: R-I-18846-22-00107

COURSE DATE: 11/28/22

EXAM DATE: 11/28/22

EXPIRATION DATE: 11/28/27

Mark Schlager  
Training Manager



## **Appendix H**

### **Documentation of Parent and Staff Notification**





Mayfair Elementary School  
3001 Princeton Avenue,  
Philadelphia, PA 19149

Principal: William Day

Phone: 215-400-3280

---

### **Notice of Paint and Plaster Stabilization Work**

Dear Mayfair Elementary School Community,

The School District of Philadelphia is conducting paint and plaster stabilization work in buildings constructed prior to 1978 to help minimize the potential risk of lead exposure, and Mayfair Elementary School has been selected to be part of this important, proactive work toward creating a safer and welcoming environment for our school community.

Beginning Tuesday, January 03, 2023, certified environmental contractors will work in the evening, when students and staff will not occupy work areas. All paint stabilization work will be monitored by third party licensed inspectors in order to confirm the spaces are ready for students and staff to safely re-occupy. We expect this work to take two weeks to complete.

Paint stabilization involves removing loose, peeling, flaking and crumbling paint and plaster under controlled conditions, and then applying a non-lead based paint to the prepared surface. The goal of the District-wide effort is to enhance classroom environments and remove the potential risk of exposure to children and staff in our school community. Our school has been selected for this work because paint damage was documented in certain parts of our building.

The experts completing this work are trained and certified in U.S. Environmental Protection Agency (EPA) lead-based paint renovation, repair and painting work practices.

After the work is completed, a full report on the project will be available on the District's [Lead Safe](#) web page. For more information about lead prevention efforts, please contact the Lead Prevention Unit of the Philadelphia Department of Health at (215) 685-2788 or visit <http://www.phila.gov/health/childhoodlead>.

Thank you for your understanding as we work toward our goal of creating safer learning spaces for our students and staff.

Sincerely,

William Day, Principal