



# ***Summary of Paint & Plaster Stabilization Activities***



***Field  
Services***

**At:**

**#1490 – Rudolph Blankenburg School  
4600 W. Girard Avenue  
Philadelphia, PA 19131**

**For:**

**Mr. Edward Escobio  
Operations Project Manager  
School District of Philadelphia  
Office of Environmental Management &  
Services  
440 North Broad Street, 3<sup>rd</sup> Floor – Portal C  
Philadelphia, PA 19130**



***Lab  
Services***

**Prepared By:**

**Mr. Ananth K. Vinjamuri  
Project Manager**

**Report Date:**

**November 10, 2020**

**Project Number:**

**191977 & 193071**

**Dates of Project:**

**July 31- August 30, 2019 &  
December 16, 2019 - February 10, 2020**



***Training  
Services***

**Summary of Paint and Plaster Stabilization Activities**  
**School Name: Rudolph Blankenburg School**  
**Address: 4600 W. Girard Avenue**  
**Philadelphia, PA 19131**  
**UCLS #: 1490**

**TABLE OF CONTENTS**

**I. Introduction**

**II. Methods Executive Summary**

**A. Preliminary Steps**

- i. Parent and Staff Notifications**
- ii. Decluttering**
- iii. Wall Hangings**
- iv. Swing Space**
- v. Facilities Building Cleaning Staff Training**

**B. Pre-Cleaning**

**C. Paint & Plaster Stabilization Procedures**

- i. Work Practices**
- ii. Oversight**

**D. Cleanup & Completion**

- i. Cleanup**
- ii. Testing**

**III. Oversight**

**A. Scope of Work**

**B. EPA Checklist**

**C. Oversight**

**D. Sample Results**

**Appendix A. Scope of Work Table**

**Appendix B. EPA Checklist Table**

**Appendix C. Oversight Table**

**Appendix D. Sample Results Table**

**Appendix E. Photographs (included in the report)**

**Appendix F. Environmental Firm Certification Documentation of Training**

**Appendix G. Paint Contractor Certifications or Documentation of Training**

## **I. INTRODUCTION**

Criterion Laboratories, Inc. (Criterion), was requested by the School District of Philadelphia's Office of Environmental Management Services (OEMS) to perform oversight and clearance testing during a paint and plaster stabilization project being performed by the School District Painters at Rudolph Blankenburg Elementary School located at 4600 W. Girard Avenue, in Philadelphia, PA (the "School"). The purpose of the oversight was to document that all parts of the US Environmental Protection Agency (EPA) Lead Renovation, Repair and Painting rules were being followed and documented. During the stabilization activities in the Summer of 2019, the closets were not stabilized and as per the School, they were sealed off until addressed later. This report includes the initial and follow up lead stabilization activities performed at the school.

## **II. METHODS EXECUTIVE SUMMARY**

### **A. Preliminary Steps**

#### **i. Parent and Staff Notifications**

Parents and staff were notified of the paint and plaster project by mail several weeks prior to the commencement of the project. Additionally, prior to the start of the project, parent and staff meetings were held by OEMS, Maintenance, and Operations to explain the process of the paint and plaster projects and to field any questions or concerns.

#### **ii. Decluttering**

Classrooms, closets and other storage areas were decluttered prior to the commencement of stabilization work. Coordination of the decluttering activities was made between teachers and facilities staff to ensure that outdated and unneeded academic materials were discarded, and that resources were provided to assist in the decluttering tasks such as support staff for heavy lifting and/or moving large furniture and additional recycling dumpsters.

#### **iii. Wall Hangings**

Posters, bulletin boards, framed art and other wall hangings were removed prior to the commencement of the paint stabilization project. This was coordinated with teachers by the Operations Division at the kick-off meeting, and during the phasing of the project, with the help of the Principal.

#### **iv. Swing Space**

Swing space was identified prior to the commencement of stabilization work to ensure that classrooms were available during the school year. A plan was created on a school-by-school basis to relocate students and teachers from classrooms during the course of this work. All work areas were scheduled for cleaning by facilities staff after the paint stabilization work was completed by Maintenance Painting Staff.

## **v. Facilities Building Cleaning Staff Training**

Facilities Building Cleaning Staff were provided with information about this project and expectations for post-cleaning, including use of wet-wipes and HEPA vacuums.

### **B. Pre-Cleaning**

On an as-needed basis, for areas such as cluttered storage closets, that required extensive movement of materials, HEPA vacuuming, and wet-wiping prior to paint and plaster stabilization, the Maintenance Environmental staff performed a pre-cleaning in advance of stabilization work. The intent of this task was to provide a clean work area prior to decluttering and stabilization.

Additionally, post-cleaning was conducted by facilities staff after paint and plaster stabilization was completed. This included the HEPA vacuuming and wet-wiping of all horizontal surfaces and polishing floors.

### **C. Paint & Plaster Stabilization Procedures**

Paint and plaster stabilization work complied with the EPA's Lead RRP rule. All staff conducting this work were trained and/or certified as Lead RRP workers.

The following procedures were followed:

#### **i. Work Practices**

- Isolate work areas to restrict dust from impacting adjacent areas.
- Post signs/notifications as per EPA Lead RRP.
- Place "walk-off" pads at all access points into/out of work area.
- Seal all openings [windows, doors, and HVAC system registers/grilles] inside work areas as per direction from on-site environmental monitors and consistent with the EPA Lead RRP rules & guidelines.
- Workers are to wear disposable clothing and foot coverings while inside work areas and will not leave work areas wearing disposable clothing.
- Move/cover all remaining objects in work area to protect them. Including all open bins, shelves and boxes in the classroom.
- Employ/Erect "portable" dust containment barrier systems to limit the size of work areas requiring post-cleaning and limit testing and exposure.
- Place plastic floor coverings to extend at least 6 feet out from vertical surfaces being stabilized unless utilizing vertical barriers/containment systems.
- Perform all paint stabilization work in compliance with the EPA Lead RRP rules & guidelines and as per the directions of on-site environmental monitors to minimize dust contamination.
- Take all steps necessary to ensure that no dust or debris leaves the work area while the work is being performed.

- Use precautions to ensure that all employees, tools, and other items, including the exteriors of waste containers, are free of dust and debris before leaving the work area.
- Collect all paint chips & debris, fold up plastic floor coverings and any other plastic sheeting used on horizontal surfaces, without dispersing dust or debris and dispose of the material in heavy duty plastic waste bags.
- Do not use power tools.
- Do not use dry sweeping with brooms.
- Do use water/misting during stabilization to minimize dust.
- Do use HEPA vacuums and wet wiping/cleaning techniques.

## **ii. Oversight**

The environmental technician will oversee paint and plaster stabilization work to ensure compliance with lead safe work practices. An oversight report will be completed at the end of every shift to record the work areas that were stabilized. The following tasks will be verified and recorded:

- Pre-cleaning
- Contents moved
- Work area prepped
- Surfaces stabilized
- Contents back in place
- Final inspection approval and photos

## **D. Cleanup & Completion**

The following clean-up and completion procedures were performed for each work area following the completion of stabilization work:

### **i. Cleanup**

- There should be no signs of loose, peeling, flaking, bubbling or crumbling paint or plaster visible on walls or ceilings or on any other painted surfaces.
- There should be no visible signs of paint chips, debris or dust of any kind on surfaces within “contained” and isolated work areas NOR outside of the contained and isolated work areas.
- Window sills, floors, baseboards, shelving units, tops of cabinets, desks, chairs, tables and all other horizontal surfaces must be free of any visible signs of paint and plaster dust and/or debris.
- There must be absolutely no visible signs of paint chips, and/or paint/plaster dust or debris on academic/educational materials, including books, bins, toys, desks, chairs, carpets, papers, etc., after each work shift and to allow for re-occupancy the next day.

- Any remaining paint and plaster must be tightly adhered to wall and ceiling surfaces such that it cannot be further damaged, pried off or disturbed by “simple fingernail pressure” otherwise work will not be considered to be successfully completed.
- Newly painted surfaces should match the aesthetics of the area in total and should cover the entirety of the wall or ceiling area that was addressed through this work. No visible “patches” of paint should be observed.

## **ii. Testing**

The District and the PFT’s Environmental Consultant worked closely to develop an agreed upon approach to verify that stabilization work was performed in accordance with lead safe work practices, and that classrooms would be safe for re-occupancy by children and staff. This approach exceeds the EPA Lead RRP rule requirements in terms of the types of, and amounts of, testing performed. Testing will take place in work areas. The areas will be cleaned by general cleaners after the stabilization work is completed and the clearance testing is performed.

Qualitative testing methods, i.e., EPA RRP verification wipe testing and colorimetric wipe testing, will be compared with the quantitative testing method of Atomic Absorption Spectrophotometry (AAS) as indicated in the testing protocol below. If the comparison testing is consistently correlated, only qualitative testing will continue for the duration of the project.

### **a. Testing Protocol**

#### **Step 1 -- EPA RRP Verification Wipes and Colorimetric Wipes**

The environmental consultant and painter foreman will coordinate the EPA RRP Verification Test Wipe in rooms/areas that have been stabilized and cleaned, and where plastic work area coverings have been removed and visual inspection conducted. After EPA RRP verification wipes pass the cleanliness standard for any surface and/or a 40 square feet (SF) section, the colorimetric testing will be conducted by the environmental consultant.

The colorimetric wipe tests will occur in “child-occupied areas” on approximately 10% of surfaces considered “clean” following the use of the verification wipes. These surfaces may include floors, window sills, or the tops of any other immovable objects that were covered and cleaned in each work area (e.g. CUVs, immovable bookshelves). Additional colorimetric wipes may be collected on surfaces that had been moved and covered and placed outside of the work area. These surfaces may include desks, chairs, bookshelves, etc.

“Child-occupied areas” will include: classrooms, restrooms, cafeterias, gymnasiums, and auditoriums that are routinely used by children in PK-1st grade classrooms. Common areas that children in PK-1st grade classrooms only pass

through, such as hallways, stairways, and garages are not included. “Child-occupied areas” will be identified by the Principal of each school.

### **Step 2 -- Response to Failed Tests**

If colorimetric testing “fails,” then the 40 SF area will be re-wiped by EPA RRP Wipes. The process will continue until both testing methods confirm a “pass.”

### **Step 3 -- Flame Atomic Absorption Spectrophotometry (FAAS)**

Flame Atomic Absorption Spectrophotometry (FAAS) will be used to verify and confirm the results of the colorimetric testing. FAAS will be used as a quality assurance/quality control for the colorimetric samples. Approximately 10% of the colorimetric samples should be submitted for FAAS analysis.

### **Step 4 -- Release Spaces Back to School/Operations**

If EPA RRP wipes and colorimetric wipes are both acceptable, as determined on site, and if work was completed in accordance with this procedure, the room will be turned over to the District’s Operations team for “deep cleaning” and for re-occupancy.

### **Step 5 — Ongoing Review**

All sampling and testing data, information and results will be readily available and accessible for review by school staff, parents and members of the Oversight Advisory Committee and will be reviewed on a regular basis. Any suggested modifications, changes or other revisions will be considered by the School District of Philadelphia.

The three testing methods were conducted as follows:

<b>Type of Clearance Tests</b>	<b>Building Component</b>	<b>Number of Sample Locations within Work Area</b>	<b>Type of Testing</b>	<b>Testing Specifications/Limitations</b>
EPA RRP Cleaning Verification Wipe	Floors, Countertops, Desks, Tables, Window Sills	One (1) wipe every 40 square feet (ft <sup>2</sup> ) or entire surface of component if surface area is less than 40ft <sup>2</sup> One (1) wipe for every window sill	Qualitative	<ul style="list-style-type: none"><li>● Qualitative testing based on cleanliness (white glove test)</li><li>● According to RRP, the areas pass after the 3rd cleaning, regardless of verification</li></ul>

Type of Clearance Tests	Building Component	Number of Sample Locations within Work Area	Type of Testing	Testing Specifications/Limitations
Colorimetric Wipe SKC, Inc. Full Disclosure® Instant Wipes	Floors, Countertops, Desks, Tables, Window Sills, Etc.	10% of surfaces considered “clean” following the use of EPA RRP Cleaning Verification Wipes	Qualitative	<ul style="list-style-type: none"> <li>• Qualitative testing based on colorimetric visual comparison</li> <li>• Lower Limit of Visual Detection is 18µg of lead</li> <li>• False positive and false negative interferences from silver, cadmium, barium, mercury, and titanium (percentages unknown)</li> <li>• Involves field preparation of sampling media using reagents</li> </ul>
Flame Atomic Absorption Spectrophotometry (AAS)	Analyze Colorimetric Wipes from locations listed above	A minimum of one and a maximum of 10% of colorimetric wipes will also be subjected to laboratory analysis by FAAS for verification. This testing method will be used on a periodic basis to validate the accuracy of qualitative methods above.	Quantitative	<ul style="list-style-type: none"> <li>• Interior Floors and Desks: &lt; 20 µg/ft<sup>2</sup> This is based upon a District and PFT agreement. This is half the current HUD and EPA standard. This is tied to the detection level for the colorimetric wipe which is 18µg per wipe.</li> <li>• Window Sills: &lt; 100 µg/ft<sup>2</sup> per HUD</li> </ul> <p>The new standards were followed after they were enacted.</p>

### **III. OVERSIGHT**

#### **A. Scope of Work**

A scope of work was developed for Rudolph Blankenburg Elementary School following a room-by-room inspection of the school. During the inspection, the location and quantity of damaged paint and plaster, along with any associated debris and whether the damage was the result of an on-going moisture intrusion, were noted. The Assessment Scope of Work was limited to the Interior, below the suspended ceiling/enclosed ceiling, and Student/Teacher occupied areas only. This information was entered into a scope of work spreadsheet, which was provided to the School District Painting Department in order to create a schedule for the work to be completed.

The scope of work for Rudolph Blankenburg Elementary School is included in the Appendix A of this report.

The stabilization activities had begun in the Summer of 2019, However, there were rooms that were not accessible during the initial assessment, were then assessed and damage was documented. The follow up stabilization activities included all these rooms.

#### **B. EPA Checklist**

Throughout the paint and plaster stabilization project, Criterion's on-site inspector observed, documented, and signed-off on tasks required by the EPA RRP. Additional notes were added to the EPA Checklist to document different oversight tasks that took place. These included documenting that warning signs were posted at the entrance to the work area, that the work area had been contained to prevent the spread of dust and debris, that all objects in the work area had been removed or covered, that all HVAC ducts in the work area were closed and covered, that windows in the work area were closed, that doors in the work area were closed and sealed, that doors that must be used in the work area were covered to allow passage but prevent the spread of dust, that floors in the work area were covered with taped-down plastic, that waste was being contained while on-site and while being transported, that the work site was properly cleaned after the renovations, that all paint chips and debris were picked up and that the protective sheeting was misted, folded dirty-side inward, and taped for removal, that the work area surfaces and objects were cleaned using HEPA vacuums and/or wet-wiping or mopping, that a certified renovator performed the post-renovation cleaning verification, a description of the post-renovation cleaning verification, including the number of wet and dry cloths used, and if the dust clearance testing was performed.

The EPA Checklist for Rudolph Blankenburg Elementary School is included in the Appendix B of this report.

### **C. Oversight**

Throughout the paint and plaster stabilization project, Criterion's on-site inspector documented the day-to-day tasks performed for each work area. These tasks included the dates of pre-cleaning, the moving of the contents of the room, the prepping of the work area, the stabilization of the painted surfaces, and the final inspection.

The Oversight Table for Rudolph Blankenburg Elementary School is included in the Appendix C of this report.

### **D. Sample Results**

Throughout the paint and plaster stabilization project, Criterion's on-site inspector documented all sampling results for each work area location. This included all RRP verification wipes, colorimetric wipes, and wipes to be submitted for Flame AAS analysis.

The Sample Results Table for Rudolph Blankenburg Elementary School is included in the Appendix D of this report.

## ***Appendix A. Scope of Work Table***

Rudolph Blankenburg ES  
Scope of Work

<i>Task ID</i>	<i>ULCS#</i>	<i>E l e m e n t</i>	<i>F l o o r</i>	<i>Space # (on Floor Plan)</i>	<i>Space Type</i>	<i>On Site Room Name</i>	<i>Student/ Teacher Occupied</i>	<i>Primary Component</i>	<i>Description of Paint and Plaster Damage - Primary Component</i>	<i>Primary Component Damage Quantity (sf)</i>	<i>Additional Component (see terms)</i>	<i>Description of Paint and Plaster Damage - Additional Component</i>	<i>Additoinal Component Damage Quantity (sf)</i>	<i>Comments</i>
1	1490	1	1	103D	Auditorium	Auditorium	yes	W3	Damaged plaster	1	N/A	N/A	N/A	Far right corner near the stage
2	1490	1	1	103D	Auditorium	Auditorium	yes	W3	N/A	N/A	Conduit pipe	Cracking	6	Far right corner near the stage
3	1490	1	1	103D	Auditorium	Auditorium	yes	Ceiling	Flaking	40	N/A	N/A	N/A	Too high to test at the ceiling. Test result is from testing a fallen paint chip
4	1490	1	1	101K	Primary	Classroom K1	yes	W1	Chipping	1	N/A	N/A	N/A	
5	1490	1	1	101K	Primary	Classroom K1	yes	W3	Cracking	2	N/A	N/A	N/A	
6	1490	1	1	101K	Primary	Classroom K1	yes	W3	N/A	N/A	Columns	Chipping/Flaking	5	
7	1490	1	1	101K	Primary	Classroom K1	yes	W4	Chipping	1	N/A	N/A	N/A	
8	1490	1	1	102K	Storage	Classroom K1 Closet	yes	W4	Partially Inaccessible	1	N/A	N/A	N/A	
9	1490	1	1	102K	Storage	Classroom K1 Closet	yes	W4	N/A	N/A	Pipe	Chipping	2	
10	1490	1	1	102K	Storage	Classroom K1 Closet	yes	Ceiling	Cracking	4	N/A	N/A	N/A	
11	1490	1	1	101KA	Storage	Classroom K1 Teacher's Closet (in front of room)	yes	W1	Partially Inaccessible	0	N/A	N/A	N/A	Closet is filled with teachers items. No damage noted in visible areas
12	1490	1	1	101KA	Storage	Classroom K1 Teacher's Closet (in front of room)	yes	W2	Partially Inaccessible	0	N/A	N/A	N/A	Closet is filled with teachers items. No damage noted in visible areas
13	1490	1	1	101KA	Storage	Classroom K1 Teacher's Closet (in front of room)	yes	W3	Partially Inaccessible	0	N/A	N/A	N/A	Closet is filled with teachers items. No damage noted in visible areas
14	1490	1	1	101KA	Storage	Classroom K1 Teacher's Closet (in front of room)	yes	W4	Partially Inaccessible	0	N/A	N/A	N/A	Closet is filled with teachers items. No damage noted in visible areas
15	1490	1	1	102KA	Student Restrooms - Male/Female (Classroom)	Classroom K1 Restroom	yes	W1	Chipping	1	N/A	N/A	N/A	
16	1490	1	1	102KA	Student Restrooms - Male/Female (Classroom)	Classroom K1 Restroom	yes	W3	Chipping	5	N/A	N/A	N/A	
17	1490	1	1	102KA	Student Restrooms - Male/Female (Classroom)	Classroom K1 Restroom	yes	W3	N/A	N/A	Columns	Efflorescence/Chipping	5	
18	1490	1	1	102KA	Student Restrooms - Male/Female (Classroom)	Classroom K1 Restroom	yes	W4	Chipping	5	N/A	N/A	N/A	
19	1490	1	1	103FB	Storage	Storage Closet (with Gate) across from Classroom K1	yes	W2	Cracking	2	N/A	N/A	N/A	
20	1490	1	1	103FB	Storage	Storage Closet (with Gate) across from Classroom K1	yes	W3	Chipping	5	N/A	N/A	N/A	
21	1490	1	1	103FB	Storage	Storage Closet (with Gate) across from Classroom K1	yes	W4	Chipping	2	N/A	N/A	N/A	
22	1490	1	1	103FB	Storage	Storage Closet (with Gate) across from Classroom K1	yes	Ceiling	Chipping	8	N/A	N/A	N/A	
23	1490	1	1	103FC	Storage	Storage Closet (Band Instruments) across from Girl's Restroom	yes	W2	Chipping	3	N/A	N/A	N/A	
24	1490	1	1	103FC	Storage	Storage Closet (Band Instruments) across from Girl's Restroom	yes	W3	Chipping	2	N/A	N/A	N/A	
25	1490	1	1	103FC	Storage	Storage Closet (Band Instruments) across from Girl's Restroom	yes	W4	Chipping	5	N/A	N/A	N/A	
26	1490	1	1	103FC	Storage	Storage Closet (Band Instruments) across from Girl's Restroom	yes	Ceiling	Chipping	10	N/A	N/A	N/A	
27	1490	1	1	S18	Stairs	Stairwell G (near Girl's Restroom)	yes	W1	Chipping	1	N/A	N/A	N/A	Entrance to 1st Floor hallway
28	1490	1	1	S18	Stairs	Stairwell G (near Girl's Restroom)	yes	W1	N/A	N/A	Door	Chipping	5	
29	1490	1	1	S18	Stairs	Stairwell G (near Girl's Restroom)	yes	W2	Chipping	1	N/A	N/A	N/A	
30	1490	1	1	S18	Stairs	Stairwell G (near Girl's Restroom)	yes	W2	N/A	n/a	Baseboard	Chipping	1	
31	1490	1	1	S18	Stairs	Stairwell G (near Girl's Restroom)	yes	W3	N/A	N/A	Stair tread	Chipping	5	
32	1490	1	1	S18	Stairs	Stairwell G (near Girl's Restroom)	yes	W3	N/A	N/A	Stair riser	Chipping	5	

Rudolph Blankenburg ES  
Scope of Work

<i>Task ID</i>	<i>ULCS#</i>	<i>E l e m e n t</i>	<i>F l o o r</i>	<i>Space # (on Floor Plan)</i>	<i>Space Type</i>	<i>On Site Room Name</i>	<i>Student/ Teacher Occupied</i>	<i>Primary Component</i>	<i>Description of Paint and Plaster Damage - Primary Component</i>	<i>Primary Component Damage Quantity (sf)</i>	<i>Additional Component (see terms)</i>	<i>Description of Paint and Plaster Damage - Additional Component</i>	<i>Additoinal Component Damage Quantity (sf)</i>	<i>Comments</i>
33	1490	1	1	S18	Stairs	Stairwell G (near Girl's Restroom)	yes	W3	N/A	N/A	Stair stringer	Chipping	5	
34	1490	1	1	S18	Stairs	Stairwell G (near Girl's Restroom)	yes	W3	N/A	N/A	Spindle	Chipping	2	
35	1490	1	1	S18	Stairs	Stairwell G (near Girl's Restroom)	yes	W3	Chipping	3	N/A	N/A	N/A	Landing between 1st and 2nd Floor
36	1490	1	1	S18	Stairs	Stairwell G (near Girl's Restroom)	yes	W4	Chipping	2	N/A	N/A	N/A	
37	1490	1	1	103	Primary	Classroom 103	yes	W1	Chipping/Cracki ng	2	N/A	N/A	N/A	
38	1490	1	1	103	Primary	Classroom 103	yes	W2	Chipping	2	N/A	N/A	N/A	
39	1490	1	1	103	Primary	Classroom 103	yes	W3	Chipping/Cracki ng	5	N/A	N/A	N/A	
40	1490	1	1	103	Primary	Classroom 103	yes	W3	N/A	N/A	Columns	Cracking/Flakin g	5	Tan is bottom. Top is white
41	1490	1	1	103	Primary	Classroom 103	yes	W4	Chipping	1	N/A	N/A	N/A	
42	1490	1	1	103	Primary	Classroom 103	yes	Ceiling	Efflorescence	10	N/A	N/A	N/A	Damage is near windows
43	1490	1	1	103A	Storage	Classroom 103 Closet	yes	W1	Partially Inaccessible/Chi pping	2	N/A	N/A	N/A	
44	1490	1	1	103A	Storage	Classroom 103 Closet	yes	W2	Partially Inaccessible	0	N/A	N/A	N/A	
45	1490	1	1	103A	Storage	Classroom 103 Closet	yes	W3	Partially Inaccessible/Chi pping	5	N/A	N/A	N/A	
46	1490	1	1	103A	Storage	Classroom 103 Closet	yes	W4	Partially Inaccessible/Effl orescence/Flaki ng	3	N/A	N/A	N/A	
47	1490	1	1	103A	Storage	Classroom 103 Closet	yes	Ceiling	Chipping/Cracki ng	5	N/A	N/A	N/A	
48	1490	1	1	102	Primary	Classroom 102	yes	W3	Efflorescence/C hipping	5	N/A	N/A	N/A	
49	1490	1	1	102	Primary	Classroom 102	yes	W3	N/A	N/A	Columns	Chipping	3	
50	1490	1	1	102	Primary	Classroom 102	yes	Ceiling	Chipping	3	N/A	N/A	N/A	Damage is near windows
51	1490	1	1	101	Primary	Classroom 101	yes	W1	Chipping	5	N/A	N/A	N/A	
52	1490	1	1	101	Primary	Classroom 101	yes	W2	Chipping	3	N/A	N/A	N/A	
53	1490	1	1	101	Primary	Classroom 101	yes	W3	N/A	N/A	Columns	Chipping	5	
54	1490	1	1	101	Primary	Classroom 101	yes	W4	Chipping	2	N/A	N/A	N/A	
55	1490	1	1	101	Primary	Classroom 101	yes	Ceiling	Chipping	5	N/A	N/A	N/A	
56	1490	1	1	101B	Storage	Classroom 101 Closet	yes	W1	None	0	N/A	N/A	N/A	Door has a padlock on it
57	1490	1	1	101B	Storage	Classroom 101 Closet	yes	W2	Efflorescence, Flaking	15	N/A	N/A	N/A	Door has a padlock on it
58	1490	1	1	101B	Storage	Classroom 101 Closet	yes	W3	None	0	N/A	N/A	N/A	Door has a padlock on it
59	1490	1	1	101B	Storage	Classroom 101 Closet	yes	Ceiling	None	0	N/A	N/A	N/A	Door has a padlock on it
60	1490	1	1	101C	Student Restrooms - Male/Female (Classroom)	Classroom 101 Restroom	yes	W3	Chipping	3	N/A	N/A	N/A	
61	1490	1	1	101C	Student Restrooms - Male/Female (Classroom)	Classroom 101 Restroom	yes	W4	Cracking	5	N/A	N/A	N/A	
62	1490	1	1	101C	Student Restrooms - Male/Female (Classroom)	Classroom 101 Restroom	yes	Ceiling	Efflorescence/C hipping	5	N/A	N/A	N/A	

Rudolph Blankenburg ES  
Scope of Work

<i>Task ID</i>	<i>ULCS#</i>	<i>E l e m e n t</i>	<i>F l o o r</i>	<i>Space # (on Floor Plan)</i>	<i>Space Type</i>	<i>On Site Room Name</i>	<i>Student/ Teacher Occupied</i>	<i>Primary Component</i>	<i>Description of Paint and Plaster Damage - Primary Component</i>	<i>Primary Component Damage Quantity (sf)</i>	<i>Additional Component (see terms)</i>	<i>Description of Paint and Plaster Damage - Additional Component</i>	<i>Additoinal Component Damage Quantity (sf)</i>	<i>Comments</i>
63	1490	1	1	S11	Stairs	Stairwell adjacent to Classroom 101	yes	W2	Chipping	5	N/A	N/A	N/A	
64	1490	1	1	S11	Stairs	Stairwell adjacent to Classroom 101	yes	W4	Chipping	5	N/A	N/A	N/A	
65	1490	1	1	101A	Restrooms, Staff - Female	Women's Restroom next to Classroom 101	yes	W3	Efflorescence	5	N/A	N/A	N/A	At windows
66	1490	1	1	101A	Restrooms, Staff - Female	Women's Restroom next to Classroom 101	yes	W3	N/A	N/A	Columns	Efflorescence	5	
67	1490	1	1	101A	Restrooms, Staff - Female	Women's Restroom next to Classroom 101	yes	W4	Cracking	10	N/A	N/A	N/A	
68	1490	1	1	101A	Restrooms, Staff - Female	Women's Restroom next to Classroom 101	yes	Ceiling	Efflorescence	5	N/A	N/A	N/A	
69	1490	1	1	H111	Circulation (Hallway)	Fire Tower Hallway adjacent to Hallway from Classrooms 101 to 103	yes	W1	Cracking	20	N/A	N/A	N/A	
70	1490	1	1	H111	Circulation (Hallway)	Fire Tower Hallway adjacent to Hallway from Classrooms 101 to 103	yes	W2	Cracking	20	N/A	N/A	N/A	
71	1490	1	1	H111	Circulation (Hallway)	Fire Tower Hallway adjacent to Hallway from Classrooms 101 to 103	yes	W2	N/A	N/A	Window sill/Grate	Chipping	8	
72	1490	1	1	H111	Circulation (Hallway)	Fire Tower Hallway adjacent to Hallway from Classrooms 101 to 103	yes	W3	Cracking	20	N/A	N/A	N/A	
73	1490	1	1	H111	Circulation (Hallway)	Fire Tower Hallway adjacent to Hallway from Classrooms 101 to 103	yes	W3	N/A	N/A	Window sill/Grate	Chipping	8	
74	1490	1	1	H111	Circulation (Hallway)	Fire Tower Hallway adjacent to Hallway from Classrooms 101 to 103	yes	W4	Cracking	20	N/A	N/A	N/A	
75	1490	1	1	H111	Circulation (Hallway)	Fire Tower Hallway adjacent to Hallway from Classrooms 101 to 103	yes	Ceiling	Chipping	20	N/A	N/A	N/A	
76	1490	1	1	S13	Stairs	Fire Tower Stairs adjacent to Hallway from Classrooms 101 to 103	yes	W4	N/A	N/A	Window frame	Flaking	8	
77	1490	1	1	S13	Stairs	Fire Tower Stairs adjacent to Hallway from Classrooms 101 to 103	yes	Floor	N/A	N/A	Stair stringer	Chipping	5	
78	1490	1	1	S13	Stairs	Fire Tower Stairs adjacent to Hallway from Classrooms 101 to 103	yes	Floor	N/A	N/A	Stair tread	Chipping	5	
79	1490	1	1	S13	Stairs	Fire Tower Stairs adjacent to Hallway from Classrooms 101 to 103	yes	Floor	N/A	N/A	Stair riser	Chipping	5	
80	1490	1	1	H16	Circulation (Hallway)	Hallway along Classrooms 101 to 103 (to Custodial Closet)	yes	W1	Chipping	2	N/A	N/A	N/A	Top of wall near door to fire tower
81	1490	1	1	H16	Circulation (Hallway)	Hallway along Classrooms 101 to 103 (to Custodial Closet)	yes	W3	Chipping	1	N/A	N/A	N/A	Top part of wall above water fountian
82	1490	1	1	H16	Circulation (Hallway)	Hallway along Classrooms 101 to 103 (to Custodial Closet)	yes	W3	Chipping	3	N/A	N/A	N/A	Under water fountian
83	1490	1	1	102C	Administrative Office	Main Office	yes	W4	Efflorescence/Flaking	3	N/A	N/A	N/A	
84	1490	1	1	102C	Administrative Office	Main Office	yes	Ceiling	Efflorescence/Chipping	5	N/A	N/A	N/A	
85	1490	1	1	H15	Circulation (Hallway)	Hallway from Stairwell near Classroom K1 to Stairwell near Classroom K4	yes	W4	Efflorescence, Flaking	16	N/A	N/A	N/A	
86	1490	1	1	H15	Circulation (Hallway)	Hallway from Stairwell near Classroom K1 to Stairwell near Classroom K4	yes	W4	N/A	N/A	Baseboard	Chipping, Flaking	4	
87	1490	1	1	H15	Circulation (Hallway)	Hallway from Stairwell near Classroom K1 to Stairwell near Classroom K4	yes	W4	N/A	N/A	Window sill	Damaged plaster	8	
88	1490	1	1	H15	Circulation (Hallway)	Hallway from Stairwell near Classroom K1 to Stairwell near Classroom K4	yes	Ceiling	Efflorescence, Flaking	8	N/A	N/A	N/A	
89	1490	1	1	H15B	Circulation (Hallway)	Hallway Area between Auditorium, Classroom K4, and Boy's Restroom	yes	W1	N/A	N/A	Baseboard	Chipping	2	
90	1490	1	1	H15B	Circulation (Hallway)	Hallway Area between Auditorium, Classroom K4, and Boy's Restroom	yes	W2	N/A	N/A	Baseboard	Chipping	2	
91	1490	1	1	H15B	Circulation (Hallway)	Hallway Area between Auditorium, Classroom K4, and Boy's Restroom	yes	W3	N/A	N/A	Baseboard	Chipping	2	
92	1490	1	1	H15B	Circulation (Hallway)	Hallway Area between Auditorium, Classroom K4, and Boy's Restroom	yes	W4	N/A	N/A	Baseboard	Chipping	2	
93	1490	1	1	104C	Student Restrooms - Male (4-12)	Boy's Restroom near Classroom K4	yes	W1	Efflorescence/Flaking/Cracking	2	N/A	N/A	N/A	
94	1490	1	1	104C	Student Restrooms - Male (4-12)	Boy's Restroom near Classroom K4	yes	W3	Cracking	2	N/A	N/A	N/A	

Rudolph Blankenburg ES  
Scope of Work

<i>Task ID</i>	<i>ULCS#</i>	<i>E l e m e n t</i>	<i>F l o o r</i>	<i>Space # (on Floor Plan)</i>	<i>Space Type</i>	<i>On Site Room Name</i>	<i>Student/ Teacher Occupied</i>	<i>Primary Component</i>	<i>Description of Paint and Plaster Damage - Primary Component</i>	<i>Primary Component Damage Quantity (sf)</i>	<i>Additional Component (see terms)</i>	<i>Description of Paint and Plaster Damage - Additional Component</i>	<i>Additoinal Component Damage Quantity (sf)</i>	<i>Comments</i>
95	1490	1	1	104C	Student Restrooms - Male (4-12)	Boy's Restroom near Classroom K4	yes	W4	Cracking	4	N/A	N/A	N/A	
96	1490	1	1	104C	Student Restrooms - Male (4-12)	Boy's Restroom near Classroom K4	yes	Ceiling	Efflorescence/Flaking/Cracking	5	N/A	N/A	N/A	
97	1490	1	1	104	Primary	Classroom K4	yes	W1	Chipping	2	N/A	N/A	N/A	
98	1490	1	1	104	Primary	Classroom K4	yes	W2	Chipping	2	N/A	N/A	N/A	
99	1490	1	1	104	Primary	Classroom K4	yes	W3	Chipping	2	N/A	N/A	N/A	Damage is next to radiator and is covered by cage
100	1490	1	1	104	Primary	Classroom K4	yes	W3	N/A	N/A	Columns	Chipping	2	
101	1490	1	1	104	Primary	Classroom K4	yes	W3	Chipping	2	N/A	N/A	N/A	
102	1490	1	1	104	Primary	Classroom K4	yes	W4	Chipping	2	N/A	N/A	N/A	
103	1490	1	1	104A	Student Restrooms - Male/Female (Classroom)	Classroom K4 Restroom	yes	W1	Chipping	1	N/A	N/A	N/A	
104	1490	1	1	104A	Student Restrooms - Male/Female (Classroom)	Classroom K4 Restroom	yes	W2	Cracking	1	N/A	N/A	N/A	
105	1490	1	1	104A	Student Restrooms - Male/Female (Classroom)	Classroom K4 Restroom	yes	W3	Efflorescence/Flaking	4	N/A	N/A	N/A	
106	1490	1	1	104A	Student Restrooms - Male/Female (Classroom)	Classroom K4 Restroom	yes	W4	Flaking	4	N/A	N/A	N/A	
107	1490	1	1	104B	Storage	Classroom K4 Closet	yes	W1	Partially Inaccessible/Chipping	3	N/A	N/A	N/A	Closet is full of teachers supplies. Damage is only noted on areas that can be seen. May be more
108	1490	1	1	104B	Storage	Classroom K4 Closet	yes	W1	Partially Inaccessible/Chipping	3	N/A	N/A	N/A	
109	1490	1	1	104B	Storage	Classroom K4 Closet	yes	W2	Partially Inaccessible	0	N/A	N/A	N/A	
110	1490	1	1	104B	Storage	Classroom K4 Closet	yes	W2	Partially Inaccessible	0	N/A	N/A	N/A	
111	1490	1	1	104B	Storage	Classroom K4 Closet	yes	W3	Partially Inaccessible/Chipping	3	N/A	N/A	N/A	
112	1490	1	1	104B	Storage	Classroom K4 Closet	yes	W3	Partially Inaccessible/Chipping	3	N/A	N/A	N/A	
113	1490	1	1	104B	Storage	Classroom K4 Closet	yes	W4	Partially Inaccessible	0	N/A	N/A	N/A	
114	1490	1	1	104B	Storage	Classroom K4 Closet	yes	W4	Partially Inaccessible/Chipping	2	N/A	N/A	N/A	
115	1490	1	1	104B	Storage	Classroom K4 Closet	yes	Ceiling	Flaking	2	N/A	N/A	N/A	
116	1490	1	1	104D	Storage	Book Storage Room adjacent Auditorium	yes	W2	Partially Inaccessible/Chipping	1	N/A	N/A	N/A	
117	1490	1	1	104D	Storage	Book Storage Room adjacent Auditorium	yes	W3	Partially Inaccessible/Chipping	1	N/A	N/A	N/A	Half wall at entrance to room
118	1490	1	1	104D	Storage	Book Storage Room adjacent Auditorium	yes	W4	Partially Inaccessible/Cracking	3	N/A	N/A	N/A	
119	1490	1	1	104D	Storage	Book Storage Room adjacent Auditorium	yes	Floor	N/A	N/A	Stair tread	Chipping	2	
120	1490	1	1	104D	Storage	Book Storage Room adjacent Auditorium	yes	Floor	N/A	N/A	Stair riser	Chipping	2	
121	1490	1	1	H14	Circulation (Hallway)	Hallway from Classroom 105 to 107	yes	W1	N/A	N/A	Baseboard	Chipping	2	No wall
122	1490	1	1	H14	Circulation (Hallway)	Hallway from Classroom 105 to 107	yes	W3	Flaking, Efflorescence	4	N/A	N/A	N/A	

Rudolph Blankenburg ES  
Scope of Work

<i>Task ID</i>	<i>ULCS#</i>	<i>E l e m e n t</i>	<i>F l o o r</i>	<i>Space # (on Floor Plan)</i>	<i>Space Type</i>	<i>On Site Room Name</i>	<i>Student/ Teacher Occupied</i>	<i>Primary Component</i>	<i>Description of Paint and Plaster Damage - Primary Component</i>	<i>Primary Component Damage Quantity (sf)</i>	<i>Additional Component (see terms)</i>	<i>Description of Paint and Plaster Damage - Additional Component</i>	<i>Additoinal Component Damage Quantity (sf)</i>	<i>Comments</i>
123	1490	1	1	H14	Circulation (Hallway)	Hallway from Classroom 105 to 107	yes	W3	Flaking, Efflorescence	6	N/A	N/A	N/A	
124	1490	1	1	H14	Circulation (Hallway)	Hallway from Classroom 105 to 107	yes	W3	N/A	N/A	Window sill	Damaged Plaster	18	
125	1490	1	1	H14	Circulation (Hallway)	Hallway from Classroom 105 to 107	yes	W4	Cracking	4	N/A	N/A	N/A	No wall
126	1490	1	1	H14	Circulation (Hallway)	Hallway from Classroom 105 to 107	yes	Ceiling	Cracking, Efflorescence, Flaking	10	N/A	N/A	N/A	
127	1490	1	1	S12	Stairs	Stairwell adjacent to Classroom 107	yes	W3	Flaking, Efflorescence	6	N/A	N/A	N/A	
128	1490	1	1	S12	Stairs	Stairwell adjacent to Classroom 107	yes	W3	Flaking, Efflorescence	6	N/A	N/A	N/A	
129	1490	1	1	S12	Stairs	Stairwell adjacent to Classroom 107	yes	W4	Flaking	4	N/A	N/A	N/A	
130	1490	1	1	107A	Restrooms, Staff - Male	Men's Restroom next to Classroom 107	yes	W1	Efflorescence	2	N/A	N/A	N/A	
131	1490	1	1	107A	Restrooms, Staff - Male	Men's Restroom next to Classroom 107	yes	W2	Cracking	2	N/A	N/A	N/A	
132	1490	1	1	107A	Restrooms, Staff - Male	Men's Restroom next to Classroom 107	yes	W3	Efflorescence/Cracking	4	N/A	N/A	N/A	
133	1490	1	1	107A	Restrooms, Staff - Male	Men's Restroom next to Classroom 107	yes	W3	N/A	N/A	Columns	Efflorescence/Chipping/Cracking	15	Column is at corner of wall 2 and 3
134	1490	1	1	107A	Restrooms, Staff - Male	Men's Restroom next to Classroom 107	yes	W4	N/A	2	N/A	N/A	N/A	
135	1490	1	1	107A	Restrooms, Staff - Male	Men's Restroom next to Classroom 107	yes	Ceiling	Cracking	4	N/A	N/A	N/A	
136	1490	1	1	107	Primary	Classroom 107	yes	W1	Cracking	1	N/A	N/A	N/A	Damage due to nails and impact
137	1490	1	1	107	Primary	Classroom 107	yes	W2	Cracking/Chipping	3	N/A	N/A	N/A	Damage near sink
138	1490	1	1	107	Primary	Classroom 107	yes	W3	Efflorescence/Flaking	8	N/A	N/A	N/A	Damage is at/under windows. Some damage is on wall at radiator which is behind cage/cover
139	1490	1	1	107	Primary	Classroom 107	yes	W3	N/A	N/A	Columns	Cracking/Chipping	5	
140	1490	1	1	107	Primary	Classroom 107	yes	W4	Cracking	1	N/A	N/A	N/A	Damage appears to be from a building component removal
141	1490	1	1	107B	Storage	Classroom 107 Closet	yes	W1	Partially Inaccessible	0	N/A	N/A	N/A	Majority of cloet is not accessible duets items stored in it. More damage may be present. Debris may also be present
142	1490	1	1	107B	Storage	Classroom 107 Closet	yes	W1	Partially Inaccessible	0	N/A	N/A	N/A	Majority of cloet is not accessible duets items stored in it. More damage may be present. Debris may also be present
143	1490	1	1	107B	Storage	Classroom 107 Closet	yes	W2	Partially Inaccessible	0	N/A	N/A	N/A	Majority of closet is not accessible due to items stored in it. More damage may be present. Debris may also be present
144	1490	1	1	107B	Storage	Classroom 107 Closet	yes	W2	Partially Inaccessible	0	N/A	N/A	N/A	Majority of closet is not accessible due to items stored in it. More damage may be present. Debris may also be present
145	1490	1	1	107B	Storage	Classroom 107 Closet	yes	W3	Partially Inaccessible/Efflorescence	5	N/A	N/A	N/A	Majority of closet is not accessible due to items stored in it. More damage may be present. Debris may also be present
146	1490	1	1	107B	Storage	Classroom 107 Closet	yes	W3	Partially Inaccessible/Cracking	5	N/A	N/A	N/A	Majority of closet is not accessible due to items stored in it. More damage may be present. Debris may also be present
147	1490	1	1	107B	Storage	Classroom 107 Closet	yes	W4	Partially Inaccessible/Cracking	2	N/A	N/A	N/A	Majority of closet is not accessible due to items stored in it. More damage may be present. Debris may also be present
148	1490	1	1	107B	Storage	Classroom 107 Closet	yes	W4	Partially Inaccessible/Cracking	2	N/A	N/A	N/A	Majority of closet is not accessible due to items stored in it. More damage may be present. Debris may also be present
149	1490	1	1	H110	Circulation (Hallway)	Fire Tower Hallway adjacent to Hallway from Classrooms 105 to 107	yes	W1	Flaking, Cracking	20	N/A	N/A	N/A	
150	1490	1	1	H110	Circulation (Hallway)	Fire Tower Hallway adjacent to Hallway from Classrooms 105 to 107	yes	W2	Flaking, Cracking	40	N/A	N/A	N/A	

Rudolph Blankenburg ES  
Scope of Work

<i>Task ID</i>	<i>ULCS#</i>	<i>E l e m e n t</i>	<i>F l o o r</i>	<i>Space # (on Floor Plan)</i>	<i>Space Type</i>	<i>On Site Room Name</i>	<i>Student/ Teacher Occupied</i>	<i>Primary Component</i>	<i>Description of Paint and Plaster Damage - Primary Component</i>	<i>Primary Component Damage Quantity (sf)</i>	<i>Additional Component (see terms)</i>	<i>Description of Paint and Plaster Damage - Additional Component</i>	<i>Additoinal Component Damage Quantity (sf)</i>	<i>Comments</i>
151	1490	1	1	H110	Circulation (Hallway)	Fire Tower Hallway adjacent to Hallway from Classrooms 105 to 107	yes	W3	Flaking, Cracking	15	N/A	N/A	N/A	
152	1490	1	1	H110	Circulation (Hallway)	Fire Tower Hallway adjacent to Hallway from Classrooms 105 to 107	yes	W4	Flaking, Cracking	40	N/A	N/A	N/A	
153	1490	1	1	H110	Circulation (Hallway)	Fire Tower Hallway adjacent to Hallway from Classrooms 105 to 107	yes	Ceiling	Flaking, Cracking	40	N/A	N/A	N/A	
154	1490	1	1	S15	Stairs	Fire Tower adjacent to Hallway from Classrooms 105 to 107	yes	W1	Cracking	5	N/A	N/A	N/A	
155	1490	1	1	S15	Stairs	Fire Tower adjacent to Hallway from Classrooms 105 to 107	yes	W4	Cracking	5	N/A	N/A	N/A	
156	1490	1	1	S15	Stairs	Fire Tower adjacent to Hallway from Classrooms 105 to 107	yes	W4	N/A	N/A	Window frame	Cracking	12	
157	1490	1	1	S15	Stairs	Fire Tower adjacent to Hallway from Classrooms 105 to 107	yes	Floor	N/A	N/A	Stair riser	Cracking	12	
158	1490	1	1	S15	Stairs	Fire Tower adjacent to Hallway from Classrooms 105 to 107	yes	Floor	N/A	N/A	Stair tread	Cracking	5	
159	1490	1	1	106	Primary	Classroom 106	yes	W3	Chipping/Cracking	2	N/A	N/A	N/A	Damage is next to radiator and is covered by cage
160	1490	1	1	105	Primary	Classroom 105	yes	W3	Chipping	2	N/A	N/A	N/A	
161	1490	1	1	105	Primary	Classroom 105	yes	W3	Cracking	6	N/A	N/A	N/A	
162	1490	1	1	105	Primary	Classroom 105	yes	W3	N/A	N/A	Columns	Chipping	4	
163	1490	1	1	105	Primary	Classroom 105	yes	Ceiling	Flaking	1	N/A	N/A	N/A	
164	1490	1	1	105A	Storage	Classroom 105 Closet	yes	W1	Partially Inaccessible/Chipping	2	N/A	N/A	N/A	Closet is full of items
165	1490	1	1	105A	Storage	Classroom 105 Closet	yes	W2	Partially Inaccessible/Chipping	2	N/A	N/A	N/A	
166	1490	1	1	105A	Storage	Classroom 105 Closet	yes	W3	Partially Inaccessible/Chipping	2	N/A	N/A	N/A	
167	1490	1	1	105A	Storage	Classroom 105 Closet	yes	W4	Partially Inaccessible/Chipping	2	N/A	N/A	N/A	
168	1490	1	1	105A	Storage	Classroom 105 Closet	yes	Ceiling	Chipping	4	N/A	N/A	N/A	
169	1490	1	1	105B	Storage	Stationery Closet adjacent to Classroom 105	yes	W2	Cracking	4	N/A	N/A	N/A	
170	1490	1	1	105B	Storage	Stationery Closet adjacent to Classroom 105	yes	W3	Friction	4	N/A	N/A	N/A	
171	1490	1	1	105B	Storage	Stationery Closet adjacent to Classroom 105	yes	W4	Flaking	3	N/A	N/A	N/A	
172	1490	1	1	105B	Storage	Stationery Closet adjacent to Classroom 105	yes	Ceiling	Flaking	8	N/A	N/A	N/A	
173	1490	1	1	S17	Stairs	Stairwell near Classroom 105	yes	W2	N/A	N/A	Baseboard	Chipping	2	
174	1490	1	1	S17	Stairs	Stairwell near Classroom 105	yes	W3	N/A	N/A	Door	Chipping, Frequent	5	
175	1490	1	1	S17	Stairs	Stairwell near Classroom 105	yes	W4	N/A	N/A	Baseboard	Chipping	2	
176	1490	1	1	S17	Stairs	Stairwell near Classroom 105	yes	Ceiling	Flaking	4	N/A	N/A	N/A	
177	1490	1	1	S17	Stairs	Stairwell near Classroom 105	yes	Floor	N/A	N/A	Stair riser	Cracking	8	
178	1490	1	1	S17	Stairs	Stairwell near Classroom 105	yes	Floor	N/A	N/A	Stair tread	Cracking	3	
179	1490	1	1	102D	Storage	Main Office Closet	yes	W2	Damaged Plaster	1	N/A	N/A	N/A	
180	1490	1	1	102D	Storage	Main Office Closet	yes	W3	Flaking	3	N/A	N/A	N/A	

Rudolph Blankenburg ES  
Scope of Work

<i>Task ID</i>	<i>ULCS#</i>	<i>E l e m e n t</i>	<i>F l o o r</i>	<i>Space # (on Floor Plan)</i>	<i>Space Type</i>	<i>On Site Room Name</i>	<i>Student/ Teacher Occupied</i>	<i>Primary Component</i>	<i>Description of Paint and Plaster Damage - Primary Component</i>	<i>Primary Component Damage Quantity (sf)</i>	<i>Additional Component (see terms)</i>	<i>Description of Paint and Plaster Damage - Additional Component</i>	<i>Additoinal Component Damage Quantity (sf)</i>	<i>Comments</i>
181	1490	1	1	102D	Storage	Main Office Closet	yes	W4	Crack in Plaster	4	N/A	N/A	N/A	
182	1490	1	1	102F	Storage	Main Office Closet	yes	Ceiling	Flaking, Damaged Plaster	3	N/A	N/A	N/A	
183	1490	1	2	213B	Storage	Book Room adjacent to Classroom 213	yes	W2	Flaking, damaged	2	N/A	N/A	N/A	
184	1490	1	2	212CF	Student Restrooms - Male (4-12)	Foyer in Boy's Restroom near Classroom 212	yes	W3	Flaking, Cracking	8	N/A	N/A	N/A	
185	1490	1	2	212C	Student Restrooms - Male (4-12)	Boy's Restroom near Classroom 212	yes	W1	Efflorescence, Flaking	6	N/A	N/A	N/A	
186	1490	1	2	212C	Student Restrooms - Male (4-12)	Boy's Restroom near Classroom 212	yes	W2	Flaking, cracking	4	N/A	N/A	N/A	
187	1490	1	2	212C	Student Restrooms - Male (4-12)	Boy's Restroom near Classroom 212	yes	W3	Flaking, cracking	10	N/A	N/A	N/A	
188	1490	1	2	212C	Student Restrooms - Male (4-12)	Boy's Restroom near Classroom 212	yes	W4	Flaking, damaged	4	N/A	N/A	N/A	
189	1490	1	2	212C	Student Restrooms - Male (4-12)	Boy's Restroom near Classroom 212	yes	Ceiling	Spalling, Flaking	15	N/A	N/A	N/A	
190	1490	1	2	212A	Storage	Book Storage adjacent to Classroom 212	yes	W2	Flaking, cracking,	15	N/A	N/A	N/A	
191	1490	1	2	212A	Storage	Book Storage adjacent to Classroom 212	yes	W3	Flaking, Cracking	10	N/A	N/A	N/A	
192	1490	1	2	212A	Storage	Book Storage adjacent to Classroom 212	yes	W3	N/A	N/A	Pipe	Flaking	6	
193	1490	1	2	212A	Storage	Book Storage adjacent to Classroom 212	yes	W4	Flaking, cracking,	40	N/A	N/A	N/A	
194	1490	1	2	212A	Storage	Book Storage adjacent to Classroom 212	yes	Ceiling	Flaking, cracking,	25	N/A	N/A	N/A	
195	1490	1	2	211E	Storage	Book Storage across from Classroom 211	yes	W1	None	0	N/A	N/A	N/A	Very limited access - books in the way
196	1490	1	2	211E	Storage	Book Storage across from Classroom 211	yes	W2	Damaged plaster	4	N/A	N/A	N/A	Very limited access - books in the way, could not reach the wall to test
197	1490	1	2	211E	Storage	Book Storage across from Classroom 211	yes	W3	Damaged plaster	6	N/A	N/A	N/A	Very limited access - books in the way, could not reach the wall to test
198	1490	1	2	211E	Storage	Book Storage across from Classroom 211	yes	W4	None	0	N/A	N/A	N/A	Very limited access - books in the way
199	1490	1	2	211E	Storage	Book Storage across from Classroom 211	yes	Ceiling	Damaged plaster	6	N/A	N/A	N/A	Very limited access - books in the way
200	1490	1	2	211C	Student Restrooms - Female (4-12)	Girl's Restroom	yes	Ceiling	Damaged plaster, cracking	10	N/A	N/A	N/A	
201	1490	1	2	H29B	Circulation (Hallway)	Hallway Area between Classroom 211 and Girl's Restroom	yes	W4	Cracking	1	N/A	N/A	N/A	
202	1490	1	2	210A	Administrative Office	Corner Office 10A (Across from Custodial Closet)	yes	W2	Flaking	10	N/A	N/A	N/A	
203	1490	1	2	210A	Administrative Office	Corner Office 10A (Across from Custodial Closet)	yes	W4	Flaking	1	N/A	N/A	N/A	at soap dispenser
204	1490	1	2	210A	Administrative Office	Corner Office 10A (Across from Custodial Closet)	yes	Ceiling	Efflorescence, flaking	20	N/A	N/A	N/A	Appears to have been repaired once
205	1490	1	2	210B	Restrooms, Staff - Male/Female	Corner Office 10A - Restroom	yes	W1	Flaking	10	N/A	N/A	N/A	
206	1490	1	2	210B	Restrooms, Staff - Male/Female	Corner Office 10A - Restroom	yes	W1	N/A	N/A	Chair rail	Flaking	2	
207	1490	1	2	210B	Restrooms, Staff - Male/Female	Corner Office 10A - Restroom	yes	W2	Flaking	12	N/A	N/A	N/A	
208	1490	1	2	210B	Restrooms, Staff - Male/Female	Corner Office 10A - Restroom	yes	W3	Flaking	12	N/A	N/A	N/A	
209	1490	1	2	210B	Restrooms, Staff - Male/Female	Corner Office 10A - Restroom	yes	W4	Flaking	4	N/A	N/A	N/A	
210	1490	1	2	210B	Restrooms, Staff - Male/Female	Corner Office 10A - Restroom	yes	Ceiling	Flaking	6	N/A	N/A	N/A	
211	1490	1	2	211D	Restrooms, Staff - Male	Men's Restroom	yes	W1	Flaking	3	N/A	N/A	N/A	
212	1490	1	2	211D	Restrooms, Staff - Male	Men's Restroom	yes	W2	Cracking	1	N/A	N/A	N/A	

Rudolph Blankenburg ES  
Scope of Work

<i>Task ID</i>	<i>ULCS#</i>	<i>E l e m e n t</i>	<i>F l o o r</i>	<i>Space # (on Floor Plan)</i>	<i>Space Type</i>	<i>On Site Room Name</i>	<i>Student/ Teacher Occupied</i>	<i>Primary Component</i>	<i>Description of Paint and Plaster Damage - Primary Component</i>	<i>Primary Component Damage Quantity (sf)</i>	<i>Additional Component (see terms)</i>	<i>Description of Paint and Plaster Damage - Additional Component</i>	<i>Additoinal Component Damage Quantity (sf)</i>	<i>Comments</i>
213	1490	1	2	211D	Restrooms, Staff - Male	Men's Restroom	yes	W3	Efflorescence, Cracking	30	N/A	N/A	N/A	including archway
214	1490	1	2	211D	Restrooms, Staff - Male	Men's Restroom	yes	W3	N/A	N/A	Pipe	Cracking	6	
215	1490	1	2	211D	Restrooms, Staff - Male	Men's Restroom	yes	W4	Cracking	2	N/A	N/A	N/A	
216	1490	1	2	211D	Restrooms, Staff - Male	Men's Restroom	yes	Ceiling	Flaking, Cracking	20	N/A	N/A	N/A	
217	1490	1	2	208A	Administrative Office	Nurse's Office	yes	W2	Flaking	3	N/A	N/A	N/A	
218	1490	1	2	208A	Administrative Office	Nurse's Office	yes	W3	Flaking	2	N/A	N/A	N/A	
219	1490	1	2	208A	Administrative Office	Nurse's Office	yes	W3	N/A	N/A	Baseboard	Flaking	5	
220	1490	1	2	208A	Administrative Office	Nurse's Office	yes	W4	Flaking	3	N/A	N/A	N/A	Appears to be have been repaired once
221	1490	1	2	208A	Administrative Office	Nurse's Office	yes	W4	Flaking, Efflorescence	4	N/A	N/A	N/A	Appears to be have been repaired once
222	1490	1	2	208A	Administrative Office	Nurse's Office	yes	W4	N/A	N/A	Baseboard	Flaking	2	
223	1490	1	2	208A	Administrative Office	Nurse's Office	yes	Ceiling	Efflorescence, Spalling	8	N/A	N/A	N/A	at drain pipe penetration
224	1490	1	2	208C	Restrooms, Staff - Male/Female	Nurse's Restroom	yes	W1	Flaking	16	N/A	N/A	N/A	
225	1490	1	2	208C	Restrooms, Staff - Male/Female	Nurse's Restroom	yes	W1	Flaking	4	N/A	N/A	N/A	
226	1490	1	2	208C	Restrooms, Staff - Male/Female	Nurse's Restroom	yes	W2	Flaking	3	N/A	N/A	N/A	
227	1490	1	2	208C	Restrooms, Staff - Male/Female	Nurse's Restroom	yes	W3	Cracking	2	N/A	N/A	N/A	
228	1490	1	2	208C	Restrooms, Staff - Male/Female	Nurse's Restroom	yes	W4	Cracking, Efflorescence	7	N/A	N/A	N/A	
229	1490	1	2	208C	Restrooms, Staff - Male/Female	Nurse's Restroom	yes	Ceiling	Flaking	5	N/A	N/A	N/A	
230	1490	1	2	S27	Stairs	Stairwell M (near Classroom 212)	yes	W4	Damaged Plaster	6	N/A	N/A	N/A	
231	1490	1	2	S27	Stairs	Stairwell M (near Classroom 212)	yes	Ceiling	Cracking, damaged	4	N/A	N/A	N/A	
232	1490	1	2	S27	Stairs	Stairwell M (near Classroom 212)	yes	Floor	N/A	N/A	Baseboard	Flaking	5	
233	1490	1	2	212	Primary	Classroom 212	yes	W1	Flaking	2	N/A	N/A	N/A	
234	1490	1	2	212	Primary	Classroom 212	yes	W1	Flaking	3	N/A	N/A	N/A	
235	1490	1	2	212	Primary	Classroom 212	yes	W2	Cracking, Spalling	8	N/A	N/A	N/A	
236	1490	1	2	212	Primary	Classroom 212	yes	W2	Flaking	2	N/A	N/A	N/A	
237	1490	1	2	212	Primary	Classroom 212	yes	W3	Flaking	3	N/A	N/A	N/A	
238	1490	1	2	212	Primary	Classroom 212	yes	W4	Flaking	2	N/A	N/A	N/A	
239	1490	1	2	212	Primary	Classroom 212	yes	Ceiling	Efflorescence, Flaking	15	N/A	N/A	N/A	
240	1490	1	2	212B	Storage	Classroom 212 Closet	yes	W1	Flaking, Damaged	10	N/A	N/A	N/A	
241	1490	1	2	212B	Storage	Classroom 212 Closet	yes	W1	Cracking, crack in plaster	10	N/A	N/A	N/A	
242	1490	1	2	212B	Storage	Classroom 212 Closet	yes	W2	Flaking, Cracking	55	N/A	N/A	N/A	
243	1490	1	2	212B	Storage	Classroom 212 Closet	yes	W3	Flaking, Cracking	45	N/A	N/A	N/A	
244	1490	1	2	212B	Storage	Classroom 212 Closet	yes	W4	Flaking	5	N/A	N/A	N/A	

Rudolph Blankenburg ES  
Scope of Work

<i>Task ID</i>	<i>ULCS#</i>	<i>E l e m e n t</i>	<i>F l o o r</i>	<i>Space # (on Floor Plan)</i>	<i>Space Type</i>	<i>On Site Room Name</i>	<i>Student/ Teacher Occupied</i>	<i>Primary Component</i>	<i>Description of Paint and Plaster Damage - Primary Component</i>	<i>Primary Component Damage Quantity (sf)</i>	<i>Additional Component (see terms)</i>	<i>Description of Paint and Plaster Damage - Additional Component</i>	<i>Additoinal Component Damage Quantity (sf)</i>	<i>Comments</i>
245	1490	1	2	212B	Storage	Classroom 212 Closet	yes	Ceiling	Flaking and damaged	10	N/A	N/A	N/A	
246	1490	1	2	212B	Storage	Classroom 212 Closet	yes	Ceiling	Flaking and damaged	15	N/A	N/A	N/A	
247	1490	1	2	213	Primary	Classroom 213	yes	W1	Flaking	4	N/A	N/A	N/A	
248	1490	1	2	213	Primary	Classroom 213	yes	W1	Flaking	6	N/A	N/A	N/A	
249	1490	1	2	213	Primary	Classroom 213	yes	W3	Flaking	2	N/A	N/A	N/A	
250	1490	1	2	213	Primary	Classroom 213	yes	W3	Flaking	60	N/A	N/A	N/A	
251	1490	1	2	213	Primary	Classroom 213	yes	W4	Cracking	2	N/A	N/A	N/A	
252	1490	1	2	213	Primary	Classroom 213	yes	W4	Flaking	10	N/A	N/A	N/A	
253	1490	1	2	213	Primary	Classroom 213	yes	Ceiling	Flaking	4	N/A	N/A	N/A	
254	1490	1	2	213A	Storage	Classroom 213 Closet	yes	W1	Cracking	1	N/A	N/A	N/A	
255	1490	1	2	213A	Storage	Classroom 213 Closet	yes	W1	Flaking	15	N/A	N/A	N/A	
256	1490	1	2	213A	Storage	Classroom 213 Closet	yes	W2	Flaking	4	N/A	N/A	N/A	
257	1490	1	2	213A	Storage	Classroom 213 Closet	yes	W2	Flaking, Damaged	10	N/A	N/A	N/A	
258	1490	1	2	213A	Storage	Classroom 213 Closet	yes	W3	Cracking	3	N/A	N/A	N/A	
259	1490	1	2	213A	Storage	Classroom 213 Closet	yes	W3	Cracking	3	N/A	N/A	N/A	
260	1490	1	2	213A	Storage	Classroom 213 Closet	yes	Ceiling	Cracking, Spalling	10	N/A	N/A	N/A	
261	1490	1	2	214	Primary	Classroom 214	yes	W1	Flaking	3	N/A	N/A	N/A	
262	1490	1	2	214	Primary	Classroom 214	yes	W1	Chipping	2	N/A	N/A	N/A	
263	1490	1	2	214	Primary	Classroom 214	yes	W3	Chipping	3	N/A	N/A	N/A	
264	1490	1	2	214	Primary	Classroom 214	yes	W3	Chipping	2	N/A	N/A	N/A	
265	1490	1	2	214	Primary	Classroom 214	yes	Ceiling	Damaged plaster	3	N/A	N/A	N/A	
266	1490	1	2	215	Primary	Classroom 215	yes	W1	Cracking, staples	4	N/A	N/A	N/A	
267	1490	1	2	215	Primary	Classroom 215	yes	W1	Flaking	2	N/A	N/A	N/A	
268	1490	1	2	215	Primary	Classroom 215	yes	W2	Crack in plaster, staples	15	N/A	N/A	N/A	
269	1490	1	2	215	Primary	Classroom 215	yes	W2	Flaking	3	N/A	N/A	N/A	
270	1490	1	2	215	Primary	Classroom 215	yes	W3	Cracking, staples	4	N/A	N/A	N/A	
271	1490	1	2	215	Primary	Classroom 215	yes	W3	Flaking	2	N/A	N/A	N/A	
272	1490	1	2	215	Primary	Classroom 215	yes	W4	Flaking	3	N/A	N/A	N/A	
273	1490	1	2	215	Primary	Classroom 215	yes	Ceiling	Cracking	3	N/A	N/A	N/A	
274	1490	1	2	215B	Storage	Classroom 215 Closet	yes	W1	Damaged plaster	2	N/A	N/A	N/A	
275	1490	1	2	215B	Storage	Classroom 215 Closet	yes	W1	Flaking	8	N/A	N/A	N/A	
276	1490	1	2	215B	Storage	Classroom 215 Closet	yes	W3	Flaking	25	N/A	N/A	N/A	

Rudolph Blankenburg ES  
Scope of Work

<i>Task ID</i>	<i>ULCS#</i>	<i>E l e m e n t</i>	<i>F l o o r</i>	<i>Space # (on Floor Plan)</i>	<i>Space Type</i>	<i>On Site Room Name</i>	<i>Student/ Teacher Occupied</i>	<i>Primary Component</i>	<i>Description of Paint and Plaster Damage - Primary Component</i>	<i>Primary Component Damage Quantity (sf)</i>	<i>Additional Component (see terms)</i>	<i>Description of Paint and Plaster Damage - Additional Component</i>	<i>Additoinal Component Damage Quantity (sf)</i>	<i>Comments</i>
277	1490	1	2	215B	Storage	Classroom 215 Closet	yes	W3	Flaking	30	N/A	N/A	N/A	
278	1490	1	2	215B	Storage	Classroom 215 Closet	yes	W4	Flaking	4	N/A	N/A	N/A	
279	1490	1	2	215B	Storage	Classroom 215 Closet	yes	W4	Crack in plaster	1	N/A	N/A	N/A	
280	1490	1	2	215B	Storage	Classroom 215 Closet	yes	Ceiling	Flaking	40	N/A	N/A	N/A	
281	1490	1	2	215A	Administrative Office	Counselor's Office 15 (next to Classroom 215)	yes	W2	Flaking	10	N/A	N/A	N/A	
282	1490	1	2	215A	Administrative Office	Counselor's Office 15 (next to Classroom 215)	yes	Ceiling	Flaking	10	N/A	N/A	N/A	
283	1490	1	2	H212	Circulation (Hallway)	Fire Tower Hallway across Hallway from Classroom 214	yes	W1	Flaking	20	N/A	N/A	N/A	
284	1490	1	2	H212	Circulation (Hallway)	Fire Tower Hallway across Hallway from Classroom 214	yes	W2	Flaking	40	N/A	N/A	N/A	
285	1490	1	2	H212	Circulation (Hallway)	Fire Tower Hallway across Hallway from Classroom 214	yes	W2	N/A	N/A	Window sill	Flaking	10	
286	1490	1	2	H212	Circulation (Hallway)	Fire Tower Hallway across Hallway from Classroom 214	yes	W3	Flaking	20	N/A	N/A	N/A	
287	1490	1	2	H212	Circulation (Hallway)	Fire Tower Hallway across Hallway from Classroom 214	yes	W3	N/A	N/A	Window sill	Flaking	10	
288	1490	1	2	H212	Circulation (Hallway)	Fire Tower Hallway across Hallway from Classroom 214	yes	W4	Flaking	50	N/A	N/A	N/A	
289	1490	1	2	H212	Circulation (Hallway)	Fire Tower Hallway across Hallway from Classroom 214	yes	Ceiling	Flaking	50	N/A	N/A	N/A	
290	1490	1	2	S25	Stairs	Fire Tower Stairs across Hallway from Classroom 214	yes	W1	Cracking	10	N/A	N/A	N/A	
291	1490	1	2	S25	Stairs	Fire Tower Stairs across Hallway from Classroom 214	yes	W2	Cracking	4	N/A	N/A	N/A	
292	1490	1	2	S25	Stairs	Fire Tower Stairs across Hallway from Classroom 214	yes	W2	N/A	N/A	Window frame	Flaking	7	
293	1490	1	2	S25	Stairs	Fire Tower Stairs across Hallway from Classroom 214	yes	W3	Cracking	5	N/A	N/A	N/A	
294	1490	1	2	S25	Stairs	Fire Tower Stairs across Hallway from Classroom 214	yes	W4	Cracking	10	N/A	N/A	N/A	
295	1490	1	2	S25	Stairs	Fire Tower Stairs across Hallway from Classroom 214	yes	Ceiling	Cracking	4	N/A	N/A	N/A	
296	1490	1	2	H27	Circulation (Hallway)	Hallway from Classrooms 213 to 215	yes	W3	Efflorescence, flaking	30	N/A	N/A	N/A	Damaged re-occured at previously repaired area, and additional damage
297	1490	1	2	H27	Circulation (Hallway)	Hallway from Classrooms 213 to 215	yes	W3	N/A	N/A	Window sill	Damaged plaster	18	3 windows
298	1490	1	2	H27	Circulation (Hallway)	Hallway from Classrooms 213 to 215	yes	Ceiling	Efflorescence	2	N/A	N/A	N/A	Outside Room 215A by light fixture
299	1490	1	2	H28	Circulation (Hallway)	Hallway adjacent to Upper Part of Auditorium (from Staiwell M to Stairwell G)	yes	W4	Efflorescence, flaking	50	N/A	N/A	N/A	Damaged re-occured at previously repaired area, and additional damage
300	1490	1	2	H28	Circulation (Hallway)	Hallway adjacent to Upper Part of Auditorium (from Staiwell M to Stairwell G)	yes	W4	N/A	N/A	Window sill	Damaged plaster	18	3 windows
301	1490	1	2	H28	Circulation (Hallway)	Hallway adjacent to Upper Part of Auditorium (from Staiwell M to Stairwell G)	yes	Ceiling	Efflorescence	4	N/A	N/A	N/A	At the top of the windows
302	1490	1	2	211	Primary	Classroom 211	yes	W1	Cracking	2	N/A	N/A	N/A	
303	1490	1	2	211	Primary	Classroom 211	yes	W1	Flaking	4	N/A	N/A	N/A	
304	1490	1	2	211	Primary	Classroom 211	yes	W2	Cracking	2	N/A	N/A	N/A	
305	1490	1	2	211	Primary	Classroom 211	yes	W2	Cracking	5	N/A	N/A	N/A	
306	1490	1	2	211	Primary	Classroom 211	yes	W3	Efflorescence	6	N/A	N/A	N/A	
307	1490	1	2	211	Primary	Classroom 211	yes	W3	Cracking	4	N/A	N/A	N/A	

Rudolph Blankenburg ES  
Scope of Work

<i>Task ID</i>	<i>ULCS#</i>	<i>E l e m e n t</i>	<i>F l o o r</i>	<i>Space # (on Floor Plan)</i>	<i>Space Type</i>	<i>On Site Room Name</i>	<i>Student/ Teacher Occupied</i>	<i>Primary Component</i>	<i>Description of Paint and Plaster Damage - Primary Component</i>	<i>Primary Component Damage Quantity (sf)</i>	<i>Additional Component (see terms)</i>	<i>Description of Paint and Plaster Damage - Additional Component</i>	<i>Additoinal Component Damage Quantity (sf)</i>	<i>Comments</i>
308	1490	1	2	211	Primary	Classroom 211	yes	W4	Cracking	2	N/A	N/A	N/A	
309	1490	1	2	211	Primary	Classroom 211	yes	W4	Cracking	2	N/A	N/A	N/A	
310	1490	1	2	211	Primary	Classroom 211	yes	Ceiling	Flaking	10	N/A	N/A	N/A	
311	1490	1	2	211A	Storage	Classroom 211 Closet	yes	W1	Flaking, damaged	6	N/A	N/A	N/A	
312	1490	1	2	211A	Storage	Classroom 211 Closet	yes	W1	Flaking	6	N/A	N/A	N/A	
313	1490	1	2	211A	Storage	Classroom 211 Closet	yes	W3	Flaking	8	N/A	N/A	N/A	
314	1490	1	2	211A	Storage	Classroom 211 Closet	yes	W3	Flaking	7	N/A	N/A	N/A	
315	1490	1	2	211A	Storage	Classroom 211 Closet	yes	W4	Flaking	2	N/A	N/A	N/A	
316	1490	1	2	211A	Storage	Classroom 211 Closet	yes	W4	Flaking	2	N/A	N/A	N/A	
317	1490	1	2	211A	Storage	Classroom 211 Closet	yes	Ceiling	Flaking	3	N/A	N/A	N/A	
318	1490	1	2	H29	Circulation (Hallway)	Hallway from Office 10A to Nurse's Office	yes	W1	N/A	N/A	Window sill	Damaged plaster	6	1 window
319	1490	1	2	208	Primary	Classroom 208	yes	W1	Flaking	2	N/A	N/A	N/A	
320	1490	1	2	208	Primary	Classroom 208	yes	W2	Crack in plaster	3	N/A	N/A	N/A	
321	1490	1	2	208	Primary	Classroom 208	yes	W2	Crack in plaster, chipping	3	N/A	N/A	N/A	
322	1490	1	2	208	Primary	Classroom 208	yes	W3	Flaking	8	N/A	N/A	N/A	
323	1490	1	2	208	Primary	Classroom 208	yes	W3	Flaking	15	N/A	N/A	N/A	
324	1490	1	2	208	Primary	Classroom 208	yes	W4	Flaking	2	N/A	N/A	N/A	
325	1490	1	2	208	Primary	Classroom 208	yes	Ceiling	Flaking	12	N/A	N/A	N/A	Appears to have been repaired once
326	1490	1	2	208B	Storage	Classroom 208 Closet	yes	W1	Damaged plaster	20	N/A	N/A	N/A	Along coat hanger line
327	1490	1	2	208B	Storage	Classroom 208 Closet	yes	W2	Efflorescence	25	N/A	N/A	N/A	
328	1490	1	2	208B	Storage	Classroom 208 Closet	yes	W3	Efflorescence	20	N/A	N/A	N/A	
329	1490	1	2	209	Primary	Classroom 209	yes	W1	Flaking	5	N/A	N/A	N/A	
330	1490	1	2	209	Primary	Classroom 209	yes	W3	Flaking	5	N/A	N/A	N/A	
331	1490	1	2	209	Primary	Classroom 209	yes	W3	Efflorescence, Flaking	15	N/A	N/A	N/A	
332	1490	1	2	209	Primary	Classroom 209	yes	Ceiling	Efflorescence, flaking	10	N/A	N/A	N/A	
333	1490	1	2	H213	Circulation (Hallway)	Fire Tower Hallway adjacent to Hallway from Classrooms 208 to 211	yes	W1	Cracking	12	N/A	N/A	N/A	
334	1490	1	2	H213	Circulation (Hallway)	Fire Tower Hallway adjacent to Hallway from Classrooms 208 to 211	yes	W2	Cracking	20	N/A	N/A	N/A	
335	1490	1	2	H213	Circulation (Hallway)	Fire Tower Hallway adjacent to Hallway from Classrooms 208 to 211	yes	W3	Cracking	8	N/A	N/A	N/A	
336	1490	1	2	H213	Circulation (Hallway)	Fire Tower Hallway adjacent to Hallway from Classrooms 208 to 211	yes	W3	N/A	N/A	Window sill	Flaking	20	
337	1490	1	2	H213	Circulation (Hallway)	Fire Tower Hallway adjacent to Hallway from Classrooms 208 to 211	yes	W4	Cracking	20	N/A	N/A	N/A	
338	1490	1	2	H213	Circulation (Hallway)	Fire Tower Hallway adjacent to Hallway from Classrooms 208 to 211	yes	W4	N/A	N/A	Window sill	Flaking	20	
339	1490	1	2	H213	Circulation (Hallway)	Fire Tower Hallway adjacent to Hallway from Classrooms 208 to 211	yes	Ceiling	Cracking	20	N/A	N/A	N/A	
340	1490	1	2	S23	Stairs	Fire Tower Stairs adjacent to Hallway from Classroom 208 to 211	yes	W1	Cracking	5	N/A	N/A	N/A	

Rudolph Blankenburg ES  
Scope of Work

<i>Task ID</i>	<i>ULCS#</i>	<i>E l e m e n t</i>	<i>F l o o r</i>	<i>Space # (on Floor Plan)</i>	<i>Space Type</i>	<i>On Site Room Name</i>	<i>Student/ Teacher Occupied</i>	<i>Primary Component</i>	<i>Description of Paint and Plaster Damage - Primary Component</i>	<i>Primary Component Damage Quantity (sf)</i>	<i>Additional Component (see terms)</i>	<i>Description of Paint and Plaster Damage - Additional Component</i>	<i>Additoinal Component Damage Quantity (sf)</i>	<i>Comments</i>
341	1490	1	2	S23	Stairs	Fire Tower Stairs adjacent to Hallway from Classroom 208 to 211	yes	W2	Cracking	10	N/A	N/A	N/A	
342	1490	1	2	S23	Stairs	Fire Tower Stairs adjacent to Hallway from Classroom 208 to 211	yes	W4	None	10	N/A	N/A	N/A	
343	1490	1	2	S23	Stairs	Fire Tower Stairs adjacent to Hallway from Classroom 208 to 211	yes	W4	N/A	N/A	Window frame	Flaking	10	
344	1490	1	2	S23	Stairs	Fire Tower Stairs adjacent to Hallway from Classroom 208 to 211	yes	Ceiling	None	8	N/A	N/A	N/A	
345	1490	1	2	209BB	Circulation (Hallway)	Hallway Entrance Area for Teacher's Lounge	yes	W1	Flaking	12	N/A	N/A	N/A	
346	1490	1	2	209BB	Circulation (Hallway)	Hallway Entrance Area for Teacher's Lounge	yes	W2	Cracking	10	N/A	N/A	N/A	
347	1490	1	2	209BB	Circulation (Hallway)	Hallway Entrance Area for Teacher's Lounge	yes	W3	Flaking	10	N/A	N/A	N/A	
348	1490	1	2	209BB	Circulation (Hallway)	Hallway Entrance Area for Teacher's Lounge	yes	W4	Flaking	8	N/A	N/A	N/A	
349	1490	1	2	209BB	Circulation (Hallway)	Hallway Entrance Area for Teacher's Lounge	yes	Ceiling	Flaking, damaged plaster	7	N/A	N/A	N/A	
350	1490	1	2	209B	Restrooms, Staff - Male/Female	Teacher's Restroom (next to Lounge)	yes	W2	Flaking, cracking	40	N/A	N/A	N/A	
351	1490	1	2	209B	Restrooms, Staff - Male/Female	Teacher's Restroom (next to Lounge)	yes	W4	Cracking, damaged plaster	6	N/A	N/A	N/A	
352	1490	1	2	209B	Restrooms, Staff - Male/Female	Teacher's Restroom (next to Lounge)	yes	Ceiling	Cracking	5	N/A	N/A	N/A	
353	1490	1	2	210	Primary	Classroom 210	yes	W1	Flaking	10	N/A	N/A	N/A	
354	1490	1	2	210	Primary	Classroom 210	yes	W1	Flaking	4	N/A	N/A	N/A	
355	1490	1	2	210	Primary	Classroom 210	yes	W2	Flaking	4	N/A	N/A	N/A	
356	1490	1	2	210	Primary	Classroom 210	yes	W2	Flaking	12	N/A	N/A	N/A	
357	1490	1	2	210	Primary	Classroom 210	yes	W3	Flaking	6	N/A	N/A	N/A	
358	1490	1	2	210	Primary	Classroom 210	yes	Ceiling	Flaking, Efflorescence	25	N/A	N/A	N/A	
359	1490	1	2	210C	Storage	Classroom 210 Closet	yes	W1	Cracking	6	N/A	N/A	N/A	Along coat hanger
360	1490	1	2	210C	Storage	Classroom 210 Closet	yes	W1	Cracking	8	N/A	N/A	N/A	Along coat hanger
361	1490	1	2	210C	Storage	Classroom 210 Closet	yes	W2	Cracking	12	N/A	N/A	N/A	Along coat hanger
362	1490	1	2	210C	Storage	Classroom 210 Closet	yes	W2	Cracking	4	N/A	N/A	N/A	Along coat hanger
363	1490	1	2	210C	Storage	Classroom 210 Closet	yes	W3	Cracking	8	N/A	N/A	N/A	Along coat hanger
364	1490	1	2	210C	Storage	Classroom 210 Closet	yes	W3	Flaking, Cracking	8	N/A	N/A	N/A	Along coat hanger
365	1490	1	2	210C	Storage	Classroom 210 Closet	yes	W4	Flaking, Cracking	12	N/A	N/A	N/A	
366	1490	1	2	210C	Storage	Classroom 210 Closet	yes	W4	Flaking, Cracking	12	N/A	N/A	N/A	
367	1490	1	2	210C	Storage	Classroom 210 Closet	yes	Ceiling	Flaking	30	N/A	N/A	N/A	
368	1490	1	2	S28	Stairs	Stairwell G (near Classroom 211)	yes	W1	Efflorescence	6	N/A	N/A	N/A	
369	1490	1	2	S28	Stairs	Stairwell G (near Classroom 211)	yes	W1	Friction	3	N/A	N/A	N/A	
370	1490	1	2	S28	Stairs	Stairwell G (near Classroom 211)	yes	W2	Flaking	10	N/A	N/A	N/A	
371	1490	1	2	S28	Stairs	Stairwell G (near Classroom 211)	yes	W3	N/A	N/A	Door	Friction, repeated contact	4	
372	1490	1	2	S28	Stairs	Stairwell G (near Classroom 211)	yes	W3	N/A	N/A	Newel posts	Friction, repeated contact	4	

Rudolph Blankenburg ES  
Scope of Work

<i>Task ID</i>	<i>ULCS#</i>	<i>E l e m e n t</i>	<i>F l o o r</i>	<i>Space # (on Floor Plan)</i>	<i>Space Type</i>	<i>On Site Room Name</i>	<i>Student/ Teacher Occupied</i>	<i>Primary Component</i>	<i>Description of Paint and Plaster Damage - Primary Component</i>	<i>Primary Component Damage Quantity (sf)</i>	<i>Additional Component (see terms)</i>	<i>Description of Paint and Plaster Damage - Additional Component</i>	<i>Additoinal Component Damage Quantity (sf)</i>	<i>Comments</i>
373	1490	1	2	S28	Stairs	Stairwell G (near Classroom 211)	yes	W3	N/A	N/A	Stair Ballustrades	Friction, repeated contact	20	
374	1490	1	2	S28	Stairs	Stairwell G (near Classroom 211)	yes	W4	Cracking	8	N/A	N/A	N/A	
375	1490	1	2	S28	Stairs	Stairwell G (near Classroom 211)	yes	W4	Cracking	5	N/A	N/A	N/A	
376	1490	1	2	S28	Stairs	Stairwell G (near Classroom 211)	yes	Ceiling	Efflorescence	2	N/A	N/A	N/A	
377	1490	1	3	316B	Restrooms, Staff - Female	Women's Restroom (near Classroom 316)	yes	W3	Efflorescence, cracking	4	N/A	N/A	N/A	
378	1490	1	3	316B	Restrooms, Staff - Female	Women's Restroom (near Classroom 316)	yes	W3	Cracking	3	N/A	N/A	N/A	
379	1490	1	3	316B	Restrooms, Staff - Female	Women's Restroom (near Classroom 316)	yes	W4	Efflorescence	4	N/A	N/A	N/A	Repaired area but spalling/efflorescence again
380	1490	1	3	316B	Restrooms, Staff - Female	Women's Restroom (near Classroom 316)	yes	W4	Efflorescence, Spalling	8	N/A	N/A	N/A	Repaired area but spalling/efflorescence again
381	1490	1	3	316B	Restrooms, Staff - Female	Women's Restroom (near Classroom 316)	yes	Ceiling	Efflorescence	5	N/A	N/A	N/A	This appears to be new damage. Other damage appears to have been repaired.
382	1490	1	3	326B	Storage	Book Closet adjacent to Classroom 326	yes	W1	Damaged plaster	3	N/A	N/A	N/A	
383	1490	1	3	326B	Storage	Book Closet adjacent to Classroom 326	yes	W2	Cracking	5	N/A	N/A	N/A	
384	1490	1	3	326B	Storage	Book Closet adjacent to Classroom 326	yes	W3	Friction	7	N/A	N/A	N/A	Friction from contact with books
385	1490	1	3	326B	Storage	Book Closet adjacent to Classroom 326	yes	W4	Cracking	5	N/A	N/A	N/A	
386	1490	1	3	326B	Storage	Book Closet adjacent to Classroom 326	yes	Ceiling	Flaking	8	N/A	N/A	N/A	
387	1490	1	3	328A	Storage	Storage Room adjacent to Classroom 328	yes	W2	Spalling	60	N/A	N/A	N/A	
388	1490	1	3	328A	Storage	Storage Room adjacent to Classroom 328	yes	W3	Spalling	5	N/A	N/A	N/A	
389	1490	1	3	316	Primary	Science Laboratory 316	yes	W3	Efflorescence, flaking	70	N/A	N/A	N/A	
390	1490	1	3	316	Primary	Science Laboratory 316	yes	Ceiling	Flaking, Cracking	20	N/A	N/A	N/A	Spread out
391	1490	1	3	316A	Storage	Science Laboratory 316 Closet	yes	W1	Efflorescence, damaged plaster	4	N/A	N/A	N/A	
392	1490	1	3	316A	Storage	Science Laboratory 316 Closet	yes	W3	Efflorescence, Flaking	80	N/A	N/A	N/A	Appears to have been repaired but efflorescence again. ACM riser
393	1490	1	3	316A	Storage	Science Laboratory 316 Closet	yes	W4	Crack in plaster	3	N/A	N/A	N/A	
394	1490	1	3	316A	Storage	Science Laboratory 316 Closet	yes	Ceiling	Flaking	5	N/A	N/A	N/A	
395	1490	1	3	317	Primary	Classroom 317	yes	W3	Efflorescence, flaking	20	N/A	N/A	N/A	Includes window perimeters
396	1490	1	3	317	Primary	Classroom 317	yes	Ceiling	Efflorescence	5	N/A	N/A	N/A	
397	1490	1	3	318A	Storage	Classroom 318 Closet	yes	W1	Flaking	5	N/A	N/A	N/A	
398	1490	1	3	318A	Storage	Classroom 318 Closet	yes	W2	Flaking, Crack in plaster	8	N/A	N/A	N/A	
399	1490	1	3	318A	Storage	Classroom 318 Closet	yes	W3	Flaking	5	N/A	N/A	N/A	
400	1490	1	3	318A	Storage	Classroom 318 Closet	yes	W4	Efflorescence	20	N/A	N/A	N/A	Appears to have been repaired once. Also, there is new damage
401	1490	1	3	318A	Storage	Classroom 318 Closet	yes	Ceiling	Flaking	20	N/A	N/A	N/A	
402	1490	1	3	319	Primary	Classroom 319	yes	W1	Flaking, Crack in plaster	15	N/A	N/A	N/A	
403	1490	1	3	319	Primary	Classroom 319	yes	W2	Flaking, Cracking	20	N/A	N/A	N/A	
404	1490	1	3	319	Primary	Classroom 319	yes	W3	Flaking	20	N/A	N/A	N/A	
405	1490	1	3	319	Primary	Classroom 319	yes	W4	Flaking	20	N/A	N/A	N/A	

Rudolph Blankenburg ES  
Scope of Work

<i>Task ID</i>	<i>ULCS#</i>	<i>E l e m e n t</i>	<i>F l o o r</i>	<i>Space # (on Floor Plan)</i>	<i>Space Type</i>	<i>On Site Room Name</i>	<i>Student/ Teacher Occupied</i>	<i>Primary Component</i>	<i>Description of Paint and Plaster Damage - Primary Component</i>	<i>Primary Component Damage Quantity (sf)</i>	<i>Additional Component (see terms)</i>	<i>Description of Paint and Plaster Damage - Additional Component</i>	<i>Additoinal Component Damage Quantity (sf)</i>	<i>Comments</i>
406	1490	1	3	319	Primary	Classroom 319	yes	Ceiling	Flaking	10	N/A	N/A	N/A	
407	1490	1	3	319B	Storage	Classroom 319 Closet	yes	W1	Flaking, Cracking	20	N/A	N/A	N/A	
408	1490	1	3	319B	Storage	Classroom 319 Closet	yes	W1	N/A	N/A	Pipe	Cracking	6	
409	1490	1	3	319B	Storage	Classroom 319 Closet	yes	W2	Flaking, Cracking	30	N/A	N/A	N/A	
410	1490	1	3	319B	Storage	Classroom 319 Closet	yes	W3	Flaking, Cracking	30	N/A	N/A	N/A	
411	1490	1	3	319B	Storage	Classroom 319 Closet	yes	W3	N/A	N/A	Pipe Jacket	Cracking	6	Jacket on ACM riser
412	1490	1	3	319B	Storage	Classroom 319 Closet	yes	Ceiling	Flaking, Efflorescence	15	N/A	N/A	N/A	
413	1490	1	3	323	Primary	Classroom 323	yes	W1	Crack and damaged plaster	5	N/A	N/A	N/A	
414	1490	1	3	323	Primary	Classroom 323	yes	W2	Crack in plaster, flaking	10	N/A	N/A	N/A	
415	1490	1	3	323	Primary	Classroom 323	yes	W3	N/A	N/A	Columns	Flaking	2	
416	1490	1	3	323	Primary	Classroom 323	yes	W3	Efflorescence, Damaged plaster, Flaking paint	10	N/A	N/A	N/A	Includes behind riser on the right
417	1490	1	3	323	Primary	Classroom 323	yes	Ceiling	Crack in plaster, Flaking	20	N/A	N/A	N/A	
418	1490	1	3	321	Primary	Classroom 321	yes	W1	Flaking, Crack in plaster	6	N/A	N/A	N/A	
419	1490	1	3	321	Primary	Classroom 321	yes	W2	Cracking, flaking	60	N/A	N/A	N/A	
420	1490	1	3	321	Primary	Classroom 321	yes	W3	Efflorescence, flaking, crack in plaster	15	N/A	N/A	N/A	
421	1490	1	3	321	Primary	Classroom 321	yes	W4	Flaking	5	N/A	N/A	N/A	
422	1490	1	3	321	Primary	Classroom 321	yes	Ceiling	Efflorescence, Flaking	15	N/A	N/A	N/A	
423	1490	1	3	321A	Storage	Classroom 321 Closet	yes	W1	Flaking	2	N/A	N/A	N/A	
424	1490	1	3	321A	Storage	Classroom 321 Closet	yes	W4	Damaged plaster	2	N/A	N/A	N/A	
425	1490	1	3	321B	Storage	Classroom 321 - Closet inside Main Closet (near Main Entrance to Classroom)	yes	W3	Damaged plaster	2	N/A	N/A	N/A	
426	1490	1	3	321C	Storage	Classroom 321 - Closet inside Main Closet (near rear of Classroom)	yes	W3	Crack in plaster	6	N/A	N/A	N/A	
427	1490	1	3	322	Primary	Classroom 322	yes	W1	Flaking, Damaged plaster	4	N/A	N/A	N/A	
428	1490	1	3	322	Primary	Classroom 322	yes	W3	Efflorescence, Flaking, crack in plaster	15	N/A	N/A	N/A	
429	1490	1	3	322	Primary	Classroom 322	yes	W4	Efflorescence, Flaking, crack in plaster	6	N/A	N/A	N/A	
430	1490	1	3	322	Primary	Classroom 322	yes	Ceiling	Flaking	6	N/A	N/A	N/A	
431	1490	1	3	322A	Storage	Classroom 322 Closet	yes	W1	Damaged plaster	2	N/A	N/A	N/A	
432	1490	1	3	322A	Storage	Classroom 322 Closet	yes	W2	Crack in plaster	3	N/A	N/A	N/A	
433	1490	1	3	322A	Storage	Classroom 322 Closet	yes	W3	Damaged plaster	5	N/A	N/A	N/A	
434	1490	1	3	324	Primary	Classroom 324	yes	W1	Flaking	5	N/A	N/A	N/A	
435	1490	1	3	324	Primary	Classroom 324	yes	W1	Damaged Plaster	3	N/A	N/A	N/A	

Rudolph Blankenburg ES  
Scope of Work

<i>Task ID</i>	<i>ULCS#</i>	<i>E l e m e n t</i>	<i>F l o o r</i>	<i>Space # (on Floor Plan)</i>	<i>Space Type</i>	<i>On Site Room Name</i>	<i>Student/ Teacher Occupied</i>	<i>Primary Component</i>	<i>Description of Paint and Plaster Damage - Primary Component</i>	<i>Primary Component Damage Quantity (sf)</i>	<i>Additional Component (see terms)</i>	<i>Description of Paint and Plaster Damage - Additional Component</i>	<i>Additoinal Component Damage Quantity (sf)</i>	<i>Comments</i>
436	1490	1	3	324	Primary	Classroom 324	yes	W2	Flaking/Craking	6	N/A	N/A	N/A	
437	1490	1	3	324	Primary	Classroom 324	yes	W3	Cracking, Flaking, damaged plaster	35	N/A	N/A	N/A	
438	1490	1	3	324	Primary	Classroom 324	yes	W4	Crack in plaster	3	N/A	N/A	N/A	
439	1490	1	3	324	Primary	Classroom 324	yes	Ceiling	Flaking	6	N/A	N/A	N/A	
440	1490	1	3	324A	Storage	Classroom 324 Closet	yes	W1	Damaged Plaster	2	N/A	N/A	N/A	
441	1490	1	3	324A	Storage	Classroom 324 Closet	yes	W1	Damaged Plaster	3	N/A	N/A	N/A	
442	1490	1	3	324A	Storage	Classroom 324 Closet	yes	W2	Flaking	10	N/A	N/A	N/A	
443	1490	1	3	324A	Storage	Classroom 324 Closet	yes	W2	Flaking, Efflorescence	20	N/A	N/A	N/A	
444	1490	1	3	324A	Storage	Classroom 324 Closet	yes	W3	Flaking, cracking	10	N/A	N/A	N/A	
445	1490	1	3	324A	Storage	Classroom 324 Closet	yes	W3	Flaking	3	N/A	N/A	N/A	
446	1490	1	3	324A	Storage	Classroom 324 Closet	yes	W4	Crack in Plaster	8	N/A	N/A	N/A	
447	1490	1	3	324A	Storage	Classroom 324 Closet	yes	Ceiling	Flaking	2	N/A	N/A	N/A	
448	1490	1	3	320	Primary	Classroom 320	yes	W1	Flaking	2	N/A	N/A	N/A	
449	1490	1	3	320	Primary	Classroom 320	yes	W2	Flaking	2	N/A	N/A	N/A	
450	1490	1	3	320	Primary	Classroom 320	yes	W3	Flaking	10	N/A	N/A	N/A	
451	1490	1	3	320	Primary	Classroom 320	yes	W3	N/A	N/A	Drain Pipe	Flaking	4	
452	1490	1	3	320A	Storage	Classroom 320 Closet	yes	W1	Crack in Plaster	5	N/A	N/A	N/A	
453	1490	1	3	320A	Storage	Classroom 320 Closet	yes	W2	Crack in Plaster	3	N/A	N/A	N/A	
454	1490	1	3	320A	Storage	Classroom 320 Closet	yes	W3	Cracking	2	N/A	N/A	N/A	
455	1490	1	3	320A	Storage	Classroom 320 Closet	yes	W3	Cracking	2	N/A	N/A	N/A	
456	1490	1	3	325	Primary	Classroom 325	yes	W1	Crack in Plaster	3	N/A	N/A	N/A	
457	1490	1	3	325	Primary	Classroom 325	yes	W1	Flaking	5	N/A	N/A	N/A	
458	1490	1	3	325	Primary	Classroom 325	yes	W2	Flaking	3	N/A	N/A	N/A	
459	1490	1	3	325	Primary	Classroom 325	yes	W3	Efflorescence, Flaking	20	N/A	N/A	N/A	
460	1490	1	3	325	Primary	Classroom 325	yes	W4	Flaking, Crack in plaster	5	N/A	N/A	N/A	
461	1490	1	3	325	Primary	Classroom 325	yes	W4	Cracking	3	N/A	N/A	N/A	
462	1490	1	3	325	Primary	Classroom 325	yes	Ceiling	Efflorescence	2	N/A	N/A	N/A	Appears to have been repaired once
463	1490	1	3	325A	Storage	Classroom 325 Closet	yes	W1	Flaking	3	N/A	N/A	N/A	
464	1490	1	3	325A	Storage	Classroom 325 Closet	yes	W1	Flaking	2	N/A	N/A	N/A	
465	1490	1	3	325A	Storage	Classroom 325 Closet	yes	W2	Crack in plaster	5	N/A	N/A	N/A	
466	1490	1	3	325A	Storage	Classroom 325 Closet	yes	W2	Efflorescence, Flaking	10	N/A	N/A	N/A	
467	1490	1	3	325A	Storage	Classroom 325 Closet	yes	W3	Efflorescence, Flaking	12	N/A	N/A	N/A	
468	1490	1	3	325A	Storage	Classroom 325 Closet	yes	W3	Efflorescence, Flaking	30	N/A	N/A	N/A	

Rudolph Blankenburg ES  
Scope of Work

<i>Task ID</i>	<i>ULCS#</i>	<i>E l e m e n t</i>	<i>F l o o r</i>	<i>Space # (on Floor Plan)</i>	<i>Space Type</i>	<i>On Site Room Name</i>	<i>Student/ Teacher Occupied</i>	<i>Primary Component</i>	<i>Description of Paint and Plaster Damage - Primary Component</i>	<i>Primary Component Damage Quantity (sf)</i>	<i>Additional Component (see terms)</i>	<i>Description of Paint and Plaster Damage - Additional Component</i>	<i>Additoinal Component Damage Quantity (sf)</i>	<i>Comments</i>
469	1490	1	3	325A	Storage	Classroom 325 Closet	yes	W4	Crack in Plaster	4	N/A	N/A	N/A	
470	1490	1	3	325A	Storage	Classroom 325 Closet	yes	W4	Flaking	1	N/A	N/A	N/A	
471	1490	1	3	325A	Storage	Classroom 325 Closet	yes	Ceiling	Flaking, craack in plaster	4	N/A	N/A	N/A	
472	1490	1	3	S37	Stairs	Stairwell M (near Classroom 326)	yes	W1	Flaking	3	N/A	N/A	N/A	
473	1490	1	3	S37	Stairs	Stairwell M (near Classroom 326)	yes	W1	Cracking	4	N/A	N/A	N/A	
474	1490	1	3	S37	Stairs	Stairwell M (near Classroom 326)	yes	W2	Flaking	3	N/A	N/A	N/A	
475	1490	1	3	S37	Stairs	Stairwell M (near Classroom 326)	yes	W2	Friction	5	N/A	N/A	N/A	
476	1490	1	3	S37	Stairs	Stairwell M (near Classroom 326)	yes	W3	Crack in plaster	4	N/A	N/A	N/A	
477	1490	1	3	S37	Stairs	Stairwell M (near Classroom 326)	yes	W4	Crack in plaster	5	N/A	N/A	N/A	
478	1490	1	3	S37	Stairs	Stairwell M (near Classroom 326)	yes	W4	Spalling	2	N/A	N/A	N/A	Spalling at middle landing
479	1490	1	3	326	Computer - Intermediate Middle	Classroom 326	yes	W1	Efflorescence, damaged plaster	4	N/A	N/A	N/A	
480	1490	1	3	326	Computer - Intermediate Middle	Classroom 326	yes	W3	Efflorescence	10	N/A	N/A	N/A	
481	1490	1	3	326	Computer - Intermediate Middle	Classroom 326	yes	W4	Friction	2	N/A	N/A	N/A	Damaged plaster due to contact with metal gate door at two spots
482	1490	1	3	326	Computer - Intermediate Middle	Classroom 326	yes	Ceiling	Efflorescence, Flaking paint	6	N/A	N/A	N/A	
483	1490	1	3	326A	Storage	Classroom 326 Closet	yes	W1	Flaking, crack in plaster	5	N/A	N/A	N/A	
484	1490	1	3	326A	Storage	Classroom 326 Closet	yes	W2	Flaking, Efflorescence	20	N/A	N/A	N/A	ACM riser (12')
485	1490	1	3	326A	Storage	Classroom 326 Closet	yes	W3	Cracking, Crack in Plaster	12	N/A	N/A	N/A	
486	1490	1	3	326A	Storage	Classroom 326 Closet	yes	Ceiling	Flaking	1	N/A	N/A	N/A	
487	1490	1	3	327	Computer - Intermediate Middle	Classroom 327	yes	W3	Efflorescence, cracking	20	N/A	N/A	N/A	below windows
488	1490	1	3	327	Computer - Intermediate Middle	Classroom 327	yes	Ceiling	Cracking	3	N/A	N/A	N/A	
489	1490	1	3	328	Primary	Classroom 328	yes	W1	Flaking	20	N/A	N/A	N/A	Upper wall - Above blackboard
490	1490	1	3	328	Primary	Classroom 328	yes	W1	Cracking	2	N/A	N/A	N/A	Lower wall - Below blackboard
491	1490	1	3	328	Primary	Classroom 328	yes	W2	Crack in plaster	2	N/A	N/A	N/A	Upper wall
492	1490	1	3	328	Primary	Classroom 328	yes	W2	Cracking	6	N/A	N/A	N/A	Lower wall - Below blackboard
493	1490	1	3	328	Primary	Classroom 328	yes	W3	Flaking	2	N/A	N/A	N/A	Upper wall
494	1490	1	3	328	Primary	Classroom 328	yes	W3	Efflorescence	20	N/A	N/A	N/A	Lower wall - Below blackboard
495	1490	1	3	328	Primary	Classroom 328	yes	Ceiling	Flaking, Efflorescence	30	N/A	N/A	N/A	
496	1490	1	3	H317	Circulation (Hallway)	Fire Tower Hallway adjacent to Hallway from Classrooms 325 to 328	yes	W1	Flaking	20	N/A	N/A	N/A	
497	1490	1	3	H317	Circulation (Hallway)	Fire Tower Hallway adjacent to Hallway from Classrooms 325 to 328	yes	W2	Flaking	35	N/A	N/A	N/A	
498	1490	1	3	H317	Circulation (Hallway)	Fire Tower Hallway adjacent to Hallway from Classrooms 325 to 328	yes	W3	N/A	N/A	Window sill	Flaking	10	
499	1490	1	3	H317	Circulation (Hallway)	Fire Tower Hallway adjacent to Hallway from Classrooms 325 to 328	yes	W4	Flaking	40	N/A	N/A	N/A	
500	1490	1	3	H317	Circulation (Hallway)	Fire Tower Hallway adjacent to Hallway from Classrooms 325 to 328	yes	Ceiling	Flaking	60	N/A	N/A	N/A	
501	1490	1	3	H317	Circulation (Hallway)	Fire Tower Hallway adjacent to Hallway from Classrooms 325 to 328	yes	Floor	Flaking	20	N/A	N/A	N/A	Along perimeter

Rudolph Blankenburg ES  
Scope of Work

<i>Task ID</i>	<i>ULCS#</i>	<i>E l e m e n t</i>	<i>F l o o r</i>	<i>Space # (on Floor Plan)</i>	<i>Space Type</i>	<i>On Site Room Name</i>	<i>Student/ Teacher Occupied</i>	<i>Primary Component</i>	<i>Description of Paint and Plaster Damage - Primary Component</i>	<i>Primary Component Damage Quantity (sf)</i>	<i>Additional Component (see terms)</i>	<i>Description of Paint and Plaster Damage - Additional Component</i>	<i>Additoinal Component Damage Quantity (sf)</i>	<i>Comments</i>
502	1490	1	3	S35	Stairs	Fire Tower adjacent to Hallway from Classrooms 325 to 328	yes	W1	Cracking, Flaking	10	N/A	N/A	N/A	
503	1490	1	3	S35	Stairs	Fire Tower adjacent to Hallway from Classrooms 325 to 328	yes	W2	Cracking	15	N/A	N/A	N/A	
504	1490	1	3	S35	Stairs	Fire Tower adjacent to Hallway from Classrooms 325 to 328	yes	W2	N/A	N/A	Window frame	Flaking	12	
505	1490	1	3	S35	Stairs	Fire Tower adjacent to Hallway from Classrooms 325 to 328	yes	W3	Cracking	10	N/A	N/A	N/A	
506	1490	1	3	S35	Stairs	Fire Tower adjacent to Hallway from Classrooms 325 to 328	yes	W4	Cracking	5	N/A	N/A	N/A	
507	1490	1	3	S35	Stairs	Fire Tower adjacent to Hallway from Classrooms 325 to 328	yes	Ceiling	Flaking, cracking	6	N/A	N/A	N/A	
508	1490	1	3	S35	Stairs	Fire Tower adjacent to Hallway from Classrooms 325 to 328	yes	Floor	Flaking	20	N/A	N/A	N/A	
509	1490	1	3	H314	Circulation (Hallway)	Hallway from Classrooms 325 to 328	yes	W3	Efflorescence, Spalling	30	N/A	N/A	N/A	
510	1490	1	3	H314	Circulation (Hallway)	Hallway from Classrooms 325 to 328	yes	W3	N/A	N/A	Window sill	Damaged plaster	4	At window across from Classroom 327
511	1490	1	3	H316	Circulation (Hallway)	Hallway from Classrooms 320 to 325	yes	Ceiling	Cracking	3	N/A	N/A	N/A	Near Stairwell
512	1490	1	3	S38	Stairs	Stairwell G (near Classroom 319)	yes	W1	Efflorescence, Spalling	30	N/A	N/A	N/A	
513	1490	1	3	S38	Stairs	Stairwell G (near Classroom 319)	yes	W2	Friction	3	N/A	N/A	N/A	
514	1490	1	3	S38	Stairs	Stairwell G (near Classroom 319)	yes	W2	Friction	3	N/A	N/A	N/A	
515	1490	1	3	S38	Stairs	Stairwell G (near Classroom 319)	yes	W3	N/A	N/A	Door	Friction, repeated contact	4	
516	1490	1	3	S38	Stairs	Stairwell G (near Classroom 319)	yes	W3	N/A	N/A	Stair riser	Flaking	10	
517	1490	1	3	S38	Stairs	Stairwell G (near Classroom 319)	yes	W4	Friction	5	N/A	N/A	N/A	
518	1490	1	3	S38	Stairs	Stairwell G (near Classroom 319)	yes	W4	Friction	2	N/A	N/A	N/A	
519	1490	1	3	S38	Stairs	Stairwell G (near Classroom 319)	yes	Ceiling	Flaking	20	N/A	N/A	N/A	
520	1490	1	3	H315A	Circulation (Hallway)	Fire Tower Hallway adjacent Hallway from Classrooms 316 to 319	yes	W1	Cracking	8	N/A	N/A	N/A	
521	1490	1	3	H315A	Circulation (Hallway)	Fire Tower Hallway adjacent Hallway from Classrooms 316 to 319	yes	W2	Cracking	20	N/A	N/A	N/A	
522	1490	1	3	H315A	Circulation (Hallway)	Fire Tower Hallway adjacent Hallway from Classrooms 316 to 319	yes	W3	N/A	N/A	Window sill	Flaking	10	
523	1490	1	3	H315A	Circulation (Hallway)	Fire Tower Hallway adjacent Hallway from Classrooms 316 to 319	yes	W4	Cracking	15	N/A	N/A	N/A	
524	1490	1	3	H315A	Circulation (Hallway)	Fire Tower Hallway adjacent Hallway from Classrooms 316 to 319	yes	W4	N/A	N/A	Window sill	Flaking	10	
525	1490	1	3	H315A	Circulation (Hallway)	Fire Tower Hallway adjacent Hallway from Classrooms 316 to 319	yes	Ceiling	Cracking	20	N/A	N/A	N/A	
526	1490	1	3	S33	Stairs	Fire Tower adjacent to Hallway from Classrooms 316 to 319	yes	W1	Flaking	3	N/A	N/A	N/A	
527	1490	1	3	S33	Stairs	Fire Tower adjacent to Hallway from Classrooms 316 to 319	yes	W4	N/A	N/A	Window frame	Flaking	10	
528	1490	1	B	H02	Circulation (Hallway)	Hallway along Gymnasium	yes	W2	Flaking, Cracking	20	N/A	N/A	N/A	At the Column
529	1490	1	B	H02	Circulation (Hallway)	Hallway along Gymnasium	yes	Ceiling	Flaking	60	N/A	N/A	N/A	
530	1490	1	B	H02	Circulation (Hallway)	Hallway along Gymnasium	yes	Ceiling	N/A	N/A	Ductwork	Flaking	15	On fiberglass insulation
531	1490	1	B	H02	Circulation (Hallway)	Hallway along Gymnasium	yes	Floor	Flaking	3	N/A	N/A	N/A	Perimeter
532	1490	1	B	H01	Circulation (Hallway)	Hallway from Boy's Restroom to Classroom 29	yes	W1	Cracking	2	N/A	N/A	N/A	
533	1490	1	B	H01	Circulation (Hallway)	Hallway from Boy's Restroom to Classroom 29	yes	W2	Flaking, Cracking	55	N/A	N/A	N/A	
534	1490	1	B	H01	Circulation (Hallway)	Hallway from Boy's Restroom to Classroom 29	yes	W2	N/A	N/A	Pipe jacket	Flaking	3	

Rudolph Blankenburg ES  
Scope of Work

<i>Task ID</i>	<i>ULCS#</i>	<i>E l e m e n t</i>	<i>F l o o r</i>	<i>Space # (on Floor Plan)</i>	<i>Space Type</i>	<i>On Site Room Name</i>	<i>Student/ Teacher Occupied</i>	<i>Primary Component</i>	<i>Description of Paint and Plaster Damage - Primary Component</i>	<i>Primary Component Damage Quantity (sf)</i>	<i>Additional Component (see terms)</i>	<i>Description of Paint and Plaster Damage - Additional Component</i>	<i>Additoinal Component Damage Quantity (sf)</i>	<i>Comments</i>
535	1490	1	B	H01	Circulation (Hallway)	Hallway from Boy's Restroom to Classroom 29	yes	W3	Flaking, Cracking	8	N/A	N/A	N/A	
536	1490	1	B	H01	Circulation (Hallway)	Hallway from Boy's Restroom to Classroom 29	yes	W4	Flaking, Cracking	15	N/A	N/A	N/A	
537	1490	1	B	H01	Circulation (Hallway)	Hallway from Boy's Restroom to Classroom 29	yes	Ceiling	Flaking	100	N/A	N/A	N/A	
538	1490	1	B	H01	Circulation (Hallway)	Hallway from Boy's Restroom to Classroom 29	yes	Ceiling	N/A	N/A	Ductwork	Flaking, Cracking	40	
539	1490	1	B	H01	Circulation (Hallway)	Hallway from Boy's Restroom to Classroom 29	yes	Floor	N/A	N/A	Grate	Flaking, Cracking	15	
540	1490	1	B	H03	Circulation (Hallway)	Hallway from Girl's Restroom to Classroom 30	yes	W1	Flaking	3	N/A	N/A	N/A	
541	1490	1	B	H03	Circulation (Hallway)	Hallway from Girl's Restroom to Classroom 30	yes	W3	Flaking	15	N/A	N/A	N/A	
542	1490	1	B	H03	Circulation (Hallway)	Hallway from Girl's Restroom to Classroom 30	yes	W3	N/A	6	N/A	N/A	N/A	
543	1490	1	B	H03	Circulation (Hallway)	Hallway from Girl's Restroom to Classroom 30	yes	Ceiling	Flaking	100	N/A	N/A	N/A	
544	1490	1	B	H03	Circulation (Hallway)	Hallway from Girl's Restroom to Classroom 30	yes	Ceiling	N/A	N/A	Ductwork	Flaking, Cracking	30	
545	1490	1	B	S08	Stairs	Stairwell adjacent to Classroom 30	yes	W1	Chipping	1	N/A	N/A	N/A	
546	1490	1	B	S08	Stairs	Stairwell adjacent to Classroom 30	yes	W2	Cracking	1	N/A	N/A	N/A	
547	1490	1	B	S08	Stairs	Stairwell adjacent to Classroom 30	yes	W2	Gouge	1	N/A	N/A	N/A	
548	1490	1	B	S08	Stairs	Stairwell adjacent to Classroom 30	yes	W4	Chipping	1	N/A	N/A	N/A	
549	1490	1	B	S07	Stairs	Stairwell adjacent to Classroom 29	yes	W2	N/A	N/A	Baseboard	Chipping	2	
550	1490	1	B	S07	Stairs	Stairwell adjacent to Classroom 29	yes	W4	Gouge	1	N/A	N/A	N/A	
551	1490	1	B	S07	Stairs	Stairwell adjacent to Classroom 29	yes	W4	N/A	N/A	Baseboard	Chipping	2	
552	1490	1	B	S07	Stairs	Stairwell adjacent to Classroom 29	yes	Ceiling	Cracking	4	N/A	N/A	N/A	
553	1490	1	B	S07	Stairs	Stairwell adjacent to Classroom 29	yes	Floor	N/A	N/A	Stair riser	Chipping	8	
554	1490	1	B	S07	Stairs	Stairwell adjacent to Classroom 29	yes	Floor	N/A	N/A	Stair tread	Chipping	3	
555	1490	1	B	S02	Stairs	Stairwell adjacent to Boy's Restroom	yes	W2	Flaking	4	N/A	N/A	N/A	
556	1490	1	B	S02	Stairs	Stairwell adjacent to Boy's Restroom	yes	W3	Flaking	20	N/A	N/A	N/A	
557	1490	1	B	S02	Stairs	Stairwell adjacent to Boy's Restroom	yes	Ceiling	Cracking	2	N/A	N/A	N/A	
558	1490	1	B	S02	Stairs	Stairwell adjacent to Boy's Restroom	yes	Floor	N/A	N/A	Stair riser	Flaking, Cracking	4	
559	1490	1	B	S02A	Circulation (Hallway)	Landing Area to outside exit near Boy's Restroom	yes	W1	Cracking	2	N/A	N/A	N/A	
560	1490	1	B	S02A	Circulation (Hallway)	Landing Area to outside exit near Boy's Restroom	yes	W2	Cracking	4	N/A	N/A	N/A	
561	1490	1	B	S02A	Circulation (Hallway)	Landing Area to outside exit near Boy's Restroom	yes	W3	Cracking	2	N/A	N/A	N/A	
562	1490	1	B	S02A	Circulation (Hallway)	Landing Area to outside exit near Boy's Restroom	yes	W4	Cracking	1	N/A	N/A	N/A	
563	1490	1	B	S02A	Circulation (Hallway)	Landing Area to outside exit near Boy's Restroom	yes	Ceiling	Cracking	2	N/A	N/A	N/A	
564	1490	1	B	S01	Stairs	Stairwell adjacent to Girl's Restroom	yes	Floor	N/A	N/A	Stair riser	Cracking	10	
565	1490	1	B	S01A	Circulation (Hallway)	Landing Area to outside exit near Girl's Restroom	yes	W1	Cracking	3	N/A	N/A	N/A	
566	1490	1	B	S01A	Circulation (Hallway)	Landing Area to outside exit near Girl's Restroom	yes	W1	N/A	N/A	Radiator cover	Cracking	2	
567	1490	1	B	S01A	Circulation (Hallway)	Landing Area to outside exit near Girl's Restroom	yes	W2	Cracking	2	N/A	N/A	N/A	
568	1490	1	B	S01A	Circulation (Hallway)	Landing Area to outside exit near Girl's Restroom	yes	W3	Cracking	3	N/A	N/A	N/A	

Rudolph Blankenburg ES  
Scope of Work

<i>Task ID</i>	<i>ULCS#</i>	<i>E l e m e n t</i>	<i>F l o o r</i>	<i>Space # (on Floor Plan)</i>	<i>Space Type</i>	<i>On Site Room Name</i>	<i>Student/ Teacher Occupied</i>	<i>Primary Component</i>	<i>Description of Paint and Plaster Damage - Primary Component</i>	<i>Primary Component Damage Quantity (sf)</i>	<i>Additional Component (see terms)</i>	<i>Description of Paint and Plaster Damage - Additional Component</i>	<i>Additoinal Component Damage Quantity (sf)</i>	<i>Comments</i>
569	1490	1	B	S01A	Circulation (Hallway)	Landing Area to outside exit near Girl's Restroom	yes	W4	Cracking	1	N/A	N/A	N/A	
570	1490	1	B	S01A	Circulation (Hallway)	Landing Area to outside exit near Girl's Restroom	yes	Ceiling	Cracking	2	N/A	N/A	N/A	
571	1490	1	B	001B	Student Restrooms - Female (4-12)	Girl's Restroom	yes	Ceiling	Cracking	20	N/A	N/A	N/A	
572	1490	1	B	31	IMC (Library)	IMC (Library)	yes	W1	Efflorescence, Flaking	3	N/A	N/A	N/A	At windows
573	1490	1	B	31	IMC (Library)	IMC (Library)	yes	W2	Flaking, Cracking	4	N/A	N/A	N/A	
574	1490	1	B	31	IMC (Library)	IMC (Library)	yes	W3	Efflorescence, Flaking, Cracking	22	N/A	N/A	N/A	
575	1490	1	B	31	IMC (Library)	IMC (Library)	yes	Ceiling	Efflorescence, Flaking	10	N/A	N/A	N/A	
576	1490	1	B	31	IMC (Library)	IMC (Library)	yes	Floor	N/A	N/A	Grating	Flaking	10	Perimeter
577	1490	1	B	002B	Administrative Office	IMC (Library) Office	yes	W1	Cracking, Flaking, Efflorescence, damaged plaster	30	N/A	N/A	N/A	
578	1490	1	B	002B	Administrative Office	IMC (Library) Office	yes	W2	Cracking, Flaking, Efflorescence, damaged plaster	25	N/A	N/A	N/A	
579	1490	1	B	002B	Administrative Office	IMC (Library) Office	yes	W3	Cracking, Flaking, Efflorescence, damaged plaster	40	N/A	N/A	N/A	
580	1490	1	B	002B	Administrative Office	IMC (Library) Office	yes	Ceiling	Flaking	4	N/A	N/A	N/A	At windows
581	1490	1	B	003B	Storage	IMC (Library) Storage	yes	W1	Spalling	2	N/A	N/A	N/A	
582	1490	1	B	003B	Storage	IMC (Library) Storage	yes	W2	Cracking, Flaking	20	N/A	N/A	N/A	
583	1490	1	B	003B	Storage	IMC (Library) Storage	yes	W4	Cracking, Flaking	10	N/A	N/A	N/A	
584	1490	1	B	030	Primary	Classroom 30	yes	W1	Cracking	6	N/A	N/A	N/A	
585	1490	1	B	030	Primary	Classroom 30	yes	W1	Chipping	4	N/A	N/A	N/A	
586	1490	1	B	030	Primary	Classroom 30	yes	W1	N/A	N/A	Wall Board	Chipping	2	
587	1490	1	B	030	Primary	Classroom 30	yes	W2	Cracking	20	N/A	N/A	N/A	
588	1490	1	B	030	Primary	Classroom 30	yes	W2	Flaking, Cracking	15	N/A	N/A	N/A	
589	1490	1	B	030	Primary	Classroom 30	yes	W2	N/A	N/A	Wall Board	Chipping	3	
590	1490	1	B	030	Primary	Classroom 30	yes	W3	Efflorescence, Flaking, Cracking	25	N/A	N/A	N/A	
591	1490	1	B	030	Primary	Classroom 30	yes	W3	Efflorescence, Flaking, Cracking, Damaged Plaster	40	N/A	N/A	N/A	
592	1490	1	B	030	Primary	Classroom 30	yes	W4	Cracking	20	N/A	N/A	N/A	
593	1490	1	B	030	Primary	Classroom 30	yes	W4	Cracking, Damaged Plaster	8	N/A	N/A	N/A	
594	1490	1	B	030	Primary	Classroom 30	yes	Ceiling	Flaking	120	N/A	N/A	N/A	

Rudolph Blankenburg ES  
Scope of Work

<i>Task ID</i>	<i>ULCS#</i>	<i>E l e m e n t</i>	<i>F l o o r</i>	<i>Space # (on Floor Plan)</i>	<i>Space Type</i>	<i>On Site Room Name</i>	<i>Student/ Teacher Occupied</i>	<i>Primary Component</i>	<i>Description of Paint and Plaster Damage - Primary Component</i>	<i>Primary Component Damage Quantity (sf)</i>	<i>Additional Component (see terms)</i>	<i>Description of Paint and Plaster Damage - Additional Component</i>	<i>Additoinal Component Damage Quantity (sf)</i>	<i>Comments</i>
595	1490	1	B	030B	Storage	Classroom 30 Closet #1	yes	W1	Flaking, Cracking	20	N/A	N/A	N/A	
596	1490	1	B	030B	Storage	Classroom 30 Closet #1	yes	W2	Efflorescence, Flaking	10	N/A	N/A	N/A	
597	1490	1	B	030B	Storage	Classroom 30 Closet #1	yes	W3	Efflorescence, Flaking	10	N/A	N/A	N/A	
598	1490	1	B	030B	Storage	Classroom 30 Closet #1	yes	Ceiling	Cracking	10	N/A	N/A	N/A	
599	1490	1	B	030A	Storage	Classroom 30 Closet #2	yes	W1	Flaking	15	N/A	N/A	N/A	
600	1490	1	B	030A	Storage	Classroom 30 Closet #2	yes	W2	Flaking, Cracking	5	N/A	N/A	N/A	
601	1490	1	B	030A	Storage	Classroom 30 Closet #2	yes	W3	Flaking	25	N/A	N/A	N/A	
602	1490	1	B	030A	Storage	Classroom 30 Closet #2	yes	W4	Flaking	20	N/A	N/A	N/A	
603	1490	1	B	030A	Storage	Classroom 30 Closet #2	yes	Ceiling	Flaking	20	N/A	N/A	N/A	
604	1490	1	B	11B	Primary	Classroom 27	yes	W1	Cracking	1	N/A	N/A	N/A	
605	1490	1	B	11B	Primary	Classroom 27	yes	W2	Cracking	1	N/A	N/A	N/A	
606	1490	1	B	11B	Primary	Classroom 27	yes	W3	Cracking	10	N/A	N/A	N/A	
607	1490	1	B	11B	Primary	Classroom 27	yes	W4	Cracking	8	N/A	N/A	N/A	
608	1490	1	B	11B	Primary	Classroom 27	yes	Ceiling	Flaking	40	N/A	N/A	N/A	
609	1490	1	B	11B	Primary	Classroom 27	yes	Ceiling	N/A	N/A	Ductwork	Flaking	6	
610	1490	1	B	11C	Administrative Office	Office in Classroom 27	yes	W2	N/A	N/A	Soffit	Efflorescence	2	Bottom of the soffit
611	1490	1	B	028	Primary	Classroom 29	yes	W1	Flaking	4	N/A	N/A	N/A	
612	1490	1	B	028	Primary	Classroom 29	yes	W2	Cracking	2	N/A	N/A	N/A	
613	1490	1	B	028	Primary	Classroom 29	yes	W3	Chipping	2	N/A	N/A	N/A	
614	1490	1	B	028	Primary	Classroom 29	yes	W4	Chipping	2	N/A	N/A	N/A	
615	1490	1	B	028	Primary	Classroom 29	yes	Ceiling	Flaking	5	N/A	N/A	N/A	
	1490	1	B	028A	Kitchen	Kitchen	yes	W1	Cracking	5	N/A	N/A	N/A	
	1490	1	B	028A	Kitchen	Kitchen	yes	W2	Cracking, Flaking	10	N/A	N/A	N/A	
	1490	1	B	028A	Kitchen	Kitchen	yes	W3	Cracking	3	N/A	N/A	N/A	
	1490	1	B	028A	Kitchen	Kitchen	yes	W4	Flaking, crack in plaster	40	N/A	N/A	N/A	
	1490	1	B	028A	Kitchen	Kitchen	yes	Ceiling	Cracking	3	N/A	N/A	N/A	At the windows
	1490	1	B	12B	Gymnasium - Intermediate Middle	Gymnasium	yes	W1	Cracking	3	N/A	N/A	N/A	
	1490	1	B	12B	Gymnasium - Intermediate Middle	Gymnasium	yes	W1	Friction, Contact	4	N/A	N/A	N/A	Bottom course
	1490	1	B	12B	Gymnasium - Intermediate Middle	Gymnasium	yes	W3	Cracking, Chipping	3	N/A	N/A	N/A	
	1490	1	B	12B	Gymnasium - Intermediate Middle	Gymnasium	yes	Ceiling	Flaking	20	N/A	N/A	N/A	
	1490	1	B	12B	Gymnasium - Intermediate Middle	Gymnasium	yes	Ceiling	Efflorescence	8	N/A	N/A	N/A	At windows
	1490	1	B	12B	Gymnasium - Intermediate Middle	Gymnasium	yes	Ceiling	N/A	N/A	Ductwork	Flaking	250	3 lines of ductwork
	1490	1	B	13B	Administrative Office	Gymnasium Office	yes	W2	N/A	N/A	Pipe	Cracking	10	
	1490	1	B	13B	Administrative Office	Gymnasium Office	yes	W3	Partially Inaccessible	0	N/A	N/A	N/A	Gym Equipment and Cabinets in the way

Rudolph Blankenburg ES  
Scope of Work

<i>Task ID</i>	<i>ULCS#</i>	<i>E l e m e n t</i>	<i>F l o o r</i>	<i>Space # (on Floor Plan)</i>	<i>Space Type</i>	<i>On Site Room Name</i>	<i>Student/ Teacher Occupied</i>	<i>Primary Component</i>	<i>Description of Paint and Plaster Damage - Primary Component</i>	<i>Primary Component Damage Quantity (sf)</i>	<i>Additional Component (see terms)</i>	<i>Description of Paint and Plaster Damage - Additional Component</i>	<i>Additoinal Component Damage Quantity (sf)</i>	<i>Comments</i>
	1490	1	B	13B	Administrative Office	Gymnasium Office	yes	W4	Partially Inaccessible	0	N/A	N/A	N/A	Gym Equipment and Cabinets in the way
	1490	1	B	13B	Administrative Office	Gymnasium Office	yes	Ceiling	Flaking	15	N/A	N/A	N/A	
	1490	1	B	14B	Storage	Gymnasium Storage Room	yes	W1	Friction	2	N/A	N/A	N/A	
	1490	1	B	14B	Storage	Gymnasium Storage Room	yes	W3	Friction, Crack in wall	8	N/A	N/A	N/A	
	1490	1	B	14B	Storage	Gymnasium Storage Room	yes	W4	Partially Inaccessible	0	N/A	N/A	N/A	Miscellaneous items on the shelves in the way
	1490	1	B	010B	Student Restrooms - Male (4-12)	Boy's Restroom	yes	W1	Efflorescence, Flaking, Cracking	70	N/A	N/A	N/A	
	1490	1	B	010B	Student Restrooms - Male (4-12)	Boy's Restroom	yes	W2	Efflorescence, Flaking, Cracking	25	N/A	N/A	N/A	
	1490	1	B	010B	Student Restrooms - Male (4-12)	Boy's Restroom	yes	W3	Cracking	15	N/A	N/A	N/A	
	1490	1	B	010B	Student Restrooms - Male (4-12)	Boy's Restroom	yes	W4	Efflorescence, Flaking, Cracking	25	N/A	N/A	N/A	
	1490	1	B	010B	Student Restrooms - Male (4-12)	Boy's Restroom	yes	Ceiling	Flaking, Cracking	120	N/A	N/A	N/A	
	1490	1	1	102K	Storage	Classroom K1 Closet	yes	W1	Flaking	4	N/A	N/A	N/A	
	1490	1	1	102K	Storage	Classroom K1 Closet	yes	W2	Cracking	1	N/A	N/A	N/A	
	1490	1	1	102K	Storage	Classroom K1 Closet	yes	W3	Flaking, Cracking	10	N/A	N/A	N/A	
	1490	1	1	102K	Storage	Classroom K1 Closet	yes	W4	Flaking, Cracking	3	N/A	N/A	N/A	
	1490	1	1	102K	Storage	Classroom K1 Closet	yes	W4	N/A	N/A	Drain Pipe	Chipping	2	
	1490	1	1	102K	Storage	Classroom K1 Closet	yes	Ceiling	Flaking, Cracking	10	N/A	N/A	N/A	
	1490	1	1	101KA	Storage	Classroom K1 Teacher's Closet (in front of room)	yes	W1	None	0	N/A	N/A	N/A	
	1490	1	1	101KA	Storage	Classroom K1 Teacher's Closet (in front of room)	yes	W2	Cracking	20	N/A	N/A	N/A	
	1490	1	1	101KA	Storage	Classroom K1 Teacher's Closet (in front of room)	yes	W3	Cracking	30	N/A	N/A	N/A	
	1490	1	1	101KA	Storage	Classroom K1 Teacher's Closet (in front of room)	yes	W4	Cracking	20	N/A	N/A	N/A	
	1490	1	1	101KA	Storage	Classroom K1 Teacher's Closet (in front of room)	yes	Ceiling	None	0	N/A	N/A	N/A	Closet is filled with teachers items. No damage noted in visible areas
	1490	1	1	107B	Storage	Classroom 107 Closet	yes	W1	None	0	N/A	N/A	N/A	Majority of cloet is not accessible duets items stored in it. More damage may be present. Debris may also be present
	1490	1	1	107B	Storage	Classroom 107 Closet	yes	W1	Crack in plaster	2	N/A	N/A	N/A	Majority of cloet is not accessible duets items stored in it. More damage may be present. Debris may also be present
	1490	1	1	107B	Storage	Classroom 107 Closet	yes	W2	None	0	N/A	N/A	N/A	Majority of closet is not accessible due to items stored in it. More damage may be present. Debris may also be present
	1490	1	1	107B	Storage	Classroom 107 Closet	yes	W2	None	0	N/A	N/A	N/A	Majority of closet is not accessible due to items stored in it. More damage may be present. Debris may also be present
	1490	1	1	107B	Storage	Classroom 107 Closet	yes	W3	Efflorescence, Flaking	5	N/A	N/A	N/A	Majority of closet is not accessible due to items stored in it. More damage may be present. Debris may also be present
	1490	1	1	107B	Storage	Classroom 107 Closet	yes	W3	Efflorescence, Flaking	5	N/A	N/A	N/A	Majority of closet is not accessible due to items stored in it. More damage may be present. Debris may also be present
	1490	1	1	107B	Storage	Classroom 107 Closet	yes	W4	Cracking	2	N/A	N/A	N/A	Majority of closet is not accessible due to items stored in it. More damage may be present. Debris may also be present

Rudolph Blankenburg ES  
Scope of Work

<i>Task ID</i>	<i>ULCS#</i>	<i>E l e m e n t</i>	<i>F l o o r</i>	<i>Space # (on Floor Plan)</i>	<i>Space Type</i>	<i>On Site Room Name</i>	<i>Student/ Teacher Occupied</i>	<i>Primary Component</i>	<i>Description of Paint and Plaster Damage - Primary Component</i>	<i>Primary Component Damage Quantity (sf)</i>	<i>Additional Component (see terms)</i>	<i>Description of Paint and Plaster Damage - Additional Component</i>	<i>Additoinal Component Damage Quantity (sf)</i>	<i>Comments</i>
	1490	1	1	107B	Storage	Classroom 107 Closet	yes	W4	None	0	N/A	N/A	N/A	Majority of closet is not accessible due to items stored in it. More damage may be present. Debris may also be present
	1490	1	1	107B	Storage	Classroom 107 Closet	yes	Ceiling	None	0	N/A	N/A	N/A	Majority of closet is not accessible due to items stored in it. More damage may be present. Debris may also be present
	1490	1	1	102A	Administrative Office	Principal's Office	yes	W1	None	0	N/A	N/A	N/A	
	1490	1	1	102A	Administrative Office	Principal's Office	yes	W2	Flaking	2	N/A	N/A	N/A	
	1490	1	1	102A	Administrative Office	Principal's Office	yes	W3	None	0	N/A	N/A	N/A	
	1490	1	1	102A	Administrative Office	Principal's Office	yes	W4	Flaking below windows	5	N/A	N/A	N/A	
	1490	1	1	102A	Administrative Office	Principal's Office	yes	Ceiling	Flaking	2	N/A	N/A	N/A	
	1490	1	1	102E	Restrooms, Staff - Male/Female	Principal's Restroom	yes	W4	Flaking	3	N/A	N/A	N/A	
	1490	1	1	102E	Restrooms, Staff - Male/Female	Principal's Restroom	yes	Ceiling	Efflorescence at window	2	N/A	N/A	N/A	
	1490	1	3	323A	Storage	Classroom 323 Closet	yes	W1	None	0	N/A	N/A	N/A	
	1490	1	3	323A	Storage	Classroom 323 Closet	yes	W2	Chipping	2	N/A	N/A	N/A	
	1490	1	3	323A	Storage	Classroom 323 Closet	yes	W3	Flaking at the top	10	N/A	N/A	N/A	
	1490	1	3	323A	Storage	Classroom 323 Closet	yes	W4	Flaking, Spalling	5	N/A	N/A	N/A	
	1490	1	3	323A	Storage	Classroom 323 Closet	yes	Ceiling	Flaking	4	N/A	N/A	N/A	
	1490	1	3	322B	Storage	Classroom 322 - Closet inside Main Closet (near Main Entrance to Classroom)	yes	W1	None	0	N/A	N/A	N/A	
	1490	1	3	322B	Storage	Classroom 322 - Closet inside Main Closet (near Main Entrance to Classroom)	yes	W2	Chipping	2	N/A	N/A	N/A	
	1490	1	3	322B	Storage	Classroom 322 - Closet inside Main Closet (near Main Entrance to Classroom)	yes	W3	Crack in plaster	4	N/A	N/A	N/A	
	1490	1	3	322B	Storage	Classroom 322 - Closet inside Main Closet (near Main Entrance to Classroom)	yes	W4	None	0	N/A	N/A	N/A	
	1490	1	3	322B	Storage	Classroom 322 - Closet inside Main Closet (near Main Entrance to Classroom)	yes	Ceiling	None	0	N/A	N/A	N/A	
	1490	1	3	322C	Storage	Classroom 322 - Closet inside Main Closet (near rear of Classroom)	yes	W1	None	0	N/A	N/A	N/A	
	1490	1	3	322C	Storage	Classroom 322 - Closet inside Main Closet (near rear of Classroom)	yes	W2	None	0	N/A	N/A	N/A	
	1490	1	3	322C	Storage	Classroom 322 - Closet inside Main Closet (near rear of Classroom)	yes	W3	None	0	N/A	N/A	N/A	
	1490	1	3	322C	Storage	Classroom 322 - Closet inside Main Closet (near rear of Classroom)	yes	W4	None	0	N/A	N/A	N/A	
	1490	1	3	322C	Storage	Classroom 322 - Closet inside Main Closet (near rear of Classroom)	yes	Ceiling	None	0	N/A	N/A	N/A	
	1490	1	3	324B	Storage	Classroom 324 Teacher Closet inside Main Closet	yes	W1	Chipping	1	N/A	N/A	N/A	
	1490	1	3	324B	Storage	Classroom 324 Teacher Closet inside Main Closet	yes	W2	Chipping	1	N/A	N/A	N/A	
	1490	1	3	324B	Storage	Classroom 324 Teacher Closet inside Main Closet	yes	W3	Crack in plaster	2	N/A	N/A	N/A	
	1490	1	3	324B	Storage	Classroom 324 Teacher Closet inside Main Closet	yes	W4	None	0	N/A	N/A	N/A	
	1490	1	3	324B	Storage	Classroom 324 Teacher Closet inside Main Closet	yes	Ceiling	Crack in plaster	2	N/A	N/A	N/A	
	1490	1	3	320B	Storage	Classroom 320 Teacher Closet inside Main Closet	yes	W1	None	0	N/A	N/A	N/A	

Rudolph Blankenburg ES  
Scope of Work

<i>Task ID</i>	<i>ULCS#</i>	<i>E l e m e n t</i>	<i>F l o o r</i>	<i>Space # (on Floor Plan)</i>	<i>Space Type</i>	<i>On Site Room Name</i>	<i>Student/ Teacher Occupied</i>	<i>Primary Component</i>	<i>Description of Paint and Plaster Damage - Primary Component</i>	<i>Primary Component Damage Quantity (sf)</i>	<i>Additional Component (see terms)</i>	<i>Description of Paint and Plaster Damage - Additional Component</i>	<i>Additoinal Component Damage Quantity (sf)</i>	<i>Comments</i>
	1490	1	3	320B	Storage	Classroom 320 Teacher Closet inside Main Closet	yes	W2	Chipping	2	N/A	N/A	N/A	
	1490	1	3	320B	Storage	Classroom 320 Teacher Closet inside Main Closet	yes	W3	Flaking, Crack in plaster	5	N/A	N/A	N/A	
	1490	1	3	320B	Storage	Classroom 320 Teacher Closet inside Main Closet	yes	W4	None	0	N/A	N/A	N/A	
	1490	1	3	320B	Storage	Classroom 320 Teacher Closet inside Main Closet	yes	Ceiling	None	0	N/A	N/A	N/A	
	1490	1	3	328B	Storage	Classroom 328 Closet	yes	W1	Chipping	3	N/A	N/A	N/A	
	1490	1	3	328B	Storage	Classroom 328 Closet	yes	W2	Crack in plaster	6	N/A	N/A	N/A	
	1490	1	3	328B	Storage	Classroom 328 Closet	yes	W3	Flaking, Cracking	15	N/A	N/A	N/A	
	1490	1	3	328B	Storage	Classroom 328 Closet	yes	W4	Flaking	8	N/A	N/A	N/A	
	1490	1	3	328B	Storage	Classroom 328 Closet	yes	Ceiling	Flaking	12	N/A	N/A	N/A	
	1490	1	B	H03A	Storage	Hallway Closet next to Classroom 30	yes	W1	None	0	N/A	N/A	N/A	
	1490	1	B	H03A	Storage	Hallway Closet next to Classroom 30	yes	W2	None	0	N/A	N/A	N/A	
	1490	1	B	H03A	Storage	Hallway Closet next to Classroom 30	yes	W3	None	0	N/A	N/A	N/A	
	1490	1	B	H03A	Storage	Hallway Closet next to Classroom 30	yes	W4	None	0	N/A	N/A	N/A	
	1490	1	B	H03A	Storage	Hallway Closet next to Classroom 30	yes	Ceiling	N/A	N/A	Ductwork	Cracking, Flaking	4	
	1490	1	B	028D	Storage	Classroom 29 - Rear Closet	yes	W1	Flaking	6	N/A	N/A	N/A	Asbestos DDC was submitted on 11/14/19
	1490	1	B	028D	Storage	Classroom 29 - Rear Closet	yes	W2	Cracking	2	N/A	N/A	N/A	Asbestos DDC was submitted on 11/14/19
	1490	1	B	028D	Storage	Classroom 29 - Rear Closet	yes	W3	Efflorescence, Flaking, Cracking	6	N/A	N/A	N/A	Asbestos DDC was submitted on 11/14/19
	1490	1	B	028D	Storage	Classroom 29 - Rear Closet	yes	W4	Cracking, hole in plaster	8	N/A	N/A	N/A	Asbestos DDC was submitted on 11/14/19
	1490	1	B	028D	Storage	Classroom 29 - Rear Closet	yes	Ceiling	Cracking	4	N/A	N/A	N/A	Asbestos DDC was submitted on 11/14/19
	1490	1	B	028E	Storage	Classroom 29 - Front Closet	yes	W1	Cracking	4	N/A	N/A	N/A	Asbestos DDC was submitted on 11/14/19
	1490	1	B	028E	Storage	Classroom 29 - Front Closet	yes	W2	Cracking, Flaking	15	N/A	N/A	N/A	Asbestos DDC was submitted on 11/14/19
	1490	1	B	028E	Storage	Classroom 29 - Front Closet	yes	W3	Cracking	25	N/A	N/A	N/A	Asbestos DDC was submitted on 11/14/19
	1490	1	B	028E	Storage	Classroom 29 - Front Closet	yes	W4	Cracking	3	N/A	N/A	N/A	Asbestos DDC was submitted on 11/14/19
	1490	1	B	028E	Storage	Classroom 29 - Front Closet	yes	Ceiling	None	0	N/A	N/A	N/A	Asbestos DDC was submitted on 11/14/19
	1490	1	B	11B	Primary	Classroom 27	yes	Ceiling	Cracking, Flaking, Spalling	30	N/A	N/A	N/A	Mainly near the entrance and by rear window. Asbestos DDC was submitted on 11/14/19
	1490	1	B	11C	Administrative Office	Office in Classroom 27	yes	W2	N/A	N/A	Soffit	Efflorescence	2	Bottom of the soffit
	1490	1	B	028A	Kitchen	Kitchen	yes	W1	Cracking	5	N/A	N/A	N/A	Above doorway
	1490	1	B	028A	Kitchen	Kitchen	yes	W4	Flaking, crack in plaster	40	N/A	N/A	N/A	
	1490	1	B	001B	Student Restrooms - Female (4-12)	Girl's Restroom	yes	Ceiling	Cracking	25	N/A	N/A	N/A	
	1490	1	B	002B	Administrative Office	IMC (Library) Office	yes	W2	Spalling - below the window	6	N/A	N/A	N/A	
	1490	1	B	003B	Storage	IMC (Library) Storage	yes	W4	Cracking, Flaking	2	N/A	N/A	N/A	Near the light switch
	1490	1	B	030	Primary	Classroom 30	yes	W3	Cracking	2	N/A	N/A	N/A	
	1490	1	B	H03	Circulation (Hallway)	Hallway from Girl's Restroom to Classroom 30	yes	Ceiling	N/A	N/A	Ductwork	Flaking, Cracking	2	on the side of the duct - near the Girls Restroom

Rudolph Blankenburg ES  
Scope of Work

<i>Task ID</i>	<i>ULCS#</i>	<i>E l e m e n t</i>	<i>F l o o r</i>	<i>Space # (on Floor Plan)</i>	<i>Space Type</i>	<i>On Site Room Name</i>	<i>Student/ Teacher Occupied</i>	<i>Primary Component</i>	<i>Description of Paint and Plaster Damage - Primary Component</i>	<i>Primary Component Damage Quantity (sf)</i>	<i>Additional Component (see terms)</i>	<i>Description of Paint and Plaster Damage - Additional Component</i>	<i>Additoinal Component Damage Quantity (sf)</i>	<i>Comments</i>
	1490	1	B	H03	Circulation (Hallway)	Hallway from Girl's Restroom to Classroom 30	yes	Ceiling	Flaking	10	N/A	N/A	N/A	Spread out
	1490	1	B	010B	Student Restrooms - Male (4-12)	Boy's Restroom	yes	W1	Cracking	3	N/A	N/A	N/A	
	1490	1	B	010B	Student Restrooms - Male (4-12)	Boy's Restroom	yes	W2	Cracking	15	N/A	N/A	N/A	
	1490	1	B	010B	Student Restrooms - Male (4-12)	Boy's Restroom	yes	W3	Cracking	20	N/A	N/A	N/A	
	1490	1	B	010B	Student Restrooms - Male (4-12)	Boy's Restroom	yes	Ceiling	Flaking, Cracking	10	N/A	N/A	N/A	Spread out
	1490	1	B	H01	Circulation (Hallway)	Hallway from Boy's Restroom to Classroom 29	yes	W2	N/A	N/A	Pipe jacket	Flaking	20	5 risers
	1490	1	B	H02	Circulation (Hallway)	Hallway along Gymnasium	yes	Ceiling	Flaking	20	N/A	N/A	N/A	Above the pipes along the wall, and outside Classroom 27
	1490	1	B	12B	Gymnasium - Intermediate Middle	Gymnasium	yes	Ceiling	Flaking	2	N/A	N/A	N/A	At the window
	1490	1	B	13B	Administrative Office	Gymnasium Office	yes	W2	N/A	N/A	Pipe	Cracking	10	
	1490	1	1	107A	Restrooms, Staff - Male	Men's Restroom next to Classroom 107	yes	W2	Damaged plaster at either columns	10	N/A	N/A	N/A	
	1490	1	1	107	Primary	Classroom 107	yes	W3	Efflorescence/Flaking	8	N/A	N/A	N/A	Damage is on wall behind at radiator cage/cover. Was not previously addressed
	1490	1	1	106	Primary	Classroom 106	yes	W3	Chipping/Cracking	8	N/A	N/A	N/A	Damage is on wall behind at radiator cage/cover. Was not previously addressed
	1490	1	1	105	Primary	Classroom 105	yes	W3	Cracking	6	N/A	N/A	N/A	Damage is on wall behind at radiator cage/cover. Was not previously addressed
	1490	1	1	105A	Storage	Classroom 105 Closet	yes	W1	Partially Inaccessible/Chipping	2	N/A	N/A	N/A	Not addressed. Not sealed off.
	1490	1	1	105A	Storage	Classroom 105 Closet	yes	W2	Partially Inaccessible/Chipping	2	N/A	N/A	N/A	Not addressed. Not sealed off.
	1490	1	1	105A	Storage	Classroom 105 Closet	yes	W3	Partially Inaccessible/Chipping	2	N/A	N/A	N/A	Not addressed. Not sealed off.
	1490	1	1	105A	Storage	Classroom 105 Closet	yes	W4	Partially Inaccessible/Chipping	2	N/A	N/A	N/A	Not addressed. Not sealed off.
	1490	1	1	105A	Storage	Classroom 105 Closet	yes	Ceiling	Chipping	4	N/A	N/A	N/A	Not addressed. Not sealed off.
	1490	1	1	105B	Storage	Stationery Closet adjacent to Classroom 105	yes	W2	Cracking	4	N/A	N/A	N/A	Not addressed. Not sealed off.
	1490	1	1	105B	Storage	Stationery Closet adjacent to Classroom 105	yes	W3	Friction	4	N/A	N/A	N/A	Not addressed. Not sealed off.
	1490	1	1	105B	Storage	Stationery Closet adjacent to Classroom 105	yes	W4	Flaking	3	N/A	N/A	N/A	Not addressed. Not sealed off.
	1490	1	1	105B	Storage	Stationery Closet adjacent to Classroom 105	yes	Ceiling	Flaking	8	N/A	N/A	N/A	Not addressed. Not sealed off.
	1490	1	1	H14	Circulation (Hallway)	Hallway from Classroom 105 to 107	yes	Ceiling	Cracking, Flaking	15	N/A	N/A	N/A	Above stairwell to Basement near Classroom 107 & outside Classroom 105
	1490	1	1	H14	Circulation (Hallway)	Hallway from Classroom 105 to 107	yes	W3	Spalling, Damaged plaster	8	N/A	N/A	N/A	Above radiator and across from Classroom 106
	1490	1	1	104C	Student Restrooms - Male (4-12)	Boy's Restroom near Classroom K4	yes	Ceiling	Flaking	1	N/A	N/A	N/A	
	1490	1	1	104	Primary	Classroom K4	yes	Ceiling	Cracking	6	N/A	N/A	N/A	
	1490	1	1	104	Primary	Classroom K4	yes	W3	Chipping	4	N/A	N/A	N/A	Damage is on wall behind at radiator cage/cover. Was not previously addressed
	1490	1	1	H15	Circulation (Hallway)	Hallway from Stairwell near Classroom K1 to Stairwell near Classroom K4	yes	W4	Efflorescence, Flaking, Damaged plaster	8	N/A	N/A	N/A	Near exit door and behind couch, Exposed damaged plaster due to missing chair rail sections
	1490	1	1	103D	Auditorium	Auditorium	yes	Ceiling	Flaking, Cracking	6	N/A	N/A	N/A	Cracking paint near the stage and Flaking paint on beam in the rear of the Auditorium
	1490	1	1	H16	Circulation (Hallway)	Hallway along Classrooms 101 to 103 (to Custodial Closet)	yes	Ceiling	Cracking	1	N/A	N/A	N/A	Across from the water fountain

***Appendix B. EPA Checklist Table***







Rudolph Blankenburg ES  
EPA Checklist

	ULCS#	F l o o r	Space # (on Floor Plan)	On Site Room Name	Primary Component	Description of Paint and Plaster Damage - Primary Component	Additional Component	Description of Paint and Plaster Damage - Additional Component	Name of Firm	Date of Renovation	Brief Description of Renovation	Name of Assigned Renovator	Name(s) of Trained Worker(s), if used	Name of Dust Sampling Technician, Inspector, or Risk Assessor, if used	Certified renovator performed post-renovation cleaning verification	Describe the results of post-renovation cleaning verification, including the number of wet and dry cloths used	If dust clearance testing was performed instead, attach a copy of the report	I certify under penalty of law that the previous information is true and complete (name and title)	Date signed
159	1490	1	106	Classroom 106	W3	Chipping/Cracking	N/A	N/A	Criterion	8/12/19	RRP scrape, spackle, and paint	WebCo	see above	Nicolette Ralieggh	Yes	20 RRP Wipes, 3 Colorimetric	16.83 µg/ft2	Nicolette Raleigh	8/12/19
160	1490	1	105	Classroom 105	W3	Chipping	N/A	N/A	see above	8/12/19	RRP scrape, spackle, and paint	WebCo	see above	Nicolette Ralieggh	Yes	21 RRP Wipes, 3 Colorimetric	101.76 µg/ft2 , 10.22 µg/ft2	Nicolette Raleigh	8/12/19
161	1490	1	105	Classroom 105	W3	Cracking	N/A	N/A	see above	8/12/19	see above	see above	see above	see above	see above	see above	see above	see above	see above
162	1490	1	105	Classroom 105	W3	N/A	Columns	Chipping	see above	8/12/19	see above	see above	see above	see above	see above	see above	see above	see above	see above
163	1490	1	105	Classroom 105	Ceiling	Flaking	N/A	N/A	see above	8/12/19	see above	see above	see above	see above	see above	see above	see above	see above	see above
164	1490	1	105A	Classroom 105 Closet	W1	Partially Inaccessible/Chipping	N/A	N/A	Criterion	1/30/20	(Lead Safe RRP) scrape, spackle, and paint of damaged areas only	SDP Painters	N/A	Jonathan McKinnon	Yes	8 RRP Wipes	N/A	Jonathan McKinnon, Industrial Hygienist	1/31/20
165	1490	1	105A	Classroom 105 Closet	W2	Partially Inaccessible/Chipping	N/A	N/A	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
166	1490	1	105A	Classroom 105 Closet	W3	Partially Inaccessible/Chipping	N/A	N/A	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
167	1490	1	105A	Classroom 105 Closet	W4	Partially Inaccessible/Chipping	N/A	N/A	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
168	1490	1	105A	Classroom 105 Closet	Ceiling	Chipping	N/A	N/A	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
169	1490	1	105B	Stationery Closet adjacent to Classroom 105	W2	Cracking	N/A	N/A	Criterion	2/11/20	(Lead Safe RRP) scrape, spackle, and paint of damaged areas	SDP Painters	SDP Painters	Jonathan McKinnon	Yes	6 RRP Wipes	N/A	Jonathan McKinnon, Industrial Hygienist	2/11/20
170	1490	1	105B	Stationery Closet adjacent to Classroom 105	W3	Friction	N/A	N/A	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
171	1490	1	105B	Stationery Closet adjacent to Classroom 105	W4	Flaking	N/A	N/A	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
172	1490	1	105B	Stationery Closet adjacent to Classroom 105	Ceiling	Flaking	N/A	N/A	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
173	1490	1	S17	Stairwell near Classroom 105	W2	N/A	Baseboard	Chipping	Criterion	8/10/2019	RRP scrape, spackle, and paint	WebCo	see above	Nicolette Ralieggh	Yes	2 RRP Wipes, 1 Colorimetric	N/A	Nicolette Raleigh	8/13/19
174	1490	1	S17	Stairwell near Classroom 105	W3	N/A	Door	Chipping, Frequent contact	see above	8/10/2019	see above	see above	see above	see above	see above	see above	see above	see above	see above
175	1490	1	S17	Stairwell near Classroom 105	W4	N/A	Baseboard	Chipping	see above	8/10/2019	see above	see above	see above	see above	see above	see above	see above	see above	see above
176	1490	1	S17	Stairwell near Classroom 105	Ceiling	Flaking	N/A	N/A	see above	8/10/2019	see above	see above	see above	see above	see above	see above	see above	see above	see above
177	1490	1	S17	Stairwell near Classroom 105	Floor	N/A	Stair riser	Cracking	see above	8/10/2019	see above	see above	see above	see above	see above	see above	see above	see above	see above
178	1490	1	S17	Stairwell near Classroom 105	Floor	N/A	Stair tread	Cracking	see above	8/10/2019	see above	see above	see above	see above	see above	see above	see above	see above	see above
179	1490	1	102D	Main Office Closet	W2	Damaged Plaster	N/A	N/A	Criterion	3/6/20	(Lead Safe RRP) scrape, spackle, and paint of damaged areas	SDP Painters	SDP Painters	Nicolette Raleigh / Jonathan McKinnon	Yes	6 RRP Wipes	N/A	Nicolette Raleigh / Jonathan McKinnon, Industrial Hygienist	3/7/20
180	1490	1	102D	Main Office Closet	W3	Flaking	N/A	N/A	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
181	1490	1	102D	Main Office Closet	W4	Crack in Plaster	N/A	N/A	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
182	1490	1	102F	Main Office Closet	Ceiling	Flaking, Damaged Plaster	N/A	N/A	Criterion	3/4/20	(Lead Safe RRP) scrape, spackle, and paint of damaged areas	SDP Painters	SDP Painters	Jonathan McKinnon	Yes	9 RRP Wipes	N/A	Jonathan McKinnon, Industrial Hygienist	3/4/20
183	1490	2	213B	Book Room adjacent to Classroom 213	W2	Flaking, damaged plaster	N/A	N/A	Criterion	2/11/20	(Lead Safe RRP) scrape, spackle, and paint of damaged areas	SDP Painters	SDP Painters	Jonathan McKinnon	Yes	6 RRP Wipes	N/A	Jonathan McKinnon, Industrial Hygienist	2/11/20
184	1490	2	212CF	Foyer in Boy's Restroom near Classroom 212	W3	Flaking, Cracking	N/A	N/A	Criterion	8/8/19	RRP scrape, spackle, and paint	WebCo	see above	Nicolette Ralieggh	Yes	2 RRP Wipes, 1 Colorimetric	29.1 µg/ft2, 19.77µg/ft2	Nicolette Raleigh	8/13/19
185	1490	2	212C	Boy's Restroom near Classroom 212	W1	Efflorescence, Flaking	N/A	N/A	see above	8/8/19	RRP scrape, spackle, and paint	WebCo	see above	Nicolette Ralieggh	Yes	5 RRP Wipes, 1 Colorimetric	see above	Nicolette Raleigh	8/13/19
186	1490	2	212C	Boy's Restroom near Classroom 212	W2	Flaking, cracking	N/A	N/A	see above	8/8/19	see above	see above	see above	see above	see above	see above	see above	see above	see above
187	1490	2	212C	Boy's Restroom near Classroom 212	W3	Flaking, cracking	N/A	N/A	see above	8/8/19	see above	see above	see above	see above	see above	see above	see above	see above	see above
188	1490	2	212C	Boy's Restroom near Classroom 212	W4	Flaking, damaged plaster	N/A	N/A	see above	8/8/19	see above	see above	see above	see above	see above	see above	see above	see above	see above
189	1490	2	212C	Boy's Restroom near Classroom 212	Ceiling	Spalling, Flaking	N/A	N/A	see above	8/8/19	see above	see above	see above	see above	see above	see above	see above	see above	see above
190	1490	2	212A	Book Storage adjacent to Classroom 212	W2	Flaking, cracking, damaged plaster	N/A	N/A	Criterion	2/20/20	RRP scrape, spackle, and paint	SDP Painters	SDP Painters	Jonathan McKinnon	Yes	1 RRP Wipe, 1 Colorimetric	<5 µg/ft2	Jonathan McKinnon	2/20/20
191	1490	2	212A	Book Storage adjacent to Classroom 212	W3	Flaking, Cracking	N/A	N/A	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
192	1490	2	212A	Book Storage adjacent to Classroom 212	W3	N/A	Pipe	Flaking	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
193	1490	2	212A	Book Storage adjacent to Classroom 212	W4	Flaking, cracking, damaged plaster	N/A	N/A	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
194	1490	2	212A	Book Storage adjacent to Classroom 212	Ceiling	Flaking, cracking, damaged plaster	N/A	N/A	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
195	1490	2	211E	Book Storage across from Classroom 211	W1	None	N/A	N/A	Criterion	2/4/20	(Lead Safe RRP) scrape, spackle, and paint of damaged areas only	SDP Painters	N/A	Jonathan McKinnon	Yes	6 RRP Wipes	N/A	Jonathan McKinnon, Industrial Hygienist	2/5/20
196	1490	2	211E	Book Storage across from Classroom 211	W2	Damaged plaster	N/A	N/A	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
197	1490	2	211E	Book Storage across from Classroom 211	W3	Damaged plaster	N/A	N/A	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
198	1490	2	211E	Book Storage across from Classroom 211	W4	None	N/A	N/A	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
199	1490	2	211E	Book Storage across from Classroom 211	Ceiling	Damaged plaster	N/A	N/A	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
200	1490	2	211C	Girl's Restroom	Ceiling	Damaged plaster, cracking	N/A	N/A	Criterion	8/8/19	RRP scrape, spackle, and paint	WebCo	see above	Nicolette Ralieggh	Yes	5 RRP Wipes	N/A	Nicolette Raleigh	8/13/19
201	1490	2	H29B	Hallway Area between Classroom 211 and Girl's Restroom	W4	Cracking	N/A	N/A	Criterion	8/8/19	RRP scrape, spackle, and paint	WebCo	see above	Nicolette Ralieggh	Yes	3 RRP Wipes	N/A	Nicolette Raleigh	8/13/19
202	1490	2	210A	Corner Office 10A (Across from Custodial Closet)	W2	Flaking	N/A	N/A	Criterion	8/12/19	RRP scrape, spackle, and paint	WebCo	see above	Nicolette Ralieggh	Yes	7 RRP Wipes, 3 Colorimetric	< 10 µg/ft2	Nicolette Raleigh	8/12/19
203	1490	2	210A	Corner Office 10A (Across from Custodial Closet)	W4	Flaking	N/A	N/A	see above	8/12/19	see above	see above	see above	see above	see above	see above	see above	see above	see above
204	1490	2	210A	Corner Office 10A (Across from Custodial Closet)	Ceiling	Efflorescence, flaking	N/A	N/A	see above	8/12/19	see above	see above	see above	see above	see above	see above	see above	see above	see above
205	1490	2	210B	Corner Office 10A - Restroom	W1	Flaking	N/A	N/A	Criterion	8/12/19	RRP scrape, spackle, and paint	WebCo	see above	Nicolette Ralieggh	Yes	1 RRP Wipe, 2 Colorimetric	Initial: 220.15 µg/ft2 , Retest: 34.56 µg/ft2 , Retest: < 10 µg/ft2	1st 2nd Nicolette Raleigh	8/12/19

















Rudolph Blankenburg ES  
EPA Checklist

	ULCS#	F l o o r	Space # (on Floor Plan)	On Site Room Name	Primary Component	Description of Paint and Plaster Damage - Primary Component	Additional Component	Description of Paint and Plaster Damage - Additional Component	Name of Firm	Date of Renovation	Brief Description of Renovation	Name of Assigned Renovator	Name(s) of Trained Worker(s), if used	Name of Dust Sampling Technician, Inspector, or Risk Assessor, if used	Certified renovator performed post-renovation cleaning verification	Describe the results of post-renovation cleaning verification, including the number of wet and dry cloths used	If dust clearance testing was performed instead, attach a copy of the report	I certify under penalty of law that the previous information is true and complete (name and title)	Date signed
	1490	3	322C	Classroom 322 - Closet inside Main Closet (near rear of Classroom)	W2	None	N/A	N/A	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
	1490	3	322C	Classroom 322 - Closet inside Main Closet (near rear of Classroom)	W3	None	N/A	N/A	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
	1490	3	322C	Classroom 322 - Closet inside Main Closet (near rear of Classroom)	W4	None	N/A	N/A	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
	1490	3	322C	Classroom 322 - Closet inside Main Closet (near rear of Classroom)	Ceiling	None	N/A	N/A	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
	1490	3	324B	Classroom 324 Teacher Closet inside Main Closet	W1	Chipping	N/A	N/A	Criterion	1/13/20, 1/14/20	(Lead Safe RRP) scrape, spackle, and paint damaged areas only	SDP Painters	SDP Painters	Jonathan McKinnon	Yes	12 RRP Wipes	N/A	Jonathan McKinnon, Industrial Hygienist	1/14/20
	1490	3	324B	Classroom 324 Teacher Closet inside Main Closet	W2	Chipping	N/A	N/A	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
	1490	3	324B	Classroom 324 Teacher Closet inside Main Closet	W3	Crack in plaster	N/A	N/A	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
	1490	3	324B	Classroom 324 Teacher Closet inside Main Closet	W4	None	N/A	N/A	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
	1490	3	324B	Classroom 324 Teacher Closet inside Main Closet	Ceiling	Crack in plaster	N/A	N/A	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
	1490	3	320B	Classroom 320 Teacher Closet inside Main Closet	W1	None	N/A	N/A	Criterion	1/15/20	(Lead Safe RRP) scrape, spackle, and paint damaged areas only	SDP Painters	SDP Painters	Jonathan McKinnon	Yes	12 RRP Wipes	N/A	Jonathan McKinnon, Industrial Hygienist	1/15/20
	1490	3	320B	Classroom 320 Teacher Closet inside Main Closet	W2	Chipping	N/A	N/A	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
	1490	3	320B	Classroom 320 Teacher Closet inside Main Closet	W3	Flaking, Crack in plaster	N/A	N/A	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
	1490	3	320B	Classroom 320 Teacher Closet inside Main Closet	W4	None	N/A	N/A	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
	1490	3	320B	Classroom 320 Teacher Closet inside Main Closet	Ceiling	None	N/A	N/A	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
	1490	3	328B	Classroom 328 Closet	W1	Chipping	N/A	N/A	Criterion	1/15/20-1/17/20	(Lead Safe RRP) scrape, spackle, and paint damaged areas only	SDP Painters	SDP Painters	Jonathan McKinnon	Yes	11 RRP Wipes	N/A	Jonathan McKinnon, Industrial Hygienist	1/17/20
	1490	3	328B	Classroom 328 Closet	W2	Crack in plaster	N/A	N/A	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
	1490	3	328B	Classroom 328 Closet	W3	Flaking, Cracking	N/A	N/A	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
	1490	3	328B	Classroom 328 Closet	W4	Flaking	N/A	N/A	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
	1490	3	328B	Classroom 328 Closet	Ceiling	Flaking	N/A	N/A	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
	1490	B	H03A	Hallway Closet next to Classroom 30	W1	None	N/A	N/A	Criterion	2/20/20	(Lead Safe RRP) scrape, spackle, and paint damaged areas only	SDP Painters	SDP Painters	Jonathan McKinnon	Yes	11 RRP Wipes	N/A	Jonathan McKinnon, Industrial Hygienist	2/20/20
	1490	B	H03A	Hallway Closet next to Classroom 30	W2	None	N/A	N/A	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
	1490	B	H03A	Hallway Closet next to Classroom 30	W3	None	N/A	N/A	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
	1490	B	H03A	Hallway Closet next to Classroom 30	W4	None	N/A	N/A	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
	1490	B	H03A	Hallway Closet next to Classroom 30	Ceiling	N/A	Ductwork	Cracking, Flaking	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
	1490	B	028D	Classroom 29 - Rear Closet	W1	Flaking	N/A	N/A	Criterion not on site for rennovation	Criterion not on site for rennovation	Criterion not on site for rennovation	Criterion not on site for rennovation	Criterion not on site for rennovation	Criterion not on site for rennovation	Criterion not on site for rennovation	Criterion not on site for rennovation	< 5 µg/ft2	Jonathan McKinnon, Industrial Hygienist	10/7/20
	1490	B	028D	Classroom 29 - Rear Closet	W2	Cracking	N/A	N/A	Criterion not on site for rennovation	Criterion not on site for rennovation	Criterion not on site for rennovation	Criterion not on site for rennovation	Criterion not on site for rennovation	Criterion not on site for rennovation	Criterion not on site for rennovation	Criterion not on site for rennovation	see above	Jonathan McKinnon, Industrial Hygienist	10/7/20
	1490	B	028D	Classroom 29 - Rear Closet	W3	Efflorescence, Flaking, Cracking	N/A	N/A	Criterion not on site for rennovation	Criterion not on site for rennovation	Criterion not on site for rennovation	Criterion not on site for rennovation	Criterion not on site for rennovation	Criterion not on site for rennovation	Criterion not on site for rennovation	Criterion not on site for rennovation	see above	Jonathan McKinnon, Industrial Hygienist	10/7/20
	1490	B	028D	Classroom 29 - Rear Closet	W4	Cracking, hole in plaster	N/A	N/A	Criterion not on site for rennovation	Criterion not on site for rennovation	Criterion not on site for rennovation	Criterion not on site for rennovation	Criterion not on site for rennovation	Criterion not on site for rennovation	Criterion not on site for rennovation	Criterion not on site for rennovation	see above	Jonathan McKinnon, Industrial Hygienist	10/7/20
	1490	B	028D	Classroom 29 - Rear Closet	Ceiling	Cracking	N/A	N/A	Criterion not on site for rennovation	Criterion not on site for rennovation	Criterion not on site for rennovation	Criterion not on site for rennovation	Criterion not on site for rennovation	Criterion not on site for rennovation	Criterion not on site for rennovation	Criterion not on site for rennovation	see above	Jonathan McKinnon, Industrial Hygienist	10/7/20
	1490	B	028E	Classroom 29 - Front Closet	W1	Cracking	N/A	N/A	Criterion not on site for rennovation	Criterion not on site for rennovation	Criterion not on site for rennovation	Criterion not on site for rennovation	Criterion not on site for rennovation	Criterion not on site for rennovation	Criterion not on site for rennovation	Criterion not on site for rennovation	7.25 µg/ft2	Jonathan McKinnon, Industrial Hygienist	10/7/20
	1490	B	028E	Classroom 29 - Front Closet	W2	Cracking, Flaking	N/A	N/A	Criterion not on site for rennovation	Criterion not on site for rennovation	Criterion not on site for rennovation	Criterion not on site for rennovation	Criterion not on site for rennovation	Criterion not on site for rennovation	Criterion not on site for rennovation	Criterion not on site for rennovation	see above	Jonathan McKinnon, Industrial Hygienist	10/7/20
	1490	B	028E	Classroom 29 - Front Closet	W3	Cracking	N/A	N/A	Criterion not on site for rennovation	Criterion not on site for rennovation	Criterion not on site for rennovation	Criterion not on site for rennovation	Criterion not on site for rennovation	Criterion not on site for rennovation	Criterion not on site for rennovation	Criterion not on site for rennovation	see above	Jonathan McKinnon, Industrial Hygienist	10/7/20
	1490	B	028E	Classroom 29 - Front Closet	W4	Cracking	N/A	N/A	Criterion not on site for rennovation	Criterion not on site for rennovation	Criterion not on site for rennovation	Criterion not on site for rennovation	Criterion not on site for rennovation	Criterion not on site for rennovation	Criterion not on site for rennovation	Criterion not on site for rennovation	see above	Jonathan McKinnon, Industrial Hygienist	10/7/20
	1490	B	028E	Classroom 29 - Front Closet	Ceiling	None	N/A	N/A	Criterion not on site for rennovation	Criterion not on site for rennovation	Criterion not on site for rennovation	Criterion not on site for rennovation	Criterion not on site for rennovation	Criterion not on site for rennovation	Criterion not on site for rennovation	Criterion not on site for rennovation	see above	Jonathan McKinnon, Industrial Hygienist	10/7/20
	1490	B	11B	Classroom 27	Ceiling	Cracking, Flaking, Spalling	N/A	N/A	Criterion not on site for rennovation	Criterion not on site for rennovation	Criterion not on site for rennovation	Criterion not on site for rennovation	Criterion not on site for rennovation	Criterion not on site for rennovation	Criterion not on site for rennovation	Criterion not on site for rennovation	< 5 µg/ft2	Jonathan McKinnon, Industrial Hygienist	10/7/20
	1490	B	11C	Office in Classroom 27	W2	N/A	Soffit	Efflorescence	Criterion not on site for rennovation	Criterion not on site for rennovation	Criterion not on site for rennovation	Criterion not on site for rennovation	Criterion not on site for rennovation	Criterion not on site for rennovation	Criterion not on site for rennovation	Criterion not on site for rennovation	19.07 µg/ft2, 13.41 µg/ft2, < 5 µg/ft2, < 5 µg/ft2	Jonathan McKinnon, Industrial Hygienist	10/7/20
	1490	B	028A	Kitchen	W1	Cracking	N/A	N/A	Criterion	2/7	(Lead Safe RRP) scrape, spackle, and paint of damaged areas	SDP Painters	SDP Painters	Max Curran	Yes	20 RRP Wipes, 1 Colorimetric Pass	Intial: 15.31 µg/ft2 , Retest: < 5 µg/ft2	Max Curran	2/7/20
	1490	B	028A	Kitchen	W4	Flaking, crack in plaster	N/A	N/A	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
	1490	B	001B	Girl's Restroom	Ceiling	Cracking	N/A	N/A	Criterion	12/18	(Lead Safe RRP) scrape, spackle, and paint of damaged areas	SDP Painters	SDP Painters	Jonathan McKinnon	Yes	20 RRP Wipes, 3 colorimtric Pass, 1 FAAS Pass	<10 µg/ft2	Jonathan McKinnon, Industrial Hygienist	12/19/19
	1490	B	002B	IMC (Library) Office	W2	Spalling - below the window	N/A	N/A	Criterion	1/29	(Lead Safe RRP) scrape, spackle, and paint of damaged areas	SDP Painters	SDP Painters	Jonathan McKinnon	Yes	9 RRP Wipes	N/A	Jonathan McKinnon, Industrial Hygienist	1/29/20

Rudolph Blankenburg ES  
EPA Checklist

	ULCS#	F l o o r	Space # (on Floor Plan)	On Site Room Name	Primary Component	Description of Paint and Plaster Damage - Primary Component	Additional Component	Description of Paint and Plaster Damage - Additional Component	Name of Firm	Date of Renovation	Brief Description of Renovation	Name of Assigned Renovator	Name(s) of Trained Worker(s), if used	Name of Dust Sampling Technician, Inspector, or Risk Assessor, if used	Certified renovator performed post-renovation cleaning verification	Describe the results of post-renovation cleaning verification, including the number of wet and dry cloths used	If dust clearance testing was performed instead, attach a copy of the report	I certify under penalty of law that the previous information is true and complete (name and title)	Date signed
	1490	B	003B	IMC (Library) Storage	W4	Cracking, Flaking	N/A	N/A	Criterion	2/18	Non-RRP (< 6 SF)	SDP Painters	SDP Painters	Jonathan McKinnon	Non-RRP (< 6 SF)	Non-RRP (< 6 SF)	Non-RRP (< 6 SF)	Jonathan McKinnon, Industrial Hygienist	2/18/20
	1490	B	030	Classroom 30	W3	Cracking	N/A	N/A	Criterion	1/28	(Lead Safe RRP) scrape, spackle, and paint of damaged areas	SDP Painters	SDP Painters	Jonathan McKinnon	Yes	10 RRP Wipes	< 5 µg/ft2	Jonathan McKinnon, Industrial Hygienist	1/29/20
	1490	B	H03	Hallway from Girl's Restroom to Classroom 30	Ceiling	N/A	Ductwork	Flaking, Cracking	Criterion	2/8/29-2/9/20	(Lead Safe RRP) scrape, spackle, and paint damaged areas only	SDP Painters	SDP Painters	Max Curran	Yes	20 RRP Wipes	N/A	Max Curran	
	1490	B	H03	Hallway from Girl's Restroom to Classroom 30	Ceiling	Flaking	N/A	N/A	Criterion	2/8/29-2/9/20	(Lead Safe RRP) scrape, spackle, and paint damaged areas only	SDP Painters	SDP Painters	Max Curran	Yes	20 RRP Wipes	N/A	Max Curran	
	1490	B	010B	Boy's Restroom	W1	Cracking	N/A	N/A	Criterion	1/27/20, 1/28/20, 1/29/20	(Lead Safe RRP) scrape, spackle, and paint damaged areas only	SDP Painters	SDP Painters	Jonathan McKinnon	Yes	20 RRP Wipes	Initial: 131.85 µg/ft2 / Retest: 11.11 µg/ft2 / Retest: 7.47 µg/ft2	Jonathan McKinnon, Industrial Hygienist	1/31/20
	1490	B	010B	Boy's Restroom	W2	Cracking	N/A	N/A	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
	1490	B	010B	Boy's Restroom	W3	Cracking	N/A	N/A	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
	1490	B	010B	Boy's Restroom	Ceiling	Flaking, Cracking	N/A	N/A	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
	1490	B	H01	Hallway from Boy's Restroom to Classroom 29	W2	N/A	Pipe jacket	Flaking	Criterion	1/27/20	(Lead Safe RRP) scrape, spackle, and paint damaged areas only	SDP Painters	SDP Painters	Jonathan McKinnon	Yes	20 RRP Wipes	N/A	Jonathan McKinnon, Industrial Hygienist	1/27/20
	1490	B	H02	Hallway along Gymnasium	Ceiling	Flaking	N/A	N/A	Criterion	2/8/29-2/9/20	(Lead Safe RRP) scrape, spackle, and paint damaged areas only	SDP Painters	SDP Painters	Max Curran	Yes	20 RRP Wipes	N/A	Max Curran	
	1490	B	12B	Gymnasium	Ceiling	Flaking	N/A	N/A	Criterion	2/8/20	(Lead Safe RRP) scrape, spackle, and paint damaged areas only	SDP Painters	SDP Painters	Max Curran	Non-RRP	Non-RRP	Non-RRP	Max Curran	
	1490	B	13B	Gymnasium Office	W2	N/A	Pipe	Cracking	Criterion	2/9/20	(Lead Safe RRP) scrape, spackle, and paint damaged areas only	SDP Painters	SDP Painters	Max Curran	Yes	12 RRP Wipes	N/A	Max Curran	
	1490	1	107A	Men's Restroom next to Classroom 107	W2	Damaged plaster at either columns	N/A	N/A	Work completed prior to Criterion Oversight	Work completed prior to Criterion Oversight	Work completed prior to Criterion Oversight	Work completed prior to Criterion Oversight	Work completed prior to Criterion Oversight	Work completed prior to Criterion Oversight	Work completed prior to Criterion Oversight	Work completed prior to Criterion Oversight	Work completed prior to Criterion Oversight	Work completed prior to Criterion Oversight	Work completed prior to Criterion Oversight
	1490	1	107	Classroom 107	W3	Efflorescence/Flaking	N/A	N/A	Criterion	2/28/20	(Lead Safe RRP) scrape, spackle, and paint damaged areas only	SDP Painters	SDP Painters	Jonathan McKinnon	Yes	3 RRP Wipes	N/A	Jonathan McKinnon, Industrial Hygienist	2/28/20
	1490	1	106	Classroom 106	W3	Chipping/Cracking	N/A	N/A	Criterion	2/6/20	(Lead Safe RRP) scrape, spackle, and paint damaged areas only	SDP Painters	SDP Painters	Jonathan McKinnon	Yes	6 RRP Wipes	N/A	Jonathan McKinnon, Industrial Hygienist	2/6/20
	1490	1	105	Classroom 105	W3	Cracking	N/A	N/A	Criterion	2/28/20	(Lead Safe RRP) scrape, spackle, and paint damaged areas only	SDP Painters	SDP Painters	Jonathan McKinnon	Yes	6 RRP Wipes	N/A	Jonathan McKinnon, Industrial Hygienist	2/28/20
	1490	1	105A	Classroom 105 Closet	W1	Partially Inaccessible/Chipping	N/A	N/A	Criterion	1/30/2020, 1/31/2020	(Lead Safe RRP) scrape, spackle, and paint of damaged areas	SDP Painters	SDP Painters	Jonathan McKinnon	Yes	9 RRP Wipes	N/A	Jonathan McKinnon, Industrial Hygienist	1/31/20
	1490	1	105A	Classroom 105 Closet	W2	Partially Inaccessible/Chipping	N/A	N/A	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
	1490	1	105A	Classroom 105 Closet	W3	Partially Inaccessible/Chipping	N/A	N/A	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
	1490	1	105A	Classroom 105 Closet	W4	Partially Inaccessible/Chipping	N/A	N/A	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
	1490	1	105A	Classroom 105 Closet	Ceiling	Chipping	N/A	N/A	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
	1490	1	105B	Stationery Closet adjacent to Classroom 105	W2	Cracking	N/A	N/A	Criterion	2/11/20	(Lead Safe RRP) scrape, spackle, and paint of damaged areas	SDP Painters	SDP Painters	Jonathan McKinnon	Yes	6 RRP Wipes	N/A	Jonathan McKinnon, Industrial Hygienist	2/11/20
	1490	1	105B	Stationery Closet adjacent to Classroom 105	W3	Friction	N/A	N/A	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
	1490	1	105B	Stationery Closet adjacent to Classroom 105	W4	Flaking	N/A	N/A	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
	1490	1	105B	Stationery Closet adjacent to Classroom 105	Ceiling	Flaking	N/A	N/A	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
	1490	1	H14	Hallway from Classroom 105 to 107	Ceiling	Cracking, Flaking	N/A	N/A	Criterion	1/8	(Lead Safe RRP) scrape, spackle, and paint of damaged areas	SDP Painters	SDP Painters	Jonathan McKinnon	Yes	25 RRP Wipes	N/A	Jonathan McKinnon, Industrial Hygienist	2/21/20
	1490	1	H14	Hallway from Classroom 105 to 107	W3	Spalling, Damaged plaster	N/A	N/A	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
	1490	1	104C	Boy's Restroom near Classroom K4	Ceiling	Flaking	N/A	N/A	Criterion	1/9	(Lead Safe RRP) scrape, spackle, and paint of damaged areas	SDP Painters	SDP Painters	Jonathan McKinnon	Yes	Initial: 12 RRP Wipes, 1 Colorimetric Pass / 2nd Reclean: 12 RRP Wipes, 1 Colorimetric Pass / Reclean: 12 RRP Wipes, 1 Colorimetric Pass / 3rd Reclean: 12 RRP Wipes, 1 Colorimetric Pass / 4th Reclean: 12 RRP Wipes, 1 Colorimetric Pass	Initial: 195.16 µg/ft2 / Retest: 27.04 µg/ft2 / Retest: 34.42 µg/ft2 / Retest: Retest: 39.99 µg/ft / Retest : < 5 µg/ft	Jonathan McKinnon, Industrial Hygienist	1/29/20
	1490	1	104	Classroom K4	Ceiling	Cracking	N/A	N/A	Non-RRP	Non-RRP	Non-RRP	Non-RRP	Non-RRP	Non-RRP	Non-RRP	Non-RRP	Non-RRP	Non-RRP	Non-RRP
	1490	1	104	Classroom K4	W3	Chipping	N/A	N/A	Criterion	2/28/20	(Lead Safe RRP) scrape, spackle, and paint of damaged areas only	SDP Painters	N/A	Jonathan McKinnon	Yes	8 RRP Wipes	< 5 µg/ft2	Jonathan McKinnon, Industrial Hygienist	3/3/20

Rudolph Blankenburg ES  
EPA Checklist

	ULCS#	F l o o r	Space # (on Floor Plan)	On Site Room Name	Primary Component	Description of Paint and Plaster Damage - Primary Component	Additional Component	Description of Paint and Plaster Damage - Additional Component	Name of Firm	Date of Renovation	Brief Description of Renovation	Name of Assigned Renovator	Name(s) of Trained Worker(s), if used	Name of Dust Sampling Technician, Inspector, or Risk Assessor, if used	Certified renovator performed post-renovation cleaning verification	Describe the results of post-renovation cleaning verification, including the number of wet and dry cloths used	If dust clearance testing was performed instead, attach a copy of the report	I certify under penalty of law that the previous information is true and complete (name and title)	Date signed
	1490	1	H15	Hallway from Stairwell near Classroom K1 to Stairwell near Classroom K4	W4	Efflorescence, Flaking, Damaged plaster	N/A	N/A	Criterion	1/6/20, 1/7/20, 1/8/20, 1/9/20, 1/10/20, 1/17/20, 1/21/20, 2/7/20, 2/21/20	(Lead Safe RRP) scrape, spackle, and paint of damaged areas only	SDP Painters	N/A	Jonathan McKinnon	Yes	20 RRP Wipes	N/A	Jonathan McKinnon, Industrial Hygienist	2/21/20
	1490	1	103D	Auditorium	Ceiling	Flaking, Cracking	N/A	N/A	Criterion	3/3/20	(Lead Safe RRP) scrape, spackle, and paint of damaged areas only	SDP Painters	N/A	Jonathan McKinnon	Yes	14 RRP Wipes, 2 Colorimetric Pass	9.5 µg/ft2	Jonathan McKinnon, Industrial Hygienist	3/4/20
	1490	1	H16	Hallway along Classrooms 101 to 103 (to Custodial Closet)	Ceiling	Cracking	N/A	N/A	Criterion	1/6/20, 1/7/20, 1/8/20, 1/9/20, 1/10/20, 1/17/20, 1/21/20, 2/7/20, 2/21/20	(Lead Safe RRP) scrape, spackle, and paint of damaged areas only	SDP Painters	N/A	Jonathan McKinnon	Yes	25 RRP Wipes	N/A	Jonathan McKinnon, Industrial Hygienist	2/21/20
	1490	1	H16	Hallway along Classrooms 101 to 103 (to Custodial Closet)	W3	Chipping (1 SF), Flaking	N/A	N/A	Criterion	1/6/20, 1/7/20, 1/8/20, 1/9/20, 1/10/20, 1/17/20, 1/21/20, 2/7/20, 2/21/20	(Lead Safe RRP) scrape, spackle, and paint of damaged areas only	SDP Painters	N/A	Jonathan McKinnon	Yes	25 RRP Wipes	N/A	Jonathan McKinnon, Industrial Hygienist	2/21/20
	1490	1	101C	Classroom 101 Restroom	W4	Damaged plaster at window	N/A	N/A	Criterion	1/23/20, 1/24/20	(Lead Safe RRP) scrape, spackle, and paint of damaged areas only	SDP Painters	SDP Painters	Jonathan McKinnon	Yes	6 RRP Wipes, 1 Colorimetric Pass (3x)	Inatial: 34.17 µg/ft2 / Retest: 234.78 µg/ft2/ Retest: < 5 µg/ft2	Jonathan McKinnon, Industrial Hygienist	1/29/20
	1490	1	101B	Classroom 101 Closet	W1	None	N/A	N/A	Criterion	2/20/20-2/21/20	(Lead Safe RRP) scrape, spackle, and paint of damaged areas only	SDP Painters	N/A	Jonathan McKinnon	Yes	6 RRP Wipes, 1 Colorimetric Pass	< 5 µg/ft2	Jonathan McKinnon, Industrial Hygienist	2/24/20
	1490	1	101B	Classroom 101 Closet	W2	Efflorescence, Flaking	N/A	N/A	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
	1490	1	101B	Classroom 101 Closet	W3	None	N/A	N/A	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
	1490	1	101B	Classroom 101 Closet	Ceiling	None	N/A	N/A	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
	1490	1	101	Classroom 101	W3	Flaking	N/A	N/A	Criterion	1/23/20, 1/24/20	(Lead Safe RRP) scrape, spackle, and paint of damaged areas only	SDP Painters	SDP Painters	Jonathan McKinnon	Yes	5 RRP Wipes, 1 colorimetic Pass	< 5 µg/ft	Jonathan McKinnon, Industrial Hygienist	1/24/20
	1490	1	101A	Women's Restroom next to Classroom 101	Ceiling	Cracking paint at window	N/A	N/A	Completed Prior to Oversight	Completed Prior to Oversight	Completed Prior to Oversight	Completed Prior to Oversight	Completed Prior to Oversight	Completed Prior to Oversight	Completed Prior to Oversight	Completed Prior to Oversight	Completed Prior to Oversight	Completed Prior to Oversight	Completed Prior to Oversight
	1490	1	102	Classroom 102	W4	Cracking paint at entrance	N/A	N/A	Criterion	1/23/20	(Lead Safe RRP) scrape, spackle, and paint of damaged areas only	SDP Painters	SDP Painters	Jonathan McKinnon	Yes	5 RRP Wipes, 1 colorimetic Pass	< 5 µg/ft	Jonathan McKinnon, Industrial Hygienist	1/24/20
	1490	1	101K	Classroom K1	W3	Flaking	N/A	N/A	Criterion	2/12/20	(Lead Safe RRP) scrape, spackle, and paint of damaged areas only	SDP Painters	SDP Painters	Jonathan McKinnon	Yes	5 RRP Wipes, 1 colorimetic Pass	< 5 µg/ft	Jonathan McKinnon, Industrial Hygienist	2/13/20
	1490	1	103	Classroom 103	W3	Flaking	N/A	N/A	Criterion	2/27/20	(Lead Safe RRP) scrape, spackle, and paint of damaged areas only	SDP Painters	SDP Painters	Jonathan McKinnon	Yes	6 RRP Wipes, 1 colorimetic Pass	< 5 µg/ft2	Jonathan McKinnon, Industrial Hygienist	3/3/20
	1490	1	103FB	Storage Closet (with Gate) across from Classroom K1	W2	Cracking	N/A	N/A	Criterion	1/27/20	(Lead Safe RRP) scrape, spackle, and paint of damaged areas only	SDP Painters	N/A	Jonathan McKinnon	Yes	3 RRP Wipes	N/A	Jonathan McKinnon, Industrial Hygienist	1/28/20
	1490	1	103FB	Storage Closet (with Gate) across from Classroom K1	W3	Chipping	N/A	N/A	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
	1490	1	103FB	Storage Closet (with Gate) across from Classroom K1	W4	Chipping	N/A	N/A	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
	1490	1	103FB	Storage Closet (with Gate) across from Classroom K1	Ceiling	Chipping	N/A	N/A	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
	1490	1	103FC	Storage Closet (Band Instruments) across from Girl's Restroom	W2	Chipping	N/A	N/A	Criterion	1/27/20	(Lead Safe RRP) scrape, spackle, and paint of damaged areas only	SDP Painters	N/A	Jonathan McKinnon	Yes	3 RRP Wipes	N/A	Jonathan McKinnon, Industrial Hygienist	1/28/20
	1490	1	103FC	Storage Closet (Band Instruments) across from Girl's Restroom	W3	Chipping	N/A	N/A	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
	1490	1	103FC	Storage Closet (Band Instruments) across from Girl's Restroom	W4	Chipping	N/A	N/A	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
	1490	1	103FC	Storage Closet (Band Instruments) across from Girl's Restroom	Ceiling	Chipping	N/A	N/A	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
	1490	1	S18	Stairwell G (near Girl's Restroom)	W3	Flaking	N/A	N/A	Criterion	2/7/20	(Lead Safe RRP) scrape, spackle, and paint of damaged areas only	SDP Painters	N/A	Jonathan McKinnon	Yes	3 RRP Wipes	N/A	Jonathan McKinnon, Industrial Hygienist	2/7/20
	1490	1	S11	Stairwell adjacent to Classroom 101	W3	Flaking	N/A	N/A	Criterion	2/7/20	(Lead Safe RRP) scrape, spackle, and paint of damaged areas only	SDP Painters	N/A	Jonathan McKinnon	Yes	3 RRP Wipes	N/A	Jonathan McKinnon, Industrial Hygienist	2/7/20
	1490	2	209	Classroom 209	W3	Flaking	N/A	N/A	Criterion	2/19/20	(Lead Safe RRP) scrape, spackle, and paint of damaged areas only	SDP Painters	N/A	Jonathan McKinnon	Yes	5 RRP Wipes	N/A	Jonathan McKinnon, Industrial Hygienist	2/19/20
	1490	2	212A	Book Storage adjacent to Classroom 212	W4	Flaking, cracking, damaged plaster	N/A	N/A	Criterion	2/20/20	(Lead Safe RRP) scrape, spackle, and paint of damaged areas only	SDP Painters	N/A	Jonathan McKinnon	Yes	3 RRP Wipes, 1 colorimetric pass	< 5 µg/ft2	Jonathan McKinnon, Industrial Hygienist	2/24/20

Rudolph Blankenburg ES  
EPA Checklist

	ULCS#	F l o o r	Space # (on Floor Plan)	On Site Room Name	Primary Component	Description of Paint and Plaster Damage - Primary Component	Additional Component	Description of Paint and Plaster Damage - Additional Component	Name of Firm	Date of Renovation	Brief Description of Renovation	Name of Assigned Renovator	Name(s) of Trained Worker(s), if used	Name of Dust Sampling Technician, Inspector, or Risk Assessor, if used	Certified renovator performed post-renovation cleaning verification	Describe the results of post-renovation cleaning verification, including the number of wet and dry cloths used	If dust clearance testing was performed instead, attach a copy of the report	I certify under penalty of law that the previous information is true and complete (name and title)	Date signed
	1490	2	212C	Boy's Restroom near Classroom 212	W1	Efflorescence, Flaking	N/A	N/A	Criterion	12/19/2019	(Lead Safe RRP) scrape, spackle, and paint damaged areas only	SDP Painters	SDP Painters	Jonathan McKinnon	Yes	5 RRP Wipes, 1 Colorimetric Pass	12.32 µg/ft2	Jonathan McKinnon, Industrial Hygienist	12/20/19
	1490	2	212C	Boy's Restroom near Classroom 212	W2	Flaking, cracking	N/A	N/A	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
	1490	2	212C	Boy's Restroom near Classroom 212	W3	Flaking, cracking	N/A	N/A	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
	1490	2	212C	Boy's Restroom near Classroom 212	W4	Flaking, damaged plaster	N/A	N/A	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
	1490	2	212C	Boy's Restroom near Classroom 212	Ceiling	Spalling, Flaking	N/A	N/A	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
	1490	2	213	Classroom 213	Ceiling	Moisture Damage	N/A	N/A	Criterion	1/23/20	(Lead Safe RRP) scrape, spackle, and paint damaged areas only	SDP Painters	SDP Painters	Jonathan McKinnon	Yes	5 RRP Wipes	N/A	Jonathan McKinnon, Industrial Hygienist	1/23/20
	1490	2	214	Classroom 214	W3	Chipping	N/A	N/A	Criterion	1/23/20	(Lead Safe RRP) scrape, spackle, and paint damaged areas only	SDP Painters	SDP Painters	Jonathan McKinnon	Yes	5 RRP Wipes	N/A	Jonathan McKinnon, Industrial Hygienist	1/23/20
	1490	2	215A	Counselor's Office 15 (next to Classroom 215)	W2	Flaking	N/A	N/A	Criterion	1/23/20, 1/24/20	(Lead Safe RRP) scrape, spackle, and paint damaged areas only	SDP Painters	SDP Painters	Jonathan McKinnon	Yes	11 RRP Wipes	N/A	Jonathan McKinnon, Industrial Hygienist	1/28/20
	1490	2	H27	Hallway from Classrooms 213 to 215	W3	Efflorescence, flaking	N/A	N/A	Criterion	12/17/19, 12/18/19, 2/7/20	(Lead Safe RRP) scrape, spackle, and paint damaged areas only	SDP Painters	SDP Painters	Jonathan McKinnon	Yes	20 RRP Wipes	N/A	Jonathan McKinnon, Industrial Hygienist	2/27/20
	1490	2	H28	Hallway adjacent to Upper Part of Auditorium (from Staiwell M to Stairwell G)	W4	Efflorescence, flaking	N/A	N/A	Criterion	12/17/19, 12/18/19, 2/7/20	(Lead Safe RRP) scrape, spackle, and paint damaged areas only	SDP Painters	SDP Painters	Jonathan McKinnon	Yes	26 RRP Wipes	N/A	Jonathan McKinnon, Industrial Hygienist	2/27/20
	1490	3	325B	Boy's Restroom (near Classroom 325)	W1	Flaking, damaged plaster	N/A	N/A	Criterion		spackle and paint holes around duct penetration	SDP Painters	SDP Painters	Jonathan McKinnon	Non-RRP (Strictly Filling Duct Penetration with Spackle and painting)	Non-RRP (Strictly Filling Duct Penetration with Spackle and painting)	Non-RRP (Strictly Filling Duct Penetration with Spackle and painting)	Jonathan McKinnon, Industrial Hygienist	
	1490	3	H315A	Fire Tower Hallway adjacent Hallway from Classrooms 316 to 319	Ceiling	Flaking	N/A	N/A	Criterion	12/17/19, 12/18/19, 12/19/19	(Lead Safe RRP) scrape, spackle, and paint damaged areas only	SDP Painters	SDP Painters	Jonathan McKinnon	Yes	22 Wipes	N/A	Jonathan McKinnon, Industrial Hygienist	12/19/19
	1490	3	H316	Hallway from Classrooms 320 to 325	W4	Holes	N/A	N/A	Criterion	12/17/19, 12/18/19, 12/19/19	(Lead Safe RRP) scrape, spackle, and paint damaged areas only	SDP Painters	SDP Painters	Jonathan McKinnon	Yes	2 RRP Wipes	N/A	Jonathan McKinnon, Industrial Hygienist	12/19/19
	1490	3	H314	Hallway from Classrooms 325 to 328	W3	Efflorescence, Spalling	N/A	N/A	Criterion	12/17/19, 12/18/19, 12/19/19	(Lead Safe RRP) scrape, spackle, and paint damaged areas only	SDP Painters	SDP Painters	Jonathan McKinnon	Yes	30 RRP Wipes	N/A	Jonathan McKinnon, Industrial Hygienist	12/19/19
	1490	3	316	Science Laboratory 316	W3	Efflorescence, flaking	N/A	N/A	Criterion	1/16/20	(Lead Safe RRP) scrape, spackle, and paint damaged areas only	SDP Painters	SDP Painters	Jonathan McKinnon	Yes	15 RRP Wipes	N/A	Jonathan McKinnon, Industrial Hygienist	1/16/20
	1490	3	316	Science Laboratory 316	Ceiling	Flaking, Cracking	N/A	N/A	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
	1490	3	317	Classroom 317	W3	Efflorescence, flaking	N/A	N/A	Criterion	1/14/20	(Lead Safe RRP) scrape, spackle, and paint damaged areas only	SDP Painters	SDP Painters	Jonathan McKinnon	Yes	8 RRP Wipes	N/A	Jonathan McKinnon, Industrial Hygienist	1/14/20
	1490	3	318	Classroom 318	Ceiling	Moisture Damage	N/A	N/A	Criterion		(Lead Safe RRP) scrape, spackle, and paint damaged areas only	SDP Painters	SDP Painters	Jonathan McKinnon	Yes	Completed Prior to Oversight	N/A	Jonathan McKinnon, Industrial Hygienist	Completed Prior to Oversight
	1490	3	319	Classroom 319	W3	Moisture Damage	N/A	N/A	Criterion	1/16/20, 1/17/20, 1/21/20	(Lead Safe RRP) scrape, spackle, and paint damaged areas only	SDP Painters	SDP Painters	Jonathan McKinnon	Yes	5 RRP Wipes	N/A	Jonathan McKinnon, Industrial Hygienist	1/21/20
	1490	3	322	Classroom 322	W3	Efflorescence, Flaking, crack in plaster	N/A	N/A	Criterion	1/13/20, 1/14/20	(Lead Safe RRP) scrape, spackle, and paint damaged areas only	SDP Painters	SDP Painters	Jonathan McKinnon	Yes	15 RRP Wipes	N/A	Jonathan McKinnon, Industrial Hygienist	1/15/20
	1490	3	322	Classroom 322	W4	Efflorescence, Flaking, crack in plaster	N/A	N/A	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
	1490	3	322	Classroom 322	Ceiling	Flaking	N/A	N/A	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
	1490	3	324	Classroom 324	W3	Cracking, Flaking, damaged plaster	N/A	N/A	Criterion	1/13/20, 1/14/20	(Lead Safe RRP) scrape, spackle, and paint damaged areas only	SDP Painters	SDP Painters	Jonathan McKinnon	Yes	11 RRP Wipes	N/A	Jonathan McKinnon, Industrial Hygienist	1/15/20
	1490	3	324	Classroom 324	W4	Crack in plaster	N/A	N/A	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
	1490	3	321	Classroom 321	W2	Cracking	N/A	N/A	Work Done Prior to Criterion Oversight	Work Done Prior to Criterion Oversight	Work Done Prior to Criterion Oversight	Work Done Prior to Criterion Oversight	Work Done Prior to Criterion Oversight	Work Done Prior to Criterion Oversight	Work Done Prior to Criterion Oversight	Work Done Prior to Criterion Oversight	Work Done Prior to Criterion Oversight	Work Done Prior to Criterion Oversight	Work Done Prior to Criterion Oversight
	1490	3	321	Classroom 321	W3	Efflorescence, flaking, crack in plaster	N/A	N/A	Work Done Prior to Criterion Oversight	Work Done Prior to Criterion Oversight	Work Done Prior to Criterion Oversight	Work Done Prior to Criterion Oversight	Work Done Prior to Criterion Oversight	Work Done Prior to Criterion Oversight	Work Done Prior to Criterion Oversight	Work Done Prior to Criterion Oversight	Work Done Prior to Criterion Oversight	Work Done Prior to Criterion Oversight	Work Done Prior to Criterion Oversight
	1490	3	321	Classroom 321	Ceiling	Efflorescence, Flaking	N/A	N/A	Work Done Prior to Criterion Oversight	Work Done Prior to Criterion Oversight	Work Done Prior to Criterion Oversight	Work Done Prior to Criterion Oversight	Work Done Prior to Criterion Oversight	Work Done Prior to Criterion Oversight	Work Done Prior to Criterion Oversight	Work Done Prior to Criterion Oversight	Work Done Prior to Criterion Oversight	Work Done Prior to Criterion Oversight	Work Done Prior to Criterion Oversight
	1490	3	320	Classroom 320	W3	Flaking, moisture damage	N/A	N/A	Criterion	1/15/20	(Lead Safe RRP) scrape, spackle, and paint damaged areas only	SDP Painters	SDP Painters	Jonathan McKinnon	Yes	10 RRP Wipes	N/A	Jonathan McKinnon, Industrial Hygienist	1/15/20



Rudolph Blankenburg ES  
EPA Checklist

[illegible]

## ***Appendix C. Oversight Table***

Rudolph Blankenburg ES  
Oversight

H	ULCS#	Floor	Space # (on Floor Plan)	On Site Room Name	Primary Component	Substrate Material	Pre-Cleaning Completed (date)	Contents Moved (date)	Work Area Prepped (date)	Surfaces Stabilized (date)	Contents Back in Place (date)	Final Inspection Approval and Photos (date)	Square Footage of Work Area	Number of Required RRP Wipes	Number of Colorimetric Wipes Used to Pass	Final Colorimetric Wipe Submitted for AAS Analysis (yes/no)	AAS Analysis Results	Comments from Oversight
1	1490	1	103D	Auditorium	W3	Plaster	Prior	n/a	8/7/19	8/12/19	n/a	8/12/19	2720	73	8	yes	Initial: 63.22 µg/ft2 & 30.31 µg/ft2 (Stage), Retest: < 10 µg/ft2 &	
2	1490	1	103D	Auditorium	W3	N/A	Prior	n/a	8/7/19	8/12/19	n/a	8/12/19	See Above	See Above	See Above	yes	see above	
3	1490	1	103D	Auditorium	Ceiling	Plaster	Prior	n/a	8/7/19	8/12/19	n/a	8/12/19	See Above	See Above	See Above	yes	see above	
4	1490	1	101K	Classroom K1	W1	Plaster	Prior	Prior	8/7/19	8/13/19	n/a	8/15/19	672	19	3	yes	< 10 µg/ft2	
5	1490	1	101K	Classroom K1	W3	Plaster	Prior	Prior	8/7/19	8/13/19	n/a	8/15/19	See Above	See Above	See Above	yes	see above	
6	1490	1	101K	Classroom K1	W3	N/A	Prior	Prior	8/7/19	8/13/19	n/a	8/15/19	See Above	See Above	See Above	yes	see above	
7	1490	1	101K	Classroom K1	W4	Plaster	Prior	Prior	8/7/19	8/13/19	n/a	8/15/19	See Above	See Above	See Above	yes	see above	
8	1490	1	102K	Classroom K1 Closet	W4	Plaster	Prior	1/9/20	1/9/20	1/9/20	1/16/20	1/10/20	50	2	1	Yes	Intial: 15.42 µg/ft2 / Retest: < 5 µg/ft2	Entire Storage closet treated as single work area/containment. Intial FAAS failed. Re-cleaned, retested, and passed.
9	1490	1	102K	Classroom K1 Closet	W4	N/A	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
10	1490	1	102K	Classroom K1 Closet	Ceiling	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
11	1490	1	101KA	Classroom K1 Teacher's Closet (in front of room)	W1	Plaster	Non-RRP no Scraping	Non-RRP no Scraping	Non-RRP no Scraping	Non-RRP no Scraping	Non-RRP no Scraping	2/3/20	Non-RRP no Scraping	Non-RRP no Scraping	Non-RRP no Scraping	Non-RRP no Scraping	Non-RRP no Scraping	Non-RRP no Scraping. Stroitly painting. Completed 2/3/20.
12	1490	1	101KA	Classroom K1 Teacher's Closet (in front of room)	W2	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
13	1490	1	101KA	Classroom K1 Teacher's Closet (in front of room)	W3	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
14	1490	1	101KA	Classroom K1 Teacher's Closet (in front of room)	W4	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
15	1490	1	102KA	Classroom K1 Restroom	W1	Plaster	Prior	n/a	8/7/19	8/14/19	n/a	8/15/19	40	2	2	yes	128.69 µg/ft2 , 25 µg/ft2, 22.9 µg/ft2, < 10 µg/ft2	
16	1490	1	102KA	Classroom K1 Restroom	W3	Plaster	Prior	n/a	8/7/19	8/14/19	n/a	8/15/19	See Above	See Above	See Above	yes	see above	
17	1490	1	102KA	Classroom K1 Restroom	W3	N/A	Prior	n/a	8/7/19	8/14/19	n/a	8/15/19	See Above	See Above	See Above	yes	see above	
18	1490	1	102KA	Classroom K1 Restroom	W4	Plaster	Prior	n/a	8/7/19	8/14/19	n/a	8/15/19	See Above	See Above	See Above	yes	see above	
19	1490	1	103FB	Storage Closet (with Gate) across from Classroom K1	W2	Plaster	1/27/20	1/27/20	1/27/20	1/27/20	2/2/20	1/28/20	40	1	N/A	No	N/A	Entire closet treated as single work area/containment.
20	1490	1	103FB	Storage Closet (with Gate) across from Classroom K1	W3	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
21	1490	1	103FB	Storage Closet (with Gate) across from Classroom K1	W4	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
22	1490	1	103FB	Storage Closet (with Gate) across from Classroom K1	Ceiling	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
23	1490	1	103FC	Storage Closet (Band Instruments) across from Girl's Restroom	W2	Plaster	1/27/20	1/27/20	1/27/20	1/27/20	2/2/20	1/28/20	30	1	N/A	No	N/A	Entire closet treated as single work area/containment.
24	1490	1	103FC	Storage Closet (Band Instruments) across from Girl's Restroom	W3	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
25	1490	1	103FC	Storage Closet (Band Instruments) across from Girl's Restroom	W4	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
26	1490	1	103FC	Storage Closet (Band Instruments) across from Girl's Restroom	Ceiling	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
27	1490	1	S18	Stairwell G (near Girl's Restroom)	W1	Metal	Prior	N/A	8/3/2019	8/10/2019	N/A	8/11/2019	160	5	1	No	n/a	
28	1490	1	S18	Stairwell G (near Girl's Restroom)	W1	N/A	Prior	N/A	8/3/2019	8/10/2019	N/A	8/11/2019	See Above	See Above	See Above	No	n/a	
29	1490	1	S18	Stairwell G (near Girl's Restroom)	W2	Plaster	Prior	N/A	8/3/2019	8/10/2019	N/A	8/11/2019	See Above	See Above	See Above	No	n/a	
30	1490	1	S18	Stairwell G (near Girl's Restroom)	W2	N/A	Prior	N/A	8/3/2019	8/10/2019	N/A	8/11/2019	See Above	See Above	See Above	No	n/a	
31	1490	1	S18	Stairwell G (near Girl's Restroom)	W3	N/A	Prior	N/A	8/3/2019	8/10/2019	N/A	8/11/2019	See Above	See Above	See Above	No	n/a	
32	1490	1	S18	Stairwell G (near Girl's Restroom)	W3	N/A	Prior	N/A	8/3/2019	8/10/2019	N/A	8/11/2019	See Above	See Above	See Above	No	n/a	
33	1490	1	S18	Stairwell G (near Girl's Restroom)	W3	N/A	Prior	N/A	8/3/2019	8/10/2019	N/A	8/11/2019	See Above	See Above	See Above	No	n/a	
34	1490	1	S18	Stairwell G (near Girl's Restroom)	W3	N/A	Prior	N/A	8/3/2019	8/10/2019	N/A	8/11/2019	See Above	See Above	See Above	No	n/a	
35	1490	1	S18	Stairwell G (near Girl's Restroom)	W3	Plaster	Prior	N/A	8/3/2019	8/10/2019	N/A	8/11/2019	See Above	See Above	See Above	No	n/a	
36	1490	1	S18	Stairwell G (near Girl's Restroom)	W4	Plaster	Prior	N/A	8/3/2019	8/10/2019	N/A	8/11/2019	See Above	See Above	See Above	No	n/a	
37	1490	1	103	Classroom 103	W1	Plaster	Prior	N/A	8/7/19	8/12/19	N/A	8/13/19	720	21	3	yes	10.22 µg/ft2	
38	1490	1	103	Classroom 103	W2	Plaster	Prior	N/A	8/7/19	8/12/19	N/A	8/13/19	See Above	See Above	See Above	yes	see above	
39	1490	1	103	Classroom 103	W3	Plaster	Prior	N/A	8/7/19	8/12/19	N/A	8/13/19	See Above	See Above	See Above	yes	see above	
40	1490	1	103	Classroom 103	W3	N/A	Prior	N/A	8/7/19	8/12/19	N/A	8/13/19	See Above	See Above	See Above	yes	see above	
41	1490	1	103	Classroom 103	W4	Plaster	Prior	N/A	8/7/19	8/12/19	N/A	8/13/19	See Above	See Above	See Above	yes	see above	
42	1490	1	103	Classroom 103	Ceiling	Plaster	Prior	N/A	8/7/19	8/12/19	N/A	8/13/19	See Above	See Above	See Above	yes	see above	
43	1490	1	103A	Classroom 103 Closet	W1	Plaster	2/13/20	2/13/20	2/13/20	2/13/20	2/13/20	2/13/20	150	4	1	Yes	7.65 µg/ft2	Entire closet treated as single containment/work area.
44	1490	1	103A	Classroom 103 Closet	W2	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
45	1490	1	103A	Classroom 103 Closet	W3	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
46	1490	1	103A	Classroom 103 Closet	W4	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above

Rudolph Blankenburg ES Oversight																		
H	ULCS#	Floor	Space # (on Floor Plan)	On Site Room Name	Primary Component	Substrate Material	Pre-Cleaning Completed (date)	Contents Moved (date)	Work Area Prepped (date)	Surfaces Stabilized (date)	Contents Back in Place (date)	Final Inspection Approval and Photos (date)	Square Footage of Work Area	Number of Required RRP Wipes	Number of Colorimetric Wipes Used to Pass	Final Colorimetric Wipe Submitted for AAS Analysis (yes/no)	AAS Analysis Results	Comments from Oversight
47	1490	1	103A	Classroom 103 Closet	Ceiling	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
48	1490	1	102	Classroom 102	W3	Plaster	Prior	N/A	8/7/19	8/13/19	N/A	8/13/19	672	20	3	yes	20 µg/ft2 , 10.22 µg/ft2	
49	1490	1	102	Classroom 102	W3	N/A	Prior	N/A	8/7/19	8/13/19	N/A	8/13/19	See Above	See Above	See Above	yes	see above	
50	1490	1	102	Classroom 102	Ceiling	Plaster	Prior	N/A	8/7/19	8/13/19	N/A	8/13/19	See Above	See Above	See Above	yes	see above	
51	1490	1	101	Classroom 101	W1	Plaster	Prior	N/A	8/7/19	8/15/19	N/A	8/15/19	720	21	3	yes	< 10 µg/ft 2	
52	1490	1	101	Classroom 101	W2	Plaster	Prior	N/A	8/7/19	8/15/19	N/A	8/15/19	See Above	See Above	See Above	yes	see above	
53	1490	1	101	Classroom 101	W3	N/A	Prior	N/A	8/7/19	8/15/19	N/A	8/15/19	See Above	See Above	See Above	yes	see above	
54	1490	1	101	Classroom 101	W4	Plaster	Prior	N/A	8/7/19	8/15/19	N/A	8/15/19	See Above	See Above	See Above	yes	see above	
55	1490	1	101	Classroom 101	Ceiling	Plaster	Prior	N/A	8/7/19	8/15/19	N/A	8/15/19	See Above	See Above	See Above	yes	see above	
56	1490	1	101B	Classroom 101 Closet	W1	Plaster	2/20/20	2/20/20	2/20/20	2/20/20	2/24/20	2/21/20	30	1	1	Yes	< 5 µg/ft2	Entire closet treated as single work area/containment.
57	1490	1	101B	Classroom 101 Closet	W2	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
58	1490	1	101B	Classroom 101 Closet	W3	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
59	1490	1	101B	Classroom 101 Closet	Ceiling	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
60	1490	1	101C	Classroom 101 Restroom	W3	Plaster	N/A	N/A	8/7/19	8/15/19	N/A	8/15/19	60	2	2	yes		
61	1490	1	101C	Classroom 101 Restroom	W4	Plaster	N/A	N/A	8/7/19	8/15/19	N/A	8/15/19	See Above	See Above	See Above	yes		
62	1490	1	101C	Classroom 101 Restroom	Ceiling	Plaster	N/A	N/A	8/7/19	8/15/19	N/A	8/15/19	See Above	See Above	See Above	yes		
63	1490	1	S11	Stairwell adjacent to Classroom 101	W2	Plaster	N/A	N/A	8/10/2019	8/10/2019	N/A	8/10/2019	40	1	1	No		
64	1490	1	S11	Stairwell adjacent to Classroom 101	W4	Plaster	N/A	N/A	8/10/2019	8/10/2019	N/A	8/10/2019	See Above	See Above	See Above	No		
65	1490	1	101A	Women's Restroom next to Classroom 101	W3	Plaster	N/A	N/A	8/10/2019	8/12/2019	N/A	8/13/2019	120	3	2	yes		
66	1490	1	101A	Women's Restroom next to Classroom 101	W3	N/A	N/A	N/A	8/10/2019	8/12/2019	N/A	8/13/2019	See Above	See Above	See Above	yes	see above	
67	1490	1	101A	Women's Restroom next to Classroom 101	W4	Plaster	N/A	N/A	8/10/2019	8/12/2019	N/A	8/13/2019	See Above	See Above	See Above	yes	see above	
68	1490	1	101A	Women's Restroom next to Classroom 101	Ceiling	Plaster	N/A	N/A	8/10/2019	8/12/2019	N/A	8/13/2019	See Above	See Above	See Above	yes	see above	
69	1490	1	H111	Fire Tower Hallway adjacent to Hallway from Classrooms 101 to 103	W1	Brick	N/A	N/A	8/10/2019	8/10/2019	N/A	8/11/2019	48	4	RRP Only	No	n/a	
70	1490	1	H111	Fire Tower Hallway adjacent to Hallway from Classrooms 101 to 103	W2	Brick	N/A	N/A	8/10/2019	8/10/2019	N/A	8/11/2019	See Above	See Above	RRP Only	No	n/a	
71	1490	1	H111	Fire Tower Hallway adjacent to Hallway from Classrooms 101 to 103	W2	N/A	N/A	N/A	8/10/2019	8/10/2019	N/A	8/11/2019	See Above	See Above	RRP Only	No	n/a	
72	1490	1	H111	Fire Tower Hallway adjacent to Hallway from Classrooms 101 to 103	W3	Brick	N/A	N/A	8/10/2019	8/10/2019	N/A	8/11/2019	See Above	See Above	RRP Only	No	n/a	
73	1490	1	H111	Fire Tower Hallway adjacent to Hallway from Classrooms 101 to 103	W3	N/A	N/A	N/A	8/10/2019	8/10/2019	N/A	8/11/2019	See Above	See Above	RRP Only	No	n/a	
74	1490	1	H111	Fire Tower Hallway adjacent to Hallway from Classrooms 101 to 103	W4	Brick	N/A	N/A	8/10/2019	8/10/2019	N/A	8/11/2019	See Above	See Above	RRP Only	No	n/a	
75	1490	1	H111	Fire Tower Hallway adjacent to Hallway from Classrooms 101 to 103	Ceiling	Concrete	N/A	N/A	8/10/2019	8/10/2019	N/A	8/11/2019	See Above	See Above	RRP Only	No	n/a	
76	1490	1	S13	Fire Tower Stairs adjacent to Hallway from Classrooms 101 to 103	W4	N/A	N/A	N/A	8/10/2019	8/10/2019	N/A	8/11/2019	60	2	RRP Only	No	n/a	
77	1490	1	S13	Fire Tower Stairs adjacent to Hallway from Classrooms 101 to 103	Floor	N/A	N/A	N/A	8/10/2019	8/10/2019	N/A	8/11/2019	See Above	See Above	RRP Only	No	n/a	
78	1490	1	S13	Fire Tower Stairs adjacent to Hallway from Classrooms 101 to 103	Floor	N/A	N/A	N/A	8/10/2019	8/10/2019	N/A	8/11/2019	See Above	See Above	RRP Only	No	n/a	
79	1490	1	S13	Fire Tower Stairs adjacent to Hallway from Classrooms 101 to 103	Floor	N/A	N/A	N/A	8/10/2019	8/10/2019	N/A	8/11/2019	See Above	See Above	RRP Only	No	n/a	
80	1490	1	H16	Hallway along Classrooms 101 to 103 (to Custodial Closet)	W1	Plaster	Prior	N/A	8/9/2019	8/12/2019	N/A	8/12/2019	400	13	RRP Only	No	n/a	
81	1490	1	H16	Hallway along Classrooms 101 to 103 (to Custodial Closet)	W3	Plaster	Prior	N/A	8/9/2019	8/12/2019	N/A	8/12/2019	See Above	See Above	RRP Only	No	n/a	
82	1490	1	H16	Hallway along Classrooms 101 to 103 (to Custodial Closet)	W3	Plaster	Prior	N/A	8/9/2019	8/12/2019	N/A	8/12/2019	See Above	See Above	RRP Only	No	n/a	
83	1490	1	102C	Main Office	W4	Plaster	Prior	N/A	8/11/2019	8/13/2019	N/A	8/13/2019	336	11	2	yes	79.97 µg/ft2 , 15.76 µg/ft2	
84	1490	1	102C	Main Office	Ceiling	Plaster	Prior	N/A	8/11/2019	8/13/2019	N/A	8/13/2019	See Above	See Above	See Above	yes	see above	
85	1490	1	H15	Hallway from Stairwell near Classroom K1 to Stairwell near Classroom K4	W4	Plaster	Prior	N/A	8/10/2019	8/14/2019	N/A	8/14/2019	1200	39	RRP Only	N/A	N/A	
86	1490	1	H15	Hallway from Stairwell near Classroom K1 to Stairwell near Classroom K4	W4	N/A	Prior	N/A	8/10/2019	8/14/2019	N/A	8/14/2019	See Above	See Above	RRP Only	N/A	N/A	
87	1490	1	H15	Hallway from Stairwell near Classroom K1 to Stairwell near Classroom K4	W4	N/A	Prior	N/A	8/10/2019	8/14/2019	N/A	8/14/2019	See Above	See Above	RRP Only	N/A	N/A	
88	1490	1	H15	Hallway from Stairwell near Classroom K1 to Stairwell near Classroom K4	Ceiling	Plaster	Prior	N/A	8/10/2019	8/14/2019	N/A	8/14/2019	See Above	See Above	RRP Only	N/A	N/A	
89	1490	1	H15B	Hallway Area between Auditorium, Classroom K4, and Boy's Restroom	W1	N/A	Prior	N/A	8/10/2019	8/14/2019	N/A	8/14/2019	54	2	RRP Only	N/A	N/A	
90	1490	1	H15B	Hallway Area between Auditorium, Classroom K4, and Boy's Restroom	W2	N/A	Prior	N/A	8/10/2019	8/14/2019	N/A	8/14/2019	See Above	See Above	RRP Only	N/A	N/A	
91	1490	1	H15B	Hallway Area between Auditorium, Classroom K4, and Boy's Restroom	W3	N/A	Prior	N/A	8/10/2019	8/14/2019	N/A	8/14/2019	See Above	See Above	RRP Only	N/A	N/A	
92	1490	1	H15B	Hallway Area between Auditorium, Classroom K4, and Boy's Restroom	W4	N/A	Prior	N/A	8/10/2019	8/14/2019	N/A	8/14/2019	See Above	See Above	RRP Only	N/A	N/A	
93	1490	1	104C	Boy's Restroom near Classroom K4	W1	Plaster	Prior	N/A	8/7/19	8/12/19	N/A	8/13/19	135	5	2	yes	Intial: 195.16 µg/ft2 / Retest: 27.04 µg/ft2 / Retest: 34.42 µg/ft2 / Retest: Retest:39.99	

Rudolph Blankenburg ES Oversight																		
H	ULCS#	Floor	Space # (on Floor Plan)	On Site Room Name	Primary Component	Substrate Material	Pre-Cleaning Completed (date)	Contents Moved (date)	Work Area Prepped (date)	Surfaces Stabilized (date)	Contents Back in Place (date)	Final Inspection Approval and Photos (date)	Square Footage of Work Area	Number of Required RRP Wipes	Number of Colorimetric Wipes Used to Pass	Final Colorimetric Wipe Submitted for AAS Analysis (yes/no)	AAS Analysis Results	Comments from Oversight
94	1490	1	104C	Boy's Restroom near Classroom K4	W3	Plaster	Prior	N/A	8/7/19	8/12/19	N/A	8/13/19	See Above	See Above	See Above	yes	see above	
95	1490	1	104C	Boy's Restroom near Classroom K4	W4	Plaster	Prior	N/A	8/7/19	8/12/19	N/A	8/13/19	See Above	See Above	See Above	yes	see above	
96	1490	1	104C	Boy's Restroom near Classroom K4	Ceiling	Plaster	Prior	N/A	8/7/19	8/12/19	N/A	8/13/19	See Above	See Above	See Above	yes	see above	
97	1490	1	104	Classroom K4	W1	Plaster	Prior	N/A	8/7/19	8/12/19	N/A	8/12/19	660	20	3	yes	< 10 µg/ft2	
98	1490	1	104	Classroom K4	W2	Plaster	Prior	N/A	8/7/19	8/12/19	N/A	8/12/19	See Above	See Above	See Above	yes	see above	
99	1490	1	104	Classroom K4	W3	Plaster	Prior	N/A	8/7/19	8/12/19	N/A	8/12/19	See Above	See Above	See Above	yes	see above	
100	1490	1	104	Classroom K4	W3	N/A	Prior	N/A	8/7/19	8/12/19	N/A	8/12/19	See Above	See Above	See Above	yes	see above	
101	1490	1	104	Classroom K4	W3	Plaster	Prior	N/A	8/7/19	8/12/19	N/A	8/12/19	See Above	See Above	See Above	yes	see above	
102	1490	1	104	Classroom K4	W4	Plaster	Prior	N/A	8/7/19	8/12/19	N/A	8/12/19	See Above	See Above	See Above	yes	see above	
103	1490	1	104A	Classroom K4 Restroom	W1	Plaster	Prior	N/A	8/7/19	8/12/19	N/A	8/12/19	40	1	2	yes	88.85 µg/ft2 , 25. 42 µg/ft2, < 10 µg/ft2	
104	1490	1	104A	Classroom K4 Restroom	W2	Plaster	Prior	N/A	8/7/19	8/12/19	N/A	8/12/19	See Above	See Above	See Above	yes	see above	
105	1490	1	104A	Classroom K4 Restroom	W3	Plaster	Prior	N/A	8/7/19	8/12/19	N/A	8/12/19	See Above	See Above	See Above	yes	see above	
106	1490	1	104A	Classroom K4 Restroom	W4	Plaster	Prior	N/A	8/7/19	8/12/19	N/A	8/12/19	See Above	See Above	See Above	yes	see above	
107	1490	1	104B	Classroom K4 Closet	W1	Plaster	Prior	N/A	8/7/19	8/12/19	N/A	8/12/19	See Above	See Above	See Above	yes	see above	
108	1490	1	104B	Classroom K4 Closet	W1	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	
109	1490	1	104B	Classroom K4 Closet	W2	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	
110	1490	1	104B	Classroom K4 Closet	W2	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	
111	1490	1	104B	Classroom K4 Closet	W3	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	
112	1490	1	104B	Classroom K4 Closet	W3	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	
113	1490	1	104B	Classroom K4 Closet	W4	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	
114	1490	1	104B	Classroom K4 Closet	W4	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	
115	1490	1	104B	Classroom K4 Closet	Ceiling	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	
116	1490	1	104D	Book Storage Room adjacent Auditorium	W2	Concrete	Prior	8/10/19	8/10/19	8/10/19	8/12/19	8/10/19	100	3 RRR Wipes	1	no	n/a	
117	1490	1	104D	Book Storage Room adjacent Auditorium	W3	Concrete	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	
118	1490	1	104D	Book Storage Room adjacent Auditorium	W4	Concrete	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	
119	1490	1	104D	Book Storage Room adjacent Auditorium	Floor	N/A	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	
120	1490	1	104D	Book Storage Room adjacent Auditorium	Floor	N/A	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	
121	1490	1	H14	Hallway from Classroom 105 to 107	W1	N/A	Prior	N/A	8/10/2019	8/13/19	N/A	8/14/19	1200	37	RRP Only	N/A	N/A	
122	1490	1	H14	Hallway from Classroom 105 to 107	W3	Plaster	Prior	N/A	8/10/2019	8/13/19	N/A	8/14/19	See Above	See Above	RRP Only	N/A	N/A	
123	1490	1	H14	Hallway from Classroom 105 to 107	W3	Plaster	Prior	N/A	8/10/2019	8/13/19	N/A	8/14/19	See Above	See Above	RRP Only	N/A	N/A	
124	1490	1	H14	Hallway from Classroom 105 to 107	W3	N/A	Prior	N/A	8/10/2019	8/13/19	N/A	8/14/19	See Above	See Above	RRP Only	N/A	N/A	
125	1490	1	H14	Hallway from Classroom 105 to 107	W4	Plaster	Prior	N/A	8/10/2019	8/13/19	N/A	8/14/19	See Above	See Above	RRP Only	N/A	N/A	
126	1490	1	H14	Hallway from Classroom 105 to 107	Ceiling	Plaster	Prior	N/A	8/10/2019	8/13/19	N/A	8/14/19	See Above	See Above	RRP Only	N/A	N/A	
127	1490	1	S12	Stairwell adjacent to Classroom 107	W3	Plaster	Prior	N/A	8/3/2019	8/10/2019	N/A	8/11/2019	80	2	1	No	N/A	
128	1490	1	S12	Stairwell adjacent to Classroom 107	W3	Plaster	Prior	N/A	8/3/2019	8/10/2019	N/A	8/11/2019	See Above	See Above	See above	No	N/A	
129	1490	1	S12	Stairwell adjacent to Classroom 107	W4	Plaster	Prior	N/A	8/3/2019	8/10/2019	N/A	8/11/2019	See Above	See Above	See above	No	N/A	
130	1490	1	107A	Men's Restroom next to Classroom 107	W1	Plaster	Prior	N/A	8/10/2019	8/13/19	N/A	8/13/19	120	4	2	No	N/A	
131	1490	1	107A	Men's Restroom next to Classroom 107	W2	Plaster	Prior	N/A	8/10/2019	8/13/19	N/A	8/13/19	See Above	See Above	See above	see above	see above	
132	1490	1	107A	Men's Restroom next to Classroom 107	W3	Plaster	Prior	N/A	8/10/2019	8/13/19	N/A	8/13/19	See Above	See Above	See above	see above	see above	
133	1490	1	107A	Men's Restroom next to Classroom 107	W3	N/A	Prior	N/A	8/10/2019	8/13/19	N/A	8/13/19	See Above	See Above	See above	see above	see above	
134	1490	1	107A	Men's Restroom next to Classroom 107	W4	Plaster	Prior	N/A	8/10/2019	8/13/19	N/A	8/13/19	See Above	See Above	See above	see above	see above	
135	1490	1	107A	Men's Restroom next to Classroom 107	Ceiling	Plaster	Prior	N/A	8/10/2019	8/13/19	N/A	8/13/19	See Above	See Above	See above	see above	see above	
136	1490	1	107	Classroom 107	W1	Plaster	N/A	N/A	8/7/2019	8/13/19	N/A	8/13/19	720	21	3	yes	13.68 µg/ft2	
137	1490	1	107	Classroom 107	W2	Plaster	N/A	N/A	8/7/2019	8/13/19	N/A	8/13/19	See Above	See Above	See above	yes	see above	
138	1490	1	107	Classroom 107	W3	Plaster	N/A	N/A	8/7/2019	8/13/19	N/A	8/13/19	See Above	See Above	See above	yes	see above	
139	1490	1	107	Classroom 107	W3	N/A	N/A	N/A	8/7/2019	8/13/19	N/A	8/13/19	See Above	See Above	See above	yes	see above	
140	1490	1	107	Classroom 107	W4	Plaster	N/A	N/A	8/7/2019	8/13/19	N/A	8/13/19	See Above	See Above	See above	yes	see above	
141	1490	1	107B	Classroom 107 Closet	W1	Plaster	N/A	N/A	2/12/2020	2/12/2020	2/13/2020	2/12/20	150	4	N/A	No	N/A	Entire closet treated as single work area/containment

Rudolph Blankenburg ES Oversight																		
H	ULCS#	Floor	Space # (on Floor Plan)	On Site Room Name	Primary Component	Substrate Material	Pre-Cleaning Completed (date)	Contents Moved (date)	Work Area Prepped (date)	Surfaces Stabilized (date)	Contents Back in Place (date)	Final Inspection Approval and Photos (date)	Square Footage of Work Area	Number of Required RRP Wipes	Number of Colorimetric Wipes Used to Pass	Final Colorimetric Wipe Submitted for AAS Analysis (yes/no)	AAS Analysis Results	Comments from Oversight
142	1490	1	107B	Classroom 107 Closet	W1	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
143	1490	1	107B	Classroom 107 Closet	W2	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
144	1490	1	107B	Classroom 107 Closet	W2	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
145	1490	1	107B	Classroom 107 Closet	W3	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
146	1490	1	107B	Classroom 107 Closet	W3	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
147	1490	1	107B	Classroom 107 Closet	W4	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
148	1490	1	107B	Classroom 107 Closet	W4	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
149	1490	1	H110	Fire Tower Hallway adjacent to Hallway from Classrooms 105 to 107	W1	Brick	N/A	N/A	8/10/2019	8/10/2019	N/A	8/11/2019	48	4	RRP Only	N/A	N/A	Not Child Occupied; colormetric not required
150	1490	1	H110	Fire Tower Hallway adjacent to Hallway from Classrooms 105 to 107	W2	Brick	N/A	N/A	8/10/2019	8/10/2019	N/A	8/11/2019	See Above	See Above	RRP Only	N/A	N/A	See Above
151	1490	1	H110	Fire Tower Hallway adjacent to Hallway from Classrooms 105 to 107	W3	Brick	N/A	N/A	8/10/2019	8/10/2019	N/A	8/11/2019	See Above	See Above	RRP Only	N/A	N/A	See Above
152	1490	1	H110	Fire Tower Hallway adjacent to Hallway from Classrooms 105 to 107	W4	Brick	N/A	N/A	8/10/2019	8/10/2019	N/A	8/11/2019	See Above	See Above	RRP Only	N/A	N/A	See Above
153	1490	1	H110	Fire Tower Hallway adjacent to Hallway from Classrooms 105 to 107	Ceiling	Concrete	N/A	N/A	8/10/2019	8/10/2019	N/A	8/11/2019	See Above	See Above	RRP Only	N/A	N/A	See Above
154	1490	1	S15	Fire Tower adjacent to Hallway from Classrooms 105 to 107	W1	Brick	N/A	N/A	8/10/2019	8/10/2019	N/A	8/11/2019	60	2	RRP Only	N/A	N/A	Not Child Occupied; colormetric not required
155	1490	1	S15	Fire Tower adjacent to Hallway from Classrooms 105 to 107	W4	Brick	N/A	N/A	8/10/2019	8/10/2019	N/A	8/11/2019	See Above	See Above	RRP Only	N/A	N/A	See Above
156	1490	1	S15	Fire Tower adjacent to Hallway from Classrooms 105 to 107	W4	N/A	N/A	N/A	8/10/2019	8/10/2019	N/A	8/11/2019	See Above	See Above	RRP Only	N/A	N/A	See Above
157	1490	1	S15	Fire Tower adjacent to Hallway from Classrooms 105 to 107	Floor	N/A	N/A	N/A	8/10/2019	8/10/2019	N/A	8/11/2019	See Above	See Above	RRP Only	N/A	N/A	See Above
158	1490	1	S15	Fire Tower adjacent to Hallway from Classrooms 105 to 107	Floor	N/A	N/A	N/A	8/10/2019	8/10/2019	N/A	8/11/2019	See Above	See Above	RRP Only	N/A	N/A	See Above
159	1490	1	106	Classroom 106	W3	Plaster		N/A	8/7/19	8/12/19	N/A	8/12/19	672	20	3	yes	16.83 µg/ft2	
160	1490	1	105	Classroom 105	W3	Plaster		N/A	8/7/19	8/12/19	N/A	8/12/19	720	21	3	yes	101.76 µg/ft2 , 10.22 µg/ft2	
161	1490	1	105	Classroom 105	W3	Plaster		N/A	8/7/19	8/12/19	N/A	8/12/19	N/A	N/A	N/A	yes	see above	
162	1490	1	105	Classroom 105	W3	N/A		N/A	8/7/19	8/12/19	N/A	8/12/19	N/A	N/A	N/A	yes	see above	
163	1490	1	105	Classroom 105	Ceiling	Plaster		N/A	8/7/19	8/12/19	N/A	8/12/19	N/A	N/A	N/A	yes	see above	
164	1490	1	105A	Classroom 105 Closet	W1	Plaster	1/30/20	1/30/20	1/30/20	1/30/20	2/3/20	1/31/20	150	4	N/A	No	N/A	
165	1490	1	105A	Classroom 105 Closet	W2	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	
166	1490	1	105A	Classroom 105 Closet	W3	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	
167	1490	1	105A	Classroom 105 Closet	W4	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	
168	1490	1	105A	Classroom 105 Closet	Ceiling	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	
169	1490	1	105B	Stationery Closet adjacent to Classroom 105	W2	Plaster	2/11/20	2/11/20	2/11/2020	2/11/20	2/12/20	2/11/20	50	2	N/A	No	N/A	Entire closet treated as single work area/containment
170	1490	1	105B	Stationery Closet adjacent to Classroom 105	W3	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
171	1490	1	105B	Stationery Closet adjacent to Classroom 105	W4	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
172	1490	1	105B	Stationery Closet adjacent to Classroom 105	Ceiling	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
173	1490	1	S17	Stairwell near Classroom 105	W2	N/A	Prior	N/A	8/3/2019	8/10/2019	N/A	8/11/2019	80	2	1	No		
174	1490	1	S17	Stairwell near Classroom 105	W3	N/A	Prior	N/A	8/3/2019	8/10/2019	N/A	8/11/2019	See Above	See Above	See Above	No		
175	1490	1	S17	Stairwell near Classroom 105	W4	N/A	Prior	N/A	8/3/2019	8/10/2019	N/A	8/11/2019	See Above	See Above	See Above	No		
176	1490	1	S17	Stairwell near Classroom 105	Ceiling	Plaster	Prior	N/A	8/3/2019	8/10/2019	N/A	8/11/2019	See Above	See Above	See Above	No		
177	1490	1	S17	Stairwell near Classroom 105	Floor	N/A	Prior	N/A	8/3/2019	8/10/2019	N/A	8/11/2019	See Above	See Above	See Above	No		
178	1490	1	S17	Stairwell near Classroom 105	Floor	N/A	Prior	N/A	8/3/2019	8/10/2019	N/A	8/11/2019	See Above	See Above	See Above	No		
179	1490	1	102D	Main Office Closet	W2	Plaster	3/6/20	3/6/20	3/6/20	3/6/20	3/7/20	3/7/20	50	2	N/A	No	N/A	Entire Storage closet/hallway treated as single work area/containment.
180	1490	1	102D	Main Office Closet	W3	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
181	1490	1	102D	Main Office Closet	W4	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
182	1490	1	102F	Main Office Closet	Ceiling	Plaster	3/2/20	3/2/20	3/2/20	3/4/20		3/4/20	100	3	N/A	No	N/A	Entire closet treated as single work area/containment
183	1490	2	213B	Book Room adjacent to Classroom 213	W2	Plaster	2/11/20	2/11/20	2/11/2020	2/11/20	2/12/20	2/11/20	50	2	N/A	No	N/A	Entire closet treated as single work area/containment
184	1490	2	212CF	Foyer in Boy's Restroom near Classroom 212	W3	Plaster	Prior	N/A	8/5/19	8/8/19	N/A		60	2	1	Yes	29.1 µg/ft2, 19.77µg/ft2	
185	1490	2	212C	Boy's Restroom near Classroom 212	W1	Plaster/Ceramic	Prior	N/A	8/5/19	8/8/19	N/A		240	5	1	Yes	see above	
186	1490	2	212C	Boy's Restroom near Classroom 212	W2	Plaster/Ceramic	Prior	N/A	8/5/19	8/8/19	N/A		See Above		1	Yes	see above	See Above
187	1490	2	212C	Boy's Restroom near Classroom 212	W3	Plaster/Ceramic	Prior	N/A	8/5/19	8/8/19	N/A		See Above		1	Yes	see above	See Above
188	1490	2	212C	Boy's Restroom near Classroom 212	W4	Plaster/Ceramic/Block	Prior	N/A	8/5/19	8/8/19	N/A		See Above		1	Yes	see above	See Above
189	1490	2	212C	Boy's Restroom near Classroom 212	Ceiling	Plaster	Prior	N/A	8/5/19	8/8/19	N/A		See Above		1	Yes	see above	See Above

Rudolph Blankenburg ES Oversight																		
H	ULCS#	Floor	Space # (on Floor Plan)	On Site Room Name	Primary Component	Substrate Material	Pre-Cleaning Completed (date)	Contents Moved (date)	Work Area Prepped (date)	Surfaces Stabilized (date)	Contents Back in Place (date)	Final Inspection Approval and Photos (date)	Square Footage of Work Area	Number of Required RRP Wipes	Number of Colorimetric Wipes Used to Pass	Final Colorimetric Wipe Submitted for AAS Analysis (yes/no)	AAS Analysis Results	Comments from Oversight
190	1490	2	212A	Book Storage adjacent to Classroom 212	W2	Plaster	2/20/20	2/20/20	2/20/20	2/20/20	2/20/20	2/20/20	40	1	1	Yes	< 5 µg/ft2	
191	1490	2	212A	Book Storage adjacent to Classroom 212	W3	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	
192	1490	2	212A	Book Storage adjacent to Classroom 212	W3	N/A	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	
193	1490	2	212A	Book Storage adjacent to Classroom 212	W4	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	
194	1490	2	212A	Book Storage adjacent to Classroom 212	Ceiling	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	
195	1490	2	211E	Book Storage across from Classroom 211	W1	Plaster	2/4/20	2/4/20	2/4/20	2/4/20	2/10/20	2/5/20	60	2	N/A	No	N/A	Entire closet treated as single work area/containment
196	1490	2	211E	Book Storage across from Classroom 211	W2	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
197	1490	2	211E	Book Storage across from Classroom 211	W3	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
198	1490	2	211E	Book Storage across from Classroom 211	W4	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
199	1490	2	211E	Book Storage across from Classroom 211	Ceiling	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
200	1490	2	211C	Girl's Restroom	Ceiling	Plaster	Prior	N/A	8/5/19	8/8/19	N/A	8/8/19	138	5	RRP Only	n/a		Not Child Occupied; colormetric not required
201	1490	2	H29B	Hallway Area between Classroom 211 and Girl's Restroom	W4	Plaster	Prior	N/A	8/5/19	8/8/19	N/A	8/8/19	120	3	RRP Only	n/a		Not Child Occupied; colormetric not required
202	1490	2	210A	Corner Office 10A (Across from Custodial Closet)	W2	Plaster	Prior	Prior	8/7/19	8/12/19	8/13/19	8/12/19	220	7	3	yes	< 10 µg/ft2	
203	1490	2	210A	Corner Office 10A (Across from Custodial Closet)	W4	Plaster	Prior	Prior	8/7/19	8/12/19	8/13/19	8/12/19	See Above	See Above	See Above	yes	see above	
204	1490	2	210A	Corner Office 10A (Across from Custodial Closet)	Ceiling	Plaster	Prior	Prior	8/7/19	8/12/19	8/13/19	8/12/19	See Above	See Above	See Above	yes	see above	
205	1490	2	210B	Corner Office 10A - Restroom	W1	Plaster	Prior	N/A	8/7/19	8/12/19	N/A	8/12/19	10	1	2	no	220.15 µg/ft2 , 34.56 µg/ft2 , < 10 µg/ft2	
206	1490	2	210B	Corner Office 10A - Restroom	W1	N/A	Prior	N/A	8/7/19	8/12/19	N/A	8/12/19	See Above	See Above	See Above	no	see above	
207	1490	2	210B	Corner Office 10A - Restroom	W2	Plaster	Prior	N/A	8/7/19	8/12/19	N/A	8/12/19	See Above	See Above	See Above	no	see above	
208	1490	2	210B	Corner Office 10A - Restroom	W3	Plaster	Prior	N/A	8/7/19	8/12/19	N/A	8/12/19	See Above	See Above	See Above	no	see above	
209	1490	2	210B	Corner Office 10A - Restroom	W4	Plaster	Prior	N/A	8/7/19	8/12/19	N/A	8/12/19	See Above	See Above	See Above	no	see above	
210	1490	2	210B	Corner Office 10A - Restroom	Ceiling	Plaster	Prior	N/A	8/7/19	8/12/19	N/A	8/12/19	See Above	See Above	See Above	no	see above	
211	1490	2	211D	Men's Restroom	W1	Plaster	Prior	N/A	8/6/19	8/9/19	N/A	8/9/19	300	10	RRP Only	N/A		Not Child Occupied; colormetric not required
212	1490	2	211D	Men's Restroom	W2	Plaster	Prior	N/A	8/6/19	8/9/19	N/A	8/9/19	See Above	See Above	RRP Only	N/A		See Above
213	1490	2	211D	Men's Restroom	W3	Plaster	Prior	N/A	8/6/19	8/9/19	N/A	8/9/19	See Above	See Above	RRP Only	N/A		See Above
214	1490	2	211D	Men's Restroom	W3	N/A	Prior	N/A	8/6/19	8/9/19	N/A	8/9/19	See Above	See Above	RRP Only	N/A		See Above
215	1490	2	211D	Men's Restroom	W4	Plaster	Prior	N/A	8/6/19	8/9/19	N/A	8/9/19	See Above	See Above	RRP Only	N/A		See Above
216	1490	2	211D	Men's Restroom	Ceiling	Plaster	Prior	N/A	8/6/19	8/9/19	N/A	8/9/19	See Above	See Above	RRP Only	N/A		See Above
217	1490	2	208A	Nurse's Office	W2	Plaster	Prior	Prior	8/7/19	8/12/19	8/13/19	8/12/19	267	8	2	Yes	51.44 µg/ft2, 65.64 µg/ft2, 15.62 µg/ft2	
218	1490	2	208A	Nurse's Office	W3	Plaster	Prior	Prior	8/7/19	8/12/19	8/13/19	8/12/19	See Above	See Above	See Above	Yes	see above	
219	1490	2	208A	Nurse's Office	W3	N/A	Prior	Prior	8/7/19	8/12/19	8/13/19	8/12/19	See Above	See Above	See Above	Yes	see above	
220	1490	2	208A	Nurse's Office	W4	Plaster	Prior	Prior	8/7/19	8/12/19	8/13/19	8/12/19	See Above	See Above	See Above	Yes	see above	
221	1490	2	208A	Nurse's Office	W4	Plaster	Prior	Prior	8/7/19	8/12/19	8/13/19	8/12/19	See Above	See Above	See Above	Yes	see above	
222	1490	2	208A	Nurse's Office	W4	N/A	Prior	Prior	8/7/19	8/12/19	8/13/19	8/12/19	See Above	See Above	See Above	Yes	see above	
223	1490	2	208A	Nurse's Office	Ceiling	Plaster	Prior	Prior	8/7/19	8/12/19	8/13/19	8/12/19	See Above	See Above	See Above	Yes	see above	
224	1490	2	208C	Nurse's Restroom	W1	Plaster	Prior	Prior	8/7/19	8/12/19	8/13/19	8/12/19	70	2	2	Yes	< 10 µg/ft2	
225	1490	2	208C	Nurse's Restroom	W1	Plaster	Prior	Prior	8/7/19	8/12/19	8/13/19	8/12/19	See Above	See Above	See Above	Yes	see above	
226	1490	2	208C	Nurse's Restroom	W2	Plaster	Prior	Prior	8/7/19	8/12/19	8/13/19	8/12/19	See Above	See Above	See Above	Yes	see above	
227	1490	2	208C	Nurse's Restroom	W3	Plaster	Prior	Prior	8/7/19	8/12/19	8/13/19	8/12/19	See Above	See Above	See Above	Yes	see above	
228	1490	2	208C	Nurse's Restroom	W4	Plaster	Prior	Prior	8/7/19	8/12/19	8/13/19	8/12/19	See Above	See Above	See Above	Yes	see above	
229	1490	2	208C	Nurse's Restroom	Ceiling	Plaster	Prior	Prior	8/7/19	8/12/19	8/13/19	8/12/19	See Above	See Above	See Above	Yes	see above	
230	1490	2	S27	Stairwell M (near Classroom 212)	W4	Plaster	Prior	N/A	8/3/2019	8/10/2019	N/A	8/11/2019	80	2	1	No		
231	1490	2	S27	Stairwell M (near Classroom 212)	Ceiling	Plaster	Prior	N/A	8/3/2019	8/10/2019	N/A	8/11/2019	See Above	See Above	See Above	No		
232	1490	2	S27	Stairwell M (near Classroom 212)	Floor	N/A	Prior	N/A	8/3/2019	8/10/2019	N/A	8/11/2019	See Above	See Above	See Above	No		
233	1490	2	212	Classroom 212	W1	Plaster		N/A	8/6/19	8/9/19	N/A	8/9/19	720	21	RRP Only	N/A		Not Child Occupied; colormetric not required
234	1490	2	212	Classroom 212	W1	Plaster	Prior	N/A	8/6/19	8/9/19	N/A	8/9/19	See Above	See Above	RRP Only	N/A		See Above
235	1490	2	212	Classroom 212	W2	Plaster	Prior	N/A	8/6/19	8/9/19	N/A	8/9/19	See Above	See Above	RRP Only	N/A		See Above
236	1490	2	212	Classroom 212	W2	Plaster	Prior	N/A	8/6/19	8/9/19	N/A	8/9/19	See Above	See Above	RRP Only	N/A		See Above
237	1490	2	212	Classroom 212	W3	Plaster	Prior	N/A	8/6/19	8/9/19	N/A	8/9/19	See Above	See Above	RRP Only	N/A		See Above

Rudolph Blankenburg ES Oversight																		
H	ULCS#	Floor	Space # (on Floor Plan)	On Site Room Name	Primary Component	Substrate Material	Pre-Cleaning Completed (date)	Contents Moved (date)	Work Area Prepped (date)	Surfaces Stabilized (date)	Contents Back in Place (date)	Final Inspection Approval and Photos (date)	Square Footage of Work Area	Number of Required RRP Wipes	Number of Colorimetric Wipes Used to Pass	Final Colorimetric Wipe Submitted for AAS Analysis (yes/no)	AAS Analysis Results	Comments from Oversight
238	1490	2	212	Classroom 212	W4	Plaster	Prior	N/A	8/6/19	8/9/19	N/A	8/9/19	See Above	See Above	RRP Only	N/A		See Above
239	1490	2	212	Classroom 212	Ceiling	Plaster	Prior	N/A	8/6/19	8/9/19	N/A	8/9/19	See Above	See Above	RRP Only	N/A		See Above
240	1490	2	212B	Classroom 212 Closet	W1	Plaster	2/10/20	2/10/20	2/10/20	2/12/20	N/A	2/12/20	150	4	N/A	no	n/a	Entire closet treated as single work area/containment
241	1490	2	212B	Classroom 212 Closet	W1	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
242	1490	2	212B	Classroom 212 Closet	W2	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
243	1490	2	212B	Classroom 212 Closet	W3	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
244	1490	2	212B	Classroom 212 Closet	W4	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
245	1490	2	212B	Classroom 212 Closet	Ceiling	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
246	1490	2	212B	Classroom 212 Closet	Ceiling	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
247	1490	2	213	Classroom 213	W1	Plaster	Prior	N/A	8/5/19	8/9/19	N/A	8/9/19	720	21	RRP Only	N/A		Not Child Occupied; colormetric not required
248	1490	2	213	Classroom 213	W1	Plaster	Prior	N/A	8/5/19	8/9/19	N/A	8/9/19	See Above	See Above	RRP Only	N/A		See Above
249	1490	2	213	Classroom 213	W3	Plaster	Prior	N/A	8/5/19	8/9/19	N/A	8/9/19	See Above	See Above	RRP Only	N/A		See Above
250	1490	2	213	Classroom 213	W3	Plaster	Prior	N/A	8/5/19	8/9/19	N/A	8/9/19	See Above	See Above	RRP Only	N/A		See Above
251	1490	2	213	Classroom 213	W4	Plaster	Prior	N/A	8/5/19	8/9/19	N/A	8/9/19	See Above	See Above	RRP Only	N/A		See Above
252	1490	2	213	Classroom 213	W4	Plaster	Prior	N/A	8/5/19	8/9/19	N/A	8/9/19	See Above	See Above	RRP Only	N/A		See Above
253	1490	2	213	Classroom 213	Ceiling	Plaster	Prior	N/A	8/5/19	8/9/19	N/A	8/9/19	See Above	See Above	RRP Only	N/A		See Above
254	1490	2	213A	Classroom 213 Closet	W1	Plaster	1/22/20	1/22/20	1/22/20	1/22/20		1/23/20	150	4	N/A	N/A	N/A	Entire closet treated as single work area/containment
255	1490	2	213A	Classroom 213 Closet	W1	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
256	1490	2	213A	Classroom 213 Closet	W2	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
257	1490	2	213A	Classroom 213 Closet	W2	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
258	1490	2	213A	Classroom 213 Closet	W3	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
259	1490	2	213A	Classroom 213 Closet	W3	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
260	1490	2	213A	Classroom 213 Closet	Ceiling	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
261	1490	2	214	Classroom 214	W1	Plaster	Prior	N/A	8/5/19	8/8/19	N/A	8/8/19	768	22	RRP Only	N/A		Not Child Occupied; colormetric not required
262	1490	2	214	Classroom 214	W1	Plaster	Prior	N/A	8/5/19	8/8/19	N/A	8/8/19	See Above	See Above	RRP Only	N/A		See Above
263	1490	2	214	Classroom 214	W3	Plaster	Prior	N/A	8/5/19	8/8/19	N/A	8/8/19	See Above	See Above	RRP Only	N/A		See Above
264	1490	2	214	Classroom 214	W3	Plaster	Prior	N/A	8/5/19	8/8/19	N/A	8/8/19	See Above	See Above	RRP Only	N/A		See Above
265	1490	2	214	Classroom 214	Ceiling	Plaster	Prior	N/A	8/5/19	8/8/19	N/A	8/8/19	See Above	See Above	RRP Only	N/A		See Above
266	1490	2	215	Classroom 215	W1	Plaster	Prior	N/A	8/5/19	8/8/19	N/A	8/8/19	768	22	RRP Only	N/A		Not Child Occupied; colormetric not required
267	1490	2	215	Classroom 215	W1	Plaster	Prior	N/A	8/5/19	8/8/19	N/A	8/8/19	See Above	See Above	RRP Only	N/A		See Above
268	1490	2	215	Classroom 215	W2	Plaster	Prior	N/A	8/5/19	8/8/19	N/A	8/8/19	See Above	See Above	RRP Only	N/A		See Above
269	1490	2	215	Classroom 215	W2	Plaster	Prior	N/A	8/5/19	8/8/19	N/A	8/8/19	See Above	See Above	RRP Only	N/A		See Above
270	1490	2	215	Classroom 215	W3	Plaster	Prior	N/A	8/5/19	8/8/19	N/A	8/8/19	See Above	See Above	RRP Only	N/A		See Above
271	1490	2	215	Classroom 215	W3	Plaster	Prior	N/A	8/5/19	8/8/19	N/A	8/8/19	See Above	See Above	RRP Only	N/A		See Above
272	1490	2	215	Classroom 215	W4	Plaster	Prior	N/A	8/5/19	8/8/19	N/A	8/8/19	See Above	See Above	RRP Only	N/A		See Above
273	1490	2	215	Classroom 215	Ceiling	Plaster	Prior	N/A	8/5/19	8/8/19	N/A	8/8/19	See Above	See Above	RRP Only	N/A		See Above
274	1490	2	215B	Classroom 215 Closet	W1	Plaster	Prior	1/2/20	1/2/20	1/9/20	N/A	1/8/20	100	3	N/A	No	N/A	Entire closet treated as single work area/containment
275	1490	2	215B	Classroom 215 Closet	W1	Plaster	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above
276	1490	2	215B	Classroom 215 Closet	W3	Plaster	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above
277	1490	2	215B	Classroom 215 Closet	W3	Plaster	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above
278	1490	2	215B	Classroom 215 Closet	W4	Plaster	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above
279	1490	2	215B	Classroom 215 Closet	W4	Plaster	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above
280	1490	2	215B	Classroom 215 Closet	Ceiling	Plaster	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above
281	1490	2	215A	Counselor's Office 15 (next to Classroom 215)	W2	Plaster	Prior	8/5/19	8/6/19	8/8/19	8/12/19	8/8/19	300	10	RRP Only	N/A		Not Child Occupied; colormetric not required
282	1490	2	215A	Counselor's Office 15 (next to Classroom 215)	Ceiling	Plaster	Prior	8/5/19	8/6/19	8/8/19	8/12/19	8/8/19	See Above	See Above	RRP Only	N/A		See Above
283	1490	2	H212	Fire Tower Hallway across Hallway from Classroom 214	W1	Brick	N/A	N/A	8/10/2019	8/10/2019	N/A	8/11/2019	48	4	RRP Only	N/A		Not Child Occupied; colormetric not required
284	1490	2	H212	Fire Tower Hallway across Hallway from Classroom 214	W2	Brick	N/A	N/A	8/10/2019	8/10/2019	N/A	8/11/2019	See Above	See Above	RRP Only	N/A		See Above
285	1490	2	H212	Fire Tower Hallway across Hallway from Classroom 214	W2	N/A	N/A	N/A	8/10/2019	8/10/2019	N/A	8/11/2019	See Above	See Above	RRP Only	N/A		See Above

Rudolph Blankenburg ES Oversight																		
H	ULCS#	Floor	Space # (on Floor Plan)	On Site Room Name	Primary Component	Substrate Material	Pre-Cleaning Completed (date)	Contents Moved (date)	Work Area Prepped (date)	Surfaces Stabilized (date)	Contents Back in Place (date)	Final Inspection Approval and Photos (date)	Square Footage of Work Area	Number of Required RRP Wipes	Number of Colorimetric Wipes Used to Pass	Final Colorimetric Wipe Submitted for AAS Analysis (yes/no)	AAS Analysis Results	Comments from Oversight
286	1490	2	H212	Fire Tower Hallway across Hallway from Classroom 214	W3	Brick	N/A	N/A	8/10/2019	8/10/2019	N/A	8/11/2019	See Above	See Above	RRP Only	N/A		See Above
287	1490	2	H212	Fire Tower Hallway across Hallway from Classroom 214	W3	N/A	N/A	N/A	8/10/2019	8/10/2019	N/A	8/11/2019	See Above	See Above	RRP Only	N/A		See Above
288	1490	2	H212	Fire Tower Hallway across Hallway from Classroom 214	W4	Brick	N/A	N/A	8/10/2019	8/10/2019	N/A	8/11/2019	See Above	See Above	RRP Only	N/A		See Above
289	1490	2	H212	Fire Tower Hallway across Hallway from Classroom 214	Ceiling	Brick	N/A	N/A	8/10/2019	8/10/2019	N/A	8/11/2019	See Above	See Above	RRP Only	N/A		See Above
290	1490	2	S25	Fire Tower Stairs across Hallway from Classroom 214	W1	Brick	N/A	N/A	8/10/2019	8/10/2019	N/A	8/11/2019	60	2	RRP Only	N/A		Not Child Occupied; colormetric not required
291	1490	2	S25	Fire Tower Stairs across Hallway from Classroom 214	W2	Brick	N/A	N/A	8/10/2019	8/10/2019	N/A	8/11/2019	See Above	See Above	RRP Only	N/A		See Above
292	1490	2	S25	Fire Tower Stairs across Hallway from Classroom 214	W2	N/A	N/A	N/A	8/10/2019	8/10/2019	N/A	8/11/2019	See Above	See Above	RRP Only	N/A		See Above
293	1490	2	S25	Fire Tower Stairs across Hallway from Classroom 214	W3	Brick	N/A	N/A	8/10/2019	8/10/2019	N/A	8/11/2019	See Above	See Above	RRP Only	N/A		See Above
294	1490	2	S25	Fire Tower Stairs across Hallway from Classroom 214	W4	Brick	N/A	N/A	8/10/2019	8/10/2019	N/A	8/11/2019	See Above	See Above	RRP Only	N/A		See Above
295	1490	2	S25	Fire Tower Stairs across Hallway from Classroom 214	Ceiling	Brick	N/A	N/A	8/10/2019	8/10/2019	N/A	8/11/2019	See Above	See Above	RRP Only	N/A		See Above
296	1490	2	H27	Hallway from Classrooms 213 to 215	W3	Plaster	Prior	N/A	8/6/2019	8/9/2019	N/A	8/9/19	960	28	RRP Only	N/A		Not Child Occupied; colormetric not required
297	1490	2	H27	Hallway from Classrooms 213 to 215	W3	N/A	Prior	N/A	8/6/2019	8/9/2019	N/A	8/9/19	See Above	See Above	RRP Only	N/A		See Above
298	1490	2	H27	Hallway from Classrooms 213 to 215	Ceiling	Plaster	Prior	N/A	8/6/2019	8/9/2019	N/A	8/9/19	See Above	See Above	RRP Only	N/A		See Above
299	1490	2	H28	Hallway adjacent to Upper Part of Auditorium (from Staiwell M to Stairwell G)	W4	Plaster	Prior	N/A	8/6/2019	8/9/2019	N/A	8/9/19	1200	35	RRP Only	N/A		Not Child Occupied; colormetric not required
300	1490	2	H28	Hallway adjacent to Upper Part of Auditorium (from Staiwell M to Stairwell G)	W4	N/A	Prior	N/A	8/6/2019	8/9/2019	N/A	8/9/19	See Above	See Above	RRP Only	N/A		See Above
301	1490	2	H28	Hallway adjacent to Upper Part of Auditorium (from Staiwell M to Stairwell G)	Ceiling	Plaster	Prior	N/A	8/6/2019	8/9/2019	N/A	8/9/19	See Above	See Above	RRP Only	N/A		See Above
302	1490	2	211	Classroom 211	W1	Plaster	Prior	N/A	8/2/2019	8/9/19	N/A	8/9/19	720	21	RRP Only	N/A		Not Child Occupied; colormetric not required
303	1490	2	211	Classroom 211	W1	Plaster	Prior	N/A	8/2/19	8/9/19	N/A	8/9/19	see above	see above	RRP Only	N/A		see above
304	1490	2	211	Classroom 211	W2	Plaster	Prior	N/A	8/2/19	8/9/19	N/A	8/9/19	see above	see above	RRP Only	N/A		see above
305	1490	2	211	Classroom 211	W2	Plaster	Prior	N/A	8/2/19	8/9/19	N/A	8/9/19	see above	see above	RRP Only	N/A		see above
306	1490	2	211	Classroom 211	W3	Plaster	Prior	N/A	8/2/19	8/9/19	N/A	8/9/19	see above	see above	RRP Only	N/A		see above
307	1490	2	211	Classroom 211	W3	Plaster	Prior	N/A	8/2/19	8/9/19	N/A	8/9/19	see above	see above	RRP Only	N/A		see above
308	1490	2	211	Classroom 211	W4	Plaster	Prior	N/A	8/2/19	8/9/19	N/A	8/9/19	see above	see above	RRP Only	N/A		see above
309	1490	2	211	Classroom 211	W4	Plaster	Prior	N/A	8/2/19	8/9/19	N/A	8/9/19	see above	see above	RRP Only	N/A		see above
310	1490	2	211	Classroom 211	Ceiling	Plaster	Prior	N/A	8/2/19	8/9/19	N/A	8/9/19	see above	see above	RRP Only	N/A		see above
311	1490	2	211A	Classroom 211 Closet	W1	Plaster	Prior	N/A	8/2/19	8/9/19	N/A	8/9/19	96	5	RRP Only	N/A		Not Child Occupied; colormetric not required
312	1490	2	211A	Classroom 211 Closet	W1	Plaster	Prior	N/A	8/2/19	8/9/19	N/A	8/9/19	see above	see above	RRP Only	N/A		see above
313	1490	2	211A	Classroom 211 Closet	W3	Plaster	Prior	N/A	8/2/19	8/9/19	N/A	8/9/19	see above	see above	RRP Only	N/A		see above
314	1490	2	211A	Classroom 211 Closet	W3	Plaster	Prior	N/A	8/2/19	8/9/19	N/A	8/9/19	see above	see above	RRP Only	N/A		see above
315	1490	2	211A	Classroom 211 Closet	W4	Plaster	Prior	N/A	8/2/19	8/9/19	N/A	8/9/19	see above	see above	RRP Only	N/A		see above
316	1490	2	211A	Classroom 211 Closet	W4	Plaster	Prior	N/A	8/2/19	8/9/19	N/A	8/9/19	see above	see above	RRP Only	N/A		see above
317	1490	2	211A	Classroom 211 Closet	Ceiling	Plaster	Prior	N/A	8/2/19	8/9/19	N/A	8/9/19	see above	see above	RRP Only	N/A		see above
318	1490	2	H29	Hallway from Office 10A to Nurse's Office	W1	N/A	Prior	Prior	8/2/19	8/14/19	n/a	8/14/19	10	3	RRP Only	n/a		Not Child Occupied; colormetric not required
319	1490	2	208	Classroom 208	W1	Plaster	Prior	n/a	8/2/19	8/8/19	n/a	8/8/19	720	21	RRP Only	n/a		Not Child Occupied; colormetric not required
320	1490	2	208	Classroom 208	W2	Plaster	Prior	n/a	8/2/19	8/8/19	n/a	8/8/19	see above	see above	RRP Only	n/a		see above
321	1490	2	208	Classroom 208	W2	Plaster	Prior	n/a	8/2/19	8/8/19	n/a	8/8/19	see above	see above	RRP Only	n/a		see above
322	1490	2	208	Classroom 208	W3	Plaster	Prior	n/a	8/2/19	8/8/19	n/a	8/8/19	see above	see above	RRP Only	n/a		see above
323	1490	2	208	Classroom 208	W3	Plaster	Prior	Prior	8/2/19	8/2/19	n/a	8/8/19	see above	see above	RRP Only	n/a		see above
324	1490	2	208	Classroom 208	W4	Plaster	Prior	Prior	8/2/19	8/2/19	n/a	8/8/19	see above	see above	RRP Only	n/a		see above
325	1490	2	208	Classroom 208	Ceiling	Plaster	Prior	Prior	8/2/19	8/2/19	n/a	8/8/19	see above	see above	RRP Only	n/a		see above
326	1490	2	208B	Classroom 208 Closet	W1	Plaster	Prior	12/19/19	12/19/19	12/19/19	1/3/20	1/2/20	100	3	N/A	No	N/A	Entire closet treated as single work area/containment
327	1490	2	208B	Classroom 208 Closet	W2	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
328	1490	2	208B	Classroom 208 Closet	W3	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
329	1490	2	209	Classroom 209	W1	Plaster	Prior	n/a	8/2/19	8/8/19	n/a	8/8/19	720	21	RRP Only	n/a		Not Child Occupied; colormetric not required
330	1490	2	209	Classroom 209	W3	Plaster	Prior	n/a	8/2/19	8/8/19	n/a	8/8/19	see above	see above	RRP Only	n/a		see above
331	1490	2	209	Classroom 209	W3	Plaster	Prior	n/a	8/2/19	8/8/19	n/a	8/8/19	see above	see above	RRP Only	n/a		see above
332	1490	2	209	Classroom 209	Ceiling	Plaster	Prior	n/a	8/2/19	8/8/19	n/a	8/8/19	see above	see above	RRP Only	n/a		see above
333	1490	2	H213	Fire Tower Hallway adjacent to Hallway from Classrooms 208 to 211	W1	Brick	n/a	n/a	8/10/2019	8/10/2019	N/A	8/11/2019	48	4	RRP Only	n/a		
334	1490	2	H213	Fire Tower Hallway adjacent to Hallway from Classrooms 208 to 211	W2	Brick	n/a	n/a	8/10/2019	8/10/2019	N/A	8/11/2019	See Above	See Above	RRP Only	n/a		



Rudolph Blankenburg ES  
Oversight

[illegible]

Rudolph Blankenburg ES Oversight																		
H	ULCS#	Floor	Space # (on Floor Plan)	On Site Room Name	Primary Component	Substrate Material	Pre-Cleaning Completed (date)	Contents Moved (date)	Work Area Prepped (date)	Surfaces Stabilized (date)	Contents Back in Place (date)	Final Inspection Approval and Photos (date)	Square Footage of Work Area	Number of Required RRP Wipes	Number of Colorimetric Wipes Used to Pass	Final Colorimetric Wipe Submitted for AAS Analysis (yes/no)	AAS Analysis Results	Comments from Oversight
433	1490	3	322A	Classroom 322 Closet	W3	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
434	1490	3	324	Classroom 324	W1	Plaster	Prior	Prior	8/1/19	8/6/19	8/8/19	8/6/19	768	22	RRP Only			Not Child Occupied; colormetric not required
435	1490	3	324	Classroom 324	W1	Plaster	Prior	Prior	8/1/19	8/6/19	8/8/19	8/6/19	see above	see above	RRP Only			see above
436	1490	3	324	Classroom 324	W2	Plaster	Prior	Prior	8/1/19	8/6/19	8/8/19	8/6/19	see above	see above	RRP Only			see above
437	1490	3	324	Classroom 324	W3	Plaster	Prior	Prior	8/1/19	8/6/19	8/8/19	8/6/19	see above	see above	RRP Only			see above
438	1490	3	324	Classroom 324	W4	Plaster	Prior	Prior	8/1/19	8/6/19	8/8/19	8/6/19	see above	see above	RRP Only			see above
439	1490	3	324	Classroom 324	Ceiling	Plaster	Prior	Prior	8/1/19	8/6/19	8/8/19	8/6/19	see above	see above	RRP Only			see above
440	1490	3	324A	Classroom 324 Closet	W1	Plaster	1/13/20	1/13/20	1/13/20	1/13/20	1/13/20	1/13/20	150	4	N/A	No	N/A	Entire Storage closet treated as single work area/containment.
441	1490	3	324A	Classroom 324 Closet	W1	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
442	1490	3	324A	Classroom 324 Closet	W2	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
443	1490	3	324A	Classroom 324 Closet	W2	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
444	1490	3	324A	Classroom 324 Closet	W3	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
445	1490	3	324A	Classroom 324 Closet	W3	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
446	1490	3	324A	Classroom 324 Closet	W4	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
447	1490	3	324A	Classroom 324 Closet	Ceiling	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
448	1490	3	320	Classroom 320	W1	Plaster	Prior	Prior	8/2/19	8/6/2019	8/6/2019	8/6/2019	804	24	RRP Only			Not Child Occupied; colormetric not required
449	1490	3	320	Classroom 320	W2	Plaster	Prior	Prior	8/2/19	8/6/2019	8/6/2019	8/6/2019	see above	see above	RRP Only			see above
450	1490	3	320	Classroom 320	W3	Plaster	Prior	Prior	8/2/19	8/6/2019	8/6/2019	8/6/2019	see above	see above	RRP Only			see above
451	1490	3	320	Classroom 320	W3	N/A	Prior	Prior	8/2/19	8/6/2019	8/6/2019	8/6/2019	see above	see above	RRP Only			see above
452	1490	3	320A	Classroom 320 Closet	W1	Plaster	1/15/20	1/15/20	1/15/20	1/15/20	1/15/20	1/15/20	150	4	N/A	No	N/A	Entire Storage closet treated as single work area/containment.
453	1490	3	320A	Classroom 320 Closet	W2	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
454	1490	3	320A	Classroom 320 Closet	W3	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
455	1490	3	320A	Classroom 320 Closet	W3	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
456	1490	3	325	Classroom 325	W1	Plaster	Prior	Prior	8/1/19	8/6/2019	8/6/2019	8/6/2019	768	22	RRP Only			Not Child Occupied; colormetric not required
457	1490	3	325	Classroom 325	W1	Plaster	Prior	Prior	8/1/19	8/6/2019	8/6/2019	8/6/2019	see above	see above	RRP Only			see above
458	1490	3	325	Classroom 325	W2	Plaster	Prior	Prior	8/1/19	8/6/2019	8/6/2019	8/6/2019	see above	see above	RRP Only			see above
459	1490	3	325	Classroom 325	W3	Plaster	Prior	Prior	8/1/19	8/6/2019	8/6/2019	8/6/2019	see above	see above	RRP Only			see above
460	1490	3	325	Classroom 325	W4	Plaster	Prior	Prior	8/1/19	8/6/2019	8/6/2019	8/6/2019	see above	see above	RRP Only			see above
461	1490	3	325	Classroom 325	W4	Plaster	Prior	Prior	8/1/19	8/6/2019	8/6/2019	8/6/2019	see above	see above	RRP Only			see above
462	1490	3	325	Classroom 325	Ceiling	Plaster	Prior	Prior	8/1/19	8/6/2019	8/6/2019	8/6/2019	see above	see above	RRP Only			see above
463	1490	3	325A	Classroom 325 Closet	W1	Plaster	2/13/20	2/13/20	2/13/20	2/13/20		2/18/20	150	4	N/A	No	N/A	Entire closet treated as single containment/work area.
464	1490	3	325A	Classroom 325 Closet	W1	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
465	1490	3	325A	Classroom 325 Closet	W2	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
466	1490	3	325A	Classroom 325 Closet	W2	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
467	1490	3	325A	Classroom 325 Closet	W3	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
468	1490	3	325A	Classroom 325 Closet	W3	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
469	1490	3	325A	Classroom 325 Closet	W4	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
470	1490	3	325A	Classroom 325 Closet	W4	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
471	1490	3	325A	Classroom 325 Closet	Ceiling	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
472	1490	3	S37	Stairwell M (near Classroom 326)	W1	Plaster	Prior	N/A	8/3/2019	8/10/2019	N/A	8/11/2019	80	2	1	No		Not Child Occupied; colormetric not required
473	1490	3	S37	Stairwell M (near Classroom 326)	W1	Plaster	Prior	N/A	8/3/2019	8/10/2019	N/A	8/11/2019	See Above	See Above	See Above	No		see above
474	1490	3	S37	Stairwell M (near Classroom 326)	W2	Plaster	Prior	N/A	8/3/2019	8/10/2019	N/A	8/11/2019	See Above	See Above	See Above	No		see above
475	1490	3	S37	Stairwell M (near Classroom 326)	W2	Plaster	Prior	N/A	8/3/2019	8/10/2019	N/A	8/11/2019	See Above	See Above	See Above	No		see above
476	1490	3	S37	Stairwell M (near Classroom 326)	W3	Plaster	Prior	N/A	8/3/2019	8/10/2019	N/A	8/11/2019	See Above	See Above	See Above	No		see above
477	1490	3	S37	Stairwell M (near Classroom 326)	W4	Plaster	Prior	N/A	8/3/2019	8/10/2019	N/A	8/11/2019	See Above	See Above	See Above	No		see above
478	1490	3	S37	Stairwell M (near Classroom 326)	W4	Plaster	Prior	N/A	8/3/2019	8/10/2019	N/A	8/11/2019	See Above	See Above	See Above	No		see above
479	1490	3	326	Classroom 326	W1	Plaster	Prior	Prior	8/1/2019	8/5/2019	8/8/19	8/5/2019	768	22	RRP Only	n/a		Not Child Occupied; colormetric not required
480	1490	3	326	Classroom 326	W3	Plaster	Prior	Prior	8/1/19	8/5/2019	8/8/19	8/5/2019	see above	see above	RRP Only	n/a		see above
481	1490	3	326	Classroom 326	W4	Plaster	Prior	Prior	8/1/19	8/5/2019	8/8/19	8/5/2019	see above	see above	RRP Only	n/a		see above
482	1490	3	326	Classroom 326	Ceiling	Plaster	Prior	Prior	8/1/19	8/5/2019	8/8/19	8/5/2019	see above	see above	RRP Only	n/a		see above



Rudolph Blankenburg ES Oversight																		
H	ULCS#	F l o o r	Space # (on Floor Plan)	On Site Room Name	Primary Component	Substrate Material	Pre-Cleaning Completed (date)	Contents Moved (date)	Work Area Prepped (date)	Surfaces Stabilized (date)	Contents Back in Place (date)	Final Inspection Approval and Photos (date)	Square Footage of Work Area	Number of Required RRP Wipes	Number of Colorimetric Wipes Used to Pass	Final Colorimetric Wipe Submitted for AAS Analysis (yes/no)	AAS Analysis Results	Comments from Oversight
533	1490	B	H01	Hallway from Boy's Restroom to Classroom 29	W2	Brick	N/A	N/A	8/10/2019	8/10/2019	N/A	8/14/2019	See Above	See Above	n/a	n/a		see above
534	1490	B	H01	Hallway from Boy's Restroom to Classroom 29	W2	N/A	N/A	N/A	8/10/2019	8/10/2019	N/A	8/14/2019	See Above	See Above	n/a	n/a		
535	1490	B	H01	Hallway from Boy's Restroom to Classroom 29	W3	Brick	N/A	N/A	8/10/2019	8/10/2019	N/A	8/14/2019	See Above	See Above	n/a	n/a		
536	1490	B	H01	Hallway from Boy's Restroom to Classroom 29	W4	Brick	N/A	N/A	8/10/2019	8/10/2019	N/A	8/14/2019	See Above	See Above	n/a	n/a		
537	1490	B	H01	Hallway from Boy's Restroom to Classroom 29	Ceiling	Concrete	N/A	N/A	8/10/2019	8/10/2019	N/A	8/14/2019	See Above	See Above	n/a	n/a		
538	1490	B	H01	Hallway from Boy's Restroom to Classroom 29	Ceiling	N/A	N/A	N/A	8/10/2019	8/10/2019	N/A	8/14/2019	See Above	See Above	n/a	n/a		
539	1490	B	H01	Hallway from Boy's Restroom to Classroom 29	Floor	N/A	N/A	N/A	8/10/2019	8/10/2019	N/A	8/14/2019	See Above	See Above	n/a	n/a		
540	1490	B	H03	Hallway from Girl's Restroom to Classroom 30	W1	Brick	N/A	N/A	8/10/2019	8/10/2019	N/A	8/14/2019	680	17	n/a	n/a		Not Child Occupied; colormetric not required
541	1490	B	H03	Hallway from Girl's Restroom to Classroom 30	W3	Brick	N/A	N/A	8/10/2019	8/10/2019	N/A	8/14/2019	See Above	See Above	n/a	n/a		see above
542	1490	B	H03	Hallway from Girl's Restroom to Classroom 30	W3	N/A	N/A	N/A	8/10/2019	8/10/2019	N/A	8/14/2019	See Above	See Above	n/a	n/a		see above
543	1490	B	H03	Hallway from Girl's Restroom to Classroom 30	Ceiling	Concrete	N/A	N/A	8/10/2019	8/10/2019	N/A	8/14/2019	See Above	See Above	n/a	n/a		see above
544	1490	B	H03	Hallway from Girl's Restroom to Classroom 30	Ceiling	N/A	N/A	N/A	8/10/2019	8/10/2019	N/A	8/14/2019	See Above	See Above	n/a	n/a		see above
545	1490	B	S08	Stairwell adjacent to Classroom 30	W1	Plaster	N/A	N/A	8/11/2019	8/11/2019	N/A	8/14/2019	80	2	n/a	n/a		Not Child Occupied; colormetric not required
546	1490	B	S08	Stairwell adjacent to Classroom 30	W2	Plaster	N/A	N/A	8/11/2019	8/11/2019	N/A	8/14/2019	See Above	See Above	n/a	n/a		see above
547	1490	B	S08	Stairwell adjacent to Classroom 30	W2	Plaster	N/A	N/A	8/11/2019	8/11/2019	N/A	8/14/2019	See Above	See Above	n/a	n/a		see above
548	1490	B	S08	Stairwell adjacent to Classroom 30	W4	Plaster	N/A	N/A	8/11/2019	8/11/2019	N/A	8/14/2019	See Above	See Above	n/a	n/a		see above
549	1490	B	S07	Stairwell adjacent to Classroom 29	W2	N/A	N/A	N/A	8/11/2019	8/11/2019	N/A	8/14/2019	80	2	n/a	n/a		Not Child Occupied; colormetric not required
550	1490	B	S07	Stairwell adjacent to Classroom 29	W4	Plaster	N/A	N/A	8/11/2019	8/11/2019	N/A	8/14/2019	See Above	See Above	n/a	n/a		see above
551	1490	B	S07	Stairwell adjacent to Classroom 29	W4	N/A	N/A	N/A	8/11/2019	8/11/2019	N/A	8/14/2019	See Above	See Above	n/a	n/a		see above
552	1490	B	S07	Stairwell adjacent to Classroom 29	Ceiling	Plaster	N/A	N/A	8/11/2019	8/11/2019	N/A	8/14/2019	See Above	See Above	n/a	n/a		see above
553	1490	B	S07	Stairwell adjacent to Classroom 29	Floor	N/A	N/A	N/A	8/11/2019	8/11/2019	N/A	8/14/2019	See Above	See Above	n/a	n/a		see above
554	1490	B	S07	Stairwell adjacent to Classroom 29	Floor	N/A	N/A	N/A	8/11/2019	8/11/2019	N/A	8/14/2019	See Above	See Above	n/a	n/a		see above
555	1490	B	S02	Stairwell adjacent to Boy's Restroom	W2	Brick	Prior	N/A	8/13/2019	8/15/2019	N/A	8/15/2019	68	2	n/a	n/a		Not Child Occupied; colormetric not required
556	1490	B	S02	Stairwell adjacent to Boy's Restroom	W3	Brick	Prior	N/A	8/13/2019	8/15/2019	N/A	8/15/2019	See Above	See Above	n/a	n/a		see above
557	1490	B	S02	Stairwell adjacent to Boy's Restroom	Ceiling	Plaster	Prior	N/A	8/13/2019	8/15/2019	N/A	8/15/2019	See Above	See Above	n/a	n/a		see above
558	1490	B	S02	Stairwell adjacent to Boy's Restroom	Floor	N/A	Prior	N/A	8/13/2019	8/15/2019	N/A	8/15/2019	See Above	See Above	n/a	n/a		see above
559	1490	B	S02A	Landing Area to outside exit near Boy's Restroom	W1	Plaster	Prior	N/A	8/13/2019	8/14/2019	N/A	8/15/2019	50	2	n/a	n/a		Not Child Occupied; colormetric not required
560	1490	B	S02A	Landing Area to outside exit near Boy's Restroom	W2	Plaster	Prior	N/A	8/13/2019	8/14/2019	N/A	8/15/2019	See Above	See Above	n/a	n/a		see above
561	1490	B	S02A	Landing Area to outside exit near Boy's Restroom	W3	Plaster	Prior	N/A	8/13/2019	8/14/2019	N/A	8/15/2019	See Above	See Above	n/a	n/a		see above
562	1490	B	S02A	Landing Area to outside exit near Boy's Restroom	W4	Plaster	Prior	N/A	8/13/2019	8/14/2019	N/A	8/15/2019	See Above	See Above	n/a	n/a		see above
563	1490	B	S02A	Landing Area to outside exit near Boy's Restroom	Ceiling	Plaster	Prior	N/A	8/13/2019	8/14/2019	N/A	8/15/2019	See Above	See Above	n/a	n/a		see above
564	1490	B	S01	Stairwell adjacent to Girl's Restroom	Floor	N/A	Prior	n/a	8/13/2019	8/15/2019	N/A	8/15/2019	68	2	n/a	n/a		Not Child Occupied; colormetric not required
565	1490	B	S01A	Landing Area to outside exit near Girl's Restroom	W1	Plaster	Prior	n/a	8/13/2019	8/15/2019	N/A	8/15/2019	50	2	n/a	n/a		Not Child Occupied; colormetric not required
566	1490	B	S01A	Landing Area to outside exit near Girl's Restroom	W1	N/A	Prior	n/a	8/13/2019	8/15/2019	N/A	8/15/2019	see above	see above	n/a	n/a		see above
567	1490	B	S01A	Landing Area to outside exit near Girl's Restroom	W2	Plaster	Prior	n/a	8/13/2019	8/15/2019	N/A	8/15/2019	see above	see above	n/a	n/a		see above
568	1490	B	S01A	Landing Area to outside exit near Girl's Restroom	W3	Plaster	Prior	n/a	8/13/2019	8/15/2019	N/A	8/15/2019	see above	see above	n/a	n/a		see above
569	1490	B	S01A	Landing Area to outside exit near Girl's Restroom	W4	Plaster	Prior	n/a	8/13/2019	8/15/2019	N/A	8/15/2019	see above	see above	n/a	n/a		see above
570	1490	B	S01A	Landing Area to outside exit near Girl's Restroom	Ceiling	Plaster	Prior	n/a	8/13/2019	8/15/2019	N/A	8/15/2019	see above	see above	n/a	n/a		see above
571	1490	B	001B	Girl's Restroom	Ceiling	Concrete	Prior	n/a	8/9/2019	8/13/2019	N/A	8/13/2019	150	4	2	yes	< 10 µg/ft2	
572	1490	B	31	IMC (Library)	W1	Plaster	N/A	8/9/2019	8/10/2019	8/14/2019		8/14/2019	1360	33	4	yes	156.31 µg/ft2, < 10 µg/ft2	
573	1490	B	31	IMC (Library)	W2	Plaster	N/A	8/9/2019	8/10/2019	8/14/2019		8/14/2019	See Above	See Above	See Above	See Above	See Above	
574	1490	B	31	IMC (Library)	W3	Plaster	N/A	8/9/2019	8/10/2019	8/14/2019		8/14/2019	See Above	See Above	See Above	See Above	See Above	
575	1490	B	31	IMC (Library)	Ceiling	Plaster	N/A	8/9/2019	8/10/2019	8/14/2019		8/14/2019	See Above	See Above	See Above	See Above	See Above	
576	1490	B	31	IMC (Library)	Floor	N/A	N/A	8/9/2019	8/10/2019	8/14/2019		8/14/2019	See Above	See Above	See Above	See Above	See Above	
577	1490	B	002B	IMC (Library) Office	W1	Plaster	N/A	8/9/2019	8/10/2019	8/14/2019		8/14/2019	120	7	n/a	n/a		Not Child Occupied; colormetric not required
578	1490	B	002B	IMC (Library) Office	W2	Plaster	N/A	8/9/2019	8/10/2019	8/14/2019		8/14/2019	See Above	See Above	n/a	n/a		see above
579	1490	B	002B	IMC (Library) Office	W3	Plaster	N/A	8/9/2019	8/10/2019	8/14/2019		8/14/2019	See Above	See Above	n/a	n/a		
580	1490	B	002B	IMC (Library) Office	Ceiling	Plaster	N/A	8/9/2019	8/10/2019	8/14/2019		8/14/2019	See Above	See Above	n/a	n/a		

Rudolph Blankenburg ES Oversight																		
H	ULCS#	Floor	Space # (on Floor Plan)	On Site Room Name	Primary Component	Substrate Material	Pre-Cleaning Completed (date)	Contents Moved (date)	Work Area Prepped (date)	Surfaces Stabilized (date)	Contents Back in Place (date)	Final Inspection Approval and Photos (date)	Square Footage of Work Area	Number of Required RRP Wipes	Number of Colorimetric Wipes Used to Pass	Final Colorimetric Wipe Submitted for AAS Analysis (yes/no)	AAS Analysis Results	Comments from Oversight
581	1490	B	003B	IMC (Library) Storage	W1	Plaster	N/A	8/9/2019	8/10/2019	8/14/2019		8/14/2019	See Above	See Above	n/a	n/a		Not Child Occupied; colormetric not required
582	1490	B	003B	IMC (Library) Storage	W2	Plaster	N/A	8/9/2019	8/10/2019	8/14/2019		8/14/2019	60	2	n/a	n/a		see above
583	1490	B	003B	IMC (Library) Storage	W4	Plaster	N/A	8/9/2019	8/10/2019	8/14/2019		8/14/2019	See Above	See Above	n/a	n/a		
584	1490	B	030	Classroom 30	W1	Plaster	prior	prior	8/9/2019	8/14/2019	n/a	8/14/2019	768	22	3	yes	< 10 µg/ft2	
585	1490	B	030	Classroom 30	W1	Plaster	prior	prior	8/9/2019	8/14/2019	n/a	8/14/2019	See Above	See Above	See Above	See Above	see above	
586	1490	B	030	Classroom 30	W1	N/A	prior	prior	8/9/2019	8/14/2019	n/a	8/14/2019	See Above	See Above	See Above	See Above	see above	
587	1490	B	030	Classroom 30	W2	Plaster	prior	prior	8/9/2019	8/14/2019	n/a	8/14/2019	See Above	See Above	See Above	See Above	see above	
588	1490	B	030	Classroom 30	W2	Plaster	prior	prior	8/9/2019	8/14/2019	n/a	8/14/2019	See Above	See Above	See Above	See Above	see above	
589	1490	B	030	Classroom 30	W2	N/A	prior	prior	8/9/2019	8/14/2019	n/a	8/14/2019	See Above	See Above	See Above	See Above	see above	
590	1490	B	030	Classroom 30	W3	Plaster	prior	prior	8/9/2019	8/14/2019	n/a	8/14/2019	See Above	See Above	See Above	See Above	see above	
591	1490	B	030	Classroom 30	W3	Plaster	prior	prior	8/9/2019	8/14/2019	n/a	8/14/2019	See Above	See Above	See Above	See Above	see above	
592	1490	B	030	Classroom 30	W4	Plaster	prior	prior	8/9/2019	8/14/2019	n/a	8/14/2019	See Above	See Above	See Above	See Above	see above	
593	1490	B	030	Classroom 30	W4	Plaster	prior	prior	8/9/2019	8/14/2019	n/a	8/14/2019	See Above	See Above	See Above	See Above	see above	
594	1490	B	030	Classroom 30	Ceiling	Plaster	prior	prior	8/9/2019	8/14/2019	n/a	8/14/2019	See Above	See Above	See Above	See Above	see above	
595	1490	B	030B	Classroom 30 Closet #1	W1	Plaster	Addressed later - see row 829	Addressed later - see row 829	Addressed later - see row 829	Addressed later - see row 829	Addressed later - see row 829	Addressed later - see row 829	Addressed later - see row 829	Addressed later - see row 829	Addressed later - see row 829	Addressed later - see row 829	Addressed later - see row 829	
596	1490	B	030B	Classroom 30 Closet #1	W2	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	
597	1490	B	030B	Classroom 30 Closet #1	W3	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	
598	1490	B	030B	Classroom 30 Closet #1	Ceiling	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	
599	1490	B	030A	Classroom 30 Closet #2	W1	Plaster	Addressed later - see row 825	Addressed later - see row 825	Addressed later - see row 825	Addressed later - see row 825	Addressed later - see row 825	Addressed later - see row 825	Addressed later - see row 825	Addressed later - see row 825	Addressed later - see row 825	Addressed later - see row 825	Addressed later - see row 825	
600	1490	B	030A	Classroom 30 Closet #2	W2	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	
601	1490	B	030A	Classroom 30 Closet #2	W3	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	
602	1490	B	030A	Classroom 30 Closet #2	W4	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	
603	1490	B	030A	Classroom 30 Closet #2	Ceiling	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	
604	1490	B	11B	Classroom 27	W1	Brick	Prior	N/A	8/12/2019	8/14/2019	N/A	8/14/2019	400	13	3	yes	< 10 µg/ft2	
605	1490	B	11B	Classroom 27	W2	Brick	Prior	N/A	8/12/2019	8/14/2019	N/A	8/14/2019	See above	See above	See above	See above	see above	
606	1490	B	11B	Classroom 27	W3	Brick	Prior	N/A	8/12/2019	8/14/2019	N/A	8/14/2019	See above	See above	See above	See above	see above	
607	1490	B	11B	Classroom 27	W4	Brick	Prior	N/A	8/12/2019	8/14/2019	N/A	8/14/2019	See above	See above	See above	See above	see above	
608	1490	B	11B	Classroom 27	Ceiling	Plaster	Prior	N/A	8/12/2019	8/14/2019	N/A	8/14/2019	See above	See above	See above	See above	see above	
609	1490	B	11B	Classroom 27	Ceiling	N/A	Prior	N/A	8/12/2019	8/14/2019	N/A	8/14/2019	See above	See above	See above	See above	see above	
610	1490	B	11C	Office in Classroom 27	W2	N/A	Addressed later - see row 713	Addressed later - see row 713	Addressed later - see row 713	Addressed later - see row 713	Addressed later - see row 713	Addressed later - see row 713	Addressed later - see row 713	Addressed later - see row 713	Addressed later - see row 713	Addressed later - see row 713	Addressed later - see row 713	
611	1490	B	028	Classroom 29	W1	Plaster	Prior	N/A	8/12/2019	8/14/2019	n/a	8/14/2019	660	19	3	yes	< 10 µg/ft2	
612	1490	B	028	Classroom 29	W2	Plaster	Prior	N/A	8/12/2019	8/14/2019	N/A	8/14/2019	See above	See above	See above	See above	see above	
613	1490	B	028	Classroom 29	W3	Plaster	Prior	N/A	8/12/2019	8/14/2019	N/A	8/14/2019	See above	See above	See above	See above	see above	
614	1490	B	028	Classroom 29	W4	Plaster	Prior	N/A	8/12/2019	8/14/2019	N/A	8/14/2019	See above	See above	See above	See above	see above	
615	1490	B	028	Classroom 29	Ceiling	Plaster	Prior	N/A	8/12/2019	8/14/2019	N/A	8/14/2019	See above	See above	See above	See above	see above	
	1490	B	028A	Kitchen	W1	Plaster	Prior	N/A	8/12/2019	8/14/2019	N/A	8/14/2019	792	20	n/a	n/a		
	1490	B	028A	Kitchen	W2	Plaster	Prior	N/A	8/12/2019	8/14/2019	N/A	8/14/2019	See Above	See Above	n/a	n/a		
	1490	B	028A	Kitchen	W3	Plaster	Prior	N/A	8/12/2019	8/14/2019	N/A	8/14/2019	See Above	See Above	n/a	n/a		
	1490	B	028A	Kitchen	W4	Plaster	Prior	N/A	8/12/2019	8/14/2019	N/A	8/14/2019	See Above	See Above	n/a	n/a		
	1490	B	028A	Kitchen	Ceiling	Plaster	Prior	N/A	8/12/2019	8/14/2019	N/A	8/14/2019	See Above	See Above	n/a	n/a		
	1490	B	12B	Gymnasium	W1	Brick	prior	prior	8/3/2019	8/29/2019	N/A	8/19/2019	3680	92	9	yes	< 10 µg/ft2	Workers return and finish necessary work for passing inspection 8/19/2019 - NR
	1490	B	12B	Gymnasium	W1	Glazed Block	Prior	Prior	8/3/2019	8/4/2019	N/A	8/19/2019	See Above	See Above	2	No	see above	Will need to return to the area at a later time to finish work, due to summer camp occupying the space during the week - JM 8/4/2019
	1490	B	12B	Gymnasium	W3	Brick	Prior	Prior	8/3/2019	8/4/2019	N/A	8/19/2019	See Above	See Above	See Above	See Above	see above	Will need to return to the area at a later time to finish work, due to summer camp occupying the space during the week - JM 8/4/2019
	1490	B	12B	Gymnasium	Ceiling	Plaster	Prior	Prior	8/3/2019	8/4/2019	N/A	8/19/2019	See Above	See Above	See Above	See Above	see above	Will need to return to the area at a later time to finish work, due to summer camp occupying the space during the week - JM 8/4/2019
	1490	B	12B	Gymnasium	Ceiling	Plaster	Prior	Prior	8/3/2019	8/4/2019	N/A	8/19/2019	See Above	See Above	See Above	See Above	see above	Will need to return to the area at a later time to finish work, due to summer camp occupying the space during the week - JM 8/4/2019

Rudolph Blankenburg ES Oversight																		
H	ULCS#	Floor	Space # (on Floor Plan)	On Site Room Name	Primary Component	Substrate Material	Pre-Cleaning Completed (date)	Contents Moved (date)	Work Area Prepped (date)	Surfaces Stabilized (date)	Contents Back in Place (date)	Final Inspection Approval and Photos (date)	Square Footage of Work Area	Number of Required RRP Wipes	Number of Colorimetric Wipes Used to Pass	Final Colorimetric Wipe Submitted for AAS Analysis (yes/no)	AAS Analysis Results	Comments from Oversight
	1490	B	12B	Gymnasium	Ceiling	N/A	Prior	Prior	8/3/2019	8/4/2019	N/A	8/19/2019	See Above	See Above	See Above	See Above	see above	Will need to return to the area at a later time to finish work, due to summer camp occupying the space during the week - JM 8/4/2019
	1490	B	13B	Gymnasium Office	W2	N/A	Prior	Prior	8/3/2019	8/19/2019	N/A	8/19/2019	288	7	1	no	n/a	Will need to return to the area at a later time to finish work, due to summer camp occupying the space during the week - JM 8/4/2019
	1490	B	13B	Gymnasium Office	W3	Brick	prior	8/8/2019	8/13/19	8/19/2019	N/A	8/19/2019	see above	See Above	See Above	See Above	See Above	
	1490	B	13B	Gymnasium Office	W4	Brick	prior	8/8/2019	8/13/19	8/19/2019	N/A	8/19/2019	see above	See Above	See Above	See Above	See Above	
	1490	B	13B	Gymnasium Office	Ceiling	Plaster	prior	8/8/2019	8/13/19	8/19/2019	N/A	8/19/2019	see above	See Above	See Above	See Above	See Above	
	1490	B	14B	Gymnasium Storage Room	W1	Brick	prior	8/8/2019	8/13/19	8/19/2019	N/A	8/19/2019	288	7	See Above	See Above	See Above	
	1490	B	14B	Gymnasium Storage Room	W3	Brick	prior	8/8/2019	8/13/19	8/19/2019	N/A	8/19/2019	see above	See Above	See Above	See Above	See Above	
	1490	B	14B	Gymnasium Storage Room	W4	Brick	prior	8/8/2019	8/13/19	8/19/2019	N/A	8/19/2019	see above	See Above	See Above	See Above	See Above	
	1490	B	010B	Boy's Restroom	W1	Plaster	prior	n/a	8/13/19	8/15/2019	n/a	8/15/2019	360	9	2	yes	< 10 µg/ft2	
	1490	B	010B	Boy's Restroom	W2	Plaster	prior	n/a	8/13/19	8/15/2019	n/a	8/15/2019	see above	see above	see above	see above	see above	
	1490	B	010B	Boy's Restroom	W3	Plaster	prior	n/a	8/13/19	8/15/2019	n/a	8/15/2019	see above	see above	see above	see above	see above	
	1490	B	010B	Boy's Restroom	W4	Plaster	prior	n/a	8/13/19	8/15/2019	n/a	8/15/2019	see above	see above	see above	see above	see above	
	1490	B	010B	Boy's Restroom	Ceiling	Concrete	prior	n/a	8/13/19	8/15/2019	n/a	8/15/2019	see above	see above	see above	see above	see above	
New	1490	1	102K	Classroom K1 Closet	W1	Plaster	Prior	1/9/20	1/9/20	1/9/20	1/15/20	1/10/20	50	2	Initial 1 Pass, Retest: 1 Pass	Yes	Initial: 15.42 µg/ft2 Retest: < 5 µg/ft2	Entire Storage closet treated as single work area/containment. Initial FAAS failed re-cleaned and retested.
New	1490	1	102K	Classroom K1 Closet	W2	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
New	1490	1	102K	Classroom K1 Closet	W3	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
New	1490	1	102K	Classroom K1 Closet	W4	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
New	1490	1	102K	Classroom K1 Closet	W4	N/A	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
New	1490	1	102K	Classroom K1 Closet	Ceiling	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
New	1490	1	101KA	Classroom K1 Teacher's Closet (in front of room)	W1	Plaster	2/3/20 (NON-RRP)	2/3/20 (NON-RRP)	2/3/20 (NON-RRP)	2/3/20 (NON-RRP)	2/3/20 (NON-RRP)	2/3/20 (NON-RRP)	2/3/20 (NON-RRP)	2/3/20 (NON-RRP)	2/3/20 (NON-RRP)	2/3/20 (NON-RRP)	2/3/20 (NON-RRP)	No Scraping required. Strictly Painting (NON-RRP)
New	1490	1	101KA	Classroom K1 Teacher's Closet (in front of room)	W2	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
New	1490	1	101KA	Classroom K1 Teacher's Closet (in front of room)	W3	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
New	1490	1	101KA	Classroom K1 Teacher's Closet (in front of room)	W4	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
New	1490	1	101KA	Classroom K1 Teacher's Closet (in front of room)	Ceiling	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
New	1490	1	107B	Classroom 107 Closet	W1	Plaster	2/12/2020	2/12/2020	2/12/2020	2/12/2020	2/13/2020	2/12/20	150	4	N/A	No	N/A	Entire closet treated as single work area/containment
New	1490	1	107B	Classroom 107 Closet	W1	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
New	1490	1	107B	Classroom 107 Closet	W2	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
New	1490	1	107B	Classroom 107 Closet	W2	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
New	1490	1	107B	Classroom 107 Closet	W3	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
New	1490	1	107B	Classroom 107 Closet	W3	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
New	1490	1	107B	Classroom 107 Closet	W4	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
New	1490	1	107B	Classroom 107 Closet	W4	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
New	1490	1	107B	Classroom 107 Closet	Ceiling	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
New	1490	1	102A	Principal's Office	W1	Plaster	3/6/20	3/6/20	3/6/20	3/6/20	3/6/20	3/6/20	150	4	1	Yes	< 5 µg/ft2	Entire office treated as single work area/containment. Contents condensed and covered. Minimal scraping
New	1490	1	102A	Principal's Office	W2	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
New	1490	1	102A	Principal's Office	W3	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
New	1490	1	102A	Principal's Office	W4	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
New	1490	1	102A	Principal's Office	Ceiling	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
New	1490	1	102E	Principal's Restroom	W4	Plaster	3/6/20	3/6/20	3/6/20	3/6/20	3/7/20	3/7/20	40	1	N/A	No	N/A	Entire Storage restroom treated as single work area/containment.
New	1490	1	102E	Principal's Restroom	Ceiling	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
New	1490	3	323A	Classroom 323 Closet	W1	Plaster	1/15/20	1/15/20	1/15/20	1/15/20	1/15/20	1/15/20	150	4	N/A	No	N/A	Entire Storage closet and mini-closets inside main closets treated as single work area/containment.
New	1490	3	323A	Classroom 323 Closet	W2	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
New	1490	3	323A	Classroom 323 Closet	W3	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
New	1490	3	323A	Classroom 323 Closet	W4	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
New	1490	3	323A	Classroom 323 Closet	Ceiling	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
New	1490	3	322B	Classroom 322 - Closet inside Main Closet (near Main Entrance to Classroom)	W1	Plaster	1/13/20	1/13/20	1/13/20	1/13/20	1/13/20	1/13/20	150	4	N/A	No	N/A	Entire Storage closet treated as single work area/containment.

Rudolph Blankenburg ES Oversight																		
H	ULCS#	Floor	Space # (on Floor Plan)	On Site Room Name	Primary Component	Substrate Material	Pre-Cleaning Completed (date)	Contents Moved (date)	Work Area Prepped (date)	Surfaces Stabilized (date)	Contents Back in Place (date)	Final Inspection Approval and Photos (date)	Square Footage of Work Area	Number of Required RRP Wipes	Number of Colorimetric Wipes Used to Pass	Final Colorimetric Wipe Submitted for AAS Analysis (yes/no)	AAS Analysis Results	Comments from Oversight
New	1490	3	322B	Classroom 322 - Closet inside Main Closet (near Main Entrance to Classroom)	W2	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
New	1490	3	322B	Classroom 322 - Closet inside Main Closet (near Main Entrance to Classroom)	W3	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
New	1490	3	322B	Classroom 322 - Closet inside Main Closet (near Main Entrance to Classroom)	W4	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
New	1490	3	322B	Classroom 322 - Closet inside Main Closet (near Main Entrance to Classroom)	Ceiling	Wood	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
New	1490	3	322C	Classroom 322 - Closet inside Main Closet (near rear of Classroom)	W1	Plaster	1/13/20	1/13/20	1/13/20	1/13/20	1/13/20	1/13/20	150	4	N/A	No	N/A	Entire Storage closet treated as single work area/containment.
New	1490	3	322C	Classroom 322 - Closet inside Main Closet (near rear of Classroom)	W2	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
New	1490	3	322C	Classroom 322 - Closet inside Main Closet (near rear of Classroom)	W3	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
New	1490	3	322C	Classroom 322 - Closet inside Main Closet (near rear of Classroom)	W4	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
New	1490	3	322C	Classroom 322 - Closet inside Main Closet (near rear of Classroom)	Ceiling	Wood	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
New	1490	3	324B	Classroom 324 Teacher Closet inside Main Closet	W1	Plaster	1/13/20	1/13/20	1/13/20	1/13/20	1/13/20	1/13/20	150	4	N/A	No	N/A	Entire Storage closet and mini-closets inside main closets treated as single work area/containment.
New	1490	3	324B	Classroom 324 Teacher Closet inside Main Closet	W2	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
New	1490	3	324B	Classroom 324 Teacher Closet inside Main Closet	W3	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
New	1490	3	324B	Classroom 324 Teacher Closet inside Main Closet	W4	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
New	1490	3	324B	Classroom 324 Teacher Closet inside Main Closet	Ceiling	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
New	1490	3	320B	Classroom 320 Teacher Closet inside Main Closet	W1	Plaster	1/15/20	1/15/20	1/15/20	1/15/20	1/15/20	1/15/20	150	4	N/A	No	N/A	Entire Storage closet and mini-closets inside main closets treated as single work area/containment.
New	1490	3	320B	Classroom 320 Teacher Closet inside Main Closet	W2	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
New	1490	3	320B	Classroom 320 Teacher Closet inside Main Closet	W3	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
New	1490	3	320B	Classroom 320 Teacher Closet inside Main Closet	W4	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
New	1490	3	320B	Classroom 320 Teacher Closet inside Main Closet	Ceiling	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
New	1490	3	328B	Classroom 328 Closet	W1	Plaster	1/15/20-1/16/20	1/16/20	1/16/20	1/16/20	1/16/20	1/16/20	150	4	N/A	No	N/A	Entire Closet treated as single work area/containment. Extensive damage.
New	1490	3	328B	Classroom 328 Closet	W2	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
New	1490	3	328B	Classroom 328 Closet	W3	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
New	1490	3	328B	Classroom 328 Closet	W4	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
New	1490	3	328B	Classroom 328 Closet	Ceiling	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
New	1490	B	H03A	Hallway Closet next to Classroom 30	W1	Brick	2/20/20	2/20/20	2/20/20	2/20/20	2/24/20	2/20/20	100	3	N/A	No	N/A	Entire Closet treated as single work area/containment.
New	1490	B	H03A	Hallway Closet next to Classroom 30	W2	Brick	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
New	1490	B	H03A	Hallway Closet next to Classroom 30	W3	Brick	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
New	1490	B	H03A	Hallway Closet next to Classroom 30	W4	Brick	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
New	1490	B	H03A	Hallway Closet next to Classroom 30	Ceiling	N/A	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
New	1490	B	028D	Classroom 29 - Rear Closet	W1	Plaster	Criterion not on site for renovations	N/A see notes	N/A see notes	N/A see notes	N/A see notes	8/13/20	N/A see notes	N/A see notes	1	Yes	< 5 µg/ft2	Criterion was not on site for renovations. Only final visual and testing.
New	1490	B	028D	Classroom 29 - Rear Closet	W2	Plaster	Criterion not on site for renovations	N/A see notes	N/A see notes	N/A see notes	N/A see notes	see above	N/A see notes	N/A see notes	N/A see notes	Yes	N/A see notes	see above
New	1490	B	028D	Classroom 29 - Rear Closet	W3	Plaster	Criterion not on site for renovations	N/A see notes	N/A see notes	N/A see notes	N/A see notes	see above	N/A see notes	N/A see notes	N/A see notes	Yes	N/A see notes	see above
New	1490	B	028D	Classroom 29 - Rear Closet	W4	Plaster	Criterion not on site for renovations	N/A see notes	N/A see notes	N/A see notes	N/A see notes	see above	N/A see notes	N/A see notes	N/A see notes	Yes	N/A see notes	see above
New	1490	B	028D	Classroom 29 - Rear Closet	Ceiling	Plaster	Criterion not on site for renovations	N/A see notes	N/A see notes	N/A see notes	N/A see notes	see above	N/A see notes	N/A see notes	N/A see notes	Yes	N/A see notes	see above
New	1490	B	028E	Classroom 29 - Front Closet	W1	Plaster	Criterion not on site for renovations	N/A see notes	N/A see notes	N/A see notes	N/A see notes	8/13/20	N/A see notes	N/A see notes	1	Yes	7.25 µg/ft2	Criterion was not on site for renovations. Only final visual and testing.
New	1490	B	028E	Classroom 29 - Front Closet	W2	Plaster	Criterion not on site for renovations	N/A see notes	N/A see notes	N/A see notes	N/A see notes	see above	N/A see notes	N/A see notes	N/A see notes	Yes	N/A see notes	see above
New	1490	B	028E	Classroom 29 - Front Closet	W3	Plaster	Criterion not on site for renovations	N/A see notes	N/A see notes	N/A see notes	N/A see notes	see above	N/A see notes	N/A see notes	N/A see notes	Yes	N/A see notes	see above
New	1490	B	028E	Classroom 29 - Front Closet	W4	Plaster	Criterion not on site for renovations	N/A see notes	N/A see notes	N/A see notes	N/A see notes	see above	N/A see notes	N/A see notes	N/A see notes	Yes	N/A see notes	see above
New	1490	B	028E	Classroom 29 - Front Closet	Ceiling	White	Criterion not on site for renovations	N/A see notes	N/A see notes	N/A see notes	N/A see notes	see above	N/A see notes	N/A see notes	N/A see notes	Yes	N/A see notes	see above
New	1490	B	11B	Classroom 27	Ceiling	Plaster	Criterion not on site for renovations	N/A see notes	N/A see notes	N/A see notes	N/A see notes	8/13/20	N/A see notes	N/A see notes	3	Yes	< 5 µg/ft2	Criterion was not on site for renovations. Only final visual and testing.
New	1490	B	11C	Office in Classroom 27	W2	N/A	Criterion not on site for renovations	N/A see notes	N/A see notes	N/A see notes	N/A see notes	9/24/20	N/A see notes	N/A see notes	2	Yes	19.07 µg/ft2, 13.41 µg/ft2, < 5 µg/ft2, < 5 µg/ft2	Criterion was not on site for renovations. Only final visual and testing.
New	1490	B	028A	Kitchen	W1	Plaster	Prior	2/7/20	2/7/20	2/7/20		2/10/20	800	20	1	Yes	Initial: 15.31 µg/ft2 , Retest: < 5 µg/ft2	Initial FAAS failed. Recleaned on 2/10/20, retested, and passed.
New	1490	B	028A	Kitchen	W4	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
New	1490	B	001B	Girl's Restroom	Ceiling	Concrete	Prior	N/A	12/18	12/18/2019	N/A	12/18/2019	500	13	3	Yes	< 10 µg/ft2	3 separate work areas. Entire restroom was cleaned.
New	1490	B	002B	IMC (Library) Office	W2	Plaster	1/29/20	1/29/20	1/29/20	1/29/20	1/29/20	1/29/20	120	3	N/A	No	N/A	

Rudolph Blankenburg ES  
Oversight

H	ULCS#	F l o o r	Space # (on Floor Plan)	On Site Room Name	Primary Component	Substrate Material	Pre-Cleaning Completed (date)	Contents Moved (date)	Work Area Prepped (date)	Surfaces Stabilized (date)	Contents Back in Place (date)	Final Inspection Approval and Photos (date)	Square Footage of Work Area	Number of Required RRP Wipes	Number of Colorimetric Wipes Used to Pass	Final Colorimetric Wipe Submitted for AAS Analysis (yes/no)	AAS Analysis Results	Comments from Oversight
New	1490	B	003B	IMC (Library) Storage	W4	Plaster	Prior	2/18/20	2/18/20	2/18/20	Non-RRP (< 6 SF)	Non-RRP (< 6 SF)	Non-RRP (< 6 SF)	Non-RRP (< 6 SF)	Non-RRP (< 6 SF)	Non-RRP (< 6 SF)	Non-RRP (< 6 SF)	Non-RRP (< 6 SF)
New	1490	B	030	Classroom 30	W3	Plaster	Prior	1/28/20	1/28/20	1/28/20	1/28/20	1/28/20	200	5	1	Yes	< 5 µg/ft2	minimal damage. minimal scraping. Wall 3 baseboard detaching from wall (Fran Davis Conatacted Carpenter Foreman of this damage)
New	1490	B	H03	Hallway from Girl's Restroom to Classroom 30	Ceiling	N/A	Prior	2/7/20	2/7/20	2/9/20	2/9/20	2/9/20	500	13	N/A	No	N/A	
New	1490	B	H03	Hallway from Girl's Restroom to Classroom 30	Ceiling	Concrete	Prior	2/7/20	2/7/20	2/9/20	2/9/20	2/9/20	500	13	N/A	No	N/A	
New	1490	B	010B	Boy's Restroom	W1	Plaster	Prior	N/A	1/27/20, 1/28/20, 1/29/20	1/28/20	N/A	1/29/20	360	9	3	Yes	Initial: 131.85 µg/ft2 / Retest: 11.11 µg/ft2 / Retest: 7.47 µg/ft2	Very Minimal Scraping. Mainly spackle repair over areas previously scraped and spot primed (mostly tight with some areas popping). Preexisting Paint/Plaster chips, debris, and dust found above ducts and beams before painters began work in this bathroom (see photos). Painters cleaned this before turning room over. Entire restroom treated as single containment/work area. Work completed in increments since room had to be reopened for occupancy each day.
New	1490	B	010B	Boy's Restroom	W2	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
New	1490	B	010B	Boy's Restroom	W3	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
New	1490	B	010B	Boy's Restroom	Ceiling	Concrete	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
New	1490	B	H01	Hallway from Boy's Restroom to Classroom 29	W2	N/A	Prior	1/27/20	1/27/20	1/27/20	1/27/20	1/27/20	500	13	N/A	No	N/A	
New	1490	B	H02	Hallway along Gymnasium	Ceiling	Concrete	Prior	2/7/20	2/7/20	2/9/20	2/9/20	2/9/20	500	13	N/A	No	N/A	
New	1490	B	12B	Gymnasium	Ceiling	Plaster	Prior	Non-RRP	Non-RRP	Non-RRP	Non-RRP	2/9/20	Non-RRP	Non-RRP	Non-RRP	Non-RRP	Non-RRP	< 6 SF and strictly Spackle repair and paint (Non-RRP)
New	1490	B	13B	Gymnasium Office	W2	N/A	Prior	2/7/20	2/7/20	2/9/20	2/9/20	2/9/20	300	8	N/A	No	N/A	
New	1490	1	107A	Men's Restroom next to Classroom 107	W2	Plaster	Work completed prior to Criterion Oversight	Work completed prior to Criterion Oversight	Work completed prior to Criterion Oversight	Work completed prior to Criterion Oversight	Work completed prior to Criterion Oversight	Work completed prior to Criterion Oversight	Work completed prior to Criterion Oversight	Work completed prior to Criterion Oversight	Work completed prior to Criterion Oversight	Work completed prior to Criterion Oversight	Work completed prior to Criterion Oversight	Work completed prior to Criterion Oversight
New	1490	1	107	Classroom 107	W3	Plaster	2/28/20	2/28/20	2/28/20	2/28/20	2/28/20	2/28/20	40	1	N/A	No	N/A	Minimal damage and scraping at wall 3
New	1490	1	106	Classroom 106	W3	Plaster	Prior	2/6/20	2/6/20	2/6/20	2/6/20	2/6/20	80	2	N/A	No	N/A	Minimal damage and scraping at wall 3
New	1490	1	105	Classroom 105	W3	Plaster	2/28/20	2/28/20	2/28/20	2/28/20	2/28/20	2/28/20	240	6	N/A	No	N/A	Minimal damage and scraping at wall 3
New	1490	1	105A	Classroom 105 Closet	W1	Plaster	1/30/20	1/30/20	1/30/20	1/30/20	2/3/20	1/31/20	150	4	N/A	No	N/A	Entire Stodge closet treated as single containment/work area. Minimal Scraping required.
New	1490	1	105A	Classroom 105 Closet	W2	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
New	1490	1	105A	Classroom 105 Closet	W3	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
New	1490	1	105A	Classroom 105 Closet	W4	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
New	1490	1	105A	Classroom 105 Closet	Ceiling	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
New	1490	1	105B	Stationery Closet adjacent to Classroom 105	W2	Plaster	2/11/20	2/11/20	2/11/2020	2/11/20	2/12/20	2/11/20	50	2	N/A	No	N/A	Entire closet treated as single work area/containment
New	1490	1	105B	Stationery Closet adjacent to Classroom 105	W3	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
New	1490	1	105B	Stationery Closet adjacent to Classroom 105	W4	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
New	1490	1	105B	Stationery Closet adjacent to Classroom 105	Ceiling	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
New	1490	1	H14	Hallway from Classroom 105 to 107	Ceiling	Plaster	Prior	1/6/20	1/6/20	1/6/20	N/A	1/21/20	1000	25	N/A	No	N/A	Work completed in increments since hallways needed be cleaned and ready for reoccupancy each night.
New	1490	1	H14	Hallway from Classroom 105 to 107	W3	Plaster	Prior	1/6/20	1/6/20	1/6/20	N/A	1/21/20	1000	25	N/A	No	N/A	Work completed in increments since hallways needed be cleaned and ready for reoccupancy each night.
New	1490	1	104C	Boy's Restroom near Classroom K4	Ceiling	Plaster	Prior	N/A	1/9/20	1/9/20	N/A	1/9/20	150	4	1	Yes	Intial: 195.16 µg/ft2 / Retest: 27.04 µg/ft2 / Retest: 34.42 µg/ft2 / Retest: Retest:39.99 µg/ft2 / <b>Retest : &lt; 5 µg/ft2</b>	Minimal Scraping Required. Mainly Spackle touch up and painting. Intial FAAS test failed. Re-cleaned and retested. Failed a 2nd time. Re-cleaned and retested. F.A.C completed deep cleaning 1/28/20 and retested. Passed 1/29/20
New	1490	1	104	Classroom K4	Ceiling	Plaster	Prior	Non-RRP	Non-RRP	Non-RRP	Non-RRP	Non-RRP	Non-RRP	Non-RRP	Non-RRP	Non-RRP	Non-RRP	Non-RRP
New	1490	1	104	Classroom K4	W3	Plaster	see above	2/28/20	2/28/20	2/28/20	2/28/20	2/28/20	240	6	1	Yes	< 5 µg/ft2	
New	1490	1	H15	Hallway from Stairwell near Classroom K1 to Stairwell near Classroom K4	W4	Plaster	Prior	1/6/20, 1/7/20, 1/8/20, 1/9/20, 1/10/20, 1/17/20, 1/21/20, 2/7/20, 2/21/20	1/6/20, 1/7/20, 1/8/20, 1/9/20, 1/10/20, 1/17/20, 1/21/20, 2/7/20, 2/21/20	1/6/20, 1/7/20, 1/8/20, 1/9/20, 1/10/20, 1/17/20, 1/21/20, 2/7/20, 2/21/20	N/A	1/21/20	1000	25	N/A	No	N/A	Hallway done in incemerents since work areas had to be turned over every night. Work areas stablitzed and cleaned up at the end of every shift. Raditor covers removed 2/7/20 for stabilization work. Final inspection date reflects the date when the hallway was completed in its entirety.
New	1490	1	103D	Auditorium	Ceiling	Plaster	Prior	3/3/20	3/3/20	3/3/20	3/4/20	3/3/20	400	10	2	Yes	9.5 µg/ft2	Very minimal scraping required (6 SF total) Cracking paint near the stage and Flaking paint on beam in the rear of the Auditorium. Two separate work areas. Auditorium Ceiling was sampled 3/2/2020 prior to stabilization work (5 samples = NAD).

Rudolph Blankenburg ES  
Oversight

H	ULCS#	Floor	Space # (on Floor Plan)	On Site Room Name	Primary Component	Substrate Material	Pre-Cleaning Completed (date)	Contents Moved (date)	Work Area Prepped (date)	Surfaces Stabilized (date)	Contents Back in Place (date)	Final Inspection Approval and Photos (date)	Square Footage of Work Area	Number of Required RRP Wipes	Number of Colorimetric Wipes Used to Pass	Final Colorimetric Wipe Submitted for AAS Analysis (yes/no)	AAS Analysis Results	Comments from Oversight
New	1490	1	H16	Hallway along Classrooms 101 to 103 (to Custodial Closet)	Ceiling	Plaster	Prior	1/6/20, 1/7/20, 1/8/20, 1/9/20, 1/10/20, 1/17/20, 1/21/20, 2/7/20, 2/21/20	1/6/20, 1/7/20, 1/8/20, 1/9/20, 1/10/20, 1/17/20, 1/21/20, 2/7/20, 2/21/20	1/6/20, 1/7/20, 1/8/20, 1/9/20, 1/10/20, 1/17/20, 1/21/20, 2/7/20, 2/21/20	N/A	1/21/20	1000	25	N/A	No	N/A	Hallway done in incemerents since work areas had to be turned over every night. Work areas stablitzed and cleaned up at the end of every shift. Raditor covers removed 2/7/20 for stablization work. Final inspection date reflects the date when the hallway was completed in its entirety.
New	1490	1	H16	Hallway along Classrooms 101 to 103 (to Custodial Closet)	W3	Plaster	Prior	1/6/20, 1/7/20, 1/8/20, 1/9/20, 1/10/20, 1/17/20, 1/21/20, 2/7/20, 2/21/20	1/6/20, 1/7/20, 1/8/20, 1/9/20, 1/10/20, 1/17/20, 1/21/20, 2/7/20, 2/21/20	1/6/20, 1/7/20, 1/8/20, 1/9/20, 1/10/20, 1/17/20, 1/21/20, 2/7/20, 2/21/20	N/A	1/21/20	1000	25	N/A	No	N/A	Hallway done in incemerents since work areas had to be turned over every night. Work areas stablitzed and cleaned up at the end of every shift. Raditor covers removed 2/7/20 for stablization work. Final inspection date reflects the date when the hallway was completed in its entirety.
New	1490	1	101C	Classroom 101 Restroom	W4	Plaster	Prior	N/A	1/23/20	1/23/20	N/A	1/23/20	60	2	1	Yes	Inital: 34.17 µg/ft2 / Retest:234.78 µg/ft2/ Retest: < 5 µg/ft2	Entire restroom treated as single work area/containment. Minimal damage.
New	1490	1	101B	Classroom 101 Closet	W1	Plaster	2/20/20	2/20/20	2/20/20	2/20/20	2/24/20	2/21/20	30	1	1	Yes	< 5 µg/ft2	Entire closet treated as single work area/containment.
New	1490	1	101B	Classroom 101 Closet	W2	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
New	1490	1	101B	Classroom 101 Closet	W3	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
New	1490	1	101B	Classroom 101 Closet	Ceiling	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
New	1490	1	101	Classroom 101	W3	Plaster	Prior	1/23/20	1/23/20	1/23/20		1/23/20	200	5	1	Yes	< 5 µg/ft	
New	1490	1	101A	Women's Restroom next to Classroom 101	Ceiling	Plaster	Complete Prior to Oversight	Complete Prior to Oversight	Complete Prior to Oversight	Complete Prior to Oversight	Complete Prior to Oversight	Complete Prior to Oversight	Complete Prior to Oversight	Complete Prior to Oversight	Complete Prior to Oversight	Complete Prior to Oversight	Complete Prior to Oversight	Complete Prior to Oversight
New	1490	1	102	Classroom 102	W4	Plaster	Prior	1/23/20	1/23/20	1/23/20		1/23/20	200	5	1	Yes	< 5 µg/ft	
New	1490	1	101K	Classroom K1	W3	Plaster	Prior	2/12/20	2/12/20	2/12/20	2/13/20	2/12/20	70	2	N/A	No	N/A	Very minimal scraping at Wall 3 behind radiator cover
New	1490	1	103	Classroom 103	W3	Plaster	Prior	2/27/20	2/27/20	2/27/20	2/27/20	2/27/20	40	1	1	Yes	< 5 µg/ft2	Very minimal damage and minimal scraping required on W3 at/behind raditor cover.
New	1490	1	103FB	Storage Closet (with Gate) across from Classroom K1	W2	Plaster	1/27/20	1/27/20	1/27/20	1/27/20	2/2/20	1/28/20	40	1	N/A	No	N/A	Entire closet treated as single work area/containment.
New	1490	1	103FB	Storage Closet (with Gate) across from Classroom K1	W3	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
New	1490	1	103FB	Storage Closet (with Gate) across from Classroom K1	W4	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
	1490	1	103FB	Storage Closet (with Gate) across from Classroom K1	Ceiling	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
	1490	1	103FC	Storage Closet (Band Instruments) across from Girl's Restroom	W2	Plaster	1/27/20	1/27/20	1/27/20	1/27/20	2/2/20	1/28/20	30	1	N/A	No	N/A	Entire closet treated as single work area/containment.
	1490	1	103FC	Storage Closet (Band Instruments) across from Girl's Restroom	W3	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
	1490	1	103FC	Storage Closet (Band Instruments) across from Girl's Restroom	W4	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
	1490	1	103FC	Storage Closet (Band Instruments) across from Girl's Restroom	Ceiling	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
	1490	1	S18	Stairwell G (near Girl's Restroom)	W3	Plaster	Prior	N/A	02/07/20	02/07/20	N/A	02/07/20	60	2	N/A	No	N/A	Iron Workers removed radiator covers 2/7/20 and replaced them 2/09/20
	1490	1	S11	Stairwell adjacent to Classroom 101	W3	Plaster	Prior	N/A	02/07/20	02/07/20	N/A	02/07/20	60	2	N/A	No	N/A	Iron Workers removed radiator covers 2/7/20 and replaced them 2/09/20
	1490	2	209	Classroom 209	W3	Plaster	Prior	02/19/20	02/19/20	02/19/20	2/19/20	02/19/20	100	3	N/A	No	N/A	Very minimal scraping at Wall 3 where damage reoccured.
	1490	2	212A	Book Storage adjacent to Classroom 212	W4	Plaster	Prior	2/20/20	2/20/20	2/20/20	2/20/20	2/20/20	40	1	1	Yes	< 5 µg/ft2	Very minimal scraping on Wall 4 at entrance.
	1490	2	212C	Boy's Restroom near Classroom 212	W1	Plaster/Ceramic	Prior	N/A	12/19/19	12/19/19	N/A	12/19/19	200	5	1	Yes	12.32 µg/ft2	COA.
	1490	2	212C	Boy's Restroom near Classroom 212	W2	Plaster/Ceramic	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	
	1490	2	212C	Boy's Restroom near Classroom 212	W3	Plaster/Ceramic	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	
	1490	2	212C	Boy's Restroom near Classroom 212	W4	Plaster/Ceramic /Block	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	
	1490	2	212C	Boy's Restroom near Classroom 212	Ceiling	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	
	1490	2	213	Classroom 213	Ceiling	Plaster	Prior	1/23/20	1/23/20	1/23/20	1/23/20	1/23/20	200	5	N/A	No	N/A	
	1490	2	214	Classroom 214	W3	Plaster	Prior	1/23/20	1/23/20	1/23/20	1/23/20	1/23/20	200	5	N/A	No	N/A	
	1490	2	215A	Counselor's Office 15 (next to Classroom 215)	W2	Plaster	Prior	1/23/20	1/23/20	1/23/20	1/23/20	1/23/20	200	5	1	Yes	< 10 µg/ft2	
	1490	2	H27	Hallway from Classrooms 213 to 215	W3	Plaster	Prior	N/A	12/17/19, 12/18/19, 2/7/20, 2/27/20	12/17/19, 12/18/19, 2/7/20, 2/27/20	N/A	2/27/20	1000	25	N/A	No	N/A	Hallway done in incemerents since work areas had to be turned over every night. Work areas stablitzed and cleaned up at the end of every shift. Raditor covers removed 2/7/20 for stablization work. Final inspection date reflects the date when the hallway was completed in its entirety.
	1490	2	H28	Hallway adjacent to Upper Part of Auditorium (from Staiwell M to Stairwell G)	W4	Plaster	Prior	N/A	12/17/19, 12/18/19, 2/7/20	12/17/19, 12/18/19, 2/7/20	N/A	2/27/20	1000	25	N/A	No	N/A	Hallway done in incemerents since work areas had to be turned over every night. Work areas stablitzed and cleaned up at the end of every shift. Raditor covers removed 2/7/20 for stablization work. Final inspection date reflects the date when the hallway was completed in its entirety.
	1490	3	325B	Boy's Restroom (near Classroom 325)	W1	Plaster/Ceramic	Prior	Non-RRP (Strictly Filling Duct Penetration with Spackle and painting)	Non-RRP (Strictly Filling Duct Penetration with Spackle and painting)	Non-RRP (Strictly Filling Duct Penetration with Spackle and painting)	Non-RRP (Strictly Filling Duct Penetration with Spackle and painting)	Non-RRP (Strictly Filling Duct Penetration with Spackle and painting)	Non-RRP (Strictly Filling Duct Penetration with Spackle and painting)	Non-RRP (Strictly Filling Duct Penetration with Spackle and painting)	Non-RRP (Strictly Filling Duct Penetration with Spackle and painting)	Non-RRP (Strictly Filling Duct Penetration with Spackle and painting)	Non-RRP (Strictly Filling Duct Penetration with Spackle and painting)	Non-RRP (Strictly Filling Duct Penetration with Spackle and painting)

Rudolph Blankenburg ES  
Oversight

H	ULCS#	F l o o r	Space # (on Floor Plan)	On Site Room Name	Primary Component	Substrate Material	Pre-Cleaning Completed (date)	Contents Moved (date)	Work Area Prepped (date)	Surfaces Stabilized (date)	Contents Back in Place (date)	Final Inspection Approval and Photos (date)	Square Footage of Work Area	Number of Required RRP Wipes	Number of Colorimetric Wipes Used to Pass	Final Colorimetric Wipe Submitted for AAS Analysis (yes/no)	AAS Analysis Results	Comments from Oversight
	1490	3	H315A	Fire Tower Hallway adjacent Hallway from Classrooms 316 to 319	Ceiling	Concrete	Prior	N/A	12/18	12/18	N/A	12/18	120	3	9	No	N/A	Storage Closet in Hallway was unable to be moved and therefore was covered with poly.
	1490	3	H316	Hallway from Classrooms 320 to 325	W4	Plaster	Prior	N/A	12/17/19, 12/18/19, 12/19/19	12/18	N/A	12/18	80	2	N/A	No	N/A	Minimal scraping, small spackle touch up to fill holes and painted.
	1490	3	H314	Hallway from Classrooms 325 to 328	W3	Plaster	Prior	N/A	12/17/19, 12/18/19, 12/19/19	12/18	N/A	12/18	500	13	N/A	No	N/A	Hallway done in incemerents since work areas had to be turned over every night. Work areas stablitzed and cleaned up at the end of every shift. Final inspection date reflects the date when the hallway was completed in its entirety.
	1490	3	316	Science Laboratory 316	W3	Plaster	1/16/20	1/16/20	1/16/20	1/16/20	1/16/20	1/16/20	500	13	N/A	No	N/A	Minimal scraping of reoccurring damage. Mainly just painting touch ups.
	1490	3	316	Science Laboratory 316	Ceiling	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
	1490	3	317	Classroom 317	W3	Plaster	Prior	1/14/20	1/14/20	1/14/20	1/14/20	1/14/20	80	2	N/A	No	N/A	Very Minimal Scraping. Damage was not deep and reoccured from water
	1490	3	318	Classroom 318	Ceiling	Plaster	Completed prior to oversight	Completed prior to oversight	Completed prior to oversight	Completed prior to oversight	Completed prior to oversight	Completed prior to oversight	Completed prior to oversight	Completed prior to oversight	Completed prior to oversight	Completed prior to oversight	Completed prior to oversight	318 Closet Intially started, prepped, and stabilized during oversight. Finished and cleaned prior to oversight.
	1490	3	319	Classroom 319	W3	Plaster	1/16/20	1/16/20	1/16/20	1/16/20	1/16/20	1/21/20	200	5	N/A	No	N/A	Entire Room treated as single work area/containment. Minimal damage in classroom at wall 3 but entire room was painted.
	1490	3	322	Classroom 322	W3	Plaster	Prior	1/13/20	1/13/20	1/13/20	1/13/20	1/13/20	240	6	N/A	No	N/A	Damage paint/plaster still exists directly behind radiators due to inaccessibility.
	1490	3	322	Classroom 322	W4	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
	1490	3	322	Classroom 322	Ceiling	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
	1490	3	324	Classroom 324	W3	Plaster	Prior	1/13/20	1/13/20	1/13/20	1/13/20	1/13/20	300	8	N/A	No	N/A	Damage paint/plaster still exists directly behind radiators due to inaccessibility.
	1490	3	324	Classroom 324	W4	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
	1490	3	321	Classroom 321	W2	Plaster	Work Done Prior to Criterion Oversight	Work Done Prior to Criterion Oversight	Work Done Prior to Criterion Oversight	Work Done Prior to Criterion Oversight	Work Done Prior to Criterion Oversight	Work Done Prior to Criterion Oversight	Work Done Prior to Criterion Oversight	Work Done Prior to Criterion Oversight	Work Done Prior to Criterion Oversight	Work Done Prior to Criterion Oversight	Work Done Prior to Criterion Oversight	Work Done Prior to Criterion Oversight
	1490	3	321	Classroom 321	W3	Plaster	Work Done Prior to Criterion Oversight	Work Done Prior to Criterion Oversight	Work Done Prior to Criterion Oversight	Work Done Prior to Criterion Oversight	Work Done Prior to Criterion Oversight	Work Done Prior to Criterion Oversight	Work Done Prior to Criterion Oversight	Work Done Prior to Criterion Oversight	Work Done Prior to Criterion Oversight	Work Done Prior to Criterion Oversight	Work Done Prior to Criterion Oversight	Work Done Prior to Criterion Oversight
	1490	3	321	Classroom 321	Ceiling	Plaster	Work Done Prior to Criterion Oversight	Work Done Prior to Criterion Oversight	Work Done Prior to Criterion Oversight	Work Done Prior to Criterion Oversight	Work Done Prior to Criterion Oversight	Work Done Prior to Criterion Oversight	Work Done Prior to Criterion Oversight	Work Done Prior to Criterion Oversight	Work Done Prior to Criterion Oversight	Work Done Prior to Criterion Oversight	Work Done Prior to Criterion Oversight	Work Done Prior to Criterion Oversight
	1490	3	320	Classroom 320	W3	Plaster	1/15/20	1/15/20	1/15/20	1/15/20	1/15/20	1/15/20	240	6	N/A	No	N/A	Damage paint/plaster still exists directly behind radiators due to inaccessibility.
	1490	3	323	Classroom 323	W3	Plaster	1/15/20	1/15/20	1/15/20	1/15/20	1/15/20	1/15/20	240	6	N/A	No	N/A	Damage paint/plaster still exists directly behind radiators due to inaccessibility.
	1490	3	327	Classroom 327	W3	Plaster	2/18/20	2/18/20	2/18/20	2/18/20	2/18/20	2/18/20	240	6	1	Yes	6.85 µg/ft2	Damage paint/plaster still exists directly behind radiators due to inaccessibility.
	1490	B	028B	Kitchen Closet	W1	Plaster	Prior	Prior	2/3/20	2/4/20	2/5/20	2/4/20	40	1	N/A	No	N/A	entire closet treated as single conaintment/work area
	1490	B	028B	Kitchen Closet	W2	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
	1490	B	028B	Kitchen Closet	W3	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
	1490	B	028B	Kitchen Closet	W4	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
	1490	B	028B	Kitchen Closet	Ceiling	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
	1490	B	028B	Kitchen Closet	W5	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
	1490	B	028C	Kitchen Closet	W1	Plaster	Prior	Prior	2/3/20	2/4/20		2/6/20	70	2	N/A	No	N/A	entire closet treated as single conaintment/work area
	1490	B	028C	Kitchen Closet	W2	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
	1490	B	028C	Kitchen Closet	W3	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
	1490	B	028C	Kitchen Closet	Ceiling	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
	1490	1	103B	Custodial Closet adjacent to Classroom 103	W1	Plaster	Prior	2/11/20	2/11/20	2/11/20	2/12/20	2/13/20	40	1	N/A	No	N/A	
	1490	1	103B	Custodial Closet adjacent to Classroom 103	W2	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
	1490	1	103B	Custodial Closet adjacent to Classroom 103	W3	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
	1490	1	103B	Custodial Closet adjacent to Classroom 103	W4	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
	1490	1	103B	Custodial Closet adjacent to Classroom 103	Ceiling	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
	1490	2	211SC	Custodial Closet adjacent to Classroom 210	W2	Plaster	Prior	2/12/20	2/12/20	2/12/20	2/12/20	2/12/20	40	1	N/A	No	N/A	
	1490	2	211SC	Custodial Closet adjacent to Classroom 210	Ceiling	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
	1490	3	318B	Custodial Closet adjacent to Classroom 318	W1	Plaster	Prior	2/12/20-2/13/20	2/12/20-2/13/20	2/13/20	2/14/20	2/13/20	40	1	N/A	No	N/A	
	1490	3	318B	Custodial Closet adjacent to Classroom 318	W2	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
	1490	3	318B	Custodial Closet adjacent to Classroom 318	W3	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
	1490	3	318B	Custodial Closet adjacent to Classroom 318	W4	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
	1490	B	030A	Classroom 30 Closet #2	W1	Plaster	2/19/20	2/19/20	2/19/20	2/19/20		2/19/20	60	2	1	Yes	Intial: 25.22 µg/ft2 Retest: 17.09 µg/ft2 2nd Retest: < 5 µg/ft2	Entire closet treated as single work area/containment. Intial colorimetrics were failing. FAC scrubbed floor and tested 2/20/20. FAC rescrubbed floor on 2/24/20 and was retested and failed again. FAC rescrubbed floor on 2/26/20 and was retested and passed.
	1490	B	030A	Classroom 30 Closet #2	W2	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
	1490	B	030A	Classroom 30 Closet #2	W3	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
	1490	B	030A	Classroom 30 Closet #2	W4	Plaster	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above	see above
	1490	B	030B	Classroom 30 Closet #1	W1	Plaster	2/18	2/18	2/18	2/18/20	2/24/20	2/18/20	110	3	1	Yes	Initial: 97.2 µg/ft2 Retest: < 5 µg/ft2	Entire closet treated as single work area/containment. Intial colorimetrics were failing. FAC scrubbed floor and retested 2/20/20 and passed.

Rudolph Blankenburg ES  
Oversight

[illegible]

***Appendix D. Sample Results Table***

Rudolph Blankenburg ES  
Sample Results

<b>F l o o r</b>	<b>Space # (on Floor Plan)</b>	<b>On Site Room Name</b>	<b>Number of Required RRP Wipes</b>	<b>Number of Colorimetric Wipes Used to Pass</b>	<b>AAS Analysis Results</b>
1	103D	Auditorium	73	8	Initial: 63.22 µg/ft2 & 30.31 µg/ft2 (Stage), Retest: < 10 µg/ft2 & <10 µg/ft2 (Stage)
1	101K	Classroom K1	19	3	< 10 µg/ft2
1	102K	Classroom K1 Closet	2	1	Initial: 15.42 µg/ft2 / Retest: < 5 µg/ft2
1	102KA	Classroom K1 Restroom	2	2	128.69 µg/ft2 , 25 µg/ft2, 22.9 µg/ft2, < 10 µg/ft2
1	103	Classroom 103	21	3	10.22 µg/ft2
1	103A	Classroom 103 Closet	4	1	7.65 µg/ft2
1	102	Classroom 102	20	3	20 µg/ft2 , 10.22 µg/ft2
1	101	Classroom 101	21	3	< 10 µg/ft 2
1	101B	Classroom 101 Closet	1	1	< 5 µg/ft2
1	102C	Main Office	11	2	Initial: 79.97 µg/ft2 , Retest: 15.76 µg/ft2
1	104C	Boy's Restroom near Classroom K4	5	2	Initial: 195.16 µg/ft2 / Retest: 27.04 µg/ft2 / Retest: 34.42 µg/ft2 / Retest: Retest:39.99 µg/ft
1	104	Classroom K4	20	3	< 10 µg/ft2
1	104A	Classroom K4 Restroom	1	2	88.85 µg/ft2 , 25. 42 µg/ft2, < 10 µg/ft2
1	107	Classroom 107	21	3	13.68 µg/ft2
1	106	Classroom 106	20	3	16.83 µg/ft2

Rudolph Blankenburg ES  
Sample Results

Floor	Space # (on Floor Plan)	On Site Room Name	Number of Required RRP Wipes	Number of Colorimetric Wipes Used to Pass	AAS Analysis Results
1	105	Classroom 105	21	3	Initial: 101.76 µg/ft <sup>2</sup> , Retest: 10.22 µg/ft <sup>2</sup>
2	212CF	Foyer in Boy's Restroom near Classroom 212	2	1	Initial: 29.1 µg/ft <sup>2</sup> , Retest: 19.77µg/ft <sup>2</sup>
2	212A	Book Storage adjacent to Classroom 212	1	1	< 5 µg/ft <sup>2</sup>
2	210A	Corner Office 10A (Across from Custodial Closet)	7	3	< 10 µg/ft <sup>2</sup>
2	210B	Corner Office 10A - Restroom	1	2	Initial: 220.15 µg/ft <sup>2</sup> , 1st Retest: 34.56 µg/ft <sup>2</sup> , 2nd Retest: < 10 µg/ft <sup>2</sup>
2	208A	Nurse's Office	8	2	Initial: 51.44 µg/ft <sup>2</sup> , 1st Retest: 65.64 µg/ft <sup>2</sup> , 2nd Retest: 15.62 µg/ft <sup>2</sup>
2	208C	Nurse's Restroom	2	2	< 10 µg/ft <sup>2</sup>
B	001B	Girl's Restroom	4	2	< 10 µg/ft <sup>2</sup>
B	31	IMC (Library)	33	4	Initial: 156.31 µg/ft <sup>2</sup> , Retest: < 10 µg/ft <sup>2</sup>
B	030	Classroom 30	22	3	< 10 µg/ft <sup>2</sup>
B	11B	Classroom 27	13	3	< 10 µg/ft <sup>2</sup>
B	028	Classroom 29	19	3	< 10 µg/ft <sup>2</sup>
B	12B	Gymnasium	92	9	< 10 µg/ft <sup>2</sup>
1	102K	Classroom K1 Closet	2	Initial 1 Pass, Retest: 1 Pass	Initial: 15.42 µg/ft <sup>2</sup> Retest: < 5 µg/ft <sup>2</sup>
B	028D	Classroom 29 - Rear Closet	N/A see notes	1	< 5 µg/ft <sup>2</sup>

Rudolph Blankenburg ES  
Sample Results

F l o o r	Space # (on Floor Plan)	On Site Room Name	Number of Required RRP Wipes	Number of Colorimetric Wipes Used to Pass	AAS Analysis Results
B	028E	Classroom 29 - Front Closet	N/A see notes	1	7.25 µg/ft2
B	11B	Classroom 27	N/A see notes	3	< 5 µg/ft2
B	11C	Office in Classroom 27	N/A see notes	2	19.07 µg/ft2, 13.41 µg/ft2, < 5 µg/ft2, < 5 µg/ft2
B	028A	Kitchen	20	1	Initial: 15.31 µg/ft2 , Retest: < 5 µg/ft2
B	001B	Girl's Restroom	13	3	< 10 µg/ft2
B	030	Classroom 30	5	1	< 5 µg/ft2
B	010B	Boy's Restroom	9	3	Initial: 131.85 µg/ft2 / 1st Retest: 11.11 µg/ft2 / 2nd Retest: 7.47 µg/ft2
1	104C	Boy's Restroom near Classroom K4	4	1	Initial: 195.16 µg/ft2 / Retest: 27.04 µg/ft2 / Retest: 34.42 µg/ft2 / Retest: Retest:39.99 µg/ft2 / <b>Retest : &lt; 5 µg/ft2</b>
1	104	Classroom K4	6	1	< 5 µg/ft2
1	103D	Auditorium	10	2	9.5 µg/ft2
1	101C	Classroom 101 Restroom	2	1	Initial: 34.17 µg/ft2 / Retest:234.78 µg/ft2/ <b>Retest: &lt; 5 µg/ft2</b>
1	101B	Classroom 101 Closet	1	1	< 5 µg/ft2
1	101	Classroom 101	5	1	< 5 µg/ft

## Rudolph Blankenburg ES Sample Results

[illegible]

## ***Appendix E. Photographs***







## ***Appendix F.***

### ***Environmental Firm Certification Documentation of Training***

# ***CRITERION LABORATORIES, INC.***

400 STREET ROAD, BENSALEM, PA 19020  
PHONE: (215) 244-1300, FAX: (215) 244-4349  
WWW.CRITERIONLABS.COM

## ***Certificate of Attendance and Successful Completion***

**Dust Sampling Technician – English**  
Per 40 CFR Part 745.225


***Jonathan McKinnon***

49 Winfield Road, Erial, NJ 08081

**Certificate Number: D-I-19014-19-748615**



*Course Date: 4/3/2019*  
*Examination Date: 4/3/2019*  
*Expiration Date: 4/3/2024*

A handwritten signature in black ink, appearing to read 'J. Weltz'.

---

**JAMES A. WELTZ, CIH**  
*Training Manager / Principal Instructor*

# ***CRITERION LABORATORIES, INC.***

400 STREET ROAD, BENSALEM, PA 19020  
PHONE: (215) 244-1300, FAX: (215) 244-4349  
WWW.CRITERIONLABS.COM

## ***Certificate of Attendance and Successful Completion***

**Lead RRP Initial – English**  
**Per 40 CFR Part 745.225**


***Jonathan McKinnon***

**49 Winfield Road, Erial, NJ 08081**

**Certificate Number: R-I-19014-19-748640**



***Course Date: 4/5/2019***  
***Examination Date: 4/5/2019***  
***Expiration Date: 4/5/2024***



---

**JAMES A. WELTZ, CIH**  
***Training Manager / Principal Instructor***

# ***CRITERION LABORATORIES, INC.***

400 STREET ROAD, BENSALEM, PA 19020  
PHONE: (215) 244-1300, FAX: (215) 244-4349  
WWW.CRITERIONLABS.COM


## ***Certificate of Attendance and Successful Completion***

**Dust Sampling Technician – English**  
Per 40 CFR Part 745.225


***Nicolette Raleigh***

3514 Spring Garden St., Philadelphia, PA 19104

**Certificate Number: D-I-19014-18-747044**

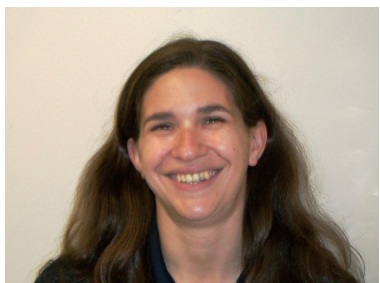

***Course Date: 8/29/2018***  
***Examination Date: 8/29/2018***  
***Expiration Date: 8/29/2023***

A handwritten signature in black ink, appearing to read 'J. Weltz'.

---

**JAMES A. WELTZ, CIH**  
***Training Manager / Principal Instructor***

# ***CRITERION LABORATORIES, INC.***

400 STREET ROAD, BENSALEM, PA 19020  
PHONE: (215) 244-1300, FAX: (215) 244-4349  
WWW.CRITERIONLABS.COM


## ***Certificate of Attendance and Successful Completion***

**Lead RRP Initial – English**  
**Per 40 CFR Part 745.225**


***Nicolette Raleigh***

**3514 Spring Garden St., B31, Philadelphia, PA 19104**

**Certificate Number: R-I-19014-18-747039**

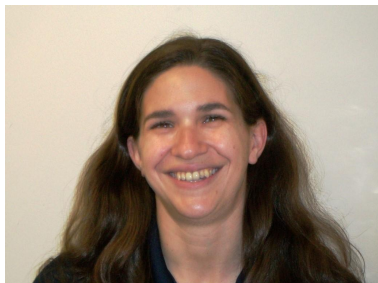

***Course Date: 8/28/2018***  
***Examination Date: 8/28/2018***  
***Expiration Date: 8/28/2023***



---

**JAMES A. WELTZ, CIH**  
***Training Manager / Principal Instructor***

## ***Appendix G.***

### ***Painting Contractor Certifications or Documentation of Training***

# Comprehensive List of Philadelphia School District Employees with EPA RRP Training

First Name	Last Name	Course Description	Course End Date	Expiration Date
Kyle	Adami	EPA-Lead Renovator Refresher	09-Mar-15	09-Mar-20
Marcel	Allen	EPA-Lead Renovator Refresher	28-Apr-15	28-Apr-20
James	Archie	EPA-Lead Renovator Refresher	09-Mar-15	09-Mar-20
Demetrius	Atwell	EPA-Lead Renovator Initial	17-Nov-17	17-Nov-22
Samuel	Atwell	EPA-Lead Renovator Initial	17-Nov-17	17-Nov-22
Shawn	Baldwin	EPA-Lead Renovator Initial	01-Apr-15	01-Apr-20
Michael	Baranek	EPA-Lead Renovator Refresher	09-Mar-15	09-Mar-20
Chris	Bartella	EPA-Lead Renovator Refresher	21-May-15	21-May-20
Chris	Bendig	EPA-Lead Renovator Refresher	10-Mar-15	10-Mar-20
Michael	Bennett	EPA-Lead Renovator Refresher	09-Mar-15	09-Mar-20
Gino	Berardinucci	EPA-Lead Renovator Refresher	21-May-15	21-May-20
Jessica	Binda-Rischow	EPA-Lead Renovator Initial	20-Apr-18	20-Apr-23
Terrence	Blocker	EPA-Lead Renovator Initial	01-Apr-15	01-Apr-20
Damian	Boninfante	EPA-Lead Renovator Refresher	19-Mar-15	19-Mar-20
James	Borie	EPA-Lead Renovator Refresher	09-Mar-15	09-Mar-20
Joe	Bowes	EPA-Lead Renovator Refresher	09-Mar-15	09-Mar-20
Rhett	Boykins	EPA-Lead Renovator Initial	03-Nov-17	03-Nov-22
Robert	Broadnax	EPA-Lead Renovator Initial	20-Apr-18	20-Apr-23
Philip	Burton	EPA-Lead Renovator Refresher	02-Apr-15	02-Apr-20
Randy	Bushnell	EPA-Lead Renovator Refresher	02-Apr-15	02-Apr-20
Okang	Cambridge	EPA-Lead Renovator Initial	17-Nov-17	17-Nov-22
Michael	Cancelliere	EPA-Lead Renovator Refresher	10-Mar-15	10-Mar-20
Anthony	Carruth	EPA-Lead Renovator Refresher	09-Mar-15	09-Mar-20
Thomas	Casey	EPA-Lead Renovator Refresher	09-Mar-15	09-Mar-20
Gabrielle	Cecala	EPA-Lead Renovator Initial	17-Nov-17	17-Nov-22
Anthony	Cecala	EPA-Lead Renovator Refresher	19-Mar-15	19-Mar-20
Brian	Chambers	EPA-Lead Renovator Refresher	09-Mar-15	09-Mar-20
Suzette	Christian	EPA-Lead Renovator Initial	17-Nov-17	17-Nov-22
Rich	Ciuckis	EPA-Lead Renovator Refresher	09-Mar-15	09-Mar-20
Michael	Clark	EPA-Lead Renovator Initial	01-Apr-15	01-Apr-20
Harold	Clark, Jr.	EPA-Lead Renovator Refresher	09-Mar-15	09-Mar-20
Joseph	Clemson	EPA-Lead Renovator Refresher	09-Mar-15	09-Mar-20
Brian	Cook	EPA-Lead Renovator Refresher	09-Mar-15	09-Mar-20
Jeff	Cook	EPA-Lead Renovator Refresher	09-Mar-15	09-Mar-20
Kevin	Courtney	EPA-Lead Renovator Initial	20-Apr-18	20-Apr-23
Jahmai	Crawley	EPA-Lead Renovator Initial	03-Nov-17	03-Nov-22
Timothy	Creighton	EPA-Lead Renovator Initial	17-Nov-17	17-Nov-22
Steven	Creighton	EPA-Lead Renovator Refresher	10-Mar-15	10-Mar-20
Joe	Curran	EPA-Lead Renovator Refresher	10-Mar-15	10-Mar-20
Kevin	Curry	EPA-Lead Renovator Refresher	28-Apr-15	28-Apr-20
Demetrius	Dancey	EPA-Lead Renovator Initial	01-Apr-15	01-Apr-20

Fran	Davis	EPA-Lead Renovator Refresher	19-Mar-15	19-Mar-20
James	Davis (diff emp.)	EPA-Lead Renovator Refresher	19-Mar-15	19-Mar-20
Edmund	Davis, Jr.	EPA-Lead Renovator Initial	20-Mar-18	20-Mar-23
Anthony	Devlin	EPA-Lead Renovator Refresher	02-Apr-15	02-Apr-20
Ken	Dickson	EPA-Lead Renovator Initial	11-Aug-14	11-Aug-19
Mark	DiGiambattista	EPA-Lead Renovator Initial	01-Apr-15	01-Apr-20
Steve	Dolan	EPA-Lead Renovator Refresher	19-Mar-15	19-Mar-20
Stephen	DuBan	EPA-Lead Renovator Refresher	20-Mar-15	20-Mar-20
James	Dugan	EPA-Lead Renovator Refresher	19-Mar-15	19-Mar-20
Mark	Dugan	EPA-Lead Renovator Refresher	09-Mar-15	09-Mar-20
Donald	Eife	EPA-Lead Renovator Refresher	19-Mar-15	19-Mar-20
George	Faccenda	EPA-Lead Renovator Refresher	20-Mar-15	20-Mar-20
Anthony	Fiore	EPA-Lead Renovator Refresher	09-Mar-15	09-Mar-20
Bill	Flanigan	EPA-Lead Renovator Refresher	10-Mar-15	10-Mar-20
Michael	Flannery Sr.	EPA-Lead Renovator Refresher	09-Mar-15	09-Mar-20
Joseph	Flannery, Jr.	EPA-Lead Renovator Initial	20-Apr-18	20-Apr-23
David	Foster	EPA-Lead Renovator Refresher	10-Mar-15	10-Mar-20
Anthony	Gajdowski	EPA-Lead Renovator Initial	30-Jul-14	30-Jul-19
Joseph	Gallagher	EPA-Lead Renovator Refresher	10-Mar-15	10-Mar-20
Stephen	Gallagher	EPA-Lead Renovator Initial	11-Aug-14	11-Aug-19
Harold	Ganskopp, Jr.	EPA-Lead Renovator Refresher	09-Mar-15	09-Mar-20
Ralph	Garcia	EPA-Lead Renovator Refresher	19-Mar-15	19-Mar-20
James	Garofolo	EPA-Lead Renovator Refresher	10-Mar-15	10-Mar-20
John	Genovese	EPA-Lead Renovator Refresher	10-Mar-15	10-Mar-20
Joe	George	EPA-Lead Renovator Initial	20-Apr-18	20-Apr-23
Thomas	Gibson	EPA-Lead Renovator Refresher	10-Mar-15	10-Mar-20
John	Gidzinski	EPA-Lead Renovator Initial	01-Apr-15	01-Apr-20
James	Gillice	EPA-Lead Renovator Refresher	09-Mar-15	09-Mar-20
Melvin	Goins	EPA-Lead Renovator Initial	17-Nov-17	17-Nov-22
Damon	Gonzaga	EPA-Lead Renovator Initial	11-Aug-14	11-Aug-19
Raynaldo	Gonzalez	EPA-Lead Renovator Initial	17-Nov-17	17-Nov-22
John	Gordon	EPA-Lead Renovator Initial	01-Apr-15	01-Apr-20
Frank	Gosciminski	EPA-Lead Renovator Refresher	19-Mar-15	19-Mar-20
Kwamie	Grove	EPA-Lead Renovator Initial	11-Aug-14	11-Aug-19
Ron	Hackimer	EPA-Lead Renovator Refresher	10-Mar-15	10-Mar-20
Richard	Hagenbuch	EPA-Lead Renovator Refresher	19-Mar-15	19-Mar-20
James	Hall	EPA-Lead Renovator Initial	11-Jul-18	11-Jul-23
David	Hampton Jr.	EPA-Lead Renovator Refresher	21-May-15	21-May-20
Gerard	Harkins	EPA-Lead Renovator Refresher	02-Apr-15	02-Apr-20
Erica	Hickey	EPA-Lead Renovator Initial	20-Mar-18	3/20/2023
Wayne	Hogeland	EPA-Lead Renovator Refresher	19-Mar-15	19-Mar-20
Timothy	Holman	EPA-Lead Renovator Refresher	19-Mar-15	19-Mar-20
Durelle	Holmes	EPA-Lead Renovator Initial	20-Mar-18	20-Mar-23

Richard	Houck	EPA-Lead Renovator Refresher	10-Mar-15	10-Mar-20
Alfred	Howard	EPA-Lead Renovator Initial	20-Mar-18	20-Mar-23
Wayne	Howard	EPA-Lead Renovator Initial	01-Apr-15	01-Apr-20
Timothy	Humes	EPA-Lead Renovator Refresher	19-Mar-15	19-Mar-20
Lance	Jackson	EPA-Lead Renovator Refresher	10-Mar-15	10-Mar-20
Eric	Johnson	EPA-Lead Renovator Refresher	28-Apr-15	28-Apr-20
James	Johnson	EPA-Lead Renovator Refresher	19-Mar-15	19-Mar-20
Jimmie	Johnson	EPA-Lead Renovator Refresher	19-Mar-15	19-Mar-20
Walter	Johnson	EPA-Lead Renovator Refresher	19-Mar-15	19-Mar-20
Donald	Johnson Jr.	EPA-Lead Renovator Refresher	19-Mar-15	19-Mar-20
Jesse	Jones	EPA-Lead Renovator Initial	11-Aug-14	11-Aug-19
Gerald	Joniec	EPA-Lead Renovator Refresher	21-May-15	21-May-20
Brian	Joseph	EPA-Lead Renovator Refresher	28-Apr-15	28-Apr-20
Anthony	Jubilee	EPA-Lead Renovator Refresher	19-Mar-15	19-Mar-20
Gerald	Junod	EPA-Lead Renovator Refresher	28-Apr-15	28-Apr-20
Joe	Kehoe	EPA-Lead Renovator Initial	01-Apr-15	01-Apr-20
John	Kenney	EPA-Lead Renovator Refresher	19-Mar-15	19-Mar-20
Mary	Koehler	EPA-Lead Renovator Refresher	02-Apr-15	02-Apr-20
Richard	Kovacs	EPA-Lead Renovator Initial	20-Apr-18	20-Apr-23
John	Krol	EPA-Lead Renovator Refresher	19-Mar-15	19-Mar-20
Michael	Leone	EPA-Lead Renovator Refresher	02-Apr-15	02-Apr-20
George	Leone	EPA-Lead Renovator Initial	11-Aug-14	11-Aug-19
Richard	Lepore	EPA-Lead Renovator Initial	20-Apr-18	20-Apr-23
Walter	Lipski	EPA-Lead Renovator Refresher	19-Mar-15	19-Mar-20
David	Loftus	EPA-Lead Renovator Refresher	09-Mar-15	09-Mar-20
Eloy	Lopez Jr.	EPA-Lead Renovator Refresher	20-Mar-15	20-Mar-20
Augustus	Lover, III	EPA-Lead Renovator Initial	20-Apr-18	20-Apr-23
Michael	Lowe	EPA-Lead Renovator Refresher	21-May-15	21-May-20
Harry	Lowe, Jr.	EPA-Lead Renovator Initial	20-Apr-18	20-Apr-23
Kenneth	Mack	EPA-Lead Renovator Initial	01-Apr-15	01-Apr-20
Thomas	Malkowski	EPA-Lead Renovator Refresher	10-Mar-15	10-Mar-20
Thomas	Malkowski, Jr.	EPA-Lead Renovator Initial	03-Nov-17	03-Nov-22
Kevin	Malone	EPA-Lead Renovator Refresher	19-Mar-15	19-Mar-20
Dante	Mancini	EPA-Lead Renovator Refresher	28-Apr-15	28-Apr-20
Stephen	Manna	EPA-Lead Renovator Initial	20-Apr-18	20-Apr-23
Charles	Markey	EPA-Lead Renovator Refresher	19-Mar-15	19-Mar-20
Derrick	Matthews	EPA-Lead Renovator Initial	01-Apr-15	01-Apr-20
Benedict	Matthews	EPA-Lead Renovator Refresher	20-Mar-15	20-Mar-20
Kevin	McAfee	EPA-Lead Renovator Initial	30-Jul-14	30-Jul-19
Gerard	McAnena	EPA-Lead Renovator Refresher	19-Mar-15	19-Mar-20
Jim	McBride	EPA-Lead Renovator Refresher	19-Mar-15	19-Mar-20
John	McFarlane	EPA-Lead Renovator Refresher	10-Mar-15	10-Mar-20
Mikkel	McKinnie	EPA-Lead Renovator Initial	01-Apr-15	01-Apr-20

Patrick	McMahon	EPA-Lead Renovator Refresher	02-Apr-15	02-Apr-20
Pat	McMahon	EPA-Lead Renovator Initial	11-Aug-14	11-Aug-19
Matthew	Melady	EPA-Lead Renovator Refresher	28-Apr-15	28-Apr-20
Joe	Mellina Jr.	EPA-Lead Renovator Refresher	19-Mar-15	19-Mar-20
Harry	Milbourne	EPA-Lead Renovator Initial	30-Jul-14	30-Jul-19
Christopher	Moore	EPA-Lead Renovator Refresher	19-Mar-15	19-Mar-20
Mike	Moore	EPA-Lead Renovator Refresher	10-Mar-15	10-Mar-20
Mike	Moore	EPA-Lead Renovator Refresher	10-Mar-15	10-Mar-20
Earl	Morris	EPA-Lead Renovator Refresher	20-Mar-15	20-Mar-20
William	Muller	EPA-Lead Renovator Refresher	20-Mar-15	20-Mar-20
Jorge	Naveiro	EPA-Lead Renovator Initial	17-Nov-17	17-Nov-22
Richard	Nedorost	EPA-Lead Renovator Refresher	10-Mar-15	10-Mar-20
Ernest	Neven	EPA-Lead Renovator Initial	20-Mar-18	20-Mar-23
Scott	Ovington	EPA-Lead Renovator Refresher	28-Apr-15	28-Apr-20
Benjamin	Pak	EPA-Lead Renovator Initial	20-Apr-18	20-Apr-23
Vernon	Palmer	EPA-Lead Renovator Initial	01-Apr-15	01-Apr-20
Derek	Parker	EPA-Lead Renovator Refresher	20-Mar-15	20-Mar-20
Percy	Payno	EPA-Lead Renovator Initial	01-Apr-15	01-Apr-20
Jose	Perez	EPA-Lead Renovator Refresher	20-Mar-15	20-Mar-20
Edward	Perks	EPA-Lead Renovator Refresher	09-Mar-15	09-Mar-20
Salvatore	Perrone	EPA-Lead Renovator Refresher	20-Mar-15	20-Mar-20
John	Pilotti	EPA-Lead Renovator Refresher	10-Mar-15	10-Mar-20
Alfred	Pizzo	EPA-Lead Renovator Initial	20-Apr-18	20-Apr-23
James	Pizzo	EPA-Lead Renovator Initial	20-Mar-18	20-Mar-23
Ernest	Purvis	EPA-Lead Renovator Refresher	10-Mar-15	10-Mar-20
Kevin	Quigley	EPA-Lead Renovator Refresher	10-Mar-15	10-Mar-20
Luke	Quinn	EPA-Lead Renovator Refresher	20-Mar-15	20-Mar-20
Fred	Raskay	EPA-Lead Renovator Initial	20-Apr-18	20-Apr-23
Frank	Ratka, II	EPA-Lead Renovator Initial	20-Apr-18	20-Apr-23
Pat	Raynor	EPA-Lead Renovator Refresher	19-Mar-15	19-Mar-20
Jim	Reick	EPA-Lead Renovator Refresher	10-Mar-15	10-Mar-20
Michael	Reilly	EPA-Lead Renovator Refresher	10-Mar-15	10-Mar-20
Eric	Ricchezza	EPA-Lead Renovator Refresher	10-Mar-15	10-Mar-20
Shawn	Robinson	EPA-Lead Renovator Initial	01-Apr-15	01-Apr-20
Joseph	Ryan	EPA-Lead Renovator Refresher	10-Mar-15	10-Mar-20
Salvatore	Sansone	EPA-Lead Renovator Refresher	20-Mar-15	20-Mar-20
William	Savage	EPA-Lead Renovator Initial	20-Mar-18	20-Mar-23
Bruce	Savage	EPA-Lead Renovator Refresher	10-Mar-15	10-Mar-20
Ricky	Scarbrough, Sr.	EPA-Lead Renovator Refresher	09-Mar-15	09-Mar-20
Jeff	Schillig	EPA-Lead Renovator Refresher	20-Mar-15	20-Mar-20
Steven	Schmidt	EPA-Lead Renovator Refresher	02-Apr-15	02-Apr-20
Harry	Schmitt	EPA-Lead Renovator Refresher	19-Mar-15	19-Mar-20
Jeff	Scott	EPA-Lead Renovator Refresher	19-Mar-15	19-Mar-20

Tom	Sharer	EPA-Lead Renovator Refresher	20-Mar-15	20-Mar-20
David	Sienko	EPA-Lead Renovator Initial	17-Nov-17	17-Nov-22
Frank	Sienko	EPA-Lead Renovator Refresher	02-Apr-15	02-Apr-20
Gregory	Smith	EPA-Lead Renovator Refresher	19-Mar-15	19-Mar-20
William	Soda	EPA-Lead Renovator Initial	20-Apr-18	20-Apr-23
Raymond	Solley	EPA-Lead Renovator Refresher	20-Mar-15	20-Mar-20
Lukose	Solomon	EPA-Lead Renovator Refresher	21-May-15	21-May-20
Joseph	Stewart	EPA-Lead Renovator Refresher	21-May-15	21-May-20
Frank	Stramitis	EPA-Lead Renovator Refresher	10-Mar-15	10-Mar-20
Mario	Tamborello	EPA-Lead Renovator Initial	11-Aug-14	11-Aug-19
Christopher	Taylor	EPA-Lead Renovator Initial	30-Jul-14	30-Jul-19
Harry	Thomson	EPA-Lead Renovator Refresher	09-Mar-15	09-Mar-20
Ray	Tierney	EPA-Lead Renovator Refresher	02-Apr-15	02-Apr-20
Vincent	Tonelli	EPA-Lead Renovator Initial	17-Nov-17	17-Nov-22
Vincent	Trasatti	EPA-Lead Renovator Initial	20-Apr-18	20-Apr-23
Richard	Tremonte	EPA-Lead Renovator Refresher	20-Mar-15	20-Mar-20
Nicholas	Umile	EPA-Lead Renovator Initial	17-Nov-17	17-Nov-22
Gerald	Watson	EPA-Lead Renovator Refresher	19-Mar-15	19-Mar-20
Tim	Weicker	EPA-Lead Renovator Initial	20-Apr-18	20-Apr-23
Stephen	Weiss	EPA-Lead Renovator Initial	17-Nov-17	17-Nov-22
George	Weissman	EPA-Lead Renovator Initial	17-Nov-17	17-Nov-22
Lee	White, II	EPA-Lead Renovator Initial	20-Apr-18	20-Apr-23
William	Wilson	EPA-Lead Renovator Refresher	09-Mar-15	09-Mar-20
Timothy	Witczak	EPA-Lead Renovator Refresher	09-Mar-15	09-Mar-20
Denice	Witkowski	EPA-Lead Renovator Initial	17-Nov-17	17-Nov-22
Robert	Yerkov	EPA-Lead Renovator Refresher	10-Mar-15	10-Mar-20
Tim	Yust	EPA-Lead Renovator Refresher	10-Mar-15	10-Mar-20
Eric	Zeoli	EPA-Lead Renovator Refresher	10-Mar-15	10-Mar-20