

LEAD-BASED PAINT STABILIZATION
WALTER B. SAUL HIGH SCHOOL
7100 Henry Avenue
Philadelphia, Pennsylvania 19128
ULCS # 6040

prepared for:

THE SCHOOL DISTRICT OF PHILADELPHIA
OFFICE OF ENVIRONMENTAL MANAGEMENT
440 North Broad Street
3rd Floor
Philadelphia, Pennsylvania 19130

prepared by:

SYNERTECH ENVIRONMENTAL LLC
228 Moore Street
Philadelphia, Pennsylvania 19148
Project # 010-4813
EP2023-0134-6040

March 8, 2023

Prepared by:



Ryan Hutsell
Project Manager



TABLE OF CONTENTS

I. Introduction

II. Methods Executive Summary

A. Preliminary Steps

- i. Parent and Staff Notifications
- ii. Decluttering
- iii. Wall Hangings
- iv. Swing Space
- v. Facilities Building Cleaning Staff Training

B. Pre-Cleaning

C. Paint and Plaster Stabilization Procedures

- i. Work Practices
- ii. Oversight

D. Cleanup and Completion

- i. Cleanup
- ii. Testing

III. Oversight

A. Scope of Work

B. EPA Checklist

C. Oversight

D. Sample Results

Appendix A. Lead Safe Assessment Table

Appendix B. Scope of Work Table

Appendix C. EPA Checklist Form

Appendix D. Oversight Table

Appendix E. Lead Safe Certificate

Appendix F. Environmental Firm Certifications

Appendix G. Paint Contractor Certifications or Documentation of Training

Appendix H. Documentation of Parent and Staff Notifications



Summary of Lead-Based Paint Stabilization Activities
Walter B. Saul High School
7100 Henry Avenue
Philadelphia, PA 19128
UCLS #: 6040

I. Introduction

This report outlines the lead safe stabilization work performed by *the School District of Philadelphia* in various areas of the Walter B. Saul High School located at 7100 Henry Avenue, Philadelphia, Pennsylvania 19128. *Synertech Environmental LLC* provided environmental oversight and documentation of work areas, and verified they were done correctly in accordance with the EPA Renovation, Repair, and Painting Rule (RRP) *EPA-740-R-09-002*.

II. Methods Executive Summary

A. Preliminary Steps

i. Detailed Work Scope Determination

Synertech Environmental LLC generated a school-specific scope determination report which detailed the location and quantity of paint and plaster to be stabilized. This report was made available to the school's main office.

ii. Parent and Staff Notifications

A letter announcing the paint stabilization project and the EPA Lead RRP pamphlet was provided to the Principal to share with parents and staff. The letter is attached in *Appendix H*.

An email to the principal was sent by the Operations Division in advance of the start of work to announce the commencement of the project. This email was to determine logistical issues such as the school calendar, work schedule, storage and/or swing space, etc.

iii. Decluttering

Classrooms, closets, and other storage areas were decluttered prior to commencing stabilization work.

iv. Wall Hangings

Posters, bulletin boards, framed art, and other wall hangings were removed in order for the paint stabilization project to commence.

v. *Swing Space*

The identification of swing space was required to ensure that classrooms were available during the school year. A plan was created on a school-specific basis to relocate students and teachers from classrooms during the course of this work. All work areas were scheduled for cleaning by facilities staff after the paint stabilization work by Maintenance.

vi. *Facilities Building Cleaning Staff Training*

Cleaning staff was provided with information about this project and expectations for post-cleaning.

B. Pre-Cleaning

On an as-needed basis for areas such as cluttered storage closets that required extensive movement of materials as well as HEPA vacuuming and wet wiping prior to paint and plaster stabilization, the Maintenance Environmental staff performed a pre-cleaning. This process provided a clean work area prior to decluttering and stabilization.

C. Paint and Plaster Stabilization Procedures

i. *Work Practices*

Paint and plaster stabilization work complied with the EPA's Lead RRP Rule. All staff conducting this work was trained and/or certified as Lead RRP Workers. The following procedures were followed:

- Work areas were isolated to restrict dust from impacting adjacent areas.
- Signs/notifications were posted as per EPA Lead RRP.
- "Walk-off" pads were placed at all access points into/out of work area.
- All openings (windows, doors, HVAC system registers/grilles) inside work areas were sealed as per direction from on-site environmental monitors and consisted with the EPA Lead RRP Rules & Guidelines.
- Workers wore disposable clothing and foot coverings while inside work areas.
- All remaining objects in work areas were moved to the center and covered with plastic.
- Portable dust containment barrier systems were erected to limit the size of work areas requiring post-cleaning and limit testing and exposure.
- Plastic floor coverings were extended at least 6 feet out from vertical surfaces being stabilized unless utilizing vertical barriers/containment systems.
- All paint stabilization work was performed in compliance with the EPA Lead RRP Rules & Guidelines, and as per the directions of on-site environmental monitors to minimize dust contamination.

- The contractor took all steps necessary to ensure that no dust or debris left the work area while the work was being performed.
- The contractor took all precautions to ensure that all employees, tools, and other items, including the exteriors of waste containers, were free of dust and debris before leaving the work area.
- The contractor collected all paint chips and debris, folded up plastic floor coverings and any other plastic sheeting used on horizontal surfaces, without dispersing dust or debris and disposed of the material in heavy duty plastic waste bags.
- No power tools were used.
- No dry sweeping with brooms was allowed.
- Water and misting were used to minimize dust.
- HEPA vacuums and wet-wiping/cleaning techniques were employed

ii. *Oversight*

An environmental technician was on-site to oversee paint and plaster stabilization work to ensure compliance with lead safe work practices. An EPA RRP compliance checklist (*Appendix B*) and an oversight checklist (*Appendix C*) were completed at the end of every shift to record the work areas that were stabilized. The following tasks were verified and recorded:

- Pre-cleaning
- Contents moved
- Work area prepped
- Surfaces stabilized
- Contents put back in place
- Final inspection approval and photos

D. Cleanup & Completion

i. *Cleanup*

- Upon completion of stabilization, there were no signs of loose, peeling, flaking, bubbling, or crumbling paint or plaster visible on walls or ceilings or on any other painted surfaces.
- There were no visible signs of paint chips, debris or dust of any kind on surfaces with “contained” and isolated work areas NOR outside of the contained and isolated work areas.
- Window sills, floors, baseboards, shelving units, tops of cabinets, desks, chairs, tables, and all other horizontal surfaces were observed to be free of any visible signs of paint and plaster dust and/or debris.
- There were no visible signs of paint chips, and/or paint/plaster dust or debris on academic/educational materials, including books, bins, toys, desks, chairs, carpets, papers, etc., after each work shift and to allow for re-occupancy the next day.
- Any remaining paint and plaster were observed to be tightly adhered to wall and ceiling surfaces such that it could not be further damaged, pried off, or disturbed by “simple fingernail pressure.”

ii. Testing

- Qualitative testing was conducted to verify that stabilization work was performed in accordance with lead safe work practices, and that classrooms were safe for re-occupancy by children and staff.

E. Testing Protocol

i. EPA RRP Verification Wipes

Synertech Environmental LLC, an environmental consulting firm, and the painter foreman coordinated the EPA RRP Verification Test Wipe in rooms/areas that had been stabilized and cleaned, and where plastic work area coverings were removed and visually inspected.

ii. Response to Failed Tests

If an RRP Verification Wipe “fails,” then the 40 SF area will be re-wiped by EPA RRP Wipes. The process will continue until both testing methods confirm a “pass.”

iii. Release of Spaces Back to School/Operations

Once it was determined that EPA RRP wipes were acceptable as determined on-site by the environmental technician, and if work was completed in accordance with this procedure, the room was turned over to the District’s Operationsteam for “deep cleaning” and then for re-occupancy.

III. Oversight

A. Scope of Work

A comprehensive Paint and Plaster Scope of Work (*Appendix A*) was determined on September 12th-October 4th, 2022. This working scope identified room-by-room locations and quantities of paint and plaster stabilization needed throughout the Walter B. Saul High School, and was made available to the school's main office.

B. EPA Checklist

The on-site environmental technician updated a checklist provided by the EPA (*Appendix B*) in an effort to contain and minimize dust within a work area. In addition to work area cleanliness, the EPA checklist accounts for visual inspections of the work area as well as qualitative and quantitative testing records.

C. Oversight

Synertech Environmental LLC was dispatched to the Walter B. Saul High School at 3pm on Monday February 6th, 2023 to provide renovation oversight. An on-site environmental technician was present through the entirety of the project to oversee paint and plaster stabilization work to ensure compliance with lead safe work practices. Each shift, an oversight report was updated, in which the following tasks were verified and recorded:

- Pre-cleaning
- Contents Moved
- Work Area Prepped
- Surfaces Stabilized
- Contents Back in Place
- Final Inspection Approval

D. Sample Results

Synertech Environmental LLC used qualitative testing techniques in accordance with the EPA's RRP Protocol to ensure that each work area was safe to turn back over to the school for re-occupancy, as detailed in Section II. E.

Thank you for allowing *Synertech Environmental LLC* to continue to provide The School District of Philadelphia with our professional environmental services. If you have any questions please do not hesitate to contact *Synertech Environmental LLC* at 215-755-2305.

Sincerely,

Synertech Environmental LLC



Ryan Hutsell
Project Manager

Appendix A

Lead Safe Assessment Table

					Dates: 9/12/22 - 10/4/22		Lead-Safe Certification Assessment Report							
					Inspector Name and Certificate Number: Jennifer Drialo-006767/ Steve Merlino- 006800		6040 Walter Biddle Saul HS/Manatawna Farm							
					Inspection Company: Synertech		7100 Henry Avenue, Philadelphia, PA 19128							
ULCS#	E l e m e n t	BldgElmt ID	F l o o r	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/ negative)
6040	1	B604001-1	1	108-1	Student Restrooms - Male (4-12)	1st Floor Boy's Restroom	yes	Door Case	Metal	Pink	Friction	10	0	Negative
6040	1	B604001-1	1	108-1	Student Restrooms - Male (4-12)	1st Floor Boy's Restroom	yes	W1	Concrete	Tan	None	0	0	Negative
6040	1	B604001-1	1	108-1	Student Restrooms - Male (4-12)	1st Floor Boy's Restroom	yes	W2	Concrete	Tan	None	0	0	Negative
6040	1	B604001-1	1	108-1	Student Restrooms - Male (4-12)	1st Floor Boy's Restroom	yes	W3	Concrete	Tan	None	0	0	Negative
6040	1	B604001-1	1	108-1	Student Restrooms - Male (4-12)	1st Floor Boy's Restroom	yes	Pipe	Metal	Tan	Flaking	10	0.15	Negative
6040	1	B604001-1	1	108-1	Student Restrooms - Male (4-12)	1st Floor Boy's Restroom	yes	Door	Metal	Brown	None	0	0	Negative
6040	1	B604001-1	1	108-1	Student Restrooms - Male (4-12)	1st Floor Boy's Restroom	yes	Door Case	Metal	Brown	None	0	0.8	Positive
6040	1	B604001-1	1	108-1	Student Restrooms - Male (4-12)	1st Floor Boy's Restroom	yes	Push Bar	Metal	Grey	None	0	0	Negative
6040	1	B604001-1	1	108-1	Student Restrooms - Male (4-12)	1st Floor Boy's Restroom	yes	W4	Concrete	Tan	None	0	0	Negative
6040	1	B604001-1	1	108-1	Student Restrooms - Male (4-12)	1st Floor Boy's Restroom	yes	Ceiling	Concrete	White	Moisture Damage	3	0	Negative
6040	1	B604001-1	1	107-1	Student Restrooms - Female (4-12)	1st Floor Girl's Restroom	yes	Door Case	Metal	Pink	Friction	12	0.1	Negative
6040	1	B604001-1	1	107-1	Student Restrooms - Female (4-12)	1st Floor Girl's Restroom	yes	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	1	107-1	Student Restrooms - Female (4-12)	1st Floor Girl's Restroom	yes	W1	Concrete	Yellow	None	0	0	Negative
6040	1	B604001-1	1	107-1	Student Restrooms - Female (4-12)	1st Floor Girl's Restroom	yes	W2	Concrete	Yellow	None	0	0	Negative
6040	1	B604001-1	1	107-1	Student Restrooms - Female (4-12)	1st Floor Girl's Restroom	yes	Pipe	Metal	Yellow	Flaking	5	0	Negative
6040	1	B604001-1	1	107-1	Student Restrooms - Female (4-12)	1st Floor Girl's Restroom	yes	W3	Concrete	Yellow	None	0	0	Negative
6040	1	B604001-1	1	107-1	Student Restrooms - Female (4-12)	1st Floor Girl's Restroom	yes	Door Case	Metal	Brown	None	0	1.2	Positive
6040	1	B604001-1	1	107-1	Student Restrooms - Female (4-12)	1st Floor Girl's Restroom	yes	Door	Metal	Brown	None	0	0	Negative

					Dates: 9/12/22 - 10/4/22		Lead-Safe Certification Assessment Report							
					Inspector Name and Certificate Number: Jennifer Drialo-006767/ Steve Merlino- 006800		6040 Walter Biddle Saul HS/Manatawna Farm							
					Inspection Company: Synertech		7100 Henry Avenue, Philadelphia, PA 19128							
ULCS#	Element	BldgElmt ID	Floor	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
6040	1	B604001-1	1	107-1	Student Restrooms - Female (4-12)	1st Floor Girl's Restroom	yes	W4	Concrete	Yellow	None	0	0	Negative
6040	1	B604001-1	1	107-1	Student Restrooms - Female (4-12)	1st Floor Girl's Restroom	yes	Ceiling	Concrete	White	None	0	0	Negative
6040	1	B604001-1	1	H13	Circulation (Hallway)	1st Floor Main Hallway	yes	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	1	H13	Circulation (Hallway)	1st Floor Main Hallway	yes	W1	Concrete	Tan	None	0	0	Negative
6040	1	B604001-1	1	H13	Circulation (Hallway)	1st Floor Main Hallway	yes	W2	Concrete	Tan	None	0	0	Negative
6040	1	B604001-1	1	H13	Circulation (Hallway)	1st Floor Main Hallway	yes	W3	Concrete	Tan	None	0	0	Negative
6040	1	B604001-1	1	H13	Circulation (Hallway)	1st Floor Main Hallway	yes	W4	Concrete	Tan	None	0	0	Negative
6040	1	B604001-1	1	H13	Circulation (Hallway)	1st Floor Main Hallway	yes	Ceiling	Concrete	White	None	0	0	Negative
6040	1	B604001-1	1	106-1	Restrooms, Staff - Male	1st Floor Men's Restroom	yes	Floor	Concrete	Grey	None	0	0	Negative
6040	1	B604001-1	1	106-1	Restrooms, Staff - Male	1st Floor Men's Restroom	yes	W1	Concrete	Tan	None	0	0	Negative
6040	1	B604001-1	1	106-1	Restrooms, Staff - Male	1st Floor Men's Restroom	yes	W2	Concrete	Tan	None	0	0	Negative
6040	1	B604001-1	1	106-1	Restrooms, Staff - Male	1st Floor Men's Restroom	yes	W3	Concrete	Tan	None	0	0	Negative
6040	1	B604001-1	1	106-1	Restrooms, Staff - Male	1st Floor Men's Restroom	yes	W4	Concrete	Tan	None	0	0	Negative
6040	1	B604001-1	1	106-1	Restrooms, Staff - Male	1st Floor Men's Restroom	yes	Ductwork	Metal	Tan	None	0	0	Negative
6040	1	B604001-1	1	106-1	Restrooms, Staff - Male	1st Floor Men's Restroom	yes	Pipe	Metal	Tan	None	0	0.14	Negative
6040	1	B604001-1	1	106-1	Restrooms, Staff - Male	1st Floor Men's Restroom	yes	Ceiling	Concrete	White	None	0	0	Negative
6040	1	B604001-1	1	113-1	Restrooms, Staff - Female	1st Floor Women's Restroom	yes	Floor	Concrete	Grey	None	0	0	Negative
6040	1	B604001-1	1	113-1	Restrooms, Staff - Female	1st Floor Women's Restroom	yes	W1	Concrete	Tan	None	0	0	Negative
6040	1	B604001-1	1	113-1	Restrooms, Staff - Female	1st Floor Women's Restroom	yes	W2	Concrete	Tan	None	0	0	Negative
6040	1	B604001-1	1	113-1	Restrooms, Staff - Female	1st Floor Women's Restroom	yes	W3	Concrete	Tan	None	0	0	Negative
6040	1	B604001-1	1	113-1	Restrooms, Staff - Female	1st Floor Women's Restroom	yes	W4	Concrete	Tan	None	0	0	Negative
6040	1	B604001-1	1	113-1	Restrooms, Staff - Female	1st Floor Women's Restroom	yes	Ductwork	Metal	Tan	None	0	0	Negative
6040	1	B604001-1	1	113-1	Restrooms, Staff - Female	1st Floor Women's Restroom	yes	Pipe	Metal	Tan	None	0	0.11	Negative
6040	1	B604001-1	1	113-1	Restrooms, Staff - Female	1st Floor Women's Restroom	yes	Ceiling	Concrete	White	None	0	0	Negative
6040	1	B604001-1	1	100-1	Senior High	Classroom 100	yes	Door Case	Metal	Brown	Friction	11	0	Negative
6040	1	B604001-1	1	100-1	Senior High	Classroom 100	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	1	100-1	Senior High	Classroom 100	yes	W1	Concrete	White	None	0	0	Negative
6040	1	B604001-1	1	100-1	Senior High	Classroom 100	yes	TeleBox	Metal	Brown	None	0	0	Negative

					Dates: 9/12/22 - 10/4/22		Lead-Safe Certification Assessment Report							
					Inspector Name and Certificate Number: Jennifer Drialo-006767/ Steve Merlino- 006800		6040 Walter Biddle Saul HS/Manatawna Farm							
					Inspection Company: Synertech		7100 Henry Avenue, Philadelphia, PA 19128							
ULCS#	E l e m e n t	BldgElmt ID	F l o o r	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/ negative)
6040	1	B604001-1	1	100-1	Senior High	Classroom 100	yes	Chalkboard Casing	Metal	Brown	Friction	7	0	Negative
6040	1	B604001-1	1	100-1	Senior High	Classroom 100	yes	W2	Wood	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	1	100-1	Senior High	Classroom 100	yes	W3	Concrete	Green	None	0	0	Negative
6040	1	B604001-1	1	100-1	Senior High	Classroom 100	yes	Column	Concrete	Tan	None	3	0	Negative
6040	1	B604001-1	1	100-1	Senior High	Classroom 100	yes	Unit-Ventilator	Metal	Grey	None	0	0	Negative
6040	1	B604001-1	1	100-1	Senior High	Classroom 100	yes	W4	Concrete	White	None	0	0	Negative
6040	1	B604001-1	1	100-1	Senior High	Classroom 100	yes	Chalkboard Casing	Metal	Brown	None	0	0	Negative
6040	1	B604001-1	1	100-1	Senior High	Classroom 100	yes	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	1	100-1	Senior High	Classroom 100	yes	Beam	Concrete	White	None	0	0	Negative
6040	1	B604001-1	1	100A-1	Storage	Classroom 100 Closet	yes	Door Case	Metal	Brown	Friction	6	0	Negative
6040	1	B604001-1	1	100A-1	Storage	Classroom 100 Closet	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	1	100A-1	Storage	Classroom 100 Closet	yes	W1	Concrete	Tan	None	0	0	Negative
6040	1	B604001-1	1	100A-1	Storage	Classroom 100 Closet	yes	W2	Concrete	Tan	None	0	0	Negative
6040	1	B604001-1	1	100A-1	Storage	Classroom 100 Closet	yes	W3	Concrete	Tan	None	0	0	Negative
6040	1	B604001-1	1	100A-1	Storage	Classroom 100 Closet	yes	W4	Concrete	Tan	None	0	0	Negative
6040	1	B604001-1	1	100A-1	Storage	Classroom 100 Closet	yes	Shelf	Wood	Tan	Friction	5	1.1	Positive
6040	1	B604001-1	1	100A-1	Storage	Classroom 100 Closet	yes	Ceiling	Concrete	Tan	None	0	0	Negative
6040	1	B604001-1	1	102	Senior High	Classroom 102	yes	Door Case	Metal	Brown	Friction	10	0	Negative
6040	1	B604001-1	1	102	Senior High	Classroom 102	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	1	102	Senior High	Classroom 102	yes	W1	Concrete	Blue	None	0	0	Negative
6040	1	B604001-1	1	102	Senior High	Classroom 102	yes	TeleBox	Metal	Brown	None	0	0	Negative
6040	1	B604001-1	1	102	Senior High	Classroom 102	yes	Chalkboard Casing	Metal	Brown	Friction	8	0	Negative
6040	1	B604001-1	1	102	Senior High	Classroom 102	yes	W2	Wood	Tan	None	0	0	Negative
6040	1	B604001-1	1	102	Senior High	Classroom 102	yes	W3	Concrete	Blue	None	0	0	Negative
6040	1	B604001-1	1	102	Senior High	Classroom 102	yes	Column	Concrete	Tan	None	0	0	Negative
6040	1	B604001-1	1	102	Senior High	Classroom 102	yes	Unit-Ventilator	Metal	Grey	None	0	0	Negative
6040	1	B604001-1	1	102	Senior High	Classroom 102	yes	W4	Wood	Tan	None	0	0	Negative
6040	1	B604001-1	1	102	Senior High	Classroom 102	yes	Chalkboard Casing	Metal	Brown	Friction	12	0	Negative
6040	1	B604001-1	1	102	Senior High	Classroom 102	yes	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	1	102	Senior High	Classroom 102	yes	Beam	Concrete	White	Chipping	2	0	Negative
6040	1	B604001-1	1	102A	Storage	Classroom 102 Closet	yes	Door Case	Metal	Brown	Friction	4	0	Negative
6040	1	B604001-1	1	102A	Storage	Classroom 102 Closet	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	1	102A	Storage	Classroom 102 Closet	yes	W1	Concrete	Tan	None	0	0	Negative
6040	1	B604001-1	1	102A	Storage	Classroom 102 Closet	yes	W2	Concrete	Tan	None	0	0	Negative
6040	1	B604001-1	1	102A	Storage	Classroom 102 Closet	yes	W3	Concrete	Tan	None	0	0	Negative
6040	1	B604001-1	1	102A	Storage	Classroom 102 Closet	yes	W4	Concrete	Tan	None	0	0	Negative
6040	1	B604001-1	1	102A	Storage	Classroom 102 Closet	yes	Shelf	Wood	Tan	Friction	4	1.1	Positive
6040	1	B604001-1	1	103-1	Senior High	Classroom 103	yes	Door Case	Metal	Brown	Friction	14	0	Negative
6040	1	B604001-1	1	103-1	Senior High	Classroom 103	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	1	103-1	Senior High	Classroom 103	yes	W1	Concrete	Yellow	None	0	0	Negative
6040	1	B604001-1	1	103-1	Senior High	Classroom 103	yes	TeleBox	Metal	Grey	None	0	0	Negative
6040	1	B604001-1	1	103-1	Senior High	Classroom 103	yes	W2	Concrete	Yellow	None	N/A	N/A	N/A
6040	1	B604001-1	1	103-1	Senior High	Classroom 103	yes	W3	Concrete	Yellow	None	0	0	Negative
6040	1	B604001-1	1	103-1	Senior High	Classroom 103	yes	Column	Concrete	Yellow	None	3	0	Negative
6040	1	B604001-1	1	103-1	Senior High	Classroom 103	yes	Unit-Ventilator	Metal	Grey	None	0	0	Negative
6040	1	B604001-1	1	103-1	Senior High	Classroom 103	yes	W4	Concrete	Yellow	None	0	0	Negative
6040	1	B604001-1	1	103-1	Senior High	Classroom 103	yes	Ceiling	Concrete	White	None	0	0	Negative
6040	1	B604001-1	1	103-1	Senior High	Classroom 103	yes	Beam	Concrete	White	Chipping	2	0	Negative
6040	1	B604001-1	1	103B	Storage	Classroom 103 Closet	yes	Door Case	Metal	Brown	Friction	9	0	Negative

						Dates: 9/12/22 - 10/4/22		Lead-Safe Certification Assessment Report						
						Inspector Name and Certificate Number: Jennifer Drialo-006767/ Steve Merlino- 006800		6040 Walter Biddle Saul HS/Manatawna Farm						
						Inspection Company: Synertech		7100 Henry Avenue, Philadelphia, PA 19128						
ULCS#	E l e m e n t	BldgElmt ID	F l o o r	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/ negative)
6040	1	B604001-1	1	103B	Storage	Classroom 103 Closet	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	1	103B	Storage	Classroom 103 Closet	yes	W1	Concrete	Green	None	0	0	Negative
6040	1	B604001-1	1	103B	Storage	Classroom 103 Closet	yes	W2	Concrete	Green	None	0	0	Negative
6040	1	B604001-1	1	103B	Storage	Classroom 103 Closet	yes	W3	Concrete	Green	None	0	0	Negative
6040	1	B604001-1	1	103B	Storage	Classroom 103 Closet	yes	Pipe	Metal	Green	None	0	0.12	Negative
6040	1	B604001-1	1	103B	Storage	Classroom 103 Closet	yes	W4	Concrete	Green	None	0	0	Negative
6040	1	B604001-1	1	103B	Storage	Classroom 103 Closet	yes	Shelf	Wood	Tan	Friction	6	1.1	Positive
6040	1	B604001-1	1	104-1	Senior High	Classroom 104	yes	Door Case	Metal	Brown	Friction	8	0	Negative
6040	1	B604001-1	1	104-1	Senior High	Classroom 104	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	1	104-1	Senior High	Classroom 104	yes	W1	Concrete	Tan	None	0	0	Negative
6040	1	B604001-1	1	104-1	Senior High	Classroom 104	yes	TeleBox	Metal	Brown	None	0	0	Negative
6040	1	B604001-1	1	104-1	Senior High	Classroom 104	yes	Chalkboard Casing	Metal	Brown	Friction	12	0	Negative
6040	1	B604001-1	1	104-1	Senior High	Classroom 104	yes	W2	Concrete	Tan	None	0	N/A	N/A
6040	1	B604001-1	1	104-1	Senior High	Classroom 104	yes	Chalkboard Casing	Metal	Brown	Friction	3	0	Negative
6040	1	B604001-1	1	104-1	Senior High	Classroom 104	yes	W3	Concrete	Tan	None	0	0	Negative
6040	1	B604001-1	1	104-1	Senior High	Classroom 104	yes	Column	Concrete	Tan	Chipping	2	0	Negative
6040	1	B604001-1	1	104-1	Senior High	Classroom 104	yes	Unit-Ventilator	Metal	Grey	None	0	0	Negative
6040	1	B604001-1	1	104-1	Senior High	Classroom 104	yes	W4	Wood	N/A	None	N/A	N/A	N/A
6040	1	B604001-1	1	104-1	Senior High	Classroom 104	yes	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	1	104-1	Senior High	Classroom 104	yes	Beam	Concrete	White	Chipping	2	0	Negative
6040	1	B604001-1	1	104-1	Senior High	Classroom 104	yes	Door Case	Metal	Pink	None	0	0	Negative
6040	1	B604001-1	1	104A	Storage	Classroom 104 Closet	yes	Door Case	Metal	Brown	None	0	0	Negative
6040	1	B604001-1	1	104A	Storage	Classroom 104 Closet	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	1	104A	Storage	Classroom 104 Closet	yes	W1	Concrete	Tan	None	0	0	Negative
6040	1	B604001-1	1	104A	Storage	Classroom 104 Closet	yes	W2	Concrete	Tan	None	0	0	Negative
6040	1	B604001-1	1	104A	Storage	Classroom 104 Closet	yes	W3	Concrete	Tan	None	0	0	Negative
6040	1	B604001-1	1	104A	Storage	Classroom 104 Closet	yes	W4	Concrete	Tan	None	0	0	Negative
6040	1	B604001-1	1	104A	Storage	Classroom 104 Closet	yes	Shelf	Wood	Tan	Friction	4	1.4	Positive
6040	1	B604001-1	1	107A-1	Service Closets	Custodial Closet adjacent to Boy's Restroom	yes	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	1	107A-1	Service Closets	Custodial Closet adjacent to Boy's Restroom	yes	W1	Concrete	Tan	None	0	0	Negative
6040	1	B604001-1	1	107A-1	Service Closets	Custodial Closet adjacent to Boy's Restroom	yes	W2	Concrete	Tan	None	0	0	Negative
6040	1	B604001-1	1	107A-1	Service Closets	Custodial Closet adjacent to Boy's Restroom	yes	W3	Concrete	Tan	None	0	0	Negative
6040	1	B604001-1	1	107A-1	Service Closets	Custodial Closet adjacent to Boy's Restroom	yes	Shelf	Wood	Tan	Friction	4	0	Negative
6040	1	B604001-1	1	107A-1	Service Closets	Custodial Closet adjacent to Boy's Restroom	yes	W4	Concrete	Tan	None	0	0	Negative
6040	1	B604001-1	1	107A-1	Service Closets	Custodial Closet adjacent to Boy's Restroom	yes	Ceiling	Concrete	White	None	0	0	Negative
6040	1	B604001-1	1	107B-1	Pipe Chase	Pipe Chase in Custodial Closet adjacent to Boy's Restroom	no	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	1	107B-1	Pipe Chase	Pipe Chase in Custodial Closet adjacent to Boy's Restroom	no	W1	Concrete	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	1	107B-1	Pipe Chase	Pipe Chase in Custodial Closet adjacent to Boy's Restroom	no	W2	Concrete	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	1	107B-1	Pipe Chase	Pipe Chase in Custodial Closet adjacent to Boy's Restroom	no	W3	Concrete	N/A	N/A	N/A	N/A	N/A

						Dates: 9/12/22 - 10/4/22		Lead-Safe Certification Assessment Report						
						Inspector Name and Certificate Number: Jennifer Drialo-006767/ Steve Merlino- 006800		6040 Walter Biddle Saul HS/Manatawna Farm						
						Inspection Company: Synertech		7100 Henry Avenue, Philadelphia, PA 19128						
ULCS#	Element	BldgElmt ID	Floor	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
6040	1	B604001-1	1	107B-1	Pipe Chase	Pipe Chase in Custodial Closet adjacent to Boy's Restroom	no	W4	Concrete	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	1	107B-1	Pipe Chase	Pipe Chase in Custodial Closet adjacent to Boy's Restroom	no	Ceiling	Concrete	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	1	S14	Stairs	Down Stairwell	yes	Door	Metal	Brown	Friction	10	0	Negative
6040	1	B604001-1	1	S14	Stairs	Down Stairwell	yes	Door Case	Metal	Brown	Friction	18	0.14	Negative
6040	1	B604001-1	1	S14	Stairs	Down Stairwell	yes	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	1	S14	Stairs	Down Stairwell	yes	Handrail	Metal	Grey	Friction	2	0	Negative
6040	1	B604001-1	1	S14	Stairs	Down Stairwell	yes	Baluster	Metal	Grey	None	0	0	Negative
6040	1	B604001-1	1	S14	Stairs	Down Stairwell	yes	Tread	Concrete	Grey	Friction	4	0	Negative
6040	1	B604001-1	1	S14	Stairs	Down Stairwell	yes	Closed Stringer	Metal	Grey	None	0	2.1	Positive
6040	1	B604001-1	1	S14	Stairs	Down Stairwell	yes	Riser	Metal	Grey	None	0	1.2	Positive
6040	1	B604001-1	1	S14	Stairs	Down Stairwell	yes	Open Stringer	Metal	Grey	None	0	2.1	Positive
6040	1	B604001-1	1	S14	Stairs	Down Stairwell	yes	Under Carriage	Metal	Red	None	0	2.3	Positive
6040	1	B604001-1	1	S14	Stairs	Down Stairwell	yes	W1	Concrete	White	None	0	0	Negative
6040	1	B604001-1	1	S14	Stairs	Down Stairwell	yes	W2	Concrete	White	None	0	0	Negative
6040	1	B604001-1	1	S14	Stairs	Down Stairwell	yes	W3	Concrete	White	None	0	0	Negative
6040	1	B604001-1	1	S14	Stairs	Down Stairwell	yes	W4	Concrete	White	None	0	0	Negative
6040	1	B604001-1	1	S14	Stairs	Down Stairwell	yes	Ceiling	Concrete	White	None	0	0	Negative
6040	1	B604001-1	1	H13A	Circulation (Hallway)	Hallway outside Home and School Office	yes	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	1	H13A	Circulation (Hallway)	Hallway outside Home and School Office	yes	W1	Concrete	Tan	None	0	0	Negative
6040	1	B604001-1	1	H13A	Circulation (Hallway)	Hallway outside Home and School Office	yes	W2	Concrete	Tan	None	0	0	Negative
6040	1	B604001-1	1	H13A	Circulation (Hallway)	Hallway outside Home and School Office	yes	W3	Concrete	Tan	None	0	0	Negative
6040	1	B604001-1	1	H13A	Circulation (Hallway)	Hallway outside Home and School Office	yes	W4	Concrete	Tan	None	0	0	Negative
6040	1	B604001-1	1	H13A	Circulation (Hallway)	Hallway outside Home and School Office	yes	Ceiling	Concrete	White	None	0	0	Negative
6040	1	B604001-1	1	105-1	Administrative Office	Home and School Office	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	1	105-1	Administrative Office	Home and School Office	yes	Door	Metal	Brown	None	0	0	Negative
6040	1	B604001-1	1	105-1	Administrative Office	Home and School Office	yes	Door Case	Metal	Brown	Friction	8	0	Negative
6040	1	B604001-1	1	105-1	Administrative Office	Home and School Office	yes	W1	Concrete	Tan	None	0	0	Negative
6040	1	B604001-1	1	105-1	Administrative Office	Home and School Office	yes	W2	Concrete	Tan	None	0	0	Negative
6040	1	B604001-1	1	105-1	Administrative Office	Home and School Office	yes	W3	Concrete	Tan	None	0	0	Negative
6040	1	B604001-1	1	105-1	Administrative Office	Home and School Office	yes	Column	Concrete	Tan	Chipping	1	0	Negative
6040	1	B604001-1	1	105-1	Administrative Office	Home and School Office	yes	W4	Concrete	Tan	None	0	0	Negative
6040	1	B604001-1	1	105-1	Administrative Office	Home and School Office	yes	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	1	H14	Circulation (Hallway)	Main Entrance Hallway	yes	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	1	H14	Circulation (Hallway)	Main Entrance Hallway	yes	Door	Metal	Brown	Friction	5	0	Negative

					Dates: 9/12/22 - 10/4/22		Lead-Safe Certification Assessment Report							
					Inspector Name and Certificate Number: Jennifer Drialo-006767/ Steve Merlino- 006800		6040 Walter Biddle Saul HS/Manatawna Farm							
					Inspection Company: Synertech		7100 Henry Avenue, Philadelphia, PA 19128							
ULCS#	Element	BldgElmt ID	Floor	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
6040	1	B604001-1	1	H14	Circulation (Hallway)	Main Entrance Hallway	yes	Door Case	Metal	Brown	Friction	12	0.13	Negative
6040	1	B604001-1	1	H14	Circulation (Hallway)	Main Entrance Hallway	yes	W2	Brick	Tan	None	0	0	Negative
6040	1	B604001-1	1	H14	Circulation (Hallway)	Main Entrance Hallway	yes	Bulletin Board	Wood	Tan	None	0	0	Negative
6040	1	B604001-1	1	H14	Circulation (Hallway)	Main Entrance Hallway	yes	Door	Metal	Brown	Friction	6	0	Negative
6040	1	B604001-1	1	H14	Circulation (Hallway)	Main Entrance Hallway	yes	Door Case	Metal	Brown	Friction	10	0.1	Negative
6040	1	B604001-1	1	H14	Circulation (Hallway)	Main Entrance Hallway	yes	W4	Brick	Tan	None	0	0	Negative
6040	1	B604001-1	1	H14	Circulation (Hallway)	Main Entrance Hallway	yes	Access Panel	Metal	Tan	None	0	0	Negative
6040	1	B604001-1	1	H14	Circulation (Hallway)	Main Entrance Hallway	yes	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	1	H14	Circulation (Hallway)	Main Entrance Hallway	yes	Beam	Concrete	White	Chipping	2	0	Negative
6040	1	B604001-1	1	110-1	General Administrative Space	Main Office	yes	Door Case	Metal	White	None	0	0	Negative
6040	1	B604001-1	1	110-1	General Administrative Space	Main Office	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	1	110-1	General Administrative Space	Main Office	yes	W1	Concrete	Green	None	0	0	Negative
6040	1	B604001-1	1	110-1	General Administrative Space	Main Office	yes	Window Case	Metal	White	None	0	0	Negative
6040	1	B604001-1	1	110-1	General Administrative Space	Main Office	yes	W2	Concrete	Green	None	0	0	Negative
6040	1	B604001-1	1	110-1	General Administrative Space	Main Office	yes	Shelf	Wood	White	None	0	0	Negative
6040	1	B604001-1	1	110-1	General Administrative Space	Main Office	yes	W3	Concrete	Green	None	0	0	Negative
6040	1	B604001-1	1	110-1	General Administrative Space	Main Office	yes	Column	Concrete	Green	None	0	0	Negative
6040	1	B604001-1	1	110-1	General Administrative Space	Main Office	yes	W4	Concrete	Green	None	0	0	Negative
6040	1	B604001-1	1	110-1	General Administrative Space	Main Office	yes	Electric Panel	Metal	Green	None	0	0	Negative
6040	1	B604001-1	1	110-1	General Administrative Space	Main Office	yes	Conduit	Metal	Green	None	0	0	Negative
6040	1	B604001-1	1	110-1	General Administrative Space	Main Office	yes	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A

					Dates: 9/12/22 - 10/4/22		Lead-Safe Certification Assessment Report							
					Inspector Name and Certificate Number: Jennifer Drialo-006767/ Steve Merlino- 006800		6040 Walter Biddle Saul HS/Manatawna Farm							
					Inspection Company: Synertech		7100 Henry Avenue, Philadelphia, PA 19128							
ULCS#	Element	BldgElmt ID	Floor	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
6040	1	B604001-1	1	110-1	General Administrative Space	Main Office	yes	Beam	Concrete	White	None	0	0	Negative
6040	1	B604001-1	1	110A	Storage	Main Office Large Closet	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	1	110A	Storage	Main Office Large Closet	yes	W1	Concrete	Yellow	None	0	0	Negative
6040	1	B604001-1	1	110A	Storage	Main Office Large Closet	yes	W2	Concrete	Yellow	None	0	0	Negative
6040	1	B604001-1	1	110A	Storage	Main Office Large Closet	yes	W3	Concrete	Yellow	None	0	0	Negative
6040	1	B604001-1	1	110A	Storage	Main Office Large Closet	yes	W4	Concrete	Yellow	None	0	0	Negative
6040	1	B604001-1	1	110A	Storage	Main Office Large Closet	yes	Ceiling	Concrete	White	None	0	0	Negative
6040	1	B604001-1	1	110B	Restrooms, Staff - Male/Female	Main Office Restroom	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	1	110B	Restrooms, Staff - Male/Female	Main Office Restroom	yes	W1	Brick	Tan	None	0	0	Negative
6040	1	B604001-1	1	110B	Restrooms, Staff - Male/Female	Main Office Restroom	yes	W1	Concrete	Tan	None	0	0	Negative
6040	1	B604001-1	1	110B	Restrooms, Staff - Male/Female	Main Office Restroom	yes	W2	Brick	Tan	None	0	0	Negative
6040	1	B604001-1	1	110B	Restrooms, Staff - Male/Female	Main Office Restroom	yes	W2	Concrete	Tan	None	0	0	Negative
6040	1	B604001-1	1	110B	Restrooms, Staff - Male/Female	Main Office Restroom	yes	W3	Brick	Tan	None	0	0	Negative
6040	1	B604001-1	1	110B	Restrooms, Staff - Male/Female	Main Office Restroom	yes	W3	Concrete	Tan	None	0	0	Negative
6040	1	B604001-1	1	110B	Restrooms, Staff - Male/Female	Main Office Restroom	yes	Fan Unit	Metal	Tan	None	1	0	Negative
6040	1	B604001-1	1	110B	Restrooms, Staff - Male/Female	Main Office Restroom	yes	W4	Brick	Tan	None	0	0	Negative
6040	1	B604001-1	1	110B	Restrooms, Staff - Male/Female	Main Office Restroom	yes	W4	Concrete	Tan	None	0	0	Negative
6040	1	B604001-1	1	110B	Restrooms, Staff - Male/Female	Main Office Restroom	yes	Ceiling	Concrete	White	None	0	0	Negative
6040	1	B604001-1	1	110C	Storage	Main Office Small Closet By Entry Door	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	1	110C	Storage	Main Office Small Closet By Entry Door	yes	W1	Concrete	Tan	None	0	0	Negative
6040	1	B604001-1	1	110C	Storage	Main Office Small Closet By Entry Door	yes	W2	Concrete	Tan	None	0	0	Negative
6040	1	B604001-1	1	110C	Storage	Main Office Small Closet By Entry Door	yes	W3	Concrete	Tan	None	0	0	Negative
6040	1	B604001-1	1	110C	Storage	Main Office Small Closet By Entry Door	yes	W4	Concrete	Tan	None	0	0	Negative
6040	1	B604001-1	1	110C	Storage	Main Office Small Closet By Entry Door	yes	Ceiling	Concrete	Tan	None	0	0	Negative

					Dates: 9/12/22 - 10/4/22		Lead-Safe Certification Assessment Report							
					Inspector Name and Certificate Number: Jennifer Drialo-006767/ Steve Merlino- 006800		6040 Walter Biddle Saul HS/Manatawna Farm							
					Inspection Company: Synertech		7100 Henry Avenue, Philadelphia, PA 19128							
ULCS#	E l e m e n t	BldgElmt ID	F l o o r	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/ negative)
6040	1	B604001-1	1	101	Health Service Room	Nurse's Office	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	1	101	Health Service Room	Nurse's Office	yes	W1	Concrete	Yellow	None	0	0	Negative
6040	1	B604001-1	1	101	Health Service Room	Nurse's Office	yes	W2	Concrete	Yellow	None	0	0	Negative
6040	1	B604001-1	1	101	Health Service Room	Nurse's Office	yes	W3	Concrete	Yellow	None	0	0	Negative
6040	1	B604001-1	1	101	Health Service Room	Nurse's Office	yes	Unit-Ventilator	Metal	Grey	None	0	0	Negative
6040	1	B604001-1	1	101	Health Service Room	Nurse's Office	yes	W4	Concrete	Yellow	None	0	0	Negative
6040	1	B604001-1	1	101	Health Service Room	Nurse's Office	yes	Ceiling	Concrete	White	None	0	0	Negative
6040	1	B604001-1	1	101C	Storage	Nurse's Office Closet	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	1	101C	Storage	Nurse's Office Closet	yes	W1	Concrete	Yellow	None	0	0	Negative
6040	1	B604001-1	1	101C	Storage	Nurse's Office Closet	yes	W2	Concrete	Yellow	None	0	0	Negative
6040	1	B604001-1	1	101C	Storage	Nurse's Office Closet	yes	W3	Concrete	Yellow	None	0	0	Negative
6040	1	B604001-1	1	101C	Storage	Nurse's Office Closet	yes	W4	Concrete	Yellow	None	0	0	Negative
6040	1	B604001-1	1	101C	Storage	Nurse's Office Closet	yes	Ceiling	Concrete	White	None	0	0	Negative
6040	1	B604001-1	1	103A	Health Service Room	Nurse's Office Exam Room	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	1	103A	Health Service Room	Nurse's Office Exam Room	yes	W1	Concrete	Yellow	None	0	0	Negative
6040	1	B604001-1	1	103A	Health Service Room	Nurse's Office Exam Room	yes	W2	Concrete	Yellow	None	0	0	Negative
6040	1	B604001-1	1	103A	Health Service Room	Nurse's Office Exam Room	yes	W3	Concrete	Yellow	Chipping	2	0	Negative
6040	1	B604001-1	1	103A	Health Service Room	Nurse's Office Exam Room	yes	W4	Concrete	Yellow	None	0	0	Negative
6040	1	B604001-1	1	103A	Health Service Room	Nurse's Office Exam Room	yes	Ceiling	Concrete	White	None	0	0	Negative
6040	1	B604001-1	1	101B-1	Student Restrooms - Male/Female	Nurse's Office Restroom	yes	Door Case	Metal	Pink	Friction	2	0	Negative
6040	1	B604001-1	1	101B-1	Student Restrooms - Male/Female	Nurse's Office Restroom	yes	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	1	101B-1	Student Restrooms - Male/Female	Nurse's Office Restroom	yes	W1	Concrete	Tan	None	0	0	Negative
6040	1	B604001-1	1	101B-1	Student Restrooms - Male/Female	Nurse's Office Restroom	yes	W2	Concrete	Tan	None	0	0	Negative
6040	1	B604001-1	1	101B-1	Student Restrooms - Male/Female	Nurse's Office Restroom	yes	W3	Concrete	Tan	None	0	0	Negative
6040	1	B604001-1	1	101B-1	Student Restrooms - Male/Female	Nurse's Office Restroom	yes	W4	Concrete	Tan	None	0	0	Negative
6040	1	B604001-1	1	101B-1	Student Restrooms - Male/Female	Nurse's Office Restroom	yes	Ceiling	Concrete	White	None	0	0	Negative

					Dates: 9/12/22 - 10/4/22		Lead-Safe Certification Assessment Report							
					Inspector Name and Certificate Number: Jennifer Drialo-006767/ Steve Merlino- 006800		6040 Walter Biddle Saul HS/Manatawna Farm							
					Inspection Company: Synertech		7100 Henry Avenue, Philadelphia, PA 19128							
ULCS#	E l e m e n t	BldgElmt ID	F l o o r	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/ negative)
6040	1	B604001-1	1	101B-1	Student Restrooms - Male/Female	Nurse's Office Restroom	yes	Ductwork	Metal	White	None	0	0	Negative
6040	1	B604001-1	1	101A-1	Storage	Nurse's Office Storage Room	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	1	101A-1	Storage	Nurse's Office Storage Room	yes	W1	Concrete	Yellow	None	0	0	Negative
6040	1	B604001-1	1	101A-1	Storage	Nurse's Office Storage Room	yes	W2	Concrete	Yellow	None	0	0	Negative
6040	1	B604001-1	1	101A-1	Storage	Nurse's Office Storage Room	yes	W3	Concrete	Yellow	None	0	0	Negative
6040	1	B604001-1	1	101A-1	Storage	Nurse's Office Storage Room	yes	W4	Concrete	Yellow	None	0	0	Negative
6040	1	B604001-1	1	101A-1	Storage	Nurse's Office Storage Room	yes	Shelf	Wood	Yellow	None	0	0	Negative
6040	1	B604001-1	1	101A-1	Storage	Nurse's Office Storage Room	yes	Ceiling	Concrete	White	None	0	0	Negative
6040	1	B604001-1	1	109-1	Principal/Directors Office	Principal's Office	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	1	109-1	Principal/Directors Office	Principal's Office	yes	Door Case	Metal	Tan	None	0	0.11	Negative
6040	1	B604001-1	1	109-1	Principal/Directors Office	Principal's Office	yes	W1	Concrete	Green	None	0	0	Negative
6040	1	B604001-1	1	109-1	Principal/Directors Office	Principal's Office	yes	Bulletin Board	Wood	White	None	0	0	Negative
6040	1	B604001-1	1	109-1	Principal/Directors Office	Principal's Office	yes	W2	Concrete	Green	None	0	0	Negative
6040	1	B604001-1	1	109-1	Principal/Directors Office	Principal's Office	yes	W3	Concrete	Green	None	0	0	Negative
6040	1	B604001-1	1	109-1	Principal/Directors Office	Principal's Office	yes	Shelf	Wood	Green	None	0	0	Negative
6040	1	B604001-1	1	109-1	Principal/Directors Office	Principal's Office	yes	W4	Concrete	Green	None	0	0	Negative
6040	1	B604001-1	1	109-1	Principal/Directors Office	Principal's Office	yes	Ceiling	Concrete	White	None	0	0	Negative
6040	1	B604001-1	1	109B	Storage	Principal's Office Closet	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	1	109B	Storage	Principal's Office Closet	yes	Door Case	Metal	Tan	None	0	0	Negative
6040	1	B604001-1	1	109B	Storage	Principal's Office Closet	yes	W1	Concrete	Yellow	None	0	0	Negative
6040	1	B604001-1	1	109B	Storage	Principal's Office Closet	yes	W2	Concrete	Yellow	None	0	0	Negative
6040	1	B604001-1	1	109B	Storage	Principal's Office Closet	yes	W3	Concrete	Yellow	None	0	0	Negative
6040	1	B604001-1	1	109B	Storage	Principal's Office Closet	yes	W4	Concrete	Yellow	None	0	0	Negative
6040	1	B604001-1	1	109B	Storage	Principal's Office Closet	yes	Ceiling	Concrete	White	None	0	0	Negative
6040	1	B604001-1	1	109A-1	Restrooms, Staff - Male/Female	Principal's Office Restroom	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	1	109A-1	Restrooms, Staff - Male/Female	Principal's Office Restroom	yes	Door Case	Metal	Tan	None	0	0	Negative
6040	1	B604001-1	1	109A-1	Restrooms, Staff - Male/Female	Principal's Office Restroom	yes	W1	Concrete	Yellow	None	0	0	Negative
6040	1	B604001-1	1	109A-1	Restrooms, Staff - Male/Female	Principal's Office Restroom	yes	W2	Concrete	Yellow	None	0	0	Negative
6040	1	B604001-1	1	109A-1	Restrooms, Staff - Male/Female	Principal's Office Restroom	yes	W3	Concrete	Yellow	None	0	0	Negative
6040	1	B604001-1	1	109A-1	Restrooms, Staff - Male/Female	Principal's Office Restroom	yes	W4	Concrete	Yellow	None	0	0	Negative

					Dates: 9/12/22 - 10/4/22		Lead-Safe Certification Assessment Report							
					Inspector Name and Certificate Number: Jennifer Drialo-006767/ Steve Merlino- 006800		6040 Walter Biddle Saul HS/Manatawna Farm							
					Inspection Company: Synertech		7100 Henry Avenue, Philadelphia, PA 19128							
ULCS#	E l e m e n t	BldgElmt ID	F l o o r	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/ negative)
6040	1	B604001-1	1	109A-1	Restrooms, Staff - Male/Female	Principal's Office Restroom	yes	Vent	Metal	Yellow	None	0	0	Negative
6040	1	B604001-1	1	109A-1	Restrooms, Staff - Male/Female	Principal's Office Restroom	yes	Pipe	Metal	Yellow	None	0	0	Negative
6040	1	B604001-1	1	109A-1	Restrooms, Staff - Male/Female	Principal's Office Restroom	yes	Ceiling	Concrete	White	None	0	0	Negative
6040	1	B604001-1	1	S12	Stairs	Up Stairwell	yes	Door	Metal	Brown	Friction	10	0	Negative
6040	1	B604001-1	1	S12	Stairs	Up Stairwell	yes	Door Case	Metal	Brown	Friction	12	0.11	Negative
6040	1	B604001-1	1	S12	Stairs	Up Stairwell	yes	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	1	S12	Stairs	Up Stairwell	yes	Handrail	Metal	Grey	Friction	2	0	Negative
6040	1	B604001-1	1	S12	Stairs	Up Stairwell	yes	Baluster	Metal	Grey	None	0	0	Negative
6040	1	B604001-1	1	S12	Stairs	Up Stairwell	yes	Tread	Concrete	Grey	Friction	10	0	Negative
6040	1	B604001-1	1	S12	Stairs	Up Stairwell	yes	Closed Stringer	Metal	Grey	None	0	2.3	Positive
6040	1	B604001-1	1	S12	Stairs	Up Stairwell	yes	Riser	Metal	Grey	None	0	1.2	Positive
6040	1	B604001-1	1	S12	Stairs	Up Stairwell	yes	Open Stringer	Metal	Grey	None	0	1.8	Positive
6040	1	B604001-1	1	S12	Stairs	Up Stairwell	yes	Under Carraige	Metal	Red	None	0	2.5	Positive
6040	1	B604001-1	1	S12	Stairs	Up Stairwell	yes	W1	Concrete	White	None	0	0	Negative
6040	1	B604001-1	1	S12	Stairs	Up Stairwell	yes	W2	Concrete	White	None	0	0	Negative
6040	1	B604001-1	1	S12	Stairs	Up Stairwell	yes	W3	Concrete	White	None	0	0	Negative
6040	1	B604001-1	1	S12	Stairs	Up Stairwell	yes	W4	Concrete	White	None	0	0	Negative
6040	1	B604001-1	1	S12	Stairs	Up Stairwell	yes	Ceiling	Concrete	White	None	0	0	Negative
6040	1	B604001-1	2	H23	Circulation (Hallway)	2nd Floor Hallway	yes	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	2	H23	Circulation (Hallway)	2nd Floor Hallway	yes	W1	Concrete	Tan	Chipping	2	0	Negative
6040	1	B604001-1	2	H23	Circulation (Hallway)	2nd Floor Hallway	yes	Electric Panel	Metal	Grey	None	0	0.14	Negative
6040	1	B604001-1	2	H23	Circulation (Hallway)	2nd Floor Hallway	yes	W2	Concrete	Tan	None	0	0	Negative
6040	1	B604001-1	2	H23	Circulation (Hallway)	2nd Floor Hallway	yes	Column	Concrete	Tan	Flaking	20	0	Negative
6040	1	B604001-1	2	H23	Circulation (Hallway)	2nd Floor Hallway	yes	Radiator	Metal	Tan	None	0	0	Negative
6040	1	B604001-1	2	H23	Circulation (Hallway)	2nd Floor Hallway	yes	W3	Concrete	Tan	None	0	0	Negative
6040	1	B604001-1	2	H23	Circulation (Hallway)	2nd Floor Hallway	yes	Electric Panel	Metal	Grey	None	0	0.1	Negative
6040	1	B604001-1	2	H23	Circulation (Hallway)	2nd Floor Hallway	yes	Radiator	Metal	Tan	None	0	0	Negative
6040	1	B604001-1	2	H23	Circulation (Hallway)	2nd Floor Hallway	yes	W4	Concrete	Tan	None	0	0	Negative
6040	1	B604001-1	2	H23	Circulation (Hallway)	2nd Floor Hallway	yes	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	2	NP2-2	Restrooms, Staff - Female	2nd Floor Women's Restroom	yes	Door Case	Metal	Pink	Friction	12	0.1	Negative
6040	1	B604001-1	2	NP2-2	Restrooms, Staff - Female	2nd Floor Women's Restroom	yes	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	2	NP2-2	Restrooms, Staff - Female	2nd Floor Women's Restroom	yes	W1	Concrete	Yellow	None	0	0	Negative

					Dates: 9/12/22 - 10/4/22		Lead-Safe Certification Assessment Report							
					Inspector Name and Certificate Number: Jennifer Drialo-006767/ Steve Merlino- 006800		6040 Walter Biddle Saul HS/Manatawna Farm							
					Inspection Company: Synertech		7100 Henry Avenue, Philadelphia, PA 19128							
ULCS#	E l e m e n t	BldgElmt ID	F l o o r	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/ negative)
6040	1	B604001-1	2	NP2-2	Restrooms, Staff - Female	2nd Floor Women's Restroom	yes	W2	Concrete	Yellow	None	0	0	Negative
6040	1	B604001-1	2	NP2-2	Restrooms, Staff - Female	2nd Floor Women's Restroom	yes	W3	Concrete	Yellow	None	0	0	Negative
6040	1	B604001-1	2	NP2-2	Restrooms, Staff - Female	2nd Floor Women's Restroom	yes	W4	Concrete	Yellow	None	0	0	Negative
6040	1	B604001-1	2	NP2-2	Restrooms, Staff - Female	2nd Floor Women's Restroom	yes	Ceiling	Concrete	White	None	0	0	Negative
6040	1	B604001-1	2	200-2	Senior High	Classroom 200	yes	Door Case	Metal	Pink	Friction	10	0.13	Negative
6040	1	B604001-1	2	200-2	Senior High	Classroom 200	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	2	200-2	Senior High	Classroom 200	yes	W1	Concrete	White	None	0	0	Negative
6040	1	B604001-1	2	200-2	Senior High	Classroom 200	yes	Telebox	Metal	Pink	None	0	0	Negative
6040	1	B604001-1	2	200-2	Senior High	Classroom 200	yes	W2	Concrete	White	None	0	0	Negative
6040	1	B604001-1	2	200-2	Senior High	Classroom 200	yes	W3	Concrete	Green	None	0	0	Negative
6040	1	B604001-1	2	200-2	Senior High	Classroom 200	yes	Unit-Ventilator	Metal	Grey	None	0	0	Negative
6040	1	B604001-1	2	200-2	Senior High	Classroom 200	yes	Column	Concrete	White	Chipping	2	0	Negative
6040	1	B604001-1	2	200-2	Senior High	Classroom 200	yes	W4	Concrete	White	None	0	0	Negative
6040	1	B604001-1	2	200-2	Senior High	Classroom 200	yes	Ceiling	Concrete	White	Flaking	20	0	Negative
6040	1	B604001-1	2	200-2	Senior High	Classroom 200	yes	Beam	Concrete	White	Chipping	4	0	Negative
6040	1	B604001-1	2	200A	Storage	Classroom 200 Closet	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	2	200A	Storage	Classroom 200 Closet	yes	Door Case	Metal	Pink	Flaking	4	0	Negative
6040	1	B604001-1	2	200A	Storage	Classroom 200 Closet	yes	W1	Concrete	White	None	0	0	Negative
6040	1	B604001-1	2	200A	Storage	Classroom 200 Closet	yes	W2	Concrete	White	None	0	0	Negative
6040	1	B604001-1	2	200A	Storage	Classroom 200 Closet	yes	W3	Concrete	White	None	0	0	Negative
6040	1	B604001-1	2	200A	Storage	Classroom 200 Closet	yes	Shelf	Wood	Green	Friction	4	2	Positive
6040	1	B604001-1	2	200A	Storage	Classroom 200 Closet	yes	W4	Concrete	White	None	0	0	Negative
6040	1	B604001-1	2	200A	Storage	Classroom 200 Closet	yes	Ceiling	Concrete	White	None	0	0	Negative
6040	1	B604001-1	2	201	Senior High	Classroom 201	yes	Door Case	Metal	Pink	Friction	10	0.12	Negative
6040	1	B604001-1	2	201	Senior High	Classroom 201	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	2	201	Senior High	Classroom 201	yes	W1	Concrete	Blue	None	0	0	Negative
6040	1	B604001-1	2	201	Senior High	Classroom 201	yes	W1	Concrete	Yellow	None	0	0	Negative
6040	1	B604001-1	2	201	Senior High	Classroom 201	yes	Chalkboard Casing	Metal	Pink	None	0	0	Negative
6040	1	B604001-1	2	201	Senior High	Classroom 201	yes	Telebox	Metal	Pink	None	0	0	Negative
6040	1	B604001-1	2	201	Senior High	Classroom 201	yes	W2	Concrete	Blue	None	0	0	Negative
6040	1	B604001-1	2	201	Senior High	Classroom 201	yes	W2	Concrete	Yellow	None	0	0	Negative
6040	1	B604001-1	2	201	Senior High	Classroom 201	yes	W3	Concrete	Tan	None	0	0	Negative
6040	1	B604001-1	2	201	Senior High	Classroom 201	yes	Unit-Ventilator	Metal	Grey	None	0	0	Negative
6040	1	B604001-1	2	201	Senior High	Classroom 201	yes	Column	Concrete	Blue	Chipping	2	0	Negative
6040	1	B604001-1	2	201	Senior High	Classroom 201	yes	W4	Concrete	White	None	0	0	Negative
6040	1	B604001-1	2	201	Senior High	Classroom 201	yes	Chalkboard Casing	Metal	Pink	None	0	0	Negative
6040	1	B604001-1	2	201	Senior High	Classroom 201	yes	Ceiling	Concrete	White	None	0	0	Negative
6040	1	B604001-1	2	201	Senior High	Classroom 201	yes	Beam	Concrete	White	Chipping	4	0	Negative
6040	1	B604001-1	2	202	Senior High	Classroom 202	yes	Door Case	Metal	Pink	Friction	8	0.12	Negative
6040	1	B604001-1	2	201A	Storage	Classroom 201 Closet	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	2	201A	Storage	Classroom 201 Closet	yes	Door Case	Metal	Pink	None	4	0	Negative
6040	1	B604001-1	2	201A	Storage	Classroom 201 Closet	yes	W1	Concrete	Yellow	None	0	0	Negative
6040	1	B604001-1	2	201A	Storage	Classroom 201 Closet	yes	W2	Concrete	Yellow	None	0	0	Negative
6040	1	B604001-1	2	201A	Storage	Classroom 201 Closet	yes	W3	Concrete	Yellow	None	0	0	Negative

						Dates: 9/12/22 - 10/4/22		Lead-Safe Certification Assessment Report						
						Inspector Name and Certificate Number: Jennifer Drialo-006767/ Steve Merlino- 006800		6040 Walter Biddle Saul HS/Manatawna Farm						
						Inspection Company: Synertech		7100 Henry Avenue, Philadelphia, PA 19128						
ULCS#	Element	BldgElmt ID	Floor	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
6040	1	B604001-1	2	201A	Storage	Classroom 201 Closet	yes	Shelf	Wood	Yellow	Friction	5	1.4	Positive
6040	1	B604001-1	2	201A	Storage	Classroom 201 Closet	yes	W4	Concrete	Yellow	None	0	0	Negative
6040	1	B604001-1	2	201A	Storage	Classroom 201 Closet	yes	Ceiling	Concrete	White	None	0	0	Negative
6040	1	B604001-1	2	202	Senior High	Classroom 202	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	2	202	Senior High	Classroom 202	yes	W1	Concrete	Blue	None	0	0	Negative
6040	1	B604001-1	2	202	Senior High	Classroom 202	yes	Telebox	Metal	Pink	None	0	0	Negative
6040	1	B604001-1	2	202	Senior High	Classroom 202	yes	W2	Concrete	Blue	Partially Inaccessible	0	0	Negative
6040	1	B604001-1	2	202	Senior High	Classroom 202	yes	Book Shelf	Wood	White	None	0	0	Negative
6040	1	B604001-1	2	202	Senior High	Classroom 202	yes	W3	Concrete	Green	Partially Inaccessible	2	0	Negative
6040	1	B604001-1	2	202	Senior High	Classroom 202	yes	Unit-Ventilator	Metal	Grey	None	0	0	Negative
6040	1	B604001-1	2	202	Senior High	Classroom 202	yes	Column	Concrete	Yellow	None	0	0	Negative
6040	1	B604001-1	2	202	Senior High	Classroom 202	yes	W4	Concrete	Blue	None	0	0	Negative
6040	1	B604001-1	2	202	Senior High	Classroom 202	yes	Ceiling	Concrete	White	Chipping	3	0	Negative
6040	1	B604001-1	2	202	Senior High	Classroom 202	yes	Beam	Concrete	Yellow	None	0	0	Negative
6040	1	B604001-1	2	203	Senior High	Classroom 203	yes	Door Case	Metal	Pink	Friction	12	0	Negative
6040	1	B604001-1	2	202A	Storage	Classroom 202 Closet	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	2	202A	Storage	Classroom 202 Closet	yes	Door Case	Metal	Blue	Friction	6	0	Negative
6040	1	B604001-1	2	202A	Storage	Classroom 202 Closet	yes	W1	Concrete	Blue	None	0	0	Negative
6040	1	B604001-1	2	202A	Storage	Classroom 202 Closet	yes	W2	Concrete	Blue	None	0	0	Negative
6040	1	B604001-1	2	202A	Storage	Classroom 202 Closet	yes	W3	Concrete	Blue	None	0	0	Negative
6040	1	B604001-1	2	202A	Storage	Classroom 202 Closet	yes	Shelf	Wood	Blue	Friction	4	1.4	Positive
6040	1	B604001-1	2	202A	Storage	Classroom 202 Closet	yes	W4	Concrete	Blue	None	0	0	Negative
6040	1	B604001-1	2	202A	Storage	Classroom 202 Closet	yes	Ceiling	Concrete	White	None	0	0	Negative
6040	1	B604001-1	2	203	Senior High	Classroom 203	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	2	203	Senior High	Classroom 203	yes	W1	Concrete	White	None	0	0	Negative
6040	1	B604001-1	2	203	Senior High	Classroom 203	yes	Chalkboard Casing	Metal	Pink	Friction	8	0	Negative
6040	1	B604001-1	2	203	Senior High	Classroom 203	yes	Telebox	Metal	Pink	None	0	0	Negative
6040	1	B604001-1	2	203	Senior High	Classroom 203	yes	W2	Concrete	White	None	0	0	Negative
6040	1	B604001-1	2	203	Senior High	Classroom 203	yes	W3	Concrete	White	None	0	0	Negative
6040	1	B604001-1	2	203	Senior High	Classroom 203	yes	Unit-Ventilator	Metal	Grey	None	0	0	Negative
6040	1	B604001-1	2	203	Senior High	Classroom 203	yes	Column	Concrete	White	None	0	0	Negative
6040	1	B604001-1	2	203	Senior High	Classroom 203	yes	W4	Concrete	White	None	0	0	Negative
6040	1	B604001-1	2	203	Senior High	Classroom 203	yes	Chalkboard Casing	Metal	Pink	Friction	15	0	Negative
6040	1	B604001-1	2	203	Senior High	Classroom 203	yes	Ceiling	Concrete	White	None	0	0	Negative
6040	1	B604001-1	2	203	Senior High	Classroom 203	yes	Beam	Concrete	White	Chipping	20	0	Negative
6040	1	B604001-1	2	203A	Storage	Classroom 203 Closet	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	2	203A	Storage	Classroom 203 Closet	yes	Door Case	Metal	Pink	Friction	4	0	Negative
6040	1	B604001-1	2	203A	Storage	Classroom 203 Closet	yes	W1	Concrete	Yellow	None	0	0	Negative
6040	1	B604001-1	2	203A	Storage	Classroom 203 Closet	yes	W2	Concrete	Yellow	None	0	0	Negative
6040	1	B604001-1	2	203A	Storage	Classroom 203 Closet	yes	W3	Concrete	Yellow	None	0	0	Negative
6040	1	B604001-1	2	203A	Storage	Classroom 203 Closet	yes	Shelf	Wood	Yellow	Friction	4	1.6	Positive
6040	1	B604001-1	2	203A	Storage	Classroom 203 Closet	yes	W4	Concrete	Yellow	None	0	0	Negative
6040	1	B604001-1	2	203A	Storage	Classroom 203 Closet	yes	Ceiling	Concrete	White	None	0	0	Negative
6040	1	B604001-1	2	204	Senior High	Classroom 204	yes	Door Case	Metal	Pink	Friction	11	0	Negative
6040	1	B604001-1	2	204	Senior High	Classroom 204	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	2	204	Senior High	Classroom 204	yes	W1	Concrete	Green	None	0	0	Negative

Dates: 9/12/22 - 10/4/22
Inspector Name and Certificate Number:
 Jennifer Drialo-006767/ Steve Merlino- 006800
Inspection Company: Synertech

Lead-Safe Certification Assessment Report
6040 Walter Biddle Saul HS/Manatawna Farm
7100 Henry Avenue, Philadelphia, PA 19128

ULCS#	E l e m e n t	BldgElmt ID	F l o o r	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/ negative)
6040	1	B604001-1	2	204	Senior High	Classroom 204	yes	Chalkboard Casing	Metal	Pink	Friction	12	0	Negative
6040	1	B604001-1	2	204	Senior High	Classroom 204	yes	Telebox	Metal	Pink	Friction	2	0	Negative
6040	1	B604001-1	2	204	Senior High	Classroom 204	yes	W2	Concrete	Green	None	0	0	Negative
6040	1	B604001-1	2	204	Senior High	Classroom 204	yes	W3	Concrete	Green	Chipping	3	0	Negative
6040	1	B604001-1	2	204	Senior High	Classroom 204	yes	Unit-Ventilator	Metal	Grey	None	0	0	Negative
6040	1	B604001-1	2	204	Senior High	Classroom 204	yes	Column	Concrete	White	None	0	0	Negative
6040	1	B604001-1	2	204	Senior High	Classroom 204	yes	W4	Concrete	Green	None	0	0	Negative
6040	1	B604001-1	2	204	Senior High	Classroom 204	yes	Chalkboard Casing	Metal	Pink	Friction	10	0	Negative
6040	1	B604001-1	2	204	Senior High	Classroom 204	yes	Ceiling	Concrete	White	None	0	0	Negative
6040	1	B604001-1	2	204	Senior High	Classroom 204	yes	Beam	Concrete	White	Flaking	10	0	Negative
6040	1	B604001-1	2	204A	Storage	Classroom 204 Closet	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	2	204A	Storage	Classroom 204 Closet	yes	Door Case	Metal	Pink	Friction	4	0	Negative
6040	1	B604001-1	2	204A	Storage	Classroom 204 Closet	yes	W1	Concrete	Green	None	0	0	Negative
6040	1	B604001-1	2	204A	Storage	Classroom 204 Closet	yes	W2	Concrete	Green	None	0	0	Negative
6040	1	B604001-1	2	204A	Storage	Classroom 204 Closet	yes	W3	Concrete	Green	None	0	0	Negative
6040	1	B604001-1	2	204A	Storage	Classroom 204 Closet	yes	Shelf	Wood	Green	Friction	8	1.4	Positive
6040	1	B604001-1	2	204A	Storage	Classroom 204 Closet	yes	W4	Concrete	Green	None	0	0	Negative
6040	1	B604001-1	2	204A	Storage	Classroom 204 Closet	yes	Ceiling	Concrete	White	None	0	0	Negative
6040	1	B604001-1	2	205	Senior High	Classroom 205	yes	Door Case	Metal	Pink	Friction	12	0.1	Negative
6040	1	B604001-1	2	205	Senior High	Classroom 205	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	2	205	Senior High	Classroom 205	yes	W1	Concrete	Blue	None	0	0	Negative
6040	1	B604001-1	2	205	Senior High	Classroom 205	yes	Chalkboard Casing	Metal	Pink	Friction	8	0	Negative
6040	1	B604001-1	2	205	Senior High	Classroom 205	yes	Telebox	Metal	Pink	None	0	0	Negative
6040	1	B604001-1	2	205	Senior High	Classroom 205	yes	Circuit Breaker	Metal	Pink	None	0	0	Negative
6040	1	B604001-1	2	205	Senior High	Classroom 205	yes	W2	Concrete	Orange	None	0	0	Negative
6040	1	B604001-1	2	205	Senior High	Classroom 205	yes	W3	Concrete	White	None	0	0	Negative
6040	1	B604001-1	2	205	Senior High	Classroom 205	yes	Unit-Ventilator	Metal	Grey	None	0	0	Negative
6040	1	B604001-1	2	205	Senior High	Classroom 205	yes	Column	Concrete	White	None	0	0	Negative
6040	1	B604001-1	2	205	Senior High	Classroom 205	yes	W4	Concrete	Blue	None	0	0	Negative
6040	1	B604001-1	2	205	Senior High	Classroom 205	yes	Chalkboard Casing	Metal	Pink	Friction	5	0	Negative
6040	1	B604001-1	2	205	Senior High	Classroom 205	yes	Ceiling	Concrete	White	None	0	0	Negative
6040	1	B604001-1	2	205	Senior High	Classroom 205	yes	Beam	Concrete	White	None	3	0	Negative
6040	1	B604001-1	2	205A	Storage	Classroom 205 Closet	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	2	205A	Storage	Classroom 205 Closet	yes	Door Case	Metal	Pink	None	4	0.13	Negative
6040	1	B604001-1	2	205A	Storage	Classroom 205 Closet	yes	W1	Concrete	Yellow	None	0	0	Negative
6040	1	B604001-1	2	205A	Storage	Classroom 205 Closet	yes	W2	Concrete	Yellow	None	0	0	Negative
6040	1	B604001-1	2	205A	Storage	Classroom 205 Closet	yes	W3	Concrete	Yellow	None	0	0	Negative
6040	1	B604001-1	2	205A	Storage	Classroom 205 Closet	yes	Shelf	Wood	Yellow	Friction	10	1.2	Positive
6040	1	B604001-1	2	205A	Storage	Classroom 205 Closet	yes	W4	Concrete	Yellow	None	0	0	Negative
6040	1	B604001-1	2	205A	Storage	Classroom 205 Closet	yes	Ceiling	Concrete	White	None	0	0	Negative
6040	1	B604001-1	2	208	Senior High	Classroom 208	yes	Door Case	Metal	Pink	Friction	10	0	Negative
6040	1	B604001-1	2	208	Senior High	Classroom 208	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	2	208	Senior High	Classroom 208	yes	W1	Concrete	Green	None	0	0	Negative
6040	1	B604001-1	2	208	Senior High	Classroom 208	yes	Chalkboard Casing	Metal	Pink	Friction	15	0	Negative
6040	1	B604001-1	2	208	Senior High	Classroom 208	yes	Telebox	Metal	Pink	None	0	0	Negative
6040	1	B604001-1	2	208	Senior High	Classroom 208	yes	W2	Concrete	Green	None	0	0	Negative
6040	1	B604001-1	2	208	Senior High	Classroom 208	yes	W3	Concrete	Green	None	0	0	Negative
6040	1	B604001-1	2	208	Senior High	Classroom 208	yes	Unit-Ventilator	Metal	Grey	None	0	0	Negative
6040	1	B604001-1	2	208	Senior High	Classroom 208	yes	Column	Concrete	White	Chipping	2	0	Negative

						Dates: 9/12/22 - 10/4/22		Lead-Safe Certification Assessment Report						
						Inspector Name and Certificate Number: Jennifer Drialo-006767/ Steve Merlino- 006800		6040 Walter Biddle Saul HS/Manatawna Farm						
						Inspection Company: Synertech		7100 Henry Avenue, Philadelphia, PA 19128						
ULCS#	E l e m e n t	BldgElmt ID	F l o o r	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/ negative)
6040	1	B604001-1	2	208	Senior High	Classroom 208	yes	W4	Concrete	Green	Chipping	2	0	Negative
6040	1	B604001-1	2	208	Senior High	Classroom 208	yes	Chalkboard Casing	Metal	Pink	Friction	25	0	Negative
6040	1	B604001-1	2	208	Senior High	Classroom 208	yes	Ceiling	Concrete	White	None	20	0	Negative
6040	1	B604001-1	2	208	Senior High	Classroom 208	yes	Beam	Concrete	White	Chipping	4	0	Negative
6040	1	B604001-1	2	208A	Storage	Classroom 208 Closet	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	2	208A	Storage	Classroom 208 Closet	yes	Door Case	Metal	Pink	Friction	5	0	Negative
6040	1	B604001-1	2	208A	Storage	Classroom 208 Closet	yes	W1	Concrete	Yellow	None	0	0	Negative
6040	1	B604001-1	2	208A	Storage	Classroom 208 Closet	yes	W2	Concrete	Yellow	None	0	0	Negative
6040	1	B604001-1	2	208A	Storage	Classroom 208 Closet	yes	W3	Concrete	Yellow	None	0	0	Negative
6040	1	B604001-1	2	208A	Storage	Classroom 208 Closet	yes	Shelf	Wood	Yellow	Friction	4	1.4	Positive
6040	1	B604001-1	2	208A	Storage	Classroom 208 Closet	yes	W4	Concrete	Yellow	None	0	0	Negative
6040	1	B604001-1	2	208A	Storage	Classroom 208 Closet	yes	Ceiling	Concrete	White	None	0	0	Negative
6040	1	B604001-1	2	210	Senior High	Classroom 210	yes	Door Case	Metal	Pink	Friction	3	0	Negative
6040	1	B604001-1	2	210	Senior High	Classroom 210	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	2	210	Senior High	Classroom 210	yes	W1	Concrete	Yellow	None	0	0	Negative
6040	1	B604001-1	2	210	Senior High	Classroom 210	yes	Chalkboard Casing	Metal	Pink	Friction	16	0	Negative
6040	1	B604001-1	2	210	Senior High	Classroom 210	yes	Telebox	Metal	Pink	None	0	0	Negative
6040	1	B604001-1	2	210	Senior High	Classroom 210	yes	W2	Concrete	White	None	0	0	Negative
6040	1	B604001-1	2	210	Senior High	Classroom 210	yes	W3	Concrete	Yellow	None	0	0	Negative
6040	1	B604001-1	2	210	Senior High	Classroom 210	yes	Unit-Ventilator	Metal	Grey	None	0	0	Negative
6040	1	B604001-1	2	210	Senior High	Classroom 210	yes	Column	Concrete	Yellow	Chipping	15	0	Negative
6040	1	B604001-1	2	210	Senior High	Classroom 210	yes	W4	Concrete	Yellow	None	0	0	Negative
6040	1	B604001-1	2	210	Senior High	Classroom 210	yes	Pipe	Metal	Yellow	Chipping	15	0	Negative
6040	1	B604001-1	2	210	Senior High	Classroom 210	yes	Chalkboard Casing	Metal	Pink	Friction	10	0	Negative
6040	1	B604001-1	2	210	Senior High	Classroom 210	yes	Ceiling	Concrete	White	None	0	0.11	Negative
6040	1	B604001-1	2	210	Senior High	Classroom 210	yes	Beam	Concrete	White	None	4	0	Negative
6040	1	B604001-1	2	207A	Service Closets	Custodial Closet 207A	no	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	2	207A	Service Closets	Custodial Closet 207A	no	W1	Concrete	Yellow	None	0	0	Negative
6040	1	B604001-1	2	207A	Service Closets	Custodial Closet 207A	no	W2	Concrete	Yellow	None	0	0	Negative
6040	1	B604001-1	2	207A	Service Closets	Custodial Closet 207A	no	W3	Concrete	Yellow	None	0	0	Negative
6040	1	B604001-1	2	207A	Service Closets	Custodial Closet 207A	no	W4	Concrete	Yellow	None	0	0	Negative
6040	1	B604001-1	2	207A	Service Closets	Custodial Closet 207A	no	Shelf	Wood	Yellow	Friction	2	0	Negative
6040	1	B604001-1	2	207A	Service Closets	Custodial Closet 207A	no	Ceiling	Concrete	White	None	0	0	Negative
6040	1	B604001-1	2	206	Administrative Office	Office 206	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	2	206	Administrative Office	Office 206	yes	W1	Concrete	White	None	0	0	Negative
6040	1	B604001-1	2	206	Administrative Office	Office 206	yes	Telebox	Metal	Pink	None	0	0	Negative
6040	1	B604001-1	2	206	Administrative Office	Office 206	yes	W2	Concrete	White	None	0	0	Negative
6040	1	B604001-1	2	206	Administrative Office	Office 206	yes	W3	Concrete	White	None	0	0	Negative
6040	1	B604001-1	2	206	Administrative Office	Office 206	yes	W4	Concrete	White	None	0	0	Negative
6040	1	B604001-1	2	206	Administrative Office	Office 206	yes	Ceiling	Concrete	White	Chipping	4	0	Negative
6040	1	B604001-1	2	207B	Storage	Storage Room 207B	yes	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	2	207B	Storage	Storage Room 207B	yes	W1	Concrete	Yellow	None	0	0	Negative
6040	1	B604001-1	2	207B	Storage	Storage Room 207B	yes	W2	Concrete	Yellow	None	0	0	Negative
6040	1	B604001-1	2	207B	Storage	Storage Room 207B	yes	W3	Concrete	Yellow	None	0	0	Negative

						Dates: 9/12/22 - 10/4/22		Lead-Safe Certification Assessment Report						
						Inspector Name and Certificate Number: Jennifer Drialo-006767/ Steve Merlino- 006800		6040 Walter Biddle Saul HS/Manatawna Farm						
						Inspection Company: Synertech		7100 Henry Avenue, Philadelphia, PA 19128						
ULCS#	E l e m e n t	BldgElmt ID	F l o o r	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/ negative)
6040	1	B604001-1	2	207B	Storage	Storage Room 207B	yes	W4	Concrete	Yellow	Flaking	2	0	Negative
6040	1	B604001-1	2	207B	Storage	Storage Room 207B	yes	Pipe	Metal	Yellow	None	4	0	Negative
6040	1	B604001-1	2	207B	Storage	Storage Room 207B	yes	Ceiling	Concrete	White	None	0	0	Negative
6040	1	B604001-1	2	207B	Storage	Storage Room 207B	yes	Exhaust Fan Unit	Metal	Yellow	None	0	0	Negative
6040	1	B604001-1	2	207C	Pipe Chase	Storage Room 207B Pipe Chase	no	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	2	207C	Pipe Chase	Storage Room 207B Pipe Chase	no	W1	Concrete	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	2	207C	Pipe Chase	Storage Room 207B Pipe Chase	no	W2	Concrete	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	2	207C	Pipe Chase	Storage Room 207B Pipe Chase	no	W3	Concrete	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	2	207C	Pipe Chase	Storage Room 207B Pipe Chase	no	W4	Concrete	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	2	207C	Pipe Chase	Storage Room 207B Pipe Chase	no	Ceiling	Concrete	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	2	NP1-2	Storage	Storage Room adjacent to Classroom 210	yes	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	2	NP1-2	Storage	Storage Room adjacent to Classroom 210	yes	W1	Concrete	Tan	None	0	0	Negative
6040	1	B604001-1	2	NP1-2	Storage	Storage Room adjacent to Classroom 210	yes	W2	Concrete	Tan	None	0	0	Negative
6040	1	B604001-1	2	NP1-2	Storage	Storage Room adjacent to Classroom 210	yes	W3	Concrete	Tan	None	0	0	Negative
6040	1	B604001-1	2	NP1-2	Storage	Storage Room adjacent to Classroom 210	yes	W4	Concrete	Tan	None	0	0	Negative
6040	1	B604001-1	2	NP1-2	Storage	Storage Room adjacent to Classroom 210	yes	Ceiling	Concrete	White	None	0	0	Negative
6040	1	B604001-1	B	S01	Stairs	Basement Stairwell	no	Door	Metal	Brown	Friction	10	0	Negative
6040	1	B604001-1	B	S01	Stairs	Basement Stairwell	no	Door Case	Metal	Brown	Friction	16	0.13	Negative
6040	1	B604001-1	B	S01	Stairs	Basement Stairwell	no	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	B	S01	Stairs	Basement Stairwell	no	Handrail	Metal	Grey	Friction	4	0.28	Negative
6040	1	B604001-1	B	S01	Stairs	Basement Stairwell	no	Tread	Concrete	Brown	Friction	4	0	Negative
6040	1	B604001-1	B	S01	Stairs	Basement Stairwell	yes	Closed Stringer	Metal	Brown	None	0	0	Negative
6040	1	B604001-1	B	S01	Stairs	Basement Stairwell	yes	Riser	Metal	Brown	None	0	0	Negative
6040	1	B604001-1	B	S01	Stairs	Basement Stairwell	yes	W1	Concrete	White	None	0	0	Negative
6040	1	B604001-1	B	S01	Stairs	Basement Stairwell	yes	W2	Concrete	White	None	0	0	Negative
6040	1	B604001-1	B	S01	Stairs	Basement Stairwell	yes	W3	Concrete	White	None	0	0	Negative
6040	1	B604001-1	B	S01	Stairs	Basement Stairwell	yes	W4	Concrete	White	None	0	0	Negative
6040	1	B604001-1	B	S01	Stairs	Basement Stairwell	yes	Ceiling	Concrete	White	None	0	0	Negative
6040	1	B604001-1	B	4	Boiler Room	Boiler Room	no	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	B	4	Boiler Room	Boiler Room	no	W1	Concrete	White	None	0	0.5	Negative
6040	1	B604001-1	B	4	Boiler Room	Boiler Room	no	W1	Concrete	Pink	None	0	0	Negative
6040	1	B604001-1	B	4	Boiler Room	Boiler Room	no	W2	Concrete	White	Flaking	20	0	Negative
6040	1	B604001-1	B	4	Boiler Room	Boiler Room	no	W2	Concrete	Pink	None	0	0	Negative
6040	1	B604001-1	B	4	Boiler Room	Boiler Room	no	Pipe	Metal	Yellow	Flaking	1	0	Negative
6040	1	B604001-1	B	4	Boiler Room	Boiler Room	no	Pipe	Metal	Orange	None	0	0	Negative
6040	1	B604001-1	B	4	Boiler Room	Boiler Room	no	Pipe	Metal	Black	None	0	0	Negative
6040	1	B604001-1	B	4	Boiler Room	Boiler Room	no	Valve	Metal	Blue	None	0	0	Negative
6040	1	B604001-1	B	4	Boiler Room	Boiler Room	no	Air Charge Valve	Metal	Red	None	0	0	Negative
6040	1	B604001-1	B	4	Boiler Room	Boiler Room	no	Sink	Porcelain	White	None	0	0	Negative
6040	1	B604001-1	B	4	Boiler Room	Boiler Room	no	Conduit	Metal	White	None	0	0	Negative
6040	1	B604001-1	B	4	Boiler Room	Boiler Room	no	W3	Concrete	White	None	0	0	Negative
6040	1	B604001-1	B	4	Boiler Room	Boiler Room	no	W3	Concrete	Pink	None	0	0	Negative
6040	1	B604001-1	B	4	Boiler Room	Boiler Room	no	Door	Metal	Brown	Friction	2	0	Negative
6040	1	B604001-1	B	4	Boiler Room	Boiler Room	no	Door Case	Metal	Brown	Friction	10	0.11	Negative

					Dates: 9/12/22 - 10/4/22		Lead-Safe Certification Assessment Report							
					Inspector Name and Certificate Number: Jennifer Drialo-006767/ Steve Merlino- 006800		6040 Walter Biddle Saul HS/Manatawna Farm							
					Inspection Company: Synertech		7100 Henry Avenue, Philadelphia, PA 19128							
ULCS#	E l e m e n t	BldgElmt ID	F l o o r	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/ negative)
6040	1	B604001-1	B	4	Boiler Room	Boiler Room	no	W4	Concrete	White	None	0	0	Negative
6040	1	B604001-1	B	4	Boiler Room	Boiler Room	no	W4	Concrete	Pink	None	0	0	Negative
6040	1	B604001-1	B	4	Boiler Room	Boiler Room	no	Chimney Clean Out Door	Metal	Grey	None	0	0.14	Negative
6040	1	B604001-1	B	4	Boiler Room	Boiler Room	no	Ceiling	No Access	White	None	0	0	No Access
6040	1	B604001-1	B	004A-B	Mechanical Room	Boiler Room Emergency Generator Room	no	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	B	004A-B	Mechanical Room	Boiler Room Emergency Generator Room	no	Door	Metal	Grey	None	0	0.21	Negative
6040	1	B604001-1	B	004A-B	Mechanical Room	Boiler Room Emergency Generator Room	no	Door Case	Metal	Grey	Friction	4	0.29	Negative
6040	1	B604001-1	B	004A-B	Mechanical Room	Boiler Room Emergency Generator Room	no	W1	Concrete	White	None	0	0.5	Negative
6040	1	B604001-1	B	004A-B	Mechanical Room	Boiler Room Emergency Generator Room	no	W1	Concrete	Pink	None	0	0	Negative
6040	1	B604001-1	B	004A-B	Mechanical Room	Boiler Room Emergency Generator Room	no	W2	Concrete	White	None	0	0	Negative
6040	1	B604001-1	B	004A-B	Mechanical Room	Boiler Room Emergency Generator Room	no	W2	Concrete	Pink	None	0	0	Negative
6040	1	B604001-1	B	004A-B	Mechanical Room	Boiler Room Emergency Generator Room	no	W3	Concrete	White	None	0	0	Negative
6040	1	B604001-1	B	004A-B	Mechanical Room	Boiler Room Emergency Generator Room	no	W3	Concrete	Pink	None	0	0	Negative
6040	1	B604001-1	B	004A-B	Mechanical Room	Boiler Room Emergency Generator Room	no	W4	Concrete	White	None	0	0	Negative
6040	1	B604001-1	B	004A-B	Mechanical Room	Boiler Room Emergency Generator Room	no	W4	Concrete	Pink	None	0	0	Negative
6040	1	B604001-1	B	004A-B	Mechanical Room	Boiler Room Emergency Generator Room	no	Generator	Metal	Orange	None	0	0	Negative
6040	1	B604001-1	B	004A-B	Mechanical Room	Boiler Room Emergency Generator Room	no	Pipe	Metal	Orange	None	0	0	Negative
6040	1	B604001-1	B	004A-B	Mechanical Room	Boiler Room Emergency Generator Room	no	Electric Panel	Metal	Grey	None	0	0	Negative
6040	1	B604001-1	B	004A-B	Mechanical Room	Boiler Room Emergency Generator Room	no	Fan Unit	Metal	Black	None	0	0	Negative
6040	1	B604001-1	B	004A-B	Mechanical Room	Boiler Room Emergency Generator Room	no	Ceiling	No Access	White	Chipping	2	0	No Access
6040	1	B604001-1	B	7	Mechanical Room	Boiler Room Pump Room	no	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	B	7	Mechanical Room	Boiler Room Pump Room	no	W1	Concrete	White	None	0	0	Negative
6040	1	B604001-1	B	7	Mechanical Room	Boiler Room Pump Room	no	W1	Concrete	Pink	None	0	0	Negative
6040	1	B604001-1	B	7	Mechanical Room	Boiler Room Pump Room	no	W2	Concrete	White	None	0	0	Negative
6040	1	B604001-1	B	7	Mechanical Room	Boiler Room Pump Room	no	W2	Concrete	Pink	Chipping	1	0	Negative
6040	1	B604001-1	B	7	Mechanical Room	Boiler Room Pump Room	no	W3	Concrete	White	Chipping	1	0	Negative
6040	1	B604001-1	B	7	Mechanical Room	Boiler Room Pump Room	no	W3	Concrete	Pink	None	0	0	Negative
6040	1	B604001-1	B	7	Mechanical Room	Boiler Room Pump Room	no	W4	Concrete	White	None	0	0	Negative
6040	1	B604001-1	B	7	Mechanical Room	Boiler Room Pump Room	no	W4	Concrete	Pink	None	0	0	Negative

					Dates: 9/12/22 - 10/4/22		Lead-Safe Certification Assessment Report							
					Inspector Name and Certificate Number: Jennifer Drialo-006767/ Steve Merlino- 006800		6040 Walter Biddle Saul HS/Manatawna Farm							
					Inspection Company: Synertech		7100 Henry Avenue, Philadelphia, PA 19128							
ULCS#	Element	BldgElmt ID	Floor	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
6040	1	B604001-1	B	7	Mechanical Room	Boiler Room Pump Room	no	Compressor	Metal	Blue	None	0	0	Negative
6040	1	B604001-1	B	7	Mechanical Room	Boiler Room Pump Room	no	Valve	Metal	Red	None	0	0	Negative
6040	1	B604001-1	B	7	Mechanical Room	Boiler Room Pump Room	no	Air Charge Valve	Metal	Orange	None	0	0	Negative
6040	1	B604001-1	B	7	Mechanical Room	Boiler Room Pump Room	no	Ceiling	Concrete	White	Flaking	1	0	Negative
6040	1	B604001-1	B	6	Storage	Boiler Room Storage Room	no	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	B	6	Storage	Boiler Room Storage Room	no	W1	Brick	Tan	None	0	0	Negative
6040	1	B604001-1	B	6	Storage	Boiler Room Storage Room	no	W2	Brick	Tan	None	0	0	Negative
6040	1	B604001-1	B	6	Storage	Boiler Room Storage Room	no	W3	Brick	Tan	None	0	0	Negative
6040	1	B604001-1	B	6	Storage	Boiler Room Storage Room	no	W4	Brick	Tan	None	0	0	Negative
6040	1	B604001-1	B	6	Storage	Boiler Room Storage Room	no	Pipe	Metal	Tan	Flaking	30	0.14	Negative
6040	1	B604001-1	B	6	Storage	Boiler Room Storage Room	no	Ceiling	Concrete	White	None	0	0	Negative
6040	1	B604001-1	B	3	Administrative Office	Building Engineer's Office	no	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	B	3	Administrative Office	Building Engineer's Office	no	Door	Metal	Pink	None	0	0	Negative
6040	1	B604001-1	B	3	Administrative Office	Building Engineer's Office	no	Door Case	Metal	Pink	Friction	12	0	Negative
6040	1	B604001-1	B	3	Administrative Office	Building Engineer's Office	no	W1	Concrete	Tan	Flaking	50	0	Negative
6040	1	B604001-1	B	3	Administrative Office	Building Engineer's Office	no	W2	Concrete	Tan	None	0	0	Negative
6040	1	B604001-1	B	3	Administrative Office	Building Engineer's Office	no	Electric Panel	Metal	Brown	None	0	0	Negative
6040	1	B604001-1	B	3	Administrative Office	Building Engineer's Office	no	Conduit	Metal	Brown	None	0	0.3	Negative
6040	1	B604001-1	B	3	Administrative Office	Building Engineer's Office	no	Shelf	Wood	Tan	None	0	0	Negative
6040	1	B604001-1	B	3	Administrative Office	Building Engineer's Office	no	W3	Concrete	Tan	None	0	0	Negative
6040	1	B604001-1	B	3	Administrative Office	Building Engineer's Office	no	W4	Concrete	Tan	None	0	0	Negative
6040	1	B604001-1	B	3	Administrative Office	Building Engineer's Office	no	Safety Switch	Metal	Red	None	0	0	Negative
6040	1	B604001-1	B	3	Administrative Office	Building Engineer's Office	no	Conduit	Metal	Grey	None	0	0.27	Negative
6040	1	B604001-1	B	3	Administrative Office	Building Engineer's Office	no	Ceiling	Concrete	White	None	0	0	Negative
6040	1	B604001-1	B	H02	Circulation (Hallway)	Hallway from Boiler Room to Boiler Room Storage Room	no	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	B	H02	Circulation (Hallway)	Hallway from Boiler Room to Boiler Room Storage Room	no	W1	Concrete	White	Chipping	2	0	Negative
6040	1	B604001-1	B	H02	Circulation (Hallway)	Hallway from Boiler Room to Boiler Room Storage Room	no	W1	Concrete	Pink	None	0	0	Negative
6040	1	B604001-1	B	H02	Circulation (Hallway)	Hallway from Boiler Room to Boiler Room Storage Room	no	W2	Concrete	White	None	0	0	Negative
6040	1	B604001-1	B	H02	Circulation (Hallway)	Hallway from Boiler Room to Boiler Room Storage Room	no	W2	Concrete	Pink	Chipping	1	0	Negative
6040	1	B604001-1	B	H02	Circulation (Hallway)	Hallway from Boiler Room to Boiler Room Storage Room	no	W3	Concrete	White	None	0	0	Negative

					Dates: 9/12/22 - 10/4/22		Lead-Safe Certification Assessment Report							
					Inspector Name and Certificate Number: Jennifer Drialo-006767/ Steve Merlino- 006800		6040 Walter Biddle Saul HS/Manatawna Farm							
					Inspection Company: Synertech		7100 Henry Avenue, Philadelphia, PA 19128							
ULCS#	Element	BldgElmt ID	Floor	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
6040	1	B604001-1	B	H02	Circulation (Hallway)	Hallway from Boiler Room to Boiler Room Storage Room	no	W3	Concrete	Pink	None	0	0	Negative
6040	1	B604001-1	B	H02	Circulation (Hallway)	Hallway from Boiler Room to Boiler Room Storage Room	no	W4	Concrete	White	None	0	0	Negative
6040	1	B604001-1	B	H02	Circulation (Hallway)	Hallway from Boiler Room to Boiler Room Storage Room	no	W4	Concrete	Pink	None	0	0	Negative
6040	1	B604001-1	B	H02	Circulation (Hallway)	Hallway from Boiler Room to Boiler Room Storage Room	no	Ceiling	Concrete	White	Flaking	2	0	Negative
6040	1	B604001-1	B	H02	Circulation (Hallway)	Hallway from Boiler Room to Boiler Room Storage Room	no	Pipe	Metal	White	None	0	0	Negative
6040	1	B604001-1	B	H03	Circulation (Hallway)	Hallway outside Building Engineer's Office	no	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	B	H03	Circulation (Hallway)	Hallway outside Building Engineer's Office	no	W1	Concrete	Tan	None	0	0	Negative
6040	1	B604001-1	B	H03	Circulation (Hallway)	Hallway outside Building Engineer's Office	no	Conduit	Metal	White	None	0	0	Negative
6040	1	B604001-1	B	H03	Circulation (Hallway)	Hallway outside Building Engineer's Office	no	W2	Concrete	Tan	None	0	0	Negative
6040	1	B604001-1	B	H03	Circulation (Hallway)	Hallway outside Building Engineer's Office	no	W3	Concrete	Tan	None	0	0	Negative
6040	1	B604001-1	B	H03	Circulation (Hallway)	Hallway outside Building Engineer's Office	no	W4	Concrete	Tan	None	0	0	Negative
6040	1	B604001-1	B	H03	Circulation (Hallway)	Hallway outside Building Engineer's Office	no	Crawlspace Access Door	Metal	Brown	None	0	0	Negative
6040	1	B604001-1	B	H03	Circulation (Hallway)	Hallway outside Building Engineer's Office	no	Ceiling	Concrete	White	None	0	0	Negative
6040	1	B604001-1	B	H03	Circulation (Hallway)	Hallway outside Building Engineer's Office	no	Pipe	Metal	Brown	Flaking	4	0	Negative
6040	1	B604001-1	B	H03	Circulation (Hallway)	Hallway outside Building Engineer's Office	no	Pipe	Metal	Tan	Flaking	10	0.1	Negative
6040	1	B604001-1	B	H01	Circulation (Hallway)	Hallway to Boiler Room	no	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	B	H01	Circulation (Hallway)	Hallway to Boiler Room	no	W1	Concrete	White	Chipping	2	0	Negative
6040	1	B604001-1	B	H01	Circulation (Hallway)	Hallway to Boiler Room	no	W1	Concrete	Pink	None	0	0	Negative
6040	1	B604001-1	B	H01	Circulation (Hallway)	Hallway to Boiler Room	no	W2	Concrete	White	None	0	0	Negative
6040	1	B604001-1	B	H01	Circulation (Hallway)	Hallway to Boiler Room	no	W2	Concrete	Pink	None	0	0	Negative
6040	1	B604001-1	B	H01	Circulation (Hallway)	Hallway to Boiler Room	no	W3	Concrete	White	None	0	0	Negative
6040	1	B604001-1	B	H01	Circulation (Hallway)	Hallway to Boiler Room	yes	W3	Concrete	Pink	None	0	0	Negative
6040	1	B604001-1	B	H01	Circulation (Hallway)	Hallway to Boiler Room	yes	W4	Concrete	White	None	0	0	Negative
6040	1	B604001-1	B	H01	Circulation (Hallway)	Hallway to Boiler Room	yes	W4	Concrete	Pink	None	0	0	Negative
6040	1	B604001-1	B	H01	Circulation (Hallway)	Hallway to Boiler Room	yes	Ceiling	Concrete	White	Flaking	10	0	Negative
6040	1	B604001-1	B	5	Shop, General	Maintenance Work Area	no	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	B	5	Shop, General	Maintenance Work Area	no	W1	Concrete	White	None	0	0	Negative
6040	1	B604001-1	B	5	Shop, General	Maintenance Work Area	no	W1	Concrete	Pink	None	0	0	Negative
6040	1	B604001-1	B	5	Shop, General	Maintenance Work Area	no	W2	Concrete	White	None	0	0	Negative

					Dates: 9/12/22 - 10/4/22		Lead-Safe Certification Assessment Report							
					Inspector Name and Certificate Number: Jennifer Drialo-006767/ Steve Merlino- 006800		6040 Walter Biddle Saul HS/Manatawna Farm							
					Inspection Company: Synertech		7100 Henry Avenue, Philadelphia, PA 19128							
ULCS#	Element	BldgElmt ID	Floor	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
6040	1	B604001-1	B	5	Shop, General	Maintenance Work Area	no	W2	Concrete	Pink	None	0	0	Negative
6040	1	B604001-1	B	5	Shop, General	Maintenance Work Area	no	W3	Concrete	White	None	0	0	Negative
6040	1	B604001-1	B	5	Shop, General	Maintenance Work Area	no	W3	Concrete	Pink	None	0	0	Negative
6040	1	B604001-1	B	5	Shop, General	Maintenance Work Area	no	W4	Concrete	White	None	0	0	Negative
6040	1	B604001-1	B	5	Shop, General	Maintenance Work Area	no	W4	Concrete	Pink	None	0	0	Negative
6040	1	B604001-1	B	5	Shop, General	Maintenance Work Area	no	Ceiling	Concrete	White	None	0	0	Negative
6040	1	B604001-1	B	5	Shop, General	Maintenance Work Area	no	Pipe	Metal	White	Flaking	100	0	Negative
6040	1	B604001-1	B	002-B	Restrooms, Staff - Male/Female	Staff Restroom adjacent to Boiler Room	no	Floor	Concrete	Grey	Friction	25	0	Negative
6040	1	B604001-1	B	002-B	Restrooms, Staff - Male/Female	Staff Restroom adjacent to Boiler Room	yes	Door	Metal	Brown	Friction	0	0	Negative
6040	1	B604001-1	B	002-B	Restrooms, Staff - Male/Female	Staff Restroom adjacent to Boiler Room	yes	Door Case	Metal	Brown	Friction	4	0	Negative
6040	1	B604001-1	B	002-B	Restrooms, Staff - Male/Female	Staff Restroom adjacent to Boiler Room	no	W1	Concrete	Tan	None	0	0	Negative
6040	1	B604001-1	B	002-B	Restrooms, Staff - Male/Female	Staff Restroom adjacent to Boiler Room	yes	W1	Concrete	White	None	0	0	Negative
6040	1	B604001-1	B	002-B	Restrooms, Staff - Male/Female	Staff Restroom adjacent to Boiler Room	no	W2	Concrete	Tan	None	0	0	Negative
6040	1	B604001-1	B	002-B	Restrooms, Staff - Male/Female	Staff Restroom adjacent to Boiler Room	yes	W2	Concrete	White	None	0	0	Negative
6040	1	B604001-1	B	002-B	Restrooms, Staff - Male/Female	Staff Restroom adjacent to Boiler Room	no	W3	Concrete	Tan	None	0	0	Negative
6040	1	B604001-1	B	002-B	Restrooms, Staff - Male/Female	Staff Restroom adjacent to Boiler Room	yes	W3	Concrete	White	None	0	0	Negative
6040	1	B604001-1	B	002-B	Restrooms, Staff - Male/Female	Staff Restroom adjacent to Boiler Room	no	W4	Concrete	Tan	None	0	0.1	Negative
6040	1	B604001-1	B	002-B	Restrooms, Staff - Male/Female	Staff Restroom adjacent to Boiler Room	yes	W4	Concrete	White	None	0	0	Negative
6040	1	B604001-1	B	002-B	Restrooms, Staff - Male/Female	Staff Restroom adjacent to Boiler Room	no	Ceiling	Concrete	White	None	0	0	Negative
6040	1	B604001-1	B	001-B	Administrative Office	Time Clock Room	no	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	B	001-B	Administrative Office	Time Clock Room	no	W1	Concrete	Tan	None	0	0	Negative
6040	1	B604001-1	B	001-B	Administrative Office	Time Clock Room	no	Shelf	Wood	Tan	Friction	4	0	Negative
6040	1	B604001-1	B	001-B	Administrative Office	Time Clock Room	no	W2	Concrete	Tan	None	0	0	Negative
6040	1	B604001-1	B	001-B	Administrative Office	Time Clock Room	no	W3	Concrete	Tan	None	0	0	Negative
6040	1	B604001-1	B	001-B	Administrative Office	Time Clock Room	no	Signal Circuit Protector	Metal	Brown	None	0	0.4	Negative

					Dates: 9/12/22 - 10/4/22		Lead-Safe Certification Assessment Report							
					Inspector Name and Certificate Number: Jennifer Drialo-006767/ Steve Merlino- 006800		6040 Walter Biddle Saul HS/Manatawna Farm							
					Inspection Company: Synertech		7100 Henry Avenue, Philadelphia, PA 19128							
ULCS#	Element	BldgElmt ID	Floor	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
6040	1	B604001-1	B	001-B	Administrative Office	Time Clock Room	no	Clock Case	Metal	Brown	None	0	0	Negative
6040	1	B604001-1	B	001-B	Administrative Office	Time Clock Room	no	W4	Concrete	Tan	None	0	0	Negative
6040	1	B604001-1	B	001-B	Administrative Office	Time Clock Room	no	Key Hanger	Wood	Brown	Chipping	1	0.7	Positive
6040	1	B604001-1	B	001-B	Administrative Office	Time Clock Room	no	Pipe	Metal	Brown	Flaking	30	0	Negative
6040	1	B604001-1	B	001-B	Administrative Office	Time Clock Room	no	Ductwork	Metal	Tan	None	0	0	Negative
6040	1	B604001-1	B	001-B	Administrative Office	Time Clock Room	no	Corkboard Case	Wood	Tan	None	0	0.14	Negative
6040	1	B604001-1	B	001-B	Administrative Office	Time Clock Room	no	Ceiling	Concrete	White	Chipping	2	0	Negative
6040	1	B604001-1	B	001A-B	Restrooms, Staff - Male	Time Clock Room Men's Restroom	no	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	B	001A-B	Restrooms, Staff - Male	Time Clock Room Men's Restroom	no	Door	Wood	Tan	Friction	2	1.4	Positive
6040	1	B604001-1	B	001A-B	Restrooms, Staff - Male	Time Clock Room Men's Restroom	no	Door Case	Wood	Tan	Friction	5	0	Negative
6040	1	B604001-1	B	001A-B	Restrooms, Staff - Male	Time Clock Room Men's Restroom	no	W1	Concrete	Tan	None	0	0.13	Negative
6040	1	B604001-1	B	001A-B	Restrooms, Staff - Male	Time Clock Room Men's Restroom	no	W2	Concrete	Tan	None	0	0	Negative
6040	1	B604001-1	B	001A-B	Restrooms, Staff - Male	Time Clock Room Men's Restroom	no	W3	Concrete	Tan	None	0	0	Negative
6040	1	B604001-1	B	001A-B	Restrooms, Staff - Male	Time Clock Room Men's Restroom	no	W4	Concrete	Tan	None	0	0	Negative
6040	1	B604001-1	B	001A-B	Restrooms, Staff - Male	Time Clock Room Men's Restroom	no	Stall	Wood	Tan	None	0	0.18	Negative
6040	1	B604001-1	B	001A-B	Restrooms, Staff - Male	Time Clock Room Men's Restroom	no	Pipe	Metal	Tan	None	0	0.11	Negative
6040	1	B604001-1	B	001A-B	Restrooms, Staff - Male	Time Clock Room Men's Restroom	no	Ceiling	Concrete	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	B	100A-B	Storage	Time Clock Room Storage Room	no	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	B	100A-B	Storage	Time Clock Room Storage Room	no	Door	Metal	Red	None	0	0.4	Negative
6040	1	B604001-1	B	100A-B	Storage	Time Clock Room Storage Room	no	Door Case	Metal	Grey	None	0	0	Negative
6040	1	B604001-1	B	100A-B	Storage	Time Clock Room Storage Room	no	W1	Concrete	Blue	None	0	0.13	Negative
6040	1	B604001-1	B	100A-B	Storage	Time Clock Room Storage Room	no	W2	Concrete	Blue	None	0	0	Negative
6040	1	B604001-1	B	100A-B	Storage	Time Clock Room Storage Room	no	W3	Concrete	Tan	None	0	0	Negative
6040	1	B604001-1	B	100A-B	Storage	Time Clock Room Storage Room	no	W4	Concrete	Blue	None	0	0	Negative
6040	1	B604001-1	B	100A-B	Storage	Time Clock Room Storage Room	no	Belt Hanger	Wood	Blue	Friction	2	0	Negative
6040	1	B604001-1	B	100A-B	Storage	Time Clock Room Storage Room	no	Pipe	Metal	Silver	None	0	0.4	Negative
6040	1	B604001-1	B	100A-B	Storage	Time Clock Room Storage Room	no	Ceiling	Concrete	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	A	AT	Attic	Attic	no	Floor	Wood	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	A	AT	Attic	Attic	no	W1	Wood	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	A	AT	Attic	Attic	no	W2	Wood	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	A	AT	Attic	Attic	no	W3	Wood	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	A	AT	Attic	Attic	no	W4	Wood	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	A	AT	Attic	Attic	no	Ceiling	Wood	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	C	CS	Crawl Space	Crawlspace Next to BE Office	no	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	C	CS	Crawl Space	Crawlspace Next to BE Office	no	W1	Concrete	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	C	CS	Crawl Space	Crawlspace Next to BE Office	no	W2	Concrete	N/A	N/A	N/A	N/A	N/A

					Dates: 9/12/22 - 10/4/22		Lead-Safe Certification Assessment Report							
					Inspector Name and Certificate Number: Jennifer Drialo-006767/ Steve Merlino- 006800		6040 Walter Biddle Saul HS/Manatawna Farm							
					Inspection Company: Synertech		7100 Henry Avenue, Philadelphia, PA 19128							
ULCS#	E l e m e n t	BldgElmt ID	F l o o r	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/ negative)
6040	1	B604001-1	C	CS	Crawl Space	Crawlspace Next to BE Office	no	W3	Concrete	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	C	CS	Crawl Space	Crawlspace Next to BE Office	no	W4	Concrete	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	C	CS	Crawl Space	Crawlspace Next to BE Office	no	Ceiling	Concrete	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	119A	Stage	Cafetorium Stage	yes	Floor	Wood	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	119A	Stage	Cafetorium Stage	yes	W1	Concrete	White	None	0	0	Negative
6040	2	B604001-1	1	119A	Stage	Cafetorium Stage	yes	W1	Concrete	Tan	None	0	0	Negative
6040	2	B604001-1	1	119A	Stage	Cafetorium Stage	yes	W2	Concrete	White	None	0	0	Negative
6040	2	B604001-1	1	119A	Stage	Cafetorium Stage	yes	W2	Concrete	Tan	None	0	0	Negative
6040	2	B604001-1	1	119A	Stage	Cafetorium Stage	yes	W3	Concrete	White	None	0	0	Negative
6040	2	B604001-1	1	119A	Stage	Cafetorium Stage	yes	W3	Concrete	Tan	None	0	0	Negative
6040	2	B604001-1	1	119A	Stage	Cafetorium Stage	yes	W4	Concrete	White	None	0	0	Negative
6040	2	B604001-1	1	119A	Stage	Cafetorium Stage	yes	W4	Concrete	Tan	None	0	0	Negative
6040	2	B604001-1	1	119A	Stage	Cafetorium Stage	yes	Ceiling	Concrete	White	None	0	N/A	No Access
6040	2	B604001-1	1	119	Cafeteria (Dining Area)	Cafetorium	yes	Floor	Wood	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	119	Cafeteria (Dining Area)	Cafetorium	yes	W1	Concrete	White	None	0	0	Negative
6040	2	B604001-1	1	119	Cafeteria (Dining Area)	Cafetorium	yes	W1	Concrete	Tan	None	0	0	Negative
6040	2	B604001-1	1	119	Cafeteria (Dining Area)	Cafetorium	yes	W2	Concrete	White	None	0	0	Negative
6040	2	B604001-1	1	119	Cafeteria (Dining Area)	Cafetorium	yes	W2	Concrete	Tan	None	0	0	Negative
6040	2	B604001-1	1	119	Cafeteria (Dining Area)	Cafetorium	yes	Column	Concrete	White	Efflorescence	45	0	Negative
6040	2	B604001-1	1	119	Cafeteria (Dining Area)	Cafetorium	yes	Column	Concrete	Tan	Efflorescence	5	0	Negative
6040	2	B604001-1	1	119	Cafeteria (Dining Area)	Cafetorium	yes	W3	Concrete	White	None	0	0	Negative
6040	2	B604001-1	1	119	Cafeteria (Dining Area)	Cafetorium	yes	W3	Concrete	Tan	None	0	0	Negative
6040	2	B604001-1	1	119	Cafeteria (Dining Area)	Cafetorium	yes	W4	Concrete	White	None	0	0	Negative
6040	2	B604001-1	1	119	Cafeteria (Dining Area)	Cafetorium	yes	W4	Concrete	Tan	None	0	0	Negative
6040	2	B604001-1	1	119	Cafeteria (Dining Area)	Cafetorium	yes	Ceiling	Concrete	White	None	0	N/A	No Access
6040	2	B604001-1	1	125	Student Restrooms - Male (4-12)	Boy's Restroom near Classrooms 3 and 4	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	125	Student Restrooms - Male (4-12)	Boy's Restroom near Classrooms 3 and 4	yes	Door Case	Metal	Tan	None	0	0	Negative
6040	2	B604001-1	1	125	Student Restrooms - Male (4-12)	Boy's Restroom near Classrooms 3 and 4	yes	W1	Concrete	Tan	None	0	0	Negative
6040	2	B604001-1	1	125	Student Restrooms - Male (4-12)	Boy's Restroom near Classrooms 3 and 4	yes	W2	Concrete	Tan	None	0	0	Negative
6040	2	B604001-1	1	125	Student Restrooms - Male (4-12)	Boy's Restroom near Classrooms 3 and 4	yes	W3	Concrete	Tan	None	0	0	Negative

					Dates: 9/12/22 - 10/4/22		Lead-Safe Certification Assessment Report							
					Inspector Name and Certificate Number: Jennifer Drialo-006767/ Steve Merlino- 006800		6040 Walter Biddle Saul HS/Manatawna Farm							
					Inspection Company: Synertech		7100 Henry Avenue, Philadelphia, PA 19128							
ULCS#	E l e m e n t	BldgElmt ID	F l o o r	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/ negative)
6040	2	B604001-1	1	125	Student Restrooms - Male (4-12)	Boy's Restroom near Classrooms 3 and 4	yes	W4	Concrete	Tan	None	0	0	Negative
6040	2	B604001-1	1	125	Student Restrooms - Male (4-12)	Boy's Restroom near Classrooms 3 and 4	yes	Ceiling	Concrete	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	109-2	Student Restrooms - Male (4-12)	Boy's Restroom near Kitchen	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	109-2	Student Restrooms - Male (4-12)	Boy's Restroom near Kitchen	yes	Door Case	Metal	Tan	None	0	0.12	Negative
6040	2	B604001-1	1	109-2	Student Restrooms - Male (4-12)	Boy's Restroom near Kitchen	yes	W1	Concrete	Tan	None	0	0	Negative
6040	2	B604001-1	1	109-2	Student Restrooms - Male (4-12)	Boy's Restroom near Kitchen	yes	W2	Concrete	Tan	None	0	0	Negative
6040	2	B604001-1	1	109-2	Student Restrooms - Male (4-12)	Boy's Restroom near Kitchen	yes	W3	Concrete	Tan	None	0	0	Negative
6040	2	B604001-1	1	109-2	Student Restrooms - Male (4-12)	Boy's Restroom near Kitchen	yes	W4	Concrete	Tan	None	0	0	Negative
6040	2	B604001-1	1	109-2	Student Restrooms - Male (4-12)	Boy's Restroom near Kitchen	yes	Ceiling	Concrete	White	None	0	0	Negative
6040	2	B604001-1	1	110-2	Restrooms, Staff - Female	Cafeteria Women's Restroom	no	Floor	N/A	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	110-2	Restrooms, Staff - Female	Cafeteria Women's Restroom	yes	Door Case	Metal	Tan	None	0	0.14	Negative
6040	2	B604001-1	1	110-2	Restrooms, Staff - Female	Cafeteria Women's Restroom	no	W1	Concrete	Tan	Chipping	10	0	Negative
6040	2	B604001-1	1	110-2	Restrooms, Staff - Female	Cafeteria Women's Restroom	no	W2	Concrete	Tan	Efflorescence	20	0	Negative
6040	2	B604001-1	1	110-2	Restrooms, Staff - Female	Cafeteria Women's Restroom	no	W3	Concrete	Tan	Efflorescence	15	0	Negative
6040	2	B604001-1	1	110-2	Restrooms, Staff - Female	Cafeteria Women's Restroom	no	W4	Concrete	Tan	Efflorescence	20	0	Negative
6040	2	B604001-1	1	110-2	Restrooms, Staff - Female	Cafeteria Women's Restroom	no	Ceiling	Concrete	White	None	0	0	Negative
6040	2	B604001-1	1	001-2	Senior High -- Science Lab	Classroom 1	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	001-2	Senior High -- Science Lab	Classroom 1	yes	W1	Concrete	Yellow	None	0	0	Negative
6040	2	B604001-1	1	001-2	Senior High -- Science Lab	Classroom 1	yes	W2	Concrete	Yellow	None	0	0	Negative
6040	2	B604001-1	1	001-2	Senior High -- Science Lab	Classroom 1	yes	W3	Sheetrock	Yellow	None	0	0	Negative
6040	2	B604001-1	1	001-2	Senior High -- Science Lab	Classroom 1	yes	W3	Concrete	Yellow	None	0	0	Negative
6040	2	B604001-1	1	001-2	Senior High -- Science Lab	Classroom 1	yes	W4	Wood	Blue	None	0	0	Negative
6040	2	B604001-1	1	001-2	Senior High -- Science Lab	Classroom 1	yes	Ceiling	Concrete	N/A	N/A	N/A	N/A	N/A

					Dates: 9/12/22 - 10/4/22		Lead-Safe Certification Assessment Report							
					Inspector Name and Certificate Number: Jennifer Drialo-006767/ Steve Merlino- 006800		6040 Walter Biddle Saul HS/Manatawna Farm							
					Inspection Company: Synertech		7100 Henry Avenue, Philadelphia, PA 19128							
ULCS#	E l e m e n t	BldgElmt ID	F l o o r	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/ negative)
6040	2	B604001-1	1	001A-2	Storage	Classroom 1 Closet	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	001A-2	Storage	Classroom 1 Closet	yes	Door Case	Metal	Tan	None	0	0	Negative
6040	2	B604001-1	1	001A-2	Storage	Classroom 1 Closet	yes	W1	Concrete	Tan	None	0	0	Negative
6040	2	B604001-1	1	001A-2	Storage	Classroom 1 Closet	yes	W2	Concrete	Tan	None	0	0	Negative
6040	2	B604001-1	1	001A-2	Storage	Classroom 1 Closet	yes	W3	Concrete	Tan	None	0	0	Negative
6040	2	B604001-1	1	001A-2	Storage	Classroom 1 Closet	yes	W4	Concrete	Tan	None	0	0	Negative
6040	2	B604001-1	1	001A-2	Storage	Classroom 1 Closet	yes	Ceiling	Concrete	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	002-2	Senior High	Classroom 2	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	002-2	Senior High	Classroom 2	yes	W1	Concrete	Tan	None	0	0	Negative
6040	2	B604001-1	1	002-2	Senior High	Classroom 2	yes	Telebox	Metal	Pink	None	0	0	Negative
6040	2	B604001-1	1	002-2	Senior High	Classroom 2	yes	W2	Wood	Tan	None	0	0	Negative
6040	2	B604001-1	1	002-2	Senior High	Classroom 2	yes	Wall Heater	Metal	Pink	None	0	0	Negative
6040	2	B604001-1	1	002-2	Senior High	Classroom 2	yes	Unit-Ventilator	Metal	Grey	None	0	0	Negative
6040	2	B604001-1	1	002-2	Senior High	Classroom 2	yes	W3	Concrete	Tan	None	0	0	Negative
6040	2	B604001-1	1	002-2	Senior High	Classroom 2	yes	W4	Wood	Tan	None	0	0	Negative
6040	2	B604001-1	1	002-2	Senior High	Classroom 2	yes	Ceiling	Concrete	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	002A	Storage	Classroom 2 Closet	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	002A	Storage	Classroom 2 Closet	yes	Door Case	Metal	Pink	Friction	2	0.1	Negative
6040	2	B604001-1	1	002A	Storage	Classroom 2 Closet	yes	W1	Concrete	Tan	None	0	0	Negative
6040	2	B604001-1	1	002A	Storage	Classroom 2 Closet	yes	W2	Concrete	Tan	None	0	0	Negative
6040	2	B604001-1	1	002A	Storage	Classroom 2 Closet	yes	W3	Concrete	Tan	None	0	0	Negative
6040	2	B604001-1	1	002A	Storage	Classroom 2 Closet	yes	W4	Concrete	Tan	None	0	0	Negative
6040	2	B604001-1	1	002A	Storage	Classroom 2 Closet	yes	Ceiling	Concrete	White	None	0	0	Negative
6040	2	B604001-1	1	44622	Senior High -- Science Lab	Classroom 3	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	44622	Senior High -- Science Lab	Classroom 3	yes	Door Case	Metal	Tan	None	0	0	Negative
6040	2	B604001-1	1	44622	Senior High -- Science Lab	Classroom 3	yes	W1	Concrete	Yellow	Chipping	1	0	Negative
6040	2	B604001-1	1	44622	Senior High -- Science Lab	Classroom 3	yes	W2	Wood	Green	None	0	0	Negative
6040	2	B604001-1	1	44622	Senior High -- Science Lab	Classroom 3	yes	W3	Concrete	Yellow	Chipping	6	0	Negative
6040	2	B604001-1	1	44622	Senior High -- Science Lab	Classroom 3	yes	W4	Concrete	Yellow	None	0	0	Negative
6040	2	B604001-1	1	44622	Senior High -- Science Lab	Classroom 3	yes	Ceiling	Concrete	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	44653	Senior High -- Science Lab	Classroom 4	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	44653	Senior High -- Science Lab	Classroom 4	yes	Door Case	Metal	Tan	None	0	0	Negative
6040	2	B604001-1	1	44653	Senior High -- Science Lab	Classroom 4	yes	W1	Concrete	Blue	None	0	0	Negative
6040	2	B604001-1	1	44653	Senior High -- Science Lab	Classroom 4	yes	W2	Concrete	Blue	None	0	0	Negative
6040	2	B604001-1	1	44653	Senior High -- Science Lab	Classroom 4	yes	W3	Concrete	Blue	None	0	0	Negative
6040	2	B604001-1	1	44653	Senior High -- Science Lab	Classroom 4	yes	Vent	Metal	Blue	None	0	0	Negative
6040	2	B604001-1	1	44653	Senior High -- Science Lab	Classroom 4	yes	W4	Concrete	Blue	None	0	0	Negative
6040	2	B604001-1	1	44653	Senior High -- Science Lab	Classroom 4	yes	Ceiling	Concrete	N/A	N/A	N/A	N/A	N/A

					Dates: 9/12/22 - 10/4/22		Lead-Safe Certification Assessment Report							
					Inspector Name and Certificate Number: Jennifer Drialo-006767/ Steve Merlino- 006800		6040 Walter Biddle Saul HS/Manatawna Farm							
					Inspection Company: Synertech		7100 Henry Avenue, Philadelphia, PA 19128							
ULCS#	Element	BldgElmt ID	Floor	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
6040	2	B604001-1	1	107-2	Copying Room	Copy Room 7 Former Teacher's Lounge	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	107-2	Copying Room	Copy Room 7 Former Teacher's Lounge	yes	Door Case	Metal	Tan	None	0	0	Negative
6040	2	B604001-1	1	107-2	Copying Room	Copy Room 7 Former Teacher's Lounge	yes	W1	Concrete	Tan	None	0	0	Negative
6040	2	B604001-1	1	107-2	Copying Room	Copy Room 7 Former Teacher's Lounge	yes	W2	Concrete	Tan	None	0	0	Negative
6040	2	B604001-1	1	107-2	Copying Room	Copy Room 7 Former Teacher's Lounge	yes	W3	Concrete	Tan	None	0	0	Negative
6040	2	B604001-1	1	107-2	Copying Room	Copy Room 7 Former Teacher's Lounge	yes	W4	Concrete	Tan	None	0	0	Negative
6040	2	B604001-1	1	107-2	Copying Room	Copy Room 7 Former Teacher's Lounge	yes	Ceiling	Concrete	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	107B-2	Pipe Chase	Copy Room 7 Former Teacher's Lounge Pipe Chase	no	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	107B-2	Pipe Chase	Copy Room 7 Former Teacher's Lounge Pipe Chase	no	W1	Concrete	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	107B-2	Pipe Chase	Copy Room 7 Former Teacher's Lounge Pipe Chase	no	W2	Concrete	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	107B-2	Pipe Chase	Copy Room 7 Former Teacher's Lounge Pipe Chase	no	W3	Concrete	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	107B-2	Pipe Chase	Copy Room 7 Former Teacher's Lounge Pipe Chase	no	W4	Concrete	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	107B-2	Pipe Chase	Copy Room 7 Former Teacher's Lounge Pipe Chase	no	Ceiling	Concrete	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	118A	Administrative Office	Counselor's Office	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	118A	Administrative Office	Counselor's Office	yes	Door Case	Metal	Grey	None	0	0.1	Negative
6040	2	B604001-1	1	118A	Administrative Office	Counselor's Office	yes	W1	Concrete	Grey	None	0	0	Negative
6040	2	B604001-1	1	118A	Administrative Office	Counselor's Office	yes	W2	Concrete	Grey	None	0	0	Negative
6040	2	B604001-1	1	118A	Administrative Office	Counselor's Office	yes	W3	Concrete	Grey	None	0	0	Negative
6040	2	B604001-1	1	118A	Administrative Office	Counselor's Office	yes	W4	Concrete	Grey	None	0	0	Negative
6040	2	B604001-1	1	118A	Administrative Office	Counselor's Office	yes	Ceiling	Concrete	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	118	Administrative Office	Counselor's Office Waiting Room	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	118	Administrative Office	Counselor's Office Waiting Room	yes	Door Case	Metal	Grey	None	0	0.13	Negative
6040	2	B604001-1	1	118	Administrative Office	Counselor's Office Waiting Room	yes	W1	Concrete	Grey	None	0	0	Negative
6040	2	B604001-1	1	118	Administrative Office	Counselor's Office Waiting Room	yes	W2	Concrete	Grey	None	0	0	Negative
6040	2	B604001-1	1	118	Administrative Office	Counselor's Office Waiting Room	yes	W3	Concrete	Grey	None	0	0	Negative
6040	2	B604001-1	1	118	Administrative Office	Counselor's Office Waiting Room	yes	W4	Concrete	Grey	None	0	0	Negative
6040	2	B604001-1	1	118	Administrative Office	Counselor's Office Waiting Room	yes	Ceiling	Concrete	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	109A-2	Service Closets	Custodial Closet near Kitchen	no	Floor	Concrete	N/A	N/A	N/A	N/A	N/A

					Dates: 9/12/22 - 10/4/22		Lead-Safe Certification Assessment Report							
					Inspector Name and Certificate Number: Jennifer Drialo-006767/ Steve Merlino- 006800		6040 Walter Biddle Saul HS/Manatawna Farm							
					Inspection Company: Synertech		7100 Henry Avenue, Philadelphia, PA 19128							
ULCS#	Element	BldgElmt ID	Floor	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
6040	2	B604001-1	1	109A-2	Service Closets	Custodial Closet near Kitchen	no	W1	Concrete	White	None	0	0	Negative
6040	2	B604001-1	1	109A-2	Service Closets	Custodial Closet near Kitchen	no	W2	Concrete	White	None	0	0	Negative
6040	2	B604001-1	1	109A-2	Service Closets	Custodial Closet near Kitchen	no	W3	Concrete	White	None	0	0	Negative
6040	2	B604001-1	1	109A-2	Service Closets	Custodial Closet near Kitchen	no	W4	Concrete	White	None	0	0	Negative
6040	2	B604001-1	1	109A-2	Service Closets	Custodial Closet near Kitchen	no	Ceiling	Plaster	White	None	0	0	Negative
6040	2	B604001-1	1	120	Administrative Office	Disciplinarian Office	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	120	Administrative Office	Disciplinarian Office	yes	Door Case	Metal	Tan	Friction	6	0	Negative
6040	2	B604001-1	1	120	Administrative Office	Disciplinarian Office	yes	W1	Concrete	Tan	None	0	0	Negative
6040	2	B604001-1	1	120	Administrative Office	Disciplinarian Office	yes	W2	Concrete	Tan	None	0	0	Negative
6040	2	B604001-1	1	120	Administrative Office	Disciplinarian Office	yes	W3	Concrete	Tan	None	0	0	Negative
6040	2	B604001-1	1	120	Administrative Office	Disciplinarian Office	yes	W4	Concrete	Tan	None	0	0	Negative
6040	2	B604001-1	1	120	Administrative Office	Disciplinarian Office	yes	Ceiling	Concrete	White	None	0	0	Negative
6040	2	B604001-1	1	120B	Storage	Disciplinarian Office Closet	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	120B	Storage	Disciplinarian Office Closet	yes	Door Case	Metal	Tan	Friction	4	0.1	Negative
6040	2	B604001-1	1	120B	Storage	Disciplinarian Office Closet	yes	W1	Concrete	Tan	None	0	0	Negative
6040	2	B604001-1	1	120B	Storage	Disciplinarian Office Closet	yes	W2	Concrete	Tan	None	0	0	Negative
6040	2	B604001-1	1	120B	Storage	Disciplinarian Office Closet	yes	W3	Concrete	Tan	None	0	0	Negative
6040	2	B604001-1	1	120B	Storage	Disciplinarian Office Closet	yes	W4	Concrete	Tan	None	0	0	Negative
6040	2	B604001-1	1	120B	Storage	Disciplinarian Office Closet	yes	Ceiling	Plaster	White	None	0	0	Negative
6040	2	B604001-1	1	120A	Restrooms, Staff - Male/Female	Disciplinarian Office Restroom	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	120A	Restrooms, Staff - Male/Female	Disciplinarian Office Restroom	yes	Door Case	Metal	Tan	Friction	4	0.12	Negative
6040	2	B604001-1	1	120A	Restrooms, Staff - Male/Female	Disciplinarian Office Restroom	yes	W1	Concrete	Tan	None	0	0	Negative
6040	2	B604001-1	1	120A	Restrooms, Staff - Male/Female	Disciplinarian Office Restroom	yes	W2	Concrete	Tan	None	0	0	Negative
6040	2	B604001-1	1	120A	Restrooms, Staff - Male/Female	Disciplinarian Office Restroom	yes	W3	Concrete	Tan	None	0	0	Negative
6040	2	B604001-1	1	120A	Restrooms, Staff - Male/Female	Disciplinarian Office Restroom	yes	W4	Concrete	Tan	None	0	0	Negative
6040	2	B604001-1	1	120A	Restrooms, Staff - Male/Female	Disciplinarian Office Restroom	yes	Ceiling	Plaster	White	None	0	0	Negative
6040	2	B604001-1	1	H112A	Circulation (Hallway)	Element 2 Main Entrance	yes	Floor	Terrazzo	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	H112A	Circulation (Hallway)	Element 2 Main Entrance	yes	Door	Metal	Brown	None	0	0	Negative
6040	2	B604001-1	1	H112A	Circulation (Hallway)	Element 2 Main Entrance	yes	Door Case	Metal	Brown	None	0	0	Negative

					Dates: 9/12/22 - 10/4/22		Lead-Safe Certification Assessment Report							
					Inspector Name and Certificate Number: Jennifer Drialo-006767/ Steve Merlino- 006800		6040 Walter Biddle Saul HS/Manatawna Farm							
					Inspection Company: Synertech		7100 Henry Avenue, Philadelphia, PA 19128							
ULCS#	Element	BldgElmt ID	Floor	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
6040	2	B604001-1	1	H112A	Circulation (Hallway)	Element 2 Main Entrance	yes	W2	Concrete	Tan	None	0	0	Negative
6040	2	B604001-1	1	H112A	Circulation (Hallway)	Element 2 Main Entrance	yes	Door	Metal	Tan	None	0	0	Negative
6040	2	B604001-1	1	H112A	Circulation (Hallway)	Element 2 Main Entrance	yes	Door Case	Metal	Tan	None	0	0	Negative
6040	2	B604001-1	1	H112A	Circulation (Hallway)	Element 2 Main Entrance	yes	W4	Concrete	Tan	None	0	0	Negative
6040	2	B604001-1	1	H112A	Circulation (Hallway)	Element 2 Main Entrance	yes	Ceiling	Concrete	White	None	0	0	Negative
6040	2	B604001-1	1	114A	Teacher Lounge/Dining	Faculty Dining Room	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	114A	Teacher Lounge/Dining	Faculty Dining Room	yes	W1	Concrete	Yellow	None	0	0	Negative
6040	2	B604001-1	1	114A	Teacher Lounge/Dining	Faculty Dining Room	yes	W2	Concrete	Yellow	None	0	0	Negative
6040	2	B604001-1	1	114A	Teacher Lounge/Dining	Faculty Dining Room	yes	W3	Concrete	Yellow	Flaking	1	0	Negative
6040	2	B604001-1	1	114A	Teacher Lounge/Dining	Faculty Dining Room	yes	W4	Concrete	Yellow	Flaking	1	0	Negative
6040	2	B604001-1	1	114A	Teacher Lounge/Dining	Faculty Dining Room	yes	Ceiling	Concrete	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	114C	Storage	Faculty Dining Room Closet	yes	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	114C	Storage	Faculty Dining Room Closet	yes	W1	Concrete	Yellow	None	0	0	Negative
6040	2	B604001-1	1	114C	Storage	Faculty Dining Room Closet	yes	W2	Concrete	Yellow	None	0	0	Negative
6040	2	B604001-1	1	114C	Storage	Faculty Dining Room Closet	yes	W3	Concrete	Yellow	None	0	0	Negative
6040	2	B604001-1	1	114C	Storage	Faculty Dining Room Closet	yes	W4	Concrete	Yellow	None	0	0	Negative
6040	2	B604001-1	1	114C	Storage	Faculty Dining Room Closet	yes	Ceiling	Concrete	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	121B	Showers - Male	Former Boy's Locker Room Showers	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	121B	Showers - Male	Former Boy's Locker Room Showers	yes	W1	N/A	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	121B	Showers - Male	Former Boy's Locker Room Showers	yes	W2	N/A	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	121B	Showers - Male	Former Boy's Locker Room Showers	yes	W3	N/A	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	121B	Showers - Male	Former Boy's Locker Room Showers	yes	W4	N/A	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	121B	Showers - Male	Former Boy's Locker Room Showers	yes	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	123	Lockers - Female	Former Girl's Locker Room	no	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	123	Lockers - Female	Former Girl's Locker Room	yes	Door Case	Metal	Tan	None	0	0	Negative
6040	2	B604001-1	1	123	Lockers - Female	Former Girl's Locker Room	no	W1	Concrete	Tan	None	0	0	Negative
6040	2	B604001-1	1	123	Lockers - Female	Former Girl's Locker Room	no	W2	Concrete	Tan	None	0	0	Negative
6040	2	B604001-1	1	123	Lockers - Female	Former Girl's Locker Room	no	W3	Concrete	Tan	None	0	0	Negative
6040	2	B604001-1	1	123	Lockers - Female	Former Girl's Locker Room	no	W4	Concrete	Tan	None	0	0	Negative
6040	2	B604001-1	1	123	Lockers - Female	Former Girl's Locker Room	no	Ceiling	Plaster	White	None	0	0	Negative
6040	2	B604001-1	1	123A	Showers - Female	Former Girl's Locker Room Large Shower Area	no	Floor	N/A	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	123A	Showers - Female	Former Girl's Locker Room Large Shower Area	no	W1	N/A	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	123A	Showers - Female	Former Girl's Locker Room Large Shower Area	no	W2	N/A	N/A	N/A	N/A	N/A	N/A

					Dates: 9/12/22 - 10/4/22		Lead-Safe Certification Assessment Report							
					Inspector Name and Certificate Number: Jennifer Drialo-006767/ Steve Merlino- 006800		6040 Walter Biddle Saul HS/Manatawna Farm							
					Inspection Company: Synertech		7100 Henry Avenue, Philadelphia, PA 19128							
ULCS#	Element	BldgElmt ID	Floor	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
6040	2	B604001-1	1	123A	Showers - Female	Former Girl's Locker Room Large Shower Area	no	W3	N/A	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	123A	Showers - Female	Former Girl's Locker Room Large Shower Area	no	W4	N/A	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	123A	Showers - Female	Former Girl's Locker Room Large Shower Area	no	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	123E	Telecommunication Equipment Room	Former Girl's Locker Room Large Telecommunication Equipment Room	no	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	123E	Telecommunication Equipment Room	Former Girl's Locker Room Large Telecommunication Equipment Room	yes	Door Case	Metal	Tan	None	0	0	Negative
6040	2	B604001-1	1	123E	Telecommunication Equipment Room	Former Girl's Locker Room Large Telecommunication Equipment Room	no	W1	Concrete	Tan	None	0	0	Negative
6040	2	B604001-1	1	123E	Telecommunication Equipment Room	Former Girl's Locker Room Large Telecommunication Equipment Room	no	W2	Concrete	Tan	None	0	0	Negative
6040	2	B604001-1	1	123E	Telecommunication Equipment Room	Former Girl's Locker Room Large Telecommunication Equipment Room	no	W3	Concrete	Tan	None	0	0	Negative
6040	2	B604001-1	1	123E	Telecommunication Equipment Room	Former Girl's Locker Room Large Telecommunication Equipment Room	no	W4	Concrete	Tan	None	0	0	Negative
6040	2	B604001-1	1	123E	Telecommunication Equipment Room	Former Girl's Locker Room Large Telecommunication Equipment Room	no	Ceiling	Plaster	White	None	0	0	Negative
6040	2	B604001-1	1	123B	Student Restrooms - Female (4-12)	Former Girl's Locker Room Restroom	no	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	123B	Student Restrooms - Female (4-12)	Former Girl's Locker Room Restroom	yes	Door Case	Metal	Tan	None	0	0	Negative
6040	2	B604001-1	1	123B	Student Restrooms - Female (4-12)	Former Girl's Locker Room Restroom	no	W1	Concrete	Tan	None	0	0	Negative
6040	2	B604001-1	1	123B	Student Restrooms - Female (4-12)	Former Girl's Locker Room Restroom	no	W2	Concrete	Tan	None	0	0	Negative
6040	2	B604001-1	1	123B	Student Restrooms - Female (4-12)	Former Girl's Locker Room Restroom	no	W3	Concrete	Tan	None	0	0	Negative
6040	2	B604001-1	1	123B	Student Restrooms - Female (4-12)	Former Girl's Locker Room Restroom	no	W4	Concrete	Tan	None	0	0	Negative
6040	2	B604001-1	1	123B	Student Restrooms - Female (4-12)	Former Girl's Locker Room Restroom	no	Ceiling	Plaster	White	None	0	0	Negative
6040	2	B604001-1	1	121C	Showers - Female	Former Girl's Locker Room Small Shower Area	no	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	121C	Showers - Female	Former Girl's Locker Room Small Shower Area	no	W1	Concrete	Tan	None	0	0	Negative
6040	2	B604001-1	1	121C	Showers - Female	Former Girl's Locker Room Small Shower Area	no	W2	Concrete	Tan	None	0	0	Negative
6040	2	B604001-1	1	121C	Showers - Female	Former Girl's Locker Room Small Shower Area	no	W3	Concrete	Tan	None	0	0	Negative

					Dates: 9/12/22 - 10/4/22		Lead-Safe Certification Assessment Report							
					Inspector Name and Certificate Number: Jennifer Drialo-006767/ Steve Merlino- 006800		6040 Walter Biddle Saul HS/Manatawna Farm							
					Inspection Company: Synertech		7100 Henry Avenue, Philadelphia, PA 19128							
ULCS#	Element	BldgElmt ID	Floor	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
6040	2	B604001-1	1	121C	Showers - Female	Former Girl's Locker Room Small Shower Area	no	W4	Concrete	Tan	None	0	0	Negative
6040	2	B604001-1	1	121C	Showers - Female	Former Girl's Locker Room Small Shower Area	no	Ceiling	Plaster	White	None	0	0	Negative
6040	2	B604001-1	1	107A-2	Copying Room	Former Teacher's Lounge 7 area with HVAC unit (hallway)	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	107A-2	Copying Room	Former Teacher's Lounge 7 area with HVAC unit (hallway)	yes	W1	Concrete	Tan	None	0	0	Negative
6040	2	B604001-1	1	107A-2	Copying Room	Former Teacher's Lounge 7 area with HVAC unit (hallway)	yes	Ductwork	Metal	Tan	None	0	0	Negative
6040	2	B604001-1	1	107A-2	Copying Room	Former Teacher's Lounge 7 area with HVAC unit (hallway)	yes	W3	Concrete	Tan	None	0	0	Negative
6040	2	B604001-1	1	107A-2	Copying Room	Former Teacher's Lounge 7 area with HVAC unit (hallway)	yes	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	124	Student Restrooms - Female (4-12)	Girl's Restroom near Classrooms 3 and 4	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	124	Student Restrooms - Female (4-12)	Girl's Restroom near Classrooms 3 and 4	yes	Door Case	Metal	Tan	None	0	0.12	Negative
6040	2	B604001-1	1	124	Student Restrooms - Female (4-12)	Girl's Restroom near Classrooms 3 and 4	yes	W1	Concrete	Tan	None	0	0	Negative
6040	2	B604001-1	1	124	Student Restrooms - Female (4-12)	Girl's Restroom near Classrooms 3 and 4	yes	W2	Concrete	Tan	Flaking	10	0	Negative
6040	2	B604001-1	1	124	Student Restrooms - Female (4-12)	Girl's Restroom near Classrooms 3 and 4	yes	W3	Concrete	Tan	Flaking	10	0	Negative
6040	2	B604001-1	1	124	Student Restrooms - Female (4-12)	Girl's Restroom near Classrooms 3 and 4	yes	W4	Concrete	Tan	None	0	0	Negative
6040	2	B604001-1	1	124	Student Restrooms - Female (4-12)	Girl's Restroom near Classrooms 3 and 4	yes	Ceiling	Concrete	White	None	0	0	Negative
6040	2	B604001-1	1	108-2	Student Restrooms - Female (4-12)	Girl's Restroom near Kitchen	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	108-2	Student Restrooms - Female (4-12)	Girl's Restroom near Kitchen	yes	Door Case	Metal	Tan	None	0	0.12	Negative
6040	2	B604001-1	1	108-2	Student Restrooms - Female (4-12)	Girl's Restroom near Kitchen	yes	W1	Concrete	Tan	None	0	0	Negative
6040	2	B604001-1	1	108-2	Student Restrooms - Female (4-12)	Girl's Restroom near Kitchen	yes	W2	Concrete	Tan	None	0	0	Negative
6040	2	B604001-1	1	108-2	Student Restrooms - Female (4-12)	Girl's Restroom near Kitchen	yes	W3	Concrete	Tan	None	0	0	Negative
6040	2	B604001-1	1	108-2	Student Restrooms - Female (4-12)	Girl's Restroom near Kitchen	yes	W4	Concrete	Tan	None	0	0	Negative
6040	2	B604001-1	1	108-2	Student Restrooms - Female (4-12)	Girl's Restroom near Kitchen	yes	Ceiling	Concrete	White	None	0	0	Negative

					Dates: 9/12/22 - 10/4/22		Lead-Safe Certification Assessment Report							
					Inspector Name and Certificate Number: Jennifer Drialo-006767/ Steve Merlino- 006800		6040 Walter Biddle Saul HS/Manatawna Farm							
					Inspection Company: Synertech		7100 Henry Avenue, Philadelphia, PA 19128							
ULCS#	Element	BldgElmt ID	Floor	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
6040	2	B604001-1	1	108A	Student Restrooms - Female (4-12)	Girl's Restroom near Kitchen Vestibule	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	108A	Student Restrooms - Female (4-12)	Girl's Restroom near Kitchen Vestibule	yes	W1	Concrete	Tan	None	0	0	Negative
6040	2	B604001-1	1	108A	Student Restrooms - Female (4-12)	Girl's Restroom near Kitchen Vestibule	yes	W2	Concrete	Tan	None	0	0	Negative
6040	2	B604001-1	1	108A	Student Restrooms - Female (4-12)	Girl's Restroom near Kitchen Vestibule	yes	W3	Concrete	Tan	None	0	0	Negative
6040	2	B604001-1	1	108A	Student Restrooms - Female (4-12)	Girl's Restroom near Kitchen Vestibule	yes	W4	Concrete	Tan	None	0	0	Negative
6040	2	B604001-1	1	108A	Student Restrooms - Female (4-12)	Girl's Restroom near Kitchen Vestibule	yes	Ceiling	Concrete	White	None	0	0	Negative
6040	2	B604001-1	1	H112	Circulation (Hallway)	Hallway from Element 1 to Counselor's Office	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	H112	Circulation (Hallway)	Hallway from Element 1 to Counselor's Office	yes	Door	Metal	Tan	None	0	0	Negative
6040	2	B604001-1	1	H112	Circulation (Hallway)	Hallway from Element 1 to Counselor's Office	yes	Door Case	Metal	Tan	Friction	0	0	Negative
6040	2	B604001-1	1	H112	Circulation (Hallway)	Hallway from Element 1 to Counselor's Office	yes	W2	Concrete	Tan	None	0	0	Negative
6040	2	B604001-1	1	H112	Circulation (Hallway)	Hallway from Element 1 to Counselor's Office	yes	W4	Concrete	Tan	None	0	0	Negative
6040	2	B604001-1	1	H112	Circulation (Hallway)	Hallway from Element 1 to Counselor's Office	yes	Ceiling	Concrete	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	H113	Circulation (Hallway)	Hallway outside Classrooms 1-4	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	H113	Circulation (Hallway)	Hallway outside Classrooms 1-4	yes	W1	Concrete	Tan	None	0	0	Negative
6040	2	B604001-1	1	H113	Circulation (Hallway)	Hallway outside Classrooms 1-4	yes	W3	Concrete	Tan	None	0	0	Negative
6040	2	B604001-1	1	H113	Circulation (Hallway)	Hallway outside Classrooms 1-4	yes	Ceiling	Concrete	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	H113C	Pipe Chase	Hallway outside Classrooms 1-4 Pipe Chase across from Classroom 1	no	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	H113C	Pipe Chase	Hallway outside Classrooms 1-4 Pipe Chase across from Classroom 1	no	W1	Concrete	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	H113C	Pipe Chase	Hallway outside Classrooms 1-4 Pipe Chase across from Classroom 1	no	W2	Concrete	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	H113C	Pipe Chase	Hallway outside Classrooms 1-4 Pipe Chase across from Classroom 1	no	W3	Concrete	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	H113C	Pipe Chase	Hallway outside Classrooms 1-4 Pipe Chase across from Classroom 1	no	W4	Concrete	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	H113C	Pipe Chase	Hallway outside Classrooms 1-4 Pipe Chase across from Classroom 1	no	Ceiling	Concrete	N/A	N/A	N/A	N/A	N/A

					Dates: 9/12/22 - 10/4/22		Lead-Safe Certification Assessment Report							
					Inspector Name and Certificate Number: Jennifer Drialo-006767/ Steve Merlino- 006800		6040 Walter Biddle Saul HS/Manatawna Farm							
					Inspection Company: Synertech		7100 Henry Avenue, Philadelphia, PA 19128							
ULCS#	Element	BldgElmt ID	Floor	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
6040	2	B604001-1	1	H113E	Pipe Chase	Hallway outside Classrooms 1-4 Pipe Chase across from Classroom 2	no	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	H113E	Pipe Chase	Hallway outside Classrooms 1-4 Pipe Chase across from Classroom 2	no	W1	Concrete	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	H113E	Pipe Chase	Hallway outside Classrooms 1-4 Pipe Chase across from Classroom 2	no	W2	Concrete	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	H113E	Pipe Chase	Hallway outside Classrooms 1-4 Pipe Chase across from Classroom 2	no	W3	Concrete	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	H113E	Pipe Chase	Hallway outside Classrooms 1-4 Pipe Chase across from Classroom 2	no	W4	Concrete	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	H113E	Pipe Chase	Hallway outside Classrooms 1-4 Pipe Chase across from Classroom 2	no	Ceiling	Concrete	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	H113D	Pipe Chase	Hallway outside Classrooms 1-4 Pipe Chase across from Classroom 3	no	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	H113D	Pipe Chase	Hallway outside Classrooms 1-4 Pipe Chase across from Classroom 3	no	W1	Concrete	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	H113D	Pipe Chase	Hallway outside Classrooms 1-4 Pipe Chase across from Classroom 3	no	W2	Concrete	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	H113D	Pipe Chase	Hallway outside Classrooms 1-4 Pipe Chase across from Classroom 3	no	W3	Concrete	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	H113D	Pipe Chase	Hallway outside Classrooms 1-4 Pipe Chase across from Classroom 3	no	W4	Concrete	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	H113D	Pipe Chase	Hallway outside Classrooms 1-4 Pipe Chase across from Classroom 3	no	Ceiling	Concrete	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	H111	Circulation (Hallway)	Hallway outside Faculty Dining Room	yes	Floor	Terrazzo	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	H111	Circulation (Hallway)	Hallway outside Faculty Dining Room	yes	W2	Concrete	Tan	None	0	0	Negative
6040	2	B604001-1	1	H111	Circulation (Hallway)	Hallway outside Faculty Dining Room	yes	Electric Panel	Metal	Brown	None	0	0	Negative
6040	2	B604001-1	1	H111	Circulation (Hallway)	Hallway outside Faculty Dining Room	yes	W4	Concrete	Tan	None	0	0	Negative
6040	2	B604001-1	1	H111	Circulation (Hallway)	Hallway outside Faculty Dining Room	yes	Ceiling	Concrete	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	H110	Circulation (Hallway)	Hallway outside Kitchen	yes	Floor	Terrazzo	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	H110	Circulation (Hallway)	Hallway outside Kitchen	yes	W2	Concrete	Tan	None	0	0	Negative
6040	2	B604001-1	1	H110	Circulation (Hallway)	Hallway outside Kitchen	yes	W4	Concrete	Tan	None	0	0	Negative
6040	2	B604001-1	1	H110	Circulation (Hallway)	Hallway outside Kitchen	yes	Ceiling	Concrete	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	H11A	Circulation (Hallway)	Hallway outside Kitchen Entrance near Faculty Dining Room	yes	Floor	Terrazzo	N/A	N/A	N/A	N/A	N/A

					Dates: 9/12/22 - 10/4/22		Lead-Safe Certification Assessment Report							
					Inspector Name and Certificate Number: Jennifer Drialo-006767/ Steve Merlino- 006800		6040 Walter Biddle Saul HS/Manatawna Farm							
					Inspection Company: Synertech		7100 Henry Avenue, Philadelphia, PA 19128							
ULCS#	Element	BldgElmt ID	Floor	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
6040	2	B604001-1	1	H11A	Circulation (Hallway)	Hallway outside Kitchen Entrance near Faculty Dining Room	yes	W2	Concrete	Tan	None	10	0	Negative
6040	2	B604001-1	1	H11A	Circulation (Hallway)	Hallway outside Kitchen Entrance near Faculty Dining Room	yes	W4	Concrete	Tan	None	0	0	Negative
6040	2	B604001-1	1	H11A	Circulation (Hallway)	Hallway outside Kitchen Entrance near Faculty Dining Room	yes	Ceiling	Concrete	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	H114	Circulation (Hallway)	Hallway outside Storage and Mechanical Room 6	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	H114	Circulation (Hallway)	Hallway outside Storage and Mechanical Room 6	yes	Door	Metal	Tan	Friction	6	0	Negative
6040	2	B604001-1	1	H114	Circulation (Hallway)	Hallway outside Storage and Mechanical Room 6	yes	Door Case	Metal	Tan	Friction	5	0	Negative
6040	2	B604001-1	1	H114	Circulation (Hallway)	Hallway outside Storage and Mechanical Room 6	yes	W2	Concrete	Tan	None	0	0	Negative
6040	2	B604001-1	1	H114	Circulation (Hallway)	Hallway outside Storage and Mechanical Room 6	yes	Door	Metal	Tan	Friction	4	0	Negative
6040	2	B604001-1	1	H114	Circulation (Hallway)	Hallway outside Storage and Mechanical Room 6	yes	Door Case	Metal	Tan	Friction	2	0	Negative
6040	2	B604001-1	1	H114	Circulation (Hallway)	Hallway outside Storage and Mechanical Room 6	yes	W4	Concrete	Tan	None	0	0	Negative
6040	2	B604001-1	1	H114	Circulation (Hallway)	Hallway outside Storage and Mechanical Room 6	yes	Ceiling	Concrete	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	124-PC	Pipe Chase	Pipe Chase between Girl's and Boy's Restrooms across from Classroom 3 in Hallway outside Classrooms 1-4	no	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	124-PC	Pipe Chase	Pipe Chase between Girl's and Boy's Restrooms across from Classroom 3 in Hallway outside Classrooms 1-4	no	W1	Concrete	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	124-PC	Pipe Chase	Pipe Chase between Girl's and Boy's Restrooms across from Classroom 3 in Hallway outside Classrooms 1-4	no	W2	Concrete	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	124-PC	Pipe Chase	Pipe Chase between Girl's and Boy's Restrooms across from Classroom 3 in Hallway outside Classrooms 1-4	no	W3	Concrete	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	124-PC	Pipe Chase	Pipe Chase between Girl's and Boy's Restrooms across from Classroom 3 in Hallway outside Classrooms 1-4	no	W4	Concrete	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	124-PC	Pipe Chase	Pipe Chase between Girl's and Boy's Restrooms across from Classroom 3 in Hallway outside Classrooms 1-4	no	Ceiling	Concrete	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	H113A	Stairs	Hallway Stairs outside Classroom 4	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	H113A	Stairs	Hallway Stairs outside Classroom 4	yes	W2	Concrete	Tan	None	0	0	Negative
6040	2	B604001-1	1	H113A	Stairs	Hallway Stairs outside Classroom 4	yes	W4	Concrete	Tan	None	0	0	Negative
6040	2	B604001-1	1	H113A	Stairs	Hallway Stairs outside Classroom 4	yes	Ceiling	Concrete	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	112	Kitchen	Kitchen	no	Floor	N/A	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	112	Kitchen	Kitchen	no	Door Case	Metal	Tan	Friction	2	0	Negative
6040	2	B604001-1	1	112	Kitchen	Kitchen	no	W1	Concrete	Yellow	None	0	0	Negative
6040	2	B604001-1	1	112	Kitchen	Kitchen	no	W2	Concrete	Yellow	None	0	0	Negative
6040	2	B604001-1	1	112	Kitchen	Kitchen	no	W3	Concrete	Yellow	None	0	0	Negative
6040	2	B604001-1	1	112	Kitchen	Kitchen	no	W4	Concrete	Yellow	None	0	0	Negative
6040	2	B604001-1	1	112	Kitchen	Kitchen	no	Ceiling	Plaster	White	None	0	0	Negative
6040	2	B604001-1	1	112C	Storage	Kitchen Closet	no	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	112C	Storage	Kitchen Closet	no	Door Case	Metal	Tan	None	0	0	Negative

					Dates: 9/12/22 - 10/4/22		Lead-Safe Certification Assessment Report							
					Inspector Name and Certificate Number: Jennifer Drialo-006767/ Steve Merlino- 006800		6040 Walter Biddle Saul HS/Manatawna Farm							
					Inspection Company: Synertech		7100 Henry Avenue, Philadelphia, PA 19128							
ULCS#	Element	BldgElmt ID	Floor	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
6040	2	B604001-1	1	112C	Storage	Kitchen Closet	no	W1	Concrete	Tan	None	0	0	Negative
6040	2	B604001-1	1	112C	Storage	Kitchen Closet	no	W2	Concrete	Tan	None	0	0	Negative
6040	2	B604001-1	1	112C	Storage	Kitchen Closet	no	W3	Concrete	Tan	None	0	0	Negative
6040	2	B604001-1	1	112C	Storage	Kitchen Closet	no	W4	Concrete	Tan	None	0	0	Negative
6040	2	B604001-1	1	112C	Storage	Kitchen Closet	no	Ceiling	Plaster	White	None	0	0	Negative
6040	2	B604001-1	1	112B	Space (Kitchen)	Kitchen Counter Area near Hallway	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	112B	Space (Kitchen)	Kitchen Counter Area near Hallway	yes	W1	Concrete	White	None	0	0	Negative
6040	2	B604001-1	1	112B	Space (Kitchen)	Kitchen Counter Area near Hallway	yes	W2	Concrete	White	None	0	0	Negative
6040	2	B604001-1	1	112B	Space (Kitchen)	Kitchen Counter Area near Hallway	yes	W3	Concrete	White	None	0	0	Negative
6040	2	B604001-1	1	112B	Space (Kitchen)	Kitchen Counter Area near Hallway	yes	Ceiling	Plaster	White	None	0	0	Negative
6040	2	B604001-1	1	112A	Kitchen and Dry Storage Area	Kitchen Dry Storage Room	no	Floor	N/A	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	112A	Kitchen and Dry Storage Area	Kitchen Dry Storage Room	no	Gate	Metal	Grey	None	0	0	Negative
6040	2	B604001-1	1	112A	Kitchen and Dry Storage Area	Kitchen Dry Storage Room	no	W2	Concrete	White	None	0	0	Negative
6040	2	B604001-1	1	112A	Kitchen and Dry Storage Area	Kitchen Dry Storage Room	no	W3	Concrete	White	None	0	0	Negative
6040	2	B604001-1	1	112A	Kitchen and Dry Storage Area	Kitchen Dry Storage Room	no	W4	Concrete	White	None	0	0	Negative
6040	2	B604001-1	1	112A	Kitchen and Dry Storage Area	Kitchen Dry Storage Room	no	Ceiling	Plaster	White	None	0	0	Negative
6040	2	B604001-1	1	113B	Circulation (Hallway)	Kitchen Hallway between Dry Storage and Walk in Refrigerator	no	Floor	N/A	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	113B	Circulation (Hallway)	Kitchen Hallway between Dry Storage and Walk in Refrigerator	no	W1	Concrete	White	None	0	0	Negative
6040	2	B604001-1	1	113B	Circulation (Hallway)	Kitchen Hallway between Dry Storage and Walk in Refrigerator	no	W2	Concrete	White	None	0	0	Negative
6040	2	B604001-1	1	113B	Circulation (Hallway)	Kitchen Hallway between Dry Storage and Walk in Refrigerator	no	W3	Concrete	White	None	0	0	Negative
6040	2	B604001-1	1	113B	Circulation (Hallway)	Kitchen Hallway between Dry Storage and Walk in Refrigerator	no	Door	Metal	Brown	None	0	0	Negative
6040	2	B604001-1	1	113B	Circulation (Hallway)	Kitchen Hallway between Dry Storage and Walk in Refrigerator	yes	Door Case	Metal	Brown	None	0	0	Negative
6040	2	B604001-1	1	113B	Circulation (Hallway)	Kitchen Hallway between Dry Storage and Walk in Refrigerator	no	Ceiling	Plaster	White	None	0	0	Negative
6040	2	B604001-1	1	112D	Kitchen Office	Kitchen Office	no	Floor	N/A	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	112D	Kitchen Office	Kitchen Office	no	Gate	Metal	Grey	None	0	0	Negative
6040	2	B604001-1	1	112D	Kitchen Office	Kitchen Office	no	W2	Concrete	White	None	0	0	Negative
6040	2	B604001-1	1	112D	Kitchen Office	Kitchen Office	no	W3	Concrete	White	None	0	0	Negative
6040	2	B604001-1	1	112D	Kitchen Office	Kitchen Office	no	W4	Concrete	White	None	0	0	Negative
6040	2	B604001-1	1	112D	Kitchen Office	Kitchen Office	no	Ceiling	Plaster	White	None	0	0	Negative
6040	2	B604001-1	1	004A-2	Space (Science Lab Prep)	Lab Prep Room between Classrooms 3 and 4	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	004A-2	Space (Science Lab Prep)	Lab Prep Room between Classrooms 3 and 4	yes	Door Case	Metal	Tan	Friction	6	0	Negative
6040	2	B604001-1	1	004A-2	Space (Science Lab Prep)	Lab Prep Room between Classrooms 3 and 4	yes	W1	Concrete	Yellow	Partially Inaccessible	0	0	Negative
6040	2	B604001-1	1	004A-2	Space (Science Lab Prep)	Lab Prep Room between Classrooms 3 and 4	yes	W2	Concrete	Yellow	Partially Inaccessible	0	0	Negative
6040	2	B604001-1	1	004A-2	Space (Science Lab Prep)	Lab Prep Room between Classrooms 3 and 4	yes	W3	Concrete	Yellow	Partially Inaccessible	0	0	Negative
6040	2	B604001-1	1	004A-2	Space (Science Lab Prep)	Lab Prep Room between Classrooms 3 and 4	yes	W4	Concrete	Yellow	Partially Inaccessible	0	0	Negative

					Dates: 9/12/22 - 10/4/22		Lead-Safe Certification Assessment Report							
					Inspector Name and Certificate Number: Jennifer Drialo-006767/ Steve Merlino- 006800		6040 Walter Biddle Saul HS/Manatawna Farm							
					Inspection Company: Synertech		7100 Henry Avenue, Philadelphia, PA 19128							
ULCS#	E l e m e n t	BldgElmt ID	F l o o r	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/ negative)
6040	2	B604001-1	1	004A-2	Space (Science Lab Prep)	Lab Prep Room between Classrooms 3 and 4	yes	Ceiling	Concrete	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	004B	Storage	Lab Prep Room between Classrooms 3 and 4 Chemical Storage Room	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	004B	Storage	Lab Prep Room between Classrooms 3 and 4 Chemical Storage Room	yes	W1	Concrete	Yellow	None	0	0	Negative
6040	2	B604001-1	1	004B	Storage	Lab Prep Room between Classrooms 3 and 4 Chemical Storage Room	yes	W2	Concrete	Yellow	None	0	0	Negative
6040	2	B604001-1	1	004B	Storage	Lab Prep Room between Classrooms 3 and 4 Chemical Storage Room	yes	W3	Concrete	Yellow	None	0	0	Negative
6040	2	B604001-1	1	004B	Storage	Lab Prep Room between Classrooms 3 and 4 Chemical Storage Room	yes	W4	Concrete	Yellow	None	0	0	Negative
6040	2	B604001-1	1	004B	Storage	Lab Prep Room between Classrooms 3 and 4 Chemical Storage Room	yes	Ceiling	Concrete	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	114B	Restrooms, Staff - Male	Men's Restroom adjacent to Faculty Dining Room	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	114B	Restrooms, Staff - Male	Men's Restroom adjacent to Faculty Dining Room	yes	Door Case	Metal	Tan	Friction	2	0.12	Negative
6040	2	B604001-1	1	114B	Restrooms, Staff - Male	Men's Restroom adjacent to Faculty Dining Room	yes	W1	Concrete	Yellow	None	0	0	Negative
6040	2	B604001-1	1	114B	Restrooms, Staff - Male	Men's Restroom adjacent to Faculty Dining Room	yes	W2	Concrete	Yellow	None	0	0	Negative
6040	2	B604001-1	1	114B	Restrooms, Staff - Male	Men's Restroom adjacent to Faculty Dining Room	yes	W3	Concrete	Yellow	None	0	0	Negative
6040	2	B604001-1	1	114B	Restrooms, Staff - Male	Men's Restroom adjacent to Faculty Dining Room	yes	W4	Concrete	Yellow	None	0	0	Negative
6040	2	B604001-1	1	114B	Restrooms, Staff - Male	Men's Restroom adjacent to Faculty Dining Room	yes	Ceiling	Plaster	White	None	0	0	Negative
6040	2	B604001-1	1	122	Administrative Office	NTA Office	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	122	Administrative Office	NTA Office	yes	Door Case	Metal	Tan	Friction	1	0	Negative
6040	2	B604001-1	1	122	Administrative Office	NTA Office	yes	W1	Concrete	Tan	None	0	0	Negative
6040	2	B604001-1	1	122	Administrative Office	NTA Office	yes	W2	Concrete	Tan	None	0	0	Negative
6040	2	B604001-1	1	122	Administrative Office	NTA Office	yes	W3	Concrete	Tan	None	0	0	Negative
6040	2	B604001-1	1	122	Administrative Office	NTA Office	yes	W4	Concrete	Tan	None	0	0	Negative
6040	2	B604001-1	1	122	Administrative Office	NTA Office	yes	Ceiling	Concrete	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	122B	Storage	NTA Office Closet	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	122B	Storage	NTA Office Closet	yes	Door Case	Metal	Tan	None	0	0	Negative
6040	2	B604001-1	1	122B	Storage	NTA Office Closet	yes	W1	Concrete	Tan	None	0	0	Negative
6040	2	B604001-1	1	122B	Storage	NTA Office Closet	yes	W2	Concrete	Tan	None	0	0	Negative
6040	2	B604001-1	1	122B	Storage	NTA Office Closet	yes	W3	Concrete	Tan	None	0	0	Negative
6040	2	B604001-1	1	122B	Storage	NTA Office Closet	yes	W4	Concrete	Tan	None	0	0	Negative
6040	2	B604001-1	1	122B	Storage	NTA Office Closet	yes	Ceiling	Concrete	N/A	N/A	N/A	N/A	N/A

					Dates: 9/12/22 - 10/4/22		Lead-Safe Certification Assessment Report							
					Inspector Name and Certificate Number: Jennifer Drialo-006767/ Steve Merlino- 006800		6040 Walter Biddle Saul HS/Manatawna Farm							
					Inspection Company: Synertech		7100 Henry Avenue, Philadelphia, PA 19128							
ULCS#	Element	BldgElmt ID	Floor	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
6040	2	B604001-1	1	122A	Restrooms, Staff - Male/Female	NTA Office Restroom	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	122A	Restrooms, Staff - Male/Female	NTA Office Restroom	yes	Door Case	Metal	Tan	None	0	0	Negative
6040	2	B604001-1	1	122A	Restrooms, Staff - Male/Female	NTA Office Restroom	yes	W1	Concrete	Tan	None	0	0	Negative
6040	2	B604001-1	1	122A	Restrooms, Staff - Male/Female	NTA Office Restroom	yes	W2	Concrete	Tan	None	0	0	Negative
6040	2	B604001-1	1	122A	Restrooms, Staff - Male/Female	NTA Office Restroom	yes	W3	Concrete	Tan	None	0	0	Negative
6040	2	B604001-1	1	122A	Restrooms, Staff - Male/Female	NTA Office Restroom	yes	W4	Concrete	Tan	None	0	0	Negative
6040	2	B604001-1	1	122A	Restrooms, Staff - Male/Female	NTA Office Restroom	yes	Ceiling	Plaster	White	None	0	0	Negative
6040	2	B604001-1	1	118B	Administrative Office	Office adjacent to Counselor's Office	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	118B	Administrative Office	Office adjacent to Counselor's Office	yes	Door Case	Metal	Tan	None	0	0	Negative
6040	2	B604001-1	1	118B	Administrative Office	Office adjacent to Counselor's Office	yes	W1	Concrete	Blue	None	0	0	Negative
6040	2	B604001-1	1	118B	Administrative Office	Office adjacent to Counselor's Office	yes	W2	Concrete	Blue	None	0	0	Negative
6040	2	B604001-1	1	118B	Administrative Office	Office adjacent to Counselor's Office	yes	W3	Concrete	Blue	None	0	0	Negative
6040	2	B604001-1	1	118B	Administrative Office	Office adjacent to Counselor's Office	yes	W4	Concrete	Blue	None	0	0	Negative
6040	2	B604001-1	1	118B	Administrative Office	Office adjacent to Counselor's Office	yes	Ceiling	Concrete	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	127	Administrative Office	Roster Office 1A	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	127	Administrative Office	Roster Office 1A	yes	Door Case	Metal	Tan	Friction	6	0.12	Negative
6040	2	B604001-1	1	127	Administrative Office	Roster Office 1A	yes	W1	Concrete	Yellow	Chipping	25	0	Negative
6040	2	B604001-1	1	127	Administrative Office	Roster Office 1A	yes	W2	Concrete	Yellow	None	0	0	Negative
6040	2	B604001-1	1	127	Administrative Office	Roster Office 1A	yes	W3	Concrete	Yellow	None	0	0	Negative
6040	2	B604001-1	1	127	Administrative Office	Roster Office 1A	yes	W4	Concrete	Yellow	None	0	0	Negative
6040	2	B604001-1	1	127	Administrative Office	Roster Office 1A	yes	Ceiling	Concrete	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	126	Administrative Office	School Police Office	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	126	Administrative Office	School Police Office	yes	Door Case	Metal	Tan	Friction	3	0.1	Negative
6040	2	B604001-1	1	126	Administrative Office	School Police Office	yes	W1	Concrete	Yellow	None	0	0	Negative

					Dates: 9/12/22 - 10/4/22		Lead-Safe Certification Assessment Report							
					Inspector Name and Certificate Number: Jennifer Drialo-006767/ Steve Merlino- 006800		6040 Walter Biddle Saul HS/Manatawna Farm							
					Inspection Company: Synertech		7100 Henry Avenue, Philadelphia, PA 19128							
ULCS#	Element	BldgElmt ID	Floor	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
6040	2	B604001-1	1	126	Administrative Office	School Police Office	yes	W2	Concrete	Yellow	None	0	0	Negative
6040	2	B604001-1	1	126	Administrative Office	School Police Office	yes	W3	Concrete	Yellow	None	0	0	Negative
6040	2	B604001-1	1	126	Administrative Office	School Police Office	yes	W4	Concrete	Yellow	None	0	0	Negative
6040	2	B604001-1	1	126	Administrative Office	School Police Office	yes	Ceiling	Concrete	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	121	School Store	School Store (former Locker Room)	yes	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	121	School Store	School Store (former Locker Room)	yes	Door Case	Metal	Tan	Friction	2	0	Negative
6040	2	B604001-1	1	121	School Store	School Store (former Locker Room)	yes	W1	Concrete	Tan	None	0	0	Negative
6040	2	B604001-1	1	121	School Store	School Store (former Locker Room)	yes	W2	Concrete	Tan	None	0	0	Negative
6040	2	B604001-1	1	121	School Store	School Store (former Locker Room)	yes	W3	Concrete	Tan	None	0	0	Negative
6040	2	B604001-1	1	121	School Store	School Store (former Locker Room)	yes	W4	Concrete	Tan	None	0	0	Negative
6040	2	B604001-1	1	121	School Store	School Store (former Locker Room)	yes	Ceiling	Plaster	White	None	0	0	Negative
6040	2	B604001-1	1	121A	Storage	School Store Storage (former Locker Room Restroom)	yes	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	121A	Storage	School Store Storage (former Locker Room Restroom)	yes	Door Case	Metal	Tan	Friction	4	0	Negative
6040	2	B604001-1	1	121A	Storage	School Store Storage (former Locker Room Restroom)	yes	W1	Concrete	Yellow	None	0	0	Negative
6040	2	B604001-1	1	121A	Storage	School Store Storage (former Locker Room Restroom)	yes	W2	Concrete	Yellow	None	0	0	Negative
6040	2	B604001-1	1	121A	Storage	School Store Storage (former Locker Room Restroom)	yes	W3	Concrete	Yellow	None	0	0	Negative
6040	2	B604001-1	1	121A	Storage	School Store Storage (former Locker Room Restroom)	yes	W4	Concrete	Yellow	None	0	0	Negative
6040	2	B604001-1	1	121A	Storage	School Store Storage (former Locker Room Restroom)	yes	Ceiling	Plaster	White	None	0	0	Negative
6040	2	B604001-1	1	44714	Shop, General	Shop 5	yes	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	44714	Shop, General	Shop 5	yes	Door Case	Metal	Tan	Friction	6	0.13	Negative
6040	2	B604001-1	1	44714	Shop, General	Shop 5	yes	W1	Concrete	Tan	Partially Inaccessible	2	0	Negative
6040	2	B604001-1	1	44714	Shop, General	Shop 5	yes	W2	Concrete	Tan	Partially Inaccessible	0	0	Negative
6040	2	B604001-1	1	44714	Shop, General	Shop 5	yes	Rolling Steel Doors	Metal	Brown	Friction	2	0	Negative
6040	2	B604001-1	1	44714	Shop, General	Shop 5	yes	Electric Panel	Metal	Brown	Chipping	1	0	Negative
6040	2	B604001-1	1	44714	Shop, General	Shop 5	yes	Door	Metal	Brown	Friction	2	0	Negative
6040	2	B604001-1	1	44714	Shop, General	Shop 5	yes	Door Case	Metal	Brown	Friction	4	0	Negative
6040	2	B604001-1	1	44714	Shop, General	Shop 5	yes	W3	Concrete	Tan	Partially Inaccessible	2	0	Negative
6040	2	B604001-1	1	44714	Shop, General	Shop 5	yes	W4	Concrete	Tan	Partially Inaccessible	0	0	Negative
6040	2	B604001-1	1	44714	Shop, General	Shop 5	yes	Ceiling	No Access	No Access	No Access	N/A	N/A	N/A
6040	2	B604001-1	1	006C	Senior High	Shop 5 Classroom	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	006C	Senior High	Shop 5 Classroom	yes	W1	Concrete	Tan	Partially Inaccessible	2	0	Negative
6040	2	B604001-1	1	006C	Senior High	Shop 5 Classroom	yes	W2	Concrete	Tan	Partially Inaccessible	1	0	Negative
6040	2	B604001-1	1	006C	Senior High	Shop 5 Classroom	yes	W3	Concrete	Tan	Partially Inaccessible	1	0	Negative
6040	2	B604001-1	1	006C	Senior High	Shop 5 Classroom	yes	W4	Concrete	Red	Partially Inaccessible	0	0	Negative
6040	2	B604001-1	1	006C	Senior High	Shop 5 Classroom	yes	Ceiling	No Access	No Access	No Access	N/A	N/A	N/A

					Dates: 9/12/22 - 10/4/22		Lead-Safe Certification Assessment Report							
					Inspector Name and Certificate Number: Jennifer Drialo-006767/ Steve Merlino- 006800		6040 Walter Biddle Saul HS/Manatawna Farm							
					Inspection Company: Synertech		7100 Henry Avenue, Philadelphia, PA 19128							
ULCS#	Element	BldgElmt ID	Floor	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
6040	2	B604001-1	1	006D	Lockers - Male	Shop 5 Locker Room	yes	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	006D	Lockers - Male	Shop 5 Locker Room	yes	Door Case	Metal	Brown	Friction	10	0	Negative
6040	2	B604001-1	1	006D	Lockers - Male	Shop 5 Locker Room	yes	W1	Concrete	Tan	Chipping	1	0	Negative
6040	2	B604001-1	1	006D	Lockers - Male	Shop 5 Locker Room	yes	Locker	Metal	Green	Friction	5	0	Negative
6040	2	B604001-1	1	006D	Lockers - Male	Shop 5 Locker Room	yes	W2	Concrete	Tan	None	0	0	Negative
6040	2	B604001-1	1	006D	Lockers - Male	Shop 5 Locker Room	yes	W3	Concrete	Tan	None	0	0	Negative
6040	2	B604001-1	1	006D	Lockers - Male	Shop 5 Locker Room	yes	W4	Concrete	Tan	None	0	0	Negative
6040	2	B604001-1	1	006D	Lockers - Male	Shop 5 Locker Room	yes	Ceiling	No Access	No Access	No Access	N/A	N/A	N/A
6040	2	B604001-1	1	006F	Student Restrooms - Male/Female	Shop 5 Locker Room Restroom	yes	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	006F	Student Restrooms - Male/Female	Shop 5 Locker Room Restroom	yes	Stall	Wood	Red	None	0	0	Negative
6040	2	B604001-1	1	006F	Student Restrooms - Male/Female	Shop 5 Locker Room Restroom	yes	W1	Concrete	Tan	None	0	0	Negative
6040	2	B604001-1	1	006F	Student Restrooms - Male/Female	Shop 5 Locker Room Restroom	yes	W2	Concrete	Tan	None	0	0	Negative
6040	2	B604001-1	1	006F	Student Restrooms - Male/Female	Shop 5 Locker Room Restroom	yes	W3	Concrete	Tan	None	0	0	Negative
6040	2	B604001-1	1	006F	Student Restrooms - Male/Female	Shop 5 Locker Room Restroom	yes	W4	Concrete	Tan	None	0	0	Negative
6040	2	B604001-1	1	006F	Student Restrooms - Male/Female	Shop 5 Locker Room Restroom	yes	Ceiling	Concrete	White	None	0	0	Negative
6040	2	B604001-1	1	006E	Showers - Male	Shop 5 Locker Room Shower	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	006E	Showers - Male	Shop 5 Locker Room Shower	yes	W1	N/A	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	006E	Showers - Male	Shop 5 Locker Room Shower	yes	W2	N/A	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	006E	Showers - Male	Shop 5 Locker Room Shower	yes	W3	N/A	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	006E	Showers - Male	Shop 5 Locker Room Shower	yes	W4	N/A	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	006E	Showers - Male	Shop 5 Locker Room Shower	yes	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	006A	Administrative Office	Shop 5 Office	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	006A	Administrative Office	Shop 5 Office	yes	Door Case	Metal	Tan	Friction	0	0.11	Negative
6040	2	B604001-1	1	006A	Administrative Office	Shop 5 Office	yes	W1	Concrete	Tan	None	0	0	Negative
6040	2	B604001-1	1	006A	Administrative Office	Shop 5 Office	yes	Window Case	Metal	Tan	None	0	0	Negative
6040	2	B604001-1	1	006A	Administrative Office	Shop 5 Office	yes	W2	Concrete	Tan	None	0	0	Negative
6040	2	B604001-1	1	006A	Administrative Office	Shop 5 Office	yes	W3	Concrete	Tan	None	0	0	Negative
6040	2	B604001-1	1	006A	Administrative Office	Shop 5 Office	yes	W4	Concrete	Tan	None	0	0	Negative
6040	2	B604001-1	1	006A	Administrative Office	Shop 5 Office	yes	Ceiling	Concrete	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	006H	Storage	Shop 5 Office Closet	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	006H	Storage	Shop 5 Office Closet	yes	Door Case	Metal	Tan	Friction	0	0.11	Negative
6040	2	B604001-1	1	006H	Storage	Shop 5 Office Closet	yes	W1	Concrete	Tan	None	0	0	Negative

					Dates: 9/12/22 - 10/4/22		Lead-Safe Certification Assessment Report							
					Inspector Name and Certificate Number: Jennifer Drialo-006767/ Steve Merlino- 006800		6040 Walter Biddle Saul HS/Manatawna Farm							
					Inspection Company: Synertech		7100 Henry Avenue, Philadelphia, PA 19128							
ULCS#	Element	BldgElmt ID	Floor	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
6040	2	B604001-1	1	006H	Storage	Shop 5 Office Closet	yes	W2	Concrete	Tan	None	0	0	Negative
6040	2	B604001-1	1	006H	Storage	Shop 5 Office Closet	yes	W3	Concrete	Tan	None	0	0	Negative
6040	2	B604001-1	1	006H	Storage	Shop 5 Office Closet	yes	W4	Concrete	Tan	None	0	0	Negative
6040	2	B604001-1	1	006H	Storage	Shop 5 Office Closet	yes	Ceiling	Concrete	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	006G	Restrooms, Staff - Male/Female	Shop 5 Office Restroom	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	006G	Restrooms, Staff - Male/Female	Shop 5 Office Restroom	yes	W1	Concrete	Tan	Flaking	1	0	Negative
6040	2	B604001-1	1	006G	Restrooms, Staff - Male/Female	Shop 5 Office Restroom	yes	W2	Concrete	Tan	Flaking	6	0	Negative
6040	2	B604001-1	1	006G	Restrooms, Staff - Male/Female	Shop 5 Office Restroom	yes	W3	Concrete	Tan	Flaking	6	0	Negative
6040	2	B604001-1	1	006G	Restrooms, Staff - Male/Female	Shop 5 Office Restroom	yes	W4	Concrete	Tan	Flaking	8	0	Negative
6040	2	B604001-1	1	006G	Restrooms, Staff - Male/Female	Shop 5 Office Restroom	yes	Ceiling	Plaster	White	None	0	0	Negative
6040	2	B604001-1	1	006B	Storage, Tool (large)	Shop 5 Stock and Tool Room	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	006B	Storage, Tool (large)	Shop 5 Stock and Tool Room	yes	W1	Concrete	Green	Partially Inaccessible	0	0	Negative
6040	2	B604001-1	1	006B	Storage, Tool (large)	Shop 5 Stock and Tool Room	yes	W2	Concrete	Green	Partially Inaccessible	0	0	Negative
6040	2	B604001-1	1	006B	Storage, Tool (large)	Shop 5 Stock and Tool Room	yes	W3	Concrete	Green	Partially Inaccessible	0	0	Negative
6040	2	B604001-1	1	006B	Storage, Tool (large)	Shop 5 Stock and Tool Room	yes	W4	Concrete	Green	Partially Inaccessible	0	0	Negative
6040	2	B604001-1	1	006B	Storage, Tool (large)	Shop 5 Stock and Tool Room	yes	Ceiling	Concrete	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	119B	Storage	Storage and Mechanical Room 6 adjacent to Stage	no	Floor	N/A	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	119B	Storage	Storage and Mechanical Room 6 adjacent to Stage	no	Door Case	Metal	Tan	Friction	5	0	Negative
6040	2	B604001-1	1	119B	Storage	Storage and Mechanical Room 6 adjacent to Stage	no	W1	Concrete	Tan	None	0	0	Negative
6040	2	B604001-1	1	119B	Storage	Storage and Mechanical Room 6 adjacent to Stage	no	W2	Concrete	Tan	None	0	0	Negative
6040	2	B604001-1	1	119B	Storage	Storage and Mechanical Room 6 adjacent to Stage	no	W3	Concrete	Tan	None	0	0	Negative
6040	2	B604001-1	1	119B	Storage	Storage and Mechanical Room 6 adjacent to Stage	no	W4	Concrete	Tan	None	0	0	Negative
6040	2	B604001-1	1	119B	Storage	Storage and Mechanical Room 6 adjacent to Stage	no	Ceiling	Concrete	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	H113B	Circulation (Hallway)	Vestibule outside Shop 5	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	H113B	Circulation (Hallway)	Vestibule outside Shop 5	yes	Door	Metal	Tan	Friction	2	0	Negative
6040	2	B604001-1	1	H113B	Circulation (Hallway)	Vestibule outside Shop 5	yes	Door Case	Metal	Tan	Friction	6	0	Negative

					Dates: 9/12/22 - 10/4/22		Lead-Safe Certification Assessment Report							
					Inspector Name and Certificate Number: Jennifer Drialo-006767/ Steve Merlino- 006800		6040 Walter Biddle Saul HS/Manatawna Farm							
					Inspection Company: Synertech		7100 Henry Avenue, Philadelphia, PA 19128							
ULCS#	Element	BldgElmt ID	Floor	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
6040	2	B604001-1	1	H113B	Circulation (Hallway)	Vestibule outside Shop 5	yes	W2	Concrete	Tan	None	0	0	Negative
6040	2	B604001-1	1	H113B	Circulation (Hallway)	Vestibule outside Shop 5	yes	Door	Metal	Tan	Friction	2	0	Negative
6040	2	B604001-1	1	H113B	Circulation (Hallway)	Vestibule outside Shop 5	yes	Door Case	Metal	Tan	Friction	10	0	Negative
6040	2	B604001-1	1	H113B	Circulation (Hallway)	Vestibule outside Shop 5	yes	W4	Concrete	Tan	None	0	0	Negative
6040	2	B604001-1	1	H113B	Circulation (Hallway)	Vestibule outside Shop 5	yes	Ceiling	Concrete	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	113A	Space (Kitchen)	Walk in Freezer inside Walk in Refrigerator	no	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	113A	Space (Kitchen)	Walk in Freezer inside Walk in Refrigerator	no	W1	Metal	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	113A	Space (Kitchen)	Walk in Freezer inside Walk in Refrigerator	no	W2	Metal	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	113A	Space (Kitchen)	Walk in Freezer inside Walk in Refrigerator	no	W3	Metal	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	113A	Space (Kitchen)	Walk in Freezer inside Walk in Refrigerator	no	W4	Metal	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	113A	Space (Kitchen)	Walk in Freezer inside Walk in Refrigerator	no	Ceiling	Metal	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	113-2	Space (Kitchen)	Walk-in Refrigerator	no	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	113-2	Space (Kitchen)	Walk-in Refrigerator	no	W1	Metal	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	113-2	Space (Kitchen)	Walk-in Refrigerator	no	W2	Metal	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	113-2	Space (Kitchen)	Walk-in Refrigerator	no	W3	Metal	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	113-2	Space (Kitchen)	Walk-in Refrigerator	no	W4	Metal	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	113-2	Space (Kitchen)	Walk-in Refrigerator	no	Ceiling	Metal	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	114	Restrooms, Staff - Female	Women's Restroom adjacent to Counselor's Office	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
6040	2	B604001-1	1	114	Restrooms, Staff - Female	Women's Restroom adjacent to Counselor's Office	yes	Door Case	Metal	Tan	Friction	1	0.12	Negative
6040	2	B604001-1	1	114	Restrooms, Staff - Female	Women's Restroom adjacent to Counselor's Office	yes	W1	Concrete	Yellow	None	0	0	Negative
6040	2	B604001-1	1	114	Restrooms, Staff - Female	Women's Restroom adjacent to Counselor's Office	yes	W2	Concrete	Yellow	None	0	0	Negative
6040	2	B604001-1	1	114	Restrooms, Staff - Female	Women's Restroom adjacent to Counselor's Office	yes	W3	Concrete	Yellow	None	0	0	Negative
6040	2	B604001-1	1	114	Restrooms, Staff - Female	Women's Restroom adjacent to Counselor's Office	yes	W4	Concrete	Yellow	None	0	0	Negative
6040	2	B604001-1	1	114	Restrooms, Staff - Female	Women's Restroom adjacent to Counselor's Office	yes	Ceiling	Plaster	White	None	0	0	Negative
6040	3	B604001-1	1	H115	Circulation (Hallway)	Hallway outside IMC	yes	Floor	Concrete	Tan	None	0	0	Negative
6040	3	B604001-1	1	H115	Circulation (Hallway)	Hallway outside IMC	yes	W1	Concrete	Tan	Flaking	1	0.26	Negative
6040	3	B604001-1	1	H115	Circulation (Hallway)	Hallway outside IMC	yes	Column	Metal	Tan	Flaking	2	0.12	Negative
6040	3	B604001-1	1	H115	Circulation (Hallway)	Hallway outside IMC	yes	W2	Brick	Tan	Flaking	1	0	Negative
6040	3	B604001-1	1	H115	Circulation (Hallway)	Hallway outside IMC	yes	Unit-Ventilator	Metal	Brown	Friction	1	0	Negative
6040	3	B604001-1	1	H115	Circulation (Hallway)	Hallway outside IMC	yes	W3	Concrete	Tan	Flaking	5	0.2	Negative

					Dates: 9/12/22 - 10/4/22		Lead-Safe Certification Assessment Report							
					Inspector Name and Certificate Number: Jennifer Drialo-006767/ Steve Merlino- 006800		6040 Walter Biddle Saul HS/Manatawna Farm							
					Inspection Company: Synertech		7100 Henry Avenue, Philadelphia, PA 19128							
ULCS#	Element	BldgElmt ID	Floor	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
6040	3	B604001-1	1	H115	Circulation (Hallway)	Hallway outside IMC	yes	Wall Heater	Metal	Tan	None	0	0	Negative
6040	3	B604001-1	1	H115	Circulation (Hallway)	Hallway outside IMC	yes	Conduit	Metal	Yellow	None	0	0.12	Negative
6040	3	B604001-1	1	H115	Circulation (Hallway)	Hallway outside IMC	yes	Pipe	Metal	Yellow	None	0	0.19	Negative
6040	3	B604001-1	1	H115	Circulation (Hallway)	Hallway outside IMC	yes	Billboard	Wood	Tan	None	0	0	Negative
6040	3	B604001-1	1	H115	Circulation (Hallway)	Hallway outside IMC	yes	W4	Concrete	Tan	None	0	0.23	Negative
6040	3	B604001-1	1	H115	Circulation (Hallway)	Hallway outside IMC	yes	Unit-Ventilator	Metal	Brown	None	0	0	Negative
6040	3	B604001-1	1	H115	Circulation (Hallway)	Hallway outside IMC	yes	Ceiling	Concrete	White	None	0	0	Negative
6040	3	B604001-1	1	H115	Circulation (Hallway)	Hallway outside IMC	yes	Beam	Metal	Tan	Flaking	3	0	Negative
6040	3	B604001-1	1	100-3	IMC (Library)	IMC	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
6040	3	B604001-1	1	100-3	IMC (Library)	IMC	yes	W1	Concrete	Tan	Partially Inaccessible	0	0.26	Negative
6040	3	B604001-1	1	100-3	IMC (Library)	IMC	yes	W2	Concrete	Tan	Partially Inaccessible	0	0.2	Negative
6040	3	B604001-1	1	100-3	IMC (Library)	IMC	yes	W3	Concrete	Tan	Partially Inaccessible	0	0.28	Negative
6040	3	B604001-1	1	100-3	IMC (Library)	IMC	yes	Pipe	Metal	Yellow	Chipping	1	0.16	Negative
6040	3	B604001-1	1	100-3	IMC (Library)	IMC	yes	Wall Heater	Metal	Yellow	None	0	0.15	Negative
6040	3	B604001-1	1	100-3	IMC (Library)	IMC	yes	Door Case	Metal	Brown	Friction	4	0	Negative
6040	3	B604001-1	1	100-3	IMC (Library)	IMC	yes	Door	Metal	Brown	None	0	0	Negative
6040	3	B604001-1	1	100-3	IMC (Library)	IMC	yes	Push Bar	Metal	Grey	None	0	0	Negative
6040	3	B604001-1	1	100-3	IMC (Library)	IMC	yes	W4	Concrete	Tan	Partially Inaccessible	0	0.23	Negative
6040	3	B604001-1	1	100-3	IMC (Library)	IMC	yes	Pipe	Metal	Yellow	None	0	0.23	Negative
6040	3	B604001-1	1	100-3	IMC (Library)	IMC	yes	Conduit	Metal	Yellow	None	0	0.29	Negative
6040	3	B604001-1	1	100-3	IMC (Library)	IMC	yes	Electric Panel	Metal	Grey	None	0	0.24	Negative
6040	3	B604001-1	1	100-3	IMC (Library)	IMC	yes	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
6040	4	B604001-1	1	1	Animal Shelter	Cow Stalls	Yes	Floor	Concrete	N/A	None	N/A	N/A	N/A
6040	4	B604001-1	1	1	Animal Shelter	Cow Stalls	Yes	W1	Brick	Green	None	0	0.1	Negative
6040	4	B604001-1	1	1	Animal Shelter	Cow Stalls	Yes	W2	Brick	Green	None	0	0.1	Negative
6040	4	B604001-1	1	1	Animal Shelter	Cow Stalls	Yes	W3	Brick	Green	None	0	0.4	Negative
6040	4	B604001-1	1	1	Animal Shelter	Cow Stalls	Yes	W4	Brick	Green	None	0	0.1	Negative
6040	4	B604001-1	1	1	Animal Shelter	Cow Stalls	Yes	Ceiling	Concrete	White	Flaking	20	0.1	Negative
6040	4	B604001-1	1	44624	Storage	Feed Storage	Yes	Floor	Concrete	Green	Flaking	20	0.1	Negative
6040	4	B604001-1	1	44624	Storage	Feed Storage	Yes	W1	Brick	Green	Flaking	10	0	Negative
6040	4	B604001-1	1	44624	Storage	Feed Storage	Yes	W2	Brick	Green	Flaking	10	0	Negative
6040	4	B604001-1	1	44624	Storage	Feed Storage	Yes	W3	Brick	Green	None	0	0	Negative
6040	4	B604001-1	1	44624	Storage	Feed Storage	Yes	W4	Brick	Green	None	0	0.1	Negative
6040	4	B604001-1	1	44624	Storage	Feed Storage	Yes	Ceiling	Concrete	White	None	0	0	Negative
6040	4	B604001-1	1	5	Student Restrooms - Male (4-12)	Former Boy's Restroom	Yes	Floor	Concrete	Grey	None	0	0.1	Negative
6040	4	B604001-1	1	5	Student Restrooms - Male (4-12)	Former Boy's Restroom	Yes	W1	Brick	Grey	None	0	0.1	Negative

					Dates: 9/12/22 - 10/4/22		Lead-Safe Certification Assessment Report							
					Inspector Name and Certificate Number: Jennifer Drialo-006767/ Steve Merlino- 006800		6040 Walter Biddle Saul HS/Manatawna Farm							
					Inspection Company: Synertech		7100 Henry Avenue, Philadelphia, PA 19128							
ULCS#	Element	BldgElmt ID	Floor	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
6040	4	B604001-1	1	5	Student Restrooms - Male (4-12)	Former Boy's Restroom	Yes	W2	Brick	Grey	None	0	0	Negative
6040	4	B604001-1	1	5	Student Restrooms - Male (4-12)	Former Boy's Restroom	Yes	W3	Brick	Grey	None	0	0.2	Negative
6040	4	B604001-1	1	5	Student Restrooms - Male (4-12)	Former Boy's Restroom	Yes	W4	Brick	White	None	0	0.1	Negative
6040	4	B604001-1	1	5	Student Restrooms - Male (4-12)	Former Boy's Restroom	Yes	Ceiling	Concrete	Grey	None	0	0	Negative
6040	4	B604001-1	1	44655	Student Restrooms - Female (4-12)	Girl's Restroom	Yes	Floor	Concrete	Grey	None	0	0	Negative
6040	4	B604001-1	1	44655	Student Restrooms - Female (4-12)	Girl's Restroom	Yes	W1	Brick	Green	None	0	0.1	Negative
6040	4	B604001-1	1	44655	Student Restrooms - Female (4-12)	Girl's Restroom	Yes	W2	Brick	Green	None	0	0.2	Negative
6040	4	B604001-1	1	44655	Student Restrooms - Female (4-12)	Girl's Restroom	Yes	W3	Brick	Green	None	0	0.1	Negative
6040	4	B604001-1	1	44655	Student Restrooms - Female (4-12)	Girl's Restroom	Yes	W4	Brick	Green	None	0	0.1	Negative
6040	4	B604001-1	1	44655	Student Restrooms - Female (4-12)	Girl's Restroom	Yes	Ceiling	Concrete	Green	None	0	0.1	Negative
6040	4	B604001-1	1	8	Circulation (Hallway)	Hallway outside Pump Room	Yes	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
6040	4	B604001-1	1	8	Circulation (Hallway)	Hallway outside Pump Room	Yes	W1	Brick	Green	None	0	0.1	Negative
6040	4	B604001-1	1	8	Circulation (Hallway)	Hallway outside Pump Room	Yes	W2	Brick	Green	None	0	0.1	Negative
6040	4	B604001-1	1	8	Circulation (Hallway)	Hallway outside Pump Room	Yes	W3	Brick	Green	None	0	0.1	Negative
6040	4	B604001-1	1	8	Circulation (Hallway)	Hallway outside Pump Room	Yes	W4	N/A	N/A	N/A	N/A	N/A	N/A
6040	4	B604001-1	1	8	Circulation (Hallway)	Hallway outside Pump Room	Yes	Ceiling	Concrete	N/A	N/A	N/A	N/A	N/A
6040	4	B604001-1	1	7	Pipe Chase	Hallway outside Pump Room Pipe Chase	Yes	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
6040	4	B604001-1	1	7	Pipe Chase	Hallway outside Pump Room Pipe Chase	Yes	W1	Brick	N/A	N/A	N/A	N/A	N/A
6040	4	B604001-1	1	7	Pipe Chase	Hallway outside Pump Room Pipe Chase	Yes	W2	Brick	N/A	N/A	N/A	N/A	N/A
6040	4	B604001-1	1	7	Pipe Chase	Hallway outside Pump Room Pipe Chase	Yes	W3	Brick	N/A	N/A	N/A	N/A	N/A
6040	4	B604001-1	1	7	Pipe Chase	Hallway outside Pump Room Pipe Chase	Yes	W4	Brick	N/A	N/A	N/A	N/A	N/A
6040	4	B604001-1	1	7	Pipe Chase	Hallway outside Pump Room Pipe Chase	Yes	Ceiling	Concrete	N/A	N/A	N/A	N/A	N/A

					Dates: 9/12/22 - 10/4/22		Lead-Safe Certification Assessment Report							
					Inspector Name and Certificate Number: Jennifer Drialo-006767/ Steve Merlino- 006800		6040 Walter Biddle Saul HS/Manatawna Farm							
					Inspection Company: Synertech		7100 Henry Avenue, Philadelphia, PA 19128							
ULCS#	Element	BldgElmt ID	Floor	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
6040	4	B604001-1	1	44716	Space (Tech/Vo tech)	Milking Room	Yes	Floor	Concrete	Green	None	0	0.1	Negative
6040	4	B604001-1	1	44716	Space (Tech/Vo tech)	Milking Room	Yes	W1	Brick	White	None	0	0.1	Negative
6040	4	B604001-1	1	44716	Space (Tech/Vo tech)	Milking Room	Yes	W2	Brick	White	None	0	0.2	Negative
6040	4	B604001-1	1	44716	Space (Tech/Vo tech)	Milking Room	Yes	W3	Brick	White	None	0	0.1	Negative
6040	4	B604001-1	1	44716	Space (Tech/Vo tech)	Milking Room	Yes	W4	Brick	White	None	0	0.1	Negative
6040	4	B604001-1	1	44716	Space (Tech/Vo tech)	Milking Room	Yes	Ceiling	Concrete	N/A	N/A	N/A	N/A	N/A
6040	4	B604001-1	1	2	Mechanical Room	Pump Room	No	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
6040	4	B604001-1	1	2	Mechanical Room	Pump Room	No	W1	Brick	Green	Cracking	20	0	Negative
6040	4	B604001-1	1	2	Mechanical Room	Pump Room	No	W2	Brick	Green	Cracking	20	0	Negative
6040	4	B604001-1	1	2	Mechanical Room	Pump Room	No	W3	Brick	Green	Cracking	20	0	Negative
6040	4	B604001-1	1	2	Mechanical Room	Pump Room	No	W4	Brick	Green	Cracking	20	0	Negative
6040	4	B604001-1	1	2	Mechanical Room	Pump Room	No	Ceiling	Concrete	Green	None	0	0	Negative
6040	5	B604001-1	1	NP20A	Pipe Chase	1st Floor Boy's Restroom Pipe Chase	no	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
6040	5	B604001-1	1	NP20A	Pipe Chase	1st Floor Boy's Restroom Pipe Chase	no	W1	Concrete	N/A	N/A	N/A	N/A	N/A
6040	5	B604001-1	1	NP20A	Pipe Chase	1st Floor Boy's Restroom Pipe Chase	no	W2	Concrete	N/A	N/A	N/A	N/A	N/A
6040	5	B604001-1	1	NP20A	Pipe Chase	1st Floor Boy's Restroom Pipe Chase	no	W3	Concrete	N/A	N/A	N/A	N/A	N/A
6040	5	B604001-1	1	NP20A	Pipe Chase	1st Floor Boy's Restroom Pipe Chase	no	W4	Concrete	N/A	N/A	N/A	N/A	N/A
6040	5	B604001-1	1	NP20A	Pipe Chase	1st Floor Boy's Restroom Pipe Chase	no	Ceiling	Concrete	N/A	N/A	N/A	N/A	N/A
6040	5	B604001-1	1	NP18	Pipe Chase	1st Floor Men's Restroom Pipe Chase	no	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
6040	5	B604001-1	1	NP18	Pipe Chase	1st Floor Men's Restroom Pipe Chase	no	W1	Concrete	N/A	N/A	N/A	N/A	N/A
6040	5	B604001-1	1	NP18	Pipe Chase	1st Floor Men's Restroom Pipe Chase	no	W2	Concrete	N/A	N/A	N/A	N/A	N/A
6040	5	B604001-1	1	NP18	Pipe Chase	1st Floor Men's Restroom Pipe Chase	no	W3	Concrete	N/A	N/A	N/A	N/A	N/A
6040	5	B604001-1	1	NP18	Pipe Chase	1st Floor Men's Restroom Pipe Chase	no	W4	Concrete	N/A	N/A	N/A	N/A	N/A
6040	5	B604001-1	1	NP18	Pipe Chase	1st Floor Men's Restroom Pipe Chase	no	Ceiling	Concrete	N/A	N/A	N/A	N/A	N/A
6040	5	B604001-1	1	A21	Vo-Tech Classroom for Related Instruction	Classroom 21A	yes	Floor	Concrete	N/A	N/A	N/A	N/A	N/A

					Dates: 9/12/22 - 10/4/22		Lead-Safe Certification Assessment Report							
					Inspector Name and Certificate Number: Jennifer Drialo-006767/ Steve Merlino- 006800		6040 Walter Biddle Saul HS/Manatawna Farm							
					Inspection Company: Synertech		7100 Henry Avenue, Philadelphia, PA 19128							
ULCS#	Element	BldgElmt ID	Floor	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
6040	5	B604001-1	1	A21	Vo-Tech Classroom for Related Instruction	Classroom 21A	yes	Door Case	Metal	Blue	None	0	0	Negative
6040	5	B604001-1	1	A21	Vo-Tech Classroom for Related Instruction	Classroom 21A	yes	W1	Concrete	Tan	None	0	0	Negative
6040	5	B604001-1	1	A21	Vo-Tech Classroom for Related Instruction	Classroom 21A	yes	W2	Concrete	Tan	None	0	0	Negative
6040	5	B604001-1	1	A21	Vo-Tech Classroom for Related Instruction	Classroom 21A	yes	W3	Concrete	Tan	None	0	0	Negative
6040	5	B604001-1	1	A21	Vo-Tech Classroom for Related Instruction	Classroom 21A	yes	W4	Concrete	Tan	None	0	0	Negative
6040	5	B604001-1	1	A21	Vo-Tech Classroom for Related Instruction	Classroom 21A	yes	Ceiling	Metal	N/A	N/A	N/A	N/A	N/A
6040	5	B604001-1	1	101-5	Space (Tech/Vo tech)	Classroom 21A Market	yes	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
6040	5	B604001-1	1	101-5	Space (Tech/Vo tech)	Classroom 21A Market	yes	Door	Metal	Brown	None	0	0	Negative
6040	5	B604001-1	1	101-5	Space (Tech/Vo tech)	Classroom 21A Market	yes	Door Case	Metal	Orange	None	0	0.1	Negative
6040	5	B604001-1	1	101-5	Space (Tech/Vo tech)	Classroom 21A Market	yes	W1	Concrete	Orange	None	0	0	Negative
6040	5	B604001-1	1	101-5	Space (Tech/Vo tech)	Classroom 21A Market	yes	W2	Concrete	Orange	None	0	0	Negative
6040	5	B604001-1	1	101-5	Space (Tech/Vo tech)	Classroom 21A Market	yes	W3	Concrete	Orange	None	0	0	Negative
6040	5	B604001-1	1	101-5	Space (Tech/Vo tech)	Classroom 21A Market	yes	W4	Concrete	Orange	None	0	0	Negative
6040	5	B604001-1	1	101-5	Space (Tech/Vo tech)	Classroom 21A Market	yes	Ceiling	Concrete	N/A	N/A	N/A	N/A	N/A
6040	5	B604001-1	1	101B-5	Storage	Classroom 21A Market Closest furthest from Greenhouses	no	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
6040	5	B604001-1	1	101B-5	Storage	Classroom 21A Market Closest furthest from Greenhouses	yes	Door Case	Metal	Blue	None	0	0	Negative
6040	5	B604001-1	1	101B-5	Storage	Classroom 21A Market Closest furthest from Greenhouses	no	W1	Concrete	Tan	None	0	0	Negative
6040	5	B604001-1	1	101B-5	Storage	Classroom 21A Market Closest furthest from Greenhouses	no	W2	Concrete	Tan	None	0	0	Negative
6040	5	B604001-1	1	101B-5	Storage	Classroom 21A Market Closest furthest from Greenhouses	no	W3	Concrete	Tan	None	0	0	Negative
6040	5	B604001-1	1	101B-5	Storage	Classroom 21A Market Closest furthest from Greenhouses	no	W4	Concrete	Tan	None	0	0	Negative
6040	5	B604001-1	1	101B-5	Storage	Classroom 21A Market Closest furthest from Greenhouses	no	Ceiling	Metal	N/A	N/A	N/A	N/A	N/A
6040	5	B604001-1	1	101A-5	Storage	Classroom 21A Market Closet closest to Greenhouses	no	Floor	Concrete	N/A	N/A	N/A	N/A	N/A

						Dates: 9/12/22 - 10/4/22	Lead-Safe Certification Assessment Report							
						Inspector Name and Certificate Number: Jennifer Drialo-006767/ Steve Merlino- 006800	6040 Walter Biddle Saul HS/Manatawna Farm							
						Inspection Company: Synertech	7100 Henry Avenue, Philadelphia, PA 19128							
ULCS#	Element	BldgElmt ID	Floor	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
6040	5	B604001-1	1	101A-5	Storage	Classroom 21A Market Closet closest to Greenhouses	yes	Door Case	Metal	Blue	None	0	0	Negative
6040	5	B604001-1	1	101A-5	Storage	Classroom 21A Market Closet closest to Greenhouses	no	W1	Concrete	Tan	None	0	0	Negative
6040	5	B604001-1	1	101A-5	Storage	Classroom 21A Market Closet closest to Greenhouses	no	W2	Concrete	Tan	None	0	0	Negative
6040	5	B604001-1	1	101A-5	Storage	Classroom 21A Market Closet closest to Greenhouses	no	W3	Concrete	Tan	None	0	0	Negative
6040	5	B604001-1	1	101A-5	Storage	Classroom 21A Market Closet closest to Greenhouses	no	W4	Concrete	Tan	None	0	0	Negative
6040	5	B604001-1	1	101A-5	Storage	Classroom 21A Market Closet closest to Greenhouses	no	Ceiling	Concrete	N/A	N/A	N/A	N/A	N/A
6040	5	B604001-1	1	A21A	Storage	Classroom 21A Storage Room	yes	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
6040	5	B604001-1	1	A21A	Storage	Classroom 21A Storage Room	yes	Door Case	Metal	Blue	None	0	0	Negative
6040	5	B604001-1	1	A21A	Storage	Classroom 21A Storage Room	yes	W1	Concrete	Tan	None	0	0	Negative
6040	5	B604001-1	1	A21A	Storage	Classroom 21A Storage Room	yes	W2	Concrete	Tan	None	0	0	Negative
6040	5	B604001-1	1	A21A	Storage	Classroom 21A Storage Room	yes	W3	Concrete	Tan	None	0	0	Negative
6040	5	B604001-1	1	A21A	Storage	Classroom 21A Storage Room	yes	W4	Concrete	Tan	None	0	0	Negative
6040	5	B604001-1	1	A21A	Storage	Classroom 21A Storage Room	yes	Ceiling	Metal	N/A	N/A	N/A	N/A	N/A
6040	5	B604001-1	1	A22	Senior High	Classroom 22A	yes	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
6040	5	B604001-1	1	A22	Senior High	Classroom 22A	yes	Door Case	Metal	Blue	None	0	0	Negative
6040	5	B604001-1	1	A22	Senior High	Classroom 22A	yes	W1	Concrete	Yellow	None	0	0	Negative
6040	5	B604001-1	1	A22	Senior High	Classroom 22A	yes	W2	Concrete	Yellow	None	0	0	Negative
6040	5	B604001-1	1	A22	Senior High	Classroom 22A	yes	W3	Concrete	Yellow	None	0	0	Negative
6040	5	B604001-1	1	A22	Senior High	Classroom 22A	yes	Pipe	Metal	Yellow	None	0	0	Negative
6040	5	B604001-1	1	A22	Senior High	Classroom 22A	yes	W4	Concrete	Yellow	None	0	0	Negative
6040	5	B604001-1	1	A22	Senior High	Classroom 22A	yes	Ceiling	Metal	N/A	N/A	N/A	N/A	N/A
6040	5	B604001-1	1	A23	Senior High	Classroom 23A	yes	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
6040	5	B604001-1	1	A23	Senior High	Classroom 23A	yes	Door Case	Metal	Blue	None	0	0	Negative
6040	5	B604001-1	1	A23	Senior High	Classroom 23A	yes	W1	Concrete	Blue	None	0	0	Negative
6040	5	B604001-1	1	A23	Senior High	Classroom 23A	yes	W2	Concrete	Blue	None	0	0	Negative
6040	5	B604001-1	1	A23	Senior High	Classroom 23A	yes	W3	Concrete	Blue	None	0	0	Negative
6040	5	B604001-1	1	A23	Senior High	Classroom 23A	yes	W4	Concrete	Blue	None	0	0	Negative
6040	5	B604001-1	1	A23	Senior High	Classroom 23A	yes	Ceiling	Metal	N/A	N/A	N/A	N/A	N/A
6040	5	B604001-1	1	A24	Senior High	Classroom 24A	yes	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
6040	5	B604001-1	1	A24	Senior High	Classroom 24A	yes	Door Case	Metal	Blue	None	0	0	Negative
6040	5	B604001-1	1	A24	Senior High	Classroom 24A	yes	W1	Concrete	Tan	None	0	0	Negative
6040	5	B604001-1	1	A24	Senior High	Classroom 24A	yes	W2	Concrete	Tan	None	0	0	Negative
6040	5	B604001-1	1	A24	Senior High	Classroom 24A	yes	W3	Concrete	Tan	None	0	0	Negative
6040	5	B604001-1	1	A24	Senior High	Classroom 24A	yes	W4	Concrete	Tan	None	0	0	Negative
6040	5	B604001-1	1	A24	Senior High	Classroom 24A	yes	Ceiling	Metal	N/A	N/A	N/A	N/A	N/A
6040	5	B604001-1	1	A25	Computer - Senior High	Classroom 25A	yes	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
6040	5	B604001-1	1	A25	Computer - Senior High	Classroom 25A	yes	Door Case	Metal	Blue	None	0	0	Negative
6040	5	B604001-1	1	A25	Computer - Senior High	Classroom 25A	yes	W1	Concrete	Tan	None	0	0	Negative
6040	5	B604001-1	1	A25	Computer - Senior High	Classroom 25A	yes	W2	Concrete	Tan	None	0	0	Negative
6040	5	B604001-1	1	A25	Computer - Senior High	Classroom 25A	yes	W3	Concrete	Tan	None	0	0	Negative

					Dates: 9/12/22 - 10/4/22		Lead-Safe Certification Assessment Report							
					Inspector Name and Certificate Number: Jennifer Drialo-006767/ Steve Merlino- 006800		6040 Walter Biddle Saul HS/Manatawna Farm							
					Inspection Company: Synertech		7100 Henry Avenue, Philadelphia, PA 19128							
ULCS#	Element	BldgElmt ID	Floor	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
6040	5	B604001-1	1	A25	Computer - Senior High	Classroom 25A	yes	W4	Concrete	Tan	None	0	0	Negative
6040	5	B604001-1	1	A25	Computer - Senior High	Classroom 25A	yes	Pipe	Metal	White	None	0	0.12	Negative
6040	5	B604001-1	1	A25	Computer - Senior High	Classroom 25A	yes	Ceiling	Metal	N/A	N/A	N/A	N/A	N/A
6040	5	B604001-1	1	A26	Senior High	Classroom 26A	yes	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
6040	5	B604001-1	1	A26	Senior High	Classroom 26A	yes	Door Case	Metal	Blue	None	0	0	Negative
6040	5	B604001-1	1	A26	Senior High	Classroom 26A	yes	W1	Concrete	Tan	None	0	0	Negative
6040	5	B604001-1	1	A26	Senior High	Classroom 26A	yes	W2	Concrete	Tan	None	0	0	Negative
6040	5	B604001-1	1	A26	Senior High	Classroom 26A	yes	W3	Concrete	Tan	None	0	0	Negative
6040	5	B604001-1	1	A26	Senior High	Classroom 26A	yes	W4	Concrete	Tan	None	0	0	Negative
6040	5	B604001-1	1	A26	Senior High	Classroom 26A	yes	Ceiling	Metal	N/A	N/A	N/A	N/A	N/A
6040	5	B604001-1	1	A27	Vo-Tech Classroom for Related Instruction	Classroom 27A	yes	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
6040	5	B604001-1	1	A27	Vo-Tech Classroom for Related Instruction	Classroom 27A	yes	Door Case	Metal	Blue	None	0	0	Negative
6040	5	B604001-1	1	A27	Vo-Tech Classroom for Related Instruction	Classroom 27A	yes	W1	Concrete	Tan	None	0	0	Negative
6040	5	B604001-1	1	A27	Vo-Tech Classroom for Related Instruction	Classroom 27A	yes	W2	Concrete	Tan	None	0	0	Negative
6040	5	B604001-1	1	A27	Vo-Tech Classroom for Related Instruction	Classroom 27A	yes	W3	Concrete	Tan	None	0	0	Negative
6040	5	B604001-1	1	A27	Vo-Tech Classroom for Related Instruction	Classroom 27A	yes	Door	Metal	Brown	Friction	10	0	Negative
6040	5	B604001-1	1	A27	Vo-Tech Classroom for Related Instruction	Classroom 27A	yes	Door Case	Metal	Brown	Friction	5	0.13	Negative
6040	5	B604001-1	1	A27	Vo-Tech Classroom for Related Instruction	Classroom 27A	yes	W4	Concrete	Tan	None	0	0	Negative
6040	5	B604001-1	1	A27	Vo-Tech Classroom for Related Instruction	Classroom 27A	yes	Ceiling	Metal	N/A	N/A	N/A	N/A	N/A
6040	5	B604001-1	1	A27A	Storage	Classroom 27A Storage Room	yes	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
6040	5	B604001-1	1	A27A	Storage	Classroom 27A Storage Room	yes	Door Case	Metal	Brown	Friction	2	0.1	Negative
6040	5	B604001-1	1	A27A	Storage	Classroom 27A Storage Room	yes	W1	Concrete	Tan	Partially Inaccessible	0	0	Negative
6040	5	B604001-1	1	A27A	Storage	Classroom 27A Storage Room	yes	W2	Concrete	Tan	Partially Inaccessible	0	0	Negative

					Dates: 9/12/22 - 10/4/22		Lead-Safe Certification Assessment Report							
					Inspector Name and Certificate Number: Jennifer Drialo-006767/ Steve Merlino- 006800		6040 Walter Biddle Saul HS/Manatawna Farm							
					Inspection Company: Synertech		7100 Henry Avenue, Philadelphia, PA 19128							
ULCS#	Element	BldgElmt ID	Floor	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
6040	5	B604001-1	1	A27A	Storage	Classroom 27A Storage Room	yes	W3	Concrete	Tan	Partially Inaccessible	0	0	Negative
6040	5	B604001-1	1	A27A	Storage	Classroom 27A Storage Room	yes	W4	Concrete	Tan	Partially Inaccessible	0	0	Negative
6040	5	B604001-1	1	A27A	Storage	Classroom 27A Storage Room	yes	Ceiling	Metal	N/A	Partially Inaccessible	N/A	N/A	N/A
6040	5	B604001-1	1	A28	Vo-Tech Classroom for Related Instruction	Classroom 28A	yes	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
6040	5	B604001-1	1	A28	Vo-Tech Classroom for Related Instruction	Classroom 28A	yes	Door Case	Metal	Blue	None	0	0	Negative
6040	5	B604001-1	1	A28	Vo-Tech Classroom for Related Instruction	Classroom 28A	yes	W1	Concrete	Tan	None	0	0	Negative
6040	5	B604001-1	1	A28	Vo-Tech Classroom for Related Instruction	Classroom 28A	yes	W2	Concrete	Tan	None	0	0	Negative
6040	5	B604001-1	1	A28	Vo-Tech Classroom for Related Instruction	Classroom 28A	yes	W3	Concrete	Tan	None	0	0	Negative
6040	5	B604001-1	1	A28	Vo-Tech Classroom for Related Instruction	Classroom 28A	yes	Rolling Steel Doors	Metal	Brown	Friction	2	0	Negative
6040	5	B604001-1	1	A28	Vo-Tech Classroom for Related Instruction	Classroom 28A	yes	W4	Concrete	Tan	None	0	0	Negative
6040	5	B604001-1	1	A28	Vo-Tech Classroom for Related Instruction	Classroom 28A	yes	Ceiling	Metal	N/A	N/A	N/A	N/A	N/A
6040	5	B604001-1	1	A28B	Pipe Chase	Classroom 28A Pipe Chase	no	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
6040	5	B604001-1	1	A28B	Pipe Chase	Classroom 28A Pipe Chase	no	W1	Concrete	N/A	N/A	N/A	N/A	N/A
6040	5	B604001-1	1	A28B	Pipe Chase	Classroom 28A Pipe Chase	no	W2	Concrete	N/A	N/A	N/A	N/A	N/A
6040	5	B604001-1	1	A28B	Pipe Chase	Classroom 28A Pipe Chase	no	W3	Concrete	N/A	N/A	N/A	N/A	N/A
6040	5	B604001-1	1	A28B	Pipe Chase	Classroom 28A Pipe Chase	no	W4	Concrete	N/A	N/A	N/A	N/A	N/A
6040	5	B604001-1	1	A28B	Pipe Chase	Classroom 28A Pipe Chase	no	Ceiling	Concrete	N/A	N/A	N/A	N/A	N/A
6040	5	B604001-1	1	A28A	Storage	Classroom 28A Storage Room	yes	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
6040	5	B604001-1	1	A28A	Storage	Classroom 28A Storage Room	yes	Door Case	Metal	Blue	None	0	0	Negative
6040	5	B604001-1	1	A28A	Storage	Classroom 28A Storage Room	yes	W1	Concrete	N/A	Partially Inaccessible	N/A	N/A	N/A
6040	5	B604001-1	1	A28A	Storage	Classroom 28A Storage Room	yes	W2	Concrete	N/A	Partially Inaccessible	N/A	N/A	N/A
6040	5	B604001-1	1	A28A	Storage	Classroom 28A Storage Room	yes	W3	Concrete	N/A	Partially Inaccessible	N/A	N/A	N/A
6040	5	B604001-1	1	A28A	Storage	Classroom 28A Storage Room	yes	W4	Concrete	N/A	Partially Inaccessible	N/A	N/A	N/A

						Dates: 9/12/22 - 10/4/22		Lead-Safe Certification Assessment Report						
						Inspector Name and Certificate Number: Jennifer Drialo-006767/ Steve Merlino- 006800		6040 Walter Biddle Saul HS/Manatawna Farm						
						Inspection Company: Synertech		7100 Henry Avenue, Philadelphia, PA 19128						
ULCS#	Element	BldgElmt ID	Floor	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
6040	5	B604001-1	1	A28A	Storage	Classroom 28A Storage Room	yes	Ceiling	Metal	N/A	Partially Inaccessible	N/A	N/A	N/A
6040	5	B604001-1	1	A29	Computer - Senior High	Classroom 29A	yes	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
6040	5	B604001-1	1	A29	Computer - Senior High	Classroom 29A	yes	Door Case	Metal	Blue	None	0	0	Negative
6040	5	B604001-1	1	A29	Computer - Senior High	Classroom 29A	yes	W1	Concrete	Tan	None	0	0	Negative
6040	5	B604001-1	1	A29	Computer - Senior High	Classroom 29A	yes	W2	Concrete	Tan	None	0	0	Negative
6040	5	B604001-1	1	A29	Computer - Senior High	Classroom 29A	yes	W3	Concrete	Tan	None	0	0	Negative
6040	5	B604001-1	1	A29	Computer - Senior High	Classroom 29A	yes	W4	Concrete	Tan	None	0	0	Negative
6040	5	B604001-1	1	A29	Computer - Senior High	Classroom 29A	yes	Ceiling	Metal	N/A	N/A	N/A	N/A	N/A
6040	5	B604001-1	1	30A	Senior High	Classroom 30A	yes	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
6040	5	B604001-1	1	30A	Senior High	Classroom 30A	yes	Door Case	Metal	Blue	None	0	0	Negative
6040	5	B604001-1	1	30A	Senior High	Classroom 30A	yes	W1	Concrete	Tan	None	0	0	Negative
6040	5	B604001-1	1	30A	Senior High	Classroom 30A	yes	W2	Concrete	Tan	None	0	0	Negative
6040	5	B604001-1	1	30A	Senior High	Classroom 30A	yes	W3	Concrete	Tan	None	0	0	Negative
6040	5	B604001-1	1	30A	Senior High	Classroom 30A	yes	W4	Concrete	Tan	None	0	0	Negative
6040	5	B604001-1	1	30A	Senior High	Classroom 30A	yes	Ceiling	Metal	N/A	N/A	N/A	N/A	N/A
6040	5	B604001-1	1	A20	Copying Room	Copy Room	yes	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
6040	5	B604001-1	1	A20	Copying Room	Copy Room	yes	Door Case	Metal	Blue	None	0	0	Negative
6040	5	B604001-1	1	A20	Copying Room	Copy Room	yes	W1	Concrete	Tan	None	0	0	Negative
6040	5	B604001-1	1	A20	Copying Room	Copy Room	yes	W2	Concrete	Tan	None	0	0	Negative
6040	5	B604001-1	1	A20	Copying Room	Copy Room	yes	W3	Concrete	Tan	None	0	0	Negative
6040	5	B604001-1	1	A20	Copying Room	Copy Room	yes	W4	Concrete	Tan	None	0	0	Negative
6040	5	B604001-1	1	A20	Copying Room	Copy Room	yes	Ceiling	Metal	N/A	N/A	N/A	N/A	N/A
6040	5	B604001-1	1	A20A	Administrative Office	Copy Room Office adjacent to Classroom 21A	yes	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
6040	5	B604001-1	1	A20A	Administrative Office	Copy Room Office adjacent to Classroom 21A	yes	Door Case	Metal	Blue	None	0	0	Negative
6040	5	B604001-1	1	A20A	Administrative Office	Copy Room Office adjacent to Classroom 21A	yes	W1	Concrete	Tan	None	0	0	Negative
6040	5	B604001-1	1	A20A	Administrative Office	Copy Room Office adjacent to Classroom 21A	yes	W2	Concrete	Tan	None	0	0	Negative
6040	5	B604001-1	1	A20A	Administrative Office	Copy Room Office adjacent to Classroom 21A	yes	W3	Concrete	Tan	None	0	0	Negative
6040	5	B604001-1	1	A20A	Administrative Office	Copy Room Office adjacent to Classroom 21A	yes	W4	Concrete	Tan	None	0	0	Negative
6040	5	B604001-1	1	A20A	Administrative Office	Copy Room Office adjacent to Classroom 21A	yes	Ceiling	Metal	N/A	N/A	N/A	N/A	N/A
6040	5	B604001-1	1	A20A	Administrative Office	Copy Room Office adjacent to Classroom 21A	yes	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
6040	5	B604001-1	1	A20B	Administrative Office	Copy Room Office adjacent to Main Entrance	yes	Door Case	Metal	Blue	None	0	0	Negative
6040	5	B604001-1	1	A20B	Administrative Office	Copy Room Office adjacent to Main Entrance	yes	W1	Concrete	Tan	None	0	0	Negative
6040	5	B604001-1	1	A20B	Administrative Office	Copy Room Office adjacent to Main Entrance	yes	W2	Concrete	Tan	None	0	0	Negative
6040	5	B604001-1	1	A20B	Administrative Office	Copy Room Office adjacent to Main Entrance	yes	W3	Concrete	Tan	None	0	0	Negative

					Dates: 9/12/22 - 10/4/22		Lead-Safe Certification Assessment Report							
					Inspector Name and Certificate Number: Jennifer Drialo-006767/ Steve Merlino- 006800		6040 Walter Biddle Saul HS/Manatawna Farm							
					Inspection Company: Synertech		7100 Henry Avenue, Philadelphia, PA 19128							
ULCS#	Element	BldgElmt ID	Floor	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
6040	5	B604001-1	1	A20B	Administrative Office	Copy Room Office adjacent to Main Entrance	yes	W4	Concrete	Tan	None	0	0	Negative
6040	5	B604001-1	1	A20B	Administrative Office	Copy Room Office adjacent to Main Entrance	yes	Ceiling	Metal	N/A	N/A	N/A	N/A	N/A
6040	5	B604001-1	1	NP1-5	Greenhouse	Greenhouse 1	yes	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
6040	5	B604001-1	1	NP1-5	Greenhouse	Greenhouse 1	yes	W1	Concrete	N/A	N/A	N/A	N/A	N/A
6040	5	B604001-1	1	NP1-5	Greenhouse	Greenhouse 1	yes	W2	Concrete	N/A	N/A	N/A	N/A	N/A
6040	5	B604001-1	1	NP1-5	Greenhouse	Greenhouse 1	yes	W3	Concrete	N/A	N/A	N/A	N/A	N/A
6040	5	B604001-1	1	NP1-5	Greenhouse	Greenhouse 1	yes	W4	Concrete	N/A	N/A	N/A	N/A	N/A
6040	5	B604001-1	1	NP1-5	Greenhouse	Greenhouse 1	yes	Ceiling	Glass	N/A	N/A	N/A	N/A	N/A
6040	5	B604001-1	1	NP2-5	Greenhouse	Greenhouse 2	yes	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
6040	5	B604001-1	1	NP2-5	Greenhouse	Greenhouse 2	yes	W1	Concrete	N/A	N/A	N/A	N/A	N/A
6040	5	B604001-1	1	NP2-5	Greenhouse	Greenhouse 2	yes	W2	Concrete	N/A	N/A	N/A	N/A	N/A
6040	5	B604001-1	1	NP2-5	Greenhouse	Greenhouse 2	yes	W3	Concrete	N/A	N/A	N/A	N/A	N/A
6040	5	B604001-1	1	NP2-5	Greenhouse	Greenhouse 2	yes	W4	Concrete	N/A	N/A	N/A	N/A	N/A
6040	5	B604001-1	1	NP2-5	Greenhouse	Greenhouse 2	yes	Ceiling	Glass	N/A	N/A	N/A	N/A	N/A
6040	5	B604001-1	1	NP3-5	Greenhouse	Greenhouse 3	yes	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
6040	5	B604001-1	1	NP3-5	Greenhouse	Greenhouse 3	yes	W1	Concrete	N/A	N/A	N/A	N/A	N/A
6040	5	B604001-1	1	NP3-5	Greenhouse	Greenhouse 3	yes	W2	Concrete	N/A	N/A	N/A	N/A	N/A
6040	5	B604001-1	1	NP3-5	Greenhouse	Greenhouse 3	yes	W3	Concrete	N/A	N/A	N/A	N/A	N/A
6040	5	B604001-1	1	NP3-5	Greenhouse	Greenhouse 3	yes	W4	Concrete	N/A	N/A	N/A	N/A	N/A
6040	5	B604001-1	1	NP3-5	Greenhouse	Greenhouse 3	yes	Ceiling	Glass	N/A	N/A	N/A	N/A	N/A
6040	5	B604001-1	1	NP4-5	Greenhouse	Greenhouse 4	yes	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
6040	5	B604001-1	1	NP4-5	Greenhouse	Greenhouse 4	yes	W1	Concrete	N/A	N/A	N/A	N/A	N/A
6040	5	B604001-1	1	NP4-5	Greenhouse	Greenhouse 4	yes	W2	Concrete	N/A	N/A	N/A	N/A	N/A
6040	5	B604001-1	1	NP4-5	Greenhouse	Greenhouse 4	yes	W3	Concrete	N/A	N/A	N/A	N/A	N/A
6040	5	B604001-1	1	NP4-5	Greenhouse	Greenhouse 4	yes	W4	Concrete	N/A	N/A	N/A	N/A	N/A
6040	5	B604001-1	1	NP4-5	Greenhouse	Greenhouse 4	yes	Ceiling	Glass	N/A	N/A	N/A	N/A	N/A
6040	5	B604001-1	1	H16A	Circulation (Hallway)	Hallway outside Classroom 29A	yes	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
6040	5	B604001-1	1	H16A	Circulation (Hallway)	Hallway outside Classroom 29A	yes	W2	Concrete	Tan	None	0	0	Negative
6040	5	B604001-1	1	H16A	Circulation (Hallway)	Hallway outside Classroom 29A	yes	W4	Concrete	Tan	None	0	0	Negative
6040	5	B604001-1	1	H16A	Circulation (Hallway)	Hallway outside Classroom 29A	yes	Ceiling	Metal	N/A	N/A	N/A	N/A	N/A
6040	5	B604001-1	1	H16	Circulation (Hallway)	Hallway outside Classrooms 22A-23A	yes	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
6040	5	B604001-1	1	H16	Circulation (Hallway)	Hallway outside Classrooms 22A-23A	yes	W2	Concrete	Tan	None	0	0	Negative
6040	5	B604001-1	1	H16	Circulation (Hallway)	Hallway outside Classrooms 22A-23A	yes	W4	Concrete	Tan	None	0	0	Negative
6040	5	B604001-1	1	H16	Circulation (Hallway)	Hallway outside Classrooms 22A-23A	yes	Ceiling	Metal	N/A	N/A	N/A	N/A	N/A
6040	5	B604001-1	1	H15	Circulation (Hallway)	Hallway outside Classrooms 24A-28A	yes	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
6040	5	B604001-1	1	H15	Circulation (Hallway)	Hallway outside Classrooms 24A-28A	yes	W2	Concrete	Tan	None	0	0	Negative
6040	5	B604001-1	1	H15	Circulation (Hallway)	Hallway outside Classrooms 24A-28A	yes	W4	Concrete	Tan	None	0	0	Negative
6040	5	B604001-1	1	H15	Circulation (Hallway)	Hallway outside Classrooms 24A-28A	yes	Ceiling	Metal	N/A	N/A	N/A	N/A	N/A

					Dates: 9/12/22 - 10/4/22		Lead-Safe Certification Assessment Report							
					Inspector Name and Certificate Number: Jennifer Drialo-006767/ Steve Merlino- 006800		6040 Walter Biddle Saul HS/Manatawna Farm							
					Inspection Company: Synertech		7100 Henry Avenue, Philadelphia, PA 19128							
ULCS#	Element	BldgElmt ID	Floor	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
6040	5	B604001-1	1	H17	Circulation (Hallway)	Hallway outside Copy Room and Classroom 21A	yes	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
6040	5	B604001-1	1	H17	Circulation (Hallway)	Hallway outside Copy Room and Classroom 21A	yes	W2	Concrete	Tan	None	0	0	Negative
6040	5	B604001-1	1	H17	Circulation (Hallway)	Hallway outside Copy Room and Classroom 21A	yes	W4	Concrete	Tan	None	0	0	Negative
6040	5	B604001-1	1	H17	Circulation (Hallway)	Hallway outside Copy Room and Classroom 21A	yes	Ceiling	Metal	N/A	N/A	N/A	N/A	N/A
6040	5	B604001-1	1	NP11	Circulation (Hallway)	Main Entrance Vestibule	yes	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
6040	5	B604001-1	1	NP11	Circulation (Hallway)	Main Entrance Vestibule	yes	W2	Concrete	Tan	None	0	0	Negative
6040	5	B604001-1	1	NP11	Circulation (Hallway)	Main Entrance Vestibule	yes	W4	Concrete	Tan	None	0	0	Negative
6040	5	B604001-1	1	NP11	Circulation (Hallway)	Main Entrance Vestibule	yes	Ceiling	Metal	N/A	N/A	N/A	N/A	N/A
6040	5	B604001-1	1	A22A	Space (Tech/Vo tech)	Refrigerator between Classrooms 21A and 22A	yes	Floor	Metal	N/A	N/A	N/A	N/A	N/A
6040	5	B604001-1	1	A22A	Space (Tech/Vo tech)	Refrigerator between Classrooms 21A and 22A	yes	W1	Metal	N/A	N/A	N/A	N/A	N/A
6040	5	B604001-1	1	A22A	Space (Tech/Vo tech)	Refrigerator between Classrooms 21A and 22A	yes	W2	Metal	N/A	N/A	N/A	N/A	N/A
6040	5	B604001-1	1	A22A	Space (Tech/Vo tech)	Refrigerator between Classrooms 21A and 22A	yes	W3	Metal	N/A	N/A	N/A	N/A	N/A
6040	5	B604001-1	1	A22A	Space (Tech/Vo tech)	Refrigerator between Classrooms 21A and 22A	yes	W4	Metal	N/A	N/A	N/A	N/A	N/A
6040	5	B604001-1	1	A22A	Space (Tech/Vo tech)	Refrigerator between Classrooms 21A and 22A	yes	Ceiling	Metal	N/A	N/A	N/A	N/A	N/A
6040	5	B604001-1	1	S16	Stairs	Stairwell adjacent to Classrooms 23A and 24A	yes	Door	Metal	Brown	None	0	0	Negative
6040	5	B604001-1	1	S16	Stairs	Stairwell adjacent to Classrooms 23A and 24A	yes	Door Case	Metal	Brown	None	0	0.1	Negative
6040	5	B604001-1	1	S16	Stairs	Stairwell adjacent to Classrooms 23A and 24A	yes	Floor	Concrete	Grey	None	0	0	Negative
6040	5	B604001-1	1	S16	Stairs	Stairwell adjacent to Classrooms 23A and 24A	yes	Baluster	Metal	Grey	None	0	0	Negative
6040	5	B604001-1	1	S16	Stairs	Stairwell adjacent to Classrooms 23A and 24A	yes	Tread	Concrete	Grey	None	0	0	Negative
6040	5	B604001-1	1	S16	Stairs	Stairwell adjacent to Classrooms 23A and 24A	yes	Closed Stringer	Metal	Grey	None	0	0.11	Negative
6040	5	B604001-1	1	S16	Stairs	Stairwell adjacent to Classrooms 23A and 24A	yes	Riser	Metal	Grey	None	0	0.17	Negative
6040	5	B604001-1	1	S16	Stairs	Stairwell adjacent to Classrooms 23A and 24A	yes	Open Stringer	Metal	Grey	None	0	0	Negative
6040	5	B604001-1	1	S16	Stairs	Stairwell adjacent to Classrooms 23A and 24A	yes	W1	Concrete	White	None	0	0	Negative
6040	5	B604001-1	1	S16	Stairs	Stairwell adjacent to Classrooms 23A and 24A	yes	W2	Concrete	White	None	0	0	Negative
6040	5	B604001-1	1	S16	Stairs	Stairwell adjacent to Classrooms 23A and 24A	yes	W3	Concrete	White	None	0	0	Negative
6040	5	B604001-1	1	S16	Stairs	Stairwell adjacent to Classrooms 23A and 24A	yes	W4	Concrete	White	None	0	0	Negative
6040	5	B604001-1	1	S16	Stairs	Stairwell adjacent to Classrooms 23A and 24A	yes	Ceiling	Concrete	White	None	0	0	Negative

						Dates: 9/12/22 - 10/4/22	Lead-Safe Certification Assessment Report								
						Inspector Name and Certificate Number: Jennifer Drialo-006767/ Steve Merlino- 006800	6040 Walter Biddle Saul HS/Manatawna Farm								
						Inspection Company: Synertech	7100 Henry Avenue, Philadelphia, PA 19128								
ULCS#	Element	BldgElmt ID	Floor	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)	
6040	5	B604001-1	1	S16	Stairs	Stairwell adjacent to Classrooms 23A and 24A	yes	Pipe	Metal	White	None	0	2.8	Positive	
6040	5	B604001-1	1	NP15	Storage	Storage Room adjacent to Classroom 29A	no	Floor	Concrete	N/A	N/A	N/A	N/A	N/A	
6040	5	B604001-1	1	NP15	Storage	Storage Room adjacent to Classroom 29A	yes	Door Case	Metal	Blue	None	0	0	Negative	
6040	5	B604001-1	1	NP15	Storage	Storage Room adjacent to Classroom 29A	no	W1	Concrete	N/A	Partially Inaccessible	N/A	N/A	N/A	
6040	5	B604001-1	1	NP15	Storage	Storage Room adjacent to Classroom 29A	no	W2	Concrete	N/A	Partially Inaccessible	N/A	N/A	N/A	
6040	5	B604001-1	1	NP15	Storage	Storage Room adjacent to Classroom 29A	no	W3	Concrete	N/A	Partially Inaccessible	N/A	N/A	N/A	
6040	5	B604001-1	1	NP15	Storage	Storage Room adjacent to Classroom 29A	no	W4	Concrete	N/A	Partially Inaccessible	N/A	N/A	N/A	
6040	5	B604001-1	1	NP15	Storage	Storage Room adjacent to Classroom 29A	no	Ceiling	Metal	N/A	Partially Inaccessible	N/A	N/A	N/A	
6040	5	B604001-1	B	A4	Vo-Tech Classroom for Related Instruction	Animal Lab A4	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A	
6040	5	B604001-1	B	A4	Vo-Tech Classroom for Related Instruction	Animal Lab A4	yes	Door Case	Metal	Blue	None	0	0	Negative	
6040	5	B604001-1	B	A4	Vo-Tech Classroom for Related Instruction	Animal Lab A4	yes	W1	Concrete	Blue	None	0	0	Negative	
6040	5	B604001-1	B	A4	Vo-Tech Classroom for Related Instruction	Animal Lab A4	yes	W2	Concrete	Blue	None	0	0	Negative	
6040	5	B604001-1	B	A4	Vo-Tech Classroom for Related Instruction	Animal Lab A4	yes	W3	Concrete	Blue	None	0	0	Negative	
6040	5	B604001-1	B	A4	Vo-Tech Classroom for Related Instruction	Animal Lab A4	yes	W4	Concrete	Blue	None	0	0	Negative	
6040	5	B604001-1	B	A4	Vo-Tech Classroom for Related Instruction	Animal Lab A4	yes	Ceiling	Concrete	N/A	N/A	N/A	N/A	N/A	
6040	5	B604001-1	B	A4	Vo-Tech Classroom for Related Instruction	Animal Lab A4	yes	Ductwork	Metal	White	None	0	0	Negative	
6040	5	B604001-1	B	NP1-B	Storage	Animal Lab A4 Large Storage Room	yes	Floor	Concrete	N/A	N/A	N/A	N/A	N/A	
6040	5	B604001-1	B	NP1-B	Storage	Animal Lab A4 Large Storage Room	yes	Door Case	Metal	Blue	None	0	0	Negative	
6040	5	B604001-1	B	NP1-B	Storage	Animal Lab A4 Large Storage Room	yes	W1	Concrete	N/A	Partially Inaccessible	N/A	N/A	N/A	
6040	5	B604001-1	B	NP1-B	Storage	Animal Lab A4 Large Storage Room	yes	W2	Concrete	N/A	Partially Inaccessible	N/A	N/A	N/A	

						Dates: 9/12/22 - 10/4/22		Lead-Safe Certification Assessment Report						
						Inspector Name and Certificate Number: Jennifer Drialo-006767/ Steve Merlino- 006800		6040 Walter Biddle Saul HS/Manatawna Farm						
						Inspection Company: Synertech		7100 Henry Avenue, Philadelphia, PA 19128						
ULCS#	E l e m e n t	BldgElmt ID	F l o o r	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/ negative)
6040	5	B604001-1	B	NP1-B	Storage	Animal Lab A4 Large Storage Room	yes	W3	Concrete	N/A	Partially Inaccessible	N/A	N/A	N/A
6040	5	B604001-1	B	NP1-B	Storage	Animal Lab A4 Large Storage Room	yes	W4	Concrete	N/A	Partially Inaccessible	N/A	N/A	N/A
6040	5	B604001-1	B	NP1-B	Storage	Animal Lab A4 Large Storage Room	yes	Ceiling	Metal	N/A	Partially Inaccessible	N/A	N/A	N/A
6040	5	B604001-1	B	A4A	Storage	Animal Lab A4 Small Storage Room	yes	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
6040	5	B604001-1	B	A4A	Storage	Animal Lab A4 Small Storage Room	yes	Door Case	Metal	Blue	None	0	0	Negative
6040	5	B604001-1	B	A4A	Storage	Animal Lab A4 Small Storage Room	yes	W1	Concrete	N/A	Partially Inaccessible	N/A	N/A	N/A
6040	5	B604001-1	B	A4A	Storage	Animal Lab A4 Small Storage Room	yes	W2	Concrete	N/A	Partially Inaccessible	N/A	N/A	N/A
6040	5	B604001-1	B	A4A	Storage	Animal Lab A4 Small Storage Room	yes	W3	Concrete	N/A	Partially Inaccessible	N/A	N/A	N/A
6040	5	B604001-1	B	A4A	Storage	Animal Lab A4 Small Storage Room	yes	W4	Concrete	N/A	Partially Inaccessible	N/A	N/A	N/A
6040	5	B604001-1	B	A4A	Storage	Animal Lab A4 Small Storage Room	yes	Ceiling	Metal	N/A	Partially Inaccessible	N/A	N/A	N/A
6040	5	B604001-1	B	NP3-B	Electrical Room	Boiler Room Electrical Room	no	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
6040	5	B604001-1	B	NP3-B	Electrical Room	Boiler Room Electrical Room	no	W1	Concrete	N/A	N/A	N/A	N/A	N/A
6040	5	B604001-1	B	NP3-B	Electrical Room	Boiler Room Electrical Room	no	W2	Concrete	N/A	N/A	N/A	N/A	N/A
6040	5	B604001-1	B	NP3-B	Electrical Room	Boiler Room Electrical Room	no	W3	Concrete	N/A	N/A	N/A	N/A	N/A
6040	5	B604001-1	B	NP3-B	Electrical Room	Boiler Room Electrical Room	no	W4	Concrete	N/A	N/A	N/A	N/A	N/A
6040	5	B604001-1	B	NP3-B	Electrical Room	Boiler Room Electrical Room	no	Ceiling	Concrete	N/A	N/A	N/A	N/A	N/A
6040	5	B604001-1	B	A1	Senior High	Classroom A1	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
6040	5	B604001-1	B	A1	Senior High	Classroom A1	yes	Door Case	Metal	Blue	None	0	0	Negative
6040	5	B604001-1	B	A1	Senior High	Classroom A1	yes	W1	Concrete	Tan	None	0	0	Negative
6040	5	B604001-1	B	A1	Senior High	Classroom A1	yes	W2	Concrete	Yellow	None	0	0	Negative
6040	5	B604001-1	B	A1	Senior High	Classroom A1	yes	Pipe	Metal	Yellow	None	0	0	Negative
6040	5	B604001-1	B	A1	Senior High	Classroom A1	yes	W3	Concrete	Tan	None	0	0	Negative
6040	5	B604001-1	B	A1	Senior High	Classroom A1	yes	W4	Concrete	Tan	None	0	0	Negative
6040	5	B604001-1	B	A1	Senior High	Classroom A1	yes	Ceiling	Concrete	N/A	N/A	N/A	N/A	N/A
6040	5	B604001-1	B	NP4-B	Storage	Classroom A1 Storage Room	yes	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
6040	5	B604001-1	B	NP4-B	Storage	Classroom A1 Storage Room	yes	Door Case	Metal	Blue	None	0	0	Negative
6040	5	B604001-1	B	NP4-B	Storage	Classroom A1 Storage Room	yes	W1	Concrete	Yellow	None	0	0	Negative
6040	5	B604001-1	B	NP4-B	Storage	Classroom A1 Storage Room	yes	W2	Concrete	Yellow	None	0	0	Negative
6040	5	B604001-1	B	NP4-B	Storage	Classroom A1 Storage Room	yes	Column	Concrete	Yellow	None	0	0	Negative
6040	5	B604001-1	B	NP4-B	Storage	Classroom A1 Storage Room	yes	W3	Concrete	Yellow	None	0	0	Negative
6040	5	B604001-1	B	NP4-B	Storage	Classroom A1 Storage Room	yes	W4	Concrete	Yellow	None	0	0	Negative
6040	5	B604001-1	B	NP4-B	Storage	Classroom A1 Storage Room	yes	Ceiling	Concrete	N/A	N/A	N/A	N/A	N/A
6040	5	B604001-1	B	A2	Senior High	Classroom A2	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
6040	5	B604001-1	B	A2	Senior High	Classroom A2	yes	Door Case	Metal	Blue	None	0	0	Negative
6040	5	B604001-1	B	A2	Senior High	Classroom A2	yes	W1	Concrete	Tan	None	0	0	Negative
6040	5	B604001-1	B	A2	Senior High	Classroom A2	yes	W2	Concrete	Yellow	None	0	0	Negative
6040	5	B604001-1	B	A2	Senior High	Classroom A2	yes	W3	Concrete	Tan	None	0	0	Negative
6040	5	B604001-1	B	A2	Senior High	Classroom A2	yes	W4	Concrete	Tan	None	0	0	Negative
6040	5	B604001-1	B	A2	Senior High	Classroom A2	yes	Ceiling	Concrete	N/A	N/A	N/A	N/A	N/A
6040	5	B604001-1	B	A3	Senior High	Classroom A3	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
6040	5	B604001-1	B	A3	Senior High	Classroom A3	yes	Door Case	Metal	Blue	None	0	0	Negative
6040	5	B604001-1	B	A3	Senior High	Classroom A3	yes	W1	Concrete	Tan	None	0	0	Negative
6040	5	B604001-1	B	A3	Senior High	Classroom A3	yes	W2	Concrete	Yellow	None	0	0	Negative
6040	5	B604001-1	B	A3	Senior High	Classroom A3	yes	W3	Concrete	Tan	None	0	0	Negative

						Dates: 9/12/22 - 10/4/22		Lead-Safe Certification Assessment Report						
						Inspector Name and Certificate Number: Jennifer Drialo-006767/ Steve Merlino- 006800		6040 Walter Biddle Saul HS/Manatawna Farm						
						Inspection Company: Synertech		7100 Henry Avenue, Philadelphia, PA 19128						
ULCS#	E l e m e n t	BldgElmt ID	F l o o r	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/ negative)
6040	5	B604001-1	B	A3	Senior High	Classroom A3	yes	W4	Concrete	Tan	None	0	0	Negative
6040	5	B604001-1	B	A3	Senior High	Classroom A3	yes	Ceiling	Concrete	N/A	N/A	N/A	N/A	N/A
6040	5	B604001-1	B	A3A	Storage	Classroom A3 Storage Room	yes	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
6040	5	B604001-1	B	A3A	Storage	Classroom A3 Storage Room	yes	Door Case	Metal	Blue	None	0	0	Negative
6040	5	B604001-1	B	A3A	Storage	Classroom A3 Storage Room	yes	W1	Concrete	Yellow	None	0	0	Negative
6040	5	B604001-1	B	A3A	Storage	Classroom A3 Storage Room	yes	W2	Concrete	Yellow	None	0	0	Negative
6040	5	B604001-1	B	A3A	Storage	Classroom A3 Storage Room	yes	Column	Concrete	Yellow	None	0	0	Negative
6040	5	B604001-1	B	A3A	Storage	Classroom A3 Storage Room	yes	W3	Concrete	Yellow	None	0	0	Negative
6040	5	B604001-1	B	A3A	Storage	Classroom A3 Storage Room	yes	W4	Concrete	Yellow	None	0	0	Negative
6040	5	B604001-1	B	A3A	Storage	Classroom A3 Storage Room	yes	Ceiling	Concrete	N/A	N/A	N/A	N/A	N/A
6040	5	B604001-1	B	A5	Senior High	Classroom A5	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
6040	5	B604001-1	B	A5	Senior High	Classroom A5	yes	Door Case	Metal	Blue	None	0	0	Negative
6040	5	B604001-1	B	A5	Senior High	Classroom A5	yes	W1	Concrete	Tan	None	0	0	Negative
6040	5	B604001-1	B	A5	Senior High	Classroom A5	yes	W2	Concrete	Yellow	None	0	0	Negative
6040	5	B604001-1	B	A5	Senior High	Classroom A5	yes	W3	Concrete	Tan	None	0	0	Negative
6040	5	B604001-1	B	A5	Senior High	Classroom A5	yes	W4	Concrete	Tan	None	0	0	Negative
6040	5	B604001-1	B	A5	Senior High	Classroom A5	yes	Ceiling	Concrete	N/A	N/A	N/A	N/A	N/A
6040	5	B604001-1	B	H05	Circulation (Hallway)	Hallway outside Animal Lab A4	yes	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
6040	5	B604001-1	B	H05	Circulation (Hallway)	Hallway outside Animal Lab A4	yes	W2	Concrete	Tan	None	0	0	Negative
6040	5	B604001-1	B	H05	Circulation (Hallway)	Hallway outside Animal Lab A4	yes	W4	Concrete	Tan	None	0	0	Negative
6040	5	B604001-1	B	H05	Circulation (Hallway)	Hallway outside Animal Lab A4	yes	Ceiling	Metal	N/A	N/A	N/A	N/A	N/A
6040	5	B604001-1	B	H05A	Service Closets	Hallway outside Animal Lab A4 Custodial Closet	no	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
6040	5	B604001-1	B	H05A	Service Closets	Hallway outside Animal Lab A4 Custodial Closet	no	W2	Concrete	Tan	None	0	0	Negative
6040	5	B604001-1	B	H05A	Service Closets	Hallway outside Animal Lab A4 Custodial Closet	no	W4	Concrete	Tan	None	0	0	Negative
6040	5	B604001-1	B	H05A	Service Closets	Hallway outside Animal Lab A4 Custodial Closet	no	Ceiling	Metal	N/A	N/A	N/A	N/A	N/A
6040	5	B604001-1	B	H06	Circulation (Hallway)	Hallway outside Classrooms A1-A3	yes	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
6040	5	B604001-1	B	H06	Circulation (Hallway)	Hallway outside Classrooms A1-A3	yes	W2	Concrete	Tan	None	0	0	Negative
6040	5	B604001-1	B	H06	Circulation (Hallway)	Hallway outside Classrooms A1-A3	yes	W4	Concrete	Tan	None	0	0	Negative
6040	5	B604001-1	B	H06	Circulation (Hallway)	Hallway outside Classrooms A1-A3	yes	Ceiling	Metal	N/A	N/A	N/A	N/A	N/A
6040	5	B604001-1	B	NP6	Pipe Chase	Hallway outside Classrooms A1-A3 Pipe Chase	no	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
6040	5	B604001-1	B	NP6	Pipe Chase	Hallway outside Classrooms A1-A3 Pipe Chase	no	W1	Concrete	N/A	N/A	N/A	N/A	N/A
6040	5	B604001-1	B	NP6	Pipe Chase	Hallway outside Classrooms A1-A3 Pipe Chase	no	W2	Concrete	N/A	N/A	N/A	N/A	N/A
6040	5	B604001-1	B	NP6	Pipe Chase	Hallway outside Classrooms A1-A3 Pipe Chase	no	W3	Concrete	N/A	N/A	N/A	N/A	N/A
6040	5	B604001-1	B	NP6	Pipe Chase	Hallway outside Classrooms A1-A3 Pipe Chase	no	W4	Concrete	N/A	N/A	N/A	N/A	N/A
6040	5	B604001-1	B	NP6	Pipe Chase	Hallway outside Classrooms A1-A3 Pipe Chase	no	Ceiling	Metal	N/A	N/A	N/A	N/A	N/A

					Dates: 9/12/22 - 10/4/22		Lead-Safe Certification Assessment Report							
					Inspector Name and Certificate Number: Jennifer Drialo-006767/ Steve Merlino- 006800		6040 Walter Biddle Saul HS/Manatawna Farm							
					Inspection Company: Synertech		7100 Henry Avenue, Philadelphia, PA 19128							
ULCS#	E l e m e n t	BldgElmt ID	F l o o r	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/ negative)
6040	5	B604001-1	B	A2A	Space (Science Lab Prep)	Prep Room between Classrooms A1 and A2	yes	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
6040	5	B604001-1	B	A2A	Space (Science Lab Prep)	Prep Room between Classrooms A1 and A2	yes	Door Case	Metal	Brown	None	0	0	Negative
6040	5	B604001-1	B	A2A	Space (Science Lab Prep)	Prep Room between Classrooms A1 and A2	yes	W1	Concrete	Tan	None	0	0	Negative
6040	5	B604001-1	B	A2A	Space (Science Lab Prep)	Prep Room between Classrooms A1 and A2	yes	W2	Concrete	Tan	None	0	0	Negative
6040	5	B604001-1	B	A2A	Space (Science Lab Prep)	Prep Room between Classrooms A1 and A2	yes	W3	Concrete	Tan	None	0	0	Negative
6040	5	B604001-1	B	A2A	Space (Science Lab Prep)	Prep Room between Classrooms A1 and A2	yes	W4	Concrete	Tan	None	0	0	Negative
6040	5	B604001-1	B	A2A	Space (Science Lab Prep)	Prep Room between Classrooms A1 and A2	yes	Ceiling	Metal	N/A	None	N/A	N/A	N/A
6040	5	B604001-1	B	NP8	Administrative Office	Room adjacent to Restroom	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
6040	5	B604001-1	B	NP8	Administrative Office	Room adjacent to Restroom	yes	Door Case	Metal	Brown	None	0	0	Negative
6040	5	B604001-1	B	NP8	Administrative Office	Room adjacent to Restroom	yes	W1	Concrete	Tan	None	0	0	Negative
6040	5	B604001-1	B	NP8	Administrative Office	Room adjacent to Restroom	yes	W2	Concrete	Tan	None	0	0	Negative
6040	5	B604001-1	B	NP8	Administrative Office	Room adjacent to Restroom	yes	W3	Concrete	Tan	None	0	0	Negative
6040	5	B604001-1	B	NP8	Administrative Office	Room adjacent to Restroom	yes	W4	Concrete	Tan	None	0	0	Negative
6040	5	B604001-1	B	NP8	Administrative Office	Room adjacent to Restroom	yes	Ceiling	Metal	N/A	None	N/A	N/A	N/A
6040	5	B604001-1	B	NP7	Administrative Office	Restroom at corner of Hallways	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
6040	5	B604001-1	B	NP7	Administrative Office	Restroom at corner of Hallways	yes	Door Case	Metal	Tan	None	0	0	Negative
6040	5	B604001-1	B	NP7	Administrative Office	Restroom at corner of Hallways	yes	W1	Concrete	Tan	None	0	0	Negative
6040	5	B604001-1	B	NP7	Administrative Office	Restroom at corner of Hallways	yes	W2	Concrete	Tan	None	0	0	Negative
6040	5	B604001-1	B	NP7	Administrative Office	Restroom at corner of Hallways	yes	W3	Concrete	Tan	None	0	0	Negative
6040	5	B604001-1	B	NP7	Administrative Office	Restroom at corner of Hallways	yes	W4	Concrete	Tan	None	0	0	Negative
6040	5	B604001-1	B	NP7	Administrative Office	Restroom at corner of Hallways	yes	Ceiling	Metal	N/A	None	N/A	N/A	N/A
6040	5	B604001-1	B	NP9	Storage	Storage Room inside Restroom	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
6040	5	B604001-1	B	NP9	Storage	Storage Room inside Restroom	yes	Door Case	Metal	Tan	None	0	0	Negative
6040	5	B604001-1	B	NP9	Storage	Storage Room inside Restroom	yes	W1	Concrete	Tan	None	0	0	Negative
6040	5	B604001-1	B	NP9	Storage	Storage Room inside Restroom	yes	W2	Concrete	Tan	None	0	0	Negative
6040	5	B604001-1	B	NP9	Storage	Storage Room inside Restroom	yes	W3	Concrete	Tan	None	0	0	Negative
6040	5	B604001-1	B	NP9	Storage	Storage Room inside Restroom	yes	W4	Concrete	Tan	None	0	0	Negative
6040	5	B604001-1	B	NP9	Storage	Storage Room inside Restroom	yes	Ceiling	Metal	N/A	None	N/A	N/A	N/A
6040	5	B604001-1	B	S06	Stairs	Stairwell adjacent to Classroom A3	yes	Door	Metal	Brown	None	0	0	Negative
6040	5	B604001-1	B	S06	Stairs	Stairwell adjacent to Classroom A3	yes	Door Case	Metal	Brown	None	0	0.1	Negative
6040	5	B604001-1	B	S06	Stairs	Stairwell adjacent to Classroom A3	yes	Floor	Concrete	Grey	None	0	0	Negative
6040	5	B604001-1	B	S06	Stairs	Stairwell adjacent to Classroom A3	yes	Baluster	Metal	Grey	None	0	0	Negative
6040	5	B604001-1	B	S06	Stairs	Stairwell adjacent to Classroom A3	yes	Tread	Concrete	Grey	None	0	0	Negative

						Dates: 9/12/22 - 10/4/22		Lead-Safe Certification Assessment Report						
						Inspector Name and Certificate Number: Jennifer Drialo-006767/ Steve Merlino- 006800		6040 Walter Biddle Saul HS/Manatawna Farm						
						Inspection Company: Synertech		7100 Henry Avenue, Philadelphia, PA 19128						
ULCS#	E l e m e n t	BldgElmt ID	F l o o r	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/ negative)
6040	5	B604001-1	B	S06	Stairs	Stairwell adjacent to Classroom A3	yes	Closed Stringer	Metal	Grey	None	0	0.15	Negative
6040	5	B604001-1	B	S06	Stairs	Stairwell adjacent to Classroom A3	yes	Riser	Metal	Grey	None	0	0.12	Negative
6040	5	B604001-1	B	S06	Stairs	Stairwell adjacent to Classroom A3	yes	Open Stringer	Metal	Grey	None	0	0	Negative
6040	5	B604001-1	B	S06	Stairs	Stairwell adjacent to Classroom A3	yes	W1	Concrete	White	None	0	0	Negative
6040	5	B604001-1	B	S06	Stairs	Stairwell adjacent to Classroom A3	yes	W2	Concrete	White	None	0	0	Negative
6040	5	B604001-1	B	S06	Stairs	Stairwell adjacent to Classroom A3	yes	W3	Concrete	White	None	0	0	Negative
6040	5	B604001-1	B	S06	Stairs	Stairwell adjacent to Classroom A3	yes	W4	Concrete	White	None	0	0	Negative
6040	5	B604001-1	B	S06	Stairs	Stairwell adjacent to Classroom A3	yes	Ceiling	Concrete	White	None	0	0	Negative
6040	5	B604001-1	B	NP5	Storage	Storage Room adjacent to Classroom A1 Storage Room (former Restroom)	yes	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
6040	5	B604001-1	B	NP5	Storage	Storage Room adjacent to Classroom A1 Storage Room (former Restroom)	yes	Door Case	Metal	Blue	None	0	0	Negative
6040	5	B604001-1	B	NP5	Storage	Storage Room adjacent to Classroom A1 Storage Room (former Restroom)	yes	W1	Concrete	N/A	Partially Inaccessible	N/A	N/A	N/A
6040	5	B604001-1	B	NP5	Storage	Storage Room adjacent to Classroom A1 Storage Room (former Restroom)	yes	W2	Concrete	N/A	Partially Inaccessible	N/A	N/A	N/A
6040	5	B604001-1	B	NP5	Storage	Storage Room adjacent to Classroom A1 Storage Room (former Restroom)	yes	W3	Concrete	N/A	Partially Inaccessible	N/A	N/A	N/A
6040	5	B604001-1	B	NP5	Storage	Storage Room adjacent to Classroom A1 Storage Room (former Restroom)	yes	W4	Concrete	N/A	Partially Inaccessible	N/A	N/A	N/A
6040	5	B604001-1	B	NP5	Storage	Storage Room adjacent to Classroom A1 Storage Room (former Restroom)	yes	Ceiling	Metal	N/A	Partially Inaccessible	N/A	N/A	N/A
6040	5	B604001-1	B	NP10	Restrooms, Staff - Female	Women's Restroom adjacent to Animal Lab A4	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
6040	5	B604001-1	B	NP10	Restrooms, Staff - Female	Women's Restroom adjacent to Animal Lab A4	yes	Door Case	Metal	Tan	None	0	0	Negative
6040	5	B604001-1	B	NP10	Restrooms, Staff - Female	Women's Restroom adjacent to Animal Lab A4	yes	W1	Concrete	Tan	None	0	0	Negative
6040	5	B604001-1	B	NP10	Restrooms, Staff - Female	Women's Restroom adjacent to Animal Lab A4	yes	W2	Concrete	Tan	None	0	0	Negative
6040	5	B604001-1	B	NP10	Restrooms, Staff - Female	Women's Restroom adjacent to Animal Lab A4	yes	W3	Concrete	Tan	None	0	0	Negative
6040	5	B604001-1	B	NP10	Restrooms, Staff - Female	Women's Restroom adjacent to Animal Lab A4	yes	W4	Concrete	Tan	None	0	0	Negative
6040	5	B604001-1	B	NP10	Restrooms, Staff - Female	Women's Restroom adjacent to Animal Lab A4	yes	Ceiling	Metal	N/A	None	N/A	N/A	N/A
6040	6	B604001-1	1	100-6	Space (Tech/Vo tech)	Meat Lab	Yes	Floor	Concrete	Grey	Flaking	50	0.1	Negative
6040	6	B604001-1	1	100-6	Space (Tech/Vo tech)	Meat Lab	Yes	W1	Vinyl	White	None	0	0	Negative
6040	6	B604001-1	1	100-6	Space (Tech/Vo tech)	Meat Lab	Yes	W2	Vinyl	White	None	0	0	Negative
6040	6	B604001-1	1	100-6	Space (Tech/Vo tech)	Meat Lab	Yes	W3	Vinyl	White	None	0	0	Negative
6040	6	B604001-1	1	100-6	Space (Tech/Vo tech)	Meat Lab	Yes	W4	Vinyl	White	None	0	0.1	Negative
6040	6	B604001-1	1	100-6	Space (Tech/Vo tech)	Meat Lab	Yes	Ceiling	Concrete	White	None	0	0	Negative

					Dates: 9/12/22 - 10/4/22		Lead-Safe Certification Assessment Report							
					Inspector Name and Certificate Number: Jennifer Drialo-006767/ Steve Merlino- 006800		6040 Walter Biddle Saul HS/Manatawna Farm							
					Inspection Company: Synertech		7100 Henry Avenue, Philadelphia, PA 19128							
ULCS#	E l e m e n t	BldgElmt ID	F l o o r	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/ negative)
6040	6	B604001-1	1	101-6	Senior High	Meat Lab Classroom	Yes	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
6040	6	B604001-1	1	101-6	Senior High	Meat Lab Classroom	Yes	W1	Brick	White	Flaking	10	0.1	Negative
6040	6	B604001-1	1	101-6	Senior High	Meat Lab Classroom	Yes	W2	Brick	White	None	0	0	Negative
6040	6	B604001-1	1	101-6	Senior High	Meat Lab Classroom	Yes	W3	Brick	White	Flaking	10	0	Negative
6040	6	B604001-1	1	101-6	Senior High	Meat Lab Classroom	Yes	W4	Brick	White	None	0	0.1	Negative
6040	6	B604001-1	1	101-6	Senior High	Meat Lab Classroom	Yes	Ceiling	Concrete	White	None	0	0.2	Negative
6040	6	B604001-1	1	101A-6	Storage	Meat Lab Classroom Closet	Yes	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
6040	6	B604001-1	1	101A-6	Storage	Meat Lab Classroom Closet	Yes	W1	Brick	White	None	0	0	Negative
6040	6	B604001-1	1	101A-6	Storage	Meat Lab Classroom Closet	Yes	W2	Brick	White	None	0	0.1	Negative
6040	6	B604001-1	1	101A-6	Storage	Meat Lab Classroom Closet	Yes	W3	Brick	White	None	0	0.2	Negative
6040	6	B604001-1	1	101A-6	Storage	Meat Lab Classroom Closet	Yes	W4	Brick	White	None	0	0	Negative
6040	6	B604001-1	1	101A-6	Storage	Meat Lab Classroom Closet	Yes	Ceiling	Concrete	N/A	N/A	N/A	N/A	N/A
6040	6	B604001-1	1	100A-6	Space (Tech/Vo tech)	Meat Lab Refrigerator	Yes	Floor	Concrete	Grey	Flaking	30	0	Negative
6040	6	B604001-1	1	100A-6	Space (Tech/Vo tech)	Meat Lab Refrigerator	Yes	W1	Metal	N/A	N/A	N/A	N/A	N/A
6040	6	B604001-1	1	100A-6	Space (Tech/Vo tech)	Meat Lab Refrigerator	Yes	W2	Metal	N/A	N/A	N/A	N/A	N/A
6040	6	B604001-1	1	100A-6	Space (Tech/Vo tech)	Meat Lab Refrigerator	Yes	W3	Metal	N/A	N/A	N/A	N/A	N/A
6040	6	B604001-1	1	100A-6	Space (Tech/Vo tech)	Meat Lab Refrigerator	Yes	W4	Metal	N/A	N/A	N/A	N/A	N/A
6040	6	B604001-1	1	100A-6	Space (Tech/Vo tech)	Meat Lab Refrigerator	Yes	Ceiling	Metal	N/A	N/A	N/A	N/A	N/A
6040	8	B604001-1	1	G9	Administrative Office	Boy's Side Gym Office	yes	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
6040	8	B604001-1	1	G9	Administrative Office	Boy's Side Gym Office	yes	Door Case	Metal	Yellow	None	0	0	Negative
6040	8	B604001-1	1	G9	Administrative Office	Boy's Side Gym Office	yes	W1	Concrete	Yellow	None	0	0	Negative
6040	8	B604001-1	1	G9	Administrative Office	Boy's Side Gym Office	yes	W2	Concrete	Yellow	None	0	0	Negative
6040	8	B604001-1	1	G9	Administrative Office	Boy's Side Gym Office	yes	W3	Concrete	Yellow	None	0	0	Negative
6040	8	B604001-1	1	G9	Administrative Office	Boy's Side Gym Office	yes	Pipe	Metal	Yellow	None	0	0	Negative
6040	8	B604001-1	1	G9	Administrative Office	Boy's Side Gym Office	yes	W4	Concrete	Tan	None	0	0	Negative
6040	8	B604001-1	1	G9	Administrative Office	Boy's Side Gym Office	yes	Ceiling	Metal	N/A	N/A	N/A	N/A	N/A
6040	8	B604001-1	1	G10	Restrooms, Staff Male/Female	Boy's Side Gym Office Restroom	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
6040	8	B604001-1	1	G10	Restrooms, Staff - Male/Female	Boy's Side Gym Office Restroom	yes	Door Case	Metal	Green	Friction	1	0.12	Negative
6040	8	B604001-1	1	G10	Restrooms, Staff - Male/Female	Boy's Side Gym Office Restroom	yes	W1	Concrete	Yellow	None	0	0	Negative
6040	8	B604001-1	1	G10	Restrooms, Staff - Male/Female	Boy's Side Gym Office Restroom	yes	W2	Concrete	Yellow	None	0	0	Negative

					Dates: 9/12/22 - 10/4/22		Lead-Safe Certification Assessment Report							
					Inspector Name and Certificate Number: Jennifer Drialo-006767/ Steve Merlino- 006800		6040 Walter Biddle Saul HS/Manatawna Farm							
					Inspection Company: Synertech		7100 Henry Avenue, Philadelphia, PA 19128							
ULCS#	Element	BldgElmt ID	Floor	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
6040	8	B604001-1	1	G10	Restrooms, Staff - Male/Female	Boy's Side Gym Office Restroom	yes	W3	Concrete	Yellow	None	0	0	Negative
6040	8	B604001-1	1	G10	Restrooms, Staff - Male/Female	Boy's Side Gym Office Restroom	yes	W4	Concrete	Yellow	None	0	0	Negative
6040	8	B604001-1	1	G10	Restrooms, Staff - Male/Female	Boy's Side Gym Office Restroom	yes	Ceiling	Plaster	White	None	0	0	Negative
6040	8	B604001-1	1	G11	Mechanical Room	Boy's Side Gym Pump Room	yes	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
6040	8	B604001-1	1	G11	Mechanical Room	Boy's Side Gym Pump Room	yes	W1	Concrete	N/A	N/A	N/A	N/A	N/A
6040	8	B604001-1	1	G11	Mechanical Room	Boy's Side Gym Pump Room	yes	W2	Concrete	N/A	N/A	N/A	N/A	N/A
6040	8	B604001-1	1	G11	Mechanical Room	Boy's Side Gym Pump Room	yes	Pump	Metal	Green	None	0	0.14	Negative
6040	8	B604001-1	1	G11	Mechanical Room	Boy's Side Gym Pump Room	yes	Stairs	Metal	Green	None	0	0	Negative
6040	8	B604001-1	1	G11	Mechanical Room	Boy's Side Gym Pump Room	yes	W3	Concrete	N/A	N/A	N/A	N/A	N/A
6040	8	B604001-1	1	G11	Mechanical Room	Boy's Side Gym Pump Room	yes	W4	Concrete	N/A	N/A	N/A	N/A	N/A
6040	8	B604001-1	1	G11	Mechanical Room	Boy's Side Gym Pump Room	yes	Ceiling	Metal	N/A	N/A	N/A	N/A	N/A
6040	8	B604001-1	1	H3A	Service Closets	Custodial Closet outside Gym	yes	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
6040	8	B604001-1	1	H3A	Service Closets	Custodial Closet outside Gym	yes	Door Case	Metal	Tan	None	0	0	Negative
6040	8	B604001-1	1	H3A	Service Closets	Custodial Closet outside Gym	yes	W1	Concrete	N/A	N/A	N/A	N/A	N/A
6040	8	B604001-1	1	H3A	Service Closets	Custodial Closet outside Gym	yes	W2	Concrete	N/A	N/A	N/A	N/A	N/A
6040	8	B604001-1	1	H3A	Service Closets	Custodial Closet outside Gym	yes	W3	Concrete	N/A	N/A	N/A	N/A	N/A
6040	8	B604001-1	1	H3A	Service Closets	Custodial Closet outside Gym	yes	W4	Concrete	N/A	N/A	N/A	N/A	N/A
6040	8	B604001-1	1	H3A	Service Closets	Custodial Closet outside Gym	yes	Ceiling	Metal	N/A	N/A	N/A	N/A	N/A
6040	8	B604001-1	1	G6	Administrative Office	Girl's Side Gym Office	yes	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
6040	8	B604001-1	1	G6	Administrative Office	Girl's Side Gym Office	yes	Door Case	Metal	Yellow	None	0	0	Negative
6040	8	B604001-1	1	G6	Administrative Office	Girl's Side Gym Office	yes	W1	Concrete	Yellow	None	0	0	Negative
6040	8	B604001-1	1	G6	Administrative Office	Girl's Side Gym Office	yes	W2	Concrete	Yellow	None	0	0	Negative
6040	8	B604001-1	1	G6	Administrative Office	Girl's Side Gym Office	yes	W3	Concrete	Yellow	None	0	0	Negative
6040	8	B604001-1	1	G6	Administrative Office	Girl's Side Gym Office	yes	W4	Concrete	Yellow	None	0	0	Negative
6040	8	B604001-1	1	G6	Administrative Office	Girl's Side Gym Office	yes	Ceiling	Metal	N/A	N/A	N/A	N/A	N/A
6040	8	B604001-1	1	G8	Restrooms, Staff - Male/Female	Girl's Side Gym Office Restroom	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
6040	8	B604001-1	1	G8	Restrooms, Staff - Male/Female	Girl's Side Gym Office Restroom	yes	Door Case	Metal	Green	Friction	3	0.1	Negative
6040	8	B604001-1	1	G8	Restrooms, Staff - Male/Female	Girl's Side Gym Office Restroom	yes	W1	Concrete	Yellow	None	0	0	Negative

					Dates: 9/12/22 - 10/4/22		Lead-Safe Certification Assessment Report							
					Inspector Name and Certificate Number: Jennifer Drialo-006767/ Steve Merlino- 006800		6040 Walter Biddle Saul HS/Manatawna Farm							
					Inspection Company: Synertech		7100 Henry Avenue, Philadelphia, PA 19128							
ULCS#	Element	BldgElmt ID	Floor	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
6040	8	B604001-1	1	G8	Restrooms, Staff - Male/Female	Girl's Side Gym Office Restroom	yes	W2	Concrete	Yellow	None	0	0	Negative
6040	8	B604001-1	1	G8	Restrooms, Staff - Male/Female	Girl's Side Gym Office Restroom	yes	W3	Concrete	Yellow	None	0	0	Negative
6040	8	B604001-1	1	G8	Restrooms, Staff - Male/Female	Girl's Side Gym Office Restroom	yes	W4	Concrete	Yellow	None	0	0	Negative
6040	8	B604001-1	1	G8	Restrooms, Staff - Male/Female	Girl's Side Gym Office Restroom	yes	Ceiling	Plaster	White	None	0	0	Negative
6040	8	B604001-1	1	G5	Storage	Girl's Side Gym Storage Room	yes	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
6040	8	B604001-1	1	G5	Storage	Girl's Side Gym Storage Room	yes	Door Case	Metal	Tan	None	0	0	Negative
6040	8	B604001-1	1	G5	Storage	Girl's Side Gym Storage Room	yes	W1	Concrete	Tan	None	0	0	Negative
6040	8	B604001-1	1	G5	Storage	Girl's Side Gym Storage Room	yes	W2	Concrete	Tan	None	0	0	Negative
6040	8	B604001-1	1	G5	Storage	Girl's Side Gym Storage Room	yes	W3	Concrete	Tan	None	0	0	Negative
6040	8	B604001-1	1	G5	Storage	Girl's Side Gym Storage Room	yes	W4	Concrete	Tan	None	0	0	Negative
6040	8	B604001-1	1	G5	Storage	Girl's Side Gym Storage Room	yes	Ceiling	Metal	N/A	N/A	N/A	N/A	N/A
6040	8	B604001-1	1	G7	Gymnasium - Senior High	Gym	yes	Floor	Wood	N/A	N/A	N/A	N/A	N/A
6040	8	B604001-1	1	G7	Gymnasium - Senior High	Gym	yes	W1	Concrete	White	None	0	0	Negative
6040	8	B604001-1	1	G7	Gymnasium - Senior High	Gym	yes	W1	Concrete	Tan	None	0	0	Negative
6040	8	B604001-1	1	G7	Gymnasium - Senior High	Gym	yes	W2	Concrete	White	None	0	0	Negative
6040	8	B604001-1	1	G7	Gymnasium - Senior High	Gym	yes	W2	Concrete	Tan	None	0	0	Negative
6040	8	B604001-1	1	G7	Gymnasium - Senior High	Gym	yes	W3	Concrete	White	None	0	0	Negative
6040	8	B604001-1	1	G7	Gymnasium - Senior High	Gym	yes	W3	Concrete	Tan	None	0	0	Negative
6040	8	B604001-1	1	G7	Gymnasium - Senior High	Gym	yes	W4	Concrete	White	None	0	0	Negative
6040	8	B604001-1	1	G7	Gymnasium - Senior High	Gym	yes	W4	Concrete	Tan	None	0	0	Negative
6040	8	B604001-1	1	G7	Gymnasium - Senior High	Gym	yes	Beam	Metal	Brown	No Access	N/A	N/A	No Access
6040	8	B604001-1	1	G7	Gymnasium - Senior High	Gym	yes	Ceiling	Metal	N/A	N/A	N/A	N/A	N/A
6040	8	B604001-1	1	H2	Circulation (Hallway)	Hallway outside Gym	yes	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
6040	8	B604001-1	1	H2	Circulation (Hallway)	Hallway outside Gym	yes	W1	Concrete	Tan	None	0	0	Negative
6040	8	B604001-1	1	H2	Circulation (Hallway)	Hallway outside Gym	yes	W2	Concrete	Tan	None	0	0	Negative
6040	8	B604001-1	1	H2	Circulation (Hallway)	Hallway outside Gym	yes	W3	Concrete	Tan	None	0	0	Negative
6040	8	B604001-1	1	H2	Circulation (Hallway)	Hallway outside Gym	yes	W4	Concrete	Tan	None	0	0	Negative
6040	8	B604001-1	1	H2	Circulation (Hallway)	Hallway outside Gym	yes	Ceiling	Metal	N/A	N/A	N/A	N/A	N/A
6040	8	B604001-1	1	H2-8	Circulation (Hallway)	Hallway outside Men's and Women's Restrooms	yes	Floor	Concrete	N/A	N/A	N/A	N/A	N/A

					Dates: 9/12/22 - 10/4/22		Lead-Safe Certification Assessment Report							
					Inspector Name and Certificate Number: Jennifer Drialo-006767/ Steve Merlino- 006800		6040 Walter Biddle Saul HS/Manatawna Farm							
					Inspection Company: Synertech		7100 Henry Avenue, Philadelphia, PA 19128							
ULCS#	E l e m e n t	BldgElmt ID	F l o o r	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/ negative)
6040	8	B604001-1	1	H2-8	Circulation (Hallway)	Hallway outside Men's and Women's Restrooms	yes	W1	Concrete	Tan	None	0	0	Negative
6040	8	B604001-1	1	H2-8	Circulation (Hallway)	Hallway outside Men's and Women's Restrooms	yes	W2	Concrete	Tan	None	0	0	Negative
6040	8	B604001-1	1	H2-8	Circulation (Hallway)	Hallway outside Men's and Women's Restrooms	yes	W3	Concrete	Tan	None	0	0	Negative
6040	8	B604001-1	1	H2-8	Circulation (Hallway)	Hallway outside Men's and Women's Restrooms	yes	W4	Concrete	Tan	None	0	0	Negative
6040	8	B604001-1	1	H2-8	Circulation (Hallway)	Hallway outside Men's and Women's Restrooms	yes	Ceiling	Metal	N/A	N/A	N/A	N/A	N/A
6040	8	B604001-1	1	G15	Senior High	Health Classroom	yes	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
6040	8	B604001-1	1	G15	Senior High	Health Classroom	yes	Door Case	Metal	Tan	None	0	0	Negative
6040	8	B604001-1	1	G15	Senior High	Health Classroom	yes	W1	Concrete	Yellow	None	0	0	Negative
6040	8	B604001-1	1	G15	Senior High	Health Classroom	yes	W2	Concrete	Yellow	None	0	0	Negative
6040	8	B604001-1	1	G15	Senior High	Health Classroom	yes	W3	Concrete	Yellow	None	0	0	Negative
6040	8	B604001-1	1	G15	Senior High	Health Classroom	yes	W4	Concrete	Yellow	None	0	0	Negative
6040	8	B604001-1	1	G15	Senior High	Health Classroom	yes	Ceiling	Metal	N/A	N/A	N/A	N/A	N/A
6040	8	B604001-1	1	H1	Circulation (Hallway)	Main Entrance Lobby	yes	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
6040	8	B604001-1	1	H1	Circulation (Hallway)	Main Entrance Lobby	yes	Door	Metal	Blue	None	0	0	Negative
6040	8	B604001-1	1	H1	Circulation (Hallway)	Main Entrance Lobby	yes	Door Case	Metal	Blue	None	0	0	Negative
6040	8	B604001-1	1	H1	Circulation (Hallway)	Main Entrance Lobby	yes	W1	Concrete	Tan	None	0	0	Negative
6040	8	B604001-1	1	H1	Circulation (Hallway)	Main Entrance Lobby	yes	W2	Concrete	Tan	None	0	0	Negative
6040	8	B604001-1	1	H1	Circulation (Hallway)	Main Entrance Lobby	yes	W3	Concrete	Tan	None	0	0	Negative
6040	8	B604001-1	1	H1	Circulation (Hallway)	Main Entrance Lobby	yes	W4	Concrete	Tan	None	0	0	Negative
6040	8	B604001-1	1	H1	Circulation (Hallway)	Main Entrance Lobby	yes	Ceiling	Metal	N/A	N/A	N/A	N/A	N/A
6040	8	B604001-1	1	G12	Lockers - Male	Men's Locker Room	yes	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
6040	8	B604001-1	1	G12	Lockers - Male	Men's Locker Room	yes	Door Case	Metal	Tan	Friction	4	0	Negative
6040	8	B604001-1	1	G12	Lockers - Male	Men's Locker Room	yes	W1	Concrete	Yellow	None	0	0	Negative
6040	8	B604001-1	1	G12	Lockers - Male	Men's Locker Room	yes	W2	Concrete	Yellow	None	0	0	Negative
6040	8	B604001-1	1	G12	Lockers - Male	Men's Locker Room	yes	W3	Concrete	Yellow	None	0	0	Negative
6040	8	B604001-1	1	G12	Lockers - Male	Men's Locker Room	yes	W4	Concrete	Yellow	None	0	0	Negative
6040	8	B604001-1	1	G12	Lockers - Male	Men's Locker Room	yes	Ceiling	Plaster	White	None	0	0	Negative
6040	8	B604001-1	1	G12A	Pipe Chase	Men's Locker Room Pipe Chase	yes	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
6040	8	B604001-1	1	G12A	Pipe Chase	Men's Locker Room Pipe Chase	yes	W1	Concrete	N/A	N/A	N/A	N/A	N/A
6040	8	B604001-1	1	G12A	Pipe Chase	Men's Locker Room Pipe Chase	yes	W2	Concrete	N/A	N/A	N/A	N/A	N/A
6040	8	B604001-1	1	G12A	Pipe Chase	Men's Locker Room Pipe Chase	yes	W3	Concrete	N/A	N/A	N/A	N/A	N/A
6040	8	B604001-1	1	G12A	Pipe Chase	Men's Locker Room Pipe Chase	yes	W4	Concrete	N/A	N/A	N/A	N/A	N/A
6040	8	B604001-1	1	G12A	Pipe Chase	Men's Locker Room Pipe Chase	yes	Ceiling	Concrete	N/A	N/A	N/A	N/A	N/A
6040	8	B604001-1	1	G14	Student Restrooms - Male (4-12)	Men's Locker Room Restroom	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
6040	8	B604001-1	1	G14	Student Restrooms - Male (4-12)	Men's Locker Room Restroom	yes	W1	Concrete	White	None	0	0	Negative

					Dates: 9/12/22 - 10/4/22		Lead-Safe Certification Assessment Report							
					Inspector Name and Certificate Number: Jennifer Drialo-006767/ Steve Merlino- 006800		6040 Walter Biddle Saul HS/Manatawna Farm							
					Inspection Company: Synertech		7100 Henry Avenue, Philadelphia, PA 19128							
ULCS#	E l e m e n t	BldgElmt ID	F l o o r	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/ negative)
6040	8	B604001-1	1	G14	Student Restrooms - Male (4-12)	Men's Locker Room Restroom	yes	W1	Concrete	Green	None	0	0	Negative
6040	8	B604001-1	1	G14	Student Restrooms - Male (4-12)	Men's Locker Room Restroom	yes	W2	Concrete	White	None	0	0	Negative
6040	8	B604001-1	1	G14	Student Restrooms - Male (4-12)	Men's Locker Room Restroom	yes	W2	Concrete	Green	None	0	0	Negative
6040	8	B604001-1	1	G14	Student Restrooms - Male (4-12)	Men's Locker Room Restroom	yes	W3	Concrete	White	None	0	0	Negative
6040	8	B604001-1	1	G14	Student Restrooms - Male (4-12)	Men's Locker Room Restroom	yes	W3	Concrete	Green	None	0	0	Negative
6040	8	B604001-1	1	G14	Student Restrooms - Male (4-12)	Men's Locker Room Restroom	yes	W4	Concrete	White	None	0	0	Negative
6040	8	B604001-1	1	G14	Student Restrooms - Male (4-12)	Men's Locker Room Restroom	yes	W4	Concrete	Green	None	0	0	Negative
6040	8	B604001-1	1	G14	Student Restrooms - Male (4-12)	Men's Locker Room Restroom	yes	Ceiling	Plaster	White	None	0	0	Negative
6040	8	B604001-1	1	G13	Showers - Male	Men's Locker Room Showers	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
6040	8	B604001-1	1	G13	Showers - Male	Men's Locker Room Showers	yes	W1	Concrete	Green	None	0	0	Negative
6040	8	B604001-1	1	G13	Showers - Male	Men's Locker Room Showers	yes	W2	Concrete	Green	None	0	0	Negative
6040	8	B604001-1	1	G13	Showers - Male	Men's Locker Room Showers	yes	W3	Concrete	Green	None	0	0	Negative
6040	8	B604001-1	1	G13	Showers - Male	Men's Locker Room Showers	yes	W4	Concrete	Green	None	0	0	Negative
6040	8	B604001-1	1	G13	Showers - Male	Men's Locker Room Showers	yes	Ceiling	Plaster	White	None	0	0	Negative
6040	8	B604001-1	1	G7A	Circulation (Hallway)	Men's Locker Room Vestibule	yes	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
6040	8	B604001-1	1	G7A	Circulation (Hallway)	Men's Locker Room Vestibule	yes	W1	Concrete	Yellow	None	0	0	Negative
6040	8	B604001-1	1	G7A	Circulation (Hallway)	Men's Locker Room Vestibule	yes	W2	Concrete	Yellow	None	0	0	Negative
6040	8	B604001-1	1	G7A	Circulation (Hallway)	Men's Locker Room Vestibule	yes	W3	Concrete	Yellow	None	0	0	Negative
6040	8	B604001-1	1	G7A	Circulation (Hallway)	Men's Locker Room Vestibule	yes	W4	Concrete	Yellow	None	0	0	Negative
6040	8	B604001-1	1	G7A	Circulation (Hallway)	Men's Locker Room Vestibule	yes	Ceiling	Plaster	White	None	0	0	Negative
6040	8	B604001-1	1	G25	Restrooms, Staff - Male	Men's Restroom	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
6040	8	B604001-1	1	G25	Restrooms, Staff - Male	Men's Restroom	yes	Door Case	Metal	Tan	Friction	1	0.12	Negative
6040	8	B604001-1	1	G25	Restrooms, Staff - Male	Men's Restroom	yes	W1	Concrete	Tan	None	0	0	Negative
6040	8	B604001-1	1	G25	Restrooms, Staff - Male	Men's Restroom	yes	W2	Concrete	Tan	None	0	0	Negative
6040	8	B604001-1	1	G25	Restrooms, Staff - Male	Men's Restroom	yes	W3	Concrete	Tan	None	0	0	Negative
6040	8	B604001-1	1	G25	Restrooms, Staff - Male	Men's Restroom	yes	W4	Concrete	Tan	None	0	0	Negative

					Dates: 9/12/22 - 10/4/22		Lead-Safe Certification Assessment Report							
					Inspector Name and Certificate Number: Jennifer Drialo-006767/ Steve Merlino- 006800		6040 Walter Biddle Saul HS/Manatawna Farm							
					Inspection Company: Synertech		7100 Henry Avenue, Philadelphia, PA 19128							
ULCS#	Element	BldgElmt ID	Floor	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
6040	8	B604001-1	1	G25	Restrooms, Staff - Male	Men's Restroom	yes	Ceiling	Plaster	White	None	0	0	Negative
6040	8	B604001-1	1	G18	Administrative Office	Social Worker Suite Common Area	yes	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
6040	8	B604001-1	1	G18	Administrative Office	Social Worker Suite Common Area	yes	Door Case	Metal	Blue	None	0	0	Negative
6040	8	B604001-1	1	G18	Administrative Office	Social Worker Suite Common Area	yes	W1	Concrete	Blue	None	0	0	Negative
6040	8	B604001-1	1	G18	Administrative Office	Social Worker Suite Common Area	yes	W2	Concrete	Blue	None	0	0	Negative
6040	8	B604001-1	1	G18	Administrative Office	Social Worker Suite Common Area	yes	W3	Concrete	Blue	None	0	0	Negative
6040	8	B604001-1	1	G18	Administrative Office	Social Worker Suite Common Area	yes	W4	Concrete	Blue	None	0	0	Negative
6040	8	B604001-1	1	G18	Administrative Office	Social Worker Suite Common Area	yes	Ceiling	Metal	N/A	N/A	N/A	N/A	N/A
6040	8	B604001-1	1	G17	Administrative Office	Social Worker Suite Entrance Office	yes	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
6040	8	B604001-1	1	G17	Administrative Office	Social Worker Suite Entrance Office	yes	Door Case	Metal	Tan	None	0	0	Negative
6040	8	B604001-1	1	G17	Administrative Office	Social Worker Suite Entrance Office	yes	W1	Concrete	White	None	0	0	Negative
6040	8	B604001-1	1	G17	Administrative Office	Social Worker Suite Entrance Office	yes	W2	Concrete	White	None	0	0	Negative
6040	8	B604001-1	1	G17	Administrative Office	Social Worker Suite Entrance Office	yes	W3	Concrete	White	None	0	0	Negative
6040	8	B604001-1	1	G17	Administrative Office	Social Worker Suite Entrance Office	yes	W4	Concrete	White	None	0	0	Negative
6040	8	B604001-1	1	G17	Administrative Office	Social Worker Suite Entrance Office	yes	Ceiling	Metal	N/A	N/A	N/A	N/A	N/A
6040	8	B604001-1	1	G23	Restrooms, Staff - Male	Social Worker Suite Men's Restroom	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
6040	8	B604001-1	1	G23	Restrooms, Staff - Male	Social Worker Suite Men's Restroom	yes	Door Case	Metal	Blue	None	0	0	Negative
6040	8	B604001-1	1	G23	Restrooms, Staff - Male	Social Worker Suite Men's Restroom	yes	W1	Concrete	Yellow	None	0	0	Negative
6040	8	B604001-1	1	G23	Restrooms, Staff - Male	Social Worker Suite Men's Restroom	yes	W2	Concrete	Yellow	None	0	0	Negative
6040	8	B604001-1	1	G23	Restrooms, Staff - Male	Social Worker Suite Men's Restroom	yes	W3	Concrete	Yellow	None	0	0	Negative
6040	8	B604001-1	1	G23	Restrooms, Staff - Male	Social Worker Suite Men's Restroom	yes	W4	Concrete	Yellow	None	0	0	Negative
6040	8	B604001-1	1	G23	Restrooms, Staff - Male	Social Worker Suite Men's Restroom	yes	Ceiling	Metal	N/A	N/A	N/A	N/A	N/A
6040	8	B604001-1	1	G20	Administrative Office	Social Worker Suite Office adjacent to Closet	yes	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
6040	8	B604001-1	1	G20	Administrative Office	Social Worker Suite Office adjacent to Closet	yes	Door Case	Metal	Blue	None	0	0.1	Negative
6040	8	B604001-1	1	G20	Administrative Office	Social Worker Suite Office adjacent to Closet	yes	W1	Concrete	Yellow	None	0	0	Negative
6040	8	B604001-1	1	G20	Administrative Office	Social Worker Suite Office adjacent to Closet	yes	W2	Concrete	Yellow	None	0	0	Negative
6040	8	B604001-1	1	G20	Administrative Office	Social Worker Suite Office adjacent to Closet	yes	W3	Concrete	Yellow	None	0	0	Negative

					Dates: 9/12/22 - 10/4/22		Lead-Safe Certification Assessment Report							
					Inspector Name and Certificate Number: Jennifer Drialo-006767/ Steve Merlino- 006800		6040 Walter Biddle Saul HS/Manatawna Farm							
					Inspection Company: Synertech		7100 Henry Avenue, Philadelphia, PA 19128							
ULCS#	Element	BldgElmt ID	Floor	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
6040	8	B604001-1	1	G20	Administrative Office	Social Worker Suite Office adjacent to Closet	yes	W4	Concrete	Yellow	None	0	0	Negative
6040	8	B604001-1	1	G20	Administrative Office	Social Worker Suite Office adjacent to Closet	yes	Ceiling	Metal	N/A	N/A	N/A	N/A	N/A
6040	8	B604001-1	1	G16	Administrative Office	Social Worker Suite Office adjacent to Women's Restroom	yes	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
6040	8	B604001-1	1	G16	Administrative Office	Social Worker Suite Office adjacent to Women's Restroom	yes	Door Case	Metal	Tan	None	0	0	Negative
6040	8	B604001-1	1	G16	Administrative Office	Social Worker Suite Office adjacent to Women's Restroom	yes	W1	Concrete	White	None	0	0	Negative
6040	8	B604001-1	1	G16	Administrative Office	Social Worker Suite Office adjacent to Women's Restroom	yes	W2	Concrete	White	None	0	0	Negative
6040	8	B604001-1	1	G16	Administrative Office	Social Worker Suite Office adjacent to Women's Restroom	yes	Pipe	Metal	White	Chipping	2	0.14	Negative
6040	8	B604001-1	1	G16	Administrative Office	Social Worker Suite Office adjacent to Women's Restroom	yes	W3	Concrete	White	None	0	0	Negative
6040	8	B604001-1	1	G16	Administrative Office	Social Worker Suite Office adjacent to Women's Restroom	yes	W4	Concrete	White	None	0	0	Negative
6040	8	B604001-1	1	G16	Administrative Office	Social Worker Suite Office adjacent to Women's Restroom	yes	Ceiling	Metal	N/A	N/A	N/A	N/A	N/A
6040	8	B604001-1	1	G21	Storage	Social Worker Suite Office Closet	yes	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
6040	8	B604001-1	1	G21	Storage	Social Worker Suite Office Closet	yes	Door Case	Metal	Tan	Friction	2	0.12	Negative
6040	8	B604001-1	1	G21	Storage	Social Worker Suite Office Closet	yes	W1	Concrete	Tan	None	0	0	Negative
6040	8	B604001-1	1	G21	Storage	Social Worker Suite Office Closet	yes	W2	Concrete	Tan	None	0	0	Negative
6040	8	B604001-1	1	G21	Storage	Social Worker Suite Office Closet	yes	Shelf	Wood	Tan	None	0	0	Negative
6040	8	B604001-1	1	G21	Storage	Social Worker Suite Office Closet	yes	W3	Concrete	Tan	None	0	0	Negative
6040	8	B604001-1	1	G21	Storage	Social Worker Suite Office Closet	yes	W4	Concrete	Tan	None	0	0	Negative
6040	8	B604001-1	1	G21	Storage	Social Worker Suite Office Closet	yes	Ceiling	Metal	N/A	N/A	N/A	N/A	N/A
6040	8	B604001-1	1	G19	Administrative Office	Social Worker Suite Rear Corner Office	yes	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
6040	8	B604001-1	1	G19	Administrative Office	Social Worker Suite Rear Corner Office	yes	Door Case	Metal	Blue	None	0	0	Negative
6040	8	B604001-1	1	G19	Administrative Office	Social Worker Suite Rear Corner Office	yes	W1	Concrete	Blue	None	0	0	Negative
6040	8	B604001-1	1	G19	Administrative Office	Social Worker Suite Rear Corner Office	yes	W2	Concrete	Blue	None	0	0	Negative
6040	8	B604001-1	1	G19	Administrative Office	Social Worker Suite Rear Corner Office	yes	W3	Concrete	Blue	None	0	0	Negative
6040	8	B604001-1	1	G19	Administrative Office	Social Worker Suite Rear Corner Office	yes	W4	Concrete	Blue	None	0	0	Negative
6040	8	B604001-1	1	G19	Administrative Office	Social Worker Suite Rear Corner Office	yes	Ceiling	Metal	N/A	N/A	N/A	N/A	N/A
6040	8	B604001-1	1	G22	Storage	Social Worker Suite Storage Room adjacent to Men's Restroom	yes	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
6040	8	B604001-1	1	G22	Storage	Social Worker Suite Storage Room adjacent to Men's Restroom	yes	Door Case	Metal	Blue	None	0	0	Negative
6040	8	B604001-1	1	G22	Storage	Social Worker Suite Storage Room adjacent to Men's Restroom	yes	W1	Concrete	Blue	None	0	0	Negative
6040	8	B604001-1	1	G22	Storage	Social Worker Suite Storage Room adjacent to Men's Restroom	yes	W2	Concrete	Blue	None	0	0	Negative
6040	8	B604001-1	1	G22	Storage	Social Worker Suite Storage Room adjacent to Men's Restroom	yes	W3	Concrete	Blue	None	0	0	Negative
6040	8	B604001-1	1	G22	Storage	Social Worker Suite Storage Room adjacent to Men's Restroom	yes	W4	Concrete	Blue	None	0	0	Negative

					Dates: 9/12/22 - 10/4/22		Lead-Safe Certification Assessment Report							
					Inspector Name and Certificate Number: Jennifer Drialo-006767/ Steve Merlino- 006800		6040 Walter Biddle Saul HS/Manatawna Farm							
					Inspection Company: Synertech		7100 Henry Avenue, Philadelphia, PA 19128							
ULCS#	E l e m e n t	BldgElmt ID	F l o o r	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/ negative)
6040	8	B604001-1	1	G22	Storage	Social Worker Suite Storage Room adjacent to Men's Restroom	yes	Ceiling	Metal	N/A	N/A	N/A	N/A	N/A
6040	8	B604001-1	1	G24	Restrooms, Staff - Female	Social Worker Suite Women's Restroom	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
6040	8	B604001-1	1	G24	Restrooms, Staff - Female	Social Worker Suite Women's Restroom	yes	Door Case	Metal	Blue	None	0	0	Negative
6040	8	B604001-1	1	G24	Restrooms, Staff - Female	Social Worker Suite Women's Restroom	yes	W1	Concrete	Tan	None	0	0	Negative
6040	8	B604001-1	1	G24	Restrooms, Staff - Female	Social Worker Suite Women's Restroom	yes	W2	Concrete	Tan	None	0	0	Negative
6040	8	B604001-1	1	G24	Restrooms, Staff - Female	Social Worker Suite Women's Restroom	yes	W3	Concrete	Tan	None	0	0	Negative
6040	8	B604001-1	1	G24	Restrooms, Staff - Female	Social Worker Suite Women's Restroom	yes	W4	Concrete	Tan	None	0	0	Negative
6040	8	B604001-1	1	G24	Restrooms, Staff - Female	Social Worker Suite Women's Restroom	yes	Ceiling	Metal	N/A	N/A	N/A	N/A	N/A
6040	8	B604001-1	1	G1	Lockers - Female	Women's Locker Room	yes	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
6040	8	B604001-1	1	G1	Lockers - Female	Women's Locker Room	yes	Door Case	Metal	Tan	None	0	0	Negative
6040	8	B604001-1	1	G1	Lockers - Female	Women's Locker Room	yes	W1	Concrete	Yellow	None	0	0	Negative
6040	8	B604001-1	1	G1	Lockers - Female	Women's Locker Room	yes	W2	Concrete	Yellow	None	0	0	Negative
6040	8	B604001-1	1	G1	Lockers - Female	Women's Locker Room	yes	W3	Concrete	Yellow	None	0	0	Negative
6040	8	B604001-1	1	G1	Lockers - Female	Women's Locker Room	yes	W4	Concrete	Yellow	None	0	0	Negative
6040	8	B604001-1	1	G1	Lockers - Female	Women's Locker Room	yes	Ceiling	Plaster	N/A	N/A	N/A	N/A	N/A
6040	8	B604001-1	1	G3	Showers - Female	Women's Locker Room Large Showers	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
6040	8	B604001-1	1	G3	Showers - Female	Women's Locker Room Large Showers	yes	W1	Ceramic Tile	N/A	N/A	N/A	N/A	N/A
6040	8	B604001-1	1	G3	Showers - Female	Women's Locker Room Large Showers	yes	W2	Ceramic Tile	N/A	N/A	N/A	N/A	N/A
6040	8	B604001-1	1	G3	Showers - Female	Women's Locker Room Large Showers	yes	W3	Ceramic Tile	N/A	N/A	N/A	N/A	N/A
6040	8	B604001-1	1	G3	Showers - Female	Women's Locker Room Large Showers	yes	W4	Ceramic Tile	N/A	N/A	N/A	N/A	N/A
6040	8	B604001-1	1	G3	Showers - Female	Women's Locker Room Large Showers	yes	Ceiling	Plaster	White	None	0	0	Negative
6040	8	B604001-1	1	G2	Student Restrooms - Female (4-12)	Women's Locker Room Restroom	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
6040	8	B604001-1	1	G2	Student Restrooms - Female (4-12)	Women's Locker Room Restroom	yes	W1	Concrete	Yellow	None	0	0	Negative
6040	8	B604001-1	1	G2	Student Restrooms - Female (4-12)	Women's Locker Room Restroom	yes	W2	Concrete	Yellow	None	0	0	Negative
6040	8	B604001-1	1	G2	Student Restrooms - Female (4-12)	Women's Locker Room Restroom	yes	W3	Concrete	Yellow	None	0	0	Negative

					Dates: 9/12/22 - 10/4/22		Lead-Safe Certification Assessment Report							
					Inspector Name and Certificate Number: Jennifer Drialo-006767/ Steve Merlino- 006800		6040 Walter Biddle Saul HS/Manatawna Farm							
					Inspection Company: Synertech		7100 Henry Avenue, Philadelphia, PA 19128							
ULCS#	Element	BldgElmt ID	Floor	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
6040	8	B604001-1	1	G2	Student Restrooms - Female (4-12)	Women's Locker Room Restroom	yes	W4	Concrete	Yellow	None	0	0	Negative
6040	8	B604001-1	1	G2	Student Restrooms - Female (4-12)	Women's Locker Room Restroom	yes	Ceiling	Plaster	White	None	0	0	Negative
6040	8	B604001-1	1	G4	Showers - Female	Women's Locker Room Small Showers	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
6040	8	B604001-1	1	G4	Showers - Female	Women's Locker Room Small Showers	yes	W1	Ceramic Tile	N/A	N/A	N/A	N/A	N/A
6040	8	B604001-1	1	G4	Showers - Female	Women's Locker Room Small Showers	yes	W2	Ceramic Tile	N/A	N/A	N/A	N/A	N/A
6040	8	B604001-1	1	G4	Showers - Female	Women's Locker Room Small Showers	yes	W3	Ceramic Tile	N/A	N/A	N/A	N/A	N/A
6040	8	B604001-1	1	G4	Showers - Female	Women's Locker Room Small Showers	yes	W4	Ceramic Tile	N/A	N/A	N/A	N/A	N/A
6040	8	B604001-1	1	G4	Showers - Female	Women's Locker Room Small Showers	yes	Ceiling	Plaster	White	None	0	0	Negative
6040	8	B604001-1	1	G1A	Circulation (Hallway)	Women's Locker Room Vestibule/Hallway	yes	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
6040	8	B604001-1	1	G1A	Circulation (Hallway)	Women's Locker Room Vestibule/Hallway	yes	W1	Concrete	Yellow	None	0	0	Negative
6040	8	B604001-1	1	G1A	Circulation (Hallway)	Women's Locker Room Vestibule/Hallway	yes	W2	Concrete	Yellow	None	0	0	Negative
6040	8	B604001-1	1	G1A	Circulation (Hallway)	Women's Locker Room Vestibule/Hallway	yes	W3	Concrete	Yellow	None	0	0	Negative
6040	8	B604001-1	1	G1A	Circulation (Hallway)	Women's Locker Room Vestibule/Hallway	yes	W4	Concrete	Yellow	None	0	0	Negative
6040	8	B604001-1	1	G1A	Circulation (Hallway)	Women's Locker Room Vestibule/Hallway	yes	Ceiling	Plaster	White	None	0	0	Negative
6040	8	B604001-1	1	G1B	Pipe Chase	Women's Locker Room Vestibule/Hallway Pipe Chase	no	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
6040	8	B604001-1	1	G1B	Pipe Chase	Women's Locker Room Vestibule/Hallway Pipe Chase	no	W1	Concrete	N/A	N/A	N/A	N/A	N/A
6040	8	B604001-1	1	G1B	Pipe Chase	Women's Locker Room Vestibule/Hallway Pipe Chase	no	W2	Concrete	N/A	N/A	N/A	N/A	N/A
6040	8	B604001-1	1	G1B	Pipe Chase	Women's Locker Room Vestibule/Hallway Pipe Chase	no	W3	Concrete	N/A	N/A	N/A	N/A	N/A
6040	8	B604001-1	1	G1B	Pipe Chase	Women's Locker Room Vestibule/Hallway Pipe Chase	no	W4	Concrete	N/A	N/A	N/A	N/A	N/A
6040	8	B604001-1	1	G1B	Pipe Chase	Women's Locker Room Vestibule/Hallway Pipe Chase	no	Ceiling	Concrete	N/A	N/A	N/A	N/A	N/A
6040	8	B604001-1	1	G26	Restrooms, Staff - Female	Women's Restroom	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
6040	8	B604001-1	1	G26	Restrooms, Staff - Female	Women's Restroom	yes	Door Case	Metal	Green	None	0	0.1	Negative
6040	8	B604001-1	1	G26	Restrooms, Staff - Female	Women's Restroom	yes	W1	Concrete	Yellow	None	0	0	Negative
6040	8	B604001-1	1	G26	Restrooms, Staff - Female	Women's Restroom	yes	W2	Concrete	Yellow	None	0	0	Negative
6040	8	B604001-1	1	G26	Restrooms, Staff - Female	Women's Restroom	yes	Pipe	Metal	Yellow	None	0	0.18	Negative
6040	8	B604001-1	1	G26	Restrooms, Staff - Female	Women's Restroom	yes	W3	Concrete	Yellow	None	0	0	Negative

					Dates: 9/12/22 - 10/4/22		Lead-Safe Certification Assessment Report							
					Inspector Name and Certificate Number: Jennifer Drialo-006767/ Steve Merlino- 006800		6040 Walter Biddle Saul HS/Manatawna Farm							
					Inspection Company: Synertech		7100 Henry Avenue, Philadelphia, PA 19128							
ULCS#	Element	BldgElmt ID	Floor	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
6040	8	B604001-1	1	G26	Restrooms, Staff - Female	Women's Restroom	yes	W4	Concrete	Yellow	None	0	0	Negative
6040	8	B604001-1	1	G26	Restrooms, Staff - Female	Women's Restroom	yes	Ceiling	Plaster	White	None	0	0	Negative
6040	9	B604001-1	1	H19	Circulation (Hallway)	1st Floor Hallway	yes	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
6040	9	B604001-1	1	H19	Circulation (Hallway)	1st Floor Hallway	yes	Door	Metal	Brown	None	0	0	Negative
6040	9	B604001-1	1	H19	Circulation (Hallway)	1st Floor Hallway	yes	Door Case	Metal	Brown	Friction	5	0.14	Negative
6040	9	B604001-1	1	H19	Circulation (Hallway)	1st Floor Hallway	yes	W2	Concrete	Tan	None	0	0	Negative
6040	9	B604001-1	1	H19	Circulation (Hallway)	1st Floor Hallway	yes	W4	Concrete	Tan	None	0	0	Negative
6040	9	B604001-1	1	H19	Circulation (Hallway)	1st Floor Hallway	yes	Electric Panel	Metal	White	None	0	0	Negative
6040	9	B604001-1	1	H19	Circulation (Hallway)	1st Floor Hallway	yes	Ductwork	Metal	White	None	0	0.3	Negative
6040	9	B604001-1	1	H19	Circulation (Hallway)	1st Floor Hallway	yes	Ceiling	Plaster	White	None	0	0	Negative
6040	9	B604001-1	1	101-9	Space (Tech/Vo tech)	Front Small Animal Room to Left of Entrance	yes	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
6040	9	B604001-1	1	101-9	Space (Tech/Vo tech)	Front Small Animal Room to Left of Entrance	yes	Fire Door	Metal	White	Friction	2	0.12	Negative
6040	9	B604001-1	1	101-9	Space (Tech/Vo tech)	Front Small Animal Room to Left of Entrance	yes	W1	Concrete	White	Friction	4	0	Negative
6040	9	B604001-1	1	101-9	Space (Tech/Vo tech)	Front Small Animal Room to Left of Entrance	yes	W2	Concrete	White	Friction	5	0	Negative
6040	9	B604001-1	1	101-9	Space (Tech/Vo tech)	Front Small Animal Room to Left of Entrance	yes	W3	Concrete	White	Friction	3	0	Negative
6040	9	B604001-1	1	101-9	Space (Tech/Vo tech)	Front Small Animal Room to Left of Entrance	yes	W4	Concrete	White	Friction	4	0	Negative
6040	9	B604001-1	1	101-9	Space (Tech/Vo tech)	Front Small Animal Room to Left of Entrance	yes	Ceiling	Plaster	White	None	0	0	Negative
6040	9	B604001-1	1	102-9	Space (Tech/Vo tech)	Front Small Animal Room to Right of Entrance	yes	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
6040	9	B604001-1	1	102-9	Space (Tech/Vo tech)	Front Small Animal Room to Right of Entrance	yes	Fire Door	Metal	White	Friction	4	0.16	Negative
6040	9	B604001-1	1	102-9	Space (Tech/Vo tech)	Front Small Animal Room to Right of Entrance	yes	W1	Concrete	White	Friction	5	0	Negative
6040	9	B604001-1	1	102-9	Space (Tech/Vo tech)	Front Small Animal Room to Right of Entrance	yes	W2	Concrete	White	Friction	5	0	Negative
6040	9	B604001-1	1	102-9	Space (Tech/Vo tech)	Front Small Animal Room to Right of Entrance	yes	W3	Concrete	White	Friction	3	0	Negative
6040	9	B604001-1	1	102-9	Space (Tech/Vo tech)	Front Small Animal Room to Right of Entrance	yes	W4	Concrete	White	Friction	4	0	Negative
6040	9	B604001-1	1	102-9	Space (Tech/Vo tech)	Front Small Animal Room to Right of Entrance	yes	Ceiling	Plaster	White	None	0	0	Negative
6040	9	B604001-1	1	103-9	Space (Tech/Vo tech)	Rear Small Animal Room to Left of Entrance	yes	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
6040	9	B604001-1	1	103-9	Space (Tech/Vo tech)	Rear Small Animal Room to Left of Entrance	yes	Fire Door	Metal	White	Friction	1	0.4	Negative
6040	9	B604001-1	1	103-9	Space (Tech/Vo tech)	Rear Small Animal Room to Left of Entrance	yes	W1	Concrete	White	Friction	3	0	Negative

					Dates: 9/12/22 - 10/4/22		Lead-Safe Certification Assessment Report							
					Inspector Name and Certificate Number: Jennifer Drialo-006767/ Steve Merlino- 006800		6040 Walter Biddle Saul HS/Manatawna Farm							
					Inspection Company: Synertech		7100 Henry Avenue, Philadelphia, PA 19128							
ULCS#	Element	BldgElmt ID	Floor	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
6040	9	B604001-1	1	103-9	Space (Tech/Vo tech)	Rear Small Animal Room to Left of Entrance	yes	W2	Concrete	White	Friction	3	0	Negative
6040	9	B604001-1	1	103-9	Space (Tech/Vo tech)	Rear Small Animal Room to Left of Entrance	yes	W3	Concrete	White	Friction	5	0	Negative
6040	9	B604001-1	1	103-9	Space (Tech/Vo tech)	Rear Small Animal Room to Left of Entrance	yes	W4	Concrete	White	Friction	5	0	Negative
6040	9	B604001-1	1	103-9	Space (Tech/Vo tech)	Rear Small Animal Room to Left of Entrance	yes	Ceiling	Plaster	White	None	0	0	Negative
6040	9	B604001-1	1	104-9	Space (Tech/Vo tech)	Rear Small Animal Room to Right of Entrance	yes	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
6040	9	B604001-1	1	104-9	Space (Tech/Vo tech)	Rear Small Animal Room to Right of Entrance	yes	Fire Door	Metal	White	Friction	1	0.4	Negative
6040	9	B604001-1	1	104-9	Space (Tech/Vo tech)	Rear Small Animal Room to Right of Entrance	yes	W1	Concrete	White	Friction	2	0	Negative
6040	9	B604001-1	1	104-9	Space (Tech/Vo tech)	Rear Small Animal Room to Right of Entrance	yes	W2	Concrete	White	Friction	3	0	Negative
6040	9	B604001-1	1	104-9	Space (Tech/Vo tech)	Rear Small Animal Room to Right of Entrance	yes	W3	Concrete	White	Friction	2	0	Negative
6040	9	B604001-1	1	104-9	Space (Tech/Vo tech)	Rear Small Animal Room to Right of Entrance	yes	W4	Concrete	White	Friction	5	0	Negative
6040	9	B604001-1	1	104-9	Space (Tech/Vo tech)	Rear Small Animal Room to Right of Entrance	yes	Ceiling	Plaster	White	None	0	0	Negative
6040	9	B604001-1	2	200-9	Space (Tech/Vo tech)	Rabbit Room	yes	Floor	N/A	N/A	N/A	N/A	N/A	N/A
6040	9	B604001-1	2	200-9	Space (Tech/Vo tech)	Rabbit Room	yes	Door	Metal	Blue	None	0	0	Negative
6040	9	B604001-1	2	200-9	Space (Tech/Vo tech)	Rabbit Room	yes	Door Case	Metal	Blue	None	0	0	Negative
6040	9	B604001-1	2	200-9	Space (Tech/Vo tech)	Rabbit Room	yes	W1	Sheetrock	White	None	0	0	Negative
6040	9	B604001-1	2	200-9	Space (Tech/Vo tech)	Rabbit Room	yes	W2	Sheetrock	White	None	0	0	Negative
6040	9	B604001-1	2	200-9	Space (Tech/Vo tech)	Rabbit Room	yes	W3	Sheetrock	White	None	0	0	Negative
6040	9	B604001-1	2	200-9	Space (Tech/Vo tech)	Rabbit Room	yes	W4	Sheetrock	White	None	0	0	Negative
6040	9	B604001-1	2	200-9	Space (Tech/Vo tech)	Rabbit Room	yes	Ceiling	Wood	White	None	0	0	Negative
6040	9	B604001-1	2	200-9	Space (Tech/Vo tech)	Rabbit Room	yes	Awning	Wood	Blue	Flaking	15	30	Positive
6040	10	B604001-1	1	107-10	Electrical Room	Electrical Room	no	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
6040	10	B604001-1	1	107-10	Electrical Room	Electrical Room	no	Door	Metal	Brown	None	0	0	Negative
6040	10	B604001-1	1	107-10	Electrical Room	Electrical Room	no	Door Case	Metal	Brown	None	0	0.16	Negative
6040	10	B604001-1	1	107-10	Electrical Room	Electrical Room	no	W1	Concrete	White	None	0	0	Negative
6040	10	B604001-1	1	107-10	Electrical Room	Electrical Room	no	W2	Concrete	White	None	0	0	Negative
6040	10	B604001-1	1	107-10	Electrical Room	Electrical Room	no	W3	Concrete	White	None	0	0	Negative
6040	10	B604001-1	1	107-10	Electrical Room	Electrical Room	no	W4	Concrete	White	None	0	0	Negative
6040	10	B604001-1	1	107-10	Electrical Room	Electrical Room	no	Ceiling	Concrete	White	None	0	0	Negative
6040	10	B604001-1	1	100-10	Space (Tech/Vo tech)	Wash Room	yes	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
6040	10	B604001-1	1	100-10	Space (Tech/Vo tech)	Wash Room	yes	W1	Concrete	White	None	0	0	Negative
6040	10	B604001-1	1	100-10	Space (Tech/Vo tech)	Wash Room	yes	W2	Concrete	White	None	0	0	Negative

					Dates: 9/12/22 - 10/4/22		Lead-Safe Certification Assessment Report							
					Inspector Name and Certificate Number: Jennifer Drialo-006767/ Steve Merlino- 006800		6040 Walter Biddle Saul HS/Manatawna Farm							
					Inspection Company: Synertech		7100 Henry Avenue, Philadelphia, PA 19128							
ULCS#	Element	BldgElmt ID	Floor	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
6040	10	B604001-1	1	100-10	Space (Tech/Vo tech)	Wash Room	yes	W3	Concrete	White	None	0	0	Negative
6040	10	B604001-1	1	100-10	Space (Tech/Vo tech)	Wash Room	yes	W4	Concrete	White	None	0	0	Negative
6040	10	B604001-1	1	100-10	Space (Tech/Vo tech)	Wash Room	yes	Ceiling	Concrete	White	None	0	0	Negative
6040	10	B604001-1	1	106-10	Storage	Wash Room Closet adjacent to Electrical Closet	yes	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
6040	10	B604001-1	1	106-10	Storage	Wash Room Closet adjacent to Electrical Closet	yes	Door	Metal	Brown	None	0	0	Negative
6040	10	B604001-1	1	106-10	Storage	Wash Room Closet adjacent to Electrical Closet	yes	Door Case	Metal	Brown	Friction	4	0.1	Negative
6040	10	B604001-1	1	106-10	Storage	Wash Room Closet adjacent to Electrical Closet	yes	W1	Concrete	White	None	0	0	Negative
6040	10	B604001-1	1	106-10	Storage	Wash Room Closet adjacent to Electrical Closet	yes	W2	Concrete	White	None	0	0	Negative
6040	10	B604001-1	1	106-10	Storage	Wash Room Closet adjacent to Electrical Closet	yes	W3	Concrete	White	None	0	0	Negative
6040	10	B604001-1	1	106-10	Storage	Wash Room Closet adjacent to Electrical Closet	yes	W4	Concrete	White	None	0	0	Negative
6040	10	B604001-1	1	106-10	Storage	Wash Room Closet adjacent to Electrical Closet	yes	Ceiling	Concrete	White	None	0	0	Negative
6040	10	B604001-1	1	105-10	Storage	Wash Room Closet adjacent to Rear Entrance	yes	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
6040	10	B604001-1	1	105-10	Storage	Wash Room Closet adjacent to Rear Entrance	yes	Door	Metal	Brown	None	0	0	Negative
6040	10	B604001-1	1	105-10	Storage	Wash Room Closet adjacent to Rear Entrance	yes	Door Case	Metal	Brown	None	0	0	Negative
6040	10	B604001-1	1	105-10	Storage	Wash Room Closet adjacent to Rear Entrance	yes	W1	Concrete	White	None	0	0	Negative
6040	10	B604001-1	1	105-10	Storage	Wash Room Closet adjacent to Rear Entrance	yes	W2	Concrete	White	None	0	0	Negative
6040	10	B604001-1	1	105-10	Storage	Wash Room Closet adjacent to Rear Entrance	yes	W3	Concrete	White	None	0	0	Negative
6040	10	B604001-1	1	105-10	Storage	Wash Room Closet adjacent to Rear Entrance	yes	W4	Concrete	White	None	0	0	Negative
6040	10	B604001-1	1	105-10	Storage	Wash Room Closet adjacent to Rear Entrance	yes	Ceiling	Concrete	White	None	0	0	Negative
6040	17	B604001-1	1	100-17	Storage, Machinery	Tractor Barn	Yes	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
6040	17	B604001-1	1	100-17	Storage, Machinery	Tractor Barn	Yes	W1	Metal	N/A	N/A	N/A	N/A	N/A
6040	17	B604001-1	1	100-17	Storage, Machinery	Tractor Barn	Yes	W2	Metal	N/A	N/A	N/A	N/A	N/A
6040	17	B604001-1	1	100-17	Storage, Machinery	Tractor Barn	Yes	W3	Metal	N/A	N/A	N/A	N/A	N/A
6040	17	B604001-1	1	100-17	Storage, Machinery	Tractor Barn	Yes	W4	Metal	N/A	N/A	N/A	N/A	N/A
6040	17	B604001-1	1	100-17	Storage, Machinery	Tractor Barn	Yes	Ceiling	Metal	N/A	N/A	N/A	N/A	N/A
6040	18	B604001-1	1	100-18	Space (Tech/Vo tech)	CSA Building	Yes	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
6040	18	B604001-1	1	100-18	Space (Tech/Vo tech)	CSA Building	Yes	W1	Concrete	White	None	0	0.1	Negative

					Dates: 9/12/22 - 10/4/22		Lead-Safe Certification Assessment Report							
					Inspector Name and Certificate Number: Jennifer Drialo-006767/ Steve Merlino- 006800		6040 Walter Biddle Saul HS/Manatawna Farm							
					Inspection Company: Synertech		7100 Henry Avenue, Philadelphia, PA 19128							
ULCS#	Element	BldgElmt ID	Floor	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
6040	18	B604001-1	1	100-18	Space (Tech/Vo tech)	CSA Building	Yes	W2	Concrete	White	None	0	0.1	Negative
6040	18	B604001-1	1	100-18	Space (Tech/Vo tech)	CSA Building	Yes	W3	Concrete	White	None	0	0	Negative
6040	18	B604001-1	1	100-18	Space (Tech/Vo tech)	CSA Building	Yes	W4	Concrete	White	None	0	0.2	Negative
6040	18	B604001-1	1	100-18	Space (Tech/Vo tech)	CSA Building	Yes	Ceiling	Concrete	White	None	0	0.1	Negative
6040	19	B604001-1	1	MFH-DR	Cafeteria (Dining Area)	Dining Room	No	Floor	Wood	N/A	N/A	N/A	N/A	N/A
6040	19	B604001-1	1	MFH-DR	Cafeteria (Dining Area)	Dining Room	No	W1	Plaster	White	None	0	0.2	Negative
6040	19	B604001-1	1	MFH-DR	Cafeteria (Dining Area)	Dining Room	No	W2	Plaster	White	Cracking	2	0.1	Negative
6040	19	B604001-1	1	MFH-DR	Cafeteria (Dining Area)	Dining Room	No	W3	Plaster	White	None	0	0.1	Negative
6040	19	B604001-1	1	MFH-DR	Cafeteria (Dining Area)	Dining Room	No	W4	Plaster	White	None	0	0	Negative
6040	19	B604001-1	1	MFH-DR	Cafeteria (Dining Area)	Dining Room	No	Ceiling	Plaster	White	None	0	0.1	Negative
6040	19	B604001-1	1	MFH-F	Building Exterior	Foyer	No	Floor	Brick	N/A	N/A	N/A	N/A	N/A
6040	19	B604001-1	1	MFH-F	Building Exterior	Foyer	No	W1	Brick	N/A	N/A	N/A	N/A	N/A
6040	19	B604001-1	1	MFH-F	Building Exterior	Foyer	No	W2	Brick	N/A	N/A	N/A	N/A	N/A
6040	19	B604001-1	1	MFH-F	Building Exterior	Foyer	No	W3	Brick	N/A	N/A	N/A	N/A	N/A
6040	19	B604001-1	1	MFH-F	Building Exterior	Foyer	No	W4	Brick	N/A	N/A	N/A	N/A	N/A
6040	19	B604001-1	1	MFH-F	Building Exterior	Foyer	No	Ceiling	Wood	N/A	N/A	N/A	N/A	N/A
6040	19	B604001-1	1	MFH-H1	Circulation (Hallway)	Hallway Between Living Room and Dining Room	No	Floor	Wood	N/A	N/A	N/A	N/A	N/A
6040	19	B604001-1	1	Lobby	Lobby	Lobby outside Basement Bathroom	No	W1	Plaster	Tan	None	0	0	Negative
6040	19	B604001-1	1	Lobby	Lobby	Lobby outside Basement Bathroom	No	W2	Plaster	Tan	Cracking	1	0	Negative
6040	19	B604001-1	1	Lobby	Lobby	Lobby outside Basement Bathroom	No	W3	Plaster	Tan	None	0	0.1	Negative
6040	19	B604001-1	1	Lobby	Lobby	Lobby outside Basement Bathroom	No	W4	Plaster	Tan	None	0	0	Negative
6040	19	B604001-1	1	Lobby	Lobby	Lobby outside Basement Bathroom	No	Ceiling	Plaster	White	Cracking	2	0.04	Negative
6040	19	B604001-1	1	MFH-LR-1	Space (Living)	Living Room	No	Floor	Wood	N/A	N/A	N/A	N/A	N/A
6040	19	B604001-1	1	MFH-LR-1	Space (Living)	Living Room	No	W1	Plaster	White	None	0	0.01	Negative
6040	19	B604001-1	1	MFH-LR-1	Space (Living)	Living Room	no	Door	Wood	White	Flaking	24	0.01	Negative
6040	19	B604001-1	1	MFH-LR-1	Space (Living)	Living Room	no	Door Frame	Wood	White	Flaking	4	0.4	Negative
6040	19	B604001-1	1	MFH-LR-1	Space (Living)	Living Room	no	Door Trim	Wood	White	Chipping	2	0	Negative
6040	19	B604001-1	1	MFH-LR-1	Space (Living)	Living Room	no	Baseboard	Wood	White	None	0	0.02	Negative
6040	19	B604001-1	1	MFH-LR-1	Space (Living)	Living Room	No	W2	Plaster	White	Cracking	1	0.01	Negative
6040	19	B604001-1	1	MFH-LR-1	Space (Living)	Living Room	no	Window Sill	Wood	Tan	Flaking	3	0	Negative
6040	19	B604001-1	1	MFH-LR-1	Space (Living)	Living Room	no	Window apron	Wood	White	Cracking	1	0.1	Negative
6040	19	B604001-1	1	MFH-LR-1	Space (Living)	Living Room	no	Baseboard	Wood	White	None	0	0.01	Negative
6040	19	B604001-1	1	MFH-LR-1	Space (Living)	Living Room	no	W3	Plaster	White	Cracking	6	0	Negative
6040	19	B604001-1	1	MFH-LR-1	Space (Living)	Living Room	no	W4	Plaster	White	Cracking	2	0.1	Negative
6040	19	B604001-1	1	MFH-LR-1	Space (Living)	Living Room	no	Ceiling	Plaster	White	Cracking	2	0.1	Negative
6040	19	B604001-1	1	MFH-MK	Kitchen	Main Kitchen	no	Floor	Wood	N/A	N/A	N/A	N/A	N/A
6040	19	B604001-1	1	MFH-MK	Kitchen	Main Kitchen	no	W1	Sheetrock	White	None	0	0	Negative
6040	19	B604001-1	1	MFH-MK	Kitchen	Main Kitchen	no	Ledge	Wood	White	Chipping	1	0.1	Negative
6040	19	B604001-1	1	MFH-MK	Kitchen	Main Kitchen	no	W2	Plaster	White	None	0	0	Negative
6040	19	B604001-1	1	MFH-MK	Kitchen	Main Kitchen	no	W3	Plaster	White	Cracking	1	0	Negative
6040	19	B604001-1	1	MFH-MK	Kitchen	Main Kitchen	no	Window Sill	Wood	White	Flaking	2	0	Negative

					Dates: 9/12/22 - 10/4/22		Lead-Safe Certification Assessment Report							
					Inspector Name and Certificate Number: Jennifer Drialo-006767/ Steve Merlino- 006800		6040 Walter Biddle Saul HS/Manatawna Farm							
					Inspection Company: Synertech		7100 Henry Avenue, Philadelphia, PA 19128							
ULCS#	Element	BldgElmt ID	Floor	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
6040	19	B604001-1	1	MFH-MK	Kitchen	Main Kitchen	no	Window Frame	Wood	White	Cracking	1	0	Negative
6040	19	B604001-1	1	MFH-MK	Kitchen	Main Kitchen	no	Window apron	Wood	White	None	0	0	Negative
6040	19	B604001-1	1	MFH-MK	Kitchen	Main Kitchen	no	Vent	Metal	White	None	0	0	Negative
6040	19	B604001-1	1	MFH-MK	Kitchen	Main Kitchen	no	W4	Plaster	White	Cracking	2	0	Negative
6040	19	B604001-1	1	MFH-MK	Kitchen	Main Kitchen	no	Ceiling	Plaster	White	Cracking	3	0	Negative
6040	19	B604001-1	1	MFH	Administrative Office	Manatawna Farm-Throughout	no	Floor	Wood	N/A	N/A	N/A	N/A	N/A
6040	19	B604001-1	1	MFH	Administrative Office	Manatawna Farm-Throughout	no	W1	Plaster	White	None	0	0.1	Negative
6040	19	B604001-1	1	MFH	Administrative Office	Manatawna Farm-Throughout	no	W2	Plaster	White	Efflorescence	5	0.1	Negative
6040	19	B604001-1	1	MFH	Administrative Office	Manatawna Farm-Throughout	no	W3	Plaster	White	None	0	0	Negative
6040	19	B604001-1	1	MFH	Administrative Office	Manatawna Farm-Throughout	no	W4	Plaster	White	None	0	0.1	Negative
6040	19	B604001-1	1	MFH	Administrative Office	Manatawna Farm-Throughout	no	Ceiling	Plaster	White	Efflorescence	5	0	Negative
6040	19	B604001-1	1	MFH-PR	Restrooms, Staff - Male/Female	Powder Room	no	Floor	N/A	N/A	N/A	N/A	N/A	N/A
6040	19	B604001-1	1	MFH-PR	Restrooms, Staff - Male/Female	Powder Room	no	W1	Plaster	White	None	0	0	Negative
6040	19	B604001-1	1	MFH-PR	Restrooms, Staff - Male/Female	Powder Room	no	Door Frame	Wood	White	None	0	N/A	N/A
6040	19	B604001-1	1	MFH-PR	Restrooms, Staff - Male/Female	Powder Room	no	W2	Plaster	White	Flaking	2	0.1	Negative
6040	19	B604001-1	1	MFH-PR	Restrooms, Staff - Male/Female	Powder Room	no	W3	Plaster	White	None	0	0	Negative
6040	19	B604001-1	1	MFH-PR	Restrooms, Staff - Male/Female	Powder Room	no	W4	Sheetrock	White	None	0	0	N/A
6040	19	B604001-1	1	MFH-PR	Restrooms, Staff - Male/Female	Powder Room	no	Ceiling	Plaster	White	Cracking	3	0.1	Negative
6040	19	B604001-1	1	MFH-PR	Restrooms, Staff - Male/Female	Powder Room	no	Duct	Metal	White	Flaking	1	0.1	Negative
6040	19	B604001-1	1	MFH-S1	Stairs	Stairway in Kitchen	no	Floor	N/A	N/A	N/A	N/A	N/A	N/A
6040	19	B604001-1	1	MFH-S1	Stairs	Stairway in Kitchen	no	W1	Plaster	White	None	0	0	Negative
6040	19	B604001-1	1	MFH-S1	Stairs	Stairway in Kitchen	no	W2	Plaster	Blue	Flaking	1	0	Negative
6040	19	B604001-1	1	MFH-S1	Stairs	Stairway in Kitchen	no	W3	Plaster	Blue	None	0	0	Negative
6040	19	B604001-1	1	MFH-S1	Stairs	Stairway in Kitchen	no	W4	Plaster	Blue	Flaking	1	0	Negative
6040	19	B604001-1	1	MFH-S1	Stairs	Stairway in Kitchen	no	Ceiling	Plaster	White	None	0	0.1	Negative
6040	19	B604001-1	1	MFH-SK	Kitchen	Summer Kitchen	no	Floor	Wood	N/A	N/A	0	0	Negative
6040	19	B604001-1	1	MFH-SK	Kitchen	Summer Kitchen	no	W1	Plaster	White	None	0	0	Negative
6040	19	B604001-1	1	MFH-SK	Kitchen	Summer Kitchen	no	W2	Plaster	White	None	0	0	Negative
6040	19	B604001-1	1	MFH-SK	Kitchen	Summer Kitchen	no	W3	Plaster	White	None	0	0	Negative
6040	19	B604001-1	1	MFH-SK	Kitchen	Summer Kitchen	no	W4	Plaster	White	None	0	0	Negative
6040	19	B604001-1	1	MFH-SK	Kitchen	Summer Kitchen	no	Ceiling	Plaster	White	None	0	0	Negative

					Dates: 9/12/22 - 10/4/22		Lead-Safe Certification Assessment Report							
					Inspector Name and Certificate Number: Jennifer Drialo-006767/ Steve Merlino- 006800		6040 Walter Biddle Saul HS/Manatawna Farm							
					Inspection Company: Synertech		7100 Henry Avenue, Philadelphia, PA 19128							
ULCS#	Element	BldgElmt ID	Floor	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
6040	19	B604001-1	2	MFH-BR	Restroom and Bath (ESE)	Bathroom	no	Floor	N/A	N/A	N/A	N/A	N/A	N/A
6040	19	B604001-1	2	MFH-BR	Restroom and Bath (ESE)	Bathroom	no	W1	Plaster	White	Flaking	1	0	Negative
6040	19	B604001-1	2	MFH-BR	Restroom and Bath (ESE)	Bathroom	no	Door Frame	Wood	White	Chipping	1	0.1	Negative
6040	19	B604001-1	2	MFH-BR	Restroom and Bath (ESE)	Bathroom	no	W2	Plaster	White	Flaking	5	0	Negative
6040	19	B604001-1	2	MFH-BR	Restroom and Bath (ESE)	Bathroom	no	W3	Plaster	White	Flaking	2	0	Negative
6040	19	B604001-1	2	MFH-BR	Restroom and Bath (ESE)	Bathroom	no	W4	Plaster	White	Flaking	2	0	Negative
6040	19	B604001-1	2	MFH-BR	Restroom and Bath (ESE)	Bathroom	no	Ceiling	Plaster	White	Flaking	7	0	Negative
6040	19	B604001-1	2	MFH-BD2	Space (Living)	Bedroom Facing Barn	no	Floor	N/A	N/A	N/A	N/A	N/A	N/A
6040	19	B604001-1	2	MFH-BD2	Space (Living)	Bedroom Facing Barn	no	W1	Plaster	Purple	Cracking	1	0	Negative
6040	19	B604001-1	2	MFH-BD2	Space (Living)	Bedroom Facing Barn	no	Door Frame	Wood	White	Chipping	1	0	Negative
6040	19	B604001-1	2	MFH-BD2	Space (Living)	Bedroom Facing Barn	no	W2	Plaster	Purple	Cracking	2	0	Negative
6040	19	B604001-1	2	MFH-BD2	Space (Living)	Bedroom Facing Barn	no	Closet Door Frame	Wood	White	Chipping	1	0.1	Negative
6040	19	B604001-1	2	MFH-BD2	Space (Living)	Bedroom Facing Barn	no	Closet wall 1	Plaster	White	None	0	0	Negative
6040	19	B604001-1	2	MFH-BD2	Space (Living)	Bedroom Facing Barn	no	Closet wall 2	Plaster	White	None	0	0	Negative
6040	19	B604001-1	2	MFH-BD2	Space (Living)	Bedroom Facing Barn	no	Closet wall 3	Plaster	White	None	0	0	Negative
6040	19	B604001-1	2	MFH-BD2	Space (Living)	Bedroom Facing Barn	no	Shelf	Wood	White	None	0	0	Negative
6040	19	B604001-1	2	MFH-BD2	Space (Living)	Bedroom Facing Barn	no	Shelf Support	Wood	White	None	0	0	Negative
6040	19	B604001-1	2	MFH-BD2	Space (Living)	Bedroom Facing Barn	no	Closet wall 4	Plaster	White	None	0	0	Negative
6040	19	B604001-1	2	MFH-BD2	Space (Living)	Bedroom Facing Barn	no	Ceiling	Plaster	White	None	0	0	Negative
6040	19	B604001-1	2	MFH-BD2	Space (Living)	Bedroom Facing Barn	no	W3	Plaster	Purple	None	0	0	Negative
6040	19	B604001-1	2	MFH-BD2	Space (Living)	Bedroom Facing Barn	no	Window Frame	Wood	White	Flaking	1	0.1	Negative
6040	19	B604001-1	2	MFH-BD2	Space (Living)	Bedroom Facing Barn	no	Window Sill	Wood	White	Cracking	2	0	Negative
6040	19	B604001-1	2	MFH-BD2	Space (Living)	Bedroom Facing Barn	no	Window Apron	Wood	White	None	0	0.1	Negative
6040	19	B604001-1	2	MFH-BD2	Space (Living)	Bedroom Facing Barn	no	W4	Plaster	Purple	Cracking	3	0	Negative
6040	19	B604001-1	2	MFH-BD2	Space (Living)	Bedroom Facing Barn	no	Ceiling	Plaster	White	Cracking	4	0	Negative
6040	19	B604001-1	2	MFH-BD	Space (Living)	Bedroom Right of Laundry Room	no	Floor	N/A	N/A	N/A	N/A	N/A	N/A
6040	19	B604001-1	2	MFH-BD	Space (Living)	Bedroom Right of Laundry Room	no	W1	Plaster	White	Flaking	2	2	Negative
6040	19	B604001-1	2	MFH-BD	Space (Living)	Bedroom Right of Laundry Room	no	W2	Plaster	White	None	0	0.1	Negative
6040	19	B604001-1	2	MFH-BD	Space (Living)	Bedroom Right of Laundry Room	no	W3	Plaster	White	None	0	0.01	Negative
6040	19	B604001-1	2	MFH-BD	Space (Living)	Bedroom Right of Laundry Room	no	W4	Plaster	White	None	0	0	Negative
6040	19	B604001-1	2	MFH-BD	Space (Living)	Bedroom Right of Laundry Room	no	Ceiling	Plaster	White	Cracking	3	0.1	Negative
6040	19	B604001-1	2	MFH-BD	Space (Living)	Bedroom Right of Laundry Room	no	Duct	Metal	White	Flaking	1	0.1	Negative
6040	19	B604001-1	2	MFH-H3	Circulation (Hallway)	Hallway Between Bedrooms	no	Floor	Wood	N/A	N/A	N/A	N/A	N/A
6040	19	B604001-1	2	MFH-H3	Circulation (Hallway)	Hallway Between Bedrooms	no	W1	Plaster	White	None	0	0.1	Negative
6040	19	B604001-1	2	MFH-H3	Circulation (Hallway)	Hallway Between Bedrooms	no	W2	Plaster	White	None	0	0	Negative
6040	19	B604001-1	2	MFH-H3	Circulation (Hallway)	Hallway Between Bedrooms	no	W3	Plaster	White	None	0	0	Negative
6040	19	B604001-1	2	MFH-H3	Circulation (Hallway)	Hallway Between Bedrooms	no	W4	Plaster	White	None	0	0.4	Negative
6040	19	B604001-1	2	MFH-H3	Circulation (Hallway)	Hallway Between Bedrooms	no	Ceiling	Plaster	White	None	0	0.1	Negative
6040	19	B604001-1	2	MFH-HC	Storage	Hallway Closet	no	Floor	Wood	White	None	0	0	Negative
6040	19	B604001-1	2	MFH-HC	Storage	Hallway Closet	no	W1	Plaster	White	None	0	0	Negative

						Dates: 9/12/22 - 10/4/22		Lead-Safe Certification Assessment Report						
						Inspector Name and Certificate Number: Jennifer Drialo-006767/ Steve Merlino- 006800		6040 Walter Biddle Saul HS/Manatawna Farm						
						Inspection Company: Synertech		7100 Henry Avenue, Philadelphia, PA 19128						
ULCS#	Element	BldgElmt ID	Floor	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
6040	19	B604001-1	2	MFH-HC	Storage	Hallway Closet	no	W2	Plaster	White	None	0	0.1	Negative
6040	19	B604001-1	2	MFH-HC	Storage	Hallway Closet	no	W3	Plaster	White	None	0	0	Negative
6040	19	B604001-1	2	MFH-HC	Storage	Hallway Closet	no	W4	Plaster	White	None	0	0	Negative
6040	19	B604001-1	2	MFH-HC	Storage	Hallway Closet	no	Ceiling	Plaster	White	None	0	0	Negative
6040	19	B604001-1	1	Heater Room	Mechanical	Heater Room	no	W1	Concrete	White	None	0	0.01	Negative
6040	19	B604001-1	1	Heater Room	Mechanical	Heater Room	no	W2	Concrete	White	None	0	0	Negative
6040	19	B604001-1	1	Heater Room	Mechanical	Heater Room	no	W3	Concrete	White	None	0	0.04	Negative
6040	19	B604001-1	1	Heater Room	Mechanical	Heater Room	no	W4	Concrete	White	None	0	0.03	Negative
6040	19	B604001-1	1	ement Bathr	Bathroom	Basement Bathroom	no	W1	Plaster	Tan	None	0	0.12	Negative
6040	19	B604001-1	1	ement Bathr	Bathroom	Basement Bathroom	no	W2	Plaster	Tan	Cracking	1	0.03	Negative
6040	19	B604001-1	1	ement Bathr	Bathroom	Basement Bathroom	no	W3	Plaster	Tan	None	0	0.25	Negative
6040	19	B604001-1	1	ement Bathr	Bathroom	Basement Bathroom	no	W4	Plaster	Tan	Cracking	2	0.04	Negative
6040	19	B604001-1	1	ement Bathr	Bathroom	Basement Bathroom	no	Ceiling	Plaster	White	None	0	0	Negative
6040	19	B604001-1	2	MFH-LR-2	Space (Living)	Laundry Room	no	Floor	N/A	N/A	N/A	N/A	N/A	N/A
6040	19	B604001-1	2	MFH-LR-2	Space (Living)	Laundry Room	no	W1	Plaster	White	None	0	0.1	Negative
6040	19	B604001-1	2	MFH-LR-2	Space (Living)	Laundry Room	no	Door frame	Wood	White	Chipping	1	0	Negative
6040	19	B604001-1	2	MFH-LR-2	Space (Living)	Laundry Room	no	W2	Concrete	White	Cracking	2	0	Negative
6040	19	B604001-1	2	MFH-LR-2	Space (Living)	Laundry Room	no	W3	Concrete	White	None	0	0	Negative
6040	19	B604001-1	2	MFH-LR-2	Space (Living)	Laundry Room	no	W4	Concrete	White	None	0	0	Negative
6040	19	B604001-1	2	MFH-LR-2	Space (Living)	Laundry Room	no	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
6040	19	B604001-1	3	MFH-BD4	Space (Living)	Bedroom Left of Stairs	no	Floor	N/A	N/A	N/A	N/A	N/A	N/A
6040	19	B604001-1	3	MFH-BD4	Space (Living)	Middle Bedroom	no	W1	Plaster	Blue	None	0	0	Negative
6040	19	B604001-1	3	MFH-BD4	Space (Living)	Middle Bedroom	no	W2	Plaster	Blue	None	5	0	Negative
6040	19	B604001-1	3	MFH-BD4	Space (Living)	Middle Bedroom	no	W3	Plaster	Blue	None	0	0	Negative
6040	19	B604001-1	3	MFH-BD4	Space (Living)	Middle Bedroom	no	W4	Plaster	Blue	None	0	0	Negative
6040	19	B604001-1	3	MFH-BD4	Space (Living)	Middle Bedroom	no	Ceiling	Plaster	White	Moisture Damage	20	0.1	Negative
6040	19	B604001-1	3	MFH-BD3	Space (Living)	Bedroom Right of Stairs	no	Floor	N/A	N/A	N/A	N/A	N/A	N/A
6040	19	B604001-1	3	MFH-BD3	Space (Living)	Bedroom closest to Dining Room	no	W1	Plaster	Purple	None	0	0.1	Negative
6040	19	B604001-1	3	MFH-BD3	Space (Living)	Bedroom Right of Stairs	no	W2	Plaster	Purple	None	0	0	Negative
6040	19	B604001-1	3	MFH-BD3	Space (Living)	Bedroom Right of Stairs	no	W3	Plaster	Purple	None	0	0.4	Negative
6040	19	B604001-1	3	MFH-BD3	Space (Living)	Bedroom Right of Stairs	no	W4	Plaster	Purple	None	0	0	Negative
6040	19	B604001-1	3	MFH-BD3	Space (Living)	Bedroom Right of Stairs	no	Ceiling	Plaster	White	None	0	0.1	Negative
6040	19	B604001-1	1	ment Front F	Space (Living)	Basement large Front Room	no	W1	Plaster	Blue	None	0	0.1	Negative
6040	19	B604001-1	1	ment Front F	Space (Living)	Basement large Front Room	no	W2	Plaster	Blue	Flaking	5	0.1	Negative
6040	19	B604001-1	1	ment Front F	Space (Living)	Basement large Front Room	no	W3	Plaster	Blue	None	0	0.1	Negative
6040	19	B604001-1	1	ment Front F	Space (Living)	Basement large Front Room	no	W4	Plaster	Blue	None	0	0.3	Negative
6040	19	B604001-1	1	ment Front F	Space (Living)	Basement large Front Room	no	Ceiling	Plaster	White	Efflorescence	20	0.1	Negative
6040	19	B604001-1	B	MFH-B	Space (Living)	Basement	no	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
6040	19	B604001-1	B	MFH-B	Space (Living)	Basement	no	W1	Plaster	Blue	Cracking	2	0	Negative
6040	19	B604001-1	B	MFH-B	Space (Living)	Basement	no	W2	Concrete	Blue	None	0	0	Negative
6040	19	B604001-1	B	MFH-B	Space (Living)	Basement	no	W3	Concrete	Blue	Flaking	4	0.1	Negative
6040	19	B604001-1	B	MFH-B	Space (Living)	Basement	no	W4	Concrete	Blue	None	0	0.2	Negative
6040	19	B604001-1	B	MFH-B	Space (Living)	Basement	no	Ceiling	Plaster	White	Flaking	12	0	Negative
6040	19	B604001-1	B	MFH-B	Space (Living)	Basement	no	Duct	Metal	White	Flaking	1	0	Negative
6040	19	B604001-1	EX	MFH-EX	Building Exterior	Exterior	no	Floor	N/A	N/A	N/A	N/A	N/A	N/A
6040	19	B604001-1	EX	MFH-EX	Building Exterior	Exterior	no	Garage Door	Metal	White	None	0	0	Negative
6040	19	B604001-1	EX	MFH-EX	Building Exterior	Exterior	no	Garage Frame	Metal	White	None	0	0	Negative
6040	19	B604001-1	EX	MFH-EX	Building Exterior	Exterior	no	Garage Header	Metal	White	Flaking	3	0.2	Negative
6040	19	B604001-1	EX	MFH-EX	Building Exterior	Exterior	no	Basement Storm Door	Metal	White	None	0	0	Negative

					Dates: 9/12/22 - 10/4/22		Lead-Safe Certification Assessment Report							
					Inspector Name and Certificate Number: Jennifer Drialo-006767/ Steve Merlino- 006800		6040 Walter Biddle Saul HS/Manatawna Farm							
					Inspection Company: Synertech		7100 Henry Avenue, Philadelphia, PA 19128							
ULCS#	Element	BldgElmt ID	Floor	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
6040	19	B604001-1	EX	MFH-EX	Building Exterior	Exterior	no	Basement Storm Door Header	Metal	White	Flaking	2	0.4	Negative
6040	19	B604001-1	EX	MFH-EX	Building Exterior	Exterior	no	Door Frame	Wood	White	None	0	0	Negative
6040	20	B604001-1	1	100-20	Animal Shelter	Horse Barn	Yes	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
6040	20	B604001-1	1	100-20	Animal Shelter	Horse Barn	Yes	W1	Concrete	N/A	N/A	N/A	N/A	N/A
6040	20	B604001-1	1	100-20	Animal Shelter	Horse Barn	Yes	W2	Concrete	N/A	N/A	N/A	N/A	N/A
6040	20	B604001-1	1	100-20	Animal Shelter	Horse Barn	Yes	W3	Concrete	N/A	N/A	N/A	N/A	N/A
6040	20	B604001-1	1	100-20	Animal Shelter	Horse Barn	Yes	W4	Concrete	N/A	N/A	N/A	N/A	N/A
6040	20	B604001-1	1	100-20	Animal Shelter	Horse Barn	Yes	Ceiling	Concrete	N/A	N/A	N/A	N/A	N/A
6040	21	B604001-1	1	100-21	Animal Shelter	Sheep Barn	Yes	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
6040	21	B604001-1	1	100-21	Animal Shelter	Sheep Barn	Yes	W1	Wood	N/A	N/A	N/A	N/A	N/A
6040	21	B604001-1	1	100-21	Animal Shelter	Sheep Barn	Yes	W2	Concrete	Blue	None	0	0.1	Negative
6040	21	B604001-1	1	100-21	Animal Shelter	Sheep Barn	Yes	W3	Wood	N/A	N/A	N/A	N/A	N/A
6040	21	B604001-1	1	100-21	Animal Shelter	Sheep Barn	Yes	W4	Wood	N/A	N/A	N/A	N/A	N/A
6040	21	B604001-1	1	100-21	Animal Shelter	Sheep Barn	Yes	Ceiling	Metal	N/A	N/A	N/A	N/A	N/A
6040	22	B604001-1	1	Demo-22	Building	Element 22/Demolished	No	Floor	N/A	N/A	N/A	N/A	N/A	N/A
6040	22	B604001-1	1	Demo-22	Building	Element 22/Demolished	No	W1	N/A	N/A	N/A	N/A	N/A	N/A
6040	22	B604001-1	1	Demo-22	Building	Element 22/Demolished	No	W2	N/A	N/A	N/A	N/A	N/A	N/A
6040	22	B604001-1	1	Demo-22	Building	Element 22/Demolished	No	W3	N/A	N/A	N/A	N/A	N/A	N/A
6040	22	B604001-1	1	Demo-22	Building	Element 22/Demolished	No	W4	N/A	N/A	N/A	N/A	N/A	N/A
6040	22	B604001-1	1	Demo-22	Building	Element 22/Demolished	No	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
6040	23	B604001-1	1	Demo-23	Building	Element 23/Demolished	No	Floor	N/A	N/A	N/A	N/A	N/A	N/A
6040	23	B604001-1	1	Demo-23	Building	Element 23/Demolished	No	W1	N/A	N/A	N/A	N/A	N/A	N/A
6040	23	B604001-1	1	Demo-23	Building	Element 23/Demolished	No	W2	N/A	N/A	N/A	N/A	N/A	N/A
6040	23	B604001-1	1	Demo-23	Building	Element 23/Demolished	No	W3	N/A	N/A	N/A	N/A	N/A	N/A
6040	23	B604001-1	1	Demo-23	Building	Element 23/Demolished	No	W4	N/A	N/A	N/A	N/A	N/A	N/A
6040	23	B604001-1	1	Demo-23	Building	Element 23/Demolished	No	Ceiling	N/A	N/A	N/A	N/A	N/A	N/A
6040	24	B604001-1	1	100-24	Space (Tech/Vo tech)	Open Air Shed	No	Floor	N/A	N/A	N/A	N/A	N/A	N/A
6040	24	B604001-1	1	100-24	Space (Tech/Vo tech)	Open Air Shed	No	W1	Wood	White	Flaking	20	0	Negative
6040	24	B604001-1	1	100-24	Space (Tech/Vo tech)	Open Air Shed	No	W2	Wood	White	Flaking	20	0.1	Negative
6040	24	B604001-1	1	100-24	Space (Tech/Vo tech)	Open Air Shed	No	W3	Wood	White	Flaking	20	0	Negative
6040	24	B604001-1	1	100-24	Space (Tech/Vo tech)	Open Air Shed	No	W4	Wood	White	Flaking	20	0.1	Negative
6040	24	B604001-1	1	100-24	Space (Tech/Vo tech)	Open Air Shed	No	Ceiling	Wood	Yellow	Flaking	150	0.1	Negative
6040	25	B604001-1	1	100-25	Paint/Flammable Storage	Fuel Pump Shed	no	Floor	Concrete	N/A	N/A	N/A	N/A	N/A
6040	25	B604001-1	1	100-25	Paint/Flammable Storage	Fuel Pump Shed	no	W1	Wood	White	Flaking	50	0	Negative
6040	25	B604001-1	1	100-25	Paint/Flammable Storage	Fuel Pump Shed	no	W2	Wood	White	Flaking	50	0	Negative
6040	25	B604001-1	1	100-25	Paint/Flammable Storage	Fuel Pump Shed	no	W3	Wood	White	Flaking	50	0	Negative
6040	25	B604001-1	1	100-25	Paint/Flammable Storage	Fuel Pump Shed	no	W4	Wood	White	Flaking	50	0	Negative
6040	25	B604001-1	1	100-25	Paint/Flammable Storage	Fuel Pump Shed	no	Ceiling	Wood	White	Flaking	50	0	Negative
6040	26	B604001-1	1	100-26	Animal Shelter	Dog Kennel	yes	Floor	Concrete	Grey	None	0	0	Negative
6040	26	B604001-1	1	100-26	Animal Shelter	Dog Kennel	yes	W1	Sheetrock	White	None	0	0	Negative

					Dates: 9/12/22 - 10/4/22		Lead-Safe Certification Assessment Report							
					Inspector Name and Certificate Number: Jennifer Drialo-006767/ Steve Merlino- 006800		6040 Walter Biddle Saul HS/Manatawna Farm							
					Inspection Company: Synertech		7100 Henry Avenue, Philadelphia, PA 19128							
ULCS#	E l e m e n t	BldgElmt ID	F l o o r	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/ negative)
6040	26	B604001-1	1	100-26	Animal Shelter	Dog Kennel	yes	Door	Metal	Blue	Flaking	2	0	Negative
6040	26	B604001-1	1	100-26	Animal Shelter	Dog Kennel	yes	Door Frame	Metal	White	Chipping	2	0	Negative
6040	26	B604001-1	1	100-26	Animal Shelter	Dog Kennel	yes	Window Bars	Metal	Black	None	0	0	Negative
6040	26	B604001-1	1	100-26	Animal Shelter	Dog Kennel	yes	W2	Concrete	White	None	0	0	Negative
6040	26	B604001-1	1	100-26	Animal Shelter	Dog Kennel	yes	Vent	Metal	White	Flaking	1	0	Negative
6040	26	B604001-1	1	100-26	Animal Shelter	Dog Kennel	yes	W3	Concrete	White	Cracking	4	0	Negative
6040	26	B604001-1	1	100-26	Animal Shelter	Dog Kennel	yes	Window Bars	Metal	Black	None	0	0	Negative
6040	26	B604001-1	1	100-26	Animal Shelter	Dog Kennel	yes	Window Frame	Metal	White	Chipping	1	0	Negative
6040	26	B604001-1	1	100-26	Animal Shelter	Dog Kennel	yes	W4	Concrete	White	None	0	0	Negative
6040	26	B604001-1	1	100-26	Animal Shelter	Dog Kennel	yes	Ceiling	Metal	N/A	N/A	N/A	N/A	N/A
6040	26	B604001-1	1	100-26	Animal Shelter	Dog Kennel	yes	Siding	Metal	Tan	None	0	0	Negative
6040	26	B604001-1	1	101-26	Mechanical Room	Dog Kennel Water Heater Room	no	Floor	Concrete	Grey	Partially Inaccessible	0	0	Negative
6040	26	B604001-1	1	101-26	Mechanical Room	Dog Kennel Water Heater Room	no	W1	Concrete	White	Partially Inaccessible	0	0	Negative
6040	26	B604001-1	1	101-26	Mechanical Room	Dog Kennel Water Heater Room	no	W2	Concrete	White	Partially Inaccessible	0	0	Negative
6040	26	B604001-1	1	101-26	Mechanical Room	Dog Kennel Water Heater Room	no	W3	Concrete	White	Partially Inaccessible	0	0	Negative
6040	26	B604001-1	1	101-26	Mechanical Room	Dog Kennel Water Heater Room	no	W4	Concrete	White	Partially Inaccessible	0	0	Negative
6040	26	B604001-1	1	101-26	Mechanical Room	Dog Kennel Water Heater Room	no	Ceiling	Metal	N/A	N/A	N/A	N/A	N/A
6040	26	B604001-1	1	101-26	Mechanical Room	Dog Kennel Water Heater Room	no	Floor	Concrete	Grey	Partially Inaccessible	0	0	Negative

Appendix B

Scope of Work Table

						Dates: 9/12/22 - 10/4/22		Lead-Safe Certification Assessment Report						
						Inspector Name and Certificate Number: Jennifer Drialo-006767/ Steve Merlino- 006800		6040 Walter Biddle Saul HS/Manatawna Farm						
						Inspection Company: Synertech		7100 Henry Avenue, Philadelphia, PA 19128						
ULCS#	E l e m e n t	BldgElmt ID	F l o o r	Space #	Space Type	On-Site Room Name	Student/Teacher Occupied (yes/no)	Component	Substrate Material	Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/ negative)
6040	1	B604001-1	1	100A-1	Storage	Classroom 100 Closet	yes	Shelf	Wood	Tan	Friction	5	1.1	Positive
6040	1	B604001-1	1	102A	Storage	Classroom 102 Closet	yes	Shelf	Wood	Tan	Friction	4	1.1	Positive
6040	1	B604001-1	1	103B	Storage	Classroom 103 Closet	yes	Shelf	Wood	Tan	Friction	6	1.1	Positive
6040	1	B604001-1	1	104A	Storage	Classroom 104 Closet	yes	Shelf	Wood	Tan	Friction	4	1.4	Positive
6040	1	B604001-1	2	200A	Storage	Classroom 200 Closet	yes	Shelf	Wood	Green	Friction	4	2	Positive
6040	1	B604001-1	2	201A	Storage	Classroom 201 Closet	yes	Shelf	Wood	Yellow	Friction	5	1.4	Positive
6040	1	B604001-1	2	202A	Storage	Classroom 202 Closet	yes	Shelf	Wood	Blue	Friction	4	1.4	Positive
6040	1	B604001-1	2	203A	Storage	Classroom 203 Closet	yes	Shelf	Wood	Yellow	Friction	4	1.6	Positive
6040	1	B604001-1	2	204A	Storage	Classroom 204 Closet	yes	Shelf	Wood	Green	Friction	8	1.4	Positive
6040	1	B604001-1	2	205A	Storage	Classroom 205 Closet	yes	Shelf	Wood	Yellow	Friction	10	1.2	Positive
6040	1	B604001-1	2	208A	Storage	Classroom 208 Closet	yes	Shelf	Wood	Yellow	Friction	4	1.4	Positive
6040	1	B604001-1	B	001-B	Administrative Office	Time Clock Room	no	Key Hanger	Wood	Brown	Chipping	1	0.7	Positive
6040	1	B604001-1	B	001A-B	Restrooms, Staff - Male	Time Clock Room Men's Restroom	no	Door	Wood	Tan	Friction	2	1.4	Positive
6040	9	B604001-1	2	200-9	Space (Tech/Vo tech)	Rabbit Room	yes	Awning	Wood	Blue	Flaking	15	30	Positive

Appendix C

EPA Checklist Form

Sample Renovation Recordkeeping Checklist Form Approved OMB No. 2070-0195 Expires 2/29/24

Name of Firm: SYNERTECH

Date and Location of Renovation: 02-06-23 WALTER BIDDLE SAUL H.S. / TIME CLOCK ROOM, TIME CLOCK ROOM'S MEN'S ROOM, SOFFIT ABOVE DOOR TO 2ND (SMALL) BUILDING

Brief Description of Renovation: RRP

Name of Assigned Renovator: PSD PAINTERS

Name(s) of Trained Worker(s), if used: NICK GICCOLONGI, SEAN FLANNERY

Name of Dust Sampling Technician, Inspector, or Risk Assessor, if used: STEPHEN CROSS

- Copies of renovator and dust sampling technician qualifications (training certificates, certifications) on file.
- Certified renovator provided training to workers on (check all that apply):

- Posting warning signs
- Setting up plastic containment barriers
- Maintaining containment
- Avoiding spread of dust to adjacent areas
- Waste handling
- Post-renovation cleaning

Test kit or test results from an EPA-recognized laboratory on collected paint chip sample, used by certified renovator to determine whether lead was present on components affected by renovation (identify method used, type of test kit used (if applicable), laboratory used to conduct paint chip analysis, describe sampling locations and results):

Warning signs posted at entrance to work area.

Work area contained to prevent spread of dust and debris

All objects in the work area removed or covered (interiors)

HVAC ducts in the work area closed and covered (interiors)

Windows in the work area closed (interiors)

Windows in and within 20 feet of the work area closed (exteriors)

Doors in the work area closed and sealed (interiors)

Doors in and within 20 feet of the work area closed and sealed (exteriors)

Doors that must be used in the work area covered to allow passage but prevent spread of dust

Floors in the work area covered with taped-down plastic (interiors)

Ground covered by plastic extending 10 feet from work area—plastic anchored to building and weighed down by heavy objects (exteriors)

Vertical containment installed if property line prevents 10 feet of ground covering, or if necessary to prevent migration of dust and debris to adjacent property (exteriors)

Waste contained on-site and while being transported off-site.

Work site properly cleaned after renovation

All chips and debris picked up, protective sheeting misted, folded dirty side inward, and taped for removal

Work area surfaces and objects cleaned using HEPA vacuum and/or wet cloths or mops (interiors)

Certified renovator performed post-renovation cleaning verification (describe results, including the number of wet and dry cloths used):

PLASTIC FOLDED IN ON ITSELF AND DISPOSED OF IN BAGS + TAKEN OFF SITE

If dust clearance testing was performed instead, attach a copy of report

I certify under penalty of law that the above information is true and complete.

STEPHEN CROSS TECH 02-06-23

Name and title

Date

Appendix D

Oversight Table

ULCS#	Element	BldgElmt ID	Floor	Space # (on Floor Plan)	Space Type	On Site Room Name	Student/Teacher Occupied	Component	Substrate Material	Color	Description of Paint and Plaster Damage	Damage Quantity (sf)
6040	1	B604001-1	1	100A-1	Storage	Classroom 100 Closet	yes	Shelf	Wood	Tan	Friction	5
6040	1	B604001-1	1	102A	Storage	Classroom 102 Closet	yes	Shelf	Wood	Tan	Friction	4
6040	1	B604001-1	1	103B	Storage	Classroom 103 Closet	yes	Shelf	Wood	Tan	Friction	6
6040	1	B604001-1	1	104A	Storage	Classroom 104 Closet	yes	Shelf	Wood	Tan	Friction	4
6040	1	B604001-1	2	200A	Storage	Classroom 200 Closet	yes	Shelf	Wood	Green	Friction	4
6040	1	B604001-1	2	201A	Storage	Classroom 201 Closet	yes	Shelf	Wood	Yellow	Friction	5
6040	1	B604001-1	2	202A	Storage	Classroom 202 Closet	yes	Shelf	Wood	Blue	Friction	4
6040	1	B604001-1	2	203A	Storage	Classroom 203 Closet	yes	Shelf	Wood	Yellow	Friction	4
6040	1	B604001-1	2	204A	Storage	Classroom 204 Closet	yes	Shelf	Wood	Green	Friction	8
6040	1	B604001-1	2	205A	Storage	Classroom 205 Closet	yes	Shelf	Wood	Yellow	Friction	10
6040	1	B604001-1	2	208A	Storage	Classroom 208 Closet	yes	Shelf	Wood	Yellow	Friction	4
6040	1	B604001-1	B	001-B	Administrative Office	Time Clock Room	no	Key Hanger	Wood	Brown	Chipping	1
6040	1	B604001-1	B	001A-B	Restrooms, Staff - Male	Time Clock Room Men's Restroom	no	Door	Wood	Tan	Friction	2
6040	9	B604001-1	2	200-9	Space (Tech/Vo tech)	Rabbit Room	yes	Awning	Wood	Blue	Flaking	15

ULCS#	Element	BldgElmt ID	Floor	Space # (on Floor Plan)	Space Type	On Site Room Name	XRF Reading (mg/cm2)	XRF (positive/negative)	Pre-Cleaning Completed (date)	Contents Moved (date)	Work Area Prepped (date)	Surfaces Stabilized (date)	Contents Back in Place (date)
6040	1	B604001-1	1	100A-1	Storage	Classroom 100 Closet	1.1	Positive	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	1	102A	Storage	Classroom 102 Closet	1.1	Positive	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	1	103B	Storage	Classroom 103 Closet	1.1	Positive	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	1	104A	Storage	Classroom 104 Closet	1.4	Positive	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	2	200A	Storage	Classroom 200 Closet	2	Positive	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	2	201A	Storage	Classroom 201 Closet	1.4	Positive	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	2	202A	Storage	Classroom 202 Closet	1.4	Positive	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	2	203A	Storage	Classroom 203 Closet	1.6	Positive	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	2	204A	Storage	Classroom 204 Closet	1.4	Positive	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	2	205A	Storage	Classroom 205 Closet	1.2	Positive	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	2	208A	Storage	Classroom 208 Closet	1.4	Positive	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	B	001-B	Administrative Office	Time Clock Room	0.7	Positive	02/06/2023	02/06/2023	02/06/2023	02/06/2023	02/06/2023
6040	1	B604001-1	B	001A-B	Restrooms, Staff - Male	Time Clock Room Men's Restroom	1.4	Positive	02/06/2023	02/06/2023	02/06/2023	02/06/2023	02/06/2023
6040	9	B604001-1	2	200-9	Space (Tech/Vo tech)	Rabbit Room	30	Positive	02/06/2023	02/06/2023	02/06/2023	02/06/2023	02/06/2023

ULCS#	Element	BldgElmt ID	Floor	Space # (on Floor Plan)	Space Type	On Site Room Name	Final Inspection Approval and Photos (date)	Square Footage of Work Area	Number of Required RRP Wipes	AAS Analysis Results	Comments from Oversight	Name of Firm	Date of Renovation
6040	1	B604001-1	1	100A-1	Storage	Classroom 100 Closet	N/A	N/A	N/A	N/A	Contact paper installed to conceal friction damage 03/01/2023	Synertech	N/A
6040	1	B604001-1	1	102A	Storage	Classroom 102 Closet	N/A	N/A	N/A	N/A	Contact paper installed to conceal friction damage 03/01/2023	Synertech	N/A
6040	1	B604001-1	1	103B	Storage	Classroom 103 Closet	N/A	N/A	N/A	N/A	Contact paper installed to conceal friction damage 03/01/2023	Synertech	N/A
6040	1	B604001-1	1	104A	Storage	Classroom 104 Closet	N/A	N/A	N/A	N/A	Contact paper installed to conceal friction damage 03/01/2023	Synertech	N/A
6040	1	B604001-1	2	200A	Storage	Classroom 200 Closet	N/A	N/A	N/A	N/A	Contact paper installed to conceal friction damage 03/01/2023	Synertech	N/A
6040	1	B604001-1	2	201A	Storage	Classroom 201 Closet	N/A	N/A	N/A	N/A	Contact paper installed to conceal friction damage 03/01/2023	Synertech	N/A
6040	1	B604001-1	2	202A	Storage	Classroom 202 Closet	N/A	N/A	N/A	N/A	Contact paper installed to conceal friction damage 03/01/2023	Synertech	N/A
6040	1	B604001-1	2	203A	Storage	Classroom 203 Closet	N/A	N/A	N/A	N/A	Contact paper installed to conceal friction damage 03/01/2023	Synertech	N/A
6040	1	B604001-1	2	204A	Storage	Classroom 204 Closet	N/A	N/A	N/A	N/A	Contact paper installed to conceal friction damage 03/01/2023	Synertech	N/A
6040	1	B604001-1	2	205A	Storage	Classroom 205 Closet	N/A	N/A	N/A	N/A	Contact paper installed to conceal friction damage 03/01/2023	Synertech	N/A
6040	1	B604001-1	2	208A	Storage	Classroom 208 Closet	N/A	N/A	N/A	N/A	Contact paper installed to conceal friction damage 03/01/2023	Synertech	N/A
6040	1	B604001-1	B	001-B	Administrative Office	Time Clock Room	02/06/2023	6	1	N/A	N/A	Synertech	02/06/2023
6040	1	B604001-1	B	001A-B	Restrooms, Staff - Male	Time Clock Room Men's Restroom	02/06/2023	12	1	N/A	N/A	Synertech	02/06/2023
6040	9	B604001-1	2	200-9	Space (Tech/Vo tech)	Rabbit Room	02/06/2023	90	3	N/A	N/A	Synertech	02/06/2023

ULCS#	Element	BldgElmt ID	Floor	Space # (on Floor Plan)	Space Type	On Site Room Name	Brief Description of Renovation	Name of Assigned Renovator	Name(s) of Trained Worker(s), if used	Name of Dust Sampling Technician, Inspector, or Risk Assessor, if used	Copies of renovator and dust sampling technician qualifications (training certificates, certifications) on file	Certified renovator provided training to workers on posting warning signs
6040	1	B604001-1	1	100A-1	Storage	Classroom 100 Closet	N/A	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	1	102A	Storage	Classroom 102 Closet	N/A	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	1	103B	Storage	Classroom 103 Closet	N/A	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	1	104A	Storage	Classroom 104 Closet	N/A	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	2	200A	Storage	Classroom 200 Closet	N/A	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	2	201A	Storage	Classroom 201 Closet	N/A	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	2	202A	Storage	Classroom 202 Closet	N/A	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	2	203A	Storage	Classroom 203 Closet	N/A	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	2	204A	Storage	Classroom 204 Closet	N/A	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	2	205A	Storage	Classroom 205 Closet	N/A	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	2	208A	Storage	Classroom 208 Closet	N/A	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	B	001-B	Administrative Office	Time Clock Room	RRP	S. Hall	SDP	S. Croce	X	X
6040	1	B604001-1	B	001A-B	Restrooms, Staff - Male	Time Clock Room Men's Restroom	RRP	S. Hall	SDP	S. Croce	X	X
6040	9	B604001-1	2	200-9	Space (Tech/Vo tech)	Rabbit Room	RRP	S. Hall	SDP	S. Croce	X	X

ULCS#	Element	BldgElmt ID	Floor	Space # (on Floor Plan)	Space Type	On Site Room Name	Certified renovator provided training to workers on setting up plastic containment barriers	Certified renovator provided training to workers on maintaining containment	Certified renovator provided training to workers on avoiding spread of dust to adjacent areas	Certified renovator provided training to workers on waste handling	Certified renovator provided training to workers on post-renovation cleaning
6040	1	B604001-1	1	100A-1	Storage	Classroom 100 Closet	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	1	102A	Storage	Classroom 102 Closet	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	1	103B	Storage	Classroom 103 Closet	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	1	104A	Storage	Classroom 104 Closet	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	2	200A	Storage	Classroom 200 Closet	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	2	201A	Storage	Classroom 201 Closet	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	2	202A	Storage	Classroom 202 Closet	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	2	203A	Storage	Classroom 203 Closet	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	2	204A	Storage	Classroom 204 Closet	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	2	205A	Storage	Classroom 205 Closet	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	2	208A	Storage	Classroom 208 Closet	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	B	001-B	Administrative Office	Time Clock Room	X	X	X	X	X
6040	1	B604001-1	B	001A-B	Restrooms, Staff - Male	Time Clock Room Men's Restroom	X	X	X	X	X
6040	9	B604001-1	2	200-9	Space (Tech/Vo tech)	Rabbit Room	X	X	X	X	X

ULCS#	Element	BldgElmt ID	Floor	Space # (on Floor Plan)	Space Type	On Site Room Name	Certified renovator provided training to workers on test kit or test results from an EPA-recognized laboratory on collected paint chip sample, used by certified renovator to determine whether lead was present on components affected by renovation	If yes to the previous, identify the method used, type of test kit used (if applicable), laboratory used to conduct paint chip analysis, describe sampling location and results	Warning signs posted at entrance to work area	Work area contained to prevent spread of dust and debris	All objects in the work area removed or covered (interiors)
6040	1	B604001-1	1	100A-1	Storage	Classroom 100 Closet	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	1	102A	Storage	Classroom 102 Closet	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	1	103B	Storage	Classroom 103 Closet	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	1	104A	Storage	Classroom 104 Closet	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	2	200A	Storage	Classroom 200 Closet	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	2	201A	Storage	Classroom 201 Closet	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	2	202A	Storage	Classroom 202 Closet	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	2	203A	Storage	Classroom 203 Closet	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	2	204A	Storage	Classroom 204 Closet	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	2	205A	Storage	Classroom 205 Closet	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	2	208A	Storage	Classroom 208 Closet	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	B	001-B	Administrative Office	Time Clock Room	X	X	X	X	X
6040	1	B604001-1	B	001A-B	Restrooms, Staff - Male	Time Clock Room Men's Restroom	X	X	X	X	X
6040	9	B604001-1	2	200-9	Space (Tech/Vo tech)	Rabbit Room	X	X	X	X	X

ULCS#	Element	BldgElmt ID	Floor	Space # (on Floor Plan)	Space Type	On Site Room Name	HVAC ducts in the work area closed and covered (interiors)	Windows in the work area closed (interiors)	Doors in the work area closed and sealed (interiors)	Doors that must be used in the work area covered to allow passage but prevent spread of dust	Floors in the work area covered with taped-down plastic (interiors)	Waste contained on-site and while being transported off-site	Work site properly cleaned after renovation
6040	1	B604001-1	1	100A-1	Storage	Classroom 100 Closet	N/A	N/A	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	1	102A	Storage	Classroom 102 Closet	N/A	N/A	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	1	103B	Storage	Classroom 103 Closet	N/A	N/A	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	1	104A	Storage	Classroom 104 Closet	N/A	N/A	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	2	200A	Storage	Classroom 200 Closet	N/A	N/A	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	2	201A	Storage	Classroom 201 Closet	N/A	N/A	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	2	202A	Storage	Classroom 202 Closet	N/A	N/A	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	2	203A	Storage	Classroom 203 Closet	N/A	N/A	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	2	204A	Storage	Classroom 204 Closet	N/A	N/A	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	2	205A	Storage	Classroom 205 Closet	N/A	N/A	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	2	208A	Storage	Classroom 208 Closet	N/A	N/A	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	B	001-B	Administrative Office	Time Clock Room	X	X	X	X	X	X	X
6040	1	B604001-1	B	001A-B	Restrooms, Staff - Male	Time Clock Room Men's Restroom	X	X	X	X	X	X	X
6040	9	B604001-1	2	200-9	Space (Tech/Vo tech)	Rabbit Room	X	X	X	X	X	X	X

ULCS#	Element	BldgElmt ID	Floor	Space # (on Floor Plan)	Space Type	On Site Room Name	All chips and debris picked up, protective sheeting misted, folded dirty side inward, and taped for removal	Light lenses inspected (Y/N)	Surfaces above light fixtures inspected (Y/N)	Work area surfaces and objects cleaned using HEPA vacuum and/or wet cloths or mops (interior)	Certified renovator performed post-renovation cleaning verification	Describe the results of post-renovation cleaning verification, including the number of wet and dry cloths used
6040	1	B604001-1	1	100A-1	Storage	Classroom 100 Closet	N/A	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	1	102A	Storage	Classroom 102 Closet	N/A	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	1	103B	Storage	Classroom 103 Closet	N/A	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	1	104A	Storage	Classroom 104 Closet	N/A	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	2	200A	Storage	Classroom 200 Closet	N/A	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	2	201A	Storage	Classroom 201 Closet	N/A	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	2	202A	Storage	Classroom 202 Closet	N/A	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	2	203A	Storage	Classroom 203 Closet	N/A	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	2	204A	Storage	Classroom 204 Closet	N/A	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	2	205A	Storage	Classroom 205 Closet	N/A	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	2	208A	Storage	Classroom 208 Closet	N/A	N/A	N/A	N/A	N/A	N/A
6040	1	B604001-1	B	001-B	Administrative Office	Time Clock Room	X	X	X	X	X	X
6040	1	B604001-1	B	001A-B	Restrooms, Staff - Male	Time Clock Room Men's Restroom	X	X	X	X	X	X
6040	9	B604001-1	2	200-9	Space (Tech/Vo tech)	Rabbit Room	X	X	X	X	X	X

ULCS#	Element	BldgElmt ID	Floor	Space # (on Floor Plan)	Space Type	On Site Room Name	If dust clearance testing was performed instead, attach a copy of the report	I certify under penalty of law that the previous information is true and complete (name and title)	Date signed
6040	1	B604001-1	1	100A-1	Storage	Classroom 100 Closet	N/A	N/A	03/01/2023
6040	1	B604001-1	1	102A	Storage	Classroom 102 Closet	N/A	N/A	03/01/2023
6040	1	B604001-1	1	103B	Storage	Classroom 103 Closet	N/A	N/A	03/01/2023
6040	1	B604001-1	1	104A	Storage	Classroom 104 Closet	N/A	N/A	03/01/2023
6040	1	B604001-1	2	200A	Storage	Classroom 200 Closet	N/A	N/A	03/01/2023
6040	1	B604001-1	2	201A	Storage	Classroom 201 Closet	N/A	N/A	03/01/2023
6040	1	B604001-1	2	202A	Storage	Classroom 202 Closet	N/A	N/A	03/01/2023
6040	1	B604001-1	2	203A	Storage	Classroom 203 Closet	N/A	N/A	03/01/2023
6040	1	B604001-1	2	204A	Storage	Classroom 204 Closet	N/A	N/A	03/01/2023
6040	1	B604001-1	2	205A	Storage	Classroom 205 Closet	N/A	N/A	03/01/2023
6040	1	B604001-1	2	208A	Storage	Classroom 208 Closet	N/A	N/A	03/01/2023
6040	1	B604001-1	B	001-B	Administrative Office	Time Clock Room	X	X	02/06/2023
6040	1	B604001-1	B	001A-B	Restrooms, Staff - Male	Time Clock Room Men's Restroom	X	X	02/06/2023
6040	9	B604001-1	2	200-9	Space (Tech/Vo tech)	Rabbit Room	X	X	02/06/2023

Appendix E

Lead Safe Certificate




Philadelphia Department of Public Health Certification of School Lead Safe Status

By signing this certificate, I confirm that I have done a visual inspection of the areas where children have access, including contact surfaces where children store their equipment or materials, and confirm these areas do not have deteriorated lead-based paint. A certified risk assessor or lead dust sampling technician completed verification wipe tests in accordance with the EPA's RRP guidelines and confirms they meet the EPA's cleanliness standard. A certified risk assessor or lead dust sampling technician collected interior dust wipe samples in compliance with EPA regulations in work areas and confirms they did not contain lead contaminated dust in excess of EPA dust lead standards in Pre-K, Kindergarten, and 1st Grade classrooms as well as the restrooms, offices, cafeterias, gymnasiums, and auditoriums these children routinely occupy. This certificate is valid for 4 years from date of verification.

Walter B. Saul High School **7100 Henry Avenue, Philadelphia, PA 19128**
School Name Street Address

Synertech Environmental LLC **NAT-F199601-1**
Certifying Company (print) Risk Assessor, Lead Inspector PA Lic. #, EPA Firm Cert or Lead Dust Sampling Technician Cert #

 **03/08/2023**
Inspector/Risk Assessor or Dust Wipe Sampling Technician Name (Signature) Date of Verification

Stephen Link, 215-400-5768, slink@philasd.org
School Official Name, Telephone and E-mail Address

Appendix F

Environmental Firm Certifications

United States Environmental Protection Agency

This is to certify that



Synertech, Inc.

has fulfilled the requirements of the Toxic Substances Control Act (TSCA) Section 402, and has received certification to conduct lead-based paint renovation, repair, and painting activities pursuant to 40 CFR Part 745.89

In the Jurisdiction of:

All EPA Administered States, Tribes, and Territories

This certification is valid from the date of issuance and expires April 11, 2024

NAT-F199601-1

Certification #

March 28, 2019

Issued On



A handwritten signature in black ink that reads "Michelle Price".

Michelle Price, Chief

Lead, Heavy Metals, and Inorganics Branch

CERTIFICATE OF COMPLETION

THIS CERTIFICATE IS AWARDED TO

STEPHEN CROCE

1100 MAPLE AVENUE, CHERRY HILL, NJ 08002

FOR SUCCESSFULLY COMPLETING THE PRESCRIBED COURSE OF STUDY IN

RENOVATOR INITIAL— ENGLISH

PER 40 CFR 745.225, LEAD RRP RULE

PRESENTED BY

ACCESS TRAINING SERVICES, INC.

7921 RIVER ROAD, PENNSAUKEN, NEW JERSEY 08110

CERTIFICATE NUMBER: R-I-18846-21-00020

COURSE DATE: 4/9/21

EXAM DATE: 4/9/21

EXPIRATION DATE: 4/9/26

Mark Schlager
Training Manager



CERTIFICATE OF COMPLETION

THIS CERTIFICATE IS AWARDED TO

STEPHEN CROCE

1100 MAPLE AVENUE, CHERRY HILL, NJ 08002

FOR SUCCESSFULLY COMPLETING THE PRESCRIBED COURSE OF STUDY IN


DUST SAMPLING TECHNICIAN INITIAL- ENGLISH

PRESENTED BY
ACCESS TRAINING SERVICES, INC.
7921 RIVER ROAD, PENNSAUKEN, NEW JERSEY 08110
(856) 665-3449

CERTIFICATE NUMBER: D-I-18846-21-00155

COURSE DATE 4/5/21
EXAM DATE 4/5/21
EXPIRATION DATE 4/5/26

Mark Schlager
Training Manager

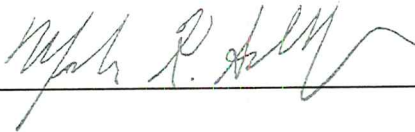

Appendix G

Paint Contractor Certifications

United States Environmental Protection Agency

This is to certify that



School District of Philadelphia Office of
Environmental Management Services

has fulfilled the requirements of the Toxic Substances Control Act (TSCA) Section 402, and has received certification to conduct lead-based paint renovation, repair, and painting activities pursuant to 40 CFR Part 745.89

In the Jurisdiction of:

All EPA Administered States, Tribes, and Territories

This certification is valid from the date of issuance and expires January 25, 2027

NAT-50914-3

Certification #

January 11, 2022

Issued On



Michelle Price, Chief

Lead, Heavy Metals, and Inorganics Branch

CRITERION LABORATORIES, INC.

400 STREET ROAD, BENSLEM, PA 19020
PHONE: (215) 244-1300, FAX: (215) 244-4349
WWW.CRITERIONLABS.COM

Certificate of Attendance and Successful Completion

Lead RRP Initial – English
Per 40 CFR Part 745.225

Nicholas Ciccolone

330 Roxborough Ave., Philadelphia, PA 19128

Certificate Number: R-I-19014-22-753596



Course Date: 2/2/2022
Examination Date: 2/2/2022
Expiration Date: 2/2/2027



JAMES A. WELTZ, CIH
Training Manager / Principal Instructor

CRITERION LABORATORIES, INC.

400 STREET ROAD, BENSLEM, PA 19020
PHONE: (215) 244-1300, FAX: (215) 244-4349
WWW.CRITERIONLABS.COM

Certificate of Attendance and Successful Completion

Lead RRP Initial – English
Per 40 CFR Part 745.225


Sean Flannery

537 Dupont St., Philadelphia, PA 19128

Certificate Number: R-I-19014-19-748936



Course Date: 5/31/2019
Examination Date: 5/31/2019
Expiration Date: 5/31/2024



JAMES A. WELTZ, CIH
Training Manager / Principal Instructor

Appendix H

**Documentation of Parent and Staff
Notification**



Saul High School
7100 Henry
Avenue,
Philadelphia, PA
19128

Principal: Samuel Howell

Phone: 215-400-3450

Notice of Paint and Plaster Stabilization Work

Dear Saul High School/Manatawna Farm Community,

The School District of Philadelphia is conducting paint and plaster stabilization work in buildings constructed prior to 1978 to help minimize the potential risk of lead exposure, and Saul High School/Manatawna Farm has been selected to be part of this important, proactive work toward creating a safer and welcoming environment for our school community.

Beginning Monday, February 6, 2023, certified environmental contractors will work in the evening, when students and staff will not occupy work areas. All paint stabilization work will be monitored by third party licensed inspectors in order to confirm the spaces are ready for students and staff to safely re-occupy. We expect this work to take two days to complete.

Paint stabilization involves removing loose, peeling, flaking and crumbling paint and plaster under controlled conditions, and then applying a non-lead based paint to the prepared surface. The goal of the District-wide effort is to enhance classroom environments and remove the potential risk of exposure to children and staff in our school community. Our school has been selected for this work because paint damage was documented in certain parts of our building.

The experts completing this work are trained and certified in U.S. Environmental Protection Agency (EPA) lead-based paint renovation, repair and painting work practices.

After the work is completed, a full report on the project will be available on the District's [Lead Safe](#) web page. For more information about lead prevention efforts, please contact the Lead Prevention Unit of the Philadelphia Department of Health at (215) 685-2788 or visit <http://www.phila.gov/health/childhoodlead>.

Thank you for your understanding as we work toward our goal of creating safer learning spaces for our students and staff.

Sincerely,

Mr. Samuel Howell, Principal