



March 13, 2024

School District of Philadelphia  
Office of Environmental Management Services  
440 North Broad Street  
Philadelphia, Pennsylvania  
Attn: Ms. Jennifer Donovan

**RE:** Philadelphia Learning Academy West/Crossroads Accelerated Academy Middle School  
Lead Safe Certification  
VERTEX Project Number: 91848  
EP2024-0219-1590

Dear Ms. Donovan:

At the request of the School District of Philadelphia's (SDP) Office of Environmental Management Services (OEMS), The Vertex Companies, LLC (VERTEX) performed an inspection throughout the Philadelphia Learning Academy West/Crossroads Accelerated Academy Middle School (ULCS Nos. 1590/8460/1450), located at 4300 Westminster Avenue in Philadelphia, PA.

The purpose of the inspection was to review each space, document all painted surfaces, test all painted surfaces with a portable X-Ray Fluorescence (XRF) direct read instrument (Niton XLp 300 Series Analyzer), which detects lead in paint, and quantify all damaged painted surfaces.

In accordance with the January 22, 2019 Philadelphia Code, Section A-703, entitled "Special Certificate of Inspection", the SDP is required to obtain a "Special Certificate of Inspection" for schools built prior to 1978. To that end, the SDP is requesting that VERTEX provide a "Lead Safe Certification", stating that the areas where children 6-years of age and younger occupy and/or access have no visibly damaged or deteriorated lead paint.

VERTEX's Pennsylvania Certified Lead Risk Assessors and Inspectors Paul Davis (License No. 060094) and Drew DiMichele (License No. 056324) performed the inspection on October 9, 2023 through October 16, 2023 and February 12, 2024 for a total of ten (10) shifts.

Painted building components in the areas that were inspected generally consisted of walls, ceilings, floors, doors, door frames, pipes, columns, beams, cove base, ductwork, stair components, and window frames. Deteriorated/damaged painted components were generally described as chipping, flaking, cracking, holes, friction, holes, peeling, and staples.

Two spaces, Storage Room 258 next to Stairwell 3 (258) and Duct Access Shaft outside Classroom D-4 (DD083) were inaccessible and could not be inspected. In addition, the Gymnasium ceiling and trusses, beams, and ductwork near the ceiling could not be accessed with the XRF because they could not be safely reached with onsite ladders. These components were visually inspected and no damage to the paint was observed.


Results of XRF instrument testing confirmed that painted building components did not contain concentrations of lead above the Philadelphia Lead Safe Level of 0.7 mg/cm<sup>2</sup> (milligrams per centimeter squared).

Refer to Attachment A for a listing of the inspected areas, tested building components, and the XRF test results.

Based upon VERTEX's inspection, the results obtained confirm that the Philadelphia Learning Academy West/Crossroads Accelerated Academy Middle School is Lead Safe. It should be noted that lead based paint may be present in concealed locations (i.e. structural steel beams). Refer to Attachment B for the Lead Safe Certificate.

If you have any questions, or require further information, please do not hesitate to contact our office.

Sincerely,  
**The Vertex Companies, LLC**

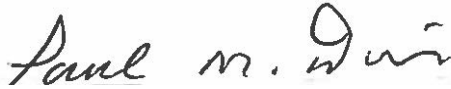

Paul Davis  
Lead Risk Assessor  
License No. 060094



Bernard Brunner  
Senior Project Manager

Attachment A  
Attachment B

Lead Safe Certification Assessment Report  
Lead Safe Certificate



**Attachment A**  
**Lead Safe Certification Assessment Report**



			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	1	130	Electrical Room 130	W1	CMU	Tan	None	0	0	Negative
1	1	130	Electrical Room 130	Door Frame	Metal	Grey	Chipping	6	0	Negative
1	1	130	Electrical Room 130	W2	Sheetrock	Tan	None	0	0	Negative
1	1	130	Electrical Room 130	W3	Sheetrock	Tan	Holes	1	0	Negative
1	1	130	Electrical Room 130	W4	CMU	Tan	None	0	0	Negative
1	1	130	Electrical Room 130	Ceiling	Metal	Unpainted	N/A	N/A	N/A	N/A
1	1	130	Electrical Room 130	Floor	Concrete	Unpainted	N/A	N/A	N/A	N/A
1	1	152	Maintenance Lounge 152	W1	CMU	White	None	0	0	Negative
1	1	152	Maintenance Lounge 152	Door Frame	Metal	Grey	Chipping	4	0	Negative
1	1	152	Maintenance Lounge 152	W2	Sheetrock	White	None	0	0	Negative

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	1	152	Maintenance Lounge 152	W3	CMU	White	None	0	0	Negative
1	1	152	Maintenance Lounge 152	W4	Sheetrock	White	None	0	0	Negative
1	1	152	Maintenance Lounge 152	Ceiling	Metal	Unpainted	N/A	N/A	N/A	N/A
1	1	152	Maintenance Lounge 152	Ceiling	Concrete	White	None	0	0	Negative
1	1	152	Maintenance Lounge 152	Floor	Concrete	Grey	Friction	30	0	Negative
1	1	153	School Supply Storage Room 153	W1	CMU	White	None	0	0	Negative
1	1	153	School Supply Storage Room 153	Door Frame	Metal	Grey	Chipping	2	0	Negative
1	1	153	School Supply Storage Room 153	W2	Sheetrock	White	Chipping	10	0	Negative

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	1	153	School Supply Storage Room 153	W3	CMU	White	Chipping	1	0	Negative
1	1	153	School Supply Storage Room 153	W3	Sheetrock	White	Chipping	4	0	Negative
1	1	153	School Supply Storage Room 153	W4	Sheetrock	White	Chipping/Friction	6	0	Negative
1	1	153	School Supply Storage Room 153	Ceiling	2x2 CT	Unpainted	N/A	N/A	N/A	N/A
1	1	153	School Supply Storage Room 153	Ceiling	Concrete	Unpainted	N/A	N/A	N/A	N/A
1	1	153	School Supply Storage Room 153	Floor	12x12 VAT	Unpainted	N/A	N/A	N/A	N/A
1	1	154	Storage Closet next to Storage Room 153	W1	CMU	White	None	0	0	Negative
1	1	154	Storage Closet next to Storage Room 153	Door Frame	Metal	Grey	Chipping	2	0	Negative
1	1	154	Storage Closet next to Storage Room 153	W2	CMU	White	Chipping	1	0	Negative

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	1	154	Storage Closet next to Storage Room 153	W3	Sheetrock	White	None	0	0	Negative
1	1	154	Storage Closet next to Storage Room 153	W4	CMU	White	None	0	0	Negative
1	1	154	Storage Closet next to Storage Room 153	Ceiling	Concrete	White	Chipping	3	0	Negative
1	1	154	Storage Closet next to Storage Room 153	Pipes	Metal	White	Chipping	10	0	Negative
1	1	154	Storage Closet next to Storage Room 153	Column	CMU	White	Chipping	3	0	Negative
1	1	154	Storage Closet next to Storage Room 153	Floor	Carpet	Unpainted	N/A	N/A	N/A	N/A
1	1	157	IT Room 157	W1	CMU	Grey	None	0	0	Negative
1	1	157	IT Room 157	Door Frame	Metal	Grey	Chipping	2	0	Negative
1	1	157	IT Room 157	W2	Sheetrock	Grey	Chipping	2	0	Negative

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	1	157	IT Room 157	W3	CMU	Grey	None	0	0	Negative
1	1	157	IT Room 157	W4	Sheetrock	Grey	Peeling	1	0	Negative
1	1	157	IT Room 157	Ceiling	2x2 CT	Unpainted	N/A	N/A	N/A	N/A
1	1	157	IT Room 157	Ceiling	Concrete	Unpainted	N/A	N/A	N/A	N/A
1	1	157	IT Room 157	Column	Concrete	Grey	Chipping	6	0	Negative
1	1	157	IT Room 157	Floor	Carpet	Unpainted	N/A	N/A	N/A	N/A
1	1	157C	Closet in Storage Room 157	W1	Sheetrock	Grey	None	0	0	Negative
1	1	157C	Closet in Storage Room 157	Door Frame	Metal	Grey	None	0	0	Negative
1	1	157C	Closet in Storage Room 157	W2	CMU	Grey	None	0	0	Negative



			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	1	157C	Closet in Storage Room 157	W3	CMU	Grey	None	0	0	Negative
1	1	157C	Closet in Storage Room 157	W4	CMU	Grey	None	0	0	Negative
1	1	157C	Closet in Storage Room 157	Ceiling	Concrete	White	Flaking	8	0	Negative
1	1	157C	Closet in Storage Room 157	Pipes	Metal	White	None	0	0	Negative
1	1	157C	Storage Room 157C	Floor	Concrete	Unpainted	N/A	N/A	N/A	N/A
1	1	158	Classroom 158	W1	CMU	White	None	0	0	Negative
1	1	158	Classroom 158	Door Frame	Metal	Grey	Chipping	4	0	Negative
1	1	158	Classroom 158	W2	CMU	White	None	0	0	Negative
1	1	158	Classroom 158	W3	CMU	White	None	0	0	Negative
1	1	158	Classroom 158	W4	CMU	White	None	0	0	Negative

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	1	158	Classroom 158	Ceiling	Metal	White	None	0	0	Negative
1	1	158	Classroom 158	Exterior, Ductwork	Metal	White	None	0	0	Negative
1	1	158	Classroom 158	Pipes	Metal	White	None	0	0	Negative
1	1	158	Classroom 158	Beam Covers	Sheetrock	White	None	0	0	Negative
1	1	158	Classroom 158	Floor	Carpet	Unpainted	N/A	N/A	N/A	N/A
1	1	158RR	Classroom 158 Restroom	W1	CMU	Grey	None	0	0	Negative
1	1	158RR	Classroom 158 Restroom	Door Frame	Metal	Grey	None	0	0	Negative
1	1	158RR	Classroom 158 Restroom	W2	Ceramic Tiles	Unpainted	N/A	N/A	N/A	N/A
1	1	158RR	Classroom 158 Restroom	W3	CMU	Grey	None	0	0	Negative

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	1	158RR	Classroom 158 Restroom	W4	CMU	Grey	None	0	0	Negative
1	1	158RR	Classroom 158 Restroom	Ceiling	Sheetrock	White	None	0	0	Negative
1	1	158RR	Classroom 158 Restroom	Floor	Ceramic Tiles	Unpainted	N/A	N/A	N/A	N/A
1	1	159	Computer Storage Room 159 off IT Room 157	W1	Sheetrock	Grey	Chipping	4	0	Negative
1	1	159	Computer Storage Room 159 off IT Room 157	Door Frame	Metal	Grey	Chipping	2	0	Negative
1	1	159	Computer Storage Room 159 off IT Room 157	W2	CMU	Grey	None	0	0	Negative
1	1	159	Computer Storage Room 159 off IT Room 157	W3	CMU	Grey	None	0	0	Negative
1	1	159	Computer Storage Room 159 off IT Room 157	W4	Sheetrock	Grey	Chipping	8	0	Negative

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	1	159	Computer Storage Room 159 off IT Room 157	Ceiling	Concrete	Grey	Chipping	3	0	Negative
1	1	159	Computer Storage Room 159 off IT Room 157	Pipes	Metal	Grey	Chipping	5	0	Negative
1	1	159	Computer Storage Room 159 off IT Room 157	Column	Concrete	Grey	Chipping	8	0	Negative
1	1	159	Computer Storage Room 159 off IT Room 157	Floor	Concrete	Unpainted	N/A	N/A	N/A	N/A
1	1	160	IT Server Room 160 off IT Room 157	W1	CMU	Grey	None	0	0	Negative
1	1	160	IT Server Room 160 off IT Room 157	W1	Sheetrock	Grey	Chipping	1	0	Negative
1	1	160	IT Server Room 160 off IT Room 157	Door Frame	Metal	Grey	None	0	0	Negative
1	1	160	IT Server Room 160 off IT Room 157	W2	Sheetrock	Grey	Chipping	2	0	Negative
1	1	160	IT Server Room 160 off IT Room 157	W3	CMU	Grey	None	0	0	Negative

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	1	160	IT Server Room 160 off IT Room 157	W4	CMU	Grey	None	0	0	Negative
1	1	160	IT Server Room 160 off IT Room 157	Cable Panel	Wood	Grey	None	0	0	Negative
1	1	160	IT Server Room 160 off IT Room 157	Ceiling	Concrete	White	None	0	0	Negative
1	1	160	IT Server Room 160 off IT Room 157	Beam	Concrete	White	None	0	0	Negative
1	1	160	IT Server Room 160 off IT Room 157	Pipes	Concrete	White	None	0	0	Negative
1	1	160	IT Server Room 160 off IT Room 157	Floor	Concrete	Unpainted	N/A	N/A	N/A	N/A
1	1	163	Storage Room 163	W1	CMU	Grey	None	0	0	Negative
1	1	163	Storage Room 163	Door Frame	Metal	Grey	Chipping	2	0	Negative
1	1	163	Storage Room 163	W2	CMU	Grey	None	0	0	Negative
1	1	163	Storage Room 163	W3	Sheetrock	Grey	None	0	0	Negative

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	1	163	Storage Room 163	W4	CMU	Grey	None	0	0	Negative
1	1	163	Storage Room 163	Ceiling	Concrete	White	Flaking	100	0.01	Negative
1	1	163	Storage Room 163	Beam	Concrete	White	None	0	0	Negative
1	1	163	Storage Room 163	Pipes	Metal	White	None	0	0	Negative
1	1	163	Storage Room 163	Floor	Concrete	Unpainted	N/A	N/A	N/A	N/A
1	1	167	Teacher Lounge 167 next to Stairwell 3	W1	CMU	White	Chipping	1	0	Negative
1	1	167	Teacher Lounge 167 next to Stairwell 3	Door Frame	Metal	Grey	Chipping	3	0	Negative
1	1	167	Teacher Lounge 167 next to Stairwell 3	Pipes	Metal	White	None	0	0	Negative
1	1	167	Teacher Lounge 167 next to Stairwell 3	W2	CMU	White	Chipping	2	0	Negative

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	1	167	Teacher Lounge 167 next to Stairwell 3	W3	CMU	White	None	0	0.02	Negative
1	1	167	Teacher Lounge 167 next to Stairwell 3	W4	Sheetrock	White	Chipping	8	0	Negative
1	1	167	Teacher Lounge 167 next to Stairwell 3	Ceiling	2x2 CT	Unpainted	N/A	N/A	N/A	N/A
1	1	167	Teacher Lounge 167 next to Stairwell 3	Ceiling	Concrete	Unpainted	N/A	N/A	N/A	N/A
1	1	167	Teacher Lounge 167 next to Stairwell 3	Floor	12x12 VAT	Unpainted	N/A	N/A	N/A	N/A
1	1	168	Electrical Room 168	W1	CMU	Grey	None	0	0.01	Negative
1	1	168	Electrical Room 168	Door Frame	Metal	Grey	Chipping	2	0	Negative
1	1	168	Electrical Room 168	W2	CMU	Grey	None	0	0	Negative
1	1	168	Electrical Room 168	W3	CMU	Grey	None	0	0	Negative
1	1	168	Electrical Room 168	W4	Sheetrock	Grey	Chipping	2	0	Negative

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	1	168	Electrical Room 168	Ceiling	Concrete	White	None	0	0	Negative
1	1	168	Electrical Room 168	Beam	Concrete	White	None	0	0	Negative
1	1	168	Electrical Room 168	Floor	Concrete	Unpainted	N/A	N/A	N/A	N/A
1	1	168A	Storage Room 169	W1	CMU	Grey	Chipping	2	0	Negative
1	1	168A	Storage Room 169	Door Frame	Metal	Grey	Chipping	3	0	Negative
1	1	168A	Storage Room 169	W2	Sheetrock	Grey	Chipping	3	0	Negative
1	1	168A	Storage Room 169	W3	CMU	Grey	None	0	0	Negative
1	1	168A	Storage Room 169	W4	CMU	Grey	Chipping	4	0	Negative
1	1	168A	Storage Room 169	Ceiling	Concrete	White	None	0	0.01	Negative



			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	1	168A	Storage Room 169	Exterior, Ductwork	Metal	White	None	0	0.04	Negative
1	1	168A	Storage Room 169	Pipes	Metal	White	Chipping	10	0	Negative
1	1	168A	Storage Room 169	Floor	Concrete	Unpainted	N/A	N/A	N/A	N/A
1	1	170	Building Engineer's Office 170	W1	CMU	White	None	0	0	Negative
1	1	170	Building Engineer's Office 170	Door Frame	Metal	Grey	None	0	0	Negative
1	1	170	Building Engineer's Office 170	W2	Sheetrock	White	Staples	10	0	Negative
1	1	170	Building Engineer's Office 170	W3	Sheetrock	Tan	Holes	1	0	Negative
1	1	170	Building Engineer's Office 170	W4	Sheetrock	White	Staples	6	0	Negative
1	1	170	Building Engineer's Office 170	Ceiling	2x2 CT	Unpainted	N/A	N/A	N/A	N/A

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	1	170	Building Engineer's Office 170	Ceiling	Concrete	Grey	None	0	0	Negative
1	1	170	Building Engineer's Office 170	Floor	Carpet	Unpainted	N/A	N/A	N/A	N/A
1	1	171	Director of Student Services Office 171	W1	CMU	White	None	0	0	Negative
1	1	171	Director of Student Services Office 171	Door Frame	Metal	Grey	Chipping	1	0	Negative
1	1	171	Director of Student Services Office 171	W2	Sheetrock	White	Chipping	1	0	Negative
1	1	171	Director of Student Services Office 171	W3	Sheetrock	Tan	Chipping	2	0	Negative
1	1	171	Director of Student Services Office 171	W4	CMU	White	None	0	0	Negative
1	1	171	Director of Student Services Office 171	Ceiling	2x2 CT	Unpainted	N/A	N/A	N/A	N/A
1	1	171	Director of Student Services Office 171	Ceiling	Concrete	Grey	None	0	0	Negative

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	1	171	Director of Student Services Office 171	Floor	Carpet	Unpainted	N/A	N/A	N/A	N/A
1	1	172	Office 172	W1	Sheetrock	White	None	0	0	Negative
1	1	172	Office 172	Door	Metal	Grey	Chipping	2	0	Negative
1	1	172	Office 172	Door Frame	Metal	Grey	Chipping	6	0	Negative
1	1	172	Office 172	W2	CMU	White	None	0	0	Negative
1	1	172	Office 172	W3	CMU	White	None	0	0	Negative
1	1	172	Office 172	W4	CMU	White	None	0	0	Negative
1	1	172	Office 172	Ceiling	2x2 CT	Unpainted	N/A	N/A	N/A	N/A
1	1	172	Office 172	Ceiling	Concrete	Grey	None	0	0	Negative
1	1	172	Office 172	Floor	Carpet	Unpainted	N/A	N/A	N/A	N/A

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	1	173	Conference Room 173 in Stairwell 2	W1	CMU	White	None	0	0	Negative
1	1	173	Conference Room 173 in Stairwell 2	Door Frame	Metal	Grey	Chipping	1	0	Negative
1	1	173	Conference Room 173 in Stairwell 2	W2	CMU	White	None	0	0	Negative
1	1	173	Conference Room 173 in Stairwell 2	W3	CMU	White	None	0	0	Negative
1	1	173	Conference Room 173 in Stairwell 2	W4	CMU	White	None	0	0	Negative
1	1	173	Conference Room 173 in Stairwell 2	Ceiling	2x2 CT	Unpainted	N/A	N/A	N/A	N/A
1	1	173	Conference Room 173 in Stairwell 2	Ceiling	Concrete	Grey	Flaking	250	0	Negative
1	1	173	Conference Room 173 in Stairwell 2	Floor	Carpet	Unpainted	N/A	N/A	N/A	N/A

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	1	173A	Fire Pump Room off Room 173 Exit Vestibule	W1	CMU	Unpainted	N/A	N/A	N/A	N/A
1	1	173A	Fire Pump Room off Room 173 Exit Vestibule	Door	Metal	Grey	None	0	0	Negative
1	1	173A	Fire Pump Room off Room 173 Exit Vestibule	Door Frame	Metal	Grey	None	0	0	Negative
1	1	173A	Fire Pump Room off Room 173 Exit Vestibule	W2	CMU	Unpainted	N/A	N/A	N/A	N/A
1	1	173A	Fire Pump Room off Room 173 Exit Vestibule	W3	CMU	Unpainted	N/A	N/A	N/A	N/A
1	1	173A	Fire Pump Room off Room 173 Exit Vestibule	W4	CMU	Unpainted	N/A	N/A	N/A	N/A
1	1	173A	Fire Pump Room off Room 173 Exit Vestibule	Ceiling	Concrete	Black	Flaking	80	0	Negative
1	1	173A	Fire Pump Room off Room 173 Exit Vestibule	Ladder	Metal	Red	Chipping	2	0	Negative
1	1	173A	Fire Pump Room off Room 173 Exit Vestibule	Floor	Concrete	Unpainted	N/A	N/A	N/A	N/A
1	1	E-1-0	Electrical Room off Room 173 Exit Vestibule	W1	CMU	Unpainted	N/A	N/A	N/A	N/A
1	1	E-1-0	Electrical Room off Room 173 Exit Vestibule	Door	Metal	Grey	None	0	0	Negative

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	1	E-1-0	Electrical Room off Room 173 Exit Vestibule	Door Frame	Metal	Grey	None	0	0	Negative
1	1	E-1-0	Electrical Room off Room 173 Exit Vestibule	W2	CMU	Unpainted	N/A	N/A	N/A	N/A
1	1	E-1-0	Electrical Room off Room 173 Exit Vestibule	W3	CMU	Unpainted	N/A	N/A	N/A	N/A
1	1	E-1-0	Electrical Room off Room 173 Exit Vestibule	W4	CMU	Unpainted	N/A	N/A	N/A	N/A
1	1	E-1-0	Electrical Room off Room 173 Exit Vestibule	Ceiling	Concrete	Black	Flaking	20	0	Negative
1	1	E-1-0	Electrical Room off Room 173 Exit Vestibule	Floor	Concrete	Unpainted	N/A	N/A	N/A	N/A
1	1	E-1-0	Electrical Room off Room 173 Exit Vestibule	Handrail	Metal	Red	Friction	2	0	Negative
1	1	173RR	Conference Room 173 Restroom	W1	CMU	White	None	0	0	Negative
1	1	173RR	Conference Room 173 Restroom	Door Frame	Metal	Grey	None	0	0.01	Negative
1	1	173RR	Conference Room 173 Restroom	W2	CMU	White	None	0	0	Negative
1	1	173RR	Conference Room 173 Restroom	W3	Ceramic Tiles	Unpainted	N/A	N/A	N/A	N/A

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	1	173RR	Conference Room 173 Restroom	W4	CMU	White	None	0	0	Negative
1	1	173RR	Conference Room 173 Restroom	Ceiling	Sheetrock	White	None	0	0	Negative
1	1	173RR	Conference Room 173 Restroom	Floor	Ceramic Tiles	Unpainted	N/A	N/A	N/A	N/A
1	1	173V	Conference Room 173 Exit Vestibule	W1	CMU	White	None	0	0	Negative
1	1	173V	Conference Room 173 Exit Vestibule	Door Frame	Metal	Grey	Chipping	1	0	Negative
1	1	173V	Conference Room 173 Exit Vestibule	W2	CMU	White	None	0	0	Negative
1	1	173V	Conference Room 173 Exit Vestibule	W3	CMU	White	None	0	0	Negative
1	1	173V	Conference Room 173 Exit Vestibule	Door	Metal	Grey	None	0	0	Negative
1	1	173V	Conference Room 173 Exit Vestibule	Door Frame	Metal	Grey	None	0	0	Negative

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	1	173V	Conference Room 173 Exit Vestibule	W4	CMU	White	None	0	0.02	Negative
1	1	173V	Conference Room 173 Exit Vestibule	Ceiling	2x2 CT	Unpainted	N/A	N/A	N/A	N/A
1	1	173V	Conference Room 173 Exit Vestibule	Ceiling	Concrete	Grey	Chipping	20	0.01	Negative
1	1	173V	Conference Room 173 Exit Vestibule	Floor	12x12 VAT	Unpainted	N/A	N/A	N/A	N/A
1	1	175	Office 175 off Conference Room 173	W1	CMU	White	None	0	0	Negative
1	1	175	Office 175 off Conference Room 173	Door Frame	Metal	Grey	None	0	0	Negative
1	1	175	Office 175 off Conference Room 173	W2	CMU	White	None	0	0	Negative
1	1	175	Office 175 off Conference Room 173	W3	CMU	White	None	0	0	Negative
1	1	175	Office 175 off Conference Room 173	Pipes	Metal	White	None	0	0	Negative



			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	1	175	Office 175 off Conference Room 173	W4	CMU	White	None	0	0	Negative
1	1	175	Office 175 off Conference Room 173	Ceiling	2x2 CT	Unpainted	N/A	N/A	N/A	N/A
1	1	175	Office 175 off Conference Room 173	Ceiling	Concrete	Unpainted	N/A	N/A	N/A	N/A
1	1	175	Office 175 off Conference Room 173	Floor	Carpet	Unpainted	N/A	N/A	N/A	N/A
1	1	L1	Main Office Suite Lobby/Reception Area	W1	Sheetrock	White	None	0	0	Negative
1	1	L1	Main Office Suite Lobby/Reception Area	Door Frame	Metal	Grey	Chipping	2	0	Negative
1	1	L1	Main Office Suite Lobby/Reception Area	W2	Sheetrock	White	Chipping	6	0	Negative
1	1	L1	Main Office Suite Lobby/Reception Area	Door Frame	Metal	Grey	Chipping	2	0	Negative
1	1	L1	Main Office Suite Lobby/Reception Area	W3	Sheetrock	White	Chipping	1	0	Negative
1	1	L1	Main Office Suite Lobby/Reception Area	W4	Sheetrock	White	Chipping	1	0	Negative

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	1	L1	Main Office Suite Lobby/Reception Area	Ceiling	2x2 CT	Unpainted	N/A	N/A	N/A	N/A
1	1	L1	Main Office Suite Lobby/Reception Area	Ceiling	Concrete	Unpainted	N/A	N/A	N/A	N/A
1	1	L1	Main Office Suite Lobby/Reception Area	Floor	Carpet	Unpainted	N/A	N/A	N/A	N/A
1	1	183	Main Office Suite - Office 183	W1	Sheetrock	White	None	0	0	Negative
1	1	183	Main Office Suite - Office 183	Door Frame	Metal	Grey	None	0	0	Negative
1	1	183	Main Office Suite - Office 183	W2	Sheetrock	White	None	0	0	Negative
1	1	183	Main Office Suite - Office 183	W3	Sheetrock	White	None	0	0	Negative
1	1	183	Main Office Suite - Office 183	W4	Sheetrock	White	None	0	0	Negative
1	1	183	Main Office Suite - Office 183	Ceiling	2x2 CT	Unpainted	N/A	N/A	N/A	N/A
1	1	183	Main Office Suite - Office 183	Ceiling	Concrete	Unpainted	N/A	N/A	N/A	N/A
1	1	183	Main Office Suite - Office 183	Floor	Carpet	Unpainted	N/A	N/A	N/A	N/A
1	1	184	Main Office Suite - Office 184	W1	Sheetrock	White	None	0	0	Negative
1	1	184	Main Office Suite - Office 184	Door Frame	Metal	Grey	None	0	0	Negative

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	1	184	Main Office Suite - Office 184	W2	Sheetrock	Tan	None	0	0	Negative
1	1	184	Main Office Suite - Office 184	W3	Sheetrock	White	None	0	0	Negative
1	1	184	Main Office Suite - Office 184	Door Frame	Metal	Grey	None	0	0	Negative
1	1	184	Main Office Suite - Office 184	W4	Sheetrock	White	Chipping	2	0	Negative
1	1	184	Main Office Suite - Office 184	Ceiling	2x2 CT	Unpainted	N/A	N/A	N/A	N/A
1	1	184	Main Office Suite - Office 184	Ceiling	Concrete	Unpainted	N/A	N/A	N/A	N/A
1	1	184	Main Office Suite - Office 184	Floor	Carpet	Unpainted	N/A	N/A	N/A	N/A
1	1	185	Main Office Suite - Office 185	W1	Sheetrock	White	None	0	0	Negative
1	1	185	Main Office Suite - Office 185	Door Frame	Metal	Grey	Chipping	1	0	Negative
1	1	185	Main Office Suite - Office 185	W2	Sheetrock	White	None	0	0	Negative
1	1	185	Main Office Suite - Office 185	W3	Sheetrock	Tan	None	0	0	Negative

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	1	185	Main Office Suite - Office 185	W4	Sheetrock	White	None	0	0	Negative
1	1	185	Main Office Suite - Office 185	Ceiling	2x2 CT	Unpainted	N/A	N/A	N/A	N/A
1	1	185	Main Office Suite - Office 185	Ceiling	Concrete	Unpainted	N/A	N/A	N/A	N/A
1	1	185	Main Office Suite - Office 185	Floor	Carpet	Unpainted	N/A	N/A	N/A	N/A
1	1	186	Main Office Suite - Office 186	W1	Sheetrock	White	None	0	0	Negative
1	1	186	Main Office Suite - Office 186	Door Frame	Metal	Grey	None	0	0	Negative
1	1	186	Main Office Suite - Office 186	W2	Sheetrock	White	None	0	0	Negative
1	1	186	Main Office Suite - Office 186	W3	Sheetrock	White	None	0	0	Negative
1	1	186	Main Office Suite - Office 186	W4	Sheetrock	White	None	0	0	Negative
1	1	186	Main Office Suite - Office 186	Ceiling	2x2 CT	Unpainted	N/A	N/A	N/A	N/A
1	1	186	Main Office Suite - Office 186	Ceiling	Concrete	Unpainted	N/A	N/A	N/A	N/A

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	1	186	Main Office Suite - Office 186	Floor	Carpet	Unpainted	N/A	N/A	N/A	N/A
1	1	None Assigned	Storage Room next to Office 186	W1	Sheetrock	White	None	0	0	Negative
1	1	None Assigned	Storage Room next to Office 186	Door Frame	Metal	Grey	None	0	0	Negative
1	1	None Assigned	Storage Room next to Office 186	W2	Sheetrock	White	None	0	0	Negative
1	1	None Assigned	Storage Room next to Office 186	W3	Sheetrock	Tan	None	0	0	Negative
1	1	None Assigned	Storage Room next to Office 186	W4	Sheetrock	White	Holes	1	0	Negative
1	1	None Assigned	Storage Room next to Office 186	Ceiling	2x2 CT	Unpainted	N/A	N/A	N/A	N/A
1	1	None Assigned	Storage Room next to Office 186	Ceiling	Concrete	Unpainted	N/A	N/A	N/A	N/A
1	1	None Assigned	Storage Room next to Office 186	Floor	Carpet	Unpainted	N/A	N/A	N/A	N/A
1	1	MR	Main Office Suite - Meeting Room	W1	Sheetrock	White	Chipping	2	0	Negative
1	1	MR	Main Office Suite - Meeting Room	Door Frame	Metal	Grey	Chipping	2	0	Negative

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	1	MR	Main Office Suite - Meeting Room	W2	Sheetrock	White	Chipping	6	0	Negative
1	1	MR	Main Office Suite - Meeting Room	W3	Sheetrock	White	None	0	0	Negative
1	1	MR	Main Office Suite - Meeting Room	W4	Sheetrock	Tan	None	0	0	Negative
1	1	MR	Main Office Suite - Meeting Room	Ceiling	2x2 CT	Unpainted	N/A	N/A	N/A	N/A
1	1	MR	Main Office Suite - Meeting Room	Ceiling	Concrete	Unpainted	N/A	N/A	N/A	N/A
1	1	MR	Main Office Suite - Meeting Room	Floor	Carpet	Unpainted	N/A	N/A	N/A	N/A
1	1	188	Kitchen Laundry Room 188	W1	CMU	White	None	0	0	Negative
1	1	188	Kitchen Laundry Room 188	Door Frame	Metal	Grey	Chipping	4	0	Negative
1	1	188	Kitchen Laundry Room 188	W2	CMU	White	None	0	0	Negative
1	1	188	Kitchen Laundry Room 188	W3	Sheetrock	White	Chipping	2	0	Negative
1	1	188	Kitchen Laundry Room 188	W4	Sheetrock	White	None	0	0	Negative

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	1	188	Kitchen Laundry Room 188	Ceiling	Concrete	White	None	0	0	Negative
1	1	188	Kitchen Laundry Room 188	Pipes	Metal	White	Chipping	3	0	Negative
1	1	188	Kitchen Laundry Room 188	Floor	Concrete	Grey	Cracking	2	0	Negative
1	1	188A	Kitchen Staff Restroom	W1	Ceramic Tiles	Unpainted	N/A	N/A	N/A	N/A
1	1	188A	Kitchen Staff Restroom	Door Frame	Metal	Grey	None	0	0	Negative
1	1	188A	Kitchen Staff Restroom	W2	Ceramic Tiles	Unpainted	N/A	N/A	N/A	N/A
1	1	188A	Kitchen Staff Restroom	W3	Ceramic Tiles	Unpainted	N/A	N/A	N/A	N/A
1	1	188A	Kitchen Staff Restroom	W4	Ceramic Tiles	Unpainted	N/A	N/A	N/A	N/A
1	1	188A	Kitchen Staff Restroom	Ceiling	Sheetrock	White	None	0	0	Negative
1	1	188A	Kitchen Staff Restroom	Floor	Ceramic Tiles	Unpainted	N/A	N/A	N/A	N/A
1	1	192	Kitchen Office 192	W1	CMU	White	Friction	3	0	Negative

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	1	192	Kitchen Office 192	Door Frame	Metal	Grey	Chipping	2	0	Negative
1	1	192	Kitchen Office 192	W2	Sheetrock	White	Chipping	4	0	Negative
1	1	192	Kitchen Office 192	W3	Sheetrock	White	Chipping	3	0	Negative
1	1	192	Kitchen Office 192	W4	CMU	White	None	0	0	Negative
1	1	192	Kitchen Office 192	Ceiling	2x2 CT	Unpainted	N/A	N/A	N/A	N/A
1	1	192	Kitchen Office 192	Ceiling	Concrete	Unpainted	N/A	N/A	N/A	N/A
1	1	192	Kitchen Office 192	Floor	Concrete	Grey	Chipping	55	0	Negative
1	1	A-1	Classroom A-1	W1	CMU	White	None	0	0	Negative
1	1	A-1	Classroom A-1	Door Frame	Metal	Grey	Chipping	4	0	Negative
1	1	A-1	Classroom A-1	W2	CMU	White	None	0	0	Negative



			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	1	A-1	Classroom A-1	Door Frame	Metal	Grey	Chipping	4	0	Negative
1	1	A-1	Classroom A-1	W3	CMU	White	None	0	0	Negative
1	1	A-1	Classroom A-1	W4	CMU	Tan	None	0	0	Negative
1	1	A-1	Classroom A-1	Textured Ceiling Paint	Concrete	White	None	0	0	Negative
1	1	A-1	Classroom A-1	Exterior, Ductwork	Metal	White	Chipping	1	0	Negative
1	1	A-1	Classroom A-1	Column	Concrete	White	None	0	0	Negative
1	1	A-1	Classroom A-1	Pipes	Metal	White	Chipping	2	0	Negative
1	1	A-1	Classroom A-1	Floor	Carpet	Unpainted	N/A	N/A	N/A	N/A
1	1	A-1-2	Restroom Vestibule between Classrooms A-1 and A-2	W1	CMU	White	None	0	0	Negative

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	1	A-1-2	Restroom Vestibule between Classrooms A-1 and A-2	W2	CMU	White	Hole	1	0	Negative
1	1	A-1-2	Restroom Vestibule between Classrooms A-1 and A-2	W3	CMU	White	None	0	0	Negative
1	1	A-1-2	Restroom Vestibule between Classrooms A-1 and A-2	W4	CMU	White	Holes	1	0	Negative
1	1	A-1-2	Restroom Vestibule between Classrooms A-1 and A-2	Ceiling	Sheetrock	White	Chipping	1	0	Negative
1	1	A-1-2	Restroom Vestibule between Classrooms A-1 and A-2	Floor	Carpet	Unpainted	N/A	N/A	N/A	N/A
1	1	A-1-2M	Boy's Restroom between Classrooms A-1 and A-2	W1	CMU	Grey	None	0	0	Negative
1	1	A-1-2M	Boy's Restroom between Classrooms A-1 and A-2	Door Frame	Metal	Grey	Chipping	2	0	Negative
1	1	A-1-2M	Boy's Restroom between Classrooms A-1 and A-2	W2	CMU	Grey	None	0	0	Negative

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	1	A-1-2M	Boy's Restroom between Classrooms A-1 and A-2	W3	Ceramic Tiles	Unpainted	N/A	N/A	N/A	N/A
1	1	A-1-2M	Boy's Restroom between Classrooms A-1 and A-2	W4	CMU	Grey	None	0	0	Negative
1	1	A-1-2M	Boy's Restroom between Classrooms A-1 and A-2	Ceiling	Sheetrock	White	None	0	0	Negative
1	1	A-1-2M	Boy's Restroom between Classrooms A-1 and A-2	Floor	Ceramic Tiles	Unpainted	N/A	N/A	N/A	N/A
1	1	A-1-2W	Girl's Restroom between Classrooms A-1 and A-2	W1	CMU	Grey	None	0	0	Negative
1	1	A-1-2W	Girl's Restroom between Classrooms A-1 and A-2	Door Frame	Metal	Grey	Chipping	2	0	Negative
1	1	A-1-2W	Girl's Restroom between Classrooms A-1 and A-2	W2	CMU	Grey	None	0	0	Negative
1	1	A-1-2W	Girl's Restroom between Classrooms A-1 and A-2	W3	Ceramic Tiles	Unpainted	N/A	N/A	N/A	N/A
1	1	A-1-2W	Girl's Restroom between Classrooms A-1 and A-2	W4	CMU	Grey	None	0	0	Negative

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	1	A-1-2W	Girl's Restroom between Classrooms A-1 and A-2	Ceiling	Sheetrock	White	None	0	0	Negative
1	1	A-1-2W	Girl's Restroom between Classrooms A-1 and A-2	Access Panel	Metal	White	Chipping	2	0	Negative
1	1	A-1-2W	Girl's Restroom between Classrooms A-1 and A-2	Floor	Ceramic Tiles	Unpainted	N/A	N/A	N/A	N/A
1	1	A-1CL	Classroom A-1 Closet	W1	CMU	White	None	0	0	Negative
1	1	A-1CL	Classroom A-1 Closet	W2	Sheetrock	White	None	0	0	Negative
1	1	A-1CL	Classroom A-1 Closet	W3	Sheetrock	White	Chipping	4	0	Negative
1	1	A-1CL	Classroom A-1 Closet	W4	CMU	White	None	0	0	Negative
1	1	A-1CL	Classroom A-1 Closet	Ceiling	Sheetrock	White	Chipping	1	0	Negative

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	1	A-1CL	Classroom A-1 Closet	Floor	Carpet	Unpainted	N/A	N/A	N/A	N/A
1	1	A-2	Classroom A-2	W1	CMU	White	None	0	0	Negative
1	1	A-2	Classroom A-2	Door Frame	Metal	Grey	Chipping	6	0	Negative
1	1	A-2	Classroom A-2	W2	CMU	Green	Chipping	2	0	Negative
1	1	A-2	Classroom A-2	W3	CMU	White	None	0	0	Negative
1	1	A-2	Classroom A-2	W4	CMU	White	None	0	0	Negative
1	1	A-2	Classroom A-2	Door Frame	Metal	Grey	Chipping	6	0	Negative
1	1	A-2	Classroom A-2	Textured Ceiling Paint	Concrete	White	None	0	0	Negative
1	1	A-2	Classroom A-2	Pipes	Metal	White	Chipping	6	0	Negative

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	1	A-2	Classroom A-2	Column	Concrete	White	Chipping	2	0	Negative
1	1	A-2	Classroom A-2	Floor	Carpet	Unpainted	N/A	N/A	N/A	N/A
1	1	A-2CL	Classroom A-2 Closet	W1	CMU	White	None	0	0	Negative
1	1	A-2CL	Classroom A-2 Closet	W2	CMU	White	None	0	0	Negative
1	1	A-2CL	Classroom A-2 Closet	W3	Sheetrock	White	None	0	0	Negative
1	1	A-2CL	Classroom A-2 Closet	W4	Sheetrock	White	Chipping	1	0	Negative
1	1	A-2CL	Classroom A-2 Closet	Ceiling	Sheetrock	White	None	0	0	Negative
1	1	A-2CL	Classroom A-2 Closet	Floor	Carpet	Unpainted	N/A	N/A	N/A	N/A
1	1	A-3	Classroom A-3	W1	CMU	White	Chipping	4	0	Negative

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	1	A-3	Classroom A-3	Door Frame	Metal	Grey	Chipping	2	0	Negative
1	1	A-3	Classroom A-3	W2	CMU	White	Chipping	2	0	Negative
1	1	A-3	Classroom A-3	Door Frame	Metal	Grey	None	0	0	Negative
1	1	A-3	Classroom A-3	W3	CMU	White	None	0	0	Negative
1	1	A-3	Classroom A-3	W4	CMU	Blue	Chipping	2	0	Negative
1	1	A-3	Classroom A-3	Door Frame	Metal	Grey	Chipping	1	0	Negative
1	1	A-3	Classroom A-3	Textured Ceiling Paint	Concrete	White	None	0	0	Negative
1	1	A-3	Classroom A-3	Pipes	Metal	White	Chipping	15	0	Negative
1	1	A-3	Classroom A-3	Exterior, Ductwork	Metal	White	None	0	0	Negative
1	1	A-3	Classroom A-3	Column	Concrete	White	Chipping	8	0	Negative

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	1	A-3	Classroom A-3	Floor	Carpet	Unpainted	N/A	N/A	N/A	N/A
1	1	A-3-4	Restroom Vestibule between Classrooms A-3 and A-4	W1	CMU	White	None	0	0	Negative
1	1	A-3-4	Restroom Vestibule between Classrooms A-3 and A-4	W2	CMU	White	None	0	0	Negative
1	1	A-3-4	Restroom Vestibule between Classrooms A-3 and A-4	W3	CMU	White	None	0	0	Negative
1	1	A-3-4	Restroom Vestibule between Classrooms A-3 and A-4	W4	CMU	White	None	0	0	Negative
1	1	A-3-4	Restroom Vestibule between Classrooms A-3 and A-4	Ceiling	Sheetrock	White	None	0	0	Negative
1	1	A-3-4	Restroom Vestibule between Classrooms A-3 and A-4	Floor	Carpet	Unpainted	N/A	N/A	N/A	N/A
1	1	A-3-4M	Boy's Restroom between Classrooms A-3 and A-4	W1	CMU	Grey	None	0	0	Negative
1	1	A-3-4M	Boy's Restroom between Classrooms A-3 and A-4	Door Frame	Metal	Grey	Chipping	3	0	Negative



			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	1	A-3-4M	Boy's Restroom between Classrooms A-3 and A-4	W2	CMU	Grey	Chipping	1	0	Negative
1	1	A-3-4M	Boy's Restroom between Classrooms A-3 and A-4	W3	Ceramic Tiles	Unpainted	N/A	N/A	N/A	N/A
1	1	A-3-4M	Boy's Restroom between Classrooms A-3 and A-4	W4	CMU	Grey	None	0	0	Negative
1	1	A-3-4M	Boy's Restroom between Classrooms A-3 and A-4	Ceiling	Sheetrock	White	None	0	0	Negative
1	1	A-3-4M	Boy's Restroom between Classrooms A-3 and A-4	Floor	Ceramic Tiles	Unpainted	N/A	N/A	N/A	N/A
1	1	A-3-4W	Girl's Restroom between Classrooms A-3 and A-4	W1	CMU	Grey	Chipping	1	0	Negative
1	1	A-3-4W	Girl's Restroom between Classrooms A-3 and A-4	Door Frame	Metal	Grey	Chipping	4	0	Negative
1	1	A-3-4W	Girl's Restroom between Classrooms A-3 and A-4	W2	CMU	Grey	None	0	0	Negative
1	1	A-3-4W	Girl's Restroom between Classrooms A-3 and A-4	W3	Ceramic Tiles	Unpainted	N/A	N/A	N/A	N/A

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	1	A-3-4W	Girl's Restroom between Classrooms A-3 and A-4	W4	CMU	Grey	Chipping	1	0	Negative
1	1	A-3-4W	Girl's Restroom between Classrooms A-3 and A-4	Ceiling	Sheetrock	White	None	0	0	Negative
1	1	A-3-4W	Girl's Restroom between Classrooms A-3 and A-4	Floor	Ceramic Tiles	Unpainted	N/A	N/A	N/A	N/A
1	1	A-3CL	Classroom A-3 Closet	W1	CMU	White	None	0	0	Negative
1	1	A-3CL	Classroom A-3 Closet	W2	Sheetrock	White	None	0	0	Negative
1	1	A-3CL	Classroom A-3 Closet	W3	Sheetrock	White	None	0	0	Negative
1	1	A-3CL	Classroom A-3 Closet	W4	CMU	White	None	0	0	Negative
1	1	A-3CL	Classroom A-3 Closet	Ceiling	Sheetrock	White	None	0	0	Negative
1	1	A-3CL	Classroom A-3 Closet	Floor	Carpet	Unpainted	N/A	N/A	N/A	N/A

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	1	A-4	Classroom A-4	W1	CMU	White	None	0	0	Negative
1	1	A-4	Classroom A-4	Door Frame	Metal	Grey	Chipping	6	0	Negative
1	1	A-4	Classroom A-4	W2	CMU	White	None	0	0	Negative
1	1	A-4	Classroom A-4	W3	CMU	White	None	0	0	Negative
1	1	A-4	Classroom A-4	W4	CMU	Purple	Chipping	4	0	Negative
1	1	A-4	Classroom A-4	Textured Ceiling Paint	Concrete	White	None	0	0	Negative
1	1	A-4	Classroom A-4	Exterior, Ductwork	Metal	White	None	0	0	Negative
1	1	A-4	Classroom A-4	Pipes	Metal	White	Chipping	2	0	Negative

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	1	A-4	Classroom A-4	Column	Concrete	White	None	0	0	Negative
1	1	A-4	Classroom A-4	Floor	12x12 VAT	Unpainted	N/A	N/A	N/A	N/A
1	1	A-4CL	Classroom A-4 Closet	W1	CMU	White	None	0	0	Negative
1	1	A-4CL	Classroom A-4 Closet	W2	CMU	White	None	0	0	Negative
1	1	A-4CL	Classroom A-4 Closet	W3	Sheetrock	White	Chipping	1	0	Negative
1	1	A-4CL	Classroom A-4 Closet	W4	Sheetrock	White	Chipping	1	0	Negative
1	1	A-4CL	Classroom A-4 Closet	Ceiling	Sheetrock	White	None	0	0	Negative
1	1	A-4CL	Classroom A-4 Closet	Floor	Carpet	Unpainted	N/A	N/A	N/A	N/A

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	1	A123	A Pod Lobby Closet A123	W1	CMU	White	None	0	0	Negative
1	1	A123	A Pod Lobby Closet A123	Door Frame	Metal	Grey	Chipping	2	0	Negative
1	1	A123	A Pod Lobby Closet A123	W2	CMU	White	None	0	0	Negative
1	1	A123	A Pod Lobby Closet A123	W3	Sheetrock	White	Hole	1	0	Negative
1	1	A123	A Pod Lobby Closet A123	W4	CMU	White	None	0	0	Negative
1	1	A123	A Pod Lobby Closet A123	Ceiling	Concrete	White	None	0	0.03	Negative
1	1	A123	A Pod Lobby Closet A123	Pipes	Metal	White	None	0	0	Negative
1	1	A123	A Pod Lobby Closet A123	Floor	Carpet	Unpainted	N/A	N/A	N/A	N/A

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	1	ACL1	A Pod Lobby Closet across from Classroom A-1	W1	CMU	White	None	0	0	Negative
1	1	ACL1	A Pod Lobby Closet across from Classroom A-1	Door Frame	Metal	Grey	Chipping	1	0	Negative
1	1	ACL1	A Pod Lobby Closet across from Classroom A-1	W2	Sheetrock	White	Chipping	1	0	Negative
1	1	ACL1	A Pod Lobby Closet across from Classroom A-1	W3	Sheetrock	White	None	0	0	Negative
1	1	ACL1	A Pod Lobby Closet across from Classroom A-1	W4	Sheetrock	White	None	0	0	Negative
1	1	ACL1	A Pod Lobby Closet across from Classroom A-1	Ceiling	Concrete	White	None	0	0	Negative
1	1	ACL1	A Pod Lobby Closet across from Classroom A-1	Floor	Carpet	Unpainted	N/A	N/A	N/A	N/A
1	1	ACL2	A Pod Lobby Server Closet across from Classroom A- 1	W1	CMU	White	None	0	0	Negative
1	1	ACL2	A Pod Lobby Server Closet across from Classroom A- 1	Door Frame	Metal	Grey	Chipping	2	0	Negative

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	1	ACL2	A Pod Lobby Server Closet across from Classroom A-1	W2	CMU	White	None	0	0	Negative
1	1	ACL2	A Pod Lobby Server Closet across from Classroom A-1	W3	Sheetrock	White	None	0	0	Negative
1	1	ACL2	A Pod Lobby Server Closet across from Classroom A-1	Cable Panel	Wood	Grey	Chipping	6	0	Negative
1	1	ACL2	A Pod Lobby Server Closet across from Classroom A-1	W4	Sheetrock	White	None	0	0	Negative
1	1	ACL2	A Pod Lobby Server Closet across from Classroom A-1	Ceiling	Concrete	White	None	0	0	Negative
1	1	ACL2	A Pod Lobby Server Closet across from Classroom A-1	Floor	Concrete	Unpainted	N/A	N/A	N/A	N/A
1	1	APOD	A Pod Lobby	W1	CMU	White	Chipping	2	0	Negative
1	1	APOD	A Pod Lobby	Door	Metal	Grey	Friction	2	0	Negative
1	1	APOD	A Pod Lobby	Door Frame	Metal	Grey	Chipping	8	0	Negative

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	1	APOD	A Pod Lobby	W2	CMU	White	None	0	0	Negative
1	1	APOD	A Pod Lobby	W3	CMU	White	Chipping	3	0	Negative
1	1	APOD	A Pod Lobby	W3	Sheetrock	White	Chipping	1	0	Negative
1	1	APOD	A Pod Lobby	W4	CMU	White	None	0	0	Negative
1	1	APOD	A Pod Lobby	Textured Ceiling Paint	Concrete	White	None	0	0	Negative
1	1	APOD	A Pod Lobby	Pipes	Metal	White	Chipping	2	0	Negative
1	1	APOD	A Pod Lobby	Column	Concrete	White	None	0	0	Negative
1	1	APOD	A Pod Lobby	Floor	12x12 VAT	Unpainted	N/A	N/A	N/A	N/A



			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	1	B-1	Classroom B-1	W1	CMU	White	None	0	0	Negative
1	1	B-1	Classroom B-1	Door Frame	Metal	Grey	Chipping	2	0	Negative
1	1	B-1	Classroom B-1	W2	CMU	White	Chipping	1	0	Negative
1	1	B-1	Classroom B-1	Door Frame	Metal	Grey	Chipping	2	0	Negative
1	1	B-1	Classroom B-1	W3	CMU	White	None	0	0	Negative
1	1	B-1	Classroom B-1	W4	CMU	Purple	None	0	0	Negative
1	1	B-1	Classroom B-1	Textured Ceiling Paint	Concrete	White	None	0	0	Negative
1	1	B-1	Classroom B-1	Pipes	Metal	White	None	0	0	Negative
1	1	B-1	Classroom B-1	Exterior, Ductwork	Metal	White	None	0	0	Negative

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	1	B-1	Classroom B-1	Column	Concrete	White	None	0	0	Negative
1	1	B-1	Classroom B-1	Floor	Carpet	Unpainted	N/A	N/A	N/A	N/A
1	1	B-1CL	Classroom B-1 Closet	W1	CMU	White	None	0	0	Negative
1	1	B-1CL	Classroom B-1 Closet	W2	Sheetrock	White	None	0	0	Negative
1	1	B-1CL	Classroom B-1 Closet	W3	Sheetrock	White	None	0	0	Negative
1	1	B-1CL	Classroom B-1 Closet	W4	CMU	White	None	0	0	Negative
1	1	B-1CL	Classroom B-1 Closet	Ceiling	Sheetrock	White	None	0	0	Negative
1	1	B-1CL	Classroom B-1 Closet	Floor	12x12 VAT	Unpainted	N/A	N/A	N/A	N/A
1	1	B-1-2M	Boy's Restroom between Classroom B-1 and Classroom B-2	W1	CMU	Grey	None	0	0	Negative
1	1	B-1-2M	Boy's Restroom between Classroom B-1 and Classroom B-2	Door Frame	Metal	Grey	None	0	0	Negative

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	1	B-1-2M	Boy's Restroom between Classroom B-1 and Classroom B-2	W2	CMU	Grey	None	0	0	Negative
1	1	B-1-2M	Boy's Restroom between Classroom B-1 and Classroom B-2	W3	Ceramic Tiles	Unpainted	N/A	N/A	N/A	N/A
1	1	B-1-2M	Boy's Restroom between Classroom B-1 and Classroom B-2	W4	CMU	Grey	None	0	0	Negative
1	1	B-1-2M	Boy's Restroom between Classroom B-1 and Classroom B-2	Ceiling	Sheetrock	White	None	0	0	Negative
1	1	B-1-2M	Boy's Restroom between Classroom B-1 and Classroom B-2	Floor	Ceramic Tiles	Unpainted	N/A	N/A	N/A	N/A
1	1	B-1-2W	Girl's Restroom between Classroom B-1 and Classroom B-2	W1	CMU	Grey	None	0	0	Negative
1	1	B-1-2W	Girl's Restroom between Classroom B-1 and Classroom B-2	Door Frame	Metal	Grey	Chipping	1	0	Negative
1	1	B-1-2W	Girl's Restroom between Classroom B-1 and Classroom B-2	W2	CMU	Grey	None	0	0	Negative
1	1	B-1-2W	Girl's Restroom between Classroom B-1 and Classroom B-2	W3	Ceramic Tiles	Unpainted	N/A	N/A	N/A	N/A

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	1	B-1-2W	Girl's Restroom between Classroom B-1 and Classroom B-2	W4	CMU	Grey	None	0	0	Negative
1	1	B-1-2W	Girl's Restroom between Classroom B-1 and Classroom B-2	Ceiling	Sheetrock	White	None	0	0	Negative
1	1	B-1-2W	Girl's Restroom between Classroom B-1 and Classroom B-2	Access Panel	Metal	White	Chipping	2	0	Negative
1	1	B-1-2W	Girl's Restroom between Classroom B-1 and Classroom B-2	Floor	Ceramic Tiles	Unpainted	N/A	N/A	N/A	N/A
1	1	B-1-2	Restroom Vestibule between Classrooms B-1 and B-2	W1	CMU	White	None	0	0	Negative
1	1	B-1-2	Restroom Vestibule between Classrooms B-1 and B-2	W2	CMU	White	None	0	0	Negative
1	1	B-1-2	Restroom Vestibule between Classrooms B-1 and B-2	W3	CMU	White	None	0	0	Negative

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	1	B-1-2	Restroom Vestibule between Classrooms B-1 and B-2	W4	CMU	White	None	0	0	Negative
1	1	B-1-2	Restroom Vestibule between Classrooms B-1 and B-2	Ceiling	Sheetrock	White	None	0	0	Negative
1	1	B-1-2	Restroom Vestibule between Classrooms B-1 and B-2	Floor	Carpet	Unpainted	N/A	N/A	N/A	N/A
1	1	B-2	Classroom B-2	W1	CMU	White	Holes	1	0	Negative
1	1	B-2	Classroom B-2	Door Frame	Metal	Grey	Chipping	4	0	Negative
1	1	B-2	Classroom B-2	W2	CMU	Blue	None	0	0	Negative
1	1	B-2	Classroom B-2	W3	CMU	White	None	0	0	Negative
1	1	B-2	Classroom B-2	W4	CMU	White	None	0	0	Negative
1	1	B-2	Classroom B-2	Door Frame	Metal	Grey	Chipping	2	0	Negative

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	1	B-2	Classroom B-2	Textured Ceiling Paint	Concrete	White	None	0	0	Negative
1	1	B-2	Classroom B-2	Column	Concrete	White	Chipping	2	0	Negative
1	1	B-2	Classroom B-2	Exterior, Ductwork	Metal	White	None	0	0	Negative
1	1	B-2	Classroom B-2	Pipes	Metal	White	Chipping	2	0	Negative
1	1	B-2	Classroom B-2	Floor	Carpet	Unpainted	N/A	N/A	N/A	N/A
1	1	B-2CL	Classroom B-2 Closet	W1	CMU	White	Cracking	1	0	Negative
1	1	B-2CL	Classroom B-2 Closet	Door Frame	Metal	Grey	None	0	0	Negative
1	1	B-2CL	Classroom B-2 Closet	W2	CMU	White	None	0	0	Negative

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	1	B-2CL	Classroom B-2 Closet	W3	Sheetrock	White	Chipping	2	0	Negative
1	1	B-2CL	Classroom B-2 Closet	W4	Sheetrock	White	Chipping	6	0	Negative
1	1	B-2CL	Classroom B-2 Closet	Ceiling	Sheetrock	White	None	0	0	Negative
1	1	B-2CL	Classroom B-2 Closet	Floor	Carpet	Unpainted	N/A	N/A	N/A	N/A
1	1	B-3	Classroom B-3	W1	CMU	White	None	0	0	Negative
1	1	B-3	Classroom B-3	Door Frame	Metal	Grey	Chipping	4	0	Negative
1	1	B-3	Classroom B-3	W2	CMU	White	None	0	0	Negative
1	1	B-3	Classroom B-3	Door Frame	Metal	Grey	Chipping	4	0	Negative
1	1	B-3	Classroom B-3	W3	CMU	White	None	0	0	Negative

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	1	B-3	Classroom B-3	W4	CMU	Green	None	0	0	Negative
1	1	B-3	Classroom B-3	Textured Ceiling Paint	Concrete	White	None	0	0	Negative
1	1	B-3	Classroom B-3	Exterior, Ductwork	Metal	White	Chipping	1	0	Negative
1	1	B-3	Classroom B-3	Column	Concrete	White	Chipping	2	0	Negative
1	1	B-3	Classroom B-3	Pipes	Metal	White	Chipping	2	0	Negative
1	1	B-3	Classroom B-3	Floor	Carpet	Unpainted	N/A	N/A	N/A	N/A
1	1	B-3-4	Restroom Vestibule between Classrooms B-3 and B-4	W1	CMU	White	None	0	0	Negative
1	1	B-3-4	Restroom Vestibule between Classrooms B-3 and B-4	W2	CMU	White	None	0	0	Negative
1	1	B-3-4	Restroom Vestibule between Classrooms B-3 and B-4	W3	CMU	White	None	0	0	Negative



			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	1	B-3-4	Restroom Vestibule between Classrooms B-3 and B-4	W4	CMU	White	None	0	0	Negative
1	1	B-3-4	Restroom Vestibule between Classrooms B-3 and B-4	Ceiling	Sheetrock	White	None	0	0	Negative
1	1	B-3-4	Restroom Vestibule between Classrooms B-3 and B-4	Floor	Carpet	Unpainted	N/A	N/A	N/A	N/A
1	1	B-3-4M	Boy's Restroom between Classrooms B-3 and B-4	W1	CMU	Grey	None	0	0	Negative
1	1	B-3-4M	Boy's Restroom between Classrooms B-3 and B-4	Door Frame	Metal	Grey	None	0	0	Negative
1	1	B-3-4M	Boy's Restroom between Classrooms B-3 and B-4	W2	CMU	Grey	None	0	0	Negative
1	1	B-3-4M	Boy's Restroom between Classrooms B-3 and B-4	W3	Ceramic Tiles	Unpainted	N/A	N/A	N/A	N/A
1	1	B-3-4M	Boy's Restroom between Classrooms B-3 and B-4	W4	CMU	Grey	None	0	0	Negative
1	1	B-3-4M	Boy's Restroom between Classrooms B-3 and B-4	Ceiling	Sheetrock	White	None	0	0	Negative

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	1	B-3-4M	Boy's Restroom between Classrooms B-3 and B-4	Floor	Ceramic Tiles	Unpainted	N/A	N/A	N/A	N/A
1	1	B-3-4W	Girl's Restroom between Classrooms B-3 and B-4	W1	CMU	Grey	None	0	0	Negative
1	1	B-3-4W	Girl's Restroom between Classrooms B-3 and B-4	Door Frame	Metal	Grey	None	0	0	Negative
1	1	B-3-4W	Girl's Restroom between Classrooms B-3 and B-4	W2	CMU	Grey	None	0	0	Negative
1	1	B-3-4W	Girl's Restroom between Classrooms B-3 and B-4	W3	Ceramic Tiles	Unpainted	N/A	N/A	N/A	N/A
1	1	B-3-4W	Girl's Restroom between Classrooms B-3 and B-4	W4	CMU	Grey	None	0	0	Negative
1	1	B-3-4W	Girl's Restroom between Classrooms B-3 and B-4	Ceiling	Sheetrock	White	Flaking	1	0	Negative
1	1	B-3-4W	Girl's Restroom between Classrooms B-3 and B-4	Floor	Ceramic Tiles	Unpainted	N/A	N/A	N/A	N/A

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	1	B-3CL	Classroom B-3 Closet	W1	CMU	White	None	0	0	Negative
1	1	B-3CL	Classroom B-3 Closet	Door Frame	Metal	Grey	None	0	0	Negative
1	1	B-3CL	Classroom B-3 Closet	W2	CMU	White	None	0	0	Negative
1	1	B-3CL	Classroom B-3 Closet	W3	CMU	White	None	0	0	Negative
1	1	B-3CL	Classroom B-3 Closet	W4	CMU	White	None	0	0	Negative
1	1	B-3CL	Classroom B-3 Closet	Ceiling	Sheetrock	White	None	0	0	Negative
1	1	B-3CL	Classroom B-3 Closet	Floor	Carpet	Unpainted	N/A	N/A	N/A	N/A
1	1	B-4	Classroom B-4	W1	CMU	White	None	0	0	Negative

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	1	B-4	Classroom B-4	Door Frame	Metal	Grey	Chipping	2	0.01	Negative
1	1	B-4	Classroom B-4	W2	CMU	Tan	None	0	0	Negative
1	1	B-4	Classroom B-4	W3	CMU	White	None	0	0	Negative
1	1	B-4	Classroom B-4	W4	CMU	White	Holes	1	0	Negative
1	1	B-4	Classroom B-4	Door Frame	Metal	Grey	Chipping	1	0	Negative
1	1	B-4	Classroom B-4	Textured Ceiling Paint	Concrete	White	None	0	0	Negative
1	1	B-4	Classroom B-4	Column	Concrete	White	Chipping	2	0	Negative
1	1	B-4	Classroom B-4	Pipes	Metal	White	Chipping	2	0	Negative
1	1	B-4	Classroom B-4	Floor	Carpet	Unpainted	N/A	N/A	N/A	N/A

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	1	B101	B Pod Lobby Closet next to Classroom B-3	W1	CMU	White	None	0	0	Negative
1	1	B101	B Pod Lobby Closet next to Classroom B-3	Door Frame	Metal	Grey	None	0	0	Negative
1	1	B101	B Pod Lobby Closet next to Classroom B-3	W2	CMU	White	None	0	0	Negative
1	1	B101	B Pod Lobby Closet next to Classroom B-3	W3	Sheetrock	White	None	0	0	Negative
1	1	B101	B Pod Lobby Closet next to Classroom B-3	W4	CMU	White	None	0	0	Negative
1	1	B101	B Pod Lobby Closet next to Classroom B-3	Ceiling	Concrete	White	None	0	0	Negative
1	1	B101	B Pod Lobby Closet next to Classroom B-3	Floor	Carpet	Unpainted	N/A	N/A	N/A	N/A
1	1	B101	B Pod Lobby Closet next to Classroom B-3	Pipes	Metal	White	Chipping	4	0	Negative
1	1	B123	B Pod Lobby Closet B123	W1	CMU	White	None	0	0	Negative
1	1	B123	B Pod Lobby Closet B123	Door Frame	Metal	Grey	Chipping	4	0	Negative

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	1	B123	B Pod Lobby Closet B123	W2	CMU	White	None	0	0	Negative
1	1	B123	B Pod Lobby Closet B123	W3	Sheetrock	White	Chipping	4	0	Negative
1	1	B123	B Pod Lobby Closet B123	W4	CMU	White	None	0	0	Negative
1	1	B123	B Pod Lobby Closet B123	Ceiling	Concrete	White	None	0	0.01	Negative
1	1	B123	B Pod Lobby Closet B123	Ceiling	Metal	White	Chipping	1	0	Negative
1	1	B123	B Pod Lobby Closet B123	Pipes	Metal	White	Chipping	4	0	Negative
1	1	B123	B Pod Lobby Closet B123	Floor	Carpet	Unpainted	N/A	N/A	N/A	N/A
1	1	BCL1	B Pod Lobby Closet between Classrooms B-1 and B-2	W1	CMU	White	None	0	0	Negative

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	1	BCL1	B Pod Lobby Closet between Classrooms B-1 and B-2	Door Frame	Metal	Grey	None	0	0	Negative
1	1	BCL1	B Pod Lobby Closet between Classrooms B-1 and B-2	W2	CMU	White	None	0	0	Negative
1	1	BCL1	B Pod Lobby Closet between Classrooms B-1 and B-2	W3	Sheetrock	White	None	0	0	Negative
1	1	BCL1	B Pod Lobby Closet between Classrooms B-1 and B-2	W4	CMU	White	None	0	0	Negative
1	1	BCL1	B Pod Lobby Closet between Classrooms B-1 and B-2	Ceiling	Concrete	White	None	0	0	Negative
1	1	BCL1	B Pod Lobby Closet between Classrooms B-1 and B-2	Pipes	Metal	White	Chipping	2	0	Negative
1	1	BCL1	B Pod Lobby Closet between Classrooms B-1 and B-2	Floor	Carpet	Unpainted	N/A	N/A	N/A	N/A
1	1	BPOD	B Pod Lobby	W1	CMU	White	None	0	0	Negative
1	1	BPOD	B Pod Lobby	Door	Metal	Grey	None	0	0	Negative

			Lead-Safe Certification Assessment Report							
			Philadelphia Learning Academy West/Crossroads Accelerated Academy MS							
			4300 Westminster Ave, Philadelphia PA 19104							
			Dates: 10/9/2023 thru 10/19/2023							
			Inspector Name: Paul Davis and Certificate Number: 060094							
			Inspection Company: VERTEX, LLC							
Element	Floor	Space #	On-Site Room Name	Component	Substrate Material	Paint Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
1	1	BPOD	B Pod Lobby	Door Frame	Metal	Grey	Chipping	4	0	Negative
1	1	BPOD	B Pod Lobby	W2	CMU	White	None	0	0	Negative
1	1	BPOD	B Pod Lobby	W3	CMU	White	None	0	0	Negative
1	1	BPOD	B Pod Lobby	W3	Sheetrock	White	None	0	0	Negative
1	1	BPOD	B Pod Lobby	W4	CMU	White	None	0	0	Negative
1	1	BPOD	B Pod Lobby	Textured Ceiling Paint	Concrete	White	None	0	0	Negative
1	1	BPOD	B Pod Lobby	Exterior, Ductwork	Metal	White	None	0	0	Negative
1	1	BPOD	B Pod Lobby	Pipes	Metal	White	Chipping	2	0	Negative
1	1	BPOD	B Pod Lobby	Floor	12x12 VAT	Unpainted	N/A	N/A	N/A	N/A
1	1	C-1	Classroom C-1	W1	CMU	White	Holes	1	0	Negative
1	1	C-1	Classroom C-1	Door Frame	Metal	Grey	None	0	0	Negative



			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	1	C-1	Classroom C-1	W2	CMU	White	None	0	0	Negative
1	1	C-1	Classroom C-1	W3	CMU	Purple	Chipping	2	0	Negative
1	1	C-1	Classroom C-1	W4	CMU	White	None	0	0	Negative
1	1	C-1	Classroom C-1	Textured Ceiling Paint	Concrete	White	None	0	0	Negative
1	1	C-1	Classroom C-1	Column	Concrete	White	None	0	0	Negative
1	1	C-1	Classroom C-1	Pipes	Metal	White	None	0	0	Negative
1	1	C-1	Classroom C-1	Floor	Carpet	Unpainted	N/A	N/A	N/A	N/A
1	1	C-1-2	Restroom Vestibule between Classrooms C-1 and C-2	W1	CMU	White	None	0	0	Negative

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	1	C-1-2	Restroom Vestibule between Classrooms C-1 and C-2	W2	CMU	White	None	0	0	Negative
1	1	C-1-2	Restroom Vestibule between Classrooms C-1 and C-2	W3	CMU	White	None	0	0	Negative
1	1	C-1-2	Restroom Vestibule between Classrooms C-1 and C-2	W4	CMU	White	None	0	0	Negative
1	1	C-1-2	Restroom Vestibule between Classrooms C-1 and C-2	Ceiling	Sheetrock	White	None	0	0	Negative
1	1	C-1-2	Restroom Vestibule between Classrooms C-1 and C-2	Floor	Carpet	Unpainted	N/A	N/A	N/A	N/A
1	1	C-1-2M	Boy's Restroom between Classrooms C-1 and C-2	W1	CMU	Grey	None	0	0	Negative
1	1	C-1-2M	Boy's Restroom between Classrooms C-1 and C-2	Door Frame	Metal	Grey	Chipping	1	0	Negative
1	1	C-1-2M	Boy's Restroom between Classrooms C-1 and C-2	W2	CMU	Grey	None	0	0	Negative
1	1	C-1-2M	Boy's Restroom between Classrooms C-1 and C-2	W3	Ceramic Tiles	Unpainted	N/A	N/A	N/A	N/A

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	1	C-1-2M	Boy's Restroom between Classrooms C-1 and C-2	W4	CMU	Grey	None	0	0	Negative
1	1	C-1-2M	Boy's Restroom between Classrooms C-1 and C-2	Ceiling	Sheetrock	White	None	0	0	Negative
1	1	C-1-2M	Boy's Restroom between Classrooms C-1 and C-2	Floor	Ceramic Tiles	Unpainted	N/A	N/A	N/A	N/A
1	1	C-1-2W	Girl's Restroom between Classrooms C-1 and C-2	W1	CMU	Grey	None	0	0	Negative
1	1	C-1-2W	Girl's Restroom between Classrooms C-1 and C-2	Door Frame	Metal	Grey	None	0	0	Negative
1	1	C-1-2W	Girl's Restroom between Classrooms C-1 and C-2	W2	CMU	Grey	None	0	0	Negative
1	1	C-1-2W	Girl's Restroom between Classrooms C-1 and C-2	W3	Ceramic Tiles	Unpainted	N/A	N/A	N/A	N/A
1	1	C-1-2W	Girl's Restroom between Classrooms C-1 and C-2	W4	CMU	Grey	None	0	0	Negative

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	1	C-1-2W	Girl's Restroom between Classrooms C-1 and C-2	Ceiling	Sheetrock	White	None	0	0	Negative
1	1	C-1-2W	Girl's Restroom between Classrooms C-1 and C-2	Floor	Ceramic Tiles	Unpainted	N/A	N/A	N/A	N/A
1	1	C-1CL	Classroom C-1 Closet	W1	CMU	White	None	0	0	Negative
1	1	C-1CL	Classroom C-1 Closet	W2	CMU	White	None	0	0	Negative
1	1	C-1CL	Classroom C-1 Closet	W3	Sheetrock	White	None	0	0	Negative
1	1	C-1CL	Classroom C-1 Closet	W4	Sheetrock	White	None	0	0	Negative
1	1	C-1CL	Classroom C-1 Closet	Ceiling	Sheetrock	White	None	0	0	Negative
1	1	C-1CL	Classroom C-1 Closet	Floor	Carpet	Unpainted	N/A	N/A	N/A	N/A
1	1	C-2	Classroom C-2	W1	CMU	White	None	0	0	Negative

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	1	C-2	Classroom C-2	Door Frame	Metal	Grey	Chipping	2	0	Negative
1	1	C-2	Classroom C-2	W2	CMU	White	None	0	0	Negative
1	1	C-2	Classroom C-2	Door Frame	Metal	Grey	None	0	0	Negative
1	1	C-2	Classroom C-2	W3	CMU	White	None	0	0	Negative
1	1	C-2	Classroom C-2	W4	CMU	Blue	None	0	0	Negative
1	1	C-2	Classroom C-2	Textured Ceiling Paint	Concrete	White	None	0	0	Negative
1	1	C-2	Classroom C-2	Exterior, Ductwork	Metal	White	None	0	0	Negative
1	1	C-2	Classroom C-2	Column	Concrete	White	Chipping	2	0	Negative
1	1	C-2	Classroom C-2	Pipes	Metal	White	None	0	0	Negative

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	1	C-2	Classroom C-2	Floor	Carpet	Unpainted	N/A	N/A	N/A	N/A
1	1	C-2CL	Classroom C-2 Closet	W1	CMU	White	None	0	0	Negative
1	1	C-2CL	Classroom C-2 Closet	Door Frame	Metal	Grey	None	0	0	Negative
1	1	C-2CL	Classroom C-2 Closet	W2	Sheetrock	White	None	0	0	Negative
1	1	C-2CL	Classroom C-2 Closet	W3	Sheetrock	White	None	0	0	Negative
1	1	C-2CL	Classroom C-2 Closet	W4	CMU	White	None	0	0	Negative
1	1	C-2CL	Classroom C-2 Closet	Ceiling	Sheetrock	White	None	0	0	Negative
1	1	C-2CL	Classroom C-2 Closet	Floor	Carpet	Unpainted	N/A	N/A	N/A	N/A
1	1	C-3	Classroom C-3	W1	CMU	White	None	0	0	Negative
1	1	C-3	Classroom C-3	Door Frame	Metal	Grey	Chipping	2	0	Negative

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	1	C-3	Classroom C-3	W2	CMU	Green	None	0	0	Negative
1	1	C-3	Classroom C-3	W3	CMU	White	None	0	0	Negative
1	1	C-3	Classroom C-3	W4	CMU	White	None	0	0	Negative
1	1	C-3	Classroom C-3	Door Frame	Metal	Grey	None	0	0	Negative
1	1	C-3	Classroom C-3	Textured Ceiling Paint	Concrete	White	None	0	0	Negative
1	1	C-3	Classroom C-3	Exterior, Ductwork	Metal	White	None	0	0	Negative
1	1	C-3	Classroom C-3	Pipes	Metal	White	None	0	0	Negative
1	1	C-3	Classroom C-3	Column	Concrete	White	None	0	0	Negative
1	1	C-3	Classroom C-3	Floor	Carpet	Unpainted	N/A	N/A	N/A	N/A

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	1	C-3-4	Restroom Vestibule between Classrooms C-3 and C-4	W1	CMU	White	None	0	0	Negative
1	1	C-3-4	Restroom Vestibule between Classrooms C-3 and C-4	W2	CMU	White	None	0	0	Negative
1	1	C-3-4	Restroom Vestibule between Classrooms C-3 and C-4	W3	CMU	White	None	0	0	Negative
1	1	C-3-4	Restroom Vestibule between Classrooms C-3 and C-4	W4	CMU	White	None	0	0	Negative
1	1	C-3-4	Restroom Vestibule between Classrooms C-3 and C-4	Ceiling	Sheetrock	White	None	0	0	Negative
1	1	C-3-4	Restroom Vestibule between Classrooms C-3 and C-4	Floor	Carpet	Unpainted	N/A	N/A	N/A	N/A
1	1	C-3-4M	Boy's Restroom between Classrooms C-3 and C-4	W1	CMU	Grey	None	0	0	Negative
1	1	C-3-4M	Boy's Restroom between Classrooms C-3 and C-4	Door Frame	Metal	Grey	Chipping	3	0	Negative



			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	1	C-3-4M	Boy's Restroom between Classrooms C-3 and C-4	W2	CMU	Grey	None	0	0	Negative
1	1	C-3-4M	Boy's Restroom between Classrooms C-3 and C-4	W3	Ceramic Tiles	Unpainted	N/A	N/A	N/A	N/A
1	1	C-3-4M	Boy's Restroom between Classrooms C-3 and C-4	W4	CMU	Grey	None	0	0	Negative
1	1	C-3-4M	Boy's Restroom between Classrooms C-3 and C-4	Ceiling	Sheetrock	White	None	0	0	Negative
1	1	C-3-4M	Boy's Restroom between Classrooms C-3 and C-4	Floor	Ceramic Tiles	Unpainted	N/A	N/A	N/A	N/A
1	1	C-3-4W	Girl's Restroom between Classrooms C-3 and C-4	W1	CMU	Grey	None	0	0	Negative
1	1	C-3-4W	Girl's Restroom between Classrooms C-3 and C-4	Door Frame	Metal	Grey	Chipping	1	0	Negative
1	1	C-3-4W	Girl's Restroom between Classrooms C-3 and C-4	W2	CMU	Grey	None	0	0	Negative
1	1	C-3-4W	Girl's Restroom between Classrooms C-3 and C-4	W3	Ceramic Tiles	Unpainted	N/A	N/A	N/A	N/A

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	1	C-3-4W	Girl's Restroom between Classrooms C-3 and C-4	W4	CMU	Grey	None	0	0	Negative
1	1	C-3-4W	Girl's Restroom between Classrooms C-3 and C-4	Ceiling	Sheetrock	White	None	0	0	Negative
1	1	C-3-4W	Girl's Restroom between Classrooms C-3 and C-4	Floor	Ceramic Tiles	Unpainted	N/A	N/A	N/A	N/A
1	1	C-4	Classroom C-4	W1	CMU	White	None	0	0	Negative
1	1	C-4	Classroom C-4	Door Frame	Metal	Grey	None	0	0	Negative
1	1	C-4	Classroom C-4	W2	CMU	White	None	0	0	Negative
1	1	C-4	Classroom C-4	W3	CMU	White	None	0	0	Negative
1	1	C-4	Classroom C-4	W4	CMU	Tan	None	0	0	Negative

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	1	C-4	Classroom C-4	Textured Ceiling Paint	Concrete	White	None	0	0	Negative
1	1	C-4	Classroom C-4	Pipes	Metal	White	None	0	0	Negative
1	1	C-4	Classroom C-4	Column	Concrete	White	None	0	0	Negative
1	1	C-4	Classroom C-4	Floor	Carpet	Unpainted	N/A	N/A	N/A	N/A
1	1	C-4CL	Classroom C-4 Closet	W1	CMU	White	None	0	0	Negative
1	1	C-4CL	Classroom C-4 Closet	Door Frame	Metal	Grey	Chipping	2	0	Negative
1	1	C-4CL	Classroom C-4 Closet	W2	CMU	White	None	0	0	Negative
1	1	C-4CL	Classroom C-4 Closet	W3	CMU	White	None	0	0	Negative
1	1	C-4CL	Classroom C-4 Closet	W4	CMU	White	None	0	0	Negative

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	1	C-4CL	Classroom C-4 Closet	Ceiling	Sheetrock	White	None	0	0	Negative
1	1	C-4CL	Classroom C-4 Closet	Floor	Carpet	Unpainted	N/A	N/A	N/A	N/A
1	1	C123	Office C123	W1	CMU	White	None	0	0	Negative
1	1	C123	Office C123	Door Frame	Metal	Grey	Chipping	2	0	Negative
1	1	C123	Office C123	W2	CMU	White	None	0	0	Negative
1	1	C123	Office C123	W3	Sheetrock	White	Chipping	2	0	Negative
1	1	C123	Office C123	W4	CMU	White	None	0	0	Negative
1	1	C123	Office C123	Ceiling	Metal	White	None	0	0	Negative
1	1	C123	Office C123	Pipes	Metal	White	None	0	0	Negative

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	1	C123	Office C123	Floor	12x12 VAT	Unpainted	N/A	N/A	N/A	N/A
1	1	CCL	C Pod Lobby Closet adjacent to Classroom C-4	W1	CMU	White	None	0	0	Negative
1	1	CCL	C Pod Lobby Closet adjacent to Classroom C-4	Door Frame	Metal	Grey	Chipping	1	0	Negative
1	1	CCL	C Pod Lobby Closet adjacent to Classroom C-4	W2	CMU	White	None	0	0	Negative
1	1	CCL	C Pod Lobby Closet adjacent to Classroom C-4	W3	Sheetrock	White	None	0	0	Negative
1	1	CCL	C Pod Lobby Closet adjacent to Classroom C-4	W4	Sheetrock	White	None	0	0	Negative
1	1	CCL	C Pod Lobby Closet adjacent to Classroom C-4	Ceiling	Concrete	White	None	0	0	Negative
1	1	CCL	C Pod Lobby Closet adjacent to Classroom C-4	Pipes	Metal	White	Chipping	3	0	Negative
1	1	CCL	C Pod Lobby Closet adjacent to Classroom C-4	Floor	12x12 VAT	Unpainted	N/A	N/A	N/A	N/A

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	1	CJAN	C Pod Lobby Custodial Closet 144	W1	CMU	White	None	0	0	Negative
1	1	CJAN	C Pod Lobby Custodial Closet 144	Door Frame	Metal	Grey	Chipping	2	0	Negative
1	1	CJAN	C Pod Lobby Custodial Closet 144	W2	Sheetrock	White	None	0	0	Negative
1	1	CJAN	C Pod Lobby Custodial Closet 144	W3	Sheetrock	White	Chipping	4	0	Negative
1	1	CJAN	C Pod Lobby Custodial Closet 144	W4	CMU	White	None	0	0	Negative
1	1	CJAN	C Pod Lobby Custodial Closet 144	Ceiling	Sheetrock	White	None	0	0	Negative
1	1	CJAN	C Pod Lobby Custodial Closet 144	Ceiling	Metal	White	None	0	0	Negative
1	1	CJAN	C Pod Lobby Custodial Closet 144	Pipes	Metal	White	Chipping	2	0	Negative
1	1	CJAN	C Pod Lobby Custodial Closet 144	Floor	Concrete	Unpainted	N/A	N/A	N/A	N/A
1	1	CPOD	C Pod Lobby	W1	CMU	White	Chipping	4	0	Negative

			Lead-Safe Certification Assessment Report							
			Philadelphia Learning Academy West/Crossroads Accelerated Academy MS							
			4300 Westminster Ave, Philadelphia PA 19104							
			3							
			4							
			5							
			6							
			7							
			8							
			9							
			10							
			11							
			12							
			13							
			14							
			15							
			16							
			17							
			18							
			19							
			20							
			21							
			22							
			23							
			24							
			25							
			26							
			27							
			28							
			29							
			30							
			31							
			32							
			33							
			34							
			35							
			36							
			37							
			38							
			39							
			40							
			41							
			42							
			43							
			44							
			45							
			46							
			47							
			48							
			49							
			50							
			51							
			52							
			53							
			54							
			55							
			56							
			57							
			58							
			59							
			60							
			61							
			62							
			63							
			64							
			65							
			66							
			67							
			68							
			69							
			70							
			71							
			72							
			73							
			74							
			75							
			76							
			77							
			78							
			79							
			80							
			81							
			82							
			83							
			84							
			85							
			86							
			87							
			88							
			89							
			90							
			91							
			92							
			93							
			94							
			95							
			96							
			97							
			98							
			99							
			100							
			Dates: 10/9/2023 thru 10/19/2023							
			Inspector Name: Paul Davis and Certificate Number: 060094							
			Inspection Company: VERTEX, LLC							
E l e m e n t	F l o o r	Space #	On-Site Room Name	Component	Substrate Material	Paint Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/ negative)
1	1	CPOD	C Pod Lobby	Door Frame	Metal	Grey	Chipping	5	0	Negative
1	1	CPOD	C Pod Lobby	Door	Metal	Grey	Chipping	2	0	Negative
1	1	CPOD	C Pod Lobby	W2	CMU	White	Chipping	1	0	Negative
1	1	CPOD	C Pod Lobby	W3	CMU	White	None	0	0	Negative
1	1	CPOD	C Pod Lobby	W3	Sheetrock	White	Cracking	3	0	Negative
1	1	CPOD	C Pod Lobby	W4	CMU	White	Chipping	3	0	Negative
1	1	CPOD	C Pod Lobby	Ceiling	Concrete	Unpainted	N/A	N/A	N/A	N/A
1	1	CPOD	C Pod Lobby	Textured Ceiling Paint	Metal	White	None	0	0	Negative
1	1	CPOD	C Pod Lobby	Pipes	Metal	White	Chipping	5	0	Negative
1	1	CPOD	C Pod Lobby	Column	Concrete	White	Chipping	10	0	Negative

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	1	CPOD	C Pod Lobby	Floor	12x12 VAT	Unpainted	N/A	N/A	N/A	N/A
1	1	EL1	Passenger Elevator	W1	Metal	Unpainted	N/A	N/A	N/A	N/A
1	1	EL1	Passenger Elevator	W2	Metal	Unpainted	N/A	N/A	N/A	N/A
1	1	EL1	Passenger Elevator	W3	Metal	Unpainted	N/A	N/A	N/A	N/A
1	1	EL1	Passenger Elevator	W4	Metal	Unpainted	N/A	N/A	N/A	N/A
1	1	EL1	Passenger Elevator	Ceiling	Metal	Unpainted	N/A	N/A	N/A	N/A
1	1	EL1	Passenger Elevator	Floor	Metal	Unpainted	N/A	N/A	N/A	N/A
1	1	EMR	Elevator Machine Room outside Welcome Center/Main Office Common Area	W1	CMU	White	None	0	0	Negative
1	1	EMR	Elevator Machine Room outside Welcome Center/Main Office Common Area	Door Frame	Metal	Grey	Chipping	2	0	Negative
1	1	EMR	Elevator Machine Room outside Welcome Center/Main Office Common Area	W2	CMU	White	None	0	0.01	Negative



			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	1	EMR	Elevator Machine Room outside Welcome Center/Main Office Common Area	W3	Sheetrock	White	None	0	0	Negative
1	1	EMR	Elevator Machine Room outside Welcome Center/Main Office Common Area	W4	Sheetrock	White	None	0	0	Negative
1	1	EMR	Elevator Machine Room outside Welcome Center/Main Office Common Area	Ceiling	Concrete	Unpainted	N/A	N/A	N/A	N/A
1	1	EMR	Elevator Machine Room outside Welcome Center/Main Office Common Area	Floor	Concrete	Unpainted	N/A	N/A	N/A	N/A
1	1	GYM	Gymnasium	W1	CMU	White	None	0	0	Negative
1	1	GYM	Gymnasium	W1	Concrete	White	None	0	0	Negative
1	1	GYM	Gymnasium	Door Frame	Metal	Grey	Chipping	10	0	Negative
1	1	GYM	Gymnasium	W2	CMU	White	None	0	0	Negative
1	1	GYM	Gymnasium	W2	Concrete	White	None	0	0	Negative

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	1	GYM	Gymnasium	W3	CMU	White	None	0	0	Negative
1	1	GYM	Gymnasium	W3	Concrete	White	None	0	0	Negative
1	1	GYM	Gymnasium	Door Frame	Metal	Grey	Chipping	4	0	Negative
1	1	GYM	Gymnasium	W4	CMU	White	None	0	0	Negative
1	1	GYM	Gymnasium	W4	Concrete	White	None	0	0	Negative
1	1	GYM	Gymnasium	Ceiling	Tectum Panels	White	None	0	No Access	No Access
1	1	GYM	Gymnasium	Trusses	Metal	White	None	0	No Access	No Access
1	1	GYM	Gymnasium	Beam	Metal	White	None	0	No Access	No Access
1	1	GYM	Gymnasium	Ductwork	Metal	Beige	None	0	No Access	No Access
1	1	GYM	Gymnasium	Floor	Wood	Unpainted	N/A	N/A	N/A	N/A
1	1	GYM	Gymnasium	Cove Base	Metal	Brown	Chipping	100	0	Negative
1	1	GYM	Gymnasium	Backboard	Wood	White	Chipping	1	0.02	Negative

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	1	GYM	Gymnasium	Backboard Supports	Metal	Black	None	0	0.01	Negative
1	1	GYM-RR	Gymnasium Unisex Restroom	W1	Ceramic Tiles	Unpainted	N/A	N/A	N/A	N/A
1	1	GYM-RR	Gymnasium Unisex Restroom	W2	Ceramic Tiles	Unpainted	N/A	N/A	N/A	N/A
1	1	GYM-RR	Gymnasium Unisex Restroom	W3	Ceramic Tiles	Unpainted	N/A	N/A	N/A	N/A
1	1	GYM-RR	Gymnasium Unisex Restroom	W4	Ceramic Tiles	Unpainted	N/A	N/A	N/A	N/A
1	1	GYM-RR	Gymnasium Unisex Restroom	Ceiling	Sheetrock	White	Flaking	2	0	Negative
1	1	GYM-RR	Gymnasium Unisex Restroom	Floor	Ceramic Tiles	Unpainted	N/A	N/A	N/A	N/A
1	1	GYM-ST	Gymnasium Storage Room	W1	CMU	White	None	0	0	Negative
1	1	GYM-ST	Gymnasium Storage Room	W2	Sheetrock	White	None	0	0	Negative

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	1	GYM-ST	Gymnasium Storage Room	W3	Sheetrock	White	None	0	0	Negative
1	1	GYM-ST	Gymnasium Storage Room	W4	CMU	White	None	0	0	Negative
1	1	GYM-ST	Gymnasium Storage Room	Ceiling	Concrete	White	None	0	0	Negative
1	1	GYM-ST	Gymnasium Storage Room	Floor	Carpet	Unpainted	N/A	N/A	N/A	N/A
1	1	H1	Hallway from Stairwell 2 to Stairwell 3	W1	CMU	White	None	0	0	Negative
1	1	H1	Hallway from Stairwell 2 to Stairwell 3	W2	CMU	White	None	0	0	Negative
1	1	H1	Hallway from Stairwell 2 to Stairwell 3	W3	CMU	White	None	0	0	Negative
1	1	H1	Hallway from Stairwell 2 to Stairwell 3	W4	CMU	White	None	0	0	Negative

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	1	H1	Hallway from Stairwell 2 to Stairwell 3	W4	Sheetrock	White	None	0	0	Negative
1	1	H1	Hallway from Stairwell 2 to Stairwell 3	Window Frame	Wood	White	None	0	0	Negative
1	1	H1	Hallway from Stairwell 2 to Stairwell 3	Ceiling	2x2 CT	Unpainted	N/A	N/A	N/A	N/A
1	1	H1	Hallway from Stairwell 2 to Stairwell 3	Ceiling	Concrete	Unpainted	N/A	N/A	N/A	N/A
1	1	H1	Hallway from Stairwell 2 to Stairwell 3	Floor	Carpet	Unpainted	N/A	N/A	N/A	N/A
1	1	H2	Hallway outside of B Pod	W2	CMU	White	None	0	0	Negative
1	1	H2	Hallway outside of B Pod	W4	CMU	White	None	0	0	Negative
1	1	H2	Hallway outside of B Pod	Ceiling	2x2 CT	Unpainted	N/A	N/A	N/A	N/A
1	1	H2	Hallway outside of B Pod	Ceiling	Concrete	Unpainted	N/A	N/A	N/A	N/A
1	1	H2	Hallway outside of B Pod	Ceiling	Metal	Unpainted	N/A	N/A	N/A	N/A
1	1	H2	Hallway outside of B Pod	Floor	Carpet	Unpainted	N/A	N/A	N/A	N/A

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	1	H3	Hallway from Passenger Elevator to School Police Office near Stairwell 4	W1	CMU	White	None	0	0	Negative
1	1	H3	Hallway from Passenger Elevator to School Police Office near Stairwell 4	W2	CMU	White	None	0	0	Negative
1	1	H3	Hallway from Passenger Elevator to School Police Office near Stairwell 4	W2	Sheetrock	White	Chipping	1	0	Negative
1	1	H3	Hallway from Passenger Elevator to School Police Office near Stairwell 4	W3	CMU	White	None	0	0	Negative
1	1	H3	Hallway from Passenger Elevator to School Police Office near Stairwell 4	W3	Sheetrock	White	None	0	0	Negative
1	1	H3	Hallway from Passenger Elevator to School Police Office near Stairwell 4	W4	CMU	White	None	0	0	Negative
1	1	H3	Hallway from Passenger Elevator to School Police Office near Stairwell 4	Ceiling	2x2 CT	Unpainted	N/A	N/A	N/A	N/A
1	1	H3	Hallway from Passenger Elevator to School Police Office near Stairwell 4	Ceiling	Concrete	Unpainted	N/A	N/A	N/A	N/A

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	1	H3	Hallway from Passenger Elevator to School Police Office near Stairwell 4	Ceiling	Metal	Unpainted	N/A	N/A	N/A	N/A
1	1	H3	Hallway from Passenger Elevator to School Police Office near Stairwell 4	Floor	Carpet	Unpainted	N/A	N/A	N/A	N/A
1	1	KIT	Main Food Service Kitchen	W1	CMU	White	None	0	0	Negative
1	1	KIT	Main Food Service Kitchen	W1	Plastic Coated Sheet Rock	Unpainted	N/A	N/A	N/A	N/A
1	1	KIT	Main Food Service Kitchen	Door Frame	Metal	Grey	Chipping	1	0	Negative
1	1	KIT	Main Food Service Kitchen	W2	CMU	White	Friction	3	0	Negative
1	1	KIT	Main Food Service Kitchen	W2	Plastic Coated Sheet Rock	Unpainted	N/A	N/A	N/A	N/A
1	1	KIT	Main Food Service Kitchen	W3	CMU	White	None	0	0	Negative
1	1	KIT	Main Food Service Kitchen	W3	Plastic Coated Sheet Rock	Unpainted	N/A	N/A	N/A	N/A

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	1	KIT	Main Food Service Kitchen	Door Frame	Metal	Grey	Chipping	2	0	Negative
1	1	KIT	Main Food Service Kitchen	W4	CMU	White	None	0	0	Negative
1	1	KIT	Main Food Service Kitchen	W4	Plastic Coated Sheet Rock	Unpainted	N/A	N/A	N/A	N/A
1	1	KIT	Main Food Service Kitchen	Ceiling	2x2 CT	Unpainted	N/A	N/A	N/A	N/A
1	1	KIT	Main Food Service Kitchen	Ceiling	2x2 CT	Unpainted	N/A	N/A	N/A	N/A
1	1	KIT	Main Food Service Kitchen	Floor	Concrete	Grey	Chipping/Friction	60	0	Negative
1	1	KST	Kitchen Dry Storage Room	W1	CMU	White	None	0	0	Negative
1	1	KST	Kitchen Dry Storage Room	Door Frame	Metal	Grey	Chipping	2	0	Negative
1	1	KST	Kitchen Dry Storage Room	W2	Plastic Coated Sheet Rock	Unpainted	N/A	N/A	N/A	N/A



			Lead-Safe Certification Assessment Report							
			Philadelphia Learning Academy West/Crossroads Accelerated Academy MS							
			4300 Westminster Ave, Philadelphia PA 19104							
			3							
			4							
			5							
			6							
			7							
			8							
			9							
			10							
			11							
			12							
			13							
			14							
			15							
			16							
			17							
			18							
			19							
			20							
			21							
			22							
			23							
			24							
			25							
			26							
			27							
			28							
			29							
			30							
			31							
			32							
			33							
			34							
			35							
			36							
			37							
			38							
			39							
			40							
			41							
			42							
			43							
			44							
			45							
			46							
			47							
			48							
			49							
			50							
			51							
			52							
			53							
			54							
			55							
			56							
			57							
			58							
			59							
			60							
			61							
			62							
			63							
			64							
			65							
			66							
			67							
			68							
			69							
			70							
			71							
			72							
			73							
			74							
			75							
			76							
			77							
			78							
			79							
			80							
			81							
			82							
			83							
			84							
			85							
			86							
			87							
			88							
			89							
			90							
			91							
			92							
			93							
			94							
			95							
			96							
			97							
			98							
			99							
			100							
			Dates: 10/9/2023 thru 10/19/2023							
			Inspector Name: Paul Davis and Certificate Number: 060094							
			Inspection Company: VERTEX, LLC							
E	F									
l	l									
e	o	Space #	On-Site Room Name	Component	Substrate Material	Paint Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
m	r									
e										
n										
t										
1	1	KST	Kitchen Dry Storage Room	W3	Plastic Coated Sheet Rock	Unpainted	N/A	N/A	N/A	N/A
1	1	KST	Kitchen Dry Storage Room	W4	Plastic Coated Sheet Rock	Unpainted	N/A	N/A	N/A	N/A
1	1	KST	Kitchen Dry Storage Room	Ceiling	2x2 CT	Unpainted	N/A	N/A	N/A	N/A
1	1	KST	Kitchen Dry Storage Room	Ceiling	Concrete	Unpainted	N/A	N/A	N/A	N/A
1	1	KST	Kitchen Dry Storage Room	Floor	Concrete	Grey	Friction	10	0	Negative
1	1	M1	Men's Restroom next to Passenger Elevator	W1	Ceramic Tiles	Unpainted	N/A	N/A	N/A	N/A
1	1	M1	Men's Restroom next to Passenger Elevator	Door Frame	Metal	Grey	Chipping	1	0	Negative
1	1	M1	Men's Restroom next to Passenger Elevator	W2	Ceramic Tiles	Unpainted	N/A	N/A	N/A	N/A
1	1	M1	Men's Restroom next to Passenger Elevator	W3	Ceramic Tiles	Unpainted	N/A	N/A	N/A	N/A
1	1	M1	Men's Restroom next to Passenger Elevator	W4	Ceramic Tiles	Unpainted	N/A	N/A	N/A	N/A

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	1	M1	Men's Restroom next to Passenger Elevator	Ceiling	Sheetrock	White	None	0	0	Negative
1	1	M1	Men's Restroom next to Passenger Elevator	Floor	Ceramic Tiles	Unpainted	N/A	N/A	N/A	N/A
1	1	S1	Stairwell 1 next to Front Entrance Lobby/Reception Area	W1	CMU	White	None	0	0	Negative
1	1	S1	Stairwell 1 next to Front Entrance Lobby/Reception Area	W2	CMU	White	None	0	0	Negative
1	1	S1	Stairwell 1 next to Front Entrance Lobby/Reception Area	W3	CMU	White	None	0	0	Negative
1	1	S1	Stairwell 1 next to Front Entrance Lobby/Reception Area	Door	Metal	Grey	None	0	0	Negative
1	1	S1	Stairwell 1 next to Front Entrance Lobby/Reception Area	Door Frame	Metal	Grey	None	0	0	Negative
1	1	S1	Stairwell 1 next to Front Entrance Lobby/Reception Area	W4	CMU	White	None	0	0	Negative
1	1	S1	Stairwell 1 next to Front Entrance Lobby/Reception Area	Heater Cover	Metal	White	None	0	0	Negative

			Dates: 10/9/2023 thru 10/19/2023	Lead-Safe Certification Assessment Report						
			Inspector Name: Paul Davis and Certificate Number: 060094	Philadelphia Learning Academy West/Crossroads Accelerated Academy MS						
			Inspection Company: VERTEX, LLC	4300 Westminster Ave, Philadelphia PA 19104						
E l e m e n t	F l o o r	Space #	On-Site Room Name	Component	Substrate Material	Paint Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/ negative)
1	1	S1	Stairwell 1 next to Front Entrance Lobby/Reception Area	Ceiling	Concrete	White	None	0	0	Negative
1	1	S1	Stairwell 1 next to Front Entrance Lobby/Reception Area	Pipes	Metal	White	None	0	0	Negative
1	1	S1	Stairwell 1 next to Front Entrance Lobby/Reception Area	Stringer	Concrete	White	None	0	0	Negative
1	1	S1	Stairwell 1 next to Front Entrance Lobby/Reception Area	Handrail	Metal	Grey	None	0	0	Negative
1	1	S1	Stairwell 1 next to Front Entrance Lobby/Reception Area	Floor	Carpet	Unpainted	N/A	N/A	N/A	N/A
1	1	S2	Stairwell 2 next to Kitchen	W1	Glass Block	Unpainted	N/A	N/A	N/A	N/A
1	1	S2	Stairwell 2 next to Kitchen	W1	Sheetrock	White	None	0	0	Negative
1	1	S2	Stairwell 2 next to Kitchen	Door Frame	Metal	Grey	Chipping	3	0	Negative
1	1	S2	Stairwell 2 next to Kitchen	W2	CMU	White	None	0	0	Negative
1	1	S2	Stairwell 2 next to Kitchen	Heater Cover	Metal	White	None	0	0	Negative
1	1	S2	Stairwell 2 next to Kitchen	W3	Glass Block	Unpainted	N/A	N/A	N/A	N/A

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	1	S2	Stairwell 2 next to Kitchen	Door	Metal	Grey	Chipping	6	0	Negative
1	1	S2	Stairwell 2 next to Kitchen	Door Frame	Metal	Grey	Chipping	1	0	Negative
1	1	S2	Stairwell 2 next to Kitchen	W4	CMU	White	None	0	0	Negative
1	1	S2	Stairwell 2 next to Kitchen	Ceiling	Concrete	White	None	0	0.05	Negative
1	1	S2	Stairwell 2 next to Kitchen	Handrail	Metal	Grey	Friction	6	0	Negative
1	1	S2	Stairwell 2 next to Kitchen	Stringer	Concrete	Grey	Chipping	1	0	Negative
1	1	S2	Stairwell 2 next to Kitchen	Floor	12x12 VAT	Unpainted	N/A	N/A	N/A	N/A
1	1	S3	Stairwell 3 (Ogden St & Parking Lot)	W1	CMU	White	None	0	0	Negative
1	1	S3	Stairwell 3 (Ogden St & Parking Lot)	W2	CMU	White	None	0	0	Negative

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	1	S3	Stairwell 3 (Ogden St & Parking Lot)	Door	Metal	Grey	None	0	0	Negative
1	1	S3	Stairwell 3 (Ogden St & Parking Lot)	Door Frame	Metal	Grey	None	0	0	Negative
1	1	S3	Stairwell 3 (Ogden St & Parking Lot)	W3	CMU	White	None	0	0	Negative
1	1	S3	Stairwell 3 (Ogden St & Parking Lot)	W4	CMU	White	None	0	0	Negative
1	1	S3	Stairwell 3 (Ogden St & Parking Lot)	W4	Sheetrock	White	None	0	0	Negative
1	1	S3	Stairwell 3 (Ogden St & Parking Lot)	Ceiling	Metal	White	None	0	0	Negative
1	1	S3	Stairwell 3 (Ogden St & Parking Lot)	Stair Underside	Metal	Tan	None	0	0	Negative
1	1	S3	Stairwell 3 (Ogden St & Parking Lot)	Handrail	Metal	Grey	None	0	0	Negative
1	1	S3	Stairwell 3 (Ogden St & Parking Lot)	Stringer	Metal	White	None	0	0	Negative
1	1	S3	Stairwell 3 (Ogden St & Parking Lot)	Floor	12x12 VAT	Unpainted	N/A	N/A	N/A	N/A

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	1	SMC	Student Media Center Classroom (across from Passenger Elevator)	W1	CMU	White	Holes	1	0	Negative
1	1	SMC	Student Media Center Classroom (across from Passenger Elevator)	Door Frame	Metal	Grey	Chipping	3	0	Negative
1	1	SMC	Student Media Center Classroom (across from Passenger Elevator)	W2	CMU	White	None	0	0	Negative
1	1	SMC	Student Media Center Classroom (across from Passenger Elevator)	W3	CMU	White	None	0	0	Negative
1	1	SMC	Student Media Center Classroom (across from Passenger Elevator)	W4	CMU	White	None	0	0	Negative
1	1	SMC	Student Media Center Classroom (across from Passenger Elevator)	Door Frame	Metal	Grey	None	0	0	Negative
1	1	SMC	Student Media Center Classroom (across from Passenger Elevator)	Ceiling	2x2 CT	Unpainted	N/A	N/A	N/A	N/A
1	1	SMC	Student Media Center Classroom (across from Passenger Elevator)	Ceiling	Metal	Unpainted	N/A	N/A	N/A	N/A
1	1	SMC	Student Media Center Classroom (across from Passenger Elevator)	Floor	Carpet	Unpainted	N/A	N/A	N/A	N/A

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	1	SMCK	Student Media Center Kitchen	W1	CMU	White	None	0	0	Negative
1	1	SMCK	Student Media Center Kitchen	Door Frame	Metal	Grey	None	0	0	Negative
1	1	SMCK	Student Media Center Kitchen	W2	CMU	White	None	0	0	Negative
1	1	SMCK	Student Media Center Kitchen	W3	CMU	White	None	0	0	Negative
1	1	SMCK	Student Media Center Kitchen	W4	CMU	White	None	0	0	Negative
1	1	SMCK	Student Media Center Kitchen	Ceiling	2x2 CT	Unpainted	N/A	N/A	N/A	N/A
1	1	SMCK	Student Media Center Kitchen	Ceiling	Metal	Unpainted	N/A	N/A	N/A	N/A
1	1	SMCK	Student Media Center Kitchen	Floor	Carpet	Unpainted	N/A	N/A	N/A	N/A
1	1	SMCRR	Student Media Center Restroom	W1	CMU	Grey	None	0	0	Negative

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	1	SMCRR	Student Media Center Restroom	Door Frame	Metal	Grey	None	0	0	Negative
1	1	SMCRR	Student Media Center Restroom	W2	Ceramic Tiles	Unpainted	N/A	N/A	N/A	N/A
1	1	SMCRR	Student Media Center Restroom	W3	CMU	Grey	None	0	0	Negative
1	1	SMCRR	Student Media Center Restroom	W4	CMU	Grey	None	0	0	Negative
1	1	SMCRR	Student Media Center Restroom	Ceiling	Sheetrock	White	None	0	0	Negative
1	1	SMCRR	Student Media Center Restroom	Floor	Ceramic Tiles	Unpainted	N/A	N/A	N/A	N/A
1	1	SP	School Police Office near Stairwell 4	W1	Sheetrock	White	None	0	0	Negative
1	1	SP	School Police Office near Stairwell 4	Door	Metal	Grey	Chipping	1	0	Negative
1	1	SP	School Police Office near Stairwell 4	Door Frame	Metal	Grey	Chipping	4	0	Negative
1	1	SP	School Police Office near Stairwell 4	Window Frame	Wood	White	None	0	0	Negative



			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	1	SP	School Police Office near Stairwell 4	W2	Sheetrock	White	None	0	0	Negative
1	1	SP	School Police Office near Stairwell 4	Door	Metal	Grey	None	0	0	Negative
1	1	SP	School Police Office near Stairwell 4	Door Frame	Metal	Grey	None	0	0	Negative
1	1	SP	School Police Office near Stairwell 4	W3	CMU	White	None	0	0	Negative
1	1	SP	School Police Office near Stairwell 4	W4	CMU	White	None	0	0	Negative
1	1	SP	School Police Office near Stairwell 4	Ceiling	2x2 CT	Unpainted	N/A	N/A	N/A	N/A
1	1	SP	School Police Office near Stairwell 4	Ceiling	Concrete	Unpainted	N/A	N/A	N/A	N/A
1	1	SP	School Police Office near Stairwell 4	Floor	Carpet	Unpainted	N/A	N/A	N/A	N/A
1	1	V1	Front Entrance Vestibule	W1	CMU	White	None	0	0	Negative
1	1	V1	Front Entrance Vestibule	W2	CMU	White	None	0	0	Negative
1	1	V1	Front Entrance Vestibule	Door Frame	Metal	Grey	Chipping	2	0	Negative

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	1	V1	Front Entrance Vestibule	W3	Sheetrock	White	None	0	0	Negative
1	1	V1	Front Entrance Vestibule	W4	Brick	Unpainted	N/A	N/A	N/A	N/A
1	1	V1	Front Entrance Vestibule	Heater Cover	Metal	White	None	0	0	Negative
1	1	V1	Front Entrance Vestibule	Ceiling	Metal	White	None	0	0	Negative
1	1	V1	Front Entrance Vestibule	Floor	12x12 VAT	Unpainted	N/A	N/A	N/A	N/A
1	1	V3	Entrance Vestibule next to Stairwell 3	W1	CMU	White	None	0	0	Negative
1	1	V3	Entrance Vestibule next to Stairwell 3	W2	CMU	White	None	0	0	Negative
1	1	V3	Entrance Vestibule next to Stairwell 3	W3	CMU	White	None	0	0	Negative
1	1	V3	Entrance Vestibule next to Stairwell 3	W4	CMU	White	None	0	0	Negative

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	1	V3	Entrance Vestibule next to Stairwell 3	Ceiling	Sheetrock	White	None	0	0	Negative
1	1	V3	Entrance Vestibule next to Stairwell 3	Heater Cover	Metal	White	None	0	0	Negative
1	1	V3	Entrance Vestibule next to Stairwell 3	Floor	12x12 VAT	Unpainted	N/A	N/A	N/A	N/A
1	1	W1	Women's Restroom next to Passenger Elevator	W1	Ceramic Tiles	Unpainted	N/A	N/A	N/A	N/A
1	1	W1	Women's Restroom next to Passenger Elevator	Door Frame	Metal	Grey	Chipping	2	0	Negative
1	1	W1	Women's Restroom next to Passenger Elevator	W2	Ceramic Tiles	Unpainted	N/A	N/A	N/A	N/A
1	1	W1	Women's Restroom next to Passenger Elevator	W3	Ceramic Tiles	Unpainted	N/A	N/A	N/A	N/A
1	1	W1	Women's Restroom next to Passenger Elevator	W4	Ceramic Tiles	Unpainted	N/A	N/A	N/A	N/A
1	1	W1	Women's Restroom next to Passenger Elevator	Ceiling	Sheetrock	White	Chipping	2	0	Negative
1	1	W1	Women's Restroom next to Passenger Elevator	Floor	Ceramic Tiles	Unpainted	N/A	N/A	N/A	N/A
1	1	WC	Main Office Suite - Common Area	W1	Glass Block	Unpainted	N/A	N/A	N/A	N/A

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	1	WC	Main Office Suite - Common Area	W2	Glass Block	Unpainted	N/A	N/A	N/A	N/A
1	1	WC	Main Office Suite - Common Area	W2	Brick	Unpainted	N/A	N/A	N/A	N/A
1	1	WC	Main Office Suite - Common Area	W3	Glass Block	Unpainted	N/A	N/A	N/A	N/A
1	1	WC	Main Office Suite - Common Area	W4	Glass Block	Unpainted	N/A	N/A	N/A	N/A
1	1	WC	Main Office Suite - Common Area	Heater Cover	Metal	White	None	0	0	Negative
1	1	WC	Main Office Suite - Common Area	Ceiling	Metal	Grey	None	0	0	Negative
1	1	WC	Main Office Suite - Common Area	Floor	12x12 VAT	Unpainted	N/A	N/A	N/A	N/A
1	2	1	Crossroads Principal's Office across from Room 238	W1	CMU	White	None	0	0	Negative
1	2	1	Crossroads Principal's Office across from Room 238	Door Frame	Metal	Grey	None	0	0	Negative
1	2	1	Crossroads Principal's Office across from Room 238	W2	CMU	White	None	0	0	Negative
1	2	1	Crossroads Principal's Office across from Room 238	W3	CMU	Tan	None	0	0	Negative

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	2	1	Crossroads Principal's Office across from Room 238	W4	CMU	White	None	0	0	Negative
1	2	1	Crossroads Principal's Office across from Room 238	Ceiling	Sheetrock	White	None	0	0	Negative
1	2	1	Crossroads Principal's Office across from Room 238	Floor	Carpet	Unpainted	N/A	N/A	N/A	N/A
1	2	1-CL	Crossroads Principal's Office Closet	W1	CMU	White	None	0	0	Negative
1	2	1-CL	Crossroads Principal's Office Closet	Door Frame	Metal	Grey	None	0	0	Negative
1	2	1-CL	Crossroads Principal's Office Closet	W2	CMU	White	None	0	0	Negative
1	2	1-CL	Crossroads Principal's Office Closet	W3	Sheetrock	White	None	0	0	Negative
1	2	1-CL	Crossroads Principal's Office Closet	W4	CMU	White	None	0	0	Negative
1	2	1-CL	Crossroads Principal's Office Closet	Ceiling	Sheetrock	White	None	0	0	Negative
1	2	1-CL	Crossroads Principal's Office Closet	Ductwork	Metal	White	None	0	0	Negative
1	2	1-CL	Crossroads Principal's Office Closet	Floor	Carpet	Unpainted	N/A	N/A	N/A	N/A

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	2	1A	Crossroads Principal's Office Restroom	W1	CMU	Grey	Cracking	1	0	Negative
1	2	1A	Crossroads Principal's Office Restroom	Door Frame	Metal	Grey	None	0	0	Negative
1	2	1A	Crossroads Principal's Office Restroom	W2	Ceramic Tiles	Unpainted	N/A	N/A	N/A	N/A
1	2	1A	Crossroads Principal's Office Restroom	W3	CMU	Grey	None	0	0	Negative
1	2	1A	Crossroads Principal's Office Restroom	W4	CMU	Grey	None	0	0	Negative
1	2	1A	Crossroads Principal's Office Restroom	Ceiling	Sheetrock	White	Flaking	1	0	Negative
1	2	1A	Crossroads Principal's Office Restroom	Floor	Ceramic Tiles	Unpainted	N/A	N/A	N/A	N/A
1	2	2	Orientation Room across from G Pod	W1	CMU	White	None	0	0	Negative
1	2	2	Orientation Room across from G Pod	Door Frame	Metal	Grey	None	0	0	Negative
1	2	2	Orientation Room across from G Pod	W2	CMU	White	None	0	0	Negative
1	2	2	Orientation Room across from G Pod	W3	CMU	Green	None	0	0	Negative

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	2	2	Orientation Room across from G Pod	W4	CMU	White	None	0	0	Negative
1	2	2	Orientation Room across from G Pod	Ceiling	Sheetrock	White	None	0	0	Negative
1	2	2	Orientation Room across from G Pod	Floor	Carpet	Unpainted	N/A	N/A	N/A	N/A
1	2	2-CL	Orientation Room Closet	W1	CMU	White	None	0	0	Negative
1	2	2-CL	Orientation Room Closet	Door Frame	Metal	Grey	None	0	0	Negative
1	2	2-CL	Orientation Room Closet	W2	CMU	White	None	0	0	Negative
1	2	2-CL	Orientation Room Closet	W3	Sheetrock	White	None	0	0	Negative
1	2	2-CL	Orientation Room Closet	W4	CMU	White	None	0	0	Negative
1	2	2-CL	Orientation Room Closet	Ceiling	Sheetrock	White	None	0	0	Negative
1	2	2-CL	Orientation Room Closet	Floor	Carpet	Unpainted	N/A	N/A	N/A	N/A
1	2	2A	Orientation Room Restroom	W1	CMU	Grey	None	0	0	Negative

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	2	2A	Orientation Room Restroom	Door Frame	Metal	Grey	None	0	0	Negative
1	2	2A	Orientation Room Restroom	W2	Ceramic Tiles	Unpainted	N/A	N/A	N/A	N/A
1	2	2A	Orientation Room Restroom	W3	CMU	Grey	None	0	0	Negative
1	2	2A	Orientation Room Restroom	W4	CMU	Grey	None	0	0	Negative
1	2	2A	Orientation Room Restroom	Ceiling	Sheetrock	White	None	0	0	Negative
1	2	2A	Orientation Room Restroom	Floor	Ceramic Tiles	Unpainted	N/A	N/A	N/A	N/A
1	2	238	Electrical Room 238	W1	CMU	White	None	0	0	Negative
1	2	238	Electrical Room 238	Door Frame	Metal	Grey	None	0	0	Negative
1	2	238	Electrical Room 238	W2	Sheetrock	White	None	0	0	Negative
1	2	238	Electrical Room 238	W3	Sheetrock	White	None	0	0	Negative
1	2	238	Electrical Room 238	W4	CMU	White	None	0	0	Negative



			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	2	238	Electrical Room 238	Ceiling	Sheetrock	White	None	0	0	Negative
1	2	238	Electrical Room 238	Floor	Concrete	Unpainted	N/A	N/A	N/A	N/A
1	2	245	Office 245	W1	CMU	White	None	0	0	Negative
1	2	245	Office 245	Door Frame	Metal	Grey	None	0	0	Negative
1	2	245	Office 245	W2	Sheetrock	White	None	0	0	Negative
1	2	245	Office 245	W3	CMU	White	None	0	0	Negative
1	2	245	Office 245	W4	Sheetrock	White	None	0	0	Negative
1	2	245	Office 245	Ceiling	2x2 CT	Unpainted	N/A	N/A	N/A	N/A
1	2	245	Office 245	Ceiling	Sheetrock	Unpainted	N/A	N/A	N/A	N/A
1	2	245	Office 245	Floor	Carpet	Unpainted	N/A	N/A	N/A	N/A
1	2	246	Supply Room 246	W1	CMU	White	Cracking	1	0	Negative

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	2	246	Supply Room 246	Door Frame	Metal	Grey	None	0	0	Negative
1	2	246	Supply Room 246	W2	Sheetrock	White	None	0	0	Negative
1	2	246	Supply Room 246	W3	Sheetrock	White	None	0	0	Negative
1	2	246	Supply Room 246	W4	Sheetrock	Tan	None	0	0	Negative
1	2	246	Supply Room 246	Ceiling	2x2 CT	Unpainted	N/A	N/A	N/A	N/A
1	2	246	Supply Room 246	Ceiling	Sheetrock	Unpainted	N/A	N/A	N/A	N/A
1	2	246	Supply Room 246	Floor	Carpet	Unpainted	N/A	N/A	N/A	N/A
1	2	247	Office 247	W1	CMU	White	None	0	0	Negative
1	2	247	Office 247	Door Frame	Metal	Grey	Friction	2	0	Negative
1	2	247	Office 247	W2	Sheetrock	Grey	None	0	0	Negative
1	2	247	Office 247	W2	CMU	White	None	0	0	Negative

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	2	247	Office 247	W3	CMU	White	None	0	0	Negative
1	2	247	Office 247	W4	Sheetrock	Grey	None	0	0	Negative
1	2	247	Office 247	Ceiling	2x2 CT	Unpainted	N/A	N/A	N/A	N/A
1	2	247	Office 247	Ceiling	Concrete	Unpainted	N/A	N/A	N/A	N/A
1	2	247	Office 247	Floor	Carpet	Unpainted	N/A	N/A	N/A	N/A
1	2	248	Main Office 248	W1	Sheetrock	White	None	0	0	Negative
1	2	248	Main Office 248	Door	Metal	Grey	None	0	0	Negative
1	2	248	Main Office 248	Door Frame	Metal	Grey	None	0	0	Negative
1	2	248	Main Office 248	W2	CMU	White	None	0	0	Negative
1	2	248	Main Office 248	W3	Window	Unpainted	N/A	N/A	N/A	N/A
1	2	248	Main Office 248	W4	CMU	White	None	0	0	Negative

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	2	248	Main Office 248	Ceiling	2X2 CT	Unpainted	N/A	N/A	N/A	N/A
1	2	248	Main Office 248	Ceiling	Concrete	White	None	0	0	Negative
1	2	248	Main Office 248	Floor	Carpet	Unpainted	N/A	N/A	N/A	N/A
1	2	248C	Storage Room in Main Office 248	W1	CMU	Beige	None	0	0	Negative
1	2	248C	Storage Room in Main Office 248	DOOR FRAME	Metal	GREY	None	0	0	Negative
1	2	248C	Storage Room in Main Office 248	W2	CMU	Beige	None	0	0	Negative
1	2	248C	Storage Room in Main Office 248	COLUMN	Concrete	Beige	None	0	0	Negative
1	2	248C	Storage Room in Main Office 248	Pipes	Metal	Beige	None	0	0	Negative
1	2	248C	Storage Room in Main Office 248	W3	Sheetrock	Beige	Chipping	1	0	Negative
1	2	248C	Storage Room in Main Office 248	W4	CMU	Beige	None	0	0	Negative

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	2	248C	Storage Room in Main Office 248	Ceiling	Concrete	White	None	0	0	Negative
1	2	248C	Storage Room in Main Office 248	Floor	Carpet	Unpainted	N/A	N/A	N/A	N/A
1	2	251	Server Room 251	W1	CMU	White	None	0	0	Negative
1	2	251	Server Room 251	Door Frame	Metal	Grey	None	0	0	Negative
1	2	251	Server Room 251	W2	CMU	White	None	0	0	Negative
1	2	251	Server Room 251	W3	Sheetrock	White	None	0	0	Negative
1	2	251	Server Room 251	Cable Panel	Wood	Grey	Chipping	4	0	Negative
1	2	251	Server Room 251	Ceiling	Concrete	White	None	0	0	Negative

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	2	251	Server Room 251	Pipes	Metal	White	None	0	0	Negative
1	2	251	Server Room 251	Floor	Concrete	Unpainted	N/A	N/A	N/A	N/A
1	2	252	Assistant Principal's Office 252	W1	CMU	Tan	None	0	0	Negative
1	2	252	Assistant Principal's Office 252	Door Frame	Metal	Grey	Chipping	2	0	Negative
1	2	252	Assistant Principal's Office 252	W2	Sheetrock	Tan	None	0	0	Negative
1	2	252	Assistant Principal's Office 252	W3	CMU	Tan	None	0	0	Negative
1	2	252	Assistant Principal's Office 252	W4	Sheetrock	Tan	Chipping	1	0	Negative
1	2	252	Assistant Principal's Office 252	Ceiling	2x2 CT	Unpainted	N/A	N/A	N/A	N/A
1	2	252	Assistant Principal's Office 252	Ceiling	Concrete	Unpainted	N/A	N/A	N/A	N/A
1	2	252	Assistant Principal's Office 252	Floor	Carpet	Unpainted	N/A	N/A	N/A	N/A
1	2	252CL	Assistant Principal's Office 252 Closet	W1	Sheetrock	White	None	0	0	Negative

			Dates: 10/9/2023 thru 10/19/2023	Lead-Safe Certification Assessment Report						
			Inspector Name: Paul Davis and Certificate Number: 060094	Philadelphia Learning Academy West/Crossroads Accelerated Academy MS						
			Inspection Company: VERTEX, LLC	4300 Westminster Ave, Philadelphia PA 19104						
E l e m e n t	F l o o r	Space #	On-Site Room Name	Component	Substrate Material	Paint Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/ negative)
1	2	252CL	Assistant Principal's Office 252 Closet	Door Frame	Metal	Grey	None	0	0	Negative
1	2	252CL	Assistant Principal's Office 252 Closet	W2	CMU	White	None	0	0	Negative
1	2	252CL	Assistant Principal's Office 252 Closet	W3	CMU	White	None	0	0	Negative
1	2	252CL	Assistant Principal's Office 252 Closet	W4	Sheetrock	White	None	0	0	Negative
1	2	252CL	Assistant Principal's Office 252 Closet	Ceiling	Concrete	White	None	0	0	Negative
1	2	252CL	Assistant Principal's Office 252 Closet	Floor	Carpet	Unpainted	N/A	N/A	N/A	N/A
1	2	254	Climate Manager Office 254	W1	CMU	White	Cracking	1	0	Negative
1	2	254	Climate Manager Office 254	Door Frame	Metal	Grey	None	0	0.02	Negative
1	2	254	Climate Manager Office 254	W2	Sheetrock	Tan	None	0	0	Negative
1	2	254	Climate Manager Office 254	W3	CMU	White	None	0	0	Negative

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	2	254	Climate Manager Office 254	W4	Sheetrock	Tan	Hole	1	0	Negative
1	2	254	Climate Manager Office 254	Ceiling	2x2 CT	Unpainted	N/A	N/A	N/A	N/A
1	2	254	Climate Manager Office 254	Ceiling	Concrete	Grey	Flaking	6	0	Negative
1	2	254	Climate Manager Office 254	Floor	Carpet	Unpainted	N/A	N/A	N/A	N/A
1	2	255	Climate Specialist Office 255	W1	CMU	White	None	0	0	Negative
1	2	255	Climate Specialist Office 255	Door Frame	Metal	Grey	None	0	0	Negative
1	2	255	Climate Specialist Office 255	W2	Sheetrock	White	None	0	0	Negative
1	2	255	Climate Specialist Office 255	W3	CMU	White	None	0	0	Negative
1	2	255	Climate Specialist Office 255	W4	Sheetrock	White	Chipping	1	0	Negative
1	2	255	Climate Specialist Office 255	Ceiling	2x2 CT	Unpainted	N/A	N/A	N/A	N/A



			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	2	255	Climate Specialist Office 255	Ceiling	Concrete	Unpainted	N/A	N/A	N/A	N/A
1	2	255	Climate Specialist Office 255	Column	Concrete	White	Chipping	1	0	Negative
1	2	255	Climate Specialist Office 255	Floor	Carpet	Unpainted	N/A	N/A	N/A	N/A
1	2	256	Computer Support Specialist Office 256	W1	CMU	White	None	0	0	Negative
1	2	256	Computer Support Specialist Office 256	Door Frame	Metal	Grey	None	0	0	Negative
1	2	256	Computer Support Specialist Office 256	W2	Sheetrock	White	Chipping	2	0	Negative
1	2	256	Computer Support Specialist Office 256	W3	CMU	White	None	0	0	Negative
1	2	256	Computer Support Specialist Office 256	W4	CMU	White	None	0	0	Negative
1	2	256	Computer Support Specialist Office 256	Ceiling	Concrete	White	None	0	0	Negative
1	2	256	Computer Support Specialist Office 256	Exterior, Ductwork	Metal	White	None	0	0	Negative

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	2	256	Computer Support Specialist Office 256	Pipes	Metal	White	Chipping	4	0	Negative
1	2	256	Computer Support Specialist Office 256	Floor	Concrete	Unpainted	N/A	N/A	N/A	N/A
1	2	257	Office 257 next to Stairwell 3	W1	CMU	White	None	0	0	Negative
1	2	257	Office 257 next to Stairwell 3	Door Frame	Metal	Grey	None	0	0	Negative
1	2	257	Office 257 next to Stairwell 3	W2	CMU	White	None	0	0	Negative
1	2	257	Office 257 next to Stairwell 3	W3	CMU	White	None	0	0	Negative
1	2	257	Office 257 next to Stairwell 3	W4	CMU	White	None	0	0	Negative
1	2	257	Office 257 next to Stairwell 3	Ceiling	2x2 CT	Unpainted	N/A	N/A	N/A	N/A
1	2	257	Office 257 next to Stairwell 3	Ceiling	Concrete	Unpainted	N/A	N/A	N/A	N/A
1	2	257	Office 257 next to Stairwell 3	Floor	Carpet	Unpainted	N/A	N/A	N/A	N/A
1	2	258	Storage Room 258 next to Stairwell 3	W1	No Access	No Access	No Access	No Access	No Access	No Access

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	2	258	Storage Room 258 next to Stairwell 3	W2	No Access	No Access	No Access	No Access	No Access	No Access
1	2	258	Storage Room 258 next to Stairwell 3	W3	No Access	No Access	No Access	No Access	No Access	No Access
1	2	258	Storage Room 258 next to Stairwell 3	W4	No Access	No Access	No Access	No Access	No Access	No Access
1	2	258	Storage Room 258 next to Stairwell 3	Ceiling	No Access	No Access	No Access	No Access	No Access	No Access
1	2	258	Storage Room 258 next to Stairwell 3	Floor	No Access	No Access	No Access	No Access	No Access	No Access
1	2	259	Electrical Room 259	W1	CMU	White	None	0	0	Negative
1	2	259	Electrical Room 259	W2	CMU	White	None	0	0	Negative
1	2	259	Electrical Room 259	W3	CMU	White	None	0	0	Negative
1	2	259	Electrical Room 259	W3	Sheetrock	White	None	0	0	Negative
1	2	259	Electrical Room 259	W4	Sheetrock	White	None	0	0	Negative
1	2	259	Electrical Room 259	Ceiling	Concrete	White	None	0	0	Negative

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	2	259	Electrical Room 259	Floor	Concrete	Unpainted	N/A	N/A	N/A	N/A
1	2	260	Storage Room 260	W1	CMU	Grey	None	0	0	Negative
1	2	260	Storage Room 260	Door Frame	Metal	Grey	Chipping	1	0	Negative
1	2	260	Storage Room 260	W2	Sheetrock	Grey	None	0	0	Negative
1	2	260	Storage Room 260	W3	CMU	Grey	None	0	0	Negative
1	2	260	Storage Room 260	W4	CMU	Grey	None	0	0	Negative
1	2	260	Storage Room 260	W4	Sheetrock	Grey	None	0	0.02	Negative
1	2	260	Storage Room 260	Ceiling	Concrete	White	Flaking	6	0	Negative
1	2	260	Storage Room 260	Ductwork	Metal	White	Chipping	1	0	Negative
1	2	260	Storage Room 260	Pipes	Metal	White	Chipping	3	0	Negative
1	2	260	Storage Room 260	Floor	Concrete	Unpainted	N/A	N/A	N/A	N/A

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	2	261	Climate Specialist Office 261	W1	CMU	White	None	0	0	Negative
1	2	261	Climate Specialist Office 261	Door Frame	Metal	Grey	Chipping	1	0	Negative
1	2	261	Climate Specialist Office 261	W2	Sheetrock	White	Chipping	1	0	Negative
1	2	261	Climate Specialist Office 261	W3	Sheetrock	Tan	Chipping	2	0	Negative
1	2	261	Climate Specialist Office 261	W4	Sheetrock	White	Chipping	1	0	Negative
1	2	261	Climate Specialist Office 261	Ceiling	2x2 CT	Unpainted	N/A	N/A	N/A	N/A
1	2	261	Climate Specialist Office 261	Ceiling	Concrete	Unpainted	N/A	N/A	N/A	N/A
1	2	261	Climate Specialist Office 261	Floor	Carpet	Unpainted	N/A	N/A	N/A	N/A
1	2	262	Office 262	W1	CMU	White	None	0	0	Negative
1	2	262	Office 262	Door Frame	Metal	Grey	None	0	0	Negative
1	2	262	Office 262	W2	Sheetrock	White	Chipping	2	0	Negative

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	2	262	Office 262	W3	Sheetrock	White	None	0	0	Negative
1	2	262	Office 262	W4	Sheetrock	Tan	Staples	4	0	Negative
1	2	262	Office 262	Ceiling	2x2 CT	Unpainted	N/A	N/A	N/A	N/A
1	2	262	Office 262	Ceiling	Concrete	Unpainted	N/A	N/A	N/A	N/A
1	2	262	Office 262	Floor	Carpet	Unpainted	N/A	N/A	N/A	N/A
1	2	263	Health Office Waiting Room	W1	CMU	White	Cracking	2	0	Negative
1	2	263	Health Office Waiting Room	Door Frame	Metal	Grey	None	0	0	Negative
1	2	263	Health Office Waiting Room	W2	Sheetrock	White	None	0	0	Negative
1	2	263	Health Office Waiting Room	W3	Sheetrock	White	None	0	0	Negative
1	2	263	Health Office Waiting Room	W4	Sheetrock	White	None	0	0	Negative
1	2	263	Health Office Waiting Room	Ceiling	2x2 CT	Unpainted	N/A	N/A	N/A	N/A

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	2	263	Health Office Waiting Room	Ceiling	Concrete	Unpainted	N/A	N/A	N/A	N/A
1	2	263	Health Office Waiting Room	Floor	Carpet	Unpainted	N/A	N/A	N/A	N/A
1	2	264	Nurse's Office 264	W1	Sheetrock	White	None	0	0	Negative
1	2	264	Nurse's Office 264	Door Frame	Metal	Grey	None	0	0	Negative
1	2	264	Nurse's Office 264	W2	Sheetrock	White	Chipping	4	0	Negative
1	2	264	Nurse's Office 264	W3	CMU	White	None	0	0	Negative
1	2	264	Nurse's Office 264	W4	CMU	White	None	0	0	Negative
1	2	264	Nurse's Office 264	Ceiling	2x2 CT	Unpainted	N/A	N/A	N/A	N/A
1	2	264	Nurse's Office 264	Ceiling	Concrete	Grey	None	0	0	Negative
1	2	264	Nurse's Office 264	Floor	Carpet	Unpainted	N/A	N/A	N/A	N/A

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	2	265	Health Office 265	W1	Sheetrock	White	Chipping	4	0	Negative
1	2	265	Health Office 265	Door Frame	Metal	Grey	None	0	0	Negative
1	2	265	Health Office 265	W2	Sheetrock	White	None	0	0	Negative
1	2	265	Health Office 265	W3	CMU	White	None	0	0	Negative
1	2	265	Health Office 265	W4	CMU	White	Chipping	1	0	Negative
1	2	265	Health Office 265	Ceiling	2x2 CT	Unpainted	N/A	N/A	N/A	N/A
1	2	265	Health Office 265	Ceiling	Concrete	Unpainted	N/A	N/A	N/A	N/A
1	2	265	Health Office 265	Floor	Carpet	Unpainted	N/A	N/A	N/A	N/A
1	2	H-RR	Health Office Restroom	W1	Ceramic Tiles	Unpainted	N/A	N/A	N/A	N/A
1	2	H-RR	Health Office Restroom	Door Frame	Metal	Grey	None	0	0	Negative



			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	2	H-RR	Health Office Restroom	W2	Ceramic Tiles	Unpainted	N/A	N/A	N/A	N/A
1	2	H-RR	Health Office Restroom	W3	Ceramic Tiles	Unpainted	N/A	N/A	N/A	N/A
1	2	H-RR	Health Office Restroom	W4	Ceramic Tiles	Unpainted	N/A	N/A	N/A	N/A
1	2	H-RR	Health Office Restroom	Ceiling	Sheetrock	White	None	0	0	Negative
1	2	H-RR	Health Office Restroom	Floor	Ceramic Tiles	Unpainted	N/A	N/A	N/A	N/A
1	2	266	Conference Room 266 next to Stairwell 2	W1	CMU	White	None	0	0	Negative
1	2	266	Conference Room 266 next to Stairwell 2	Door Frame	Metal	Grey	None	0	0	Negative
1	2	266	Conference Room 266 next to Stairwell 2	W2	CMU	White	None	0	0	Negative
1	2	266	Conference Room 266 next to Stairwell 2	W3	CMU	White	None	0	0	Negative
1	2	266	Conference Room 266 next to Stairwell 2	Column	Concrete	White	None	0	0	Negative

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	2	266	Conference Room 266 next to Stairwell 2	W4	CMU	White	None	0	0	Negative
1	2	266	Conference Room 266 next to Stairwell 2	Ceiling	2x2 CT	Unpainted	N/A	N/A	N/A	N/A
1	2	266	Conference Room 266 next to Stairwell 2	Ceiling	Concrete	Unpainted	N/A	N/A	N/A	N/A
1	2	266	Conference Room 266 next to Stairwell 2	Floor	Carpet	Unpainted	N/A	N/A	N/A	N/A
1	2	267	Office 267	W1	CMU	White	None	0	0	Negative
1	2	267	Office 267	Door Frame	Metal	Grey	None	0	0	Negative
1	2	267	Office 267	W2	CMU	White	None	0	0	Negative
1	2	267	Office 267	W3	CMU	White	None	0	0	Negative
1	2	267	Office 267	Door	Metal	Grey	None	0	0	Negative
1	2	267	Office 267	Door Frame	Metal	Grey	None	0	0	Negative
1	2	267	Office 267	W4	CMU	White	None	0	0	Negative

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	2	267	Office 267	Ceiling	2x2 CT	Unpainted	N/A	N/A	N/A	N/A
1	2	267	Office 267	Ceiling	Concrete	Unpainted	N/A	N/A	N/A	N/A
1	2	267	Office 267	Ceiling	Metal	Unpainted	N/A	N/A	N/A	N/A
1	2	267	Office 267	Floor	Carpet	Unpainted	N/A	N/A	N/A	N/A
1	2	268	Mechanical Room 268 inside Office 267	W1	CMU	Unpainted	N/A	N/A	N/A	N/A
1	2	268	Mechanical Room 268 inside Office 267	W2	CMU	Unpainted	N/A	N/A	N/A	N/A
1	2	268	Mechanical Room 268 inside Office 267	W3	CMU	Unpainted	N/A	N/A	N/A	N/A
1	2	268	Mechanical Room 268 inside Office 267	W4	CMU	Unpainted	N/A	N/A	N/A	N/A
1	2	268	Mechanical Room 268 inside Office 267	Ceiling	Concrete	Unpainted	N/A	N/A	N/A	N/A
1	2	268	Mechanical Room 268 inside Office 267	Ceiling	Metal	Unpainted	N/A	N/A	N/A	N/A
1	2	268	Mechanical Room 268 inside Office 267	Floor	Concrete	Grey	Friction	50	0	Negative
1	2	270A	Gender Neutral Restroom 270A off Stairwell 2	W1	CMU	Grey	None	0	0	Negative

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	2	270A	Gender Neutral Restroom 270A off Stairwell 2	Door Frame	Metal	Grey	None	0	0	Negative
1	2	270A	Gender Neutral Restroom 270A off Stairwell 2	W2	CMU	Grey	None	0	0	Negative
1	2	270A	Gender Neutral Restroom 270A off Stairwell 2	W3	Ceramic Tiles	Unpainted	N/A	N/A	N/A	N/A
1	2	270A	Gender Neutral Restroom 270A off Stairwell 2	W4	CMU	Grey	None	0	0	Negative
1	2	270A	Gender Neutral Restroom 270A off Stairwell 2	Ceiling	Sheetrock	White	None	0	0	Negative
1	2	270A	Gender Neutral Restroom 270A off Stairwell 2	Floor	Ceramic Tiles	Unpainted	N/A	N/A	N/A	N/A
1	2	270B	Gender Neutral Restroom 270B off Stairwell 2	W1	CMU	Grey	None	0	0	Negative
1	2	270B	Gender Neutral Restroom 270B off Stairwell 2	Door Frame	Metal	Grey	None	0	0	Negative
1	2	270B	Gender Neutral Restroom 270B off Stairwell 2	W2	CMU	Grey	None	0	0	Negative
1	2	270B	Gender Neutral Restroom 270B off Stairwell 2	W3	Ceramic Tiles	Unpainted	N/A	N/A	N/A	N/A

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	2	270B	Gender Neutral Restroom 270B off Stairwell 2	W4	CMU	Grey	None	0	0	Negative
1	2	270B	Gender Neutral Restroom 270B off Stairwell 2	Ceiling	Sheetrock	White	None	0	0	Negative
1	2	270B	Gender Neutral Restroom 270B off Stairwell 2	Floor	Ceramic Tiles	Unpainted	N/A	N/A	N/A	N/A
1	2	274	Office Suite - Office 274	W1	Sheetrock	White	None	0	0	Negative
1	2	274	Office Suite - Office 274	Door Frame	Metal	Grey	None	0	0	Negative
1	2	274	Office Suite - Office 274	W2	Sheetrock	White	Holes	1	0	Negative
1	2	274	Office Suite - Office 274	W3	CMU	White	None	0	0	Negative
1	2	274	Office Suite - Office 274	W4	Sheetrock	Tan	None	0	0	Negative
1	2	274	Office Suite - Office 274	Ceiling	2x2 CT	Unpainted	N/A	N/A	N/A	N/A

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	2	274	Office Suite - Office 274	Ceiling	Concrete	White	Chipping	2	0	Negative
1	2	274	Office Suite - Office 274	Floor	CMU	Unpainted	N/A	N/A	N/A	N/A
1	2	274A	Meeting Room next to Office 274	W1	Sheetrock	White	None	0	0	Negative
1	2	274A	Meeting Room next to Office 274	Door Frame	Metal	Grey	None	0	0	Negative
1	2	274A	Meeting Room next to Office 274	W2	Sheetrock	White	Holes	1	0	Negative
1	2	274A	Meeting Room next to Office 274	W3	CMU	Tan	None	0	0	Negative
1	2	274A	Meeting Room next to Office 274	W4	CMU	Tan	None	0	0.02	Negative
1	2	274A	Meeting Room next to Office 274	Ceiling	2x2 CT	Unpainted	N/A	N/A	N/A	N/A
1	2	274A	Meeting Room next to Office 274	Ceiling	Concrete	Unpainted	N/A	N/A	N/A	N/A
1	2	274A	Meeting Room next to Office 274	Floor	Carpet	Unpainted	N/A	N/A	N/A	N/A
1	2	275	Office Suite - Office 275	W1	Sheetrock	White	None	0	0	Negative

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	2	275	Office Suite - Office 275	Door Frame	Metal	Grey	None	0	0	Negative
1	2	275	Office Suite - Office 275	W2	Sheetrock	White	Holes	1	0	Negative
1	2	275	Office Suite - Office 275	W3	CMU	White	Holes	1	0	Negative
1	2	275	Office Suite - Office 275	W4	Sheetrock	Tan	Chipping	1	0	Negative
1	2	275	Office Suite - Office 275	Ceiling	2x2 CT	Unpainted	N/A	N/A	N/A	N/A
1	2	275	Office Suite - Office 275	Ceiling	Concrete	White	Flaking	6	0	Negative
1	2	275	Office Suite - Office 275	Floor	Carpet	Unpainted	N/A	N/A	N/A	N/A
1	2	276	Office Suite - Storage Room 276	W1	Sheetrock	White	Chipping	1	0	Negative
1	2	276	Office Suite - Storage Room 276	Door Frame	Metal	Grey	Chipping	2	0	Negative
1	2	276	Office Suite - Storage Room 276	W2	Sheetrock	White	Chipping	10	0	Negative

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	2	276	Office Suite - Storage Room 276	W3	CMU	Tan	None	0	0	Negative
1	2	276	Office Suite - Storage Room 276	W4	Sheetrock	White	Chipping	8	0	Negative
1	2	276	Office Suite - Storage Room 276	Ceiling	2x2 CT	Unpainted	N/A	N/A	N/A	N/A
1	2	276	Office Suite - Storage Room 276	Ceiling	Concrete	White	Chipping	6	0	Negative
1	2	276	Office Suite - Storage Room 276	Floor	Carpet	Unpainted	N/A	N/A	N/A	N/A
1	2	277	Office Suite - Office 277	W1	Sheetrock	White	Staples	2	0	Negative
1	2	277	Office Suite - Office 277	Door Frame	Metal	Grey	None	0	0	Negative
1	2	277	Office Suite - Office 277	W2	Sheetrock	Tan	None	0	0	Negative
1	2	277	Office Suite - Office 277	W3	CMU	White	None	0	0	Negative
1	2	277	Office Suite - Office 277	W4	Sheetrock	Purple	None	0	0	Negative



			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	2	277	Office Suite - Office 277	Ceiling	2x2 CT	Unpainted	N/A	N/A	N/A	N/A
1	2	277	Office Suite - Office 277	Ceiling	Concrete	White	Flaking	10	0	Negative
1	2	277	Office Suite - Office 277	Floor	Carpet	Unpainted	N/A	N/A	N/A	N/A
1	2	278	Office Suite - Storage Room 278	W1	Sheetrock	White	None	0	0	Negative
1	2	278	Office Suite - Storage Room 278	Door Frame	Metal	Grey	Chipping	1	0	Negative
1	2	278	Office Suite - Storage Room 278	W2	Sheetrock	White	None	0	0	Negative
1	2	278	Office Suite - Storage Room 278	W3	CMU	Tan	None	0	0	Negative
1	2	278	Office Suite - Storage Room 278	W4	Sheetrock	White	Holes	1	0	Negative
1	2	278	Office Suite - Storage Room 278	Ceiling	2x2 CT	Unpainted	N/A	N/A	N/A	N/A

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	2	278	Office Suite - Storage Room 278	Ceiling	Concrete	White	Chipping	4	0	Negative
1	2	278	Office Suite - Storage Room 278	Floor	Carpet	Unpainted	N/A	N/A	N/A	N/A
1	2	279	Office Suite - Office 279	W1	Sheetrock	White	None	0	0	Negative
1	2	279	Office Suite - Office 279	Door Frame	Metal	Grey	None	0	0	Negative
1	2	279	Office Suite - Office 279	W2	Sheetrock	Purple	None	0	0	Negative
1	2	279	Office Suite - Office 279	W3	CMU	Tan	None	0	0	Negative
1	2	279	Office Suite - Office 279	W4	Sheetrock	Purple	None	0	0	Negative
1	2	279	Office Suite - Office 279	Ceiling	2x2 CT	Unpainted	N/A	N/A	N/A	N/A
1	2	279	Office Suite - Office 279	Ceiling	Concrete	White	Chipping	4	0	Negative

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	2	279	Office Suite - Office 279	Floor	Carpet	Unpainted	N/A	N/A	N/A	N/A
1	2	280	Office Suite - Office 280	W1	Sheetrock	White	None	0	0	Negative
1	2	280	Office Suite - Office 280	Door Frame	Metal	Grey	None	0	0	Negative
1	2	280	Office Suite - Office 280	W2	Sheetrock	Tan	None	0	0	Negative
1	2	280	Office Suite - Office 280	W3	CMU	White	None	0	0	Negative
1	2	280	Office Suite - Office 280	W4	Sheetrock	Tan	None	0	0	Negative
1	2	280	Office Suite - Office 280	Ceiling	2x2 CT	Unpainted	N/A	N/A	N/A	N/A
1	2	280	Office Suite - Office 280	Ceiling	Concrete	Unpainted	N/A	N/A	N/A	N/A
1	2	280	Office Suite - Office 280	Floor	Carpet	Unpainted	N/A	N/A	N/A	N/A
1	2	282	Office Suite - Office 282	W1	Sheetrock	Tan	None	0	0	Negative
1	2	282	Office Suite - Office 282	Door Frame	Metal	Grey	None	0	0	Negative
1	2	282	Office Suite - Office 282	W2	Sheetrock	Purple	None	0	0	Negative

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	2	282	Office Suite - Office 282	W3	CMU	White	None	0	0	Negative
1	2	282	Office Suite - Office 282	W4	Sheetrock	White	Chipping	1	0	Negative
1	2	282	Office Suite - Office 282	Ceiling	2x2 CT	Unpainted	N/A	N/A	N/A	N/A
1	2	282	Office Suite - Office 282	Ceiling	Concrete	White	Chipping	4	0	Negative
1	2	282	Office Suite - Office 282	Floor	Carpet	Unpainted	N/A	N/A	N/A	N/A
1	2	286	Office Suite - Office 286	W1	Sheetrock	Tan	None	0	0	Negative
1	2	286	Office Suite - Office 286	Door Frame	Metal	Grey	None	0	0	Negative
1	2	286	Office Suite - Office 286	W2	Sheetrock	White	None	0	0	Negative
1	2	286	Office Suite - Office 286	W3	CMU	White	None	0	0	Negative
1	2	286	Office Suite - Office 286	W4	Sheetrock	Tan	Holes	1	0	Negative
1	2	286	Office Suite - Office 286	Ceiling	2x2 CT	Unpainted	N/A	N/A	N/A	N/A

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	2	286	Office Suite - Office 286	Ceiling	Concrete	White	Chipping	4	0	Negative
1	2	286	Office Suite - Office 286	Floor	Carpet	Unpainted	N/A	N/A	N/A	N/A
1	2	287	Office Suite - Copy Room 287	W1	Sheetrock	White	Holes	1	0	Negative
1	2	287	Office Suite - Copy Room 287	Door Frame	Metal	Grey	None	0	0	Negative
1	2	287	Office Suite - Copy Room 287	W2	Sheetrock	White	Holes	1	0	Negative
1	2	287	Office Suite - Copy Room 287	W3	CMU	White	None	0	0	Negative
1	2	287	Office Suite - Copy Room 287	W4	Sheetrock	Tan	Chipping	1	0	Negative
1	2	287	Office Suite - Copy Room 287	Ceiling	2x2 CT	Unpainted	N/A	N/A	N/A	N/A
1	2	287	Office Suite - Copy Room 287	Ceiling	Concrete	White	Chipping	2	0	Negative

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	2	287	Office Suite - Copy Room 287	Floor	Carpet	Unpainted	N/A	N/A	N/A	N/A
1	2	287A	Office Suite Restroom	W1	Ceramic Tiles	Unpainted	N/A	N/A	N/A	N/A
1	2	287A	Office Suite Restroom	Door Frame	Metal	Grey	None	0	0	Negative
1	2	287A	Office Suite Restroom	W2	Ceramic Tiles	Unpainted	N/A	N/A	N/A	N/A
1	2	287A	Office Suite Restroom	W3	Ceramic Tiles	Unpainted	N/A	N/A	N/A	N/A
1	2	287A	Office Suite Restroom	W4	Ceramic Tiles	Unpainted	N/A	N/A	N/A	N/A
1	2	287A	Office Suite Restroom	Ceiling	Sheetrock	White	None	0	0	Negative
1	2	287A	Office Suite Restroom	Floor	Ceramic Tiles	Unpainted	N/A	N/A	N/A	N/A
1	2	290	Office 290	W1	CMU	White	None	0	0	Negative
1	2	290	Office 290	Door Frame	Metal	Grey	None	0	0	Negative
1	2	290	Office 290	W2	Sheetrock	White	Chipping	1	0	Negative

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	2	290	Office 290	W3	CMU	White	None	0	0	Negative
1	2	290	Office 290	W4	Sheetrock	Tan	None	0	0	Negative
1	2	290	Office 290	Ceiling	2x2 CT	Unpainted	N/A	N/A	N/A	N/A
1	2	290	Office 290	Ceiling	Concrete	White	Chipping	4	0	Negative
1	2	290	Office 290	Column	Concrete	White	None	0	0	Negative
1	2	290	Office 290	Floor	Carpet	Unpainted	N/A	N/A	N/A	N/A
1	2	291	Office 291	W1	CMU	White	Cracking	2	0	Negative
1	2	291	Office 291	Door Frame	Metal	Grey	None	0	0	Negative
1	2	291	Office 291	W2	Sheetrock	Tan	None	0	0	Negative

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	2	291	Office 291	W3	CMU	White	None	0	0	Negative
1	2	291	Office 291	W4	Sheetrock	White	None	0	0	Negative
1	2	291	Office 291	Ceiling	2x2 CT	Unpainted	N/A	N/A	N/A	N/A
1	2	291	Office 291	Ceiling	Concrete	Unpainted	N/A	N/A	N/A	N/A
1	2	291	Office 291	Floor	Carpet	Unpainted	N/A	N/A	N/A	N/A
1	2	292	Office 292	W1	CMU	White	None	0	0	Negative
1	2	292	Office 292	Door Frame	Metal	Grey	None	0	0	Negative
1	2	292	Office 292	W2	Sheetrock	Tan	None	0	0	Negative
1	2	292	Office 292	W3	CMU	White	None	0	0	Negative
1	2	292	Office 292	W4	Sheetrock	White	None	0	0	Negative
1	2	292	Office 292	Ceiling	2x2 CT	Unpainted	N/A	N/A	N/A	N/A



			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	2	292	Office 292	Ceiling	Concrete	White	Chipping	4	0	Negative
1	2	292	Office 292	Column	Concrete	White	None	0	0	Negative
1	2	292	Office 292	Floor	Carpet	Unpainted	N/A	N/A	N/A	N/A
1	2	293	Office 293	W1	CMU	White	None	0	0	Negative
1	2	293	Office 293	Door Frame	Metal	Grey	None	0	0	Negative
1	2	293	Office 293	W2	Sheetrock	Tan	Holes	1	0	Negative
1	2	293	Office 293	W3	CMU	White	None	0	0	Negative
1	2	293	Office 293	W4	CMU	White	None	0	0	Negative
1	2	293	Office 293	Ceiling	2x2 CT	Unpainted	N/A	N/A	N/A	N/A
1	2	293	Office 293	Ceiling	Concrete	Unpainted	N/A	N/A	N/A	N/A

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	2	293	Office 293	Floor	Carpet	Unpainted	N/A	N/A	N/A	N/A
1	2	CONF	Faculty Work Room across from Staff Restrooms & Passenger Elevator	W1	CMU	White	None	0	0	Negative
1	2	CONF	Faculty Work Room across from Staff Restrooms & Passenger Elevator	Door Frame	Metal	Grey	None	0	0	Negative
1	2	CONF	Faculty Work Room across from Staff Restrooms & Passenger Elevator	W2	CMU	White	None	0	0	Negative
1	2	CONF	Faculty Work Room across from Staff Restrooms & Passenger Elevator	W3	Sheetrock	White	None	0	0	Negative
1	2	CONF	Faculty Work Room across from Staff Restrooms & Passenger Elevator	Access Panel	Metal	White	None	0	0	Negative
1	2	CONF	Faculty Work Room across from Staff Restrooms & Passenger Elevator	W4	CMU	White	None	0	0	Negative
1	2	CONF	Faculty Work Room across from Staff Restrooms & Passenger Elevator	Ceiling	2x2 CT	Unpainted	N/A	N/A	N/A	N/A
1	2	CONF	Faculty Work Room across from Staff Restrooms & Passenger Elevator	Ceiling	Sheetrock	Unpainted	N/A	N/A	N/A	N/A

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	2	CONF	Faculty Work Room across from Staff Restrooms & Passenger Elevator	Floor	Carpet	Unpainted	N/A	N/A	N/A	N/A
1	2	D-1	Classroom D-1	W1	CMU	White	Cracking	2	0	Negative
1	2	D-1	Classroom D-1	Door Frame	Metal	Grey	Chipping	3	0	Negative
1	2	D-1	Classroom D-1	W2	CMU	White	Holes	1	0	Negative
1	2	D-1	Classroom D-1	W3	CMU	White	None	0	0	Negative
1	2	D-1	Classroom D-1	W4	CMU	Purple	None	0	0	Negative
1	2	D-1	Classroom D-1	Textured Ceiling Paint	Concrete	White	None	0	0	Negative
1	2	D-1	Classroom D-1	Exterior, Ductwork	Metal	White	None	0	0	Negative
1	2	D-1	Classroom D-1	Pipes	Metal	White	Chipping	6	0	Negative
1	2	D-1	Classroom D-1	Column	Concrete	White	None	0	0	Negative

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	2	D-1	Classroom D-1	Floor	Carpet	Unpainted	N/A	N/A	N/A	N/A
1	2	D-1-2	Restroom Vestibule between Classrooms D-1 and D-2	W1	CMU	White	None	0	0	Negative
1	2	D-1-2	Restroom Vestibule between Classrooms D-1 and D-2	W2	CMU	White	None	0	0	Negative
1	2	D-1-2	Restroom Vestibule between Classrooms D-1 and D-2	W3	CMU	White	Cracking	1	0	Negative
1	2	D-1-2	Restroom Vestibule between Classrooms D-1 and D-2	W4	CMU	White	None	0	0	Negative
1	2	D-1-2	Restroom Vestibule between Classrooms D-1 and D-2	Ceiling	Sheetrock	White	None	0	0	Negative
1	2	D-1-2	Restroom Vestibule between Classrooms D-1 and D-2	Floor	Carpet	Unpainted	N/A	N/A	N/A	N/A
1	2	D-1-2M	Boy's Restroom between Classrooms D-1 and D-2	W1	CMU	Grey	None	0	0	Negative
1	2	D-1-2M	Boy's Restroom between Classrooms D-1 and D-2	Door Frame	Metal	Grey	None	0	0	Negative
1	2	D-1-2M	Boy's Restroom between Classrooms D-1 and D-2	W2	CMU	Grey	None	0	0	Negative
1	2	D-1-2M	Boy's Restroom between Classrooms D-1 and D-2	W3	Ceramic Tiles	Unpainted	N/A	N/A	N/A	N/A

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	2	D-1-2M	Boy's Restroom between Classrooms D-1 and D-2	W4	CMU	Grey	None	0	0	Negative
1	2	D-1-2M	Boy's Restroom between Classrooms D-1 and D-2	Ceiling	Sheetrock	White	None	0	0	Negative
1	2	D-1-2M	Boy's Restroom between Classrooms D-1 and D-2	Floor	Ceramic Tiles	Unpainted	N/A	N/A	N/A	N/A
1	2	D-1-2W	Girl's Restroom between Classrooms D-1 and D-2	W1	CMU	Grey	None	0	0	Negative
1	2	D-1-2W	Girl's Restroom between Classrooms D-1 and D-2	Door Frame	Metal	Grey	None	0	0	Negative
1	2	D-1-2W	Girl's Restroom between Classrooms D-1 and D-2	W2	CMU	Grey	None	0	0	Negative
1	2	D-1-2W	Girl's Restroom between Classrooms D-1 and D-2	W3	Ceramic Tiles	Unpainted	N/A	N/A	N/A	N/A
1	2	D-1-2W	Girl's Restroom between Classrooms D-1 and D-2	W4	CMU	Grey	None	0	0	Negative
1	2	D-1-2W	Girl's Restroom between Classrooms D-1 and D-2	Ceiling	Sheetrock	White	None	0	0	Negative

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	2	D-1-2W	Girl's Restroom between Classrooms D-1 and D-2	Floor	Ceramic Tiles	Unpainted	N/A	N/A	N/A	N/A
1	2	D-1CL	Classroom D-1 Closet	W1	CMU	White	None	0	0	Negative
1	2	D-1CL	Classroom D-1 Closet	Door Frame	Metal	Grey	None	0	0	Negative
1	2	D-1CL	Classroom D-1 Closet	W2	CMU	White	None	0	0	Negative
1	2	D-1CL	Classroom D-1 Closet	W3	Sheetrock	White	None	0	0	Negative
1	2	D-1CL	Classroom D-1 Closet	W4	Sheetrock	White	None	0	0	Negative
1	2	D-1CL	Classroom D-1 Closet	Ductwork	Metal	White	None	0	0	Negative
1	2	D-1CL	Classroom D-1 Closet	Ceiling	Sheetrock	White	None	0	0	Negative
1	2	D-1CL	Classroom D-1 Closet	Floor	Carpet	Unpainted	N/A	N/A	N/A	N/A
1	2	D-2	Classroom D-2	W1	CMU	White	Holes	1	0	Negative
1	2	D-2	Classroom D-2	Door Frame	Metal	Grey	Chipping	2	0	Negative

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	2	D-2	Classroom D-2	W2	CMU	White	Cracking	2	0	Negative
1	2	D-2	Classroom D-2	W3	CMU	White	None	0	0	Negative
1	2	D-2	Classroom D-2	W4	CMU	Blue	None	0	0	Negative
1	2	D-2	Classroom D-2	Door Frame	Metal	Grey	None	0	0	Negative
1	2	D-2	Classroom D-2	Textured Ceiling Paint	Concrete	White	None	0	0	Negative
1	2	D-2	Classroom D-2	Exterior, Ductwork	Metal	White	None	0	0	Negative
1	2	D-2	Classroom D-2	Pipes	Metal	White	Chipping	4	0	Negative
1	2	D-2	Classroom D-2	Column	Concrete	White	None	0	0	Negative
1	2	D-2	Classroom D-2	Floor	Carpet	Unpainted	N/A	N/A	N/A	N/A
1	2	D-2CL	Classroom D-2 Closet	W1	CMU	White	None	0	0	Negative

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	2	D-2CL	Classroom D-2 Closet	Door Frame	Metal	Grey	None	0	0	Negative
1	2	D-2CL	Classroom D-2 Closet	W2	Sheetrock	White	None	0	0	Negative
1	2	D-2CL	Classroom D-2 Closet	W3	Sheetrock	White	None	0	0	Negative
1	2	D-2CL	Classroom D-2 Closet	W4	CMU	White	None	0	0	Negative
1	2	D-2CL	Classroom D-2 Closet	Ceiling	Sheetrock	White	None	0	0	Negative
1	2	D-2CL	Classroom D-2 Closet	Floor	Carpet	Unpainted	N/A	N/A	N/A	N/A
1	2	D-3	Classroom D-3	W1	CMU	White	Cracking	3	0	Negative
1	2	D-3	Classroom D-3	Door Frame	Metal	Grey	Chipping	2	0	Negative
1	2	D-3	Classroom D-3	W2	CMU	Green	Chipping	1	0	Negative
1	2	D-3	Classroom D-3	W3	CMU	White	None	0	0	Negative
1	2	D-3	Classroom D-3	W4	CMU	White	None	0	0	Negative
1	2	D-3	Classroom D-3	Door Frame	Metal	Grey	None	0	0	Negative



			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	2	D-3	Classroom D-3	Ceiling	Concrete	White	None	0	0	Negative
1	2	D-3	Classroom D-3	Pipes	Metal	White	Chipping	4	0	Negative
1	2	D-3	Classroom D-3	Column	Concrete	White	None	0	0	Negative
1	2	D-3	Classroom D-3	Floor	Carpet	Unpainted	N/A	N/A	N/A	N/A
1	2	D-3-4	Restroom Vestibule between Classrooms D-3 and D-4	W1	CMU	White	None	0	0	Negative
1	2	D-3-4	Restroom Vestibule between Classrooms D-3 and D-4	W2	CMU	White	None	0	0	Negative
1	2	D-3-4	Restroom Vestibule between Classrooms D-3 and D-4	W3	CMU	White	Chipping	1	0	Negative
1	2	D-3-4	Restroom Vestibule between Classrooms D-3 and D-4	W4	CMU	White	None	0	0	Negative
1	2	D-3-4	Restroom Vestibule between Classrooms D-3 and D-4	Ceiling	Sheetrock	White	None	0	0	Negative
1	2	D-3-4	Restroom Vestibule between Classrooms D-3 and D-4	Floor	Carpet	Unpainted	N/A	N/A	N/A	N/A

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	2	D-3-4M	Boy's Restroom between Classrooms D-3 and D-4	W1	CMU	Grey	None	0	0	Negative
1	2	D-3-4M	Boy's Restroom between Classrooms D-3 and D-4	Door Frame	Metal	Grey	None	0	0	Negative
1	2	D-3-4M	Boy's Restroom between Classrooms D-3 and D-4	W2	CMU	Grey	None	0	0	Negative
1	2	D-3-4M	Boy's Restroom between Classrooms D-3 and D-4	W3	Ceramic Tiles	Unpainted	N/A	N/A	N/A	N/A
1	2	D-3-4M	Boy's Restroom between Classrooms D-3 and D-4	W4	CMU	Grey	None	0	0	Negative
1	2	D-3-4M	Boy's Restroom between Classrooms D-3 and D-4	Ceiling	Sheetrock	White	None	0	0	Negative
1	2	D-3-4M	Boy's Restroom between Classrooms D-3 and D-4	Floor	Ceramic Tiles	Unpainted	N/A	N/A	N/A	N/A
1	2	D-3-4W	Girl's Restroom between Classrooms D-3 and D-4	W1	CMU	Grey	None	0	0	Negative
1	2	D-3-4W	Girl's Restroom between Classrooms D-3 and D-4	Door Frame	Metal	Grey	None	0	0	Negative
1	2	D-3-4W	Girl's Restroom between Classrooms D-3 and D-4	W2	CMU	Grey	None	0	0	Negative

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	2	D-3-4W	Girl's Restroom between Classrooms D-3 and D-4	W3	Ceramic Tiles	Unpainted	N/A	N/A	n/a	N/A
1	2	D-3-4W	Girl's Restroom between Classrooms D-3 and D-4	W4	CMU	Grey	None	0	0	Negative
1	2	D-3-4W	Girl's Restroom between Classrooms D-3 and D-4	Ceiling	Sheetrock	White	None	0	0	Negative
1	2	D-3-4W	Girl's Restroom between Classrooms D-3 and D-4	Access Panel	Metal	White	Chipping	2	0	Negative
1	2	D-3-4W	Girl's Restroom between Classrooms D-3 and D-4	Floor	Ceramic Tiles	Unpainted	N/A	N/A	N/A	N/A
1	2	D-3CL	Classroom D-3 Closet	W1	CMU	White	None	0	0	Negative
1	2	D-3CL	Classroom D-3 Closet	Door Frame	Metal	Grey	None	0	0	Negative
1	2	D-3CL	Classroom D-3 Closet	W2	CMU	White	Cracking	2	0	Negative
1	2	D-3CL	Classroom D-3 Closet	W3	Sheetrock	White	None	0	0	Negative

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	2	D-3CL	Classroom D-3 Closet	W4	Sheetrock	White	Chipping	1	0	Negative
1	2	D-3CL	Classroom D-3 Closet	Ceiling	Sheetrock	White	None	0	0	Negative
1	2	D-3CL	Classroom D-3 Closet	Floor	Carpet	Unpainted	N/A	N/A	N/A	N/A
1	2	D-4	Classroom D-4	W1	CMU	White	Holes	1	0	Negative
1	2	D-4	Classroom D-4	Door Frame	Metal	Grey	None	0	0	Negative
1	2	D-4	Classroom D-4	W2	CMU	White	Cracking	2	0	Negative
1	2	D-4	Classroom D-4	Door Frame	Metal	Grey	None	0	0	Negative
1	2	D-4	Classroom D-4	W3	CMU	White	None	0	0	Negative
1	2	D-4	Classroom D-4	W4	CMU	Tan	None	0	0	Negative
1	2	D-4	Classroom D-4	Textured Ceiling Paint	Concrete	White	None	0	0	Negative
1	2	D-4	Classroom D-4	Exterior, Ductwork	Metal	White	Chipping	2	0	Negative

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	2	D-4	Classroom D-4	Pipes	Metal	White	Chipping	6	0	Negative
1	2	D-4	Classroom D-4	Column	Concrete	White	None	0	0	Negative
1	2	D-4	Classroom D-4	Floor	Carpet	Unpainted	N/A	N/A	N/A	N/A
1	2	D-4CL	Classroom D-4 Closet	W1	CMU	White	None	0	0	Negative
1	2	D-4CL	Classroom D-4 Closet	Door Frame	Metal	Grey	None	0	0	Negative
1	2	D-4CL	Classroom D-4 Closet	W2	Sheetrock	White	None	0	0	Negative
1	2	D-4CL	Classroom D-4 Closet	W3	Sheetrock	White	None	0	0	Negative
1	2	D-4CL	Classroom D-4 Closet	W4	CMU	White	None	0	0	Negative
1	2	D-4CL	Classroom D-4 Closet	Ceiling	Sheetrock	White	None	0	0	Negative
1	2	D-4CL	Classroom D-4 Closet	Floor	Carpet	Unpainted	N/A	N/A	N/A	N/A
1	2	D221	D Pod Lobby Server Closet D221 across from Classroom D-3	W1	CMU	White	None	0	0	Negative

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	2	D221	D Pod Lobby Server Closet D221 across from Classroom D-3	Door Frame	Metal	Grey	None	0	0	Negative
1	2	D221	D Pod Lobby Server Closet D221 across from Classroom D-3	W2	Sheetrock	White	Chipping	1	0	Negative
1	2	D221	D Pod Lobby Server Closet D221 across from Classroom D-3	W3	Sheetrock	White	None	0	0	Negative
1	2	D221	D Pod Lobby Server Closet D221 across from Classroom D-3	Cable Panel	Wood	Grey	None	0	0	Negative
1	2	D221	D Pod Lobby Server Closet D221 across from Classroom D-3	W4	Sheetrock	White	None	0	0	Negative
1	2	D221	D Pod Lobby Server Closet D221 across from Classroom D-3	Ceiling	Concrete	White	None	0	0	Negative
1	2	D221	D Pod Lobby Server Closet D221 across from Classroom D-3	Floor	Concrete	Unpainted	N/A	N/A	N/A	N/A
1	2	D222	D Pod Lobby Closet D222	W1	CMU	White	None	0	0	Negative
1	2	D222	D Pod Lobby Closet D222	Door Frame	Metal	Grey	None	0	0	Negative
1	2	D222	D Pod Lobby Closet D222	W2	CMU	White	Cracking	4	0	Negative
1	2	D222	D Pod Lobby Closet D222	W3	Sheetrock	White	None	0	0	Negative

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	2	D222	D Pod Lobby Closet D222	W4	CMU	White	None	0	0	Negative
1	2	D222	D Pod Lobby Closet D222	Ceiling	Concrete	White	None	0	0	Negative
1	2	D222	D Pod Lobby Closet D222	Pipes	Metal	White	Chipping	2	0	Negative
1	2	D222	D Pod Lobby Closet D222	Floor	12x12 VAT	Unpainted	N/A	N/A	N/A	N/A
1	2	DD083	Duct Access Shaft outside Classroom D-4	W1	No Access	No Access	No Access	No Access	No Access	No Access
1	2	DD083	Duct Access Shaft outside Classroom D-4	W2	No Access	No Access	No Access	No Access	No Access	No Access
1	2	DD083	Duct Access Shaft outside Classroom D-4	W3	No Access	No Access	No Access	No Access	No Access	No Access
1	2	DD083	Duct Access Shaft outside Classroom D-4	W4	No Access	No Access	No Access	No Access	No Access	No Access
1	2	DD083	Duct Access Shaft outside Classroom D-4	Ceiling	No Access	No Access	No Access	No Access	No Access	No Access
1	2	DD083	Duct Access Shaft outside Classroom D-4	Floor	No Access	No Access	No Access	No Access	No Access	No Access

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	2	DPOD	D Pod Lobby	W1	CMU	White	None	0	0	Negative
1	2	DPOD	D Pod Lobby	Door Frame	Metal	Grey	Chipping	4	0	Negative
1	2	DPOD	D Pod Lobby	Door	Metal	Grey	Friction	2	0	Negative
1	2	DPOD	D Pod Lobby	W2	CMU	White	None	0	0	Negative
1	2	DPOD	D Pod Lobby	W3	CMU	White	None	0	0	Negative
1	2	DPOD	D Pod Lobby	W3	Sheetrock	White	None	0	0	Negative
1	2	DPOD	D Pod Lobby	W4	CMU	White	None	0	0	Negative
1	2	DPOD	D Pod Lobby	Ceiling	Concrete	White	None	0	0	Negative
1	2	DPOD	D Pod Lobby	Pipes	Metal	White	Chipping	4	0	Negative
1	2	DPOD	D Pod Lobby	Floor	12x12 VAT	Unpainted	N/A	N/A	N/A	N/A
1	2	E-1-1	Classroom E-1	W1	CMU	White	None	0	0	Negative
1	2	E-1-1	Classroom E-1	Door Frame	Metal	Grey	Chipping	2	0	Negative



			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	2	E-1-1	Classroom E-1	W2	CMU	White	None	0	0	Negative
1	2	E-1-1	Classroom E-1	Door Frame	Metal	Grey	Chipping	1	0	Negative
1	2	E-1-1	Classroom E-1	W3	CMU	White	Cracking	6	0	Negative
1	2	E-1-1	Classroom E-1	W4	CMU	Purple	Holes	1	0	Negative
1	2	E-1-1	Classroom E-1	Textured Ceiling Paint	Concrete	White	None	0	0	Negative
1	2	E-1-1	Classroom E-1	Exterior, Ductwork	Metal	White	Chipping	1	0	Negative
1	2	E-1-1	Classroom E-1	Pipes	Metal	White	Chipping	4	0	Negative
1	2	E-1-1	Classroom E-1	Column	Concrete	Brown	Flaking	20	0	Negative
1	2	E-1-1	Classroom E-1	Floor	Carpet	Unpainted	N/A	N/A	N/A	N/A
1	2	E-1-2	Restroom Vestibule between Classrooms E-1 and E-2	W1	CMU	White	None	0	0	Negative
1	2	E-1-2	Restroom Vestibule between Classrooms E-1 and E-2	W2	CMU	White	None	0	0	Negative

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	2	E-1-2	Restroom Vestibule between Classrooms E-1 and E-2	W3	CMU	White	None	0	0	Negative
1	2	E-1-2	Restroom Vestibule between Classrooms E-1 and E-2	W4	CMU	White	Cracking	1	0	Negative
1	2	E-1-2	Restroom Vestibule between Classrooms E-1 and E-2	Ceiling	Sheetrock	White	None	0	0	Negative
1	2	E-1-2	Restroom Vestibule between Classrooms E-1 and E-2	Floor	Carpet	Unpainted	N/A	N/A	N/A	N/A
1	2	E-1-2M	Boy's Restroom between Classrooms E-1 and E-2	W1	CMU	Grey	None	0	0	Negative
1	2	E-1-2M	Boy's Restroom between Classrooms E-1 and E-2	Door Frame	Metal	Grey	None	0	0.02	Negative
1	2	E-1-2M	Boy's Restroom between Classrooms E-1 and E-2	W2	CMU	Grey	None	0	0	Negative
1	2	E-1-2M	Boy's Restroom between Classrooms E-1 and E-2	W3	Ceramic Tiles	Unpainted	N/A	N/A	N/A	N/A
1	2	E-1-2M	Boy's Restroom between Classrooms E-1 and E-2	W4	CMU	Grey	None	0	0	Negative
1	2	E-1-2M	Boy's Restroom between Classrooms E-1 and E-2	Ceiling	Sheetrock	White	None	0	0	Negative
1	2	E-1-2M	Boy's Restroom between Classrooms E-1 and E-2	Floor	Ceramic Tiles	Unpainted	N/A	N/A	N/A	N/A

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	2	E-1-2W	Girl's Restroom between Classrooms E-1 and E-2	W1	CMU	Grey	None	0	0	Negative
1	2	E-1-2W	Girl's Restroom between Classrooms E-1 and E-2	Door Frame	Metal	Grey	None	0	0	Negative
1	2	E-1-2W	Girl's Restroom between Classrooms E-1 and E-2	W2	CMU	Grey	Chipping	2	0	Negative
1	2	E-1-2W	Girl's Restroom between Classrooms E-1 and E-2	W3	Ceramic Tiles	Unpainted	N/A	N/A	N/A	N/A
1	2	E-1-2W	Girl's Restroom between Classrooms E-1 and E-2	W4	CMU	Grey	None	0	0	Negative
1	2	E-1-2W	Girl's Restroom between Classrooms E-1 and E-2	Ceiling	Sheetrock	White	None	0	0	Negative
1	2	E-1-2W	Girl's Restroom between Classrooms E-1 and E-2	Floor	Ceramic Tiles	Unpainted	N/A	N/A	N/A	N/A
1	2	E-2	Classroom E-2	W1	CMU	White	None	0	0	Negative
1	2	E-2	Classroom E-2	Door Frame	Metal	Grey	Chipping	3	0.04	Negative

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	2	E-2	Classroom E-2	W2	CMU	Blue	Holes	1	0	Negative
1	2	E-2	Classroom E-2	W3	CMU	White	None	0	0	Negative
1	2	E-2	Classroom E-2	W4	CMU	White	Cracking	6	0	Negative
1	2	E-2	Classroom E-2	Door Frame	Metal	Grey	None	0	0	Negative
1	2	E-2	Classroom E-2	Textured Ceiling Paint	Concrete	White	None	0	0	Negative
1	2	E-2	Classroom E-2	Exterior, Ductwork	Metal	White	None	0	0	Negative
1	2	E-2	Classroom E-2	Pipes	Metal	White	Chipping	4	0	Negative
1	2	E-2	Classroom E-2	Column	Concrete	White	None	0	0	Negative
1	2	E-2	Classroom E-2	Floor	Carpet	Unpainted	N/A	N/A	N/A	N/A
1	2	E-3	Classroom E-3	W1	CMU	White	None	0	0	Negative

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	2	E-3	Classroom E-3	Door Frame	Metal	Grey	Chipping	2	0	Negative
1	2	E-3	Classroom E-3	W2	CMU	White	None	0	0	Negative
1	2	E-3	Classroom E-3	W3	CMU	White	None	0	0	Negative
1	2	E-3	Classroom E-3	W4	CMU	Green	Holes	1	0	Negative
1	2	E-3	Classroom E-3	Door Frame	Metal	Green	None	0	0	Negative
1	2	E-3	Classroom E-3	Textured Ceiling Paint	Concrete	White	None	0	0	Negative
1	2	E-3	Classroom E-3	Exterior, Ductwork	Metal	White	None	0	0	Negative
1	2	E-3	Classroom E-3	Pipes	Metal	White	Chipping	5	0	Negative
1	2	E-3	Classroom E-3	Column	Concrete	White	Chipping	2	0	Negative
1	2	E-3	Classroom E-3	Floor	Carpet	Unpainted	N/A	N/A	N/A	N/A

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	2	E-3-4	Restroom Vestibule between Classrooms E-3 and E-4	W1	CMU	White	None	0	0	Negative
1	2	E-3-4	Restroom Vestibule between Classrooms E-3 and E-4	W2	CMU	White	None	0	0	Negative
1	2	E-3-4	Restroom Vestibule between Classrooms E-3 and E-4	W3	CMU	White	None	0	0	Negative
1	2	E-3-4	Restroom Vestibule between Classrooms E-3 and E-4	W4	CMU	White	Cracking	2	0	Negative
1	2	E-3-4	Restroom Vestibule between Classrooms E-3 and E-4	Ceiling	Sheetrock	White	None	0	0	Negative
1	2	E-3-4	Restroom Vestibule between Classrooms E-3 and E-4	Floor	Carpet	Unpainted	N/A	N/A	N/A	N/A
1	2	E-3-4M	Boy's Restroom between Classrooms E-3 and E-4	W1	CMU	Grey	None	0	0	Negative
1	2	E-3-4M	Boy's Restroom between Classrooms E-3 and E-4	Door Frame	Metal	Grey	None	0	0	Negative
1	2	E-3-4M	Boy's Restroom between Classrooms E-3 and E-4	W2	CMU	Grey	None	0	0	Negative
1	2	E-3-4M	Boy's Restroom between Classrooms E-3 and E-4	W3	Ceramic Tiles	Unpainted	N/A	N/A	N/A	N/A
1	2	E-3-4M	Boy's Restroom between Classrooms E-3 and E-4	W4	CMU	Grey	None	0	0	Negative

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	2	E-3-4M	Boy's Restroom between Classrooms E-3 and E-4	Ceiling	Sheetrock	White	None	0	0	Negative
1	2	E-3-4M	Boy's Restroom between Classrooms E-3 and E-4	Floor	Ceramic Tiles	Unpainted	N/A	N/A	N/A	N/A
1	2	E-3-4W	Girl's Restroom between Classrooms E-3 and E-4	W1	CMU	Grey	None	0	0	Negative
1	2	E-3-4W	Girl's Restroom between Classrooms E-3 and E-4	Door Frame	Metal	Grey	None	0	0	Negative
1	2	E-3-4W	Girl's Restroom between Classrooms E-3 and E-4	W2	CMU	Grey	None	0	0	Negative
1	2	E-3-4W	Girl's Restroom between Classrooms E-3 and E-4	W3	Ceramic Tiles	Unpainted	N/A	N/A	N/A	N/A
1	2	E-3-4W	Girl's Restroom between Classrooms E-3 and E-4	W4	CMU	Grey	None	0	0	Negative
1	2	E-3-4W	Girl's Restroom between Classrooms E-3 and E-4	Ceiling	Sheetrock	White	None	0	0	Negative
1	2	E-3-4W	Girl's Restroom between Classrooms E-3 and E-4	Floor	Ceramic Tiles	Unpainted	N/A	N/A	N/A	N/A

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	2	E-3CL	Classroom E-3 Closet	W1	CMU	White	None	0	0	Negative
1	2	E-3CL	Classroom E-3 Closet	Door Frame	Metal	Grey	None	0	0	Negative
1	2	E-3CL	Classroom E-3 Closet	W2	CMU	White	Chipping	1	0	Negative
1	2	E-3CL	Classroom E-3 Closet	Ductwork	Metal	White	None	0	0	Negative
1	2	E-3CL	Classroom E-3 Closet	W3	CMU	White	Hole	1	0	Negative
1	2	E-3CL	Classroom E-3 Closet	W4	CMU	White	None	0	0	Negative
1	2	E-3CL	Classroom E-3 Closet	Ceiling	Sheetrock	White	None	0	0	Negative
1	2	E-3CL	Classroom E-3 Closet	Floor	Carpet	Unpainted	N/A	N/A	N/A	N/A
1	2	E-4	Classroom E-4	W1	CMU	White	None	0	0	Negative
1	2	E-4	Classroom E-4	Door Frame	Metal	Grey	None	0	0	Negative
1	2	E-4	Classroom E-4	W2	CMU	Tan	Holes	1	0	Negative



			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	2	E-4	Classroom E-4	W3	CMU	White	Chipping	1	0	Negative
1	2	E-4	Classroom E-4	W4	CMU	White	Chipping	1	0	Negative
1	2	E-4	Classroom E-4	Door Frame	Metal	Grey	None	0	0	Negative
1	2	E-4	Classroom E-4	Textured Ceiling Paint	CONcrete	White	None	0	0	Negative
1	2	E-4	Classroom E-4	Pipes	Metal	White	Chipping	4	0	Negative
1	2	E-4	Classroom E-4	Column	Concrete	White	Chipping	1	0	Negative
1	2	E-4	Classroom E-4	Floor	Carpet	Unpainted	N/A	N/A	N/A	N/A
1	2	E100	E Pod Lobby Closet next to Classroom E3	W1	CMU	White	None	0	0	Negative
1	2	E100	E Pod Lobby Closet next to Classroom E3	Door Frame	Metal	Grey	None	0	0	Negative
1	2	E100	E Pod Lobby Closet next to Classroom E3	W2	CMU	White	None	0	0	Negative
1	2	E100	E Pod Lobby Closet next to Classroom E3	W3	Sheetrock	White	None	0	0	Negative

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	2	E100	E Pod Lobby Closet next to Classroom E3	W4	CMU	White	None	0	0	Negative
1	2	E100	E Pod Lobby Closet next to Classroom E3	Pipes	Metal	White	None	0	0	Negative
1	2	E100	E Pod Lobby Closet next to Classroom E3	Ceiling	Concrete	White	None	0	0	Negative
1	2	E100	E Pod Lobby Closet next to Classroom E3	Floor	12x12 VAT	Unpainted	N/A	N/A	N/A	N/A
1	2	E222	E Pod Lobby Closet E222	W1	CMU	White	Holes	1	0	Negative
1	2	E222	E Pod Lobby Closet E222	Door Frame	Metal	Grey	None	0	0	Negative
1	2	E222	E Pod Lobby Closet E222	W2	CMU	White	None	0	0	Negative
1	2	E222	E Pod Lobby Closet E222	W3	Sheetrock	White	Chipping	4	0	Negative
1	2	E222	E Pod Lobby Closet E222	W4	CMU	White	None	0	0	Negative

			Lead-Safe Certification Assessment Report							
			Philadelphia Learning Academy West/Crossroads Accelerated Academy MS							
			4300 Westminster Ave, Philadelphia PA 19104							
			Dates: 10/9/2023 thru 10/19/2023							
			Inspector Name: Paul Davis and Certificate Number: 060094							
			Inspection Company: VERTEX, LLC							
Element	Floor	Space #	On-Site Room Name	Component	Substrate Material	Paint Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
1	2	E222	E Pod Lobby Closet E222	Ceiling	Concrete	White	None	0	0	Negative
1	2	E222	E Pod Lobby Closet E222	Pipes	Metal	White	None	0	0	Negative
1	2	E222	E Pod Lobby Closet E222	Floor	12x12 VAT	Unpainted	N/A	N/A	N/A	N/A
1	2	EPOD	E Pod Lobby	W1	CMU	White	None	0	0	Negative
1	2	EPOD	E Pod Lobby	Door	Metal	Grey	Chipping	2	0	Negative
1	2	EPOD	E Pod Lobby	Door Frame	Metal	Grey	Chipping	2	0	Negative
1	2	EPOD	E Pod Lobby	W2	CMU	White	None	0	0	Negative
1	2	EPOD	E Pod Lobby	W3	CMU	White	Chipping	1	0	Negative
1	2	EPOD	E Pod Lobby	W3	Sheetrock	White	Flaking	1	0	Negative
1	2	EPOD	E Pod Lobby	W4	CMU	White	None	0	0	Negative
1	2	EPOD	E Pod Lobby	Textured Ceiling Paint	Concrete	White	None	0	0	Negative
1	2	EPOD	E Pod Lobby	Pipes	Metal	White	None	0	0	Negative

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	2	EPOD	E Pod Lobby	Column	Concrete	Blue	None	0	0	Negative
1	2	EPOD	E Pod Lobby	Floor	12x12 VAT	Unpainted	N/A	N/A	N/A	N/A
1	2	G-1	Classroom G-1	W1	CMU	White	Cracking	3	0	Negative
1	2	G-1	Classroom G-1	Door Frame	Metal	Grey	None	0	0	Negative
1	2	G-1	Classroom G-1	W2	CMU	White	Holes	1	0	Negative
1	2	G-1	Classroom G-1	W3	CMU	Purple	Chipping	6	0	Negative
1	2	G-1	Classroom G-1	W4	CMU	White	None	0	0	Negative
1	2	G-1	Classroom G-1	Ceiling	Concrete	White	None	0	0	Negative
1	2	G-1	Classroom G-1	Pipes	Metal	White	Chipping	4	0	Negative
1	2	G-1	Classroom G-1	Column	Concrete	White	Chipping	1	0	Negative
1	2	G-1	Classroom G-1	Floor	Carpet	Unpainted	N/A	N/A	N/A	N/A

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	2	G-1-2	Restroom Vestibule between Classrooms G-1 and G-2	W1	CMU	White	None	0	0	Negative
1	2	G-1-2	Restroom Vestibule between Classrooms G-1 and G-2	W2	CMU	White	None	0	0	Negative
1	2	G-1-2	Restroom Vestibule between Classrooms G-1 and G-2	W3	CMU	White	None	0	0	Negative
1	2	G-1-2	Restroom Vestibule between Classrooms G-1 and G-2	W4	CMU	White	None	0	0	Negative
1	2	G-1-2	Restroom Vestibule between Classrooms G-1 and G-2	Ceiling	Sheetrock	White	None	0	0	Negative
1	2	G-1-2	Restroom Vestibule between Classrooms G-1 and G-2	Floor	Carpet	Unpainted	N/A	N/A	N/A	N/A
1	2	G-1-2M	Boy's Restroom between Classrooms G-1 and G-2	W1	CMU	Grey	None	0	0	Negative
1	2	G-1-2M	Boy's Restroom between Classrooms G-1 and G-2	Door Frame	Metal	Grey	None	0	0	Negative
1	2	G-1-2M	Boy's Restroom between Classrooms G-1 and G-2	W2	CMU	Grey	None	0	0	Negative
1	2	G-1-2M	Boy's Restroom between Classrooms G-1 and G-2	W3	Ceramic Tiles	Unpainted	N/A	N/A	N/A	N/A
1	2	G-1-2M	Boy's Restroom between Classrooms G-1 and G-2	W4	CMU	Grey	None	0	0	Negative

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	2	G-1-2M	Boy's Restroom between Classrooms G-1 and G-2	Ceiling	Sheetrock	White	None	0	0	Negative
1	2	G-1-2M	Boy's Restroom between Classrooms G-1 and G-2	Floor	Ceramic Tiles	Unpainted	N/A	N/A	N/A	N/A
1	2	G-1-2W	Girl's Restroom between Classrooms G-1 and G-2	W1	CMU	Grey	None	0	0	Negative
1	2	G-1-2W	Girl's Restroom between Classrooms G-1 and G-2	Door Frame	Metal	Grey	Chipping	1	0	Negative
1	2	G-1-2W	Girl's Restroom between Classrooms G-1 and G-2	W2	CMU	Grey	None	0	0	Negative
1	2	G-1-2W	Girl's Restroom between Classrooms G-1 and G-2	W3	Ceramic Tiles	Unpainted	N/A	N/A	N/A	N/A
1	2	G-1-2W	Girl's Restroom between Classrooms G-1 and G-2	W4	CMU	Grey	None	0	0	Negative
1	2	G-1-2W	Girl's Restroom between Classrooms G-1 and G-2	Ceiling	Sheetrock	White	None	0	0	Negative
1	2	G-1-2W	Girl's Restroom between Classrooms G-1 and G-2	Floor	Ceramic Tiles	Unpainted	N/A	N/A	N/A	N/A

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	2	G-1CL	Classroom G-1 Closet	W1	Sheetrock	White	Chipping	1	0	Negative
1	2	G-1CL	Classroom G-1 Closet	Door Frame	Metal	Grey	None	0	0	Negative
1	2	G-1CL	Classroom G-1 Closet	W2	Sheetrock	White	Chipping	1	0	Negative
1	2	G-1CL	Classroom G-1 Closet	W3	Sheetrock	White	Chipping	2	0	Negative
1	2	G-1CL	Classroom G-1 Closet	W4	CMU	White	None	0	0	Negative
1	2	G-1CL	Classroom G-1 Closet	Ceiling	Sheetrock	White	None	0	0	Negative
1	2	G-1CL	Classroom G-1 Closet	Floor	Carpet	Unpainted	N/A	N/A	N/A	N/A
1	2	G-2	Classroom G-2	W1	CMU	White	Cracking	2	0	Negative
1	2	G-2	Classroom G-2	W1	Sheetrock	White	None	0	0	Negative
1	2	G-2	Classroom G-2	Door Frame	Metal	Grey	Chipping	6	0	Negative
1	2	G-2	Classroom G-2	W2	CMU	White	Chipping	1	0	Negative
1	2	G-2	Classroom G-2	W3	CMU	White	None	0	0	Negative

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	2	G-2	Classroom G-2	W4	CMU	Blue	Chipping	4	0	Negative
1	2	G-2	Classroom G-2	Door Frame	Metal	Grey	None	0	0	Negative
1	2	G-2	Classroom G-2	Textured Ceiling Paint	Concrete	White	None	0	0	Negative
1	2	G-2	Classroom G-2	Exterior, Ductwork	Metal	White	None	0	0	Negative
1	2	G-2	Classroom G-2	Pipes	Metal	White	Chipping	4	0	Negative
1	2	G-2	Classroom G-2	Column	Concrete	White	None	0	0	Negative
1	2	G-2	Classroom G-2	Floor	Carpet	Unpainted	N/A	N/A	N/A	N/A
1	2	G-2CL	Classroom G-2 Closet	W1	CMU	White	None	0	0	Negative
1	2	G-2CL	Classroom G-2 Closet	Door Frame	Metal	Grey	None	0	0	Negative
1	2	G-2CL	Classroom G-2 Closet	W2	Sheetrock	White	None	0	0	Negative
1	2	G-2CL	Classroom G-2 Closet	Ductwork	Metal	White	None	0	0	Negative
1	2	G-2CL	Classroom G-2 Closet	W3	Sheetrock	White	Chipping	1	0	Negative



			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	2	G-2CL	Classroom G-2 Closet	W4	CMU	White	None	0	0	Negative
1	2	G-2CL	Classroom G-2 Closet	Ceiling	Sheetrock	White	None	0	0	Negative
1	2	G-2CL	Classroom G-2 Closet	Floor	Carpet	Unpainted	N/A	N/A	N/A	N/A
1	2	G-3	Classroom G-3	W1	CMU	White	None	0	0	Negative
1	2	G-3	Classroom G-3	Door Frame	Metal	Grey	Chipping	4	0	Negative
1	2	G-3	Classroom G-3	W2	CMU	Green	Holes	2	0	Negative
1	2	G-3	Classroom G-3	W3	CMU	White	None	0	0	Negative
1	2	G-3	Classroom G-3	W4	CMU	White	Cracking	2	0	Negative
1	2	G-3	Classroom G-3	Door Frame	Metal	Grey	None	0	0	Negative
1	2	G-3	Classroom G-3	Textured Ceiling Paint	Concrete	White	None	0	0	Negative
1	2	G-3	Classroom G-3	Exterior, Ductwork	Metal	White	None	0	0	Negative

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	2	G-3	Classroom G-3	Pipes	Metal	White	Chipping	4	0.02	Negative
1	2	G-3	Classroom G-3	Column	Concrete	White	None	0	0	Negative
1	2	G-3	Classroom G-3	Floor	Carpet	Unpainted	N/A	N/A	N/A	N/A
1	2	G-3-4	Restroom Vestibule between Classrooms G-3 and G-4	W1	CMU	White	None	0	0	Negative
1	2	G-3-4	Restroom Vestibule between Classrooms G-3 and G-4	W2	CMU	White	None	0	0	Negative
1	2	G-3-4	Restroom Vestibule between Classrooms G-3 and G-4	W3	CMU	White	Chipping	1	0	Negative
1	2	G-3-4	Restroom Vestibule between Classrooms G-3 and G-4	W4	CMU	White	None	0	0	Negative
1	2	G-3-4	Restroom Vestibule between Classrooms G-3 and G-4	Ceiling	Sheetrock	White	None	0	0	Negative
1	2	G-3-4	Restroom Vestibule between Classrooms G-3 and G-4	Floor	Carpet	Unpainted	N/A	N/A	N/A	N/A
1	2	G-3-4M	Boy's Restroom between Classrooms G-3 and G-4	W1	CMU	Grey	None	0	0	Negative
1	2	G-3-4M	Boy's Restroom between Classrooms G-3 and G-4	Door Frame	Metal	Grey	None	0	0	Negative

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	2	G-3-4M	Boy's Restroom between Classrooms G-3 and G-4	W2	CMU	Grey	None	0	0	Negative
1	2	G-3-4M	Boy's Restroom between Classrooms G-3 and G-4	W3	Ceramic Tiles	Unpainted	N/A	N/A	N/A	N/A
1	2	G-3-4M	Boy's Restroom between Classrooms G-3 and G-4	W4	CMU	Grey	None	0	0	Negative
1	2	G-3-4M	Boy's Restroom between Classrooms G-3 and G-4	Ceiling	Sheetrock	White	Cracking	2	0	Negative
1	2	G-3-4M	Boy's Restroom between Classrooms G-3 and G-4	Floor	Ceramic Tiles	Unpainted	N/A	N/A	N/A	N/A
1	2	G-3-4W	Girl's Restroom between Classrooms G-3 and G-4	W1	CMU	Grey	None	0	0	Negative
1	2	G-3-4W	Girl's Restroom between Classrooms G-3 and G-4	Door Frame	Metal	Grey	None	0	0	Negative
1	2	G-3-4W	Girl's Restroom between Classrooms G-3 and G-4	W2	CMU	Grey	None	0	0	Negative
1	2	G-3-4W	Girl's Restroom between Classrooms G-3 and G-4	W3	Ceramic Tiles	Unpainted	N/A	N/A	N/A	N/A
1	2	G-3-4W	Girl's Restroom between Classrooms G-3 and G-4	W4	CMU	Grey	None	0	0	Negative

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	2	G-3-4W	Girl's Restroom between Classrooms G-3 and G-4	Ceiling	Sheetrock	White	None	0	0	Negative
1	2	G-3-4W	Girl's Restroom between Classrooms G-3 and G-4	Floor	Ceramic Tiles	Unpainted	N/A	N/A	N/A	N/A
1	2	G-4	Classroom G-4	W1	CMU	White	None	0	0	Negative
1	2	G-4	Classroom G-4	Door Frame	Metal	Grey	Chipping	1	0	Negative
1	2	G-4	Classroom G-4	W2	CMU	White	Cracking	6	0	Negative
1	2	G-4	Classroom G-4	Door Frame	Metal	Grey	Chipping	2	0	Negative
1	2	G-4	Classroom G-4	W3	CMU	White	Cracking	4	0	Negative
1	2	G-4	Classroom G-4	W4	CMU	Tan	Chipping	6	0	Negative
1	2	G-4	Classroom G-4	Textured Ceiling Paint	Concrete	White	None	0	0	Negative
1	2	G-4	Classroom G-4	Pipes	Metal	White	Chipping	4	0	Negative
1	2	G-4	Classroom G-4	Column	Concrete	White	Chipping	2	0	Negative

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	2	G-4	Classroom G-4	Floor	Carpet	Unpainted	N/A	N/A	N/A	N/A
1	2	G-4CL	Classroom G-4 Closet	W1	CMU	White	None	0	0	Negative
1	2	G-4CL	Classroom G-4 Closet	Door Frame	Metal	Grey	None	0	0	Negative
1	2	G-4CL	Classroom G-4 Closet	W2	CMU	White	None	0	0	Negative
1	2	G-4CL	Classroom G-4 Closet	Ductwork	Metal	White	None	0	0	Negative
1	2	G-4CL	Classroom G-4 Closet	W3	CMU	White	None	0	0	Negative
1	2	G-4CL	Classroom G-4 Closet	W4	CMU	White	None	0	0	Negative
1	2	G-4CL	Classroom G-4 Closet	Ceiling	Sheetrock	White	None	0	0	Negative
1	2	G-4CL	Classroom G-4 Closet	Floor	Carpet	Unpainted	N/A	N/A	N/A	N/A
1	2	GCL1	G Pod Lobby School Store	W1	CMU	White	None	0	0	Negative
1	2	GCL1	G Pod Lobby School Store	Door Frame	Metal	Grey	None	0	0	Negative
1	2	GCL1	G Pod Lobby School Store	W2	CMU	White	None	0	0	Negative

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	2	GCL1	G Pod Lobby School Store	W3	Sheetrock	White	None	0	0	Negative
1	2	GCL1	G Pod Lobby School Store	W4	CMU	White	None	0	0	Negative
1	2	GCL1	G Pod Lobby School Store	Ceiling	Sheetrock	White	None	0	0	Negative
1	2	GCL1	G Pod Lobby School Store	Floor	12x12 VAT	Unpainted	N/A	N/A	N/A	N/A
1	2	GCL2	G Pod Lobby Closet across from Classroom G-3	W1	CMU	White	None	0	0	Negative
1	2	GCL2	G Pod Lobby Closet across from Classroom G-3	Door Frame	Metal	Grey	None	0	0	Negative
1	2	GCL2	G Pod Lobby Closet across from Classroom G-3	W2	Sheetrock	White	None	0	0	Negative
1	2	GCL2	G Pod Lobby Closet across from Classroom G-3	W3	Sheetrock	White	None	0	0	Negative
1	2	GCL2	G Pod Lobby Closet across from Classroom G-3	Pipes	Metal	White	Chipping	1	0	Negative
1	2	GCL2	G Pod Lobby Closet across from Classroom G-3	W4	Sheetrock	White	None	0	0	Negative
1	2	GCL2	G Pod Lobby Closet across from Classroom G-3	Ceiling	Sheetrock	White	None	0	0	Negative

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	2	GCL2	G Pod Lobby Closet across from Classroom G-3	Floor	12x12 VAT	Unpainted	N/A	N/A	N/A	N/A
1	2	GPOD	G Pod Lobby	W1	CMU	White	Cracking	2	0	Negative
1	2	GPOD	G Pod Lobby	Door	Metal	Grey	Chipping	2	0	Negative
1	2	GPOD	G Pod Lobby	Door Frame	Metal	Grey	Chipping	6	0	Negative
1	2	GPOD	G Pod Lobby	W2	CMU	White	None	0	0	Negative
1	2	GPOD	G Pod Lobby	W3	CMU	White	Holes	1	0	Negative
1	2	GPOD	G Pod Lobby	W3	Sheetrock	White	Flaking	2	0	Negative
1	2	GPOD	G Pod Lobby	W4	CMU	White	None	0	0	Negative
1	2	GPOD	G Pod Lobby	Textured Ceiling Paint	Concrete	White	None	0	0	Negative
1	2	GPOD	G Pod Lobby	Column	Concrete	Blue	Friction	5	0	Negative
1	2	GPOD	G Pod Lobby	Floor	12x12 VAT	Unpainted	N/A	N/A	N/A	N/A
1	2	H21	Main Hallway	W1	CMU	White	None	0	0	Negative

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	2	H21	Main Hallway	Door Frame	Metal	Grey	Friction	2	0	Negative
1	2	H21	Main Hallway	W2	CMU	White	None	0	0	Negative
1	2	H21	Main Hallway	W4	CMU	White	None	0	0	Negative
1	2	H21	Main Hallway	W4	Sheetrock	Blue	None	0	0	Negative
1	2	H21	Main Hallway	Ceiling	2x2 CT	Unpainted	N/A	N/A	N/A	N/A
1	2	H21	Main Hallway	Ceiling	Concrete	White	Flaking	10	0.01	Negative
1	2	H21	Main Hallway	Floor	Carpet	Unpainted	N/A	N/A	N/A	N/A
1	2	H22	Hallway outside of Rooms 266 and 267	W1	CMU	White	None	0	0	Negative
1	2	H22	Hallway outside of Rooms 266 and 267	Door Frame	Metal	Grey	None	0	0	Negative
1	2	H22	Hallway outside of Rooms 266 and 267	W2	CMU	White	None	0	0	Negative



			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	2	H22	Hallway outside of Rooms 266 and 267	W3	CMU	White	None	0	0	Negative
1	2	H22	Hallway outside of Rooms 266 and 267	W4	CMU	White	None	0	0	Negative
1	2	H22	Hallway outside of Rooms 266 and 267	Ceiling	2x2 CT	Unpainted	N/A	N/A	N/A	N/A
1	2	H22	Hallway outside of Rooms 266 and 267	Ceiling	Concrete	Unpainted	N/A	N/A	N/A	N/A
1	2	H22	Hallway outside of Rooms 266 and 267	Floor	Carpet	Unpainted	N/A	N/A	N/A	N/A
1	2	H23	Office Suite Hallway	W1	Sheetrock	White	Holes	1	0	Negative
1	2	H23	Office Suite Hallway	W1	CMU	White	None	0	0	Negative
1	2	H23	Office Suite Hallway	W2	Sheetrock	White	None	0	0	Negative
1	2	H23	Office Suite Hallway	W3	Sheetrock	Tan	None	0	0	Negative
1	2	H23	Office Suite Hallway	W4	Sheetrock	White	None	0	0	Negative
1	2	H23	Office Suite Hallway	Ceiling	2x2 CT	Unpainted	N/A	N/A	N/A	N/A

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	2	H23	Office Suite Hallway	Ceiling	Concrete	White	Chipping	20	0	Negative
1	2	H23	Office Suite Hallway	Floor	Carpet	Unpainted	N/A	N/A	N/A	N/A
1	2	M2	Men's Restroom next to Passenger Elevator	W1	Ceramic Tiles	Unpainted	N/A	N/A	N/A	N/A
1	2	M2	Men's Restroom next to Passenger Elevator	Door Frame	Metal	Grey	None	0	0	Negative
1	2	M2	Men's Restroom next to Passenger Elevator	W2	Ceramic Tiles	Unpainted	N/A	N/A	N/A	N/A
1	2	M2	Men's Restroom next to Passenger Elevator	W3	Ceramic Tiles	Unpainted	N/A	N/A	N/A	N/A
1	2	M2	Men's Restroom next to Passenger Elevator	W4	Ceramic Tiles	Unpainted	N/A	N/A	N/A	N/A
1	2	M2	Men's Restroom next to Passenger Elevator	Ceiling	Sheetrock	White	None	0	0	Negative
1	2	M2	Men's Restroom next to Passenger Elevator	Floor	Ceramic Tiles	Unpainted	N/A	N/A	N/A	N/A
1	2	S12	Stairwell 1 next to Front Entrance Lobby/Reception Area	W1	CMU	White	None	0	0	Negative

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	2	S12	Stairwell 1 next to Front Entrance Lobby/Reception Area	Door	Metal	Grey	None	0	0	Negative
1	2	S12	Stairwell 1 next to Front Entrance Lobby/Reception Area	Door Frame	Metal	Grey	None	0	0	Negative
1	2	S12	Stairwell 1 next to Front Entrance Lobby/Reception Area	W2	CMU	White	None	0	0	Negative
1	2	S12	Stairwell 1 next to Front Entrance Lobby/Reception Area	W3	CMU	White	None	0	0	Negative
1	2	S12	Stairwell 1 next to Front Entrance Lobby/Reception Area	W4	CMU	White	None	0	0	Negative
1	2	S12	Stairwell 1 next to Front Entrance Lobby/Reception Area	Ceiling	Concrete	White	None	0	0.01	Negative
1	2	S12	Stairwell 1 next to Front Entrance Lobby/Reception Area	Floor	Carpet	Unpainted	N/A	N/A	N/A	N/A
1	2	S12	Stairwell 1 next to Front Entrance Lobby/Reception Area	Handrail	Metal	Grey	Friction	6	0	Negative
1	2	S12	Stairwell 1 next to Front Entrance Lobby/Reception Area	Pipes	Metal	White	None	0	0	Negative

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	2	S12	Stairwell 1 next to Front Entrance Lobby/Reception Area	Stringer	Metal	White	None	0	0	Negative
1	2	S12V	Vestibule by Stairwell 1 next to Front Entrance Lobby/Reception Area	W1	Sheetrock	White	None	0	0	Negative
1	2	S12V	Vestibule by Stairwell 1 next to Front Entrance Lobby/Reception Area	W2	Sheetrock	White	None	0	0	Negative
1	2	S12V	Vestibule by Stairwell 1 next to Front Entrance Lobby/Reception Area	W3	Sheetrock	White	None	0	0	Negative
1	2	S12V	Vestibule by Stairwell 1 next to Front Entrance Lobby/Reception Area	W4	Sheetrock	White	None	0	0	Negative
1	2	S12V	Vestibule by Stairwell 1 next to Front Entrance Lobby/Reception Area	Ceiling	Sheetrock	White	None	0	0	Negative
1	2	S12V	Vestibule by Stairwell 1 next to Front Entrance Lobby/Reception Area	Floor	Carpet	Unpainted	N/A	N/A	N/A	N/A
1	2	S22	Stairwell 2 next to Kitchen	W1	CMU	White	None	0	0	Negative
1	2	S22	Stairwell 2 next to Kitchen	Door	Metal	Grey	None	0	0	Negative
1	2	S22	Stairwell 2 next to Kitchen	Door Frame	Metal	Grey	None	0	0	Negative
1	2	S22	Stairwell 2 next to Kitchen	W2	CMU	White	None	0	0	Negative

			Lead-Safe Certification Assessment Report							
			Philadelphia Learning Academy West/Crossroads Accelerated Academy MS							
			4300 Westminster Ave, Philadelphia PA 19104							
			Dates: 10/9/2023 thru 10/19/2023							
			Inspector Name: Paul Davis and Certificate Number: 060094							
			Inspection Company: VERTEX, LLC							
Element	Floor	Space #	On-Site Room Name	Component	Substrate Material	Paint Color	Description of Damage	Damage Quantity (sf)	XRF Reading (mg/cm2)	XRF (positive/negative)
1	2	S22	Stairwell 2 next to Kitchen	W3	CMU	White	None	0	0	Negative
1	2	S22	Stairwell 2 next to Kitchen	W4	CMU	White	None	0	0	Negative
1	2	S22	Stairwell 2 next to Kitchen	Ceiling	Concrete	White	None	0	0	Negative
1	2	S22	Stairwell 2 next to Kitchen	Pipes	Metal	White	None	0	0	Negative
1	2	S22	Stairwell 2 next to Kitchen	Handrail	Metal	Grey	None	0	0	Negative
1	2	S22	Stairwell 2 next to Kitchen	Stringer	Metal	White	None	0	0	Negative
1	2	S22	Stairwell 2 next to Kitchen	Floor	12x12 VAT	Unpainted	N/A	N/A	N/A	N/A
1	2	S32	Stairwell 3 (Ogden St & Parking Lot)	W1	CMU	White	None	0	0	Negative
1	2	S32	Stairwell 3 (Ogden St & Parking Lot)	Door Frame	Metal	Grey	None	0	0	Negative
1	2	S32	Stairwell 3 (Ogden St & Parking Lot)	W2	CMU	White	None	0	0	Negative
1	2	S32	Stairwell 3 (Ogden St & Parking Lot)	W3	CMU	White	None	0	0	Negative

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	2	S32	Stairwell 3 (Ogden St & Parking Lot)	W4	CMU	White	None	0	0	Negative
1	2	S32	Stairwell 3 (Ogden St & Parking Lot)	Ceiling	Concrete	White	None	0	0	Negative
1	2	S32	Stairwell 3 (Ogden St & Parking Lot)	Pipes	Metal	White	None	0	0	Negative
1	2	S32	Stairwell 3 (Ogden St & Parking Lot)	Floor	12x12 VAT	Unpainted	N/A	N/A	N/A	N/A
1	2	S32	Stairwell 3 (Ogden St & Parking Lot)	Handrail	Metal	Grey	None	0	0	Negative
1	2	S32	Stairwell 3 (Ogden St & Parking Lot)	Stringer	Metal	White	None	0	0	Negative
1	2	S42	Stairwell 4 next to Main Office 248	W1	CMU	White	None	0	0	Negative
1	2	S42	Stairwell 4 next to Main Office 248	W2	CMU	White	None	0	0	Negative
1	2	S42	Stairwell 4 next to Main Office 248	Heater Cover	Metal	White	None	0	0	Negative
1	2	S42	Stairwell 4 next to Main Office 248	W3	CMU	White	None	0	0	Negative
1	2	S42	Stairwell 4 next to Main Office 248	W4	CMU	White	None	0	0	Negative

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	2	S42	Stairwell 4 next to Main Office 248	Door Frame	Metal	Grey	Friction	1	0	Negative
1	2	S42	Stairwell 4 next to Main Office 248	Handrail	Metal	Grey	None	0	0	Negative
1	2	S42	Stairwell 4 next to Main Office 248	Stringer	Metal	White	None	0	0	Negative
1	2	S42	Stairwell 4 next to Main Office 248	Ceiling	2x2 CT	Unpainted	N/A	N/A	N/A	N/A
1	2	S42	Stairwell 4 next to Main Office 248	Ceiling	Concrete	White	Chipping	2	0.03	Negative
1	2	S42	Stairwell 4 next to Main Office 248	Ceiling	Metal	White	None	0	0.1	Negative
1	2	S42	Stairwell 4 next to Main Office 248	Floor	12x12 VAT	Unpainted	N/A	N/A	N/A	N/A
1	2	W2	Women's Restroom next to Passenger Elevator	W1	Ceramic Tiles	Unpainted	N/A	N/A	N/A	N/A
1	2	W2	Women's Restroom next to Passenger Elevator	Door Frame	Metal	Grey	None	0	0	Negative
1	2	W2	Women's Restroom next to Passenger Elevator	W2	Ceramic Tiles	Unpainted	N/A	N/A	N/A	N/A

			Dates: 10/9/2023 thru 10/19/2023	<b>Lead-Safe Certification Assessment Report</b>						
			Inspector Name: Paul Davis and Certificate Number: 060094	<b>Philadelphia Learning Academy West/Crossroads Accelerated Academy MS</b>						
			Inspection Company: VERTEX, LLC	<b>4300 Westminster Ave, Philadelphia PA 19104</b>						
<b>E l e m e n t</b>	<b>F l o o r</b>	<b>Space #</b>	<b>On-Site Room Name</b>	<b>Component</b>	<b>Substrate Material</b>	<b>Paint Color</b>	<b>Description of Damage</b>	<b>Damage Quantity (sf)</b>	<b>XRF Reading (mg/cm2)</b>	<b>XRF (positive/ negative)</b>
1	2	W2	Women's Restroom next to Passenger Elevator	W3	Ceramic Tiles	Unpainted	N/A	N/A	N/A	N/A
1	2	W2	Women's Restroom next to Passenger Elevator	W4	Ceramic Tiles	Unpainted	N/A	N/A	N/A	N/A
1	2	W2	Women's Restroom next to Passenger Elevator	Ceiling	Sheetrock	White	None	0	0	Negative
1	2	W2	Women's Restroom next to Passenger Elevator	Floor	Ceramic Tiles	Unpainted	N/A	N/A	N/A	N/A



**Attachment B**  
**Lead Safe Certificate**



**Philadelphia Department of Public Health  
Certification of School Lead Safe Status**

By signing this certificate, I confirm that I have done a visual inspection of the areas where children have access, including contact surfaces where children store their equipment or materials, and confirm these areas do not have deteriorated lead-based paint. This certificate is valid for 4 years from date of verification.

**Philadelphia Learning Academy West/  
Crossroads Accelerated Academy Middle School**      **4300 Westminster Avenue, Philadelphia PA 19104**

School Name

Street Address

**The Vertex Companies, LLC**

Certifying Company (print)

**NAT-F199670-1**

Risk Assessor, Lead Inspector PA Lic. #, EPA Firm Cert or Lead Dust Sampling Technician Cert #

**February 15, 2024**

Inspector/Risk Assessor or Dust Wipe Sampling Technician Name (Signature)

Date of Verification

**Jennifer Donovan, 215-400-5719, jdonovan2@philasd.org**

School Official Name, Telephone and E-mail Address