

Summary of Paint & Plaster Stabilization Activities

AT:

**#2580– Kirkbride Elementary School
1501 S. 7th Street
Philadelphia, PA 19147**

PREPARED FOR:

**Ms. Francine Locke, M.S.
Environmental Services Director**

**Mr. Jerry Junod
Environmental Services Manager**

**School District of Philadelphia
Office of Environmental Management & Services
440 North Broad Street
3rd Floor – Portal C
Philadelphia, PA 19130**

PREPARED BY:

**Mr. Steven A. Vena, CIH
Project Manager**

**Criterion Laboratories, Inc.
January 28, 2019**

**Project Number: 181786
Project Dates: August 7 – October 12, 2018**

Summary of Paint and Plaster Stabilization Activities
School Name: Kirkbride Elementary School
Address: 1501 S. 7th Street
Philadelphia, PA 19147
UCLS #: 2580

TABLE OF CONTENTS

- I. Introduction**

- II. Methods Executive Summary**
 - A. Preliminary Steps**
 - i. Parent and Staff Notifications**
 - ii. Decluttering**
 - iii. Wall Hangings**
 - iv. Swing Space**
 - v. Facilities Building Cleaning Staff Training**
 - B. Pre-Cleaning**
 - C. Paint & Plaster Stabilization Procedures**
 - i. Work Practices**
 - ii. Oversight**
 - D. Cleanup & Completion**
 - i. Cleanup**
 - ii. Testing**

- III. Oversight**
 - A. Scope of Work**
 - B. EPA Checklist**
 - C. Oversight**
 - D. Sample Results**

Appendix A. Scope of Work Table

Appendix B. EPA Checklist Table

Appendix C. Oversight Table

Appendix D. Sample Results Table

Appendix E. Photographs

Appendix F. Environmental Firm Certification Documentation of Training

Appendix G. Paint Contractor Certifications or Documentation of Training

Appendix H. Documentation of Parent and Staff Notifications

I. INTRODUCTION

Criterion Laboratories, Inc. (Criterion), was requested by the School District of Philadelphia's Office of Environmental Management Services (OEMS) to perform oversight and clearance testing during a paint and plaster stabilization project being performed by the School District Painters at Kirkbride Elementary School located at 1501 S. 7th Street in Philadelphia, PA (the "School"). The purpose of the oversight was to document that all parts of the US Environmental Protection Agency (EPA) Lead Renovation, Repair and Painting rules were being followed and documented.

II. METHODS EXECUTIVE SUMMARY

A. Preliminary Steps

i. Parent and Staff Notifications

Parents and staff were notified of the paint and plaster project by mail several weeks prior to the commencement of the project. Additionally, prior to the start of the project, parent and staff meetings were held by OEMS, Maintenance, and Operations to explain the process of the paint and plaster projects and to field any questions or concerns.

ii. Decluttering

Classrooms, closets and other storage areas were decluttered prior to the commencement of stabilization work. Coordination of the decluttering activities was made between teachers and facilities staff to ensure that outdated and unneeded academic materials were discarded, and that resources were provided to assist in the decluttering tasks such as support staff for heavy lifting and/or moving large furniture and additional recycling dumpsters.

iii. Wall Hangings

Posters, bulletin boards, framed art and other wall hangings were removed prior to the commencement of the paint stabilization project. This was coordinated with teachers by the Operations Division at the kick-off meeting, and during the phasing of the project, with the help of the Principal.

iv. Swing Space

Swing space was identified prior to the commencement of stabilization work to ensure that classrooms were available during the school year. A plan was created on a school-by-school basis to relocate students and teachers from classrooms during the course of this work. All work areas were scheduled for cleaning by facilities staff after the paint stabilization work was completed by Maintenance Painting Staff.

v. Facilities Building Cleaning Staff Training

Facilities Building Cleaning Staff were provided with information about this project and expectations for post-cleaning, including use of wet-wipes and HEPA vacuums.

B. Pre-Cleaning

On an as-needed basis, for areas such as cluttered storage closets, that required extensive movement of materials, HEPA vacuuming, and wet-wiping prior to paint and plaster stabilization, the Maintenance Environmental staff performed a pre-cleaning in advance of stabilization work. The intent of this task was to provide a clean work area prior to decluttering and stabilization.

Additionally, post-cleaning was conducted by facilities staff after paint and plaster stabilization was completed. This included the HEPA vacuuming and wet-wiping of all horizontal surfaces and polishing floors.

C. Paint & Plaster Stabilization Procedures

Paint and plaster stabilization work complied with the EPA's Lead RRP rule. All staff conducting this work were trained and/or certified as Lead RRP workers.

The following procedures were followed:

i. Work Practices

- Isolate work areas to restrict dust from impacting adjacent areas.
- Post signs/notifications as per EPA Lead RRP.
- Place "walk-off" pads at all access points into/out of work area.
- Seal all openings [windows, doors, and HVAC system registers/grilles] inside work areas as per direction from on-site environmental monitors and consistent with the EPA Lead RRP rules & guidelines.
- Workers are to wear disposable clothing and foot coverings while inside work areas and will not leave work areas wearing disposable clothing.
- Move/cover all remaining objects in work area to protect them. Including all open bins, shelves and boxes in the classroom.
- Employ/Erect "portable" dust containment barrier systems to limit the size of work areas requiring post-cleaning and limit testing and exposure.
- Place plastic floor coverings to extend at least 6 feet out from vertical surfaces being stabilized unless utilizing vertical barriers/containment systems.
- Perform all paint stabilization work in compliance with the EPA Lead RRP rules & guidelines and as per the directions of on-site environmental monitors to minimize dust contamination.
- Take all steps necessary to ensure that no dust or debris leaves the work area while the work is being performed.
- Use precautions to ensure that all employees, tools, and other items, including the exteriors of waste containers, are free of dust and debris before leaving the work area.

- Collect all paint chips & debris, fold up plastic floor coverings and any other plastic sheeting used on horizontal surfaces, without dispersing dust or debris and dispose of the material in heavy duty plastic waste bags.
- Do not use power tools.
- Do not use dry sweeping with brooms.
- Do use water/misting during stabilization to minimize dust.
- Do use HEPA vacuums and wet wiping/cleaning techniques.

ii. Oversight

The environmental technician will oversee paint and plaster stabilization work to ensure compliance with lead safe work practices. An oversight report will be completed at the end of every shift to record the work areas that were stabilized. The following tasks will be verified and recorded:

- Pre-cleaning
- Contents moved
- Work area prepped
- Surfaces stabilized
- Contents back in place
- Final inspection approval and photos

D. Cleanup & Completion

The following clean-up and completion procedures were performed for each work area following the completion of stabilization work:

i. Cleanup

- There should be no signs of loose, peeling, flaking, bubbling or crumbling paint or plaster visible on walls or ceilings or on any other painted surfaces.
- There should be no visible signs of paint chips, debris or dust of any kind on surfaces within "contained" and isolated work areas NOR outside of the contained and isolated work areas.
- Window sills, floors, baseboards, shelving units, tops of cabinets, desks, chairs, tables and all other horizontal surfaces must be free of any visible signs of paint and plaster dust and/or debris.
- There must be absolutely no visible signs of paint chips, and/or paint/plaster dust or debris on academic/educational materials, including books, bins, toys, desks, chairs, carpets, papers, etc., after each work shift and to allow for re-occupancy the next day.
- Any remaining paint and plaster must be tightly adhered to wall and ceiling surfaces such that it cannot be further damaged, pried off or disturbed by "simple fingernail pressure" otherwise work will not be considered to be successfully completed.
- Newly painted surfaces should match the aesthetics of the area in total and should cover the entirety of the wall or ceiling area that was addressed through this work. No visible "patches" of paint should be observed.

ii. Testing

The District and the PFT's Environmental Consultant worked closely to develop an agreed upon approach to verify that stabilization work was performed in accordance with lead safe work practices, and that classrooms would be safe for re-occupancy by children and staff. This approach exceeds the EPA Lead RRP rule requirements in terms of the types of, and amounts of, testing performed. Testing will take place in work areas. The areas will be cleaned by general cleaners after the stabilization work is completed and the clearance testing is performed.

Qualitative testing methods, i.e., EPA RRP verification wipe testing and colorimetric wipe testing, will be compared with the quantitative testing method of Atomic Absorption Spectrophotometry (AAS) as indicated in the testing protocol below. If the comparison testing is consistently correlated, only qualitative testing will continue for the duration of the project.

a. Testing Protocol

Step 1 -- EPA RRP Verification Wipes and Colorimetric Wipes

The environmental consultant and painter foreman will coordinate the EPA RRP Verification Test Wipe in rooms/areas that have been stabilized and cleaned, and where plastic work area coverings have been removed and visual inspection conducted. After EPA RRP verification wipes pass the cleanliness standard for any surface and/or a 40 square feet (SF) section, the colorimetric testing will be conducted by the environmental consultant.

The colorimetric wipe tests will occur in "child-occupied areas" on approximately 10% of surfaces considered "clean" following the use of the verification wipes. These surfaces may include floors, window sills, or the tops of any other immovable objects that were covered and cleaned in each work area (e.g. CUVs, immovable bookshelves). Additional colorimetric wipes may be collected on surfaces that had been moved and covered and placed outside of the work area. These surfaces may include desks, chairs, bookshelves, etc.

"Child-occupied areas" will include: classrooms, restrooms, cafeterias, gymnasiums, and auditoriums that are routinely used by children in PK-1st grade classrooms. Common areas that children in PK-1st grade classrooms only pass through, such as hallways, stairways, and garages are not included. "Child-occupied areas" will be identified by the Principal of each school.

Step 2 -- Response to Failed Tests

If colorimetric testing "fails," then the 40 SF area will be re-wiped by EPA RRP Wipes. The process will continue until both testing methods confirm a "pass."

Step 3 -- Flame Atomic Absorption Spectrophotometry (FAAS)

Flame Atomic Absorption Spectrophotometry (FAAS) will be used to verify and confirm the results of the colorimetric testing. FAAS will be used as a quality assurance/quality control for the colorimetric samples. Approximately 10% of the colorimetric samples should be submitted for FAAS analysis.

Step 4 -- Release Spaces Back to School/Operations

If EPA RRP wipes and colorimetric wipes are both acceptable, as determined on site, and if work was completed in accordance with this procedure, the room will be turned over to the District's Operations team for "deep cleaning" and for re-occupancy.

Step 5 -- Ongoing Review

All sampling and testing data, information and results will be readily available and accessible for review by school staff, parents and members of the Oversight Advisory Committee and will be reviewed on a regular basis. Any suggested modifications, changes or other revisions will be considered by the School District of Philadelphia.

The three testing methods were conducted as follows:

Type of Clearance Tests	Building Component	Number of Sample Locations within Work Area	Type of Testing	Testing Specifications/Limitations
EPA RRP Cleaning Verification Wipe	Floors, Countertops, Desks, Tables, Window Sills	One (1) wipe every 40 square feet (ft ²) or entire surface of component if surface area is less than 40ft ² One (1) wipe for every window sill	Qualitative	<ul style="list-style-type: none"> • Qualitative testing based on cleanliness (white glove test) • According to RRP, the areas pass after the 3rd cleaning, regardless of verification
Colorimetric Wipe SKC, Inc. Full Disclosure® Instant Wipes	Floors, Countertops, Desks, Tables, Window Sills, Etc.	10% of surfaces considered "clean" following the use of EPA RRP Cleaning Verification Wipes	Qualitative	<ul style="list-style-type: none"> • Qualitative testing based on colorimetric visual comparison • Lower Limit of Visual Detection is 18µg of lead • False positive and false negative interferences from silver, cadmium, barium, mercury, and titanium (percentages unknown) • Involves field preparation of sampling media using reagents

Flame Atomic Absorption Spectrophotometry (AAS)	Analyze Colorimetric Wipes from locations listed above	A minimum of one and a maximum of 10% of colorimetric wipes will also be subjected to laboratory analysis by FAAS for verification. This testing method will be used on a periodic basis to validate the accuracy of qualitative methods above.	Quantitative	<ul style="list-style-type: none">• Interior Floors and Desks: < 20 $\mu\text{g}/\text{ft}^2$ This is based upon a District and PFT agreement. This is half the current HUD and EPA standard. This is tied to the detection level for the colorimetric wipe which is 18μg per wipe.• Window Sills: < 100 $\mu\text{g}/\text{ft}^2$ per HUD
---	--	---	--------------	---

III. OVERSIGHT

A. Scope of Work

A scope of work was developed for Kirkbride Elementary School following a room-by-room inspection of the school. During the inspection, the location and quantity of damaged paint and plaster, along with any associated debris and whether the damage was the result of an on-going moisture intrusion, were noted. This information was entered into a scope of work spreadsheet, which was provided to the School District Painting Department in order to create a schedule for the work to be completed.

During the paint and plaster stabilization project, additional areas of damage were found behind wall hangings, inside of closets that had now been decluttered, and behind furniture once it had been moved. These additional areas of work were added to the scope of work as they were observed.

The scope of work for Kirkbride Elementary School is included in the Appendix A of this report.

B. EPA Checklist

Throughout the paint and plaster stabilization project, Criterion's on-site inspector observed, documented, and signed-off on tasks required by the EPA RRP. Additional notes were added to the EPA Checklist to document different oversight tasks that took place. These included documenting that warning signs were posted at the entrance to the work area, that the work area had been contained to prevent the spread of dust and debris, that all objects in the work area had been removed or covered, that all HVAC ducts in the work area were closed and covered, that windows in the work area were closed, that doors in the work area were closed and sealed, that doors that must be used in the work area were covered to allow passage but prevent the spread of dust, that floors in the work area were covered with taped-down plastic, that waste was being contained while on-site and while being transported, that the work site was properly cleaned after the renovations, that all paint chips and debris were picked up and that the protective sheeting was misted, folded dirty-side inward, and taped for removal, that the work area surfaces and objects were cleaned using HEPA vacuums and/or wet-wiping or mopping, that a certified renovator performed the post-renovation cleaning verification, a description of the post-renovation cleaning verification, including the number of wet and dry cloths used, and if the dust clearance testing was performed.

The EPA Checklist for Kirkbride Elementary School is included in the Appendix B of this report.

C. Oversight

Throughout the paint and plaster stabilization project, Criterion's on-site inspector documented the day-to-day tasks performed for each work area. These tasks included the dates of pre-cleaning, the moving of the contents of the room, the prepping of the work area, the stabilization of the painted surfaces, and the final inspection.

The Oversight Table for Kirkbride Elementary School is included in the Appendix C of this report.

D. Sample Results

Throughout the paint and plaster stabilization project, Criterion's on-site inspector documented all sampling results for each work area location. This included all RRP verification wipes, colorimetric wipes, and wipes to be submitted for Flame AAS analysis.

The Sample Results Table for Kirkbride Elementary School is included in the Appendix D of this report.

Appendix A. Scope of Work Table

Task ID	ULCS#	Element	Floor	Space # (on Floor Plan)	Space Type	On Site Room Name	Component	Description of Paint and Plaster Damage (i.e. cracking, chipping, gouges, holes, flaking, spalling, efflorescence, significant moisture damage)	Quantity (sf)	On-going Moisture Intrusion (yes or no)	Paint and Plaster Debris on Surfaces and/or Educational Materials (describe location)	Quantity (sf)	Contents Need to be Moved (i.e. posters, contents, furniture)	Plastering Needed (yes or no)	Other Notes or Comments
1	2580	1	1	101	Primary	Head Start Classroom 101	W2	Peeling and Cracking paint	50	No	None		None		
2	2580	1	1	101	Primary	Head Start Classroom 101	W3	Cracking paint & Efflorescence	30	No	None		None	Y	
3	2580	1	1	101	Primary	Head Start Classroom 101	W4	Cracking paint	30	No	None		None		
4	2580	1	1	101	Student Restrooms - Male/Female (Classroom)	Classroom 101 Storage Room	W1	Peeling paint	10	No	None		None		
5	2580	1	1	101	Student Restrooms - Male/Female (Classroom)	Classroom 101 Storage Room	W2	Peeling paint by riser	15	No	None		None		
6	2580	1	1	101	Student Restrooms - Male/Female (Classroom)	Classroom 101 Storage Room	W3	Peeling paint	5	No	None		None		
7	2580	1	1	101A	Student Restrooms - Male/Female (Classroom)	Classroom 101 Storage Room	W4	Peeling paint	15	No	None		None		
8	2580	1	1	101B	Primary	Classroom 102	W1	Cracking paint	20	No	None		None		
9	2580	1	1	101B	Primary	Classroom 102	W2	Cracking paint	10	No	None		None		
10	2580	1	1	101B	Primary	Classroom 102	W3	Cracking & Peeling paint	25	No	None		None		
11	2580	1	1	102	Primary	Classroom 102	W4	Cracking, & Peeling paint at door	20	No	None		None		
12	2580	1	1	102	Primary	Classroom 102	Ceiling	Peeling paint above drop ceiling (seen through the missing ceiling tile)	8	No	None		None		
13	2580	1	1	102	Storage	Classroom 102 Closet	W1	Cracking & Peeling paint	20	No	None		None		
14	2580	1	1	102	Storage	Classroom 102 Closet	W2	Cracking	20	No	None		None		
15	2580	1	1	102	Storage	Classroom 102 Closet	W3	Cracking & Severe peeling paint	40	No	None		None		
16	2580	1	1	102A	Storage	Classroom 102 Closet	W4	Cracking	20	No	None		None		
17	2580	1	1	102A	Primary	Classroom 103	W1	Cracking paint	30	No	None		None		
18	2580	1	1	102A	Primary	Classroom 103	W2	Cracking paint	30	No	None		None		
19	2580	1	1	102A	Primary	Classroom 103	W3	Cracking & Peeling paint	40	No	None		None		
20	2580	1	1	103	Primary	Classroom 103	W4	Cracking paint	20	No	None		None		
21	2580	1	1	103	Storage	Classroom 103 Coat Closet	W1	Cracking paint	5	No	None		None		
22	2580	1	1	103	Storage	Classroom 103 Coat Closet	W2	Cracking paint	5	No	None		None		
23	2580	1	1	103	Storage	Classroom 103 Coat Closet	W3	Cracking & Peeling paint	20	No	None		None		
24	2580	1	1	103A	Storage	Classroom 103 Coat Closet	W4	Cracking	5	No	None		None		
25	2580	1	1	103A	Storage	Classroom 103 Coat Closet	Ceiling	Cracking & Peeling paint	25	No	None		None		
26	2580	1	1	103B	Storage	Classroom 103 Closet	Ceiling	Cracking & Peeling paint	30	No	None		None		

27	2580	1	1	103B	Primary	Classroom 104	W1	Cracking paint below the blackboard	30	No	None		None		
28	2580	1	1	103B	Primary	Classroom 104	W2	Cracking paint below the blackboard	30	No	None		None		
29	2580	1	1	103B	Primary	Classroom 104	W3	Cracking & Peeling paint	40	No	None		None		
30	2580	1	1	104	Primary	Classroom 104	W4	Cracking & Peeling paint	40	No	None		None		
31	2580	1	1	104	Storage	Classroom 104 Closet	W1	No access		No	None		None		
32	2580	1	1	104	Storage	Classroom 104 Closet	W2	No access		No	None		None		
33	2580	1	1	104	Storage	Classroom 104 Closet	W3	No access		No	None		None		
34	2580	1	1	104A	Storage	Classroom 104 Closet	W4	No access		No	None		None		
35	2580	1	1	104A	Storage	Classroom 104 Closet	Ceiling	No access		No	None		None		
36	2580	1	1	104A	Storage	Classroom 104 Closet	Floor	No access		No	None		None		
37	2580	1	1	104B	Primary	Counselor's Office Room 105	W1	Cracking paint	30	No	None		None		
38	2580	1	1	104B	Primary	Counselor's Office Room 105	W2	Cracking paint	10	No	None		None		
39	2580	1	1	104B	Primary	Counselor's Office Room 105	W3	Peeling paint at columns & behind radiators	30	No	None		None		
40	2580	1	1	105	Primary	Counselor's Office Room 105	W4	Cracking paint	20	No	None		None		
41	2580	1	1	105	Primary	Room 105 Counselor's Sub Office	W1	No access		No	None		None		
42	2580	1	1	105	Primary	Room 105 Counselor's Sub Office	W2	No access		No	None		None		
43	2580	1	1	105	Primary	Room 105 Counselor's Sub Office	W3	No access		No	None		None		
44	2580	1	1	105.1	Primary	Room 105 Counselor's Sub Office	W4	No access		No	None		None		
45	2580	1	1	105.1	Primary	Room 105 Counselor's Sub Office	Ceiling	No access		No	None		None		
46	2580	1	1	105.1	Primary	Room 105 Counselor's Sub Office	Floor	No access		No	None		None		
47	2580	1	1	105.1	Storage	Counselor's Office Closet	W1	No access		No	None		None		
48	2580	1	1	105.1	Storage	Counselor's Office Closet	W2	No access		No	None		None		
49	2580	1	1	105.1	Storage	Counselor's Office Closet	W3	No access		No	None		None		
50	2580	1	1	105A	Storage	Counselor's Office Closet	W4	No access		No	None		None		
51	2580	1	1	105A	Storage	Counselor's Office Closet	Ceiling	No access		No	None		None		
52	2580	1	1	105A	Storage	Counselor's Office Closet	Floor	No access		No	None		None		

53	2580	1	1	105A	Primary	Classroom 106	W1	Cracking & Peeling paint	50	No	None		None		
54	2580	1	1	105A	Primary	Classroom 106	W2	Cracking paint	30	No	None		None		
55	2580	1	1	105A	Primary	Classroom 106	W3	Peeling paint behind radiators/casing	40	No	None		None		
56	2580	1	1	106	Primary	Classroom 106	W4	Cracking & Peeling paint	30	No	None		None		
57	2580	1	1	106	Storage	Classroom 106 Coat Closet	W1	Cracking paint	30	No	None		None		
58	2580	1	1	106	Storage	Classroom 106 Coat Closet	W2	Cracking paint	10	No	None		None		
59	2580	1	1	106	Storage	Classroom 106 Coat Closet	W3	Cracking paint	30	No	None		None		
60	2580	1	1	106A	Storage	Classroom 106 Coat Closet	Ceiling	Peeling paint above drop ceiling (seen through the missing ceiling tile)	8	No	None		None		
61	2580	1	1	106A	Primary	Room 107 Teacher's Lounge	W1	Cracking paint	10	No	None		None		
62	2580	1	1	106A	Primary	Room 107 Teacher's Lounge	W2	Cracking paint & Damaged plaster	20	No	None		None	Yes	
63	2580	1	1	106A	Primary	Room 107 Teacher's Lounge	W3	Cracking paint at columns, peeling paint behind radiators	40	No	None		None		
64	2580	1	1	107	Primary	Room 107 Teacher's Lounge	W4	Cracking paint	10	No	None		None		
65	2580	1	1	107	Storage	Room 107 Teacher's Lounge Staff Closet	W1	No access		No	None		None		
66	2580	1	1	107	Storage	Room 107 Teacher's Lounge Staff Closet	W2	No access		No	None		None		
67	2580	1	1	107	Storage	Room 107 Teacher's Lounge Staff Closet	W3	No access		No	None		None		
68	2580	1	1	107A	Storage	Room 107 Teacher's Lounge Staff Closet	W4	No access		No	None		None		
69	2580	1	1	107A	Storage	Room 107 Teacher's Lounge Staff Closet	Ceiling	No access		No	None		None		
70	2580	1	1	107A	Storage	Room 107 Teacher's Lounge Staff Closet	Floor	No access		No	None		None		
71	2580	1	1	107A	Student Restrooms - Male/Female (Classroom)	Classroom 107 Restroom	W1	No access		No	None		None		
72	2580	1	1	107A	Student Restrooms - Male/Female (Classroom)	Classroom 107 Restroom	W2	No access		No	None		None		
73	2580	1	1	107A	Student Restrooms - Male/Female (Classroom)	Classroom 107 Restroom	W3	No access		No	None		None		
74	2580	1	1	107B	Student Restrooms - Male/Female (Classroom)	Classroom 107 Restroom	W4	No access		No	None		None		
75	2580	1	1	107B	Student Restrooms - Male/Female (Classroom)	Classroom 107 Restroom	Ceiling	No access		No	None		None		
76	2580	1	1	107B	Student Restrooms - Male/Female (Classroom)	Classroom 107 Restroom	Floor	No access		No	None		None		
77	2580	1	1	107B	Primary	Classroom 108	W1	Peeling paint	10	No	None		None		
78	2580	1	1	107B	Primary	Classroom 108	W2	Peeling paint	10	No	None		None		

79	2580	1	1	107B	Primary	Classroom 108	W3	Severe peeling paint at radiators, peeling paint & damaged plaster at columns	50	No	None		None		
80	2580	1	1	108	Primary	Classroom 108	W4	Flaking paint	20	No	None		None		
81	2580	1	1	108	Storage	Classroom 108 Coat Closet	W1	Cracking paint	5	No	None		None		
82	2580	1	1	108	Storage	Classroom 108 Coat Closet	W2	Severe peeling paint at columns	30	No	None		None		
83	2580	1	1	108	Storage	Classroom 108 Coat Closet	W3	Cracking & Flaking paint	20	No	None		None		
84	2580	1	1	108A	Primary	Classroom 109	W1	Cracking paint	5	No	None		None		
85	2580	1	1	108A	Primary	Classroom 109	W2	Cracking paint	30	No	None		None		
86	2580	1	1	108A	Primary	Classroom 109	W3	Severe peeling paint at radiators, Cracking paint at columns	50	No	None		None		
87	2580	1	1	109	Primary	Classroom 109	W4	Cracking & Flaking paint	20	No	None		None		
88	2580	1	1	109	Storage	Classroom 109 Storage Closet	W1	No access		No	None		None		
89	2580	1	1	109	Storage	Classroom 109 Storage Closet	W2	No access		No	None		None		
90	2580	1	1	109	Storage	Classroom 109 Storage Closet	W3	No access		No	None		None		
91	2580	1	1	109A	Storage	Classroom 109 Storage Closet	W4	No access		No	None		None		
92	2580	1	1	109A	Storage	Classroom 109 Storage Closet	Ceiling	No access		No	None		None		
93	2580	1	1	109A	Storage	Classroom 109 Storage Closet	Floor	No access		No	None		None		
94	2580	1	1	109A	Stairs	Side Entrance to 110	W1	Cracking paint	10	No	None		None		
95	2580	1	1	109A	Stairs	Side Entrance to 110	W2	Cracking, Spalling, Flaking paint	30	No	None		None		
96	2580	1	1	109A	Stairs	Side Entrance to 110	W3	Peeling paint	5	No	None		None		
97	2580	1	1	110A	Stairs	Side Entrance to 110	W4	Cracking paint	30	No	None		None		
98	2580	1	1	110A	Stairs	Side Entrance to 110	Ceiling	Peeling paint above drop ceiling (seen through the missing ceiling tile)	10	No	None		None		
99	2580	1	1	110A	Storage	Classroom 110 Storage Closet	W1	No access		No	None		None		
100	2580	1	1	110A	Storage	Classroom 110 Storage Closet	W2	No access (severe peeling paint could be seen through the door)	20	No	None		None		
101	2580	1	1	110A	Storage	Classroom 110 Storage Closet	W3	No access (severe peeling paint could be seen through the door)	20	No	None		None		
102	2580	1	1	110B	Storage	Classroom 110 Storage Closet	W4	No access (severe peeling paint could be seen through the door)	20	No	None		None		
103	2580	1	1	110B	Storage	Classroom 110 Storage Closet	Ceiling	No access		No	None		None		
104	2580	1	1	110B	Storage	Classroom 110 Storage Closet	Floor	No access		No	None		None		
105	2580	1	1	110B	Primary	Classroom 110	W1	Cracking & Peeling paint	20	No	None		None		
106	2580	1	1	110B	Primary	Classroom 110	W2	Severe peeling paint & Efflorescence	50	No	None		None		
107	2580	1	1	110B	Primary	Classroom 110	W3	Cracking & Peeling paint	20	No	None		None		
108	2580	1	1	110	Primary	Classroom 110	W4	Cracking paint	20	No	None		None		
109	2580	1	1	110	Primary	Classroom 110	Ceiling	Cracking paint at stage ceiling	10	No	None		None		
110	2580	1	1	110	Administrative Office	Principal's Office	W1	Peeling paint at column	20	No	None		None		
111	2580	1	1	110	Administrative Office	Principal's Office	W2	Severe peeling paint	40	No	None		None		

112	2580	1	1	110	Administrative Office	Principal's Office	W3	Severe peeling paint behind computer desk	50	No	None		None		
113	2580	1	1	111A	Administrative Office	Principal's Office	W4	Cracking, Chipping, and peeling paint	75	No	None		None		
114	2580	1	1	111A	Restrooms, Staff - Male/Female	Principal's Office Restroom	W1	Cracking paint	5	No	None		None		
115	2580	1	1	111A	Restrooms, Staff - Male/Female	Principal's Office Restroom	W2	Cracking paint	5	No	None		None		
116	2580	1	1	111A	Restrooms, Staff - Male/Female	Principal's Office Restroom	W3	Cracking paint	5	No	None		None		
117	2580	1	1	111B	Restrooms, Staff - Male/Female	Principal's Office Restroom	W4	Cracking paint	5	No	None		None		
118	2580	1	1	111B	Restrooms, Staff - Male/Female	Principal's Office Restroom	Ceiling	Cracking paint	20	No	None		None		
119	2580	1	1	111C	Administrative Office	Main Office	W1	Cracking & Chipping paint	15	No	None		None		
120	2580	1	1	111C	Administrative Office	Main Office	W2	Cracking & Peeling paint	30	No	None		None		
121	2580	1	1	111C	Administrative Office	Main Office	W3	Peeling paint	10	No	None		None		
122	2580	1	1	111	Administrative Office	Main Office	W4	Cracking paint & hole in plaster	20	No	None		None	Yes	
123	2580	1	1	111	Administrative Office	Conference Room	W1	Severe peeling paint on door	40	No	None		None		
124	2580	1	1	111	Administrative Office	Conference Room	W2	Peeling paint	5	No	None		None		
125	2580	1	1	111	Administrative Office	Conference Room	W3	Peeling paint around windows	10	No	None		None		
126	2580	1	1	112	Administrative Office	Conference Room	W4	Peeling paint & Damaged plaster	20	No	None		None	Yes	
127	2580	1	1	112	Administrative Office	Conference Room	Floor	Baseboard	20	No	None		None		
128	2580	1	1	112	Administrative Office	Conference Room Restroom	W1	Severe peeling paint on door	30	No	None		None		
129	2580	1	1	112	Administrative Office	Conference Room Restroom	W2	Peeling paint	5	No	None		None		
130	2580	1	1	112	Administrative Office	Conference Room Restroom	W3	Peeling paint	5	No	None		None		
131	2580	1	1	112A	Storage	Main Office Closet on the left side	Ceiling	Peeling paint	5	No	None		None		
132	2580	1	1	112A	Storage	Main Office Closet/File Room on the right side	W1	Peeling paint	5	No	None		None		
133	2580	1	1	112A	Storage	Main Office Closet/File Room on the right side	W2	Severe peeling paint	20	No	None		None		
134	2580	1	1	112C	Administrative Office	Main Office Copy Room	W1	Severe peeling paint	20	No	None		None		
135	2580	1	1	112C	Administrative Office	Main Office Copy Room	W2	Cracking paint	5	No	None		None		
136	2580	1	1	112C	Administrative Office	Main Office Copy Room	W3	Cracking paint	5	No	None		None		
137	2580	1	1	112B	Administrative Office	Main Office Copy Room	W4	Cracking paint	5	No	None		None		
138	2580	1	1	112B	Administrative Office	Nurse's Office	W1	Cracking paint	5	No	None		None		

139	2580	1	1	112B	Administrative Office	Nurse's Office	W2	Cracking paint, and damaged plaster by door	10	No	None		None		
140	2580	1	1	112B	Administrative Office	Nurse's Office	W3	Peeling paint behind radiator	10	No	None		None		
141	2580	1	1	113	Administrative Office	Nurse's Office	W4	Cracking paint	5	No	None		None		
142	2580	1	1	113	Restrooms, Staff - Male/Female	Nurse's Office Restroom	W1	Cracking paint	15	No	None		None		
143	2580	1	1	113	Restrooms, Staff - Male/Female	Nurse's Office Restroom	W2	Cracking paint	5	No	None		None		
144	2580	1	1	113	Restrooms, Staff - Male/Female	Nurse's Office Restroom	W3	Cracking paint	10	No	None		None		
145	2580	1	1	113B	Restrooms, Staff - Male/Female	Nurse's Office Restroom	W4	Cracking paint	20	No	None		None		
146	2580	1	1	113B	Student Restrooms - Male/Female (Classroom)	Kindergarten Restroom by Classroom 106	W1	Peeling paint	40	No	None		None		
147	2580	1	1	113B	Student Restrooms - Male/Female (Classroom)	Kindergarten Restroom by Classroom 106	W2	Peeling paint & Efflorescence	100	No	None		None	Yes	
148	2580	1	1	113B	Student Restrooms - Male/Female (Classroom)	Kindergarten Restroom by Classroom 106	W3	Peeling paint & Efflorescence	50	No	None		None	Yes	
149	2580	1	1	120	Student Restrooms - Male/Female (Classroom)	Kindergarten Restroom by Classroom 106	W4	Peeling paint	50	No	None		None		
150	2580	1	1	120	Student Restrooms - Male/Female (Classroom)	Kindergarten Restroom by Classroom 106	Ceiling	Peeling paint & Efflorescence & Pipe	100	No	None		None	Yes	
151	2580	1	1	120	Student Restrooms - Female (4-12)	Girl's Restroom	W1	Cracking paint	5	No	None		None		
152	2580	1	1	120	Student Restrooms - Female (4-12)	Girl's Restroom	W2	Cracking paint	15	No	None		None		
153	2580	1	1	120	Student Restrooms - Female (4-12)	Girl's Restroom	W3	Cracking paint & Flaking paint	10	No	None		None		
154	2580	1	1	121	Student Restrooms - Female (4-12)	Girl's Restroom	W4	Cracking paint & Pipe	30	No	None		None		
155	2580	1	1	121	Student Restrooms - Female (4-12)	Girl's Restroom	Ceiling	Peeling paint & Efflorescence	40	No	None		None	Yes	
156	2580	1	1	121	Restrooms, Staff - Female	Women's Lounge	W1	Cracking paint on wall and door (varnish)	30	No	None		None		
157	2580	1	1	121	Restrooms, Staff - Female	Women's Lounge	W2	Cracking paint & peeling paint	15	No	None		None		
158	2580	1	1	121	Restrooms, Staff - Female	Women's Lounge	W3	Severely damaged plaster	15	No	None		None	Yes	
159	2580	1	1	122	Restrooms, Staff - Female	Women's Lounge	W4	Cracking paint and holes in plaster	15	No	None		None		
160	2580	1	1	122	Restrooms, Staff - Female	Women's Lounge Restroom	W1	Peeling paint & Efflorescence	10	No	None		None		
161	2580	1	1	122	Restrooms, Staff - Female	Women's Lounge Restroom	W2	Peeling paint behind radiator	10	No	None		None		
162	2580	1	1	122	Restrooms, Staff - Female	Women's Lounge Restroom	W3	Cracking paint	25	No	None		None		
163	2580	1	1	122A	Restrooms, Staff - Female	Women's Lounge Restroom	W4	Cracking paint	10	No	None		None		

164	2580	1	1	122A	Restrooms, Staff - Female	Women's Lounge Restroom	Ceiling	Cracking paint	5	No	None		None		
165	2580	1	1	122A	Circulation (Hallway)	Hallway from Classrooms 106 to 109	W1	Cracking paint	15	No	None		None		
166	2580	1	1	122A	Circulation (Hallway)	Hallway from Classrooms 106 to 109	W2	Damaged plaster at entrance to Room 108	5	No	None		None	Yes	
167	2580	1	1	122A	Circulation (Hallway)	Hallway from Classrooms 106 to 109	W3	-		No	None		None		
168	2580	1	1	H13	Circulation (Hallway)	Hallway from Classrooms 106 to 109	W4	Peeling & Cracking paint on wall, Peeling paint on pipe	40	No	None		None		
169	2580	1	1	H13	Circulation (Hallway)	Main Hallway in Front of Main Office	W1	Severe peeling paint & Cracking paint	150	No	None		None		
170	2580	1	1	H13	Circulation (Hallway)	Main Hallway in Front of Main Office	W2	-		No	None		None		
171	2580	1	1	H13	Circulation (Hallway)	Main Hallway in Front of Main Office	W3	Severe peeling paint & Cracking paint	150	No	None		None		
172	2580	1	1	H14	Circulation (Hallway)	Main Hallway in Front of Main Office	W4	-		No	None		None		
173	2580	1	1	H14	Circulation (Hallway)	Main Hallway in Front of Main Office	Floor	Baseboard	30	No	None		None		
174	2580	1	1	H14	Circulation (Hallway)	Main Entrance Hallway	W1	Severe peeling paint & Efflorescence	70	No	None		None	Yes	
175	2580	1	1	H14	Circulation (Hallway)	Main Entrance Hallway	W2	Severe peeling paint & Efflorescence	80	No	None		None	Yes	
176	2580	1	1	H14	Circulation (Hallway)	Main Entrance Hallway	W3	Cracking paint	15	No	None		None		
177	2580	1	1	H14A	Circulation (Hallway)	Main Entrance Hallway	W4	Cracking & Peeling paint	40	No	None		None		
178	2580	1	1	H14A	Circulation (Hallway)	Main Entrance Hallway	Ceiling	Severe peeling paint & Efflorescence	50	No	None		None	Yes	
179	2580	1	1	H14A	Circulation (Hallway)	Hallway from Classrooms 101 to 104	W1	-		No	None		None		
180	2580	1	1	H14A	Circulation (Hallway)	Hallway from Classrooms 101 to 104	W2	Cracking & Peeling paint	5	No	None		None		
181	2580	1	1	H14A	Circulation (Hallway)	Hallway from Classrooms 101 to 104	W3	Cracking paint	5	No	None		None		
182	2580	1	1	H15	Circulation (Hallway)	Hallway from Classrooms 101 to 104	W4	Cracking paint along wall & Damaged plaster by fire tower	100	No	None		None	Yes	
183	2580	1	1	H15	Circulation (Hallway)	Hallway from Classrooms 101 to 104	Floor	Baseboard	10	No	None		None		
184	2580	1	1	H15	Stairs	Stairwell next to Classroom 106	W1	Cracking paint	30	No	None		None		
185	2580	1	1	H15	Stairs	Stairwell next to Classroom 106	W2	Peeling paint on door	10	No	None		None		
186	2580	1	1	H15	Stairs	Stairwell next to Classroom 106	W3	Cracking & Peeling paint, Damaged plaster	30	No	None		None	Yes	

187	2580	1	1	S11	Stairs	Stairwell next to Classroom 106	W4	Cracking paint	10	No	None		None		
188	2580	1	1	S11	Stairs	Stairwell next to Classroom 106	Ceiling	Severe peeling paint	30	No	None		None		
189	2580	1	1	S11	Stairs	Stairwell next to Classroom 104	W1	Cracking paint	30	No	None		None		
190	2580	1	1	S11	Stairs	Stairwell next to Classroom 104	W2	Cracking paint	5	No	None		None		
191	2580	1	1	S11	Stairs	Stairwell next to Classroom 104	W3	Cracking & peeling paint	30	No	None		None		
192	2580	1	1	S16	Stairs	Stairwell next to Classroom 104	W4	Peeling paint on door	10	No	None		None		
193	2580	1	1	S16	Stairs	Stairwell next to Classroom 104	Ceiling	Peeling & Flaking paint	20	No	None		None		
194	2580	1	1	S16	Stairs	Stairwell next to Classroom 104	Floor	Baseboard	20	No	None		None		
195	2580	1	1	S16	Stairs	Fire Tower by Classroom 103	W3	Peeling & Flaking paint	10	No	None		None		
196	2580	1	1	S18	Stairs	Fire Tower by Classroom 103	Ceiling	Severe peeling paint	100	No	None		None		
197	2580	1	1	S18	Stairs	Fire Tower by Classroom 103	Floor	Debris	50	No	None		None		
198	2580	1	1	S18	Stairs	Fire Tower by Classroom 103	W3	Peeling paint on pipe and window sill	20	No	None		None		
199	2580	1	1	S18A	Stairs	Fire Tower by Classroom 103	Ceiling	Severe peeling paint	20	No	None		None		
200	2580	1	1	S18A	Storage	Custodial Closet outside Classroom 106	W1	Hole in plaster wall	5	No	None		None	Yes	
201	2580	1	1	S18A	Storage	Custodial Closet outside Classroom 106	W2	Severe peeling paint & Damaged plaster	70	No	None		None	Yes	
202	2580	1	1	S18A	Storage	Custodial Closet outside Classroom 106	W3	Severe peeling paint	70	No	None		None		
203	2580	1	1	120A	Storage	Custodial Closet outside Classroom 106	W4	Severe peeling paint	70	No	None		None		
204	2580	1	1	120A	Storage	Custodial Closet outside Classroom 106	Ceiling	Severe peeling paint & Damaged plaster	20	No	None		None	Yes	
205	2580	1	1	120A	Storage	Custodial Closet outside Classroom 104	W1	Peeling paint	10	No	None		None		
206	2580	1	1	120A	Storage	Custodial Closet outside Classroom 104	W3	Peeling paint	25	No	None		None		
207	2580	1	1	121A	Storage	Head Start Closet outside Girl's Restroom	W1	No Access		No	None		None		
208	2580	1	1	121A	Storage	Head Start Closet outside Girl's Restroom	W2	No Access		No	None		None		
209	2580	1	1	121A	Storage	Head Start Closet outside Girl's Restroom	W3	No Access		No	None		None		

210	2580	1	1	104R	Storage	Head Start Closet outside Girl's Restroom	W4	No Access		No	None		None		
211	2580	1	1	104R	Storage	Head Start Closet outside Girl's Restroom	Ceiling	No Access		No	None		None		
212	2580	1	1	104R	Storage	Head Start Closet outside Girl's Restroom	Floor	No Access		No	None		None		
213	2580	1	1	104R	Primary	Classroom 201	W1	Peeling & Flaking paint	70	No	None		None		
214	2580	1	1	104R	Primary	Classroom 201	W2	Severe peeling paint & Efflorescence	150	No	None		None	Yes	
215	2580	1	1	104R	Primary	Classroom 201	W3	Peeling, Cracking, Spalling paint & Efflorescence	80	No	None		None	Yes	
216	2580	1	2	201	Primary	Classroom 201	W4	Peeling, Cracking, Spalling paint & Efflorescence	80	No	None		None	Yes	
217	2580	1	2	201	Storage	Classroom 201 Storage Closet	W1	No Access		No	None		None		
218	2580	1	2	201	Storage	Classroom 201 Storage Closet	W2	No Access		No	None		None		
219	2580	1	2	201	Storage	Classroom 201 Storage Closet	W3	No Access		No	None		None		
220	2580	1	2	201A	Storage	Classroom 201 Storage Closet	W4	No Access (severe peeling paint could be seen through the door)	40	No	None		None		
221	2580	1	2	201A	Storage	Classroom 201 Storage Closet	Ceiling	No Access		No	None		None		
222	2580	1	2	201A	Storage	Classroom 201 Storage Closet	Floor	No Access		No	None		None		
223	2580	1	2	201A	Primary	Classroom 202	W1	Cracking paint and some spalling	5	No	None		None		
224	2580	1	2	201A	Primary	Classroom 202	W2	Cracking paint and some spalling, Damaged plaster at door	15	No	None		None	Yes	
225	2580	1	2	201A	Primary	Classroom 202	W3	Peeling paint & Severely damaged plaster	50	No	None		None	Yes	
226	2580	1	2	202	Primary	Classroom 202	W4	Cracking paint	5	No	None		None		
227	2580	1	2	202	Storage	Classroom 202 Closet	W1	No Access		No	None		None		
228	2580	1	2	202	Storage	Classroom 202 Closet	W2	No Access		No	None		None		
229	2580	1	2	202	Storage	Classroom 202 Closet	W3	No Access		No	None		None		
230	2580	1	2	202A	Storage	Classroom 202 Closet	W4	No Access		No	None		None		
231	2580	1	2	202A	Storage	Classroom 202 Closet	Ceiling	No Access		No	None		None		
232	2580	1	2	202A	Storage	Classroom 202 Closet	Floor	No Access		No	None		None		
233	2580	1	2	202A	Primary	Classroom 203	W2	Peeling paint at edges of wallboard	5	No	None		None		
234	2580	1	2	202A	Primary	Classroom 203	W3	Peeling & Cracking paint, Damaged plaster	25	No	None		None	Yes	
235	2580	1	2	203A	Storage	Classroom 203 Storage Closet	W1	No Access		No	None		None		
236	2580	1	2	203A	Storage	Classroom 203 Storage Closet	W2	No Access		No	None		None		
237	2580	1	2	203A	Storage	Classroom 203 Storage Closet	W3	No Access		No	None		None		

238	2580	1	2	203B	Storage	Classroom 203 Storage Closet	W4	No Access		No	None		None		
239	2580	1	2	203B	Storage	Classroom 203 Storage Closet	Ceiling	No Access		No	None		None		
240	2580	1	2	203B	Storage	Classroom 203 Storage Closet	Floor	No Access		No	None		None		
241	2580	1	2	203B	Primary	Classroom 204	W1	Cracking & Chipping paint	40	No	None		None		
242	2580	1	2	203B	Primary	Classroom 204	W2	Cracking Paint, Spalling at closet	60	No	None		None		
243	2580	1	2	203B	Primary	Classroom 204	W3	Peeling paint & Damaged plaster	30	No	None		None	Yes	
244	2580	1	2	204	Primary	Classroom 204	W4	Chipping paint at some spots	5	No	None		None		
245	2580	1	2	204	Storage	Classroom 204 Storage Closet	W3	Damaged plaster, Efflorescence, Peeling paint at windows & columns	80	No	None		None	Yes	
246	2580	1	2	204A	Storage	Classroom 204 Storage Closet	W4	Cracking paint	20	No	None		None		
247	2580	1	2	204A	Primary	Classroom 205	W1	Cracking paint & Damaged plaster	50	No	None		None	Yes	
248	2580	1	2	204A	Primary	Classroom 205	W2	Minor peeling paint	5	No	None		None		
249	2580	1	2	204A	Primary	Classroom 205	W3	Peeling & Cracking paint, Efflorescence at columns	60	No	None		None	Yes	
250	2580	1	2	205	Primary	Classroom 205	W4	Cracking paint	40	No	None		None		
251	2580	1	2	205	Storage	Classroom 205 Closet	W1	No Access		No	None		None		
252	2580	1	2	205	Storage	Classroom 205 Closet	W2	No Access		No	None		None		
253	2580	1	2	205	Storage	Classroom 205 Closet	W3	No Access		No	None		None		
254	2580	1	2	205A	Storage	Classroom 205 Closet	W4	No Access		No	None		None		
255	2580	1	2	205A	Storage	Classroom 205 Closet	Ceiling	No Access		No	None		None		
256	2580	1	2	205A	Storage	Classroom 205 Closet	Floor	No Access		No	None		None		
257	2580	1	2	205A	IMC (Library)	Library	W1	Flaking paint at one spot	1	No	None		None		
258	2580	1	2	205A	IMC (Library)	Library	W3	Peeling paint at window sill, behind radiators, at left corner column, debris on window sill	85	No	None		None		
259	2580	1	2	207	Storage	Library Office	W1	No Access		No	None		None		
260	2580	1	2	207	Storage	Library Office	W2	No Access		No	None		None		
261	2580	1	2	207	Storage	Library Office	W3	No Access		No	None		None		
262	2580	1	2	207A	Storage	Library Office	W4	No Access		No	None		None		
263	2580	1	2	207A	Storage	Library Office	Ceiling	No Access		No	None		None		
264	2580	1	2	207A	Storage	Library Office	Floor	No Access		No	None		None		
265	2580	1	2	207B	Primary	Classroom 208	W1	Cracking paint	35	No	None		None		
266	2580	1	2	207B	Primary	Classroom 208	W2	Peeling & Cracking paint, hole in plaster	55	No	None		None	Yes	
267	2580	1	2	207B	Primary	Classroom 208	W3	Peeling paint on wall including column	35	No	None		None		
268	2580	1	2	208	Primary	Classroom 208	W4	Peeling & Cracking paint below blackboard	10	No	None		None		
269	2580	1	2	208	Storage	Classroom 208 Closet	W1	Minor Flaking paint	3	No	None		None		
270	2580	1	2	208	Storage	Classroom 208 Closet	W2	Severe peeling paint & debris at column	20	No	None		None		
271	2580	1	2	208	Storage	Classroom 208 Closet	W3	Peeling paint & Efflorescence at radiators	40	No	None		None		

272	2580	1	2	208A	Storage	Classroom 208 Closet	Floor	Debris	3	No	None		None		
273	2580	1	2	208A	Primary	Classroom 209	W1	Flaking paint - mostly below the blackboard	10	No	None		None		
274	2580	1	2	208A	Primary	Classroom 209	W2	Flaking paint at spots	2	No	None		None		
275	2580	1	2	208A	Primary	Classroom 209	W3	Peeling paint behind radiators, debris at far right corner window sill	15	No	None		None		
276	2580	1	2	209	Primary	Classroom 209	W4	Flaking paint below blackboard	10	No	None		None		
277	2580	1	2	209	Storage	Classroom 209 Closet	W1	Flaking paint	3	No	None		None		
278	2580	1	2	209	Storage	Classroom 209 Closet	W3	Cracking paint	1	No	None		None		
279	2580	1	2	209A	Storage	Classroom 209 Closet	W4	Severe peeling paint on wall including columns	20	No	None		None		
280	2580	1	2	209A	Primary	Classroom 210	W1	Cracking & Chipping paint		No	None		None		
281	2580	1	2	209A	Primary	Classroom 210	W2	Severe peeling paint, Cracking paint on wall and columns. Holes in plaster	80	No	None		None	Yes	
282	2580	1	2	209A	Primary	Classroom 210	W3	Peeling, Cracking, Peeling paint	30	No	None		None		
283	2580	1	2	210	Primary	Classroom 210	W4	Cracking & Flaking paint	5	No	None		None		
284	2580	1	2	210A	Storage	Storage ESOL Department	W2	Flaking paint on wall and column	10	No	None		None		
285	2580	1	2	210B	Storage	Storage ESOL Department	W4	Cracking paint	1	No	None		None		
286	2580	1	2	210B	Primary	Classroom 211	W1	Cracking paint	30	No	None		None		
287	2580	1	2	210B	Primary	Classroom 211	W2	Cracking paint	35	No	None		None		
288	2580	1	2	210B	Primary	Classroom 211	W3	Cracking paint, Damaged plaster behind radiators, Spot debris on window sill	53	No	None		None		
289	2580	1	2	211	Primary	Classroom 211	W4	Cracking paint	30	No	None		None		
290	2580	1	2	211	Primary	Classroom 211	Ceiling	Above ceiling - Severe peeling paint visible through missing tile	8	No	None		None		
291	2580	1	2	211	Storage	Classroom 211 Closet	W1	Cracking paint	20	No	None		None		
292	2580	1	2	211	Storage	Classroom 211 Closet	W2	Cracking & Chipping paint	15	No	None		None		
293	2580	1	2	211	Storage	Classroom 211 Closet	W3	Cracking, flaking, and peeling paint	50	No	None		None		
294	2580	1	2	211A	Storage	Classroom 211 Closet	W4	Cracking and peeling on wall & pipe	20	No	None		None		
295	2580	1	2	211A	Primary	Classroom 212	W1	Cracking paint	30	No	None		None		
296	2580	1	2	211A	Primary	Classroom 212	W2	Cracking paint below blackboard	50	No	None		None		
297	2580	1	2	211A	Primary	Classroom 212	W3	Damaged plaster at and behind radiators	40	No	None		None	Yes	
298	2580	1	2	212	Primary	Classroom 212	W4	Cracking paint	30	No	None		None		
299	2580	1	2	212	Storage	Classroom 212 Closet	W1	No Access		No	None		None		
300	2580	1	2	212	Storage	Classroom 212 Closet	W2	No Access		No	None		None		
301	2580	1	2	212	Storage	Classroom 212 Closet	W3	No Access		No	None		None		
302	2580	1	2	212A	Storage	Classroom 212 Closet	W4	No Access		No	None		None		
303	2580	1	2	212A	Storage	Classroom 212 Closet	Ceiling	No Access		No	None		None		

304	2580	1	2	212A	Storage	Classroom 212 Closet	Floor	No Access		No	None		None		
305	2580	1	2	212A	Student Restrooms - Male (4-12)	Boy's Restroom	W1	Severe peeling paint	50	No	None		None		
306	2580	1	2	212A	Student Restrooms - Male (4-12)	Boy's Restroom	W2	Severely damaged plaster and Efflorescence	120	No	None		None	Yes	
307	2580	1	2	212A	Student Restrooms - Male (4-12)	Boy's Restroom	W3	Severe peeling paint & Efflorescence	30	No	None		None	Yes	
308	2580	1	2	220	Student Restrooms - Male (4-12)	Boy's Restroom	W4	Peeling paint	30	No	None		None		
309	2580	1	2	220	Student Restrooms - Male (4-12)	Boy's Restroom	Ceiling	Severely damaged plaster and Efflorescence	100	No	None		None	Yes	
310	2580	1	2	220	Student Restrooms - Male (4-12)	Boy's Restroom	Floor	Debris top of urinals	50	No	None		None		
311	2580	1	2	220A	Student Restrooms - Female (4-12)	Girl's Restroom	W3	Efflorescence at window	20	No	None		None		
312	2580	1	2	221	Student Restrooms - Female (4-12)	Girl's Restroom	W4	Cracking paint & Efflorescence	30	No	None		None		
313	2580	1	2	221	Student Restrooms - Female (4-12)	Girl's Restroom	Ceiling	Damaged plaster & Efflorescence	20	No	None		None		
314	2580	1	2	221A	Student Restrooms - Female (4-12)	Custodial Closet outside Girl's Restroom	Ceiling	Peeling paint	20	No	None		None		
315	2580	1	2	221A	Teacher Lounge/Dining	Women's Restroom Lounge	W2	Efflorescence, Peeling paint at window	20	No	None		None		
316	2580	1	2	221A	Teacher Lounge/Dining	Women's Restroom Lounge	W3	Efflorescence, Peeling paint at window	10	No	None		None		
317	2580	1	2	222	Teacher Lounge/Dining	Women's Restroom Lounge	W4	Flaking paint	5	No	None		None		
318	2580	1	2	222	Teacher Lounge/Dining	Women's Restroom	W2	Efflorescence	10	No	None		None		
319	2580	1	2	222	Teacher Lounge/Dining	Women's Restroom	W3	Spalling		No	None		None		
320	2580	1	2	222A	Teacher Lounge/Dining	Women's Restroom	Ceiling	Efflorescence		No	None		None		
321	2580	1	2	H26	Circulation (Hallway)	Hallway from Classrooms 208 to 211	Floor	Baseboard	10	No	None		None		
322	2580	1	2	H26	Circulation (Hallway)	Hallway in Front of Library	W2	Damaged plaster	25	No	None		None	Yes	
323	2580	1	2	H26	Circulation (Hallway)	Hallway in Front of Library	W3			No	None		None		
324	2580	1	2	H27	Circulation (Hallway)	Hallway in Front of Library	W4	Damaged plaster	25	No	None		None	Yes	
325	2580	1	2	H27	Circulation (Hallway)	Hallway in Front of Library	Floor	Peeling paint at baseboard	50	No	None		None		
326	2580	1	2	H27	Circulation (Hallway)	Hallway from Classrooms 201 to 204	W1	-		No	None		None		
327	2580	1	2	H27	Circulation (Hallway)	Hallway from Classrooms 201 to 204	W3	-		No	None		None		
328	2580	1	2	H28	Circulation (Hallway)	Hallway from Classrooms 201 to 204	Floor	Peeling at baseboard	100	No	None		None		

329	2580	1	2	H28	Stairs	Stairwell at Classroom 208	W1	-		No	None		None		
330	2580	1	2	H28	Stairs	Stairwell at Classroom 208	W2	Damaged plaster, peeling paint on 2nd floor and middle landing	10	No	None		None		
331	2580	1	2	S21	Stairs	Stairwell at Classroom 208	W4	Damaged plaster at middle landing, Peeling paint on 2nd floor	15	No	None		None		
332	2580	1	2	S21	Stairs	Stairwell at Classroom 208	Ceiling	Under stairs & middle landing	50	No	None		None		
333	2580	1	2	S21	Stairs	Stairwell at Classroom 208	Floor	Baseboard	30	No	None		None		
334	2580	1	2	S21	Stairs	Stairwell at Classroom 204	W1	-		No	None		None		
335	2580	1	2	S21	Stairs	Stairwell at Classroom 204	W2	Severe peeling paint	10	No	None		None		
336	2580	1	2	S21	Stairs	Stairwell at Classroom 204	W3	-		No	None		None		
337	2580	1	2	S26	Stairs	Stairwell at Classroom 204	W4	Peeling paint	5	No	None		None		
338	2580	1	2	S26	Stairs	Stairwell at Classroom 204	Ceiling	Severe peeling paint, Middle landing	35	No	None		None		
339	2580	1	2	S28	Stairs	Fire Tower near Classroom 203	Floor	Debris	30	No	None		None		
340	2580	1	2	S28	Stairs	Fire Tower walkway near Classroom 203	W3	Peeling paint at pipe	12	No	None		None		
341	2580	1	2	S28	Stairs	Fire Tower near Classroom 203	Ceiling	Peeling paint	100	No	None		None		
342	2580	1	2	S28A	Stairs	Fire Tower walkway near Classroom 203	Ceiling	Severe peeling paint, Damaged plaster	100	No	None		None	Yes	
343	2580	1	2	S28A	Primary	Classroom 301	W1	Peeling paint	20	No	None		None		
344	2580	1	2	S28A	Primary	Classroom 301	W2	Peeling paint	30	No	None		None		
345	2580	1	2	S28A	Primary	Classroom 301	W3	Cracking paint	4	No	None		None		
346	2580	1	3	301	Primary	Classroom 301	W4	Cracking & Chipping paint	30	No	None		None		
347	2580	1	3	301	Storage	Classroom 301 Closet	W1	No Access		No	None		None		
348	2580	1	3	301	Storage	Classroom 301 Closet	W2	No Access		No	None		None		
349	2580	1	3	301	Storage	Classroom 301 Closet	W3	No Access		No	None		None		
350	2580	1	3	301A	Storage	Classroom 301 Closet	W4	No Access (Severe peeling paint on wall and pipe by window - seen through the door)	40	No	None		None		
351	2580	1	3	301A	Storage	Classroom 301 Closet	Ceiling	No Access		No	None		None		
352	2580	1	3	301A	Storage	Classroom 301 Closet	Floor	No Access		No	None		None		
353	2580	1	3	301A	Primary	Classroom 302	W1	Severe peeling paint & Efflorescence	100	No	None		None		
354	2580	1	3	301A	Primary	Classroom 302	W2	Peeling & Cracking paint	10	No	None		None		
355	2580	1	3	301A	Primary	Classroom 302	W3	Cracking paint	15	No	None		None		
356	2580	1	3	302	Primary	Classroom 302	W4	Cracking paint	30	No	None		None		
357	2580	1	3	302	Primary	Classroom 302	Ceiling	Above ceiling - Severe peeling paint & damaged plaster visible through missing tile	20	No	None		None		
358	2580	1	3	302	Primary	Classroom 302	Floor	Debris	10	No	None		None		
359	2580	1	3	302	Storage	Classroom 302 Closet	W1	No Access		No	None		None		

360	2580	1	3	302	Storage	Classroom 302 Closet	W2	No Access		No	None		None		
361	2580	1	3	302	Storage	Classroom 302 Closet	W3	No Access		No	None		None		
362	2580	1	3	302A	Storage	Classroom 302 Closet	W4	No Access		No	None		None		
363	2580	1	3	302A	Storage	Classroom 302 Closet	Ceiling	No Access		No	None		None		
364	2580	1	3	302A	Storage	Classroom 302 Closet	Floor	No Access		No	None		None		
365	2580	1	3	302A	Primary	Classroom 303	W1	Cracking & Chipping paint	20	No	None		None		
366	2580	1	3	302A	Primary	Classroom 303	W2	Cracking & Chipping paint	20	No	None		None		
367	2580	1	3	302A	Primary	Classroom 303	W3	Severe peeling paint & damaged plaster	30	No	None		None	Yes	
368	2580	1	3	303	Primary	Classroom 303	W4	Cracking & peeling paint	40	No	None		None		
369	2580	1	3	303	Storage	Classroom 303 Closet	W1	Cracking paint	5	No	None		None		
370	2580	1	3	303	Storage	Classroom 303 Closet	W3	Exposed damaged plaster at coat hanger	10	No	None		None		
371	2580	1	3	303A	Storage	Classroom 303 Closet	W1	No Access		No	None		None		
372	2580	1	3	303A	Storage	Classroom 303 Closet	W2	No Access		No	None		None		
373	2580	1	3	303A	Storage	Classroom 303 Closet	W3	No Access		No	None		None		
374	2580	1	3	303B	Storage	Classroom 303 Closet	W4	No Access		No	None		None		
375	2580	1	3	303B	Storage	Classroom 303 Closet	Ceiling	No Access		No	None		None		
376	2580	1	3	303B	Storage	Classroom 303 Closet	Floor	No Access		No	None		None		
377	2580	1	3	303B	Primary	Classroom 304	W1	Cracking & Flaking paint	125	No	None		None		
378	2580	1	3	303B	Primary	Classroom 304	W2	Cracking & Flaking paint	70	No	None		None		
379	2580	1	3	303B	Primary	Classroom 304	W3	Cracking paint at columns	40	No	None		None		
380	2580	1	3	304	Primary	Classroom 304	W4	Cracking & Flaking paint	60	No	None		None		
381	2580	1	3	304	Storage	Classroom 304 Closet	W1	No Access		No	None		None		
382	2580	1	3	304	Storage	Classroom 304 Closet	W2	No Access		No	None		None		
383	2580	1	3	304	Storage	Classroom 304 Closet	W3	No Access		No	None		None		
384	2580	1	3	304A	Storage	Classroom 304 Closet	W4	No Access		No	None		None		
385	2580	1	3	304A	Storage	Classroom 304 Closet	Ceiling	No Access		No	None		None		
386	2580	1	3	304A	Storage	Classroom 304 Closet	Floor	No Access		No	None		None		
387	2580	1	3	304A	Primary	Classroom 305	W1	Cracking paint	20	No	None		None		
388	2580	1	3	304A	Primary	Classroom 305	W2	-		No	None		None		
389	2580	1	3	304A	Primary	Classroom 305	W3	Cracking paint, damaged plaster at column	15	No	None		None		
390	2580	1	3	305	Primary	Classroom 305	W4	Cracking & Flaking paint	20	No	None		None		
391	2580	1	3	305	Storage	Classroom 305 Closet	W2	Flaking paint at spots	5	No	None		None		
392	2580	1	3	305A	Primary	Classroom 306	W1	Cracking paint	3	No	None		None		
393	2580	1	3	305A	Primary	Classroom 306	W2	Cracking paint	3	No	None		None		

394	2580	1	3	306	Primary	Classroom 306	W4	-		No	None		None		
395	2580	1	3	306A	Storage	Classroom 306 Closet	W4	Cracking paint	10	No	None		None		
396	2580	1	3	306A	Storage	Classroom 306 Closet	W2	Cracking paint at column	10	No	None		None		
397	2580	1	3	306B	Primary	Classroom 307	W1	Cracking paint	30	No	None		None		
398	2580	1	3	306B	Primary	Classroom 307	W2	Cracking paint	50	No	None		None		
399	2580	1	3	306B	Primary	Classroom 307	W3	Cracking paint at columns	40	No	None		None		
400	2580	1	3	307	Primary	Classroom 307	W4	Cracking paint	30	No	None		None		
401	2580	1	3	307	Storage	Classroom 307 Closet	W1	Peeling paint	5	No	None		None		
402	2580	1	3	307	Storage	Classroom 307 Closet	W2	Peeling paint	20	No	None		None		
403	2580	1	3	307A	Storage	Classroom 307 Closet	W4	Peeling paint	5	No	None		None		
404	2580	1	3	307A	Primary	Classroom 308	W1	Cracking & Chipping paint	10	No	None		None		
405	2580	1	3	307A	Primary	Classroom 308	W2	Cracking & peeling paint	20	No	None		None		
406	2580	1	3	307A	Primary	Classroom 308	W3	Cracking, flaking, and peeling paint	30	No	None		None		
407	2580	1	3	308	Primary	Classroom 308	W4	Cracking paint	20	No	None		None		
408	2580	1	3	308	Storage	Classroom 308 Closet	W1	Cracking paint	20	No	None		None		
409	2580	1	3	308	Storage	Classroom 308 Closet	W2	Severe peeling paint & Cracking paint	40	No	None		None		
410	2580	1	3	308	Storage	Classroom 308 Closet	W3	Severe peeling paint, Efflorescence at window	50	No	None		None	Yes	
411	2580	1	3	308A	Storage	Classroom 308 Closet	Ceiling	Tiles are badly damaged		No	None		None		
412	2580	1	3	308A	Primary	Classroom 309	W1	Flaking & peeling paint	15	No	None		None		
413	2580	1	3	308A	Primary	Classroom 309	W2	Cracking paint	25	No	None		None		
414	2580	1	3	308A	Primary	Classroom 309	W3	Peeling paint behind radiators, and at columns	30	No	None		None		
415	2580	1	3	309	Primary	Classroom 309	W4	Cracking & peeling paint	30	No	None		None		
416	2580	1	3	309	Storage	Classroom 309 Closet	W1	No Access		No	None		None		
417	2580	1	3	309	Storage	Classroom 309 Closet	W2	No Access		No	None		None		
418	2580	1	3	309	Storage	Classroom 309 Closet	W3	No Access		No	None		None		
419	2580	1	3	309A	Storage	Classroom 309 Closet	W4	No Access (Severe peeling paint on wall and pipe by window - seen through the door)	30	No	None		None		
420	2580	1	3	309A	Storage	Classroom 309 Closet	Ceiling	No Access		No	None		None		
421	2580	1	3	309A	Storage	Classroom 309 Closet	Floor	No Access		No	None		None		
422	2580	1	3	309A	Primary	Classroom 310	W1	Cracking & peeling paint	70	No	None		None		
423	2580	1	3	309A	Primary	Classroom 310	W2	Cracking & peeling paint	70	No	None		None		
424	2580	1	3	309A	Primary	Classroom 310	W3	Cracking & peeling paint	80	No	None		None		
425	2580	1	3	310	Primary	Classroom 310	W4	Cracking & peeling paint including plenums	100	No	None		None		
426	2580	1	3	310	Primary	Classroom 310	Ceiling	Peeling paint at stage ceiling	25	No	None		None		
427	2580	1	3	310	Storage	Classroom 310 Closet	W1	No Access		No	None		None		
428	2580	1	3	310	Storage	Classroom 310 Closet	W2	No Access (Efflorescence, Damaged plaster, Flaking paint - seen through the door)	60	No	None		None	Yes	

460	2580	1	3	320	Student Restrooms - Female (4-12)	Girl's Restroom	W4	Severely peeling paint	80	No	None		None		
461	2580	1	3	320	Student Restrooms - Female (4-12)	Girl's Restroom	Ceiling	Severely peeling paint	60	No	None		None		
462	2580	1	3	320A	Student Restrooms - Male (4-12)	Boy's Restroom	W1	Peeling paint	10	No	None		None		
463	2580	1	3	320A	Student Restrooms - Male (4-12)	Boy's Restroom	W2	Peeling paint	10	No	None		None		
464	2580	1	3	320A	Student Restrooms - Male (4-12)	Boy's Restroom	W3	Peeling paint	10	No	None		None		
465	2580	1	3	321	Student Restrooms - Male (4-12)	Boy's Restroom	W4	Peeling paint	10	No	None		None		
466	2580	1	3	321	Student Restrooms - Male (4-12)	Boy's Restroom	Ceiling	Peeling paint	40	No	None		None		
467	2580	1	3	321	Student Restrooms - Male (4-12)	Boy's Restroom	Floor	Peeling paint	20	No	None		None		
468	2580	1	3	321A	Restrooms, Staff - Male	Men's Restroom Lounge	W3	Flaking paint behind pipe	6	No	None		None		
469	2580	1	3	322	Restrooms, Staff - Female	Men's Restroom	W1	Cracking paint	5	No	None		None		
470	2580	1	3	322	Restrooms, Staff - Female	Men's Restroom	W2	Cracking paint	5	No	None		None		
471	2580	1	3	322	Restrooms, Staff - Female	Men's Restroom	W3	Cracking paint	5	No	None		None		
472	2580	1	3	322A	Restrooms, Staff - Female	Men's Restroom	W4	Cracking paint	5	No	None		None		
473	2580	1	3	322A	Circulation (Hallway)	Hallway from Classrooms 305 to 307	W1	Peeling & flaking paint	50	No	None		None		
474	2580	1	3	322A	Circulation (Hallway)	Hallway from Classrooms 305 to 307	W2	-		No	None		None		
475	2580	1	3	322A	Circulation (Hallway)	Hallway from Classrooms 305 to 307	W3	Cracking paint on wall including behind radiators	100	No	None		None		
476	2580	1	3	H310	Circulation (Hallway)	Hallway from Classrooms 305 to 307	W4	-		No	None		None		
477	2580	1	3	H310	Circulation (Hallway)	Hallway from Classrooms 305 to 307	Floor	Baseboard	10	No	None		None		
478	2580	1	3	H310	Circulation (Hallway)	Hallway from Classrooms 301 to 304	W1	Efflorescence & damaged plaster at the arch by fire tower	5	No	None		None	Yes	
479	2580	1	3	H310	Circulation (Hallway)	Hallway from Classrooms 301 to 304	W2	Severe peeling paint by stairwell	20	No	None		None		
480	2580	1	3	H310	Circulation (Hallway)	Hallway from Classrooms 301 to 304	W3	-	10	No	None		None		
481	2580	1	3	H311	Circulation (Hallway)	Hallway from Classrooms 301 to 304	W4	Damaged plaster at room 303	40	No	None		None		
482	2580	1	3	H311	Circulation (Hallway)	Hallway from Classrooms 301 to 304	Floor	Baseboard	30	No	None		None		

483	2580	1	3	H311	Circulation (Hallway)	Hallway from Classrooms 308 to 311	W1	Flaking paint	5	No	None		None		
484	2580	1	3	H311	Circulation (Hallway)	Hallway from Classrooms 308 to 311	W2	Severe peeling paint & flaking paint by 311	20	No	None		None		
485	2580	1	3	H311	Circulation (Hallway)	Hallway from Classrooms 308 to 311	W3	Damaged plaster at room 312, Cracking paint	10	No	None		None	Yes	
486	2580	1	3	H39	Circulation (Hallway)	Hallway from Classrooms 308 to 311	W4	Cracking paint	40	No	None		None		
487	2580	1	3	H39	Circulation (Hallway)	Hallway from Classrooms 308 to 311	Floor	Baseboard	30	No	None		None		
488	2580	1	3	H39	Stairs	Stairwell next to Classroom 308	W1	Peeling & flaking paint by windows and radiators	30	No	None		None		
489	2580	1	3	H39	Stairs	Stairwell next to Classroom 308	W2	Cracking paint	10	No	None		None		
490	2580	1	3	H39	Stairs	Stairwell next to Classroom 308	W3	Cracking paint	10	No	None		None		
491	2580	1	3	S31	Stairs	Stairwell next to Classroom 308	W4	Cracking paint	30	No	None		None		
492	2580	1	3	S31	Stairs	Stairwell next to Classroom 308	Ceiling	Peeling paint	30	No	None		None		
493	2580	1	3	S31	Stairs	Stairwell next to Classroom 308	Floor	Baseboard	20	No	None		None		
494	2580	1	3	S31	Stairs	Stairwell next to Classroom 304	W1	-		No	None		None		
495	2580	1	3	S31	Stairs	Stairwell next to Classroom 304	W2	Peeling paint	10	No	None		None		
496	2580	1	3	S31	Stairs	Stairwell next to Classroom 304	W3	-		No	None		None		
497	2580	1	3	S36	Stairs	Stairwell next to Classroom 304	W4	Peeling paint	20	No	None		None		
498	2580	1	3	S36	Stairs	Stairwell next to Classroom 304	Ceiling	Peeling paint	15	No	None		None		
499	2580	1	3	S36	Stairs	Fire Tower next to Classroom 303	W1	Peeling paint	10	No	None		None		
500	2580	1	3	S36	Stairs	Fire Tower next to Classroom 303	W2	Peeling paint, & damaged plaster at window	20	No	None		None		
501	2580	1	3	S36	Stairs	Fire Tower next to Classroom 303	W3	Peeling paint	20	No	None		None		
502	2580	1	3	S38	Stairs	Fire Tower next to Classroom 303	W4	Peeling paint	10	No	None		None		
503	2580	1	3	S38	Stairs	Fire Tower next to Classroom 303	Ceiling	Severe peeling paint	15	No	None		None		
504	2580	1	3	S38	Stairs	Fire Tower next to Classroom 303	Floor	Debris	3	No	Floor	3	None		
505	2580	1	3	S38	Stairs	Fire Tower walkway next to Classroom 303	W3	Damaged plaster & peeling paint	30	No	None		None		
506	2580	1	3	S38A	Stairs	Fire Tower walkway next to Classroom 303	Ceiling	Peeling paint	10	No	None		None		

507	2580	1	3	S38A	Gymnasium - Intermediate Middle	Gymnasium	W1	Cracking & Peeling paint	50	No	None		None		
508	2580	1	3	S38A	Gymnasium - Intermediate Middle	Gymnasium	W2	Cracking & Peeling paint	150	No	None		None		
509	2580	1	3	S38A	Gymnasium - Intermediate Middle	Gymnasium	W3	Cracking & Peeling paint	50	No	None		None		
510	2580	1	B	1	Gymnasium - Intermediate Middle	Gymnasium	W4	Cracking & Peeling paint	100	No	None		None		
511	2580	1	B	1	Gymnasium - Intermediate Middle	Gymnasium	Ceiling	Severe peeling paint including ductwork & beams	1200	No	None		None		
512	2580	1	B	1	Gymnasium - Intermediate Middle	Gymnasium	Floor	Debris along windows & chair	20	No	Chair	4	None		
513	2580	1	B	1	Administrative Office	Gymnasium Office	W1	Peeling & flaking paint	30	No	None		None		
514	2580	1	B	1	Administrative Office	Gymnasium Office	W2	Efflorescence, Severe Peeling & flaking paint	80	No	None		None	Yes	
515	2580	1	B	1	Administrative Office	Gymnasium Office	W3	Efflorescence, Severe Peeling & flaking paint	100	No	None		None	Yes	
516	2580	1	B	001A	Administrative Office	Gymnasium Office	W4	Peeling & flaking paint	20	No	None		None		
517	2580	1	B	001A	Administrative Office	Gymnasium Office	Ceiling	Severe peeling & flaking paint	120	No	None		None		
518	2580	1	B	001A	Restrooms, Staff - Male/Female	Gymnasium Office Teacher's Restroom	W1	Cracking paint	5	No	None		None		
519	2580	1	B	001A	Restrooms, Staff - Male/Female	Gymnasium Office Teacher's Restroom	W2	Cracking paint	5	No	None		None		
520	2580	1	B	001A	Restrooms, Staff - Male/Female	Gymnasium Office Teacher's Restroom	W3	Cracking paint	5	No	None		None		
521	2580	1	B	001C	Restrooms, Staff - Male/Female	Gymnasium Office Teacher's Restroom	W4	Cracking paint	5	No	None		None		
522	2580	1	B	001C	Restrooms, Staff - Male/Female	Gymnasium Office Teacher's Restroom	Ceiling	Severe peeling paint including ductwork	80	No	None		None		
523	2580	1	B	001C	Restrooms, Staff - Male/Female	Gymnasium Office Teacher's Restroom	Floor	Severe peeling paint	30	No	None		None		
524	2580	1	B	001C	Storage	Gymnasium Storage closet at the far along Room 015	W1	Efflorescence & Severe peeling paint	80	No	None		None		
525	2580	1	B	001C	Storage	Gymnasium Storage closet at the far along Room 015	W2	Efflorescence & Severe peeling paint	100	No	None		None		
526	2580	1	B	001C	Storage	Gymnasium Storage closet at the far along Room 015	W3	Efflorescence & Severe peeling paint	120	No	None		None		
527	2580	1	B	001B	Storage	Gymnasium Storage closet at the far along Room 015	W4	Efflorescence & Severe peeling paint	50	No	None		None		
528	2580	1	B	001B	Storage	Gymnasium Storage closet at the far along Room 015	Ceiling	Severely damaged plaster, Peeling & flaking paint including ductwork	200	No	None		None	Yes	
529	2580	1	B	001B	Storage	Gymnasium Storage closet at the far along Room 015	Floor	Debris on electrical components & chair	200	No	Electrical components & chair	45	None		
530	2580	1	B	001B	Storage	Gymnasium Storage Room	W1	Peeling & flaking paint	20	No	None		None		
531	2580	1	B	001B	Storage	Gymnasium Storage Room	W2	Peeling paint, flaking paint including pipes and window frame	80	No	None		None		

532	2580	1	B	001B	Storage	Gymnasium Storage Room	W3	Cracking paint	5	No	None		None		
533	2580	1	B	2	Storage	Gymnasium Storage Room	W4	Peeling & flaking paint by the door	20	No	None		None		
534	2580	1	B	2	Storage	Gymnasium Storage Room	Ceiling	Severe peeling paint, flaking paint including on ductwork	150	No	None		None		
535	2580	1	B	2	Storage	Gymnasium Storage Room	Floor	Debris on floor and maintenance supplies	200	No	Maintenance supplies	100	None		
536	2580	1	B	4	Student Restrooms - Female (4-12)	Girl's Restroom	W1	Severe peeling paint	30	No	None		None		
537	2580	1	B	4	Student Restrooms - Female (4-12)	Girl's Restroom	W2	Severe peeling paint	50	No	None		None		
538	2580	1	B	4	Student Restrooms - Female (4-12)	Girl's Restroom	W3	Severe peeling paint	50	No	None		None		
539	2580	1	B	5	Student Restrooms - Female (4-12)	Girl's Restroom	W4	Severe peeling paint	15	No	None		None		
540	2580	1	B	5	Student Restrooms - Female (4-12)	Girl's Restroom	Ceiling	Severe peeling paint including radiators	400	No	None		None		
541	2580	1	B	5	Student Restrooms - Female (4-12)	Girl's Restroom	Floor	Debris and peeling paint on baseboard	40	No	None		None		
542	2580	1	B	5	Student Restrooms - Male (4-12)	Boy's Restroom	W1	Severe peeling paint	100	No	None		None		
543	2580	1	B	5	Student Restrooms - Male (4-12)	Boy's Restroom	W2	Severe peeling paint	100	No	None		None		
544	2580	1	B	5	Student Restrooms - Male (4-12)	Boy's Restroom	W3	Severe peeling paint	100	No	None		None		
545	2580	1	B	6	Student Restrooms - Male (4-12)	Boy's Restroom	W4	Severe peeling paint	50	No	None		None		
546	2580	1	B	6	Student Restrooms - Male (4-12)	Boy's Restroom	Ceiling	Severe peeling paint including radiators	600	No	None		None		
547	2580	1	B	6	Student Restrooms - Male (4-12)	Boy's Restroom	Floor	Debris	150	No	None		None		
548	2580	1	B	007B	Storage	Storage Closet in Hallway across Engineer's Office	W1	Peeling paint on pipe	20	No	None		None		
549	2580	1	B	007B	Storage	Storage Closet in Hallway across Engineer's Office	W2	Peeling paint on wall, columns, and pipe	55	No	None		None		
550	2580	1	B	007B	Storage	Storage Closet in Hallway across Engineer's Office	W3	Peeling paint on wall and pipe	30	No	None		None		
551	2580	1	B	8	Storage	Storage Closet in Hallway across Engineer's Office	W4	Peeling paint	5	No	None		None		
552	2580	1	B	8	Storage	Storage Closet in Hallway across Engineer's Office	Floor	Peeling paint	20	No	None		None		
553	2580	1	B	8	Storage	Former Engineer's Office	W1	Cracking paint	20	No	None		None		
554	2580	1	B	8	Storage	Former Engineer's Office	W2	Cracking paint	50	No	None		None		
555	2580	1	B	8	Storage	Former Engineer's Office	W3	Cracking paint	30	No	None		None		
556	2580	1	B	9	Storage	Former Engineer's Office	W4	Cracking paint	50	No	None		None		

557	2580	1	B	9	Storage	Former Engineer's Office	Ceiling	Cracking, peeling, and flaking paint	100	No	None		None		
558	2580	1	B	11	Cafeteria (Dining Area)	Kitchen/Cafeteria with Walk-in Freezer	W1	Cracking, peeling, and flaking paint	80	No	None		None		
559	2580	1	B	11	Cafeteria (Dining Area)	Kitchen/Cafeteria with Walk-in Freezer	W2	Cracking, peeling, and flaking paint	30	No	None		None		
560	2580	1	B	11	Cafeteria (Dining Area)	Kitchen/Cafeteria with Walk-in Freezer	W3	Cracking paint	10	No	None		None		
561	2580	1	B	12	Cafeteria (Dining Area)	Kitchen/Cafeteria with Walk-in Freezer	W4	Cracking paint	10	No	None		None		
562	2580	1	B	12	Cafeteria (Dining Area)	Kitchen/Cafeteria with Walk-in Freezer	Ceiling	peeling paint	150	No	None		None		
563	2580	1	B	12	Cafeteria (Dining Area)	Kitchen/Cafeteria with Walk-in Freezer	Floor	peeling paint including baseboard	70	No	None		None		
564	2580	1	B	12	Kitchen	Storage between Lunch Rooms	W1	No Access							
565	2580	1	B	12	Kitchen	Storage between Lunch Rooms	W2	No Access							
566	2580	1	B	12	Kitchen	Storage between Lunch Rooms	W3	No Access							
567	2580	1	B	012A	Kitchen	Storage between Lunch Rooms	W4	No Access							
568	2580	1	B	012A	Kitchen	Storage between Lunch Rooms	Ceiling	No Access							
569	2580	1	B	012A	Kitchen	Storage between Lunch Rooms	Floor	No Access							
570	2580	1	B	012A	Circulation (Hallway)	Hallway between Lunch Rooms	W1	Cracking paint	15	No	None		None		
571	2580	1	B	012A	Circulation (Hallway)	Hallway between Lunch Rooms	W2	Cracking paint	20	No	None		None		
572	2580	1	B	012A	Circulation (Hallway)	Hallway between Lunch Rooms	W3	Cracking paint	10	No	None		None		
573	2580	1	B	13	Circulation (Hallway)	Hallway between Lunch Rooms	W4	Cracking paint	15	No	None		None		
574	2580	1	B	13	Circulation (Hallway)	Hallway between Lunch Rooms	Ceiling	Peeling paint	20	No	None		None		
575	2580	1	B	13	Cafeteria (Dining Area)	Cafeteria	W1	Cracking & flaking paint	20	No	None		None		
576	2580	1	B	13	Cafeteria (Dining Area)	Cafeteria	W3	Damaged plaster, Efflorescence, severe peeling paint, and cracking paint	120	No	None		None	Yes	
577	2580	1	B	14	Cafeteria (Dining Area)	Cafeteria	W4	flaking paint underneath the shelf	12	No	None		None		
578	2580	1	B	14	Cafeteria (Dining Area)	Cafeteria	Floor	flaking paint	350	No	None		None		
579	2580	1	B	14	Primary	Art Room	W1	Severe peeling paint near window	10	No	None		None		
580	2580	1	B	14	Primary	Art Room	W2	Peeling paint near middle column	10	No	None		None		
581	2580	1	B	14	Primary	Art Room	W3	Efflorescence & severe peeling paint	15	No	None		None	Yes	
582	2580	1	B	15	Primary	Art Room	W4	Peeling & flaking paint	30	No	None		None		
583	2580	1	B	15	Storage	Art Room Large Storage Closet	W1	Cracking paint, damaged plaster	30	No	None		None	Yes	
584	2580	1	B	15	Storage	Art Room Large Storage Closet	W3	Efflorescence & severe peeling paint	60	No	None		None	Yes	
585	2580	1	B	15A	Storage	Art Room Large Storage Closet	W4	Severe peeling paint	30	No	None		None		

586	2580	1	B	15A	Storage	Art Room Small Storage Closet	W1	Cracking paint	30	No	None		None		
587	2580	1	B	15A	Storage	Art Room Small Storage Closet	W2	Severe peeling paint	50	No	None		None		
588	2580	1	B	15A	Storage	Art Room Small Storage Closet	W3	Severe peeling paint	60	No	None		None		
589	2580	1	B	15B	Storage	Art Room Small Storage Closet	Ceiling	Peeling paint	20	No	None		None		
590	2580	1	B	15B	Circulation (Hallway)	Hallway by the Gym	W1	Severe peeling paint & flaking paint	200	No	None		None		
591	2580	1	B	15B	Circulation (Hallway)	Hallway by the Gym	W2	Severe peeling paint & flaking paint	100	No	None		None		
592	2580	1	B	15B	Circulation (Hallway)	Hallway by the Gym	W3	Severe peeling paint & flaking paint	200	No	None		None		
593	2580	1	B	H01	Circulation (Hallway)	Hallway by the Gym	W4	Severe peeling paint & flaking paint	100	No	None		None		
594	2580	1	B	H01	Circulation (Hallway)	Hallway by the Gym	Ceiling	Severe peeling paint & flaking paint including ductwork and pipes	400	No	None		None		
595	2580	1	B	H01	Circulation (Hallway)	Hallway by the Gym	Floor	Baseboard	30	No	None		None		
596	2580	1	B	H01	Circulation (Hallway)	Storage area in Hallway by the Gym	W1	Severe peeling paint & flaking paint	30	No	None		None		
597	2580	1	B	H01	Circulation (Hallway)	Storage area in Hallway by the Gym	W2	Severe peeling paint & flaking paint	5	No	None		None		
598	2580	1	B	H01	Circulation (Hallway)	Storage area in Hallway by the Gym	W3	Severe peeling paint & flaking paint	30	No	None		None		
599	2580	1	B	H01A	Circulation (Hallway)	Storage area in Hallway by the Gym	W4	Severe peeling paint & flaking paint	30	No	None		None		
600	2580	1	B	H01A	Circulation (Hallway)	Hallway by the Building Engineer's Office and the Boy's and Girl's Restrooms	W2	Cracking paint	100	No	None		None		
601	2580	1	B	H01A	Circulation (Hallway)	Hallway by the Building Engineer's Office and the Boy's and Girl's Restrooms	W3	Peeling paint on electrical conduit by stairs	6	No	None		None		
602	2580	1	B	H02	Circulation (Hallway)	Hallway by the Building Engineer's Office and the Boy's and Girl's Restrooms	W4	Cracking, peeling, and flaking paint	100	No	None		None		
603	2580	1	B	H02	Circulation (Hallway)	Hallway by the Building Engineer's Office and the Boy's and Girl's Restrooms	Ceiling	Peeling & flaking paint	50	No	None		None		
604	2580	1	B	H02	Circulation (Hallway)	Hallway by the Building Engineer's Office and the Boy's and Girl's Restrooms	Floor	Baseboard	20	No	None		None		
605	2580	1	B	H02	Stairs	Stairwell between the Cafeteria and Art Room	W1	Peeling paint above entrance	15	No	None		None		

Appendix B. EPA Checklist Table

Table with columns for ID, Room, Storage, Art Room, W#, Peeling & flaking paint, and various inspection criteria. Rows include details for rooms 582 through 615, covering areas like Art Rooms, Stairwells, and Restrooms, with various notes on paint conditions and inspection results.

Appendix C. Oversight Table

101	2580	1	1	110A	Storage	Classroom 110 Storage Closet	W3	No access (severe peeling paint could be seen through the door)	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	
102	2580	1	1	110B	Storage	Classroom 110 Storage Closet	W4	No access (severe peeling paint could be seen through the door)	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above
103	2580	1	1	110B	Storage	Classroom 110 Storage Closet	Ceiling	No access	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above
104	2580	1	1	110B	Storage	Classroom 110 Storage Closet	Floor	No access	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above
105	2580	1	1	110B	Primary	Classroom 110	W1	Cracking & Peeling paint	8/7/2018	8/7/2018	8/8/2018	8/17/2018		8/17/2018	150	4	1	1	<20 ug/ft2	Colometric and Flame AA passed			
106	2580	1	1	110B	Primary	Classroom 110	W2	Severe peeling paint & Efflorescence	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above
107	2580	1	1	110B	Primary	Classroom 110	W3	Cracking & Peeling paint	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above
108	2580	1	1	110	Primary	Classroom 110	W4	Cracking paint	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above
109	2580	1	1	110	Primary	Classroom 110	Ceiling	Cracking paint at stage ceiling	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above
110	2580	1	1	110	Administrative Office	Principal's Office	W1	Peeling paint at column	Prior	Prior	8/11/2018	8/13/2018	8/17/2018	8/17/2018	150	4	1	1	<20 ug/ft2	Flame Passed			
111	2580	1	1	110	Administrative Office	Principal's Office	W2	Severe peeling paint	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above
112	2580	1	1	110	Administrative Office	Principal's Office	W3	Severe peeling paint behind computer desk	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above
113	2580	1	1	111A	Administrative Office	Principal's Office	W4	Cracking, Chipping, and peeling paint	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above
114	2580	1	1	111A	Restrooms, Staff - Male/Female	Principal's Office Restroom	W1	Cracking paint	Prior	Prior	8/9/2018	8/11/2018		8/11/2018	80	2	1	1	<20 ug/ft2	Colometric and FLame AA passed			
115	2580	1	1	111A	Restrooms, Staff - Male/Female	Principal's Office Restroom	W2	Cracking paint	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above
116	2580	1	1	111A	Restrooms, Staff - Male/Female	Principal's Office Restroom	W3	Cracking paint	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above
117	2580	1	1	111B	Restrooms, Staff - Male/Female	Principal's Office Restroom	W4	Cracking paint	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above
118	2580	1	1	111B	Restrooms, Staff - Male/Female	Principal's Office Restroom	Ceiling	Cracking paint	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above
119	2580	1	1	111C	Administrative Office	Main Office	W1	Cracking & Chipping paint	Prior	Prior	8/9/2018	8/11/2018		8/11/2018	153	4	1	1	<20 ug/ft2	Colometric submitted for Flame analysis 8/11/2018			
120	2580	1	1	111C	Administrative Office	Main Office	W2	Cracking & Peeling paint	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above
121	2580	1	1	111C	Administrative Office	Main Office	W3	Peeling paint	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above
122	2580	1	1	111	Administrative Office	Main Office	W4	Cracking paint & hole in plaster	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above
123	2580	1	1	111	Administrative Office	Conference Room	W1	Severe peeling paint on door	Prior	Prior	8/15/2018	8/17/2018		8/17/2018	40	1	1	1	<20 ug/ft2	Colometric submitted for Flame analysis and both passed			
124	2580	1	1	111	Administrative Office	Conference Room	W2	Peeling paint	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above
125	2580	1	1	111	Administrative Office	Conference Room	W3	Peeling paint around windows	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above
126	2580	1	1	112	Administrative Office	Conference Room	W4	Peeling paint & Damaged plaster	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above
127	2580	1	1	112	Administrative Office	Conference Room	Floor	Baseboard	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above
128	2580	1	1	112	Administrative Office	Conference Room Restroom	W1	Severe peeling paint on door	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above
129	2580	1	1	112	Administrative Office	Conference Room Restroom	W2	Peeling paint	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above
130	2580	1	1	112	Administrative Office	Conference Room Restroom	W3	Peeling paint	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above
131	2580	1	1	112A	Storage	Main Office Closet on the left side	Ceiling	Peeling paint	No visible damage	No visible damage	No visible damage	No visible damage	No visible damage	No visible damage	No visible damage	No visible damage	No visible damage	No visible damage	No visible damage	No visible damage	No visible damage	No visible damage	No visible damage
132	2580	1	1	112A	Storage	Main Office Closet/File Room on the right side	W1	Peeling paint	No visible damage	No visible damage	No visible damage	No visible damage	No visible damage	No visible damage	No visible damage	No visible damage	No visible damage	No visible damage	No visible damage	No visible damage	No visible damage	No visible damage	No visible damage
133	2580	1	1	112A	Storage	Main Office Closet/File Room on the right side	W2	Severe peeling paint	No visible damage	No visible damage	No visible damage	No visible damage	No visible damage	No visible damage	No visible damage	No visible damage	No visible damage	No visible damage	No visible damage	No visible damage	No visible damage	No visible damage	No visible damage
134	2580	1	1	112C	Administrative Office	Main Office Copy Room	W1	Severe peeling paint	No visible damage	No visible damage	No visible damage	No visible damage	No visible damage	No visible damage	No visible damage	No visible damage	No visible damage	No visible damage	No visible damage	No visible damage	No visible damage	No visible damage	No visible damage
135	2580	1	1	112C	Administrative Office	Main Office Copy Room	W2	Cracking paint	No visible damage	No visible damage	No visible damage	No visible damage	No visible damage	No visible damage	No visible damage	No visible damage	No visible damage	No visible damage	No visible damage	No visible damage	No visible damage	No visible damage	No visible damage
136	2580	1	1	112C	Administrative Office	Main Office Copy Room	W3	Cracking paint	No visible damage	No visible damage	No visible damage	No visible damage	No visible damage	No visible damage	No visible damage	No visible damage	No visible damage	No visible damage	No visible damage	No visible damage	No visible damage	No visible damage	No visible damage
137	2580	1	1	112B	Administrative Office	Main Office Copy Room	W4	Cracking paint	No visible damage	No visible damage	No visible damage	No visible damage	No visible damage	No visible damage	No visible damage	No visible damage	No visible damage	No visible damage	No visible damage	No visible damage	No visible damage	No visible damage	No visible damage
138	2580	1	1	112B	Administrative Office	Nurse's Office	W1	Cracking paint	Prior	Prior	10/3/2018	10/3/2018		10/4/2018	160	4	1	1	<20 ug/ft2	Colometric and Flame AA passed			

139	2580	1	1	112B	Administrative Office	Nurse's Office	W2	Cracking paint, and damaged plaster by door	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above
140	2580	1	1	112B	Administrative Office	Nurse's Office	W3	Peeling paint behind radiator	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above
141	2580	1	1	113	Administrative Office	Nurse's Office	W4	Cracking paint	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above
142	2580	1	1	113	Restrooms, Staff - Male/Female	Nurse's Office Restroom	W1	Cracking paint	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above
143	2580	1	1	113	Restrooms, Staff - Male/Female	Nurse's Office Restroom	W2	Cracking paint	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above
144	2580	1	1	113	Restrooms, Staff - Male/Female	Nurse's Office Restroom	W3	Cracking paint	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above
145	2580	1	1	113B	Restrooms, Staff - Male/Female	Nurse's Office Restroom	W4	Cracking paint	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above
146	2580	1	1	113B	Student Restrooms - Male/Female (Classroom)	Kindergarten Restroom by Classroom 106	W1	Peeling paint	Prior	Prior	8/9/2018	8/11/2018		8/11/2018	120	3	1	1	<20 ug/ft2	Colometric and Flame AA passed 8/11/2018
147	2580	1	1	113B	Student Restrooms - Male/Female (Classroom)	Kindergarten Restroom by Classroom 106	W2	Peeling paint & Efflorescence	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above
148	2580	1	1	113B	Student Restrooms - Male/Female (Classroom)	Kindergarten Restroom by Classroom 106	W3	Peeling paint & Efflorescence	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above
149	2580	1	1	120	Student Restrooms - Male/Female (Classroom)	Kindergarten Restroom by Classroom 106	W4	Peeling paint	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above
150	2580	1	1	120	Student Restrooms - Male/Female (Classroom)	Kindergarten Restroom by Classroom 106	Ceiling	Peeling paint & Efflorescence & Pipe	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above
151	2580	1	1	120	Student Restrooms - Female (4-12)	Girl's Restroom	W1	Cracking paint	Prior	Prior	8/15/2018	8/17/2018		8/17/2018	125	3	1	1	<20 ug/ft2	Colometric and Flame AA passed 8/17/2018
152	2580	1	1	120	Student Restrooms - Female (4-12)	Girl's Restroom	W2	Cracking paint	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above
153	2580	1	1	120	Student Restrooms - Female (4-12)	Girl's Restroom	W3	Cracking paint & Flaking paint	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above
154	2580	1	1	121	Student Restrooms - Female (4-12)	Girl's Restroom	W4	Cracking paint & Pipe	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above
155	2580	1	1	121	Student Restrooms - Female (4-12)	Girl's Restroom	Ceiling	Peeling paint & Efflorescence	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above
156	2580	1	1	121	Restrooms, Staff - Female	Women's Lounge	W1	Cracking paint on wall and door (varnish)	See comments	See comments	See comments	See comments	See comments	See comments	See comments	See comments	See comments	See comments	See comments	Unknown area- women's 1st Floor lounge/restroom listed below what tested and cleared
157	2580	1	1	121	Restrooms, Staff - Female	Women's Lounge	W2	Cracking paint & peeling paint	See comments	See comments	See comments	See comments	See comments	See comments	See comments	See comments	See comments	See comments	See comments	Unknown area- women's 1st Floor lounge/restroom listed below what tested and cleared
158	2580	1	1	121	Restrooms, Staff - Female	Women's Lounge	W3	Severely damaged plaster	See comments	See comments	See comments	See comments	See comments	See comments	See comments	See comments	See comments	See comments	See comments	Unknown area- women's 1st Floor lounge/restroom listed below what tested and cleared
159	2580	1	1	122	Restrooms, Staff - Female	Women's Lounge	W4	Cracking paint and holes in plaster	See comments	See comments	See comments	See comments	See comments	See comments	See comments	See comments	See comments	See comments	See comments	Unknown area- women's 1st Floor lounge/restroom listed below what tested and cleared
160	2580	1	1	122	Restrooms, Staff - Female	Women's Lounge Restroom	W1	Peeling paint & Efflorescence	Prior	Prior	8/9/2018	8/11/2018		8/11/2018	200	5	1	1	<20 ug/ft	Colometric submitted for Flame analysis 8/11/2018. Both passed. Work stopped and revisited 10/8/2018. Colometric submitted for Flame analysis 10/9/2018. Both passed and area fully stabilized.
161	2580	1	1	122	Restrooms, Staff - Female	Women's Lounge Restroom	W2	Peeling paint behind radiator	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above
162	2580	1	1	122	Restrooms, Staff - Female	Women's Lounge Restroom	W3	Cracking paint	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above
163	2580	1	1	122A	Restrooms, Staff - Female	Women's Lounge Restroom	W4	Cracking paint	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above
164	2580	1	1	122A	Restrooms, Staff - Female	Women's Lounge Restroom	Ceiling	Cracking paint	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above
165	2580	1	1	122A	Circulation (Hallway)	Hallway from Classrooms 106 to 109	W1	Cracking paint	Prior	Prior	9/10/2018	9/11/2018	9/11/2018	9/12/2018	60	1	1	1	<20 ug/ft	Colometric submitted for Flame analysis: passed 9/12/2018

520	2580	1	B	001A	Restrooms, Staff - Male/Female	Gymnasium Office Teacher's Restroom	W3	Cracking paint	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above
521	2580	1	B	001C	Restrooms, Staff - Male/Female	Gymnasium Office Teacher's Restroom	W4	Cracking paint	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above
522	2580	1	B	001C	Restrooms, Staff - Male/Female	Gymnasium Office Teacher's Restroom	Ceiling	Severe peeling paint including ductwork	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above
523	2580	1	B	001C	Restrooms, Staff - Male/Female	Gymnasium Office Teacher's Restroom	Floor	Severe peeling paint	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above
524	2580	1	B	001C	Storage	Gymnasium Storage closet at the far along Room 015	W1	Efflorescence & Severe peeling paint	Unknown area	Unknown area	Unknown area	Unknown area	Unknown area	Unknown area	Unknown area	Unknown area	Unknown area	Unknown area	Unknown area	Unknown area
525	2580	1	B	001C	Storage	Gymnasium Storage closet at the far along Room 015	W2	Efflorescence & Severe peeling paint	Unknown area	Unknown area	Unknown area	Unknown area	Unknown area	Unknown area	Unknown area	Unknown area	Unknown area	Unknown area	Unknown area	Unknown area
526	2580	1	B	001C	Storage	Gymnasium Storage closet at the far along Room 015	W3	Efflorescence & Severe peeling paint	Unknown area	Unknown area	Unknown area	Unknown area	Unknown area	Unknown area	Unknown area	Unknown area	Unknown area	Unknown area	Unknown area	Unknown area
527	2580	1	B	001B	Storage	Gymnasium Storage closet at the far along Room 015	W4	Efflorescence & Severe peeling paint	Unknown area	Unknown area	Unknown area	Unknown area	Unknown area	Unknown area	Unknown area	Unknown area	Unknown area	Unknown area	Unknown area	Unknown area
528	2580	1	B	001B	Storage	Gymnasium Storage closet at the far along Room 015	Ceiling	Severely damaged plaster, Peeling & flaking paint including ductwork	Unknown area	Unknown area	Unknown area	Unknown area	Unknown area	Unknown area	Unknown area	Unknown area	Unknown area	Unknown area	Unknown area	Unknown area
529	2580	1	B	001B	Storage	Gymnasium Storage closet at the far along Room 015	Floor	Debris on electrical components & chair	Unknown area	Unknown area	Unknown area	Unknown area	Unknown area	Unknown area	Unknown area	Unknown area	Unknown area	Unknown area	Unknown area	Unknown area
530	2580	1	B	001B	Storage	Gymnasium Storage Room	W1	Peeling & flaking paint	Unknown area	Unknown area	Unknown area	Unknown area	Unknown area	Unknown area	Unknown area	Unknown area	Unknown area	Unknown area	Unknown area	Unknown area
531	2580	1	B	001B	Storage	Gymnasium Storage Room	W2	Peeling paint, flaking paint including pipes and window frame	Prior	Prior	10/3/2018	10/5/2018		10/5/2018	160	4	1	0	None Colometric failed-see comments	This area stabilized during the last few shifts of the project. Colometric failed on site-Jerry Junod approved 2nd reclean and paint encapsulation of floor. No further wipes or Flame AA submitted per approval of OEMS.
532	2580	1	B	001B	Storage	Gymnasium Storage Room	W3	Cracking paint	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above
533	2580	1	B	2	Storage	Gymnasium Storage Room	W4	Peeling & flaking paint by the door	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above
534	2580	1	B	2	Storage	Gymnasium Storage Room	Ceiling	Severe peeling paint, flaking paint including on ductwork	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above
535	2580	1	B	2	Storage	Gymnasium Storage Room	Floor	Debris on floor and maintenance supplies	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above
536	2580	1	B	4	Student Restrooms - Female (4-12)	Girl's Restroom	W1	Severe peeling paint	Prior	Prior	8/20/2018	8/23/2018		8/25/2018	150	4	1	1	<20 ug/ft2	Colometric passed and Flame AA Passed
537	2580	1	B	4	Student Restrooms - Female (4-12)	Girl's Restroom	W2	Severe peeling paint	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above
538	2580	1	B	4	Student Restrooms - Female (4-12)	Girl's Restroom	W3	Severe peeling paint	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above
539	2580	1	B	5	Student Restrooms - Female (4-12)	Girl's Restroom	W4	Severe peeling paint	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above
540	2580	1	B	5	Student Restrooms - Female (4-12)	Girl's Restroom	Ceiling	Severe peeling paint including radiators	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above
541	2580	1	B	5	Student Restrooms - Female (4-12)	Girl's Restroom	Floor	Debris and peeling paint on baseboard	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above
542	2580	1	B	5	Student Restrooms - Male (4-12)	Boy's Restroom	W1	Severe peeling paint	Prior	Prior	8/21/2018	8/21/2018		8/22/2018	150	1	1	1	<20 ug/ft2	Colometric passed and Flame AA Passed
543	2580	1	B	5	Student Restrooms - Male (4-12)	Boy's Restroom	W2	Severe peeling paint	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above
544	2580	1	B	5	Student Restrooms - Male (4-12)	Boy's Restroom	W3	Severe peeling paint	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above
545	2580	1	B	6	Student Restrooms - Male (4-12)	Boy's Restroom	W4	Severe peeling paint	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above
546	2580	1	B	6	Student Restrooms - Male (4-12)	Boy's Restroom	Ceiling	Severe peeling paint including radiators	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above
547	2580	1	B	6	Student Restrooms - Male (4-12)	Boy's Restroom	Floor	Debris	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above	See above
548	2580	1	B	007B	Storage	Storage Closet in Hallway across Engineer's Office	W1	Peeling paint on pipe	See comments	See comments	See comments	See comments	See comments	See comments	See comments	See comments	See comments	See comments	See comments	This area was skipped. No time left during project duration. Project ended 10/12/2018
549	2580	1	B	007B	Storage	Storage Closet in Hallway across Engineer's Office	W2	Peeling paint on wall, columns, and pipe	See comments	See comments	See comments	See comments	See comments	See comments	See comments	See comments	See comments	See comments	See comments	This area was skipped. No time left during project duration. Project ended 10/12/2018

Appendix D. Sample Results Table

Task ID	Floor	Space # (on Floor Plan)	Space Type	On Site Room Name	Component	Description of Paint and Plaster Damage (i.e. cracking, chipping, gouges, holes, flaking, spalling, efflorescence, significant moisture damage)	Number of Required RRP Wipes	Number of Colorimetric Wipes Used to Pass	Final Colorimetric Wipe Submitted for AAS Analysis (yes/no)	AAS Analysis Results	Other Notes or Comments
1	1	101	Primary	Head Start Classroom 101	W2	Peeling and Cracking paint	5	1	2	79 ug/ft3 - 8/11/18; <20 ug/ft2 (retest)	First Colormetric failed. Retest Colormetric submitted for Flame analysis 8/11/2018. Passed
2	1	101	Primary	Head Start Classroom 101	W3	Cracking paint & Efflorescence	See above	See above	See above	See above	See above
3	1	101	Primary	Head Start Classroom 101	W4	Cracking paint	See above	See above	See above	See above	See above
4	1	101	Student Restrooms - Male/Female (Classroom)	Classroom 101 Storage Room	W1	Peeling paint	See above	See above	See above	See above	See above
5	1	101	Student Restrooms - Male/Female (Classroom)	Classroom 101 Storage Room	W2	Peeling paint by riser	See above	See above	See above	See above	See above
6	1	101	Student Restrooms - Male/Female (Classroom)	Classroom 101 Storage Room	W3	Peeling paint	See above	See above	See above	See above	See above
7	1	101A	Student Restrooms - Male/Female (Classroom)	Classroom 101 Storage Room	W4	Peeling paint	See above	See above	See above	See above	See above
8	1	101B	Primary	Classroom 102	W1	Cracking paint	See above	See above	See above	See above	See above
9	1	101B	Primary	Classroom 102	W2	Cracking paint	See above	See above	See above	See above	See above
10	1	101B	Primary	Classroom 102	W3	Cracking & Peeling paint	5	1	0	None	SDP Protocol every other Classroom tested
11	1	102	Primary	Classroom 102	W4	Cracking, & Peeling paint at door	See above	See above	See above	See above	See above
12	1	102	Primary	Classroom 102	Ceiling	Peeling paint above drop ceiling (seen through the missing ceiling tile)	See above	See above	See above	See above	See above
13	1	102	Storage	Classroom 102 Closet	W1	Cracking & Peeling paint	See above	See above	See above	See above	See above
14	1	102	Storage	Classroom 102 Closet	W2	Cracking	See above	See above	See above	See above	See above
15	1	102	Storage	Classroom 102 Closet	W3	Cracking & Severe peeling paint	See above	See above	See above	See above	See above
16	1	102A	Storage	Classroom 102 Closet	W4	Cracking	See above	See above	See above	See above	See above
17	1	102A	Primary	Classroom 103	W1	Cracking paint	5	1	0	None	Every Other Classroom Colormetric protocol-passed
18	1	102A	Primary	Classroom 103	W2	Cracking paint	See above	See above	See above	See above	See above
19	1	102A	Primary	Classroom 103	W3	Cracking & Peeling paint	See above	See above	See above	See above	See above

20	1	103	Primary	Classroom 103	W4	Cracking paint	See above	See above	See above	See above	See above	
21	1	103	Storage	Classroom 103 Coat Closet	W1	Cracking paint	See above	See above	See above	See above	See above	
22	1	103	Storage	Classroom 103 Coat Closet	W2	Cracking paint	See above	See above	See above	See above	See above	
23	1	103	Storage	Classroom 103 Coat Closet	W3	Cracking & Peeling paint	See above	See above	See above	See above	See above	
24	1	103A	Storage	Classroom 103 Coat Closet	W4	Cracking	See above	See above	See above	See above	See above	
25	1	103A	Storage	Classroom 103 Coat Closet	Ceiling	Cracking & Peeling paint	See above	See above	See above	See above	See above	
26	1	103B	Storage	Classroom 103 Closet	Ceiling	Cracking & Peeling paint	See above	See above	See above	See above	See above	
27	1	103B	Primary	Classroom 104	W1	Cracking paint below the blackboard	5	1	1	<20 ug/ft2	Colormetric submitted for Flame analysis 8/11/2018-passed	
28	1	103B	Primary	Classroom 104	W2	Cracking paint below the blackboard	See above	See above	See above	See above	See above	
29	1	103B	Primary	Classroom 104	W3	Cracking & Peeling paint	See above	See above	See above	See above	See above	
30	1	104	Primary	Classroom 104	W4	Cracking & Peeling paint	See above	See above	See above	See above	See above	
31	1	104	Storage	Classroom 104 Closet	W1	No access	See above	See above	See above	See above	See above	
32	1	104	Storage	Classroom 104 Closet	W2	No access	See above	See above	See above	See above	See above	
33	1	104	Storage	Classroom 104 Closet	W3	No access	See above	See above	See above	See above	See above	
34	1	104A	Storage	Classroom 104 Closet	W4	No access	See above	See above	See above	See above	See above	
35	1	104A	Storage	Classroom 104 Closet	Ceiling	No access	See above	See above	See above	See above	See above	
36	1	104A	Storage	Classroom 104 Closet	Floor	No access	See above	See above	See above	See above	See above	
37	1	104B	Primary	Counselor's Office Room 105	W1	Cracking paint	4	1	1	<20 ug/ft2	Colormetric and Flame AA passed	
38	1	104B	Primary	Counselor's Office Room 105	W2	Cracking paint	See above	See above	See above	See above	See above	
39	1	104B	Primary	Counselor's Office Room 105	W3	Peeling paint at columns & behind radiators	See above	See above	See above	See above	See above	
40	1	105	Primary	Counselor's Office Room 105	W4	Cracking paint	See above	See above	See above	See above	See above	
41	1	105	Primary	Room 105 Counselor's Sub Office	W1	No access	See above	See above	See above	See above	See above	
42	1	105	Primary	Room 105 Counselor's Sub Office	W2	No access	See above	See above	See above	See above	See above	

43	1	105	Primary	Room 105 Counselor's Sub Office	W3	No access	See above	See above	See above	See above	See above
44	1	105.1	Primary	Room 105 Counselor's Sub Office	W4	No access	See above	See above	See above	See above	See above
45	1	105.1	Primary	Room 105 Counselor's Sub Office	Ceiling	No access	See above	See above	See above	See above	See above
46	1	105.1	Primary	Room 105 Counselor's Sub Office	Floor	No access	See above	See above	See above	See above	See above
47	1	105.1	Storage	Counselor's Office Closet	W1	No access	See above	See above	See above	See above	See above
48	1	105.1	Storage	Counselor's Office Closet	W2	No access	See above	See above	See above	See above	See above
49	1	105.1	Storage	Counselor's Office Closet	W3	No access	See above	See above	See above	See above	See above
50	1	105A	Storage	Counselor's Office Closet	W4	No access	See above	See above	See above	See above	See above
51	1	105A	Storage	Counselor's Office Closet	Ceiling	No access	See above	See above	See above	See above	See above
52	1	105A	Storage	Counselor's Office Closet	Floor	No access	See above	See above	See above	See above	See above
53	1	105A	Primary	Classroom 106	W1	Cracking & Peeling paint	5	1	0	None	SDP Protocol every other Classroom tested
54	1	105A	Primary	Classroom 106	W2	Cracking paint	See above	See above	See above	See above	See above
55	1	105A	Primary	Classroom 106	W3	Peeling paint behind radiators/casing	See above	See above	See above	See above	See above
56	1	106	Primary	Classroom 106	W4	Cracking & Peeling paint	See above	See above	See above	See above	See above
57	1	106	Storage	Classroom 106 Coat Closet	W1	Cracking paint	See above	See above	See above	See above	See above
58	1	106	Storage	Classroom 106 Coat Closet	W2	Cracking paint	See above	See above	See above	See above	See above
59	1	106	Storage	Classroom 106 Coat Closet	W3	Cracking paint	See above	See above	See above	See above	See above
60	1	106A	Storage	Classroom 106 Coat Closet	Ceiling	Peeling paint above drop ceiling (seen through the missing ceiling tile)	See above	See above	See above	See above	See above
61	1	106A	Primary	Room 107 Teacher's Lounge	W1	Cracking paint	See above	See above	See above	See above	See above
62	1	106A	Primary	Room 107 Teacher's Lounge	W2	Cracking paint & Damaged plaster	See above	See above	See above	See above	See above
63	1	106A	Primary	Room 107 Teacher's Lounge	W3	Cracking paint at columns, peeling paint behind radiators	See above	See above	See above	See above	See above
64	1	107	Primary	Room 107 Teacher's Lounge	W4	Cracking paint	See above	See above	See above	See above	See above

65	1	107	Storage	Room 107 Teacher's Lounge Staff Closet	W1	No access	See above	See above	See above	See above	See above
66	1	107	Storage	Room 107 Teacher's Lounge Staff Closet	W2	No access	See above	See above	See above	See above	See above
67	1	107	Storage	Room 107 Teacher's Lounge Staff Closet	W3	No access	See above	See above	See above	See above	See above
68	1	107A	Storage	Room 107 Teacher's Lounge Staff Closet	W4	No access	5	1	2	31 ug/ft ² - 8/9/18, <20 µg/ft ² - 8/14/18 (retest)	Retest passed 8/10/2018
69	1	107A	Storage	Room 107 Teacher's Lounge Staff Closet	Ceiling	No access	See above	See above	See above	See above	See above
70	1	107A	Storage	Room 107 Teacher's Lounge Staff Closet	Floor	No access	See above	See above	See above	See above	See above
71	1	107A	Student Restrooms - Male/Female (Classroom)	Classroom 107 Restroom	W1	No access	See above	See above	See above	See above	See above
72	1	107A	Student Restrooms - Male/Female (Classroom)	Classroom 107 Restroom	W2	No access	See above	See above	See above	See above	See above
73	1	107A	Student Restrooms - Male/Female (Classroom)	Classroom 107 Restroom	W3	No access	See above	See above	See above	See above	See above
74	1	107B	Student Restrooms - Male/Female (Classroom)	Classroom 107 Restroom	W4	No access	See above	See above	See above	See above	See above
75	1	107B	Student Restrooms - Male/Female (Classroom)	Classroom 107 Restroom	Ceiling	No access	See above	See above	See above	See above	See above
76	1	107B	Student Restrooms - Male/Female (Classroom)	Classroom 107 Restroom	Floor	No access	See above	See above	See above	See above	See above
77	1	107B	Primary	Classroom 108	W1	Peeling paint	4	1	1	Colormetric only	Every Other Classroom Colormetric protocol-passed
78	1	107B	Primary	Classroom 108	W2	Peeling paint	See above	See above	See above	See above	See above
79	1	107B	Primary	Classroom 108	W3	Severe peeling paint at radiators, peeling paint & damaged plaster at columns	See above	See above	See above	See above	See above
80	1	108	Primary	Classroom 108	W4	Flaking paint	See above	See above	See above	See above	See above
81	1	108	Storage	Classroom 108 Coat Closet	W1	Cracking paint	See above	See above	See above	See above	See above
82	1	108	Storage	Classroom 108 Coat Closet	W2	Severe peeling paint at columns	See above	See above	See above	See above	See above
83	1	108	Storage	Classroom 108 Coat Closet	W3	Cracking & Flaking paint	See above	See above	See above	See above	See above

84	1	108A	Primary	Classroom 109	W1	Cracking paint	See above	See above	See above	See above	See above
85	1	108A	Primary	Classroom 109	W2	Cracking paint	5	1	2	559.0 µg/ft ² , <20 µg/ft ²	Retested and passed
86	1	108A	Primary	Classroom 109	W3	Severe peeling paint at radiators, Cracking paint at columns	See above	See above	See above	See above	See above
87	1	109	Primary	Classroom 109	W4	Cracking & Flaking paint	See above	See above	See above	See above	See above
88	1	109	Storage	Classroom 109 Storage Closet	W1	No access	See above	See above	See above	See above	See above
89	1	109	Storage	Classroom 109 Storage Closet	W2	No access	See above	See above	See above	See above	See above
90	1	109	Storage	Classroom 109 Storage Closet	W3	No access	See above	See above	See above	See above	See above
91	1	109A	Storage	Classroom 109 Storage Closet	W4	No access	See above	See above	See above	See above	See above
92	1	109A	Storage	Classroom 109 Storage Closet	Ceiling	No access	See above	See above	See above	See above	See above
93	1	109A	Storage	Classroom 109 Storage Closet	Floor	No access	See above	See above	See above	See above	See above
94	1	109A	Stairs	Side Entrance to 110	W1	Cracking paint	5	1	2	558 µg/ft ² - 8/9/18; <20 ug/ft ² - 8/10/18 (retest)	Took Colormetric on 8/9/2018- Passed. Submitted for Flame and Failed. Retested and passed colormetric on 8/10/2018. Resubmitted for Flame 8/10/2018
95	1	109A	Stairs	Side Entrance to 110	W2	Cracking, Spalling, Flaking paint	See above	See above	See above	See above	See above
96	1	109A	Stairs	Side Entrance to 110	W3	Peeling paint	See above	See above	See above	See above	See above
97	1	110A	Stairs	Side Entrance to 110	W4	Cracking paint	See above	See above	See above	See above	See above
98	1	110A	Stairs	Side Entrance to 110	Ceiling	Peeling paint above drop ceiling (seen through the missing ceiling tile)	See above	See above	See above	See above	See above
99	1	110A	Storage	Classroom 110 Storage Closet	W1	No access	See above	See above	See above	See above	See above
100	1	110A	Storage	Classroom 110 Storage Closet	W2	No access (severe peeling paint could be seen through the door)	See above	See above	See above	See above	See above
101	1	110A	Storage	Classroom 110 Storage Closet	W3	No access (severe peeling paint could be seen through the door)	See above	See above	See above	See above	See above
102	1	110B	Storage	Classroom 110 Storage Closet	W4	No access (severe peeling paint could be seen through the door)	See above	See above	See above	See above	See above
103	1	110B	Storage	Classroom 110 Storage Closet	Ceiling	No access	See above	See above	See above	See above	See above
104	1	110B	Storage	Classroom 110 Storage Closet	Floor	No access	See above	See above	See above	See above	See above
105	1	110B	Primary	Classroom 110	W1	Cracking & Peeling paint	4	1	1	<20 ug/ft ²	Colormetric and Flame AA passed
106	1	110B	Primary	Classroom 110	W2	Severe peeling paint & Efflorescence	See above	See above	See above	See above	See above

107	1	110B	Primary	Classroom 110	W3	Cracking & Peeling paint	See above	See above	See above	See above	See above
108	1	110	Primary	Classroom 110	W4	Cracking paint	See above	See above	See above	See above	See above
109	1	110	Primary	Classroom 110	Ceiling	Cracking paint at stage ceiling	See above	See above	See above	See above	See above
110	1	110	Administrative Office	Principal's Office	W1	Peeling paint at column	4	1	1	<20 ug/ft2	Flame Passed
111	1	110	Administrative Office	Principal's Office	W2	Severe peeling paint	See above	See above	See above	See above	See above
112	1	110	Administrative Office	Principal's Office	W3	Severe peeling paint behind computer desk	See above	See above	See above	See above	See above
113	1	111A	Administrative Office	Principal's Office	W4	Cracking, Chipping, and peeling paint	See above	See above	See above	See above	See above
114	1	111A	Restrooms, Staff - Male/Female	Principal's Office Restroom	W1	Cracking paint	2	1	1	<20 ug/ft2	Colormetric and FLame AA passed
115	1	111A	Restrooms, Staff - Male/Female	Principal's Office Restroom	W2	Cracking paint	See above	See above	See above	See above	See above
116	1	111A	Restrooms, Staff - Male/Female	Principal's Office Restroom	W3	Cracking paint	See above	See above	See above	See above	See above
117	1	111B	Restrooms, Staff - Male/Female	Principal's Office Restroom	W4	Cracking paint	See above	See above	See above	See above	See above
118	1	111B	Restrooms, Staff - Male/Female	Principal's Office Restroom	Ceiling	Cracking paint	See above	See above	See above	See above	See above
119	1	111C	Administrative Office	Main Office	W1	Cracking & Chipping paint	4	1	1	<20 ug/ft2	Colormetric submitted for Flame analysis 8/11/2018
120	1	111C	Administrative Office	Main Office	W2	Cracking & Peeling paint	See above	See above	See above	See above	See above
121	1	111C	Administrative Office	Main Office	W3	Peeling paint	See above	See above	See above	See above	See above
122	1	111	Administrative Office	Main Office	W4	Cracking paint & hole in plaster	See above	See above	See above	See above	See above
123	1	111	Administrative Office	Conference Room	W1	Severe peeling paint on door	1	1	1	<20 ug/ft2	Colormetric submitted for Flame analysis and both passed
124	1	111	Administrative Office	Conference Room	W2	Peeling paint	See above	See above	See above	See above	See above
125	1	111	Administrative Office	Conference Room	W3	Peeling paint around windows	See above	See above	See above	See above	See above
126	1	112	Administrative Office	Conference Room	W4	Peeling paint & Damaged plaster	See above	See above	See above	See above	See above
127	1	112	Administrative Office	Conference Room	Floor	Baseboard	See above	See above	See above	See above	See above
128	1	112	Administrative Office	Conference Room Restroom	W1	Severe peeling paint on door	See above	See above	See above	See above	See above
129	1	112	Administrative Office	Conference Room Restroom	W2	Peeling paint	See above	See above	See above	See above	See above
130	1	112	Administrative Office	Conference Room Restroom	W3	Peeling paint	See above	See above	See above	See above	See above

131	1	112A	Storage	Main Office Closet on the left side	Ceiling	Peeling paint	No visible damage	No visible damage	No visible damage	No visible damage	No visible damage
132	1	112A	Storage	Main Office Closet/File Room on the right side	W1	Peeling paint	No visible damage	No visible damage	No visible damage	No visible damage	No visible damage
133	1	112A	Storage	Main Office Closet/File Room on the right side	W2	Severe peeling paint	No visible damage	No visible damage	No visible damage	No visible damage	No visible damage
134	1	112C	Administrative Office	Main Office Copy Room	W1	Severe peeling paint	No visible damage	No visible damage	No visible damage	No visible damage	No visible damage
135	1	112C	Administrative Office	Main Office Copy Room	W2	Cracking paint	No visible damage	No visible damage	No visible damage	No visible damage	No visible damage
136	1	112C	Administrative Office	Main Office Copy Room	W3	Cracking paint	No visible damage	No visible damage	No visible damage	No visible damage	No visible damage
137	1	112B	Administrative Office	Main Office Copy Room	W4	Cracking paint	No visible damage	No visible damage	No visible damage	No visible damage	No visible damage
138	1	112B	Administrative Office	Nurse's Office	W1	Cracking paint	4	1	1	<20 ug/ft2	Colormetric and Flame AA passed
139	1	112B	Administrative Office	Nurse's Office	W2	Cracking paint, and damaged plaster by door	See above	See above	See above	See above	See above
140	1	112B	Administrative Office	Nurse's Office	W3	Peeling paint behind radiator	See above	See above	See above	See above	See above
141	1	113	Administrative Office	Nurse's Office	W4	Cracking paint	See above	See above	See above	See above	See above
142	1	113	Restrooms, Staff - Male/Female	Nurse's Office Restroom	W1	Cracking paint	See above	See above	See above	See above	See above
143	1	113	Restrooms, Staff - Male/Female	Nurse's Office Restroom	W2	Cracking paint	See above	See above	See above	See above	See above
144	1	113	Restrooms, Staff - Male/Female	Nurse's Office Restroom	W3	Cracking paint	See above	See above	See above	See above	See above
145	1	113B	Restrooms, Staff - Male/Female	Nurse's Office Restroom	W4	Cracking paint	See above	See above	See above	See above	See above
146	1	113B	Student Restrooms - Male/Female (Classroom)	Kindergarten Restroom by Classroom 106	W1	Peeling paint	3	1	1	<20 ug/ft2	Colormetric and Flame AA passed 8/11/2018
147	1	113B	Student Restrooms - Male/Female (Classroom)	Kindergarten Restroom by Classroom 106	W2	Peeling paint & Efflorescence	See above	See above	See above	See above	See above
148	1	113B	Student Restrooms - Male/Female (Classroom)	Kindergarten Restroom by Classroom 106	W3	Peeling paint & Efflorescence	See above	See above	See above	See above	See above
149	1	120	Student Restrooms - Male/Female (Classroom)	Kindergarten Restroom by Classroom 106	W4	Peeling paint	See above	See above	See above	See above	See above
150	1	120	Student Restrooms - Male/Female (Classroom)	Kindergarten Restroom by Classroom 106	Ceiling	Peeling paint & Efflorescence & Pipe	See above	See above	See above	See above	See above

151	1	120	Student Restrooms - Female (4-12)	Girl's Restroom	W1	Cracking paint	3	1	1	<20 ug/ft2	Colormetric and Flame AA passed 8/17/2018
152	1	120	Student Restrooms - Female (4-12)	Girl's Restroom	W2	Cracking paint	See above	See above	See above	See above	See above
153	1	120	Student Restrooms - Female (4-12)	Girl's Restroom	W3	Cracking paint & Flaking paint	See above	See above	See above	See above	See above
154	1	121	Student Restrooms - Female (4-12)	Girl's Restroom	W4	Cracking paint & Pipe	See above	See above	See above	See above	See above
155	1	121	Student Restrooms - Female (4-12)	Girl's Restroom	Ceiling	Peeling paint & Efflorescence	See above	See above	See above	See above	See above
156	1	121	Restrooms, Staff - Female	Women's Lounge	W1	Cracking paint on wall and door (varnish)	See comments	See comments	See comments	See comments	Unknown area- women's 1st Floor lounge/restroom listed below what tested and cleared
157	1	121	Restrooms, Staff - Female	Women's Lounge	W2	Cracking paint & peeling paint	See comments	See comments	See comments	See comments	Unknown area- women's 1st Floor lounge/restroom listed below what tested and cleared
158	1	121	Restrooms, Staff - Female	Women's Lounge	W3	Severely damaged plaster	See comments	See comments	See comments	See comments	Unknown area- women's 1st Floor lounge/restroom listed below what tested and cleared
159	1	122	Restrooms, Staff - Female	Women's Lounge	W4	Cracking paint and holes in plaster	See comments	See comments	See comments	See comments	Unknown area- women's 1st Floor lounge/restroom listed below what tested and cleared
160	1	122	Restrooms, Staff - Female	Women's Lounge Restroom	W1	Peeling paint & Efflorescence	5	1	1	<20 ug/ft	Colormetric submitted for Flame analysis 8/11/2018. Both passed. Work stopped and revisited 10/8/2018. Colormetric submitted for Flame analysis 10/9/2018. Both passed and area fully stabilized.
161	1	122	Restrooms, Staff - Female	Women's Lounge Restroom	W2	Peeling paint behind radiator	See above	See above	See above	See above	See above
162	1	122	Restrooms, Staff - Female	Women's Lounge Restroom	W3	Cracking paint	See above	See above	See above	See above	See above
163	1	122A	Restrooms, Staff - Female	Women's Lounge Restroom	W4	Cracking paint	See above	See above	See above	See above	See above
164	1	122A	Restrooms, Staff - Female	Women's Lounge Restroom	Ceiling	Cracking paint	See above	See above	See above	See above	See above
165	1	122A	Circulation (Hallway)	Hallway from Classrooms 106 to 109	W1	Cracking paint	1	1	1	<20 ug/ft	Colormetric submitted for Flame analysis: passed 9/12/2018
166	1	122A	Circulation (Hallway)	Hallway from Classrooms 106 to 109	W2	Damaged plaster at entrance to Room 108	See above	See above	See above	See above	See above

167	1	122A	Circulation (Hallway)	Hallway from Classrooms 106 to 109	W3	-	See above	See above	See above	See above	See above
168	1	H13	Circulation (Hallway)	Hallway from Classrooms 106 to 109	W4	Peeling & Cracking paint on wall, Peeling paint on pipe	See above	See above	See above	See above	See above
169	1	H13	Circulation (Hallway)	Main Hallway in Front of Main Office	W1	Severe peeling paint & Cracking paint	10	1	1	<20 ug/ft	Colormetric submitted for Flame analysis: passed 9/12/2018
170	1	H13	Circulation (Hallway)	Main Hallway in Front of Main Office	W2	-	See above	See above	See above	See above	See above
171	1	H13	Circulation (Hallway)	Main Hallway in Front of Main Office	W3	Severe peeling paint & Cracking paint	See above	See above	See above	See above	See above
172	1	H14	Circulation (Hallway)	Main Hallway in Front of Main Office	W4	-	See above	See above	See above	See above	See above
173	1	H14	Circulation (Hallway)	Main Hallway in Front of Main Office	Floor	Baseboard	See above	See above	See above	See above	See above
174	1	H14	Circulation (Hallway)	Main Entrance Hallway	W1	Severe peeling paint & Efflorescence	7	1	1	<20 ug/ft	Colormetric submitted for Flame analysis: passed 9/12/2018
175	1	H14	Circulation (Hallway)	Main Entrance Hallway	W2	Severe peeling paint & Efflorescence	See above	See above	See above	See above	See above
176	1	H14	Circulation (Hallway)	Main Entrance Hallway	W3	Cracking paint	See above	See above	See above	See above	See above
177	1	H14A	Circulation (Hallway)	Main Entrance Hallway	W4	Cracking & Peeling paint	See above	See above	See above	See above	See above
178	1	H14A	Circulation (Hallway)	Main Entrance Hallway	Ceiling	Severe peeling paint & Efflorescence	See above	See above	See above	See above	See above
179	1	H14A	Circulation (Hallway)	Hallway from Classrooms 101 to 104	W1	-	3	1	1	<20 ug/ft	Colormetric submitted for Flame analysis: passed 9/12/2018
180	1	H14A	Circulation (Hallway)	Hallway from Classrooms 101 to 104	W2	Cracking & Peeling paint	See above	See above	See above	See above	See above
181	1	H14A	Circulation (Hallway)	Hallway from Classrooms 101 to 104	W3	Cracking paint	See above	See above	See above	See above	See above
182	1	H15	Circulation (Hallway)	Hallway from Classrooms 101 to 104	W4	Cracking paint along wall & Damaged plaster by fire tower	See above	See above	See above	See above	See above
183	1	H15	Circulation (Hallway)	Hallway from Classrooms 101 to 104	Floor	Baseboard	See above	See above	See above	See above	See above
184	1	H15	Stairs	Stairwell next to Classroom 106	W1	Cracking paint	4	1	1	<20 ug/ft2	Colormetric and Flame AA wipe Passed 1st time
185	1	H15	Stairs	Stairwell next to Classroom 106	W2	Peeling paint on door	See above	See above	See above	See above	See above

186	1	H15	Stairs	Stairwell next to Classroom 106	W3	Cracking & Peeling paint, Damaged plaster	See above	See above	See above	See above	See above	
187	1	S11	Stairs	Stairwell next to Classroom 106	W4	Cracking paint	See above	See above	See above	See above	See above	
188	1	S11	Stairs	Stairwell next to Classroom 106	Ceiling	Severe peeling paint	See above	See above	See above	See above	See above	
189	1	S11	Stairs	Stairwell next to Classroom 104	W1	Cracking paint	3	1	1	<20 ug/ft	Colormetric submitted for Flame analysis: passed 9/12/2018	
190	1	S11	Stairs	Stairwell next to Classroom 104	W2	Cracking paint	See above	See above	See above	See above	See above	
191	1	S11	Stairs	Stairwell next to Classroom 104	W3	Cracking & peeling paint	See above	See above	See above	See above	See above	
192	1	S16	Stairs	Stairwell next to Classroom 104	W4	Peeling paint on door	See above	See above	See above	See above	See above	
193	1	S16	Stairs	Stairwell next to Classroom 104	Ceiling	Peeling & Flaking paint	See above	See above	See above	See above	See above	
194	1	S16	Stairs	Stairwell next to Classroom 104	Floor	Baseboard	See above	See above	See above	See above	See above	
195	1	S16	Stairs	Fire Tower by Classroom 103	W3	Peeling & Flaking paint	4	1	1	None colormetric only-see comments	1st Colormetric failed, approved by OEMS for 2nd reclean and no further testing.	
196	1	S18	Stairs	Fire Tower by Classroom 103	Ceiling	Severe peeling paint	See above	See above	See above	See above	See above	
197	1	S18	Stairs	Fire Tower by Classroom 103	Floor	Debris	See above	See above	See above	See above	See above	
198	1	S18	Stairs	Fire Tower by Classroom 103	W3	Peeling paint on pipe and window sill	See above	See above	See above	See above	See above	
199	1	S18A	Stairs	Fire Tower by Classroom 103	Ceiling	Severe peeling paint	See above	See above	See above	See above	See above	
200	1	S18A	Storage	Custodial Closet outside Classroom 106	W1	Hole in plaster wall	6	1	1	<20 ug/ft	Colormetric submitted for Flame analysis: passed 9/12/2018	
201	1	S18A	Storage	Custodial Closet outside Classroom 106	W2	Severe peeling paint & Damaged plaster	See above	See above	See above	See above	See above	
202	1	S18A	Storage	Custodial Closet outside Classroom 106	W3	Severe peeling paint	See above	See above	See above	See above	See above	
203	1	120A	Storage	Custodial Closet outside Classroom 106	W4	Severe peeling paint	See above	See above	See above	See above	See above	
204	1	120A	Storage	Custodial Closet outside Classroom 106	Ceiling	Severe peeling paint & Damaged plaster	See above	See above	See above	See above	See above	

205	1	120A	Storage	Custodial Closet outside Classroom 104	W1	Peeling paint	1	1	1	<20 ug/ft	Colormetric submitted for Flame analysis: passed 9/12/2018
206	1	120A	Storage	Custodial Closet outside Classroom 104	W3	Peeling paint	See above	See above	See above	See above	See above
207	1	121A	Storage	Head Start Closet outside Girl's Restroom	W1	No Access	See comments	See comments	See comments	See comments	Area was excluded from Scope. May revisit at a later date-Approved by OEMS.
208	1	121A	Storage	Head Start Closet outside Girl's Restroom	W2	No Access	See comments	See comments	See comments	See comments	Area was excluded from Scope. May revisit at a later date-Approved by OEMS.
209	1	121A	Storage	Head Start Closet outside Girl's Restroom	W3	No Access	See comments	See comments	See comments	See comments	Area was excluded from Scope. May revisit at a later date-Approved by OEMS.
210	1	104R	Storage	Head Start Closet outside Girl's Restroom	W4	No Access	See comments	See comments	See comments	See comments	Area was excluded from Scope. May revisit at a later date-Approved by OEMS.
211	1	104R	Storage	Head Start Closet outside Girl's Restroom	Ceiling	No Access	See comments	See comments	See comments	See comments	Area was excluded from Scope. May revisit at a later date-Approved by OEMS.
212	1	104R	Storage	Head Start Closet outside Girl's Restroom	Floor	No Access	See comments	See comments	See comments	See comments	Area was excluded from Scope. May revisit at a later date-Approved by OEMS.
213	1	104R	Primary	Classroom 201	W1	Peeling & Flaking paint	7	1	1	<20	Colormetric submitted for Flame analysis. Passed
214	1	104R	Primary	Classroom 201	W2	Severe peeling paint & Efflorescence	See above	See above	See above	See above	See above
215	1	104R	Primary	Classroom 201	W3	Peeling, Cracking, Spalling paint & Efflorescence	See above	See above	See above	See above	See above
216	2	201	Primary	Classroom 201	W4	Peeling, Cracking, Spalling paint & Efflorescence	See above	See above	See above	See above	See above
217	2	201	Storage	Classroom 201 Storage Closet	W1	No Access	See above	See above	See above	See above	See above
218	2	201	Storage	Classroom 201 Storage Closet	W2	No Access	See above	See above	See above	See above	See above
219	2	201	Storage	Classroom 201 Storage Closet	W3	No Access	See above	See above	See above	See above	See above
220	2	201A	Storage	Classroom 201 Storage Closet	W4	No Access (severe peeling paint could be seen through the door)	See above	See above	See above	See above	See above

221	2	201A	Storage	Classroom 201 Storage Closet	Ceiling	No Access	See above	See above	See above	See above	See above
222	2	201A	Storage	Classroom 201 Storage Closet	Floor	No Access	See above	See above	See above	See above	See above
223	2	201A	Primary	Classroom 202	W1	Cracking paint and some spalling	See above	See above	See above	See above	See above
224	2	201A	Primary	Classroom 202	W2	Cracking paint and some spalling, Damaged plaster at door	4	1	1	<20 ug/ft2	Colormetric submitted for Flame analysis. Passed
225	2	201A	Primary	Classroom 202	W3	Peeling paint & Severely damaged plaster	See above	See above	See above	See above	See above
226	2	202	Primary	Classroom 202	W4	Cracking paint	See above	See above	See above	See above	See above
227	2	202	Storage	Classroom 202 Closet	W1	No Access	See above	See above	See above	See above	See above
228	2	202	Storage	Classroom 202 Closet	W2	No Access	See above	See above	See above	See above	See above
229	2	202	Storage	Classroom 202 Closet	W3	No Access	See above	See above	See above	See above	See above
230	2	202A	Storage	Classroom 202 Closet	W4	No Access	See above	See above	See above	See above	See above
231	2	202A	Storage	Classroom 202 Closet	Ceiling	No Access	See above	See above	See above	See above	See above
232	2	202A	Storage	Classroom 202 Closet	Floor	No Access	See above	See above	See above	See above	See above
233	2	202A	Primary	Classroom 203	W2	Peeling paint at edges of wallboard	7	1	1	<20 ug/ft2	Colormetric submitted for Flame analysis. Passed
234	2	202A	Primary	Classroom 203	W3	Peeling & Cracking paint, Damaged plaster	See above	See above	See above	See above	See above
235	2	203A	Storage	Classroom 203 Storage Closet	W1	No Access	See above	See above	See above	See above	See above
236	2	203A	Storage	Classroom 203 Storage Closet	W2	No Access	See above	See above	See above	See above	See above
237	2	203A	Storage	Classroom 203 Storage Closet	W3	No Access	See above	See above	See above	See above	See above
238	2	203B	Storage	Classroom 203 Storage Closet	W4	No Access	See above	See above	See above	See above	See above
239	2	203B	Storage	Classroom 203 Storage Closet	Ceiling	No Access	See above	See above	See above	See above	See above
240	2	203B	Storage	Classroom 203 Storage Closet	Floor	No Access	See above	See above	See above	See above	See above
241	2	203B	Primary	Classroom 204	W1	Cracking & Chipping paint	See above	See above	See above	See above	See above
242	2	203B	Primary	Classroom 204	W2	Cracking Paint, Spalling at closet	4	1	1	<20 ug/ft2	Colormetric submitted for Flame analysis. Passed
243	2	203B	Primary	Classroom 204	W3	Peeling paint & Damaged plaster	See above	See above	See above	See above	See above
244	2	204	Primary	Classroom 204	W4	Chipping paint at some spots	See above	See above	See above	See above	See above
245	2	204	Storage	Classroom 204 Storage Closet	W3	Damaged plaster, Efflorescence, Peeling paint at windows & columns	See above	See above	See above	See above	See above

246	2	204A	Storage	Classroom 204 Storage Closet	W4	Cracking paint	See above	See above	See above	See above	See above
247	2	204A	Primary	Classroom 205	W1	Cracking paint & Damaged plaster	7	1	1	27.1, <20 (retest)	Failed initial Flame AA. Needs retest. Retest taken 8/18/2018. Pending results
248	2	204A	Primary	Classroom 205	W2	Minor peeling paint	See above	See above	See above	See above	See above
249	2	204A	Primary	Classroom 205	W3	Peeling & Cracking paint, Efflorescence at columns	See above	See above	See above	See above	See above
250	2	205	Primary	Classroom 205	W4	Cracking paint	See above	See above	See above	See above	See above
251	2	205	Storage	Classroom 205 Closet	W1	No Access	See above	See above	See above	See above	See above
252	2	205	Storage	Classroom 205 Closet	W2	No Access	See above	See above	See above	See above	See above
253	2	205	Storage	Classroom 205 Closet	W3	No Access	See above	See above	See above	See above	See above
254	2	205A	Storage	Classroom 205 Closet	W4	No Access	See above	See above	See above	See above	See above
255	2	205A	Storage	Classroom 205 Closet	Ceiling	No Access	See above	See above	See above	See above	See above
256	2	205A	Storage	Classroom 205 Closet	Floor	No Access	See above	See above	See above	See above	See above
257	2	205A	IMC (Library)	Library	W1	Flaking paint at one spot	See above	See above	See above	See above	See above
258	2	205A	IMC (Library)	Library	W3	Peeling paint at window sill, behind radiators, at left corner column, debris on window sill	4	1	1	<20 ug/ft2	Colometric submitted for Flame analysis. Passed
259	2	207	Storage	Library Office	W1	No Access	See above	See above	See above	See above	See above
260	2	207	Storage	Library Office	W2	No Access	See above	See above	See above	See above	See above
261	2	207	Storage	Library Office	W3	No Access	See above	See above	See above	See above	See above
262	2	207A	Storage	Library Office	W4	No Access	See above	See above	See above	See above	See above
263	2	207A	Storage	Library Office	Ceiling	No Access	See above	See above	See above	See above	See above
264	2	207A	Storage	Library Office	Floor	No Access	See above	See above	See above	See above	See above
265	2	207B	Primary	Classroom 208	W1	Cracking paint	See above	See above	See above	See above	See above
266	2	207B	Primary	Classroom 208	W2	Peeling & Cracking paint, hole in plaster	4	1	1	<20 ug/ft2	Colometric passed and Flame AA Passed
267	2	207B	Primary	Classroom 208	W3	Peeling paint on wall including column	See above	See above	See above	See above	See above
268	2	208	Primary	Classroom 208	W4	Peeling & Cracking paint below blackboard	See above	See above	See above	See above	See above
269	2	208	Storage	Classroom 208 Closet	W1	Minor Flaking paint	See above	See above	See above	See above	See above
270	2	208	Storage	Classroom 208 Closet	W2	Severe peeling paint & debris at column	See above	See above	See above	See above	See above
271	2	208	Storage	Classroom 208 Closet	W3	Peeling paint & Efflorescence at radiators	See above	See above	See above	See above	See above
272	2	208A	Storage	Classroom 208 Closet	Floor	Debris	See above	See above	See above	See above	See above

273	2	208A	Primary	Classroom 209	W1	Flaking paint - mostly below the blackboard	See above	See above	See above	See above	See above
274	2	208A	Primary	Classroom 209	W2	Flaking paint at spots	4	1	1	<20 ug/ft2	Colormetric passed and Flame AA Passed 9/28
275	2	208A	Primary	Classroom 209	W3	Peeling paint behind radiators, debris at far right corner window sill	See above	See above	See above	See above	See above
276	2	209	Primary	Classroom 209	W4	Flaking paint below blackboard	See above	See above	See above	See above	See above
277	2	209	Storage	Classroom 209 Closet	W1	Flaking paint	See above	See above	See above	See above	See above
278	2	209	Storage	Classroom 209 Closet	W3	Cracking paint	See above	See above	See above	See above	See above
279	2	209A	Storage	Classroom 209 Closet	W4	Severe peeling paint on wall including columns	See above	See above	See above	See above	See above
280	2	209A	Primary	Classroom 210	W1	Cracking & Chipping paint	5	1	0	None	Every other Classroom ok to clear using Colormetric. Colormetric passed 8/16/2018
281	2	209A	Primary	Classroom 210	W2	Severe peeling paint, Cracking paint on wall and columns. Holes in plaster	See above	See above	See above	See above	See above
282	2	209A	Primary	Classroom 210	W3	Peeling, Cracking, Peeling paint	See above	See above	See above	See above	See above
283	2	210	Primary	Classroom 210	W4	Cracking & Flaking paint	See above	See above	See above	See above	See above
284	2	210A	Storage	Storage ESOL Department	W2	Flaking paint on wall and column	See comments	See comments	See comments	See comments	Unknown area. Confirmed unknown by Fran Davis
285	2	210B	Storage	Storage ESOL Department	W4	Cracking paint	See comments	See comments	See comments	See comments	Unknown area. Confirmed unknown by Fran Davis
286	2	210B	Primary	Classroom 211	W1	Cracking paint	See above	See above	See above	See above	See above
287	2	210B	Primary	Classroom 211	W2	Cracking paint	4	1	1	<20 ug/ft2	Colormetric and Flame AA passed
288	2	210B	Primary	Classroom 211	W3	Cracking paint, Damaged plaster behind radiators, Spot debris on window sill	See above	See above	See above	See above	See above
289	2	211	Primary	Classroom 211	W4	Cracking paint	See above	See above	See above	See above	See above
290	2	211	Primary	Classroom 211	Ceiling	Above ceiling - Severe peeling paint visible through missing tile	See above	See above	See above	See above	See above
291	2	211	Storage	Classroom 211 Closet	W1	Cracking paint	See above	See above	See above	See above	See above
292	2	211	Storage	Classroom 211 Closet	W2	Cracking & Chipping paint	See above	See above	See above	See above	See above
293	2	211	Storage	Classroom 211 Closet	W3	Cracking, flaking, and peeling paint	See above	See above	See above	See above	See above
294	2	211A	Storage	Classroom 211 Closet	W4	Cracking and peeling on wall & pipe	See above	See above	See above	See above	See above
295	2	211A	Primary	Classroom 212	W1	Cracking paint	See above	See above	See above	See above	See above
296	2	211A	Primary	Classroom 212	W2	Cracking paint below blackboard	4	1	1	<20 ug/ft2	Colormetric and Flame AA passed

297	2	211A	Primary	Classroom 212	W3	Damaged plaster at and behind radiators	See above	See above	See above	See above	See above	See above
298	2	212	Primary	Classroom 212	W4	Cracking paint	See above	See above	See above	See above	See above	See above
299	2	212	Storage	Classroom 212 Closet	W1	No Access	See above	See above	See above	See above	See above	See above
300	2	212	Storage	Classroom 212 Closet	W2	No Access	See above	See above	See above	See above	See above	See above
301	2	212	Storage	Classroom 212 Closet	W3	No Access	See above	See above	See above	See above	See above	See above
302	2	212A	Storage	Classroom 212 Closet	W4	No Access	See above	See above	See above	See above	See above	See above
303	2	212A	Storage	Classroom 212 Closet	Ceiling	No Access	See above	See above	See above	See above	See above	See above
304	2	212A	Storage	Classroom 212 Closet	Floor	No Access	See above	See above	See above	See above	See above	See above
305	2	212A	Student Restrooms - Male (4-12)	Boy's Restroom	W1	Severe peeling paint	5	2	1	<20 ug/ft2	Colorimetric Failed on the first wipe, recleaned 8/17/2018 and passed Colorimetric. Second passing colorimetric submitted for Flame AA analysis and passed.	
306	2	212A	Student Restrooms - Male (4-12)	Boy's Restroom	W2	Severely damaged plaster and Efflorescence	See above	See above	See above	See above	See above	See above
307	2	212A	Student Restrooms - Male (4-12)	Boy's Restroom	W3	Severe peeling paint & Efflorescence	See above	See above	See above	See above	See above	See above
308	2	220	Student Restrooms - Male (4-12)	Boy's Restroom	W4	Peeling paint	See above	See above	See above	See above	See above	See above
309	2	220	Student Restrooms - Male (4-12)	Boy's Restroom	Ceiling	Severely damaged plaster and Efflorescence	See above	See above	See above	See above	See above	See above
310	2	220	Student Restrooms - Male (4-12)	Boy's Restroom	Floor	Debris top of urinals	See above	See above	See above	See above	See above	See above
311	2	220A	Student Restrooms - Female (4-12)	Girl's Restroom	W3	Efflorescence at window	3	1	1	<20 ug/ft2	Submitted Flame waiting for results	
312	2	221	Student Restrooms - Female (4-12)	Girl's Restroom	W4	Cracking paint & Efflorescence	See above	See above	See above	See above	See above	See above
313	2	221	Student Restrooms - Female (4-12)	Girl's Restroom	Ceiling	Damaged plaster & Efflorescence	See above	See above	See above	See above	See above	See above
314	2	221A	Student Restrooms - Female (4-12)	Custodial Closet outside Girl's Restroom	Ceiling	Peeling paint	See comments	See comments	See comments	See comments	Area was excluded from Scope. May revisit at a later date-Approved by OEMS.	
315	2	221A	Teacher Lounge/Dining	Women's Restroom Lounge	W2	Efflorescence, Peeling paint at window	2	1	1	<20 ug/ft2	Colorimetric and Flame AA passed	
316	2	221A	Teacher Lounge/Dining	Women's Restroom Lounge	W3	Efflorescence, Peeling paint at window	See above	See above	See above	See above	See above	See above

317	2	222	Teacher Lounge/Dining	Women's Restroom Lounge	W4	Flaking paint	See above	See above	See above	See above	See above
318	2	222	Teacher Lounge/Dining	Women's Restroom	W2	Efflorescence	See above	See above	See above	See above	See above
319	2	222	Teacher Lounge/Dining	Women's Restroom	W3	Spalling	See above	See above	See above	See above	See above
320	2	222A	Teacher Lounge/Dining	Women's Restroom	Ceiling	Efflorescence	See above	See above	See above	See above	See above
321	2	H26	Circulation (Hallway)	Hallway from Classrooms 208 to 211	Floor	Baseboard	20	1	None	None	
322	2	H26	Circulation (Hallway)	Hallway in Front of Library	W2	Damaged plaster	See above	See above	See above	See above	See above
323	2	H26	Circulation (Hallway)	Hallway in Front of Library	W3	-	See above	See above	See above	See above	See above
324	2	H27	Circulation (Hallway)	Hallway in Front of Library	W4	Damaged plaster	See above	See above	See above	See above	See above
325	2	H27	Circulation (Hallway)	Hallway in Front of Library	Floor	Peeling paint at baseboard	20	1	None	None	
326	2	H27	Circulation (Hallway)	Hallway from Classrooms 201 to 204	W1	-	See above	See above	See above	See above	See above
327	2	H27	Circulation (Hallway)	Hallway from Classrooms 201 to 204	W3	-	See above	See above	See above	See above	See above
328	2	H28	Circulation (Hallway)	Hallway from Classrooms 201 to 204	Floor	Peeling at baseboard	See above	See above	See above	See above	See above
329	2	H28	Stairs	Stairwell at Classroom 208	W1	-	4	1	1	<20 ug/ft2	Colometric and Flame AA wipe Passed 1st time
330	2	H28	Stairs	Stairwell at Classroom 208	W2	Damaged plaster, peeling paint on 2nd floor and middle landing	See above	See above	See above	See above	See above
331	2	S21	Stairs	Stairwell at Classroom 208	W4	Damaged plaster at middle landing, Peeling paint on 2nd floor	See above	See above	See above	See above	See above
332	2	S21	Stairs	Stairwell at Classroom 208	Ceiling	Under stairs & middle landing	See above	See above	See above	See above	See above
333	2	S21	Stairs	Stairwell at Classroom 208	Floor	Baseboard	See above	See above	See above	See above	See above
334	2	S21	Stairs	Stairwell at Classroom 204	W1	-	20	1	None	None	
335	2	S21	Stairs	Stairwell at Classroom 204	W2	Severe peeling paint	See above	See above	See above	See above	See above
336	2	S21	Stairs	Stairwell at Classroom 204	W3	-	See above	See above	See above	See above	See above
337	2	S26	Stairs	Stairwell at Classroom 204	W4	Peeling paint	See above	See above	See above	See above	See above

338	2	S26	Stairs	Stairwell at Classroom 204	Ceiling	Severe peeling paint, Middle landing	See above	See above	See above	See above	See above
339	2	S28	Stairs	Fire Tower near Classroom 203	Floor	Debris	4	1	1	Colormetric only	1st Colormetric failed, OEMS approved a 2nd reclean. Further action will be taken at a later date.
340	2	S28	Stairs	Fire Tower walkway near Classroom 203	W3	Peeling paint at pipe	2	1	1	1392	Instructed to do 1 Colormetric -passed on 10/11/2018, Flame AA failed. This area TBD. Jerry Junod approved the floor of this area to not be painted at this time -ML 10/12/2018
341	2	S28	Stairs	Fire Tower near Classroom 203	Ceiling	Peeling paint	See above	See above	See above	See above	See above
342	2	S28A	Stairs	Fire Tower walkway near Classroom 203	Ceiling	Severe peeling paint, Damaged plaster	See above	See above	See above	See above	See above
343	2	S28A	Primary	Classroom 301	W1	Peeling paint	4	1	1	<20 ug/ft2	Colormetric and Flame AA passed initial test.
344	2	S28A	Primary	Classroom 301	W2	Peeling paint	See above	See above	See above	See above	See above
345	2	S28A	Primary	Classroom 301	W3	Cracking paint	See above	See above	See above	See above	See above
346	3	301	Primary	Classroom 301	W4	Cracking & Chipping paint	See above	See above	See above	See above	See above
347	3	301	Storage	Classroom 301 Closet	W1	No Access	See above	See above	See above	See above	See above
348	3	301	Storage	Classroom 301 Closet	W2	No Access	See above	See above	See above	See above	See above
349	3	301	Storage	Classroom 301 Closet	W3	No Access	See above	See above	See above	See above	See above
350	3	301A	Storage	Classroom 301 Closet	W4	No Access (Severe peeling paint on wall and pipe by window - seen through the door)	See above	See above	See above	See above	See above
351	3	301A	Storage	Classroom 301 Closet	Ceiling	No Access	See above	See above	See above	See above	See above
352	3	301A	Storage	Classroom 301 Closet	Floor	No Access	See above	See above	See above	See above	See above
353	3	301A	Primary	Classroom 302	W1	Severe peeling paint & Efflorescence	4	1	1	<20 ug/ft2	Colormetric and Flame AA passed initial test.
354	3	301A	Primary	Classroom 302	W2	Peeling & Cracking paint	See above	See above	See above	See above	See above
355	3	301A	Primary	Classroom 302	W3	Cracking paint	See above	See above	See above	See above	See above
356	3	302	Primary	Classroom 302	W4	Cracking paint	See above	See above	See above	See above	See above
357	3	302	Primary	Classroom 302	Ceiling	Above ceiling - Severe peeling paint & damaged plaster visible through missing tile	See above	See above	See above	See above	See above
358	3	302	Primary	Classroom 302	Floor	Debris	See above	See above	See above	See above	See above
359	3	302	Storage	Classroom 302 Closet	W1	No Access	See above	See above	See above	See above	See above

360	3	302	Storage	Classroom 302 Closet	W2	No Access	See above	See above	See above	See above	See above
361	3	302	Storage	Classroom 302 Closet	W3	No Access	See above	See above	See above	See above	See above
362	3	302A	Storage	Classroom 302 Closet	W4	No Access	See above	See above	See above	See above	See above
363	3	302A	Storage	Classroom 302 Closet	Ceiling	No Access	See above	See above	See above	See above	See above
364	3	302A	Storage	Classroom 302 Closet	Floor	No Access	See above	See above	See above	See above	See above
365	3	302A	Primary	Classroom 303	W1	Cracking & Chipping paint	4	1	1	<20 ug/ft2	Colormetric and Flame AA passed initial test.
366	3	302A	Primary	Classroom 303	W2	Cracking & Chipping paint	See above	See above	See above	See above	See above
367	3	302A	Primary	Classroom 303	W3	Severe peeling paint & damaged plaster	See above	See above	See above	See above	See above
368	3	303	Primary	Classroom 303	W4	Cracking & peeling paint	See above	See above	See above	See above	See above
369	3	303	Storage	Classroom 303 Closet	W1	Cracking paint	See above	See above	See above	See above	See above
370	3	303	Storage	Classroom 303 Closet	W3	Exposed damaged plaster at coat hanger	See above	See above	See above	See above	See above
371	3	303A	Storage	Classroom 303 Closet	W1	No Access	See above	See above	See above	See above	See above
372	3	303A	Storage	Classroom 303 Closet	W2	No Access	See above	See above	See above	See above	See above
373	3	303A	Storage	Classroom 303 Closet	W3	No Access	See above	See above	See above	See above	See above
374	3	303B	Storage	Classroom 303 Closet	W4	No Access	See above	See above	See above	See above	See above
375	3	303B	Storage	Classroom 303 Closet	Ceiling	No Access	See above	See above	See above	See above	See above
376	3	303B	Storage	Classroom 303 Closet	Floor	No Access	See above	See above	See above	See above	See above
377	3	303B	Primary	Classroom 304	W1	Cracking & Flaking paint	4	1	1	<20 ug/ft2	Colormetric and Flame AA Passed
378	3	303B	Primary	Classroom 304	W2	Cracking & Flaking paint	See above	See above	See above	See above	See above
379	3	303B	Primary	Classroom 304	W3	Cracking paint at columns	See above	See above	See above	See above	See above
380	3	304	Primary	Classroom 304	W4	Cracking & Flaking paint	See above	See above	See above	See above	See above
381	3	304	Storage	Classroom 304 Closet	W1	No Access	See above	See above	See above	See above	See above
382	3	304	Storage	Classroom 304 Closet	W2	No Access	See above	See above	See above	See above	See above
383	3	304	Storage	Classroom 304 Closet	W3	No Access	See above	See above	See above	See above	See above
384	3	304A	Storage	Classroom 304 Closet	W4	No Access	See above	See above	See above	See above	See above
385	3	304A	Storage	Classroom 304 Closet	Ceiling	No Access	See above	See above	See above	See above	See above

386	3	304A	Storage	Classroom 304 Closet	Floor	No Access	See above	See above	See above	See above	See above
387	3	304A	Primary	Classroom 305	W1	Cracking paint	4	1	1	<20 ug/ft2	Colormetric passed and Flame AA Passed on first try
388	3	304A	Primary	Classroom 305	W2	-	See above	See above	See above	See above	See above
389	3	304A	Primary	Classroom 305	W3	Cracking paint, damaged plaster at column	See above	See above	See above	See above	See above
390	3	305	Primary	Classroom 305	W4	Cracking & Flaking paint	See above	See above	See above	See above	See above
391	3	305	Storage	Classroom 305 Closet	W2	Flaking paint at spots	4	1	1	<20 ug/ft2	Colormetric and Flame AA passed
392	3	305A	Primary	Classroom 306	W1	Cracking paint	Area skipped	Area skipped	Area skipped	Area skipped	Area skipped
393	3	305A	Primary	Classroom 306	W2	Cracking paint	Area skipped	Area skipped	Area skipped	Area skipped	Area skipped
394	3	306	Primary	Classroom 306	W4	-	Area skipped	Area skipped	Area skipped	Area skipped	Area skipped
395	3	306A	Storage	Classroom 306 Closet	W4	Cracking paint	Area skipped	Area skipped	Area skipped	Area skipped	Area skipped
396	3	306A	Storage	Classroom 306 Closet	W2	Cracking paint at column	Area skipped	Area skipped	Area skipped	Area skipped	Area skipped
397	3	306B	Primary	Classroom 307	W1	Cracking paint	4	1	1	<20 ug/ft2	Colormetric passed- waiting for Flame AA Results
398	3	306B	Primary	Classroom 307	W2	Cracking paint	See above	See above	See above	See above	See above
399	3	306B	Primary	Classroom 307	W3	Cracking paint at columns	See above	See above	See above	See above	See above
400	3	307	Primary	Classroom 307	W4	Cracking paint	See above	See above	See above	See above	See above
401	3	307	Storage	Classroom 307 Closet	W1	Peeling paint	2	1	1	<20 ug/ft2	Colormetric passed- waiting for Flame AA Results
402	3	307	Storage	Classroom 307 Closet	W2	Peeling paint	See above	See above	See above	See above	See above
403	3	307A	Storage	Classroom 307 Closet	W4	Peeling paint	See above	See above	See above	See above	See above
404	3	307A	Primary	Classroom 308	W1	Cracking & Chipping paint	4	1	1	<20 ug/ft2	Colormetric and Flame AA passed initial test.
405	3	307A	Primary	Classroom 308	W2	Cracking & peeling paint	See above	See above	See above	See above	See above
406	3	307A	Primary	Classroom 308	W3	Cracking, flaking, and peeling paint	See above	See above	See above	See above	See above
407	3	308	Primary	Classroom 308	W4	Cracking paint	See above	See above	See above	See above	See above
408	3	308	Storage	Classroom 308 Closet	W1	Cracking paint	See above	See above	See above	See above	See above
409	3	308	Storage	Classroom 308 Closet	W2	Severe peeling paint & Cracking paint	See above	See above	See above	See above	See above
410	3	308	Storage	Classroom 308 Closet	W3	Severe peeling paint, Efflorescence at window	See above	See above	See above	See above	See above
411	3	308A	Storage	Classroom 308 Closet	Ceiling	Tiles are badly damaged	See above	See above	See above	See above	See above
412	3	308A	Primary	Classroom 309	W1	Flaking & peeling paint	5	1	1	<20 ug/ft2	Colormetric and Flame AA passed
413	3	308A	Primary	Classroom 309	W2	Cracking paint	See above	See above	See above	See above	See above
414	3	308A	Primary	Classroom 309	W3	Peeling paint behind radiators, and at columns	See above	See above	See above	See above	See above

415	3	309	Primary	Classroom 309	W4	Cracking & peeling paint	See above	See above	See above	See above	See above	See above
416	3	309	Storage	Classroom 309 Closet	W1	No Access	See above	See above	See above	See above	See above	See above
417	3	309	Storage	Classroom 309 Closet	W2	No Access	See above	See above	See above	See above	See above	See above
418	3	309	Storage	Classroom 309 Closet	W3	No Access	See above	See above	See above	See above	See above	See above
419	3	309A	Storage	Classroom 309 Closet	W4	No Access (Severe peeling paint on wall and pipe by window - seen through the door)	See above	See above	See above	See above	See above	See above
420	3	309A	Storage	Classroom 309 Closet	Ceiling	No Access	See above	See above	See above	See above	See above	See above
421	3	309A	Storage	Classroom 309 Closet	Floor	No Access	See above	See above	See above	See above	See above	See above
422	3	309A	Primary	Classroom 310	W1	Cracking & peeling paint	4	1	1	<20 ug/ft2	Colormetric passed waiting on Flame AA Results	See above
423	3	309A	Primary	Classroom 310	W2	Cracking & peeling paint	See above	See above	See above	See above	See above	See above
424	3	309A	Primary	Classroom 310	W3	Cracking & peeling paint	See above	See above	See above	See above	See above	See above
425	3	310	Primary	Classroom 310	W4	Cracking & peeling paint including plenums	See above	See above	See above	See above	See above	See above
426	3	310	Primary	Classroom 310	Ceiling	Peeling paint at stage ceiling	See above	See above	See above	See above	See above	See above
427	3	310	Storage	Classroom 310 Closet	W1	No Access	See above	See above	See above	See above	See above	See above
428	3	310	Storage	Classroom 310 Closet	W2	No Access (Efflorescence, Damaged plaster, Flaking paint - seen through the door)	See above	See above	See above	See above	See above	See above
429	3	310	Storage	Classroom 310 Closet	W3	No Access	See above	See above	See above	See above	See above	See above
430	3	310A	Storage	Classroom 310 Closet	W4	No Access	See above	See above	See above	See above	See above	See above
431	3	310A	Storage	Classroom 310 Closet	Ceiling	No Access	See above	See above	See above	See above	See above	See above
432	3	310A	Storage	Classroom 310 Closet	Floor	No Access	See above	See above	See above	See above	See above	See above
433	3	310A	Storage	Classroom 310 Closet	W1	No Access	See above	See above	See above	See above	See above	See above
434	3	310A	Storage	Classroom 310 Closet	W2	No Access	See above	See above	See above	See above	See above	See above
435	3	310A	Storage	Classroom 310 Closet	W3	No Access (Cracking paint observed through door)	See above	See above	See above	See above	See above	See above
436	3	310B	Storage	Classroom 310 Closet	W4	No Access (Damaged plaster observed through door)	See above	See above	See above	See above	See above	See above
437	3	310B	Storage	Classroom 310 Closet	Ceiling	No Access (Damaged plaster observed through door)	See above	See above	See above	See above	See above	See above
438	3	310B	Storage	Classroom 310 Closet	Floor	No Access	See above	See above	See above	See above	See above	See above

439	3	310B	Primary	Classroom 311	W1	Cracking paint	4	1	1	<20 ug/ft2	Colormetric passed. Waiting for Flame AA Results
440	3	310B	Primary	Classroom 311	W2	Cracking & peeling paint	See above	See above	See above	See above	See above
441	3	310B	Primary	Classroom 311	W3	Cracking paint at columns	See above	See above	See above	See above	See above
442	3	311	Primary	Classroom 311	W4	Cracking & Spalling paint	See above	See above	See above	See above	See above
443	3	311	Storage	Classroom 311 Closet	W1	Cracking & Chipping paint	See above	See above	See above	See above	See above
444	3	311	Storage	Classroom 311 Closet	W2	Cracking & Chipping paint	See above	See above	See above	See above	See above
445	3	311	Storage	Classroom 311 Closet	W3	Efflorescence, Peeling & flaking paint	See above	See above	See above	See above	See above
446	3	311A	Storage	Classroom 311 Closet	W4	Cracking paint	See above	See above	See above	See above	See above
447	3	311A	Primary	Classroom 312	W1	Damaged plaster, Cracking & flaking paint	4	1	1	<20 ug/ft2	
448	3	311A	Primary	Classroom 312	W2	Cracking paint	See above	See above	See above	See above	See above
449	3	311A	Primary	Classroom 312	W3	Cracking paint at columns	See above	See above	See above	See above	See above
450	3	312	Primary	Classroom 312	W4	Cracking paint	See above	See above	See above	See above	See above
451	3	312	Storage	Classroom 312 Closet	W1	No Access	See above	See above	See above	See above	See above
452	3	312	Storage	Classroom 312 Closet	W2	No Access (Flaking paint observed through door)	See above	See above	See above	See above	See above
453	3	312	Storage	Classroom 312 Closet	W3	No Access (Flaking paint observed through door)	See above	See above	See above	See above	See above
454	3	312A	Storage	Classroom 312 Closet	W4	No Access	See above	See above	See above	See above	See above
455	3	312A	Storage	Classroom 312 Closet	Ceiling	No Access	See above	See above	See above	See above	See above
456	3	312A	Storage	Classroom 312 Closet	Floor	No Access	See above	See above	See above	See above	See above
457	3	312A	Student Restrooms - Female (4-12)	Girl's Restroom	W1	Severely peeling paint	4	1	1	<20 ug/ft2	Colormetric and Flame AA Passed
458	3	312A	Student Restrooms - Female (4-12)	Girl's Restroom	W2	Severely peeling paint	See above	See above	See above	See above	See above
459	3	312A	Student Restrooms - Female (4-12)	Girl's Restroom	W3	Severely peeling paint	See above	See above	See above	See above	See above
460	3	320	Student Restrooms - Female (4-12)	Girl's Restroom	W4	Severely peeling paint	See above	See above	See above	See above	See above
461	3	320	Student Restrooms - Female (4-12)	Girl's Restroom	Ceiling	Severely peeling paint	See above	See above	See above	See above	See above
462	3	320A	Student Restrooms - Male (4-12)	Boy's Restroom	W1	Peeling paint	4	1	1	34, <20 ug/ft2	Colormetric passed and Flame Failed initially on 8/20/2018. Retested and passed Colormetric and Flame AA on 8/22/2018
463	3	320A	Student Restrooms - Male (4-12)	Boy's Restroom	W2	Peeling paint	See above	See above	See above	See above	See above

464	3	320A	Student Restrooms - Male (4-12)	Boy's Restroom	W3	Peeling paint	See above	See above	See above	See above	See above
465	3	321	Student Restrooms - Male (4-12)	Boy's Restroom	W4	Peeling paint	See above	See above	See above	See above	See above
466	3	321	Student Restrooms - Male (4-12)	Boy's Restroom	Ceiling	Peeling paint	See above	See above	See above	See above	See above
467	3	321	Student Restrooms - Male (4-12)	Boy's Restroom	Floor	Peeling paint	See above	See above	See above	See above	See above
468	3	321A	Restrooms, Staff - Male	Men's Restroom Lounge	W3	Flaking paint behind pipe	2	1	1	<20 ug/ft2	Colormetric and Flame AA passed
469	3	322	Restrooms, Staff - Female	Men's Restroom	W1	Cracking paint	2	1	1	<20 ug/ft2	Colormetric and Flame AA passed
470	3	322	Restrooms, Staff - Female	Men's Restroom	W2	Cracking paint	See above	See above	See above	See above	See above
471	3	322	Restrooms, Staff - Female	Men's Restroom	W3	Cracking paint	See above	See above	See above	See above	See above
472	3	322A	Restrooms, Staff - Female	Men's Restroom	W4	Cracking paint	See above	See above	See above	See above	See above
473	3	322A	Circulation (Hallway)	Hallway from Classrooms 305 to 307	W1	Peeling & flaking paint	20	1	None	None	
474	3	322A	Circulation (Hallway)	Hallway from Classrooms 305 to 307	W2	-	See above	See above	See above	See above	See above
475	3	322A	Circulation (Hallway)	Hallway from Classrooms 305 to 307	W3	Cracking paint on wall including behind radiators	See above	See above	See above	See above	See above
476	3	H310	Circulation (Hallway)	Hallway from Classrooms 305 to 307	W4	-	See above	See above	See above	See above	See above
477	3	H310	Circulation (Hallway)	Hallway from Classrooms 305 to 307	Floor	Baseboard	20	1	None	None	
478	3	H310	Circulation (Hallway)	Hallway from Classrooms 301 to 304	W1	Efflorescence & damaged plaster at the arch by fire tower	See above	See above	See above	See above	See above
479	3	H310	Circulation (Hallway)	Hallway from Classrooms 301 to 304	W2	Severe peeling paint by stairwell	See above	See above	See above	See above	See above
480	3	H310	Circulation (Hallway)	Hallway from Classrooms 301 to 304	W3	-	See above	See above	See above	See above	See above
481	3	H311	Circulation (Hallway)	Hallway from Classrooms 301 to 304	W4	Damaged plaster at room 303	See above	See above	See above	See above	See above

482	3	H311	Circulation (Hallway)	Hallway from Classrooms 301 to 304	Floor	Baseboard	20	1	None	None	
483	3	H311	Circulation (Hallway)	Hallway from Classrooms 308 to 311	W1	Flaking paint	See above	See above	See above		
484	3	H311	Circulation (Hallway)	Hallway from Classrooms 308 to 311	W2	Severe peeling paint & flaking paint by 311	See above	See above	See above		
485	3	H311	Circulation (Hallway)	Hallway from Classrooms 308 to 311	W3	Damaged plaster at room 312, Cracking paint	See above	See above	See above		
486	3	H39	Circulation (Hallway)	Hallway from Classrooms 308 to 311	W4	Cracking paint	See above	See above	See above		
487	3	H39	Circulation (Hallway)	Hallway from Classrooms 308 to 311	Floor	Baseboard	See above	See above	See above		
488	3	H39	Stairs	Stairwell next to Classroom 308	W1	Peeling & flaking paint by windows and radiators	4	1	1	<20 ug/ft2	Colometric and Flame AA wipe Passed 1st time
489	3	H39	Stairs	Stairwell next to Classroom 308	W2	Cracking paint	See above	See above	See above	See above	See above
490	3	H39	Stairs	Stairwell next to Classroom 308	W3	Cracking paint	See above	See above	See above	See above	See above
491	3	S31	Stairs	Stairwell next to Classroom 308	W4	Cracking paint	See above	See above	See above	See above	See above
492	3	S31	Stairs	Stairwell next to Classroom 308	Ceiling	Peeling paint	See above	See above	See above	See above	See above
493	3	S31	Stairs	Stairwell next to Classroom 308	Floor	Baseboard	See above	See above	See above	See above	See above
494	3	S31	Stairs	Stairwell next to Classroom 304	W1	-	20	1	None	None	
495	3	S31	Stairs	Stairwell next to Classroom 304	W2	Peeling paint	See above	See above	See above	See above	
496	3	S31	Stairs	Stairwell next to Classroom 304	W3	-	See above	See above	See above	See above	
497	3	S36	Stairs	Stairwell next to Classroom 304	W4	Peeling paint	See above	See above	See above	See above	
498	3	S36	Stairs	Stairwell next to Classroom 304	Ceiling	Peeling paint	See above	See above	See above	See above	
499	3	S36	Stairs	Fire Tower next to Classroom 303	W1	Peeling paint	4	1	1	None.	1st and 2nd Colometric failed. Approved by OEMS for 3rd recleaning; no additional testing taken. Further action may be taken at a later date.

500	3	S36	Stairs	Fire Tower next to Classroom 303	W2	Peeling paint, & damaged plaster at window	See above	See above	See above	See above	See above
501	3	S36	Stairs	Fire Tower next to Classroom 303	W3	Peeling paint	See above	See above	See above	See above	See above
502	3	S38	Stairs	Fire Tower next to Classroom 303	W4	Peeling paint	See above	See above	See above	See above	See above
503	3	S38	Stairs	Fire Tower next to Classroom 303	Ceiling	Severe peeling paint	See above	See above	See above	See above	See above
504	3	S38	Stairs	Fire Tower next to Classroom 303	Floor	Debris	See above	See above	See above	See above	See above
505	3	S38	Stairs	Fire Tower walkway next to Classroom 303	W3	Damaged plaster & peeling paint	2	1	0	None-postponed. Colormetric taken only-1st attempt failed	Colormetric taken, failed 1st attempt. SDP approval to post pone recleaning and testing of the area.
506	3	S38A	Stairs	Fire Tower walkway next to Classroom 303	Ceiling	Peeling paint	See above	See above	See above	See above	See above
507	3	S38A	Gymnasium - Intermediate Middle	Gymnasium	W1	Cracking & Peeling paint	40	4	3	<20 ug/ft2, <20 ug/ft2	1st round of colormetric wipes- 1st one passed, second failed. 2nd Round: 4 colormetric wipes passed, 2 submitted for flame and passed.
508	3	S38A	Gymnasium - Intermediate Middle	Gymnasium	W2	Cracking & Peeling paint	See above	See above	See above	See above	See above
509	3	S38A	Gymnasium - Intermediate Middle	Gymnasium	W3	Cracking & Peeling paint	See above	See above	See above	See above	See above
510	B	1	Gymnasium - Intermediate Middle	Gymnasium	W4	Cracking & Peeling paint	See above	See above	See above	See above	See above
511	B	1	Gymnasium - Intermediate Middle	Gymnasium	Ceiling	Severe peeling paint including ductwork & beams	See above	See above	See above	See above	See above
512	B	1	Gymnasium - Intermediate Middle	Gymnasium	Floor	Debris along windows & chair	See above	See above	See above	See above	See above
513	B	1	Administrative Office	Gymnasium Office	W1	Peeling & flaking paint	1	1	1	32.8	Colormetric wipe passed, submitted for Flame AA which failed. Workers recleaned a 2nd time and encapsulated the floor with paint. Approved by OEMS.
514	B	1	Administrative Office	Gymnasium Office	W2	Efflorescence, Severe Peeling & flaking paint	See above	See above	See above	See above	See above
515	B	1	Administrative Office	Gymnasium Office	W3	Efflorescence, Severe Peeling & flaking paint	See above	See above	See above	See above	See above
516	B	001A	Administrative Office	Gymnasium Office	W4	Peeling & flaking paint	See above	See above	See above	See above	See above

517	B	001A	Administrative Office	Gymnasium Office	Ceiling	Severe peeling & flaking paint	See above	See above	See above	See above	See above
518	B	001A	Restrooms, Staff - Male/Female	Gymnasium Office Teacher's Restroom	W1	Cracking paint	See above	See above	See above	See above	See above
519	B	001A	Restrooms, Staff - Male/Female	Gymnasium Office Teacher's Restroom	W2	Cracking paint	See above	See above	See above	See above	See above
520	B	001A	Restrooms, Staff - Male/Female	Gymnasium Office Teacher's Restroom	W3	Cracking paint	See above	See above	See above	See above	See above
521	B	001C	Restrooms, Staff - Male/Female	Gymnasium Office Teacher's Restroom	W4	Cracking paint	See above	See above	See above	See above	See above
522	B	001C	Restrooms, Staff - Male/Female	Gymnasium Office Teacher's Restroom	Ceiling	Severe peeling paint including ductwork	See above	See above	See above	See above	See above
523	B	001C	Restrooms, Staff - Male/Female	Gymnasium Office Teacher's Restroom	Floor	Severe peeling paint	See above	See above	See above	See above	See above
524	B	001C	Storage	Gymnasium Storage closet at the far along Room 015	W1	Efflorescence & Severe peeling paint	Unknown area	Unknown area	Unknown area	Unknown area	Unknown area
525	B	001C	Storage	Gymnasium Storage closet at the far along Room 015	W2	Efflorescence & Severe peeling paint	Unknown area	Unknown area	Unknown area	Unknown area	Unknown area
526	B	001C	Storage	Gymnasium Storage closet at the far along Room 015	W3	Efflorescence & Severe peeling paint	Unknown area	Unknown area	Unknown area	Unknown area	Unknown area
527	B	001B	Storage	Gymnasium Storage closet at the far along Room 015	W4	Efflorescence & Severe peeling paint	Unknown area	Unknown area	Unknown area	Unknown area	Unknown area
528	B	001B	Storage	Gymnasium Storage closet at the far along Room 015	Ceiling	Severely damaged plaster, Peeling & flaking paint including ductwork	Unknown area	Unknown area	Unknown area	Unknown area	Unknown area
529	B	001B	Storage	Gymnasium Storage closet at the far along Room 015	Floor	Debris on electrical components & chair	Unknown area	Unknown area	Unknown area	Unknown area	Unknown area
530	B	001B	Storage	Gymnasium Storage Room	W1	Peeling & flaking paint	Unknown area	Unknown area	Unknown area	Unknown area	Unknown area
531	B	001B	Storage	Gymnasium Storage Room	W2	Peeling paint, flaking paint including pipes and window frame	4	1	0	None Colormetric failed-see comments	This area stabilized during the last few shifts of the project. Colormetric failed on site-Jerry Junod approved 2nd reclean and paint encapsulation of floor. No further wipes or Flame AA submitted per approval of OEMS.
532	B	001B	Storage	Gymnasium Storage Room	W3	Cracking paint	See above	See above	See above	See above	See above
533	B	2	Storage	Gymnasium Storage Room	W4	Peeling & flaking paint by the door	See above	See above	See above	See above	See above

534	B	2	Storage	Gymnasium Storage Room	Ceiling	Severe peeling paint, flaking paint including on ductwork	See above	See above	See above	See above	See above
535	B	2	Storage	Gymnasium Storage Room	Floor	Debris on floor and maintenance supplies	See above	See above	See above	See above	See above
536	B	4	Student Restrooms - Female (4-12)	Girl's Restroom	W1	Severe peeling paint	4	1	1	<20 ug/ft2	Colormetric passed and Flame AA Passed
537	B	4	Student Restrooms - Female (4-12)	Girl's Restroom	W2	Severe peeling paint	See above	See above	See above	See above	See above
538	B	4	Student Restrooms - Female (4-12)	Girl's Restroom	W3	Severe peeling paint	See above	See above	See above	See above	See above
539	B	5	Student Restrooms - Female (4-12)	Girl's Restroom	W4	Severe peeling paint	See above	See above	See above	See above	See above
540	B	5	Student Restrooms - Female (4-12)	Girl's Restroom	Ceiling	Severe peeling paint including radiators	See above	See above	See above	See above	See above
541	B	5	Student Restrooms - Female (4-12)	Girl's Restroom	Floor	Debris and peeling paint on baseboard	See above	See above	See above	See above	See above
542	B	5	Student Restrooms - Male (4-12)	Boy's Restroom	W1	Severe peeling paint	1	1	1	<20 ug/ft2	Colormetric passed and Flame AA Passed
543	B	5	Student Restrooms - Male (4-12)	Boy's Restroom	W2	Severe peeling paint	See above	See above	See above	See above	See above
544	B	5	Student Restrooms - Male (4-12)	Boy's Restroom	W3	Severe peeling paint	See above	See above	See above	See above	See above
545	B	6	Student Restrooms - Male (4-12)	Boy's Restroom	W4	Severe peeling paint	See above	See above	See above	See above	See above
546	B	6	Student Restrooms - Male (4-12)	Boy's Restroom	Ceiling	Severe peeling paint including radiators	See above	See above	See above	See above	See above
547	B	6	Student Restrooms - Male (4-12)	Boy's Restroom	Floor	Debris	See above	See above	See above	See above	See above
548	B	007B	Storage	Storage Closet in Hallway across Engineer's Office	W1	Peeling paint on pipe	See comments	See comments	See comments	See comments	This area was skipped. No time left during project duration. Project ended 10/12/2018
549	B	007B	Storage	Storage Closet in Hallway across Engineer's Office	W2	Peeling paint on wall, columns, and pipe	See comments	See comments	See comments	See comments	This area was skipped. No time left during project duration. Project ended 10/12/2018
550	B	007B	Storage	Storage Closet in Hallway across Engineer's Office	W3	Peeling paint on wall and pipe	See comments	See comments	See comments	See comments	This area was skipped. No time left during project duration. Project ended 10/12/2018
551	B	8	Storage	Storage Closet in Hallway across Engineer's Office	W4	Peeling paint	See comments	See comments	See comments	See comments	This area was skipped. No time left during project duration. Project ended 10/12/2018
552	B	8	Storage	Storage Closet in Hallway across Engineer's Office	Floor	Peeling paint	See comments	See comments	See comments	See comments	This area was skipped. No time left during project duration. Project ended 10/12/2018


553	B	8	Storage	Former Engineer's Office	W1	Cracking paint	See comments	See comments	See comments	See comments	This area did not have visible damage or chipping paint during project duration. This location skipped
554	B	8	Storage	Former Engineer's Office	W2	Cracking paint	See above	See above	See above	See above	See above
555	B	8	Storage	Former Engineer's Office	W3	Cracking paint	See above	See above	See above	See above	See above
556	B	9	Storage	Former Engineer's Office	W4	Cracking paint	See above	See above	See above	See above	See above
557	B	9	Storage	Former Engineer's Office	Ceiling	Cracking, peeling, and flaking paint	See above	See above	See above	See above	See above
558	B	11	Cafeteria (Dining Area)	Kitchen/Cafeteria with Walk-in Freezer	W1	Cracking, peeling, and flaking paint	20	4	2	61, <20 ug/ft2	East Corner and West Corner were sampled and both <20. 1st Colormetric taken on 8/23/2018 passed, 2nd Colormetric on 8/23/2018 failed. Stopped sampling and asked to reclean. Resampled and passed 8/24/2018
559	B	11	Cafeteria (Dining Area)	Kitchen/Cafeteria with Walk-in Freezer	W2	Cracking, peeling, and flaking paint	See above	See above	See above	See above	See above
560	B	11	Cafeteria (Dining Area)	Kitchen/Cafeteria with Walk-in Freezer	W3	Cracking paint	See above	See above	See above	See above	See above
561	B	12	Cafeteria (Dining Area)	Kitchen/Cafeteria with Walk-in Freezer	W4	Cracking paint	See above	See above	See above	See above	See above
562	B	12	Cafeteria (Dining Area)	Kitchen/Cafeteria with Walk-in Freezer	Ceiling	peeling paint	See above	See above	See above	See above	See above
563	B	12	Cafeteria (Dining Area)	Kitchen/Cafeteria with Walk-in Freezer	Floor	peeling paint including baseboard	See above	See above	See above	See above	See above
564	B	12	Kitchen	Storage between Lunch Rooms	W1	No Access	10	2	2	24, <20 ug/ft2 (retest)	1st Colormetric passed, 2nd Colormetric sent to get analyzed for Flame AA- Failed. Retested and recleaned 8/24/2018 and passed <20.
565	B	12	Kitchen	Storage between Lunch Rooms	W2	No Access	See above	See above	See above	See above	See above
566	B	12	Kitchen	Storage between Lunch Rooms	W3	No Access	See above	See above	See above	See above	See above
567	B	012A	Kitchen	Storage between Lunch Rooms	W4	No Access	See above	See above	See above	See above	See above
568	B	012A	Kitchen	Storage between Lunch Rooms	Ceiling	No Access	See above	See above	See above	See above	See above
569	B	012A	Kitchen	Storage between Lunch Rooms	Floor	No Access	See above	See above	See above	See above	See above

570	B	012A	Circulation (Hallway)	Hallway between Lunch Rooms	W1	Cracking paint	10	4	2	<20 ug/ft2	First Colormetric failed, re-cleaned and tested - passed 8/23/2018
571	B	012A	Circulation (Hallway)	Hallway between Lunch Rooms	W2	Cracking paint	See above	See above	See above	See above	See above
572	B	012A	Circulation (Hallway)	Hallway between Lunch Rooms	W3	Cracking paint	See above	See above	See above	See above	See above
573	B	13	Circulation (Hallway)	Hallway between Lunch Rooms	W4	Cracking paint	See above	See above	See above	See above	See above
574	B	13	Circulation (Hallway)	Hallway between Lunch Rooms	Ceiling	Peeling paint	See above	See above	See above	See above	See above
575	B	13	Cafeteria (Dining Area)	Cafeteria	W1	Cracking & flaking paint	10	2	2	25, <20 ug/ft2	First Colormetric failed, re-cleaned and Colormetric/Flame AA tested -passed 8/23/2018
576	B	13	Cafeteria (Dining Area)	Cafeteria	W3	Damaged plaster, Efflorescence, severe peeling paint, and cracking paint	See above	See above	See above	See above	See above
577	B	14	Cafeteria (Dining Area)	Cafeteria	W4	flaking paint underneath the shelf	See above	See above	See above	See above	See above
578	B	14	Cafeteria (Dining Area)	Cafeteria	Floor	flaking paint	See above	See above	See above	See above	See above
579	B	14	Primary	Art Room	W1	Severe peeling paint near window	5	1	1	<20 ug/ft2	Colormetric and Flame AA passed
580	B	14	Primary	Art Room	W2	Peeling paint near middle column	See above	See above	See above	See above	See above
581	B	14	Primary	Art Room	W3	Efflorescence & severe peeling paint	See above	See above	See above	See above	See above
582	B	15	Primary	Art Room	W4	Peeling & flaking paint	See above	See above	See above	See above	See above
583	B	15	Storage	Art Room Large Storage Closet	W1	Cracking paint, damaged plaster	See above	See above	See above	See above	See above
584	B	15	Storage	Art Room Large Storage Closet	W3	Efflorescence & severe peeling paint	See above	See above	See above	See above	See above
585	B	15A	Storage	Art Room Large Storage Closet	W4	Severe peeling paint	See above	See above	See above	See above	See above
586	B	15A	Storage	Art Room Small Storage Closet	W1	Cracking paint	See above	See above	See above	See above	See above
587	B	15A	Storage	Art Room Small Storage Closet	W2	Severe peeling paint	See above	See above	See above	See above	See above
588	B	15A	Storage	Art Room Small Storage Closet	W3	Severe peeling paint	See above	See above	See above	See above	See above
589	B	15B	Storage	Art Room Small Storage Closet	Ceiling	Peeling paint	See above	See above	See above	See above	See above
590	B	15B	Circulation (Hallway)	Hallway by the Gym	W1	Severe peeling paint & flaking paint	Where is this area? 2 existing Basement Hallways already tested	Where is this area? 2 existing Basement Hallways already tested	Where is this area? 2 existing Basement Hallways already tested	Where is this area? 2 existing Basement Hallways already tested	Where is this area? 2 existing Basement Hallways already tested

591	B	15B	Circulation (Hallway)	Hallway by the Gym	W2	Severe peeling paint & flaking paint	See above	See above	See above	See above	See above
592	B	15B	Circulation (Hallway)	Hallway by the Gym	W3	Severe peeling paint & flaking paint	See above	See above	See above	See above	See above
593	B	H01	Circulation (Hallway)	Hallway by the Gym	W4	Severe peeling paint & flaking paint	See above	See above	See above	See above	See above
594	B	H01	Circulation (Hallway)	Hallway by the Gym	Ceiling	Severe peeling paint & flaking paint including ductwork and pipes	See above	See above	See above	See above	See above
595	B	H01	Circulation (Hallway)	Hallway by the Gym	Floor	Baseboard	See above	See above	See above	See above	See above
596	B	H01	Circulation (Hallway)	Storage area in Hallway by the Gym	W1	Severe peeling paint & flaking paint	2	1	1	205	Colormetric Passed, Submitted for Flame AA testing which failed. 2nd cleaning occurred as well as encapsulation of the floor with paint on 10/12/2018. No additional wipes taken as floor was immediately painted after result failed
597	B	H01	Circulation (Hallway)	Storage area in Hallway by the Gym	W2	Severe peeling paint & flaking paint	See above	See above	See above	See above	See above
598	B	H01	Circulation (Hallway)	Storage area in Hallway by the Gym	W3	Severe peeling paint & flaking paint	See above	See above	See above	See above	See above
599	B	H01A	Circulation (Hallway)	Storage area in Hallway by the Gym	W4	Severe peeling paint & flaking paint	See above	See above	See above	See above	See above
600	B	H01A	Circulation (Hallway)	Hallway by the Building Engineer's Office and the Boy's and Girl's Restrooms	W2	Cracking paint	20	2	2	7.6 , <20 ug/ft2	Colormetric passed, then submitted for Flame AA which failed. Cleaned and retested 8/24/2018. Passed 2nd Colormetric and Flame AA on 8/24/2018. Went back for more scraping on 9/24. Scraped and painted and passed this second round of testing as well
601	B	H01A	Circulation (Hallway)	Hallway by the Building Engineer's Office and the Boy's and Girl's Restrooms	W3	Peeling paint on electrical conduit by stairs	See above	See above	See above	See above	See above
602	B	H02	Circulation (Hallway)	Hallway by the Building Engineer's Office and the Boy's and Girl's Restrooms	W4	Cracking, peeling, and flaking paint	See above	See above	See above	See above	See above


603	B	H02	Circulation (Hallway)	Hallway by the Building Engineer's Office and the Boy's and Girl's Restrooms	Ceiling	Peeling & flaking paint	See above	See above	See above	See above	See above
604	B	H02	Circulation (Hallway)	Hallway by the Building Engineer's Office and the Boy's and Girl's Restrooms	Floor	Baseboard	See above	See above	See above	See above	See above
605	B	H02	Stairs	Stairwell between the Cafeteria and Art Room	W1	Peeling paint above entrance	See results of Task ID#s 184/329/488	See results of Task ID#s 184/329/488	See results of Task ID#s 184/329/488	See results of Task ID#s 184/329/488	See results of Task ID#s 184/329/488
606	B	H02	Stairs	Stairwell between the Cafeteria and Art Room	W2	Cracking & Peeling paint	See results of Task ID#s 184/329/488	See results of Task ID#s 184/329/488	See results of Task ID#s 184/329/488	See results of Task ID#s 184/329/488	See results of Task ID#s 184/329/488
607	B	H02	Stairs	Stairwell between the Cafeteria and Art Room	W3	Cracking paint	See results of Task ID#s 184/329/488	See results of Task ID#s 184/329/488	See results of Task ID#s 184/329/488	See results of Task ID#s 184/329/488	See results of Task ID#s 184/329/488
608	B	S01	Stairs	Stairwell between the Cafeteria and Art Room	W4	Cracking & Peeling paint	See results of Task ID#s 184/329/488	See results of Task ID#s 184/329/488	See results of Task ID#s 184/329/488	See results of Task ID#s 184/329/488	See results of Task ID#s 184/329/488
609	B	S01	Stairs	Stairwell between the Cafeteria and Art Room	Ceiling	Peeling paint at landings	See results of Task ID#s 184/329/488	See results of Task ID#s 184/329/488	See results of Task ID#s 184/329/488	See results of Task ID#s 184/329/488	See results of Task ID#s 184/329/488
610	B	S01	Stairs	Stairwell between the Cafeteria and Art Room	Floor	Baseboard	See results of Task ID#s 184/329/488	See results of Task ID#s 184/329/488	See results of Task ID#s 184/329/488	See results of Task ID#s 184/329/488	See results of Task ID#s 184/329/488
611	B	S01	Stairs	Stairwell between the Boy's and Girl's Restrooms	W3	Damaged plaster, Peeling & flaking paint	20	1	None	None	
612	B	S06	Stairs	Stairwell between the Boy's and Girl's Restrooms	Ceiling	Peeling paint at landings	See above	See above	See above	See above	
613	B	S06	Stairs	Stairwell between the Boy's and Girl's Restrooms	Floor	Baseboard	See above	See above	See above	See above	
614	1		Stairwell	Main Entrance Stairwell next to Nurse's Office	W1	Scraping needed on walls	2	1	1	<20 ug/ft2	Colorimetric and Flame AA passed

Appendix E. Photographs

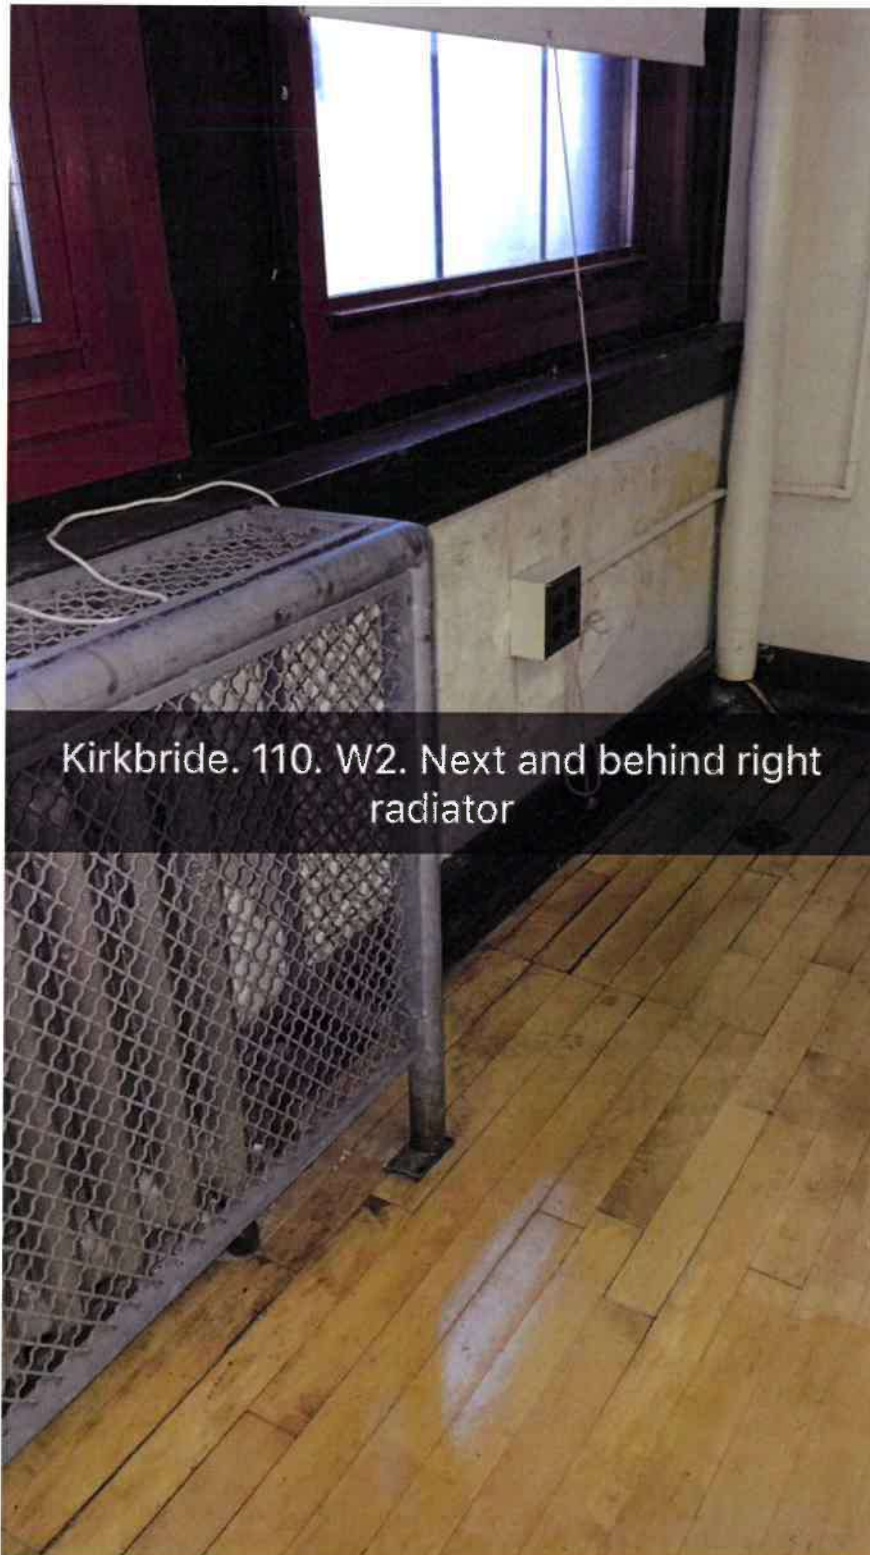


Kirkbride. 110. W2. Next and behind right radiator


Prior to stabilization.

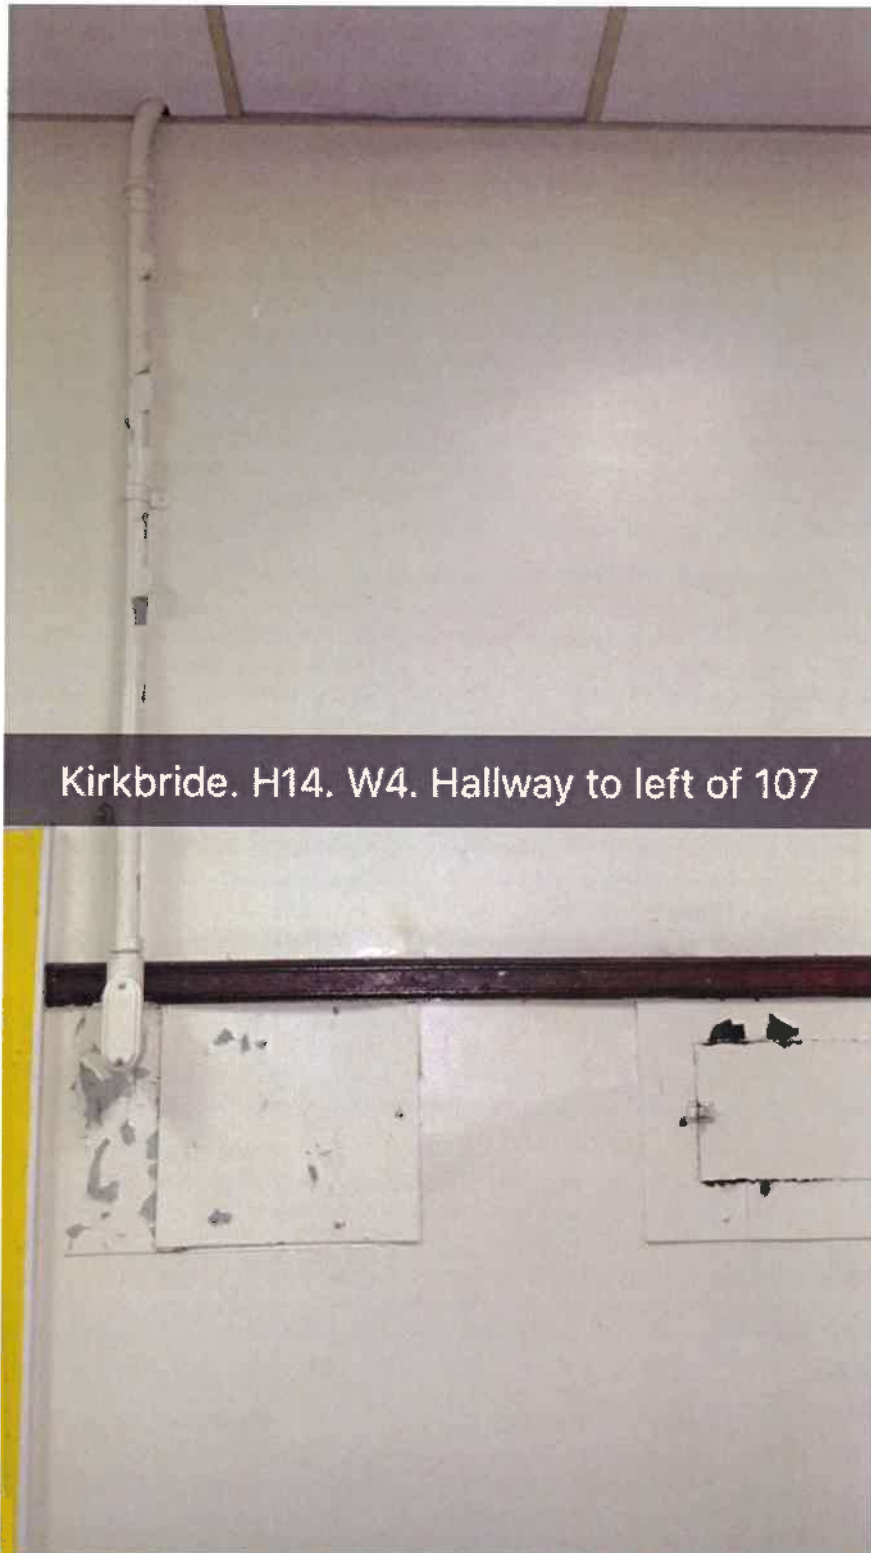

Prior to stabilization.

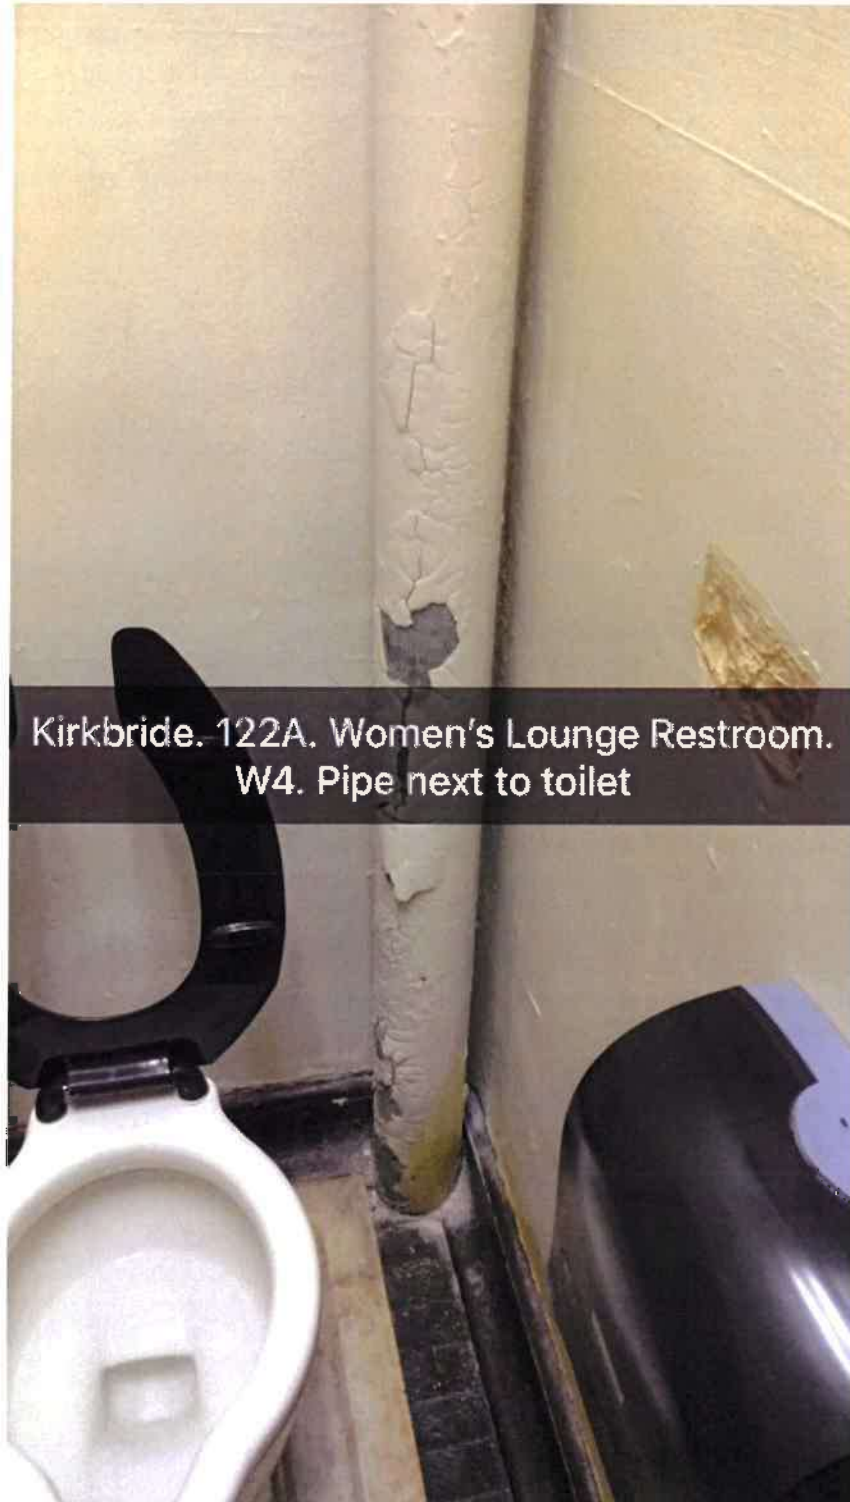

Prior to stabilization.

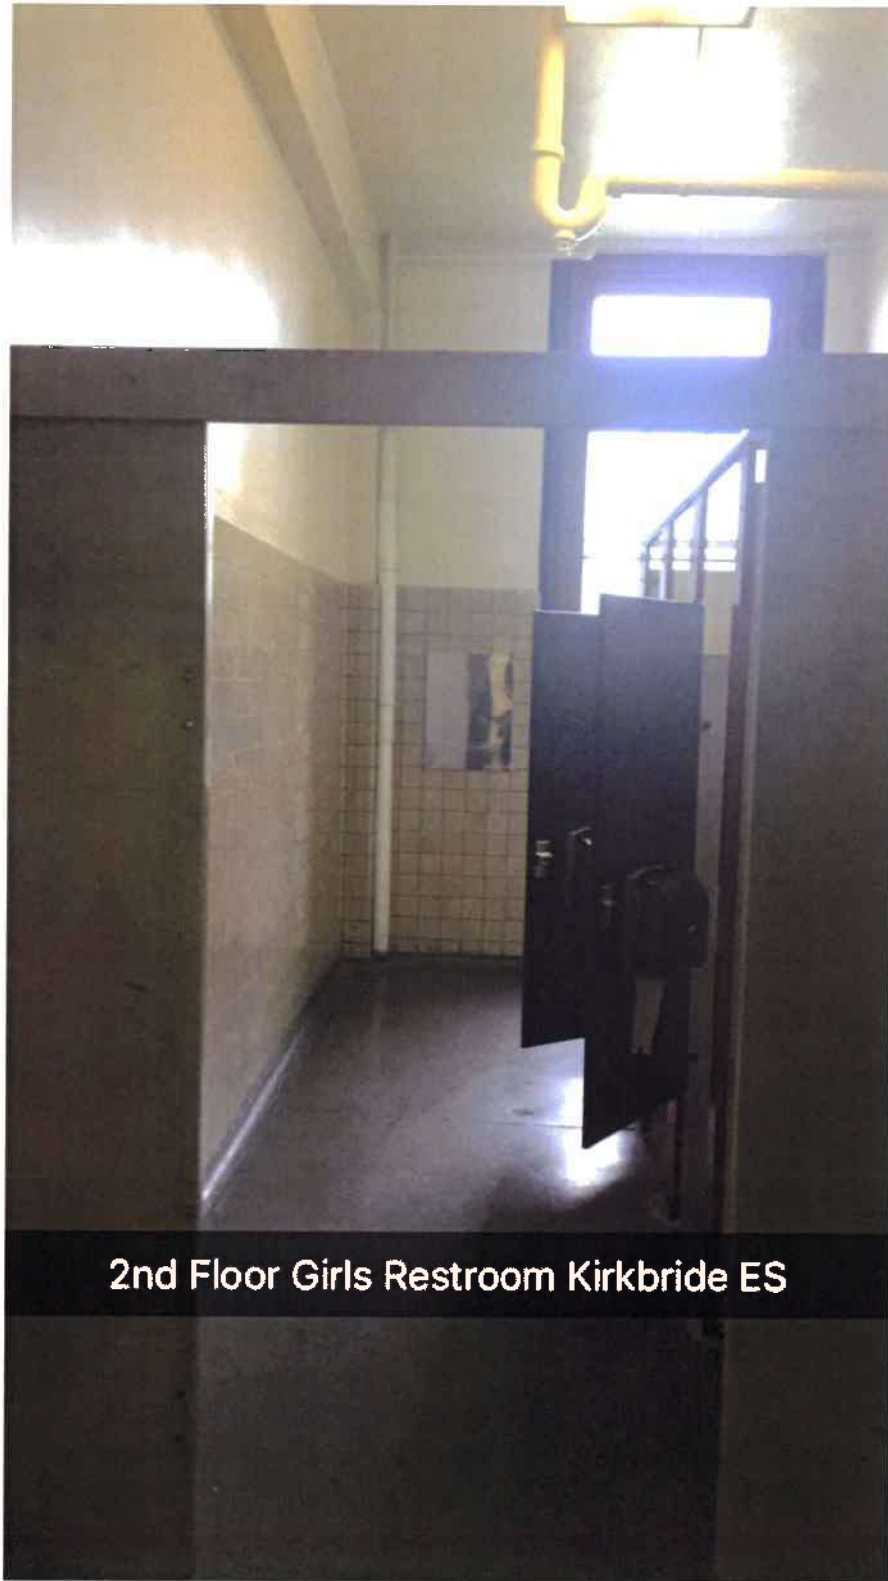

2nd Floor Girls Restroom Kirkbride ES

Following stabilization



**Basement Hallway next to Lunchrooms
Kirkbride ES**

Following stabilization



Classroom 108 Kirkbride ES

Following stabilization

***Appendix F. Environmental Firm Certification Documentation of
Training***

Documentation of Criterion Employees Assigned to Site with EPA RRP & Dust Sampling Technician Training

First Name	Last Name	Course Description	Course End Date	Expiration Date
Julie	Mui	EPA-Lead Renovator Initial	4/8/2016	4/8/2021
Julie	Mui	Dust Sampling Technician Initial	1/8/2018	1/8/2023
Isa	Haj	EPA-Lead Renovator Initial	11/20/2015	11/20/2020
Isa	Haj	Dust Sampling Technician Initial	1/8/2018	1/8/2023
Mary Anne	Lerro	EPA-Lead Renovator Initial	9/10/2015	9/10/2020
Mary Anne	Lerro	Dust Sampling Technician Initial	1/8/2018	1/8/2023
Alyssa	Cartagena	EPA-Lead Renovator Initial	6/11/2018	6/11/2023
Alyssa	Cartagena	Dust Sampling Technician Initial	11/2/2016	11/2/2021
Gina	Fernandes	EPA-Lead Renovator Initial	12/3/2018	12/3/2023
Gina	Fernandes	Dust Sampling Technician Initial	11/20/2018	11/20/2023
Cristopher	Karoly	EPA-Lead Renovator Initial	12/17/2018	12/17/2023
Cristopher	Karoly	Dust Sampling Technician Initial	11/20/2018	11/20/2023
Jackie	Neiman	EPA-Lead Renovator Initial	6/11/2018	6/11/2023
Jackie	Neiman	Dust Sampling Technician Initial	6/14/2018	6/14/2023
Nicollete	Raleigh	EPA-Lead Renovator Initial	8/28/2018	8/28/2023

***Appendix G. Painting Contractor Certifications or Documentation of
Training***

United States Environmental Protection Agency

This is to certify that



Hispanic Ventures Inc

has fulfilled the requirements of the Toxic Substances Control Act (TSCA) Section 402, and has received certification to conduct lead-based paint renovation, repair, and painting activities pursuant to 40 CFR Part 745.89

In the jurisdiction of:

All EPA Administered States, Tribes, and Territories

This certification is valid from the date of issuance and expires May 01, 2020

NAT-31364-2

Certification #

March 24, 2015

Issued On

Michelle Price

Michelle Price, Chief

Lead, Heavy Metals, and Inorganics Branch



Documentation of Contractor EPA RRP Training

First Name	Last Name	Course Description	Course End Date	Expiration Date
Martin	McNulty	EPA-Lead Renovator Initial	7/13/2018	7/13/2023

Appendix H. Documentation of Parent and Staff Notification



Eliza B. Kirkbride Elementary School
1501 South 7th Street
Philadelphia, PA 19147

Rebecca Julien
Principal

Telephone: 215-400-7980
Fax: 215-400-7981

Notice of Building Improvement Project:
Paint and Plaster Stabilization

Dear School Families,

The School District of Philadelphia works daily to ensure that our students and staff have a safe, healthy environment in which to learn and work. On behalf of the School District, I am writing to share information with you about plans for renovation to remove loose and peeling paint in our school building. The goal of the work is to enhance classroom environments and remove the risk of lead exposure to children in our school community.

The School District has begun paint and plaster stabilization work in school buildings constructed prior to 1978 that are likely to contain lead-based paint. Paint stabilization involves removing loose, peeling, flaking and crumbling paint and plaster under controlled conditions. Our school has been selected for this work because paint damage was documented in occupied spaces such as classrooms and classroom closets, administrative offices, cafeteria, auditorium, bathrooms, kitchen, hallways, and emergency exit stairways.

The work is being completed by individuals who are trained and certified in United States Environmental Protection Agency (EPA) lead-based paint renovation, repair and painting work practices. These work practices ensure that classrooms and other areas are free of paint chips, dust and debris. A quality control assessment will take place after the work is completed in each area to ensure that the spaces are ready for students and staff to safely occupy.

Details about the project including the environmental consultant's assessment report, project schedule and frequently asked questions are available in the school's main office or by visiting www.philasd.org/facilities. Copies will also be provided to the School Advisory Council and Home and School Association in the near future.

We understand that you likely will have additional questions, and we will work to address those promptly. The School District will host a meeting for families to share an overview of the repairs and to answer questions on **Wednesday, November 14, 2018 at 5:00 PM** in the school auditorium.

Sincerely,
Rebecca Julien
Principal