

SCHOOL DISTRICT OF PHILADELPHIA



Asbestos Hazard Emergency Response Act “AHERA”

THREE-YEAR RE-INSPECTION 2015-2016 and ASBESTOS MANAGEMENT PLAN for the

Swenson Arts and Technology High School

**ULCS# 8090
Building # B809001-1
2750 Red Lion Road
Philadelphia, Pennsylvania
19114**

Year Built: 1976

December 2015

Conducted by:

Accredited Environmental Technologies, Incorporated
Batta Environmental Associates, Incorporated
Criterion Laboratories, Incorporated
Environmental Testing Consultants, LLC
G & C Environmental Services, Incorporated
KEM Partners, Incorporated
Synertech, Inc.
TTI Environmental, Inc.
USA Environmental Management, Inc.
The Vertex Companies, Inc.

Management Plan Prepared by:
Criterion Labs, Inc. and Synertech Inc.

This report must remain in the Main Office as mandated by the US EPA AHERA Regulations.

AHERA THREE-YEAR REINSPECTION VOLUME IX

Table of Contents

Transmittal Letter

Executive Summary

- I. Summary list of Confirmed Asbestos Containing Building Materials
- II. Summary list of Assumed Asbestos Contain Building Materials
- III. Summary list of Non-Asbestos Containing Building Materials
- IV. Summary list of Non Suspect Asbestos Containing Building Materials
- V. Summary List of Auditorium DATA for this location
- VI. Summary list of Attic and/or Crawlspace DATA for this location
- VII. Summary list of Pipe Chase/Pipe Shaft DATA for this location

Section I Report of Re-Inspection

- A. Introduction
- B. Three-Year Re-inspection IX Overview
- C. Post- Management Plan Activities and Changes
 - C.1 - Sampling and Analysis
 - C.2 - New Floor Tile Sampling
 - C.3 - Abatement Activity
 - C.4 - Periodic (Six-Month) Surveillance (Damaged Materials)

Section II Re-Inspection Data

- A. Introduction
- B. Re-Inspection Key Definitions
- C. Room by Room Location Log Report

Section III Certificates

- A. Management Planner/Building Inspector Certificates

Section IV	Cross Reference Table	Page 1-8
	Asbestos Management Program	Page 9-19

SCHOOL DISTRICT OF PHILADELPHIA
EDUCATIONAL CENTER
440 NORTH BROAD STREET
PHILADELPHIA, PENNSYLVANIA 19130

OFFICE OF ENVIRONMENTAL MANAGEMENT AND SERVICES

PHONE (215)-400-4750

January 2016

TO: All Principals
All Building Administrators

FROM: Fran Burns
Chief Operating Officer

Francine Locke, M.S., Director
Office of Environmental Management and Services

SUBJECT: AHERA Three (3) Year Re-inspection IX report

In order to comply with the provisions of the Asbestos Hazard Emergency Response Act (AHERA) the attached report is submitted to you. The law requires that this report be kept in the Main/Principal's office. It cannot be removed from these locations. *If the school (program) is relocated to a different building, these environmental documents are to be safely retained for the next school/building occupants.* All asbestos reports must be available to the public and Federal EPA upon request.



Fran Burns
Chief Operation Officer

Francine Locke, M.S., Director
Office of Environmental Management
and Services

Executive Summary

This Asbestos Hazard Emergency Response Act (AHERA) Three-Year Re-inspection “Volume # IX” Management Plan at this location, has been completed and the report of re-inspection submitted to the School District of Philadelphia. The re-inspections in all School District of Philadelphia buildings of 2015-2016 were conducted and completed between October 5th, 2015 through March 30th, 2016 as a joint project by Accredited Environmental Technologies, Inc., Batta Environmental Associates, Inc., Criterion Laboratories, Inc., Environmental Testing Consultants, LLC, G & C Environmental Services, Inc., KEM Partners, Inc., Synertech, Inc., TTI Environmental, Inc., USA Environmental Management, Inc. and The Vertex Companies, Inc.

In general, the School District of Philadelphia Office of Environmental Management and Services conducts Environmental Impact Evaluations and provides Asbestos Inspection Reports prior to any renovation, demolition and/or maintenance activities. The AHERA report must be reviewed prior to any renovation, demolition and/or maintenance activities in order to avoid the unknowing disturbance to Asbestos Containing Building Materials identified within this location. In addition, prior to work activities above all drop ceilings this report should be reviewed to avoid potential disturbances to Asbestos Containing Materials. Refer to Section IV of the Cross Reference Table, for additional Asbestos Management Program information. Contact the Office of Environmental Management and Services to have an Environmental Impact Evaluation conducted prior to any renovation, demolition and/or maintenance activities within this facility.

The information contained in this report was obtained from the original Asbestos Management Plan for the school, from update reports on changes and activities since the completion of the 1st Management Plan for each location and from all prior inspections performed and documented in Volume # I through Volume VIII (dated respectively 1992, 1995, 1998, 2001, 2004, 2007, 2010 or 2013) (if applicable) - and by this Three-Year Re-inspection of this school. The re-inspection report/Management Plan of 2015-2016 were reviewed and prepared collectively by Management Planner Megan Vala, Mary Anne Lerro of Criterion Laboratories, Inc. and/or Monique Causley, of Synertech Inc.

The 2015-2016 inspection process included the addition of a comprehensive Room by Room Inventory of all Thermal (T), Surfacing (S) and Miscellaneous (M) Materials specific to each room of this facility. Inspections of each room's thermal, ceilings, walls, floors and miscellaneous items regardless of Asbestos Content are categorized on the Room by Room Location Log Report for this location. Rooms or areas of the facility that were not accessible at the time of the inspection are marked with an "X". The Room by Room Location Log Report is found in Section II C of this Management Plan.

All Presumed or Suspect Asbestos Containing Building Materials (ACBMs), listed in the following summary charts are categorized as Confirmed, Assumed, Non-Asbestos, and/or Non-Suspect (ACBMs) were identified in the original Management Plan, or in the Volume I through Volume VIII AHERA Three-Year Re-inspection reports, and were re-inspected as part of this project.

As mandated by the U S EPA AHERA regulations, periodic Six-Month inspections and Three-Year Re-inspections of this location will be performed and the Inspection Data in this report will be updated accordingly.

Please feel free to contact the School District of Philadelphia's Office of Environmental Management and Services (OEMS) regarding any comments, questions, or concerns regarding this report or any Environmental related topic. OEMS staff can be reached at (215) 400 4750, via fax at (215) 400 4751 or via e-mail at flocke@philasd.org and/or gfunod@philasd.org.

Additional information can be found on our website. Here is the link to the OEMS website.
<http://webgui.phila.k12.pa.us/offices/e/environmental>

I. Summary list of Confirmed Asbestos Containing Building Materials within this facility

These charts are to be used for a quick reference* in order to avoid the unknowing disturbance of Asbestos Containing Materials during any and all Operations, Maintenance, Renovation, and/or Demolition activities at this location. *These materials have been sampled and Laboratory Analysis has CONFIRMED the presence of Asbestos. Contact OEMS prior to the disturbance of any of the following materials.*

Confirmed Asbestos Containing Building Materials for this location

Transite

* *Always refer to the Room by Room Logs for each specific material classification as the material classification findings may be different in various rooms throughout this facility.*

** *Some Materials may have multiple classifications (Confirmed, Assumed, NAD and Non Suspect) within this facility.*

II. Summary list of Assumed Asbestos Containing Building Materials within this facility

These charts are to be used for a quick reference* in order to avoid the unknowing disturbance of Asbestos Containing Materials during any and all Operations, Maintenance, Renovation, and/or Demolition activities at this location. These materials have not been sampled and should not be disturbed until verification of Asbestos Content. Contact OEMS for assessment and sampling prior to the disturbance of these materials.

Assumed Asbestos Containing Building Materials for this location

Blackboard Glue Dots	Pipe Insulation > 6 inch	Transite Sills
Floor Tile VAT 12" x 12"	Pipe Insulation 2-6 inch	Vibration Damper Cloth
Pipe Fitting Insulation	Plaster Ceiling	

** Always refer to the Room by Room Logs for each specific material classification as the material classification findings may be different in various rooms throughout this facility.*

*** Some Materials may have multiple classifications (Confirmed, Assumed, NAD and Non Suspect) within this facility.*

III. Summary list of Non-Asbestos Containing Building Materials within this facility

These charts are to be used for a quick reference* in order to avoid the unknowing disturbance of Asbestos Containing Materials during any and all Operations, Maintenance, Renovation, and/or Demolition activities at this location. *These materials have been sampled and Laboratory Analysis has indicated NO Asbestos present or NO ASBESTOS DETECTED (NAD).*

Non- Asbestos Containing Building Materials for this location

Ceiling Tile 2' x 4'

* *Always refer to the Room by Room Logs for each specific material classification as the material classification findings may be different in various rooms throughout this facility.*

** *Some Materials may have multiple classifications (Confirmed, Assumed, NAD and Non Suspect) within this facility.*

IV. Summary list of Non-Suspect Asbestos Containing Building Materials within this facility

These charts are to be used for a quick reference* in order to avoid the unknowing disturbance of Asbestos Containing Materials during any and all Operations, Maintenance, Renovation, and/or Demolition activities at this location. These materials are not typically known to contain Asbestos.

Non-Suspect Asbestos Containing Building Materials for this location

Carpet	Concrete Ceiling	Metal Wall
Ceiling Tile 2' x 4'	Concrete Floor	Sheetrock Ceiling
Cement Floor	Fiberglass Pipe Fitting Insulation	Sheetrock Wall
Ceramic Tile Floors	Fiberglass Pipe Insulation	Wood Floor
Ceramic Tile Walls	Metal Ceiling	
Concrete Block Wall	Metal Deck	

** Always refer to the Room by Room Logs for each specific material classification as the material classification findings may be different in various rooms throughout this facility.*

*** Some Materials may have multiple classifications (Confirmed, Assumed, NAD and Non Suspect) within this facility.*

V. Summary list of Auditorium DATA for this location

These charts are to be used for a quick reference of the Auditorium DATA within this facility. Sampling of the Auditorium Ceilings throughout the District is more difficult because of the various ceiling heights. As sampling occurs this information is updated on a case by case basis for each specific location and facility.

This is a list of known materials for this location's Auditorium

This building does not have an Auditorium.

** Always refer to the Room by Room Logs for each specific material classification as the material classification findings may be different in various rooms throughout this facility.*

*** Some Materials may have multiple classifications (Confirmed, Assumed, NAD and Non Suspect) within this facility.*

VI. Summary list of Attic and/or Crawlspace DATA for this location

These charts are to be used for a quick reference regarding the Attics and/or Crawlspaces inspection DATA within this facility. Contact OEMS prior to entering any attic or crawlspace within this facility and refer to the below chart and legend for Category Rank determination. The Data relative to these spaces is updated as conditions change regarding Abatement or Renovation activity on a case by case basis for each specific location and facility. In general, Crawlspaces are below the basement or 1st floor and Attics are above the floor space.

Category Rank Legend

"A" - No Asbestos Containing Materials - Sample Results indicate NO ACM on pipes, fittings, elbows, or equipment located within this functional space, and NO VISIBLE DEBRIS or DAMAGE observed at time of this inspection.
"B" - Asbestos Containing Materials Exist - Sample Results indicate ACM on pipes, fittings, elbows, or equipment located within this functional space, HOWEVER, NO VISIBLE DEBRIS or DAMAGE observed at time of this inspection.
"C" - Asbestos Containing Materials Exist - Sample Results indicate ACM on pipes, fittings, elbows, or equipment located within this functional space, and LOCALIZED VISIBLE DEBRIS or DAMAGE observed at time of this inspection.
"D" - Asbestos Containing Materials Exist - Sample Results indicate ACM on pipes, fittings, elbows, or equipment located within this functional space and DISTRIBUTED VISIBLE DEBRIS or SIGNIFICANT DAMAGE observed at time of this inspection.
"E" - No Bulk Sample Results Available SUSPECT ACM OBSERVED. Contact OEMS immediately for additional instructions.

Attic/Crawlspace	Access Area	Floor Surface	Category Rank	Comments
Attic	X	X	X	No Attic
Crawlspace	X	X	X	No Crawlspace

VII. Summary list of Pipe Chase/Pipe Shaft DATA for this location

These charts are to be used for a quick reference regarding the information known about the Pipe Chases and/or Pipe Shafts inspection DATA within this facility. Contact OEMS prior to performing renovation activities any Pipe Chase and/or Pipe Shaft within this facility and refer to the below chart and legend for Asbestos Content of various materials identified within each space. The Data relative to these spaces is updated as conditions change regarding Inspection, Abatement and/or Renovation activity on a case by case basis for each specific location and facility. In general, Pipe Chases are horizontal spaces and Pipe Shafts are vertical spaces.

Pipe Chases and Pipe Shafts need to be assessed.

Section I

Report of Re-Inspection

A. Introduction

B. Three-Year Re-Inspection IX Overview

C. Post-Management Plan Activities and Changes

C.1 Sampling and Analysis

C.2 New Floor Tile Sampling

C.3 Abatement Activity

C.4 Periodic Six-Month Surveillance (Damaged Materials)

Section I - A

Report of Re-inspection

Introduction

The Three-Year Re-inspection IX was performed to fulfill the requirements of 40 CFR Part 763 - the Asbestos Hazard Emergency Response Act (AHERA). As required by AHERA, each Local Education Agency (LEA) must re-inspect all known confirmed or assumed Asbestos Containing Building Material (ACBM) located in the LEA's facilities. This re-inspection is intended to update the original Asbestos Management Plan for the LEA's facilities.

Multiple Building Inspectors of several firms performed the 2015/2016 re-inspection. The re-inspection report/Management Plan of 2015-2016 were reviewed and prepared collectively by Management Planner Megan Vala, Mary Anne Lerro of Criterion Laboratories, Inc. and Monique Causley, of Synertech Inc.

All of the certificates can be found in Section III.

During the re-inspection of each School District of Philadelphia facility, all of the Management Plans for that facility were reviewed. Information from the conclusions section of that report is included in this report. Additionally, information on activities such as abatements, cleanings, sampling and inspections, which have taken place since the completion of the original Management Plan, were reviewed during the re-inspection. Information on those activities is included in this report.

As mandated by the U S EPA AHERA regulations, all future periodic Six-Month inspections and Three-Year Re-inspections of this location will be performed and the Inspection Data in this report will be updated accordingly.

Section I - B

Three-Year Re-inspection IX Overview

Each homogeneous area of Asbestos Containing Building Material (ACBM) listed in the original Management Plan or in the 1992, 1995, 1998, 2001, etc., Three-Year Re-inspection reports were inspected for the AHERA Three-Year Re-inspection Volume IX, and the information for that material verified. Any changes to a homogeneous area listed in the updates to the Management Plans were verified. Any area of suspected ACBM found in the course of the re-inspection, and not listed in the Management Plan or updates, were either assumed to contain asbestos or sampled and analyzed to determine their asbestos content. Any such new areas either assumed to contain asbestos or determined through analysis to contain asbestos were included in the report of the Three-Year Re-inspection. The results of the AHERA Three-Year Re-inspection IX are tabulated in the Room by Room log reports located in *Section II-C* of this report.

As previously noted, all future periodic Six-Month inspections and Three-Year Re-inspections of this location will be performed and the Inspection Data in this report will be updated accordingly.

Section I – C.1

Post Management Plan Activities/Changes

Information on activities affecting Asbestos Containing Building Materials (ACBMs) at this location is contained in updates to the Management Plan. These updates are kept on file by the School District of Philadelphia and were reviewed for this project. Updates to the Management Plan include the following: *Sampling and Analysis, New Tile Installation, Abatement Activity and Periodic Six-Month Surveillance Data.*

Sampling and Analysis

Date	Floor	Room Type	Location	Material	Color	Results
5/16/2016	Ground	Classroom	Classroom 126	Floor Tile 12" x 12"	Orange	Asbestos was Detected
5/16/2016	Ground	Classroom	Classroom 126	Mastic a/w Floor Tile	Black	Asbestos was Detected
5/16/2016	Ground	Classroom	Classroom 126	Floor Tile 12" x 12"	Tan	NAD
5/16/2016	Ground	Classroom	Classroom 126	Mastic a/w Floor Tile	Black	NAD

Section I – C.2

Information on the installation of new floor tiles/renovation activities affecting Asbestos Containing Building Materials (ACBMs) at this location is contained in updates to the Management Plan. These updates are kept on file by the School District of Philadelphia and were reviewed for this project. Updates to the Management Plan include the following:

New Floor Tile Sampling

In the event that new tile is installed, the material must be tested prior to installation.

Section I – C.3

Information on the Asbestos Abatement and renovation activities affecting Asbestos Containing Building Materials (ACBMs) at this location is contained in updates to the Management Plan. These updates are kept on file by the School District of Philadelphia and were reviewed for this project. Updates to the Management Plan include the following:

Abatement Activity

<i>Date</i>	<i>Floor</i>	<i>Location</i>	<i>Material</i>	<i>Color</i>	<i>Removed or Encapsulated</i>	<i>Quantity</i>
5/19/2016	GD	Classroom 126	Floor Tile 9" x 9"	Tan	Removed	150 SF

Section I – C.4

Information on the AHERA inspection that noted damage to various Building Materials at this location is contained in updates to the Management Plan. These updates are kept on file by the School District of Philadelphia and were reviewed for this project. Work orders are created for Corrective Action responses and tracked for completion. Updates to the Management Plan include the following:

Periodic (Six-Month) Surveillance (Damaged Materials)

<i>Date</i>	<i>Element</i>	<i>Floor</i>	<i>On Site Room Name</i>	<i>Material</i>	<i>Amount of Material</i>	<i>Amount of Damage</i>
11/8/2016	1	2	Classroom 200	Floor Tile VAT 12" x 12"	1596 SF	12 SF
11/8/2016	1	2	Classroom 214	Floor Tile VAT 12" x 12"	800 SF	2 SF
11/8/2016	1	2	Classroom 232	Floor Tile VAT 12" x 12"	1000 SF	3 SF
11/8/2016	1	2	Classroom 249	Floor Tile VAT 12" x 12"	1085 SF	4 SF
11/8/2016	1	2	Classroom 258	Floor Tile VAT 12" x 12"	1400 SF	2 SF
11/8/2016	1	1	School Store-Home and School Associate Office	Floor Tile VAT 12" x 12"	300 SF	4 SF
11/8/2016	1	1	Student Cafeteria	Floor Tile VAT 12" x 12"	8192 SF	10 SF

Section II

Re-Inspection Data

A. Introduction

B. Re-Inspection Key Definitions

C. Room by Room Location Log Report

Section II - A

Re-inspection Data

Introduction

The following information documents the Three-Year Re-inspection IX of the subject school/facility. The Homogeneous Area Reports were produced using the building inspector's field data on the facility. The key to the Homogeneous Area Report is outlined in the following pages of this report.

Section II - B
(page 1 of 4)

SCHOOL DISTRICT OF PHILADELPHIA
AHERA THREE YEAR RE-INSPECTION IX

ITEM	DEFINITION
ULCS#	Individual identification number assigned to each school within the School District of Philadelphia.
HOMOGENEOUS AREA ID#	Identification number assigned to each homogeneous area in a school/facility. Each section of the homogeneous area ID is significant. 1010/01/01/01 A B C D A. Is the ULCS# for the school. B. Designates the specific building/building area within the school. C. Designates the floor or level within the building/building area. D. Designates the homogeneous material within that floor or level. Note: Item D may be a number or a letter.
SYSTEM AFFECTED	Corresponds to the AHERA system for classifying materials. T : Thermal System S : Surfacing System M : Miscellaneous
ITEM AFFECTED	Is a description of the homogeneous material.
ORIGINAL INSPECTION DATA	This section contains the information found in the original Management Plan (1988-1989).
AMOUNT OF MATERIAL/ UNIT	Quantity of material, and measuring unit. Units include: Square Feet (SF) Each (EA) Linear Feet (LF) Cubic Feet (CF).

**SCHOOL DISTRICT OF PHILADELPHIA
AHERA THREE YEAR RE-INSPECTION IX**

RE-INSPECTION FORM KEY

ITEM	DEFINITION
CND Condition	Corresponds to AHERA condition rating for materials. 0 : No Damage 1 : Damage 2 : Significant Damage
DP Damage Potential	Corresponds to the AHERA material assessment system. 1 : Potential for Damage 2 : Potential for Significant Damage
ASMD Assumed Asbestos	This means that a material was not sampled for asbestos content during the original Management Plan inspection.
RA Response Action	This corresponds to the AHERA system of response action rating for materials. 1 : Establish O&M Program 2 : Repair and Establish O&M Program 3 : Enclose 4 : Encapsulate 5 : Remove 6 : Partial Removal and Establish O&M Program
CHANGES	This section describes changes to the homogeneous material in the twenty-four years since the original AHERA inspection. The abbreviations are defined below. RMVD : Removed ENCL : Enclosed ENCP : Encapsulated DMGD : Damaged SMPLD : Sampled MTRL : Material RPRD : Repaired N/L : None Located RPLCD : Replaced

**SCHOOL DISTRICT OF PHILADELPHIA
AHERA THREE-YEAR RE-INSPECTION IX**

RE-INSPECTION FORM KEY

ITEM	DEFINITION																				
THREE YEAR RE-INSPECTION	<p>This section contains the information obtained from the Three-Year Re-inspection IX. With three exceptions, the information categories are identical in format and meaning to those found in the original inspection data section. The three exceptions are defined below.</p>																				
DMGD AMT Amount Damaged	<p>This section gives the quantity of damaged material in a homogeneous area. The quantity is shown in the same format as the amount of material/unit section.</p>																				
NF Newly Friable	<p>This section identifies materials in the original Management Plan which have since become friable.</p>																				
RA Response Action	<p>This rating is based on the AHERA regulations, and is comparable to the RA rating found in the "Original Inspection Data" section. The following table details the response actions.</p> <table><tr><td>1.</td><td>Establish O&M Program</td></tr><tr><td>2.</td><td>Repair and Establish O&M Program</td></tr><tr><td>3.</td><td>Enclose</td></tr><tr><td>4.</td><td>Encapsulate</td></tr><tr><td>5.</td><td>Remove</td></tr><tr><td>6.</td><td>Partial Removal and Establish O&M Program</td></tr><tr><td>a.</td><td>High Priority Response The homogeneous material has been scheduled for abatement or other response action.</td></tr><tr><td>b.</td><td>Medium Priority Response The homogeneous material will be scheduled for abatement or other response action as soon as the high priority responses have been addressed.</td></tr><tr><td>c.</td><td>Low Priority Response The homogeneous material will be scheduled for abatement or other response action as soon as the medium priority responses have been addressed.</td></tr><tr><td>d.</td><td>On-Going Response/Operations and Maintenance The homogeneous material does not require abatement or other response action at present, and should be included in the facility's on-going operations and maintenance program.</td></tr></table>	1.	Establish O&M Program	2.	Repair and Establish O&M Program	3.	Enclose	4.	Encapsulate	5.	Remove	6.	Partial Removal and Establish O&M Program	a.	High Priority Response The homogeneous material has been scheduled for abatement or other response action.	b.	Medium Priority Response The homogeneous material will be scheduled for abatement or other response action as soon as the high priority responses have been addressed.	c.	Low Priority Response The homogeneous material will be scheduled for abatement or other response action as soon as the medium priority responses have been addressed.	d.	On-Going Response/Operations and Maintenance The homogeneous material does not require abatement or other response action at present, and should be included in the facility's on-going operations and maintenance program.
1.	Establish O&M Program																				
2.	Repair and Establish O&M Program																				
3.	Enclose																				
4.	Encapsulate																				
5.	Remove																				
6.	Partial Removal and Establish O&M Program																				
a.	High Priority Response The homogeneous material has been scheduled for abatement or other response action.																				
b.	Medium Priority Response The homogeneous material will be scheduled for abatement or other response action as soon as the high priority responses have been addressed.																				
c.	Low Priority Response The homogeneous material will be scheduled for abatement or other response action as soon as the medium priority responses have been addressed.																				
d.	On-Going Response/Operations and Maintenance The homogeneous material does not require abatement or other response action at present, and should be included in the facility's on-going operations and maintenance program.																				

**SCHOOL DISTRICT OF PHILADELPHIA
AHERA THREE-YEAR RE-INSPECTION IX**

RE-INSPECTION FORM KEY

The information presented in the changes section has been compiled from a variety of sources, including the Re-inspection and the following:

- * Quality Control/Quality Assurance Reports of asbestos abatement projects, prepared by consultants to the School District.
- * Permit and Notification Forms for asbestos abatement projects.
- * Periodic Surveillance Forms
- * Operations and Maintenance activities performed by School District personnel.
- * Verbal information from School District personnel.
- * Reports of sampling and analysis of suspected materials by both School District personnel and outside consultants.

**ROOM BY
ROOM
LOCATION LOG
REPORT**

This section gives information, including damage amount and location, for a specific homogeneous material on a room-by-room basis and follows the Re-inspection form.

NOTE: The disparate nature of the above sources of information prohibits the verification of much information within the scope of the AHERA Three-Year Re-inspection. Discrepancies and omissions may exist in this information, and therefore is included on an "as is" basis. The inspectors for the Three-Year Re-inspection IX evaluated homogeneous areas based on the materials current condition and location, as evidenced during the inspector's site visit.

Section II - C

Room by Room Location Log Report

These charts are to be used for a quick reference* in order to avoid the unknowing disturbance of Asbestos Containing Materials during any and all Operations, Maintenance, Renovation, and/or Demolition activities at this location.

NOTE:

*Contact OEMS prior to the disturbance of any of the materials that are listed as **Confirmed and/or Assumed**.*

The quantities listed for (NAD) non-asbestos containing materials and/or Non-Suspect Materials are only estimated and were not measured for the purpose of this report. Field verification of quantities for renovation purposes would be necessary.

8090 Swenson Arts and Technology High School 2015-2016 AHERA Three Year Report

School District of Philadelphia Swenson Arts and Technology High School (9-12) 2750 Red Lion Road, Philadelphia , PA 19114 UCLS# 8090 Date Built: 1976			AHERA Three-Year Reinspection 2015-2016 Room by Room Location Log Report										Reinspection Date: 12/05/2015 Building Inspector: Norman Harrison Certificate Number: ACC-0915-6-011 Management Planner: Monique Causley Certificate Number: ACC-0215-8-010								
Element	Floor	On Site Room Name	System Affected	Material Description	HID#	Confirmed Assumed NAD Non Suspect ACM	Amount of Material	SF LF EA	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic / Crawl Space Ranking	Damage Potential (DP)	Newly Friable (NF)	Response Action (RA)					
1	2	Classroom 200	N/A	Sheetrock Wall		Non Suspect ACM	1000	SF	0	SF											
1	2	Classroom 200	M	Floor Tile VAT 12" x 12"	8090/01/02/HH	Assumed	1596	SF	12	SF	White			1	No	6/C					
1	2	Classroom 200	N/A	Ceiling Tile 2' x 4'		NAD	1596	SF	6	SF				N/A	N/A	N/A					
1	2	Classroom 200	N/A	Concrete Block Wall		Non Suspect ACM	2200	SF	0	SF				N/A	N/A	N/A					
1	2	Storage adjacent to Office 212	S	Plaster Ceiling	8090/01/02/CR/ML/1900	Assumed	140	SF	0	SF				1	No	1/D					
1	2	Storage adjacent to Office 212	N/A	Cement Floor		Non Suspect ACM	140	SF	0	SF				N/A	N/A	N/A					
1	2	Storage adjacent to Office 212	N/A	Concrete Block Wall		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A					
1	2	Electronics Shop	M	Floor Tile VAT 12" x 12"	8090/01/02/HH	Assumed	2345	SF	0	SF	White			1	No	1/D					
1	2	Electronics Shop	N/A	Ceiling Tile 2' x 4'		NAD	2345	SF	0	SF				N/A	N/A	N/A					
1	2	Electronics Shop	N/A	Concrete Block Wall		Non Suspect ACM	4000	SF	0	SF				N/A	N/A	N/A					
1	2	Storage adjacent to Office 213	S	Plaster Ceiling	8090/01/02/CR/ML/1900	Assumed	225	SF	0	SF				1	No	1/D					
1	2	Storage adjacent to Office 213	N/A	Cement Floor		Non Suspect ACM	225	SF	0	SF				N/A	N/A	N/A					
1	2	Storage adjacent to Office 213	N/A	Concrete Block Wall		Non Suspect ACM	400	SF	0	SF				N/A	N/A	N/A					
1	2	Classroom 216 (Art)	M	Floor Tile VAT 12" x 12"	8090/01/02/HH	Assumed	1608	SF	0	SF	Tan			1	No	1/D					
1	2	Classroom 216 (Art)	N/A	Ceiling Tile 2' x 4'		NAD	1608	SF	0	SF				N/A	N/A	N/A					
1	2	Classroom 216 (Art)	N/A	Concrete Block Wall		Non Suspect ACM	2200	SF	0	SF				N/A	N/A	N/A					
1	2	ROTC Room	N/A	Sheetrock Wall		Non Suspect ACM	6000	SF	0	SF				N/A	N/A	N/A					
1	2	ROTC Room	M	Floor Tile VAT 12" x 12"	8090/01/02/HH	Assumed	5184	SF	0	SF	White			1	No	1/D					
1	2	ROTC Room	N/A	Ceiling Tile 2' x 4'		NAD	5184	SF	0	SF				N/A	N/A	N/A					
1	2	Storage Room adjacent to Office 202	M	Floor Tile VAT 12" x 12"	8090/01/02/HH	Assumed	200	SF	0	SF	Tan			1	No	1/D					
1	2	Storage Room adjacent to Office 202	N/A	Ceiling Tile 2' x 4'		NAD	200	SF	0	SF				N/A	N/A	N/A					
1	2	Storage Room adjacent to Office 202	N/A	Concrete Block Wall		Non Suspect ACM	500	SF	0	SF				N/A	N/A	N/A					
1	2	Office 202	M	Floor Tile VAT 12" x 12"	8090/01/02/HH	Assumed	500	SF	0	SF	Tan			1	No	1/D					
1	2	Office 202	N/A	Ceiling Tile 2' x 4'		NAD	500	SF	0	SF				N/A	N/A	N/A					
1	2	Office 202	N/A	Concrete Block Wall		Non Suspect ACM	1100	SF	0	SF				N/A	N/A	N/A					
1	2	Storage Room into Office 202	N/A	Concrete Floor		Non Suspect ACM	220	SF	0	SF				N/A	N/A	N/A					
1	2	Storage Room into Office 202	N/A	Ceiling Tile 2' x 4'		NAD	220	SF	0	SF				N/A	N/A	N/A					
1	2	Storage Room into Office 202	N/A	Concrete Block Wall		Non Suspect ACM	400	SF	0	SF				N/A	N/A	N/A					
1	2	Storage Room 204	N/A	Concrete Floor		Non Suspect ACM	220	SF	0	SF				N/A	N/A	N/A					
1	2	Storage Room 204	N/A	Ceiling Tile 2' x 4'		NAD	220	SF	0	SF				N/A	N/A	N/A					
1	2	Storage Room 204	N/A	Concrete Block Wall		Non Suspect ACM	400	SF	0	SF				N/A	N/A	N/A					
1	2	Storage Room 205	N/A	Ceiling Tile 2' x 4'		NAD	750	SF	0	SF				N/A	N/A	N/A					
1	2	Storage Room 205	N/A	Concrete Block Wall		Non Suspect ACM	1000	SF	0	SF				N/A	N/A	N/A					
1	2	Storage Room 205	M	Floor Tile VAT 12" x 12"	8090/01/02/HH	Assumed	625	SF	0	SF	Tan			1	No	1/D					
1	2	Classroom 206	M	Floor Tile VAT 12" x 12"	8090/01/02/HH	Assumed	625	SF	0	SF	Tan			1	No	1/D					
1	2	Classroom 206	N/A	Ceiling Tile 2' x 4'		NAD	625	SF	0	SF				N/A	N/A	N/A					
1	2	Classroom 206	N/A	Concrete Block Wall		Non Suspect ACM	1000	SF	0	SF				N/A	N/A	N/A					
1	2	Classroom 206 Closet	M	Floor Tile VAT 12" x 12"	8090/01/02/HH	Assumed	125	SF	0	SF	Tan			1	No	1/D					
1	2	Classroom 206 Closet	N/A	Ceiling Tile 2' x 4'		NAD	125	SF	0	SF				N/A	N/A	N/A					
1	2	Classroom 206 Closet	N/A	Concrete Block Wall		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A					
1	2	Classroom 208	M	Transite Sills	8090/01/02/CR/ML/2300	Assumed	10	SF	0	SF				1	No	1/D					
1	2	Classroom 208	M	Floor Tile VAT 12" x 12"	8090/01/02/HH	Assumed	625	SF	0	SF	Grey			1	No	1/D					
1	2	Classroom 208	N/A	Ceiling Tile 2' x 4'		NAD	625	SF	0	SF				N/A	N/A	N/A					
1	2	Classroom 208	N/A	Concrete Block Wall		Non Suspect ACM	1000	SF	0	SF				N/A	N/A	N/A					
1	2	Classroom 208	M	Blackboard Glue Dots	8090/01/02/CR/ML/2600	Assumed	5	SF	0	SF				1	No	1/D					
1	2	Storage Room 209	X	X		X	X	X	X	X	X	No Access		X	X	X					
1	2	Classroom 210	M	Floor Tile VAT 12" x 12"	8090/01/02/HH	Assumed	375	SF	0	SF	Tan			1	No	1/D					
1	2	Classroom 210'	N/A	Ceiling Tile 2' x 4'		NAD	375	SF	0	SF				N/A	N/A	N/A					
1	2	Classroom 210	N/A	Concrete Block Wall		Non Suspect ACM	500	SF	0	SF				N/A	N/A	N/A					
1	2	Classroom 211	M	Floor Tile VAT 12" x 12"	8090/01/02/HH	Assumed	280	SF	0	SF	Tan			1	No	1/D					
1	2	Classroom 211	N/A	Ceiling Tile 2' x 4'		NAD	280	SF	0	SF				N/A	N/A	N/A					
1	2	Classroom 211	N/A	Concrete Block Wall		Non Suspect ACM	400	SF	0	SF				N/A	N/A	N/A					
1	2	Classroom 211	M	Blackboard Glue Dots	8090/01/02/CR/ML/2600	Assumed	5	SF	0	SF				1	No	1/D					
1	2	Classroom 214A	M	Floor Tile VAT 12" x 12"	8090/01/02/HH	Assumed	210	SF	0	SF	Multi			1	No	1/D					
1	2	Classroom 214A	N/A	Ceiling Tile 2' x 4'		NAD	210	SF	0	SF				N/A	N/A	N/A					
1	2	Classroom 214A	N/A	Sheetrock Wall		Non Suspect ACM	400	SF	0	SF				N/A	N/A	N/A					
1	2	Classroom 214	M	Floor Tile VAT 12" x 12"	8090/01/02/HH	Assumed	800	SF	2	SF	Multi			1	No	6/C					
1	2	Classroom 214	N/A	Ceiling Tile 2' x 4'		NAD	800	SF	0	SF				N/A	N/A	N/A					
1	2	Classroom 214	N/A	Sheetrock Wall		Non Suspect ACM	1100	SF	0	SF				N/A	N/A	N/A					
1	2	Classroom 214	N/A	Concrete Block Wall		Non Suspect ACM	550	SF	0	SF				N/A	N/A	N/A					
1	2	Storage Room 213	X	X		X	X	X	X	X	X	No Access		X	X	X					
1	2	Storage Room 215	M	Floor Tile VAT 12" x 12"	8090/01/02/HH	Assumed	100	SF	0	SF	Tan			1	No	1/D					
1	2	Storage Room 215	N/A	Ceiling Tile 2' x 4'		NAD	100	SF	0	SF				N/A	N/A	N/A					
1	2	Storage Room 215	N/A	Concrete Block Wall		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A					
1	2	Art Classroom 216	M	Floor Tile VAT 12" x 12"	8090/01/02/HH	Assumed	1000	SF	0	SF	Multi			1	No	1/D					
1	2	Art Classroom 216	N/A	Ceiling Tile 2' x 4'		NAD	1000	SF	0	SF				N/A	N/A	N/A					
1	2	Art Classroom 216	N/A	Sheetrock Wall		Non Suspect ACM	400	SF	0	SF				N/A	N/A	N/A					
1	2	Art Classroom 216	N/A	Concrete Block Wall		Non Suspect ACM	1600	SF	0	SF				N/A	N/A	N/A					
1	2	Storage Near Windows	N/A	Concrete Block Wall		Non Suspect ACM	150	SF	0	SF				N/A	N/A	N/A					
1	2	Storage Near Windows	M	Floor Tile VAT 12" x 12"	8090/01/02/HH	Assumed	100	SF	0	SF	Tan			1	No	1/D					
1	2	Storage Near Windows	N/A	Ceiling Tile 2' x 4'		NAD	160	SF	0	SF				N/A	N/A	N/A					
1	2	Storage Near Art Classroom Entry on Right	N/A	Concrete Block Wall		Non Suspect ACM	150	SF	0	SF				N/A	N/A	N/A					
1	2	Storage Near Art Classroom Entry on Right	M	Floor Tile VAT 12" x 12"	8090/01/02/HH	Assumed	100	SF	0	SF	Tan			1	No	1/D					
1	2	Storage Near Art Classroom Entry on Right	N/A	Ceiling Tile 2' x 4'		NAD	160	SF	0	SF				N/A	N/A	N/A					
1	2	Storage Near Art Classroom Entry on Left	N/A	Concrete Block Wall		Non Suspect ACM	90	SF	0	SF				N/A	N/A	N/A					
1	2	Storage Near Art Classroom Entry on Left	M	Floor Tile VAT 12" x 12"	8090/01/02/HH	Assumed	45	SF	0	SF	Tan			1	No	1/D					

8090 Swenson Arts and Technology High School 2015-2016 AHERA Three Year Report

School District of Philadelphia Swenson Arts and Technology High School (9-12) 2750 Red Lion Road, Philadelphia , PA 19114 UCLS# 8090 Date Built: 1976			AHERA Three-Year Reinspection 2015-2016 Room by Room Location Log Report										Reinspection Date: 12/05/2015 Building Inspector: Norman Harrison Certificate Number: ACC-0915-6-011 Management Planner: Monique Causley Certificate Number: ACC-0215-8-010			
E l e m e n t	F l o o r	On Site Room Name	System Affected	Material Description	HID#	Confirmed Assumed NAD Non Suspect ACM	Amount of Material	SF LF EA	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic / Crawl Space Ranking	Damage Potential (DP)	Newly Friable (NF)	Response Action (RA)
1	2	Storage Near Art Classroom Entry on Left	N/A	Ceiling Tile 2' x 4'		NAD	45	SF	0	SF				N/A	N/A	N/A
1	2	Office in Art Classroom	N/A	Concrete Block Wall		Non Suspect ACM	90	SF	0	SF				N/A	N/A	N/A
1	2	Office in Art Classroom	M	Floor Tile VAT 12" x 12"	8090/01/02/HH	Assumed	45	SF	0	SF	Tan			1	No	1/D
1	2	Office in Art Classroom	N/A	Ceiling Tile 2' x 4'		NAD	45	SF	0	SF				N/A	N/A	N/A
1	2	Storage at Back	N/A	Concrete Block Wall		Non Suspect ACM	90	SF	0	SF				N/A	N/A	N/A
1	2	Storage at Back	M	Floor Tile VAT 12" x 12"	8090/01/02/HH	Assumed	45	SF	0	SF	Tan			1	No	1/D
1	2	Storage at Back	N/A	Ceiling Tile 2' x 4'		NAD	45	SF	0	SF				N/A	N/A	N/A
1	2	Storage Room 217	M	Floor Tile VAT 12" x 12"	8090/01/02/HH	Assumed	140	SF	0	SF	Tan			1	No	1/D
1	2	Storage Room 217	N/A	Ceiling Tile 2' x 4'		NAD	140	SF	0	SF				N/A	N/A	N/A
1	2	Storage Room 217	N/A	Concrete Block Wall		Non Suspect ACM	250	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 218	M	Floor Tile VAT 12" x 12"	8090/01/02/HH	Assumed	1100	SF	0	SF	Multi			1	No	1/D
1	2	Classroom 218	N/A	Ceiling Tile 2' x 4'		NAD	1100	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 218	N/A	Sheetrock Wall		Non Suspect ACM	1600	SF	0	SF				N/A	N/A	N/A
1	2	AFJROTC Instructor's Office	M	Floor Tile VAT 12" x 12"	8090/01/02/HH	Assumed	200	SF	0	SF	Tan			1	No	1/D
1	2	AFJROTC Instructor's Office	N/A	Ceiling Tile 2' x 4'		NAD	200	SF	0	SF				N/A	N/A	N/A
1	2	AFJROTC Instructor's Office	N/A	Sheetrock Wall		Non Suspect ACM	400	SF	0	SF				N/A	N/A	N/A
1	2	AFJROTC Conference Room	M	Floor Tile VAT 12" x 12"	8090/01/02/HH	Assumed	200	SF	0	SF	Tan			1	No	1/D
1	2	AFJROTC Conference Room	N/A	Ceiling Tile 2' x 4'		NAD	200	SF	0	SF				N/A	N/A	N/A
1	2	AFJROTC Conference Room	N/A	Sheetrock Wall		Non Suspect ACM	400	SF	0	SF				N/A	N/A	N/A
1	2	Storage in AFJROTC Instructor's Office	N/A	Concrete Floor		Non Suspect ACM	150	SF	0	SF				N/A	N/A	N/A
1	2	Storage in AFJROTC Instructor's Office	N/A	Ceiling Tile 2' x 4'		NAD	150	SF	0	SF				N/A	N/A	N/A
1	2	Storage in AFJROTC Instructor's Office	N/A	Concrete Block Wall		Non Suspect ACM	300	SF	0	SF				N/A	N/A	N/A
1	2	Technology Resource Center	M	Floor Tile VAT 12" x 12"	8090/01/02/HH	Assumed	608	SF	0	SF	Tan			1	No	1/D
1	2	Technology Resource Center	N/A	Ceiling Tile 2' x 4'		NAD	608	SF	0	SF				N/A	N/A	N/A
1	2	Technology Resource Center	N/A	Sheetrock Wall		Non Suspect ACM	1000	SF	0	SF				N/A	N/A	N/A
1	2	Storage 220	N/A	Concrete Block Wall		Non Suspect ACM	700	SF	0	SF				N/A	N/A	N/A
1	2	Storage 220	M	Floor Tile VAT 12" x 12"	8090/01/02/HH	Assumed	350	SF	0	SF	Tan			1	No	1/D
1	2	Storage 220	N/A	Ceiling Tile 2' x 4'		NAD	350	SF	0	SF				N/A	N/A	N/A
1	2	Boy's Restroom (ROTC)	N/A	Ceramic Tile Floors		Non Suspect ACM	216	SF	0	SF				N/A	N/A	N/A
1	2	Boy's Restroom (ROTC)	N/A	Ceiling Tile 2' x 4'		NAD	216	SF	0	SF				N/A	N/A	N/A
1	2	Boy's Restroom (ROTC)	N/A	Concrete Block Wall		Non Suspect ACM	400	SF	0	SF				N/A	N/A	N/A
1	2	Custodial Closet	N/A	Concrete Floor		Non Suspect ACM	25	SF	0	SF				N/A	N/A	N/A
1	2	Custodial Closet	N/A	Ceiling Tile 2' x 4'		NAD	25	SF	0	SF				N/A	N/A	N/A
1	2	Custodial Closet	N/A	Concrete Block Wall		Non Suspect ACM	50	SF	0	SF				N/A	N/A	N/A
1	2	Girl's Restroom (ROTC)	N/A	Ceramic Tile Floors		Non Suspect ACM	216	SF	0	SF				N/A	N/A	N/A
1	2	Girl's Restroom (ROTC)	N/A	Ceiling Tile 2' x 4'		NAD	216	SF	0	SF				N/A	N/A	N/A
1	2	Girl's Restroom (ROTC)	N/A	Concrete Block Wall		Non Suspect ACM	400	SF	0	SF				N/A	N/A	N/A
1	2	Women's Restroom (ROTC)	N/A	Ceramic Tile Floors		Non Suspect ACM	88	SF	0	SF				N/A	N/A	N/A
1	2	Women's Restroom (ROTC)	N/A	Ceiling Tile 2' x 4'		NAD	88	SF	0	SF				N/A	N/A	N/A
1	2	Women's Restroom (ROTC)	N/A	Concrete Block Wall		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A
1	2	Men's Restroom (ROTC)	N/A	Ceramic Tile Floors		Non Suspect ACM	160	SF	0	SF				N/A	N/A	N/A
1	2	Men's Restroom (ROTC)	N/A	Ceiling Tile 2' x 4'		NAD	160	SF	0	SF				N/A	N/A	N/A
1	2	Men's Restroom (ROTC)	N/A	Concrete Block Wall		Non Suspect ACM	400	SF	0	SF				N/A	N/A	N/A
1	2	Storage Room 226	M	Floor Tile VAT 12" x 12"	8090/01/02/HH	Assumed	600	SF	0	SF	Tan			1	No	1/D
1	2	Storage Room 226	N/A	Ceiling Tile 2' x 4'		NAD	600	SF	0	SF				N/A	N/A	N/A
1	2	Storage Room 226	N/A	Concrete Block Wall		Non Suspect ACM	1000	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 227	M	Transite Sills	8090/01/02/CR/IM/L/2300	Assumed	10	SF	0	SF				1	No	1/D
1	2	Classroom 227	N/A	Metal Wall		Non Suspect ACM	800	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 227	M	Floor Tile VAT 12" x 12"	8090/01/02/HH	Assumed	800	SF	0	SF	Tan			1	No	1/D
1	2	Classroom 227	N/A	Ceiling Tile 2' x 4'		NAD	800	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 227	N/A	Concrete Block Wall		Non Suspect ACM	800	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 227	M	Blackboard Glue Dots	8090/01/02/CR/IM/L/2600	Assumed	5	SF	0	SF				1	No	1/D
1	2	Classroom 227 Closet	N/A	Ceiling Tile 2' x 4'		NAD	90	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 227 Closet	N/A	Carpet		Non Suspect ACM	90	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 227 Closet	N/A	Concrete Block Wall		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 228	N/A	Sheetrock Wall		Non Suspect ACM	700	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 228	N/A	Metal Wall		Non Suspect ACM	700	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 228	M	Floor Tile VAT 12" x 12"	8090/01/02/HH	Assumed	900	SF	0	SF	Tan			1	No	1/D
1	2	Classroom 228	N/A	Ceiling Tile 2' x 4'		NAD	900	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 228	N/A	Concrete Block Wall		Non Suspect ACM	700	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 228	M	Blackboard Glue Dots	8090/01/02/CR/IM/L/2600	Assumed	5	SF	0	SF				1	No	1/D
1	2	Classroom 229	N/A	Sheetrock Wall		Non Suspect ACM	800	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 229	M	Floor Tile VAT 12" x 12"	8090/01/02/HH	Assumed	520	SF	0	SF	Tan			1	No	1/D
1	2	Classroom 229	N/A	Ceiling Tile 2' x 4'		NAD	520	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 229 Closet	N/A	Sheetrock Wall		Non Suspect ACM	300	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 229 Closet	N/A	Carpet		Non Suspect ACM	100	SF	0	SF	Tan			N/A	N/A	N/A
1	2	Classroom 229 Closet	N/A	Ceiling Tile 2' x 4'		NAD	100	SF	0	SF				N/A	N/A	N/A
1	2	Office 231	N/A	Sheetrock Wall		Non Suspect ACM	600	SF	0	SF				N/A	N/A	N/A
1	2	Office 231	M	Floor Tile VAT 12" x 12"	8090/01/02/HH	Assumed	350	SF	0	SF	Tan			1	No	1/D
1	2	Office 231	N/A	Ceiling Tile 2' x 4'		NAD	350	SF	0	SF				N/A	N/A	N/A
1	2	Office 231 Closet	N/A	Sheetrock Wall		Non Suspect ACM	50	SF	0	SF				N/A	N/A	N/A
1	2	Office 231 Closet	M	Floor Tile VAT 12" x 12"	8090/01/02/HH	Assumed	30	SF	0	SF	Tan			1	No	1/D
1	2	Office 231 Closet	N/A	Ceiling Tile 2' x 4'		NAD	30	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 230	N/A	Sheetrock Wall		Non Suspect ACM	500	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 230	M	Floor Tile VAT 12" x 12"	8090/01/02/HH	Assumed	300	SF	0	SF	Tan			1	No	1/D
1	2	Classroom 230	N/A	Ceiling Tile 2' x 4'		NAD	300	SF	0	SF				N/A	N/A	N/A

8090 Swenson Arts and Technology High School 2015-2016 AHERA Three Year Report

School District of Philadelphia Swenson Arts and Technology High School (9-12) 2750 Red Lion Road, Philadelphia , PA 19114 UCLS# 8090 Date Built: 1976			AHERA Three-Year Reinspection 2015-2016 Room by Room Location Log Report										Reinspection Date: 12/05/2015 Building Inspector: Norman Harrison Certificate Number: ACC-0915-6-011 Management Planner: Monique Causley Certificate Number: ACC-0215-8-010			
Element	Floor	On Site Room Name	System Affected	Material Description	HID#	Confirmed Assumed NAD Non Suspect ACM	Amount of Material	SF LF EA	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic / Crawl Space Ranking	Damage Potential (DP)	Newly Friable (NF)	Response Action (RA)
1	2	Classroom 232	N/A	Sheetrock Wall		Non Suspect ACM	700	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 232	N/A	Metal Wall		Non Suspect ACM	700	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 232	M	Floor Tile VAT 12" x 12"	8090/01/02/HH	Assumed	1000	SF	3	SF	Tan			1	No	6/C
1	2	Classroom 232	N/A	Ceiling Tile 2' x 4'		NAD	1000	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 232	N/A	Concrete Block Wall		Non Suspect ACM	700	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 232	M	Blackboard Glue Dots	8090/01/02/CR/IM/L/2600	Assumed	5	SF	0	SF				1	No	1/D
1	2	Office 232B	N/A	Sheetrock Wall		Non Suspect ACM	400	SF	0	SF				N/A	N/A	N/A
1	2	Office 232B	M	Floor Tile VAT 12" x 12"	8090/01/02/HH	Assumed	200	SF	0	SF	Tan			1	No	1/D
1	2	Office 232B	N/A	Ceiling Tile 2' x 4'		NAD	200	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 235B	M	Floor Tile VAT 12" x 12"	8090/01/02/HH	Assumed	700	SF	0	SF	Tan			1	No	1/D
1	2	Classroom 235B	N/A	Ceiling Tile 2' x 4'		NAD	700	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 235B	N/A	Metal Wall		Non Suspect ACM	700	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 235B	N/A	Concrete Block Wall		Non Suspect ACM	400	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 234	N/A	Sheetrock Wall		Non Suspect ACM	700	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 234	N/A	Metal Wall		Non Suspect ACM	700	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 234	M	Floor Tile VAT 12" x 12"	8090/01/02/HH	Assumed	812	SF	0	SF	Tan			1	No	1/D
1	2	Classroom 234	N/A	Ceiling Tile 2' x 4'		NAD	812	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 236	N/A	Sheetrock Wall		Non Suspect ACM	700	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 236	M	Floor Tile VAT 12" x 12"	8090/01/02/HH	Assumed	1200	SF	0	SF	Brown			1	No	1/D
1	2	Classroom 236	N/A	Fiberglass Pipe Fitting Insulation		Non Suspect ACM	2	EA	0	SF				N/A	N/A	N/A
1	2	Classroom 236	N/A	Ceiling Tile 2' x 4'		NAD	1200	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 236	N/A	Concrete Block Wall		Non Suspect ACM	700	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 236	M	Blackboard Glue Dots	8090/01/02/CR/IM/L/2600	Assumed	5	SF	0	SF				1	No	1/D
1	2	Classroom 236 Closet	N/A	Sheetrock Wall		Non Suspect ACM	350	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 236 Closet	M	Floor Tile VAT 12" x 12"	8090/01/02/HH	Assumed	196	SF	0	SF	Tan			1	No	1/D
1	2	Classroom 236 Closet	N/A	Ceiling Tile 2' x 4'		NAD	196	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 228	M	Transite Sills	8090/01/02/CR/IM/L/2300	Assumed	10	SF	0	SF				1	No	1/D
1	2	Classroom 228	N/A	Sheetrock Wall		Non Suspect ACM	800	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 228	M	Floor Tile VAT 12" x 12"	8090/01/02/HH	Assumed	1400	SF	0	SF	Tan			1	No	1/D
1	2	Classroom 228	N/A	Ceiling Tile 2' x 4'		NAD	1400	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 228	N/A	Concrete Block Wall		Non Suspect ACM	800	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 228	M	Blackboard Glue Dots	8090/01/02/CR/IM/L/2600	Assumed	5	SF	0	SF				1	No	1/D
1	2	Boy's Restroom 243	N/A	Concrete Block Wall		Non Suspect ACM	400	SF	0	SF				N/A	N/A	N/A
1	2	Boy's Restroom 243	N/A	Ceramic Tile Floors		Non Suspect ACM	280	SF	0	SF				N/A	N/A	N/A
1	2	Boy's Restroom 243	N/A	Ceiling Tile 2' x 4'		NAD	280	SF	0	SF				N/A	N/A	N/A
1	2	Custodian Storage Room	N/A	Cement Floor		Non Suspect ACM	56	SF	0	SF				N/A	N/A	N/A
1	2	Custodian Storage Room	N/A	Ceiling Tile 2' x 4'		NAD	56	SF	0	SF				N/A	N/A	N/A
1	2	Custodian Storage Room	N/A	Concrete Block Wall		Non Suspect ACM	150	SF	0	SF				N/A	N/A	N/A
1	2	Boys Restroom 240	N/A	Concrete Block Wall		Non Suspect ACM	350	SF	0	SF				N/A	N/A	N/A
1	2	Boys Restroom 240	N/A	Ceramic Tile Floors		Non Suspect ACM	144	SF	0	SF				N/A	N/A	N/A
1	2	Boys Restroom 240	N/A	Ceiling Tile 2' x 4'		NAD	144	SF	0	SF				N/A	N/A	N/A
1	2	Men's Restroom	N/A	Concrete Block Wall		Non Suspect ACM	300	SF	0	SF				N/A	N/A	N/A
1	2	Men's Restroom	N/A	Ceramic Tile Floors		Non Suspect ACM	128	SF	0	SF				N/A	N/A	N/A
1	2	Men's Restroom	N/A	Ceiling Tile 2' x 4'		NAD	128	SF	0	SF				N/A	N/A	N/A
1	2	Women's Restroom	N/A	Concrete Block Wall		Non Suspect ACM	300	SF	0	SF				N/A	N/A	N/A
1	2	Women's Restroom	N/A	Ceramic Tile Floors		Non Suspect ACM	128	SF	0	SF				N/A	N/A	N/A
1	2	Women's Restroom	N/A	Ceiling Tile 2' x 4'		NAD	128	SF	0	SF				N/A	N/A	N/A
1	2	Storage adjacent to Women's Restroom	M	Floor Tile VAT 12" x 12"	8090/01/02/HH	Assumed	60	SF	0	SF	Tan			1	No	1/D
1	2	Storage adjacent to Women's Restroom	N/A	Ceiling Tile 2' x 4'		NAD	60	SF	0	SF				N/A	N/A	N/A
1	2	Storage adjacent to Women's Restroom	N/A	Concrete Block Wall		Non Suspect ACM	150	SF	0	SF				N/A	N/A	N/A
1	2	Girl's Restroom 238	N/A	Concrete Block Wall		Non Suspect ACM	350	SF	0	SF				N/A	N/A	N/A
1	2	Girl's Restroom 238	N/A	Ceramic Tile Floors		Non Suspect ACM	170	SF	0	SF				N/A	N/A	N/A
1	2	Girl's Restroom 238	N/A	Ceiling Tile 2' x 4'		NAD	170	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 238	N/A	Sheetrock Wall		Non Suspect ACM	700	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 238	M	Floor Tile VAT 12" x 12"	8090/01/02/HH	Assumed	450	SF	0	SF	Tan			1	No	1/D
1	2	Classroom 238	N/A	Ceiling Tile 2' x 4'		NAD	450	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 238	N/A	Concrete Block Wall		Non Suspect ACM	150	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 238 Storage	N/A	Sheetrock Wall		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 238 Storage	M	Floor Tile VAT 12" x 12"	8090/01/02/HH	Assumed	150	SF	0	SF	Pink			1	No	1/D
1	2	Classroom 238 Storage	N/A	Ceiling Tile 2' x 4'		NAD	150	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 238 Storage	N/A	Concrete Block Wall		Non Suspect ACM	50	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 245	N/A	Sheetrock Wall		Non Suspect ACM	700	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 245	M	Floor Tile VAT 12" x 12"	8090/01/02/HH	Assumed	450	SF	0	SF	Tan			1	No	1/D
1	2	Classroom 245	N/A	Ceiling Tile 2' x 4'		NAD	450	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 245	N/A	Concrete Block Wall		Non Suspect ACM	150	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 259	M	Floor Tile VAT 12" x 12"	8090/01/02/HH	Assumed	800	SF	0	SF	Tan			1	No	1/D
1	2	Classroom 259	N/A	Ceiling Tile 2' x 4'		NAD	800	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 259	N/A	Concrete Block Wall		Non Suspect ACM	80	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 259	N/A	Metal Wall		Non Suspect ACM	900	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 259	M	Transite Sills	8090/01/02/CR/IM/L/2300	Assumed	10	SF	0	SF				1	No	1/D
1	2	Music Storage	N/A	Sheetrock Wall		Non Suspect ACM	90	SF	0	SF				N/A	N/A	N/A
1	2	Music Storage	M	Floor Tile VAT 12" x 12"	8090/01/02/HH	Assumed	40	SF	0	SF	Tan			1	No	1/D
1	2	Music Storage	N/A	Ceiling Tile 2' x 4'		NAD	40	SF	0	SF				N/A	N/A	N/A
1	2	Instrumental Music Office	N/A	Sheetrock Wall		Non Suspect ACM	120	SF	0	SF				N/A	N/A	N/A
1	2	Instrumental Music Office	M	Floor Tile VAT 12" x 12"	8090/01/02/HH	Assumed	65	SF	0	SF	Tan			1	No	1/D
1	2	Instrumental Music Office	N/A	Ceiling Tile 2' x 4'		NAD	65	SF	0	SF				N/A	N/A	N/A

8090 Swenson Arts and Technology High School 2015-2016 AHERA Three Year Report

School District of Philadelphia				AHERA Three-Year Reinspection 2015-2016										Reinspection Date: 12/05/2015			
Swenson Arts and Technology High School (9-12)				Room by Room Location Log Report										Building Inspector: Norman Harrison			
2750 Red Lion Road, Philadelphia , PA 19114														Certificate Number: ACC-0915-6-011			
UCLS# 8090														Management Planner: Monique Causley			
Date Built: 1976														Certificate Number: ACC-0215-8-010			
E l e m e n t	F l o o r	On Site Room Name	System Affected	Material Description	HID#	Confirmed Assumed NAD Non Suspect ACM	Amount of Material	SF LF EA	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic / Crawl Space Ranking	Damage Potential (DP)	Newly Friable (NF)	Response Action (RA)	
1	2	Teacher's Lounge	N/A	Sheetrock Wall		Non Suspect ACM	600	SF	0	SF				N/A	N/A	N/A	
1	2	Teacher's Lounge	M	Floor Tile VAT 12" x 12"	8090/01/02/HH	Assumed	400	SF	0	SF	Tan			1	No	1/D	
1	2	Teacher's Lounge	N/A	Ceiling Tile 2' x 4'		NAD	400	SF	0	SF				N/A	N/A	N/A	
1	2	Copy Room	N/A	Sheetrock Wall		Non Suspect ACM	250	SF	0	SF				N/A	N/A	N/A	
1	2	Copy Room	M	Floor Tile VAT 12" x 12"	8090/01/02/HH	Assumed	125	SF	0	SF	Tan			1	No	1/D	
1	2	Copy Room	N/A	Ceiling Tile 2' x 4'		NAD	125	SF	0	SF				N/A	N/A	N/A	
1	2	Staff Locker Room	N/A	Sheetrock Wall		Non Suspect ACM	120	SF	0	SF				N/A	N/A	N/A	
1	2	Staff Locker Room	M	Floor Tile VAT 12" x 12"	8090/01/02/HH	Assumed	65	SF	0	SF	Tan			1	No	1/D	
1	2	Staff Locker Room	N/A	Ceiling Tile 2' x 4'		NAD	65	SF	0	SF				N/A	N/A	N/A	
1	2	Test Room	N/A	Sheetrock Wall		Non Suspect ACM	120	SF	0	SF				N/A	N/A	N/A	
1	2	Test Room	M	Floor Tile VAT 12" x 12"	8090/01/02/HH	Assumed	65	SF	0	SF	Tan			1	No	1/D	
1	2	Test Room	N/A	Ceiling Tile 2' x 4'		NAD	65	SF	0	SF				N/A	N/A	N/A	
1	2	Classroom 261	M	Transite Sills	8090/01/02/CR/ML/2300	Assumed	10	SF	0	SF				1	No	1/D	
1	2	Classroom 261	N/A	Sheetrock Wall		Non Suspect ACM	800	SF	0	SF				N/A	N/A	N/A	
1	2	Classroom 261	M	Floor Tile VAT 12" x 12"	8090/01/02/HH	Assumed	750	SF	0	SF	Tan			1	No	1/D	
1	2	Classroom 261	N/A	Ceiling Tile 2' x 4'		NAD	750	SF	0	SF				N/A	N/A	N/A	
1	2	Classroom 261	N/A	Concrete Block Wall		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A	
1	2	Classroom 261	M	Blackboard Glue Dots	8090/01/02/CR/ML/2600	Assumed	5	SF	0	SF				1	No	1/D	
1	2	Classroom 261 Storage	N/A	Transite Sills	8090/01/02/CR/ML/2300	Assumed	4	SF	0	SF				N/A	N/A	N/A	
1	2	Classroom 261 Storage	N/A	Sheetrock Wall		Non Suspect ACM	300	SF	0	SF				N/A	N/A	N/A	
1	2	Classroom 261 Storage	M	Floor Tile VAT 12" x 12"	8090/01/02/HH	Assumed	150	SF	0	SF	Tan			1	No	1/D	
1	2	Classroom 261 Storage	N/A	Ceiling Tile 2' x 4'		NAD	150	SF	0	SF				N/A	N/A	N/A	
1	2	Classroom 262/263	N/A	Wood Floor		Non Suspect ACM	550	SF	0	SF				N/A	N/A	N/A	
1	2	Classroom 262/263	M	Transite Sills	8090/01/02/CR/ML/2300	Assumed	10	SF	0	SF				1	No	1/D	
1	2	Classroom 262/263	N/A	Sheetrock Wall		Non Suspect ACM	1000	SF	0	SF				N/A	N/A	N/A	
1	2	Classroom 262/263	M	Floor Tile VAT 12" x 12"	8090/01/02/HH	Assumed	1150	SF	0	SF	Tan			1	No	1/D	
1	2	Classroom 262/263	N/A	Ceiling Tile 2' x 4'		NAD	2200	SF	0	SF				N/A	N/A	N/A	
1	2	Classroom 262/263	N/A	Concrete Block Wall		Non Suspect ACM	1000	SF	0	SF				N/A	N/A	N/A	
1	2	Classroom 262/263	M	Blackboard Glue Dots	8090/01/02/CR/ML/2600	Assumed	5	SF	0	SF				1	No	1/D	
1	2	Storage Closet 262A	N/A	Carpet		Non Suspect ACM	20	SF	0	SF				N/A	N/A	N/A	
1	2	Storage Closet 262A	N/A	Ceiling Tile 2' x 4'		NAD	20	SF	0	SF				N/A	N/A	N/A	
1	2	Storage Closet 262A	M	Transite Sills	8090/01/02/CR/ML/2300	Assumed	3	SF	0	SF				1	No	1/D	
1	2	Storage Closet 262A	N/A	Sheetrock Wall		Non Suspect ACM	40	SF	0	SF				N/A	N/A	N/A	
1	2	Classroom 264	N/A	Sheetrock Wall		Non Suspect ACM	1500	SF	0	SF				N/A	N/A	N/A	
1	2	Classroom 264	M	Floor Tile VAT 12" x 12"	8090/01/02/HH	Assumed	784	SF	0	SF	Tan			1	No	1/D	
1	2	Classroom 264	N/A	Ceiling Tile 2' x 4'		NAD	784	SF	0	SF				N/A	N/A	N/A	
1	2	Classroom 264	M	Blackboard Glue Dots	8090/01/02/CR/ML/2600	Assumed	5	SF	0	SF				1	No	1/D	
1	2	Classroom 265	N/A	Sheetrock Wall		Non Suspect ACM	1500	SF	0	SF				N/A	N/A	N/A	
1	2	Classroom 265	M	Floor Tile VAT 12" x 12"	8090/01/02/HH	Assumed	784	SF	0	SF	Tan			1	No	1/D	
1	2	Classroom 265	N/A	Ceiling Tile 2' x 4'		NAD	784	SF	0	SF				N/A	N/A	N/A	
1	2	Classroom 265	M	Blackboard Glue Dots	8090/01/02/CR/ML/2600	Assumed	5	SF	0	SF				1	No	1/D	
1	2	Storage Room 265A	M	Floor Tile VAT 12" x 12"	8090/01/02/HH	Assumed	1100	SF	0	SF	Tan			1	No	1/D	
1	2	Storage Room 265A	N/A	Ceiling Tile 2' x 4'		NAD	1100	SF	0	SF				N/A	N/A	N/A	
1	2	Storage Room 265A	N/A	Sheetrock Wall		Non Suspect ACM	2000	SF	0	SF				N/A	N/A	N/A	
1	2	Classroom 246/247	N/A	Sheetrock Wall		Non Suspect ACM	750	SF	0	SF				N/A	N/A	N/A	
1	2	Classroom 246/247	M	Floor Tile VAT 12" x 12"	8090/01/02/HH	Assumed	485	SF	0	SF	Tan			1	No	1/D	
1	2	Classroom 246/247	N/A	Ceiling Tile 2' x 4'		NAD	485	SF	0	SF				N/A	N/A	N/A	
1	2	Classroom 249	N/A	Sheetrock Wall		Non Suspect ACM	800	SF	0	SF				N/A	N/A	N/A	
1	2	Classroom 249	M	Floor Tile VAT 12" x 12"	8090/01/02/HH	Assumed	1085	SF	4	SF	Tan			1	No	6/C	
1	2	Classroom 249	N/A	Ceiling Tile 2' x 4'		NAD	1085	SF	0	SF				N/A	N/A	N/A	
1	2	Classroom 249	N/A	Concrete Block Wall		Non Suspect ACM	800	SF	0	SF				N/A	N/A	N/A	
1	2	Classroom 249	M	Blackboard Glue Dots	8090/01/02/CR/ML/2600	Assumed	5	SF	0	SF				1	No	1/D	
1	2	Classroom 250	M	Transite Sills	8090/01/02/CR/ML/2300	Assumed	10	SF	0	SF				1	No	1/D	
1	2	Classroom 250	N/A	Sheetrock Wall		Non Suspect ACM	1600	SF	0	SF				N/A	N/A	N/A	
1	2	Classroom 250	M	Floor Tile VAT 12" x 12"	8090/01/02/HH	Assumed	1085	SF	0	SF	Tan			1	No	1/D	
1	2	Classroom 250	N/A	Ceiling Tile 2' x 4'		NAD	1085	SF	0	SF				N/A	N/A	N/A	
1	2	Classroom 250	M	Blackboard Glue Dots	8090/01/02/CR/ML/2600	Assumed	5	SF	0	SF				1	No	1/D	
1	2	Office 249B	N/A	Sheetrock Wall		Non Suspect ACM	400	SF	0	SF				N/A	N/A	N/A	
1	2	Office 249B	M	Floor Tile VAT 12" x 12"	8090/01/02/HH	Assumed	225	SF	0	SF	Tan			1	No	1/D	
1	2	Office 249B	N/A	Ceiling Tile 2' x 4'		NAD	225	SF	0	SF				N/A	N/A	N/A	
1	2	Storage Room 249A	N/A	Sheetrock Wall		Non Suspect ACM	500	SF	0	SF				N/A	N/A	N/A	
1	2	Storage Room 249A	M	Floor Tile VAT 12" x 12"	8090/01/02/HH	Assumed	255	SF	0	SF	Tan			1	No	1/D	
1	2	Storage Room 249A	N/A	Ceiling Tile 2' x 4'		NAD	255	SF	0	SF				N/A	N/A	N/A	
1	2	Classroom 253	M	Transite Sills	8090/01/02/CR/ML/2300	Assumed	10	SF	0	SF				1	No	1/D	
1	2	Classroom 253	N/A	Sheetrock Wall		Non Suspect ACM	4000	SF	0	SF				N/A	N/A	N/A	
1	2	Classroom 253	M	Floor Tile VAT 12" x 12"	8090/01/02/HH	Assumed	2275	SF	0	SF	Tan			1	No	1/D	
1	2	Classroom 253	N/A	Ceiling Tile 2' x 4'		NAD	2275	SF	0	SF				N/A	N/A	N/A	
1	2	Classroom 257	M	Transite Sills	8090/01/02/CR/ML/2300	Assumed	10	SF	0	SF				1	No	1/D	
1	2	Classroom 257	N/A	Metal Wall		Non Suspect ACM	800	SF	0	SF				N/A	N/A	N/A	
1	2	Classroom 257	M	Floor Tile VAT 12" x 12"	8090/01/02/HH	Assumed	1400	SF	0	SF	Tan			1	No	1/D	
1	2	Classroom 257	N/A	Ceiling Tile 2' x 4'		NAD	1400	SF	0	SF				N/A	N/A	N/A	
1	2	Classroom 257	N/A	Concrete Block Wall		Non Suspect ACM	800	SF	0	SF				N/A	N/A	N/A	
1	2	Classroom 257	M	Blackboard Glue Dots	8090/01/02/CR/ML/2600	Assumed	5	SF	0	SF				1	No	1/D	
1	2	Classroom 228	M	Transite Sills	8090/01/02/CR/ML/2300	Assumed	10	SF	0	SF				1	No	1/D	
1	2	Classroom 258	N/A	Sheetrock Wall		Non Suspect ACM	800	SF	0	SF				N/A	N/A	N/A	
1	2	Classroom 258	M	Floor Tile VAT 12" x 12"	8090/01/02/HH	Assumed	1400	SF	2	SF	Tan			1	No	6/C	

8090 Swenson Arts and Technology High School 2015-2016 AHERA Three Year Report

		School District of Philadelphia Swenson Arts and Technology High School (9-12) 2750 Red Lion Road, Philadelphia, PA 19114 UCLS# 8090 Date Built: 1976		AHERA Three-Year Reinspection 2015-2016 Room by Room Location Log Report						Reinspection Date: 12/05/2015 Building Inspector: Norman Harrison Certificate Number: ACC-0915-6-011 Management Planner: Monique Causley Certificate Number: ACC-0215-8-010							
E l e m e n t	F l o o r	On Site Room Name		System Affected	Material Description	HID#	Confirmed Assumed NAD Non Suspect ACM	Amount of Material	SF LF EA	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic / Crawl Space Ranking	Damage Potential (DP)	Newly Friable (NF)	Response Action (RA)
1	2	Classroom 258		N/A	Ceiling Tile 2' x 4'		NAD	1400	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 258		N/A	Concrete Block Wall		Non Suspect ACM	800	SF	0	SF				N/A	N/A	N/A
1	2	Classroom 258		M	Blackboard Glue Dots	8090/01/02/CR/ML/2600	Assumed	5	SF	0	SF				1	No	1/D
1	2	Hallway between Classroom 247-253		N/A	Sheetrock Wall		Non Suspect ACM	1000	SF	0	SF				N/A	N/A	N/A
1	2	Hallway between Classroom 247-253		N/A	Floor Tile VAT 12" x 12"	8090/01/02/HH	Assumed	808	SF	0	SF	Tan			N/A	N/A	N/A
1	2	Hallway between Classroom 247-253		N/A	Ceiling Tile 2' x 4'		NAD	808	SF	0	SF				N/A	N/A	N/A
1	2	Hallway between Classroom 247-253		N/A	Concrete Block Wall		Non Suspect ACM	800	SF	0	SF				N/A	N/A	N/A
1	2	Hallway between Classroom 244-227		N/A	Sheetrock Wall		Non Suspect ACM	1500	SF	0	SF				N/A	N/A	N/A
1	2	Hallway between Classroom 244-227		M	Floor Tile VAT 12" x 12"	8090/01/02/HH	Assumed	1092	SF	0	SF	Tan			1	No	1/D
1	2	Hallway between Classroom 244-227		N/A	Ceiling Tile 2' x 4'		NAD	1092	SF	0	SF				N/A	N/A	N/A
1	2	Hallway between Classroom 244-227		N/A	Concrete Block Wall		Non Suspect ACM	1000	SF	0	SF				N/A	N/A	N/A
1	2	Hallway between Classroom 253-263		N/A	Sheetrock Wall		Non Suspect ACM	1500	SF	0	SF				N/A	N/A	N/A
1	2	Hallway between Classroom 253-263		M	Floor Tile VAT 12" x 12"	8090/01/02/HH	Assumed	1582	SF	0	SF	Tan			1	No	1/D
1	2	Hallway between Classroom 253-263		N/A	Ceiling Tile 2' x 4'		NAD	1582	SF	0	SF				N/A	N/A	N/A
1	2	Hallway between Classroom 253-263		N/A	Concrete Block Wall		Non Suspect ACM	1000	SF	0	SF				N/A	N/A	N/A
1	2	Hallway between Classroom 231-242		N/A	Sheetrock Wall		Non Suspect ACM	1000	SF	0	SF				N/A	N/A	N/A
1	2	Hallway between Classroom 231-242		M	Floor Tile VAT 12" x 12"	8090/01/02/HH	Assumed	808	SF	0	SF	Tan			1	No	1/D
1	2	Hallway between Classroom 231-242		N/A	Ceiling Tile 2' x 4'		NAD	808	SF	0	SF				N/A	N/A	N/A
1	2	Hallway between Classroom 231-242		N/A	Concrete Block Wall		Non Suspect ACM	800	SF	0	SF				N/A	N/A	N/A
1	2	Hallway between Classroom 235-237		N/A	Sheetrock Wall		Non Suspect ACM	1000	SF	0	SF				N/A	N/A	N/A
1	2	Hallway between Classroom 235-237		M	Floor Tile VAT 12" x 12"	8090/01/02/HH	Assumed	808	SF	0	SF	Tan			1	No	1/D
1	2	Hallway between Classroom 235-237		N/A	Ceiling Tile 2' x 4'		NAD	808	SF	0	SF				N/A	N/A	N/A
1	2	Hallway between Classroom 235-237		N/A	Concrete Block Wall		Non Suspect ACM	800	SF	0	SF				N/A	N/A	N/A
1	2	Hallway Classroom 245		N/A	Sheetrock Wall		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A
1	2	Hallway Classroom 245		M	Floor Tile VAT 12" x 12"	8090/01/02/HH	Assumed	110	SF	0	SF	Tan			1	No	1/D
1	2	Hallway Classroom 245		N/A	Ceiling Tile 2' x 4'		NAD	110	SF	0	SF				N/A	N/A	N/A
1	2	Hallway Classroom 245		N/A	Concrete Block Wall		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A
1	2	Hallway between Classroom 249-250		N/A	Sheetrock Wall		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A
1	2	Hallway between Classroom 249-250		M	Floor Tile VAT 12" x 12"	8090/01/02/HH	Assumed	150	SF	0	SF	Tan			1	No	1/D
1	2	Hallway between Classroom 249-250		N/A	Ceiling Tile 2' x 4'		NAD	150	SF	0	SF				N/A	N/A	N/A
1	2	Hallway between Classroom 249-250		N/A	Concrete Block Wall		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A
1	2	Hallway between Classroom 227-230		N/A	Sheetrock Wall		Non Suspect ACM	1000	SF	0	SF				N/A	N/A	N/A
1	2	Hallway between Classroom 227-230		M	Floor Tile VAT 12" x 12"	8090/01/02/HH	Assumed	808	SF	0	SF	Tan			1	No	1/D
1	2	Hallway between Classroom 227-230		N/A	Ceiling Tile 2' x 4'		NAD	808	SF	0	SF				N/A	N/A	N/A
1	2	Hallway between Classroom 227-230		N/A	Concrete Block Wall		Non Suspect ACM	800	SF	0	SF				N/A	N/A	N/A
1	2	Stairs next to Classroom 200		N/A	Concrete Ceiling		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A
1	2	Stairs next to Classroom 200		N/A	Concrete Block Wall		Non Suspect ACM	500	SF	0	SF				N/A	N/A	N/A
1	2	Stairs next to Classroom 200		N/A	Cement Floor		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A
1	2	Stairs next to Classroom 229		N/A	Concrete Ceiling		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A
1	2	Stairs next to Classroom 229		N/A	Concrete Block Wall		Non Suspect ACM	500	SF	0	SF				N/A	N/A	N/A
1	2	Stairs next to Classroom 229		N/A	Cement Floor		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A
1	2	Stairs next to Classroom 262		N/A	Concrete Ceiling		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A
1	2	Stairs next to Classroom 262		N/A	Concrete Block Wall		Non Suspect ACM	500	SF	0	SF				N/A	N/A	N/A
1	2	Stairs next to Classroom 262		N/A	Cement Floor		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A
1	2	Stairs next to Classroom 257		N/A	Concrete Ceiling		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A
1	2	Stairs next to Classroom 257		N/A	Concrete Block Wall		Non Suspect ACM	500	SF	0	SF				N/A	N/A	N/A
1	2	Stairs next to Classroom 257		N/A	Cement Floor		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A
1	2	Stairs next to Classroom 245		N/A	Concrete Ceiling		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A
1	2	Stairs next to Classroom 245		N/A	Concrete Block Wall		Non Suspect ACM	500	SF	0	SF				N/A	N/A	N/A
1	2	Stairs next to Classroom 245		N/A	Cement Floor		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A
1	2	Stairs next to Classroom 211		N/A	Concrete Ceiling		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A
1	2	Stairs next to Classroom 211		N/A	Concrete Block Wall		Non Suspect ACM	500	SF	0	SF				N/A	N/A	N/A
1	2	Stairs next to Classroom 211		N/A	Cement Floor		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A
1	1	Main Office		N/A	Sheetrock Wall		Non Suspect ACM	1000	SF	0	SF				N/A	N/A	N/A
1	1	Main Office		M	Floor Tile VAT 12" x 12"	8090/01/01/GG	Assumed	808	SF	0	SF	Green			1	No	1/D
1	1	Main Office		N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	808	SF	0	SF				N/A	N/A	N/A
1	1	Main Office		N/A	Concrete Block Wall		Non Suspect ACM	800	SF	0	SF				N/A	N/A	N/A
1	1	Principal's Office		N/A	Sheetrock Wall		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A
1	1	Principal's Office		N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	225	SF	0	SF				N/A	N/A	N/A
1	1	Principal's Office		N/A	Carpet		Non Suspect ACM	225	SF	0	SF				N/A	N/A	N/A
1	1	Principal's Office		N/A	Concrete Block Wall		Non Suspect ACM	100	SF	0	SF				N/A	N/A	N/A
1	1	Principal's Office Restroom		N/A	Concrete Block Wall		Non Suspect ACM	100	SF	0	SF				N/A	N/A	N/A
1	1	Principal's Office Restroom		M	Floor Tile VAT 12" x 12"	8090/01/01/GG	Assumed	30	SF	0	SF	Tan			1	No	1/D
1	1	Principal's Office Restroom		N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	30	SF	0	SF				N/A	N/A	N/A
1	1	Principal's Office Storage		X	X		X	X	X	X	X	No access			X	X	X
1	1	Roster Office		M	Floor Tile VAT 12" x 12"	8090/01/01/GG	Assumed	75	SF	0	SF	Green			1	No	1/D
1	1	Roster Office		N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	75	SF	0	SF				N/A	N/A	N/A
1	1	Roster Office		N/A	Concrete Block Wall		Non Suspect ACM	150	SF	0	SF				N/A	N/A	N/A
1	1	Faculty Mail Room		M	Floor Tile VAT 12" x 12"	8090/01/01/GG	Assumed	75	SF	0	SF	Green			1	No	1/D
1	1	Faculty Mail Room		N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	75	SF	0	SF				N/A	N/A	N/A
1	1	Faculty Mail Room		N/A	Concrete Block Wall		Non Suspect ACM	150	SF	0	SF				N/A	N/A	N/A
1	1	Principal's Office Conference Room		N/A	Concrete Block Wall		Non Suspect ACM	400	SF	0	SF				N/A	N/A	N/A
1	1	Principal's Office Conference Room		N/A	Carpet		Non Suspect ACM	200	SF	0	SF	Tan			N/A	N/A	N/A
1	1	Principal's Office Conference Room		N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A
1	1	Teen Parent Classroom		N/A	Concrete Block Wall		Non Suspect ACM	140	SF	0	SF				N/A	N/A	N/A
1	1	Teen Parent Classroom		M	Floor Tile VAT 12" x 12"	8090/01/01/GG	Assumed	75	SF	0	SF	Tan			1	No	1/D

8090 Swenson Arts and Technology High School 2015-2016 AHERA Three Year Report

School District of Philadelphia				AHERA Three-Year Reinspection 2015-2016										Reinspection Date: 12/05/2015			
Swenson Arts and Technology High School (9-12)				Room by Room Location Log Report										Building Inspector: Norman Harrison			
2750 Red Lion Road, Philadelphia , PA 19114														Certificate Number: ACC-0915-6-011			
UCLS# 8090														Management Planner: Monique Causley			
Date Built: 1976														Certificate Number: ACC-0215-8-010			
E l e m e n t	F l o o r	On Site Room Name	System Affected	Material Description	HID#	Confirmed Assumed NAD	Amount of Material	SF LF EA	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic / Crawl Space Ranking	Damage Potential (DP)	Newly Friable (NF)	Response Action (RA)	
1	1	Teen Parent Classroom	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	75	SF	0	SF				N/A	N/A	N/A	
1	1	Discipline Office/Dean Office	N/A	Concrete Block Wall		Non Suspect ACM	140	SF	0	SF				N/A	N/A	N/A	
1	1	Discipline Office/Dean Office	M	Floor Tile VAT 12" x 12"	8090/01/01/GG	Assumed	75	SF	0	SF	Tan			1	No	1/D	
1	1	Discipline Office/Dean Office	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	75	SF	0	SF				N/A	N/A	N/A	
1	1	Psychologist Office	N/A	Concrete Block Wall		Non Suspect ACM	140	SF	0	SF				N/A	N/A	N/A	
1	1	Psychologist Office	M	Floor Tile VAT 12" x 12"	8090/01/01/GG	Assumed	75	SF	0	SF	Tan			1	No	1/D	
1	1	Psychologist Office	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	75	SF	0	SF				N/A	N/A	N/A	
1	1	105 Office	N/A	Concrete Block Wall		Non Suspect ACM	140	SF	0	SF				N/A	N/A	N/A	
1	1	105 Office	M	Floor Tile VAT 12" x 12"	8090/01/01/GG	Assumed	75	SF	0	SF	Tan			1	No	1/D	
1	1	105 Office	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	75	SF	0	SF				N/A	N/A	N/A	
1	1	104 Office	N/A	Concrete Block Wall		Non Suspect ACM	140	SF	0	SF				N/A	N/A	N/A	
1	1	104 Office	M	Floor Tile VAT 12" x 12"	8090/01/01/GG	Assumed	75	SF	0	SF	Tan			1	No	1/D	
1	1	104 Office	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	75	SF	0	SF				N/A	N/A	N/A	
1	1	103 Office	N/A	Concrete Block Wall		Non Suspect ACM	140	SF	0	SF				N/A	N/A	N/A	
1	1	103 Office	M	Floor Tile VAT 12" x 12"	8090/01/01/GG	Assumed	75	SF	0	SF	Tan			1	No	1/D	
1	1	103 Office	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	75	SF	0	SF				N/A	N/A	N/A	
1	1	School Operation's Officer	N/A	Concrete Block Wall		Non Suspect ACM	140	SF	0	SF				N/A	N/A	N/A	
1	1	School Operation's Officer	M	Floor Tile VAT 12" x 12"	8090/01/01/GG	Assumed	75	SF	0	SF	Tan			1	No	1/D	
1	1	School Operation's Officer	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	75	SF	0	SF				N/A	N/A	N/A	
1	1	Room 111	N/A	Concrete Block Wall		Non Suspect ACM	350	SF	0	SF				N/A	N/A	N/A	
1	1	Room 111	M	Floor Tile VAT 12" x 12"	8090/01/01/GG	Assumed	200	SF	0	SF	Brown			1	No	1/D	
1	1	Room 111	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A	
1	1	Room 111 Restroom	N/A	Concrete Block Wall		Non Suspect ACM	50	SF	0	SF				N/A	N/A	N/A	
1	1	Room 111 Restroom	N/A	Ceramic Tile Floors		Non Suspect ACM	25	SF	0	SF				N/A	N/A	N/A	
1	1	Room 111 Restroom	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	25	SF	0	SF				N/A	N/A	N/A	
1	1	Counselor's Office	N/A	Concrete Block Wall		Non Suspect ACM	140	SF	0	SF				N/A	N/A	N/A	
1	1	Counselor's Office	M	Floor Tile VAT 12" x 12"	8090/01/01/GG	Assumed	75	SF	0	SF	Grey			1	No	1/D	
1	1	Counselor's Office	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	75	SF	0	SF				N/A	N/A	N/A	
1	1	Nurse's Office	N/A	Sheetrock Wall		Non Suspect ACM	300	SF	0	SF				N/A	N/A	N/A	
1	1	Nurse's Office	M	Floor Tile VAT 12" x 12"	8090/01/01/GG	Assumed	150	SF	0	SF	Tan			1	No	1/D	
1	1	Nurse's Office	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	150	SF	0	SF				N/A	N/A	N/A	
1	1	Nurse's Office Storage	N/A	Sheetrock Wall		Non Suspect ACM	400	SF	0	SF				N/A	N/A	N/A	
1	1	Nurse's Office Storage	M	Floor Tile VAT 12" x 12"	8090/01/01/GG	Assumed	210	SF	0	SF	Tan			1	No	1/D	
1	1	Nurse's Office Storage	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	210	SF	0	SF				N/A	N/A	N/A	
1	1	Nurse's Office Examination Room	N/A	Sheetrock Wall		Non Suspect ACM	300	SF	0	SF				N/A	N/A	N/A	
1	1	Nurse's Office Examination Room	M	Floor Tile VAT 12" x 12"	8090/01/01/GG	Assumed	135	SF	0	SF	Tan			1	No	1/D	
1	1	Nurse's Office Examination Room	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	135	SF	0	SF				N/A	N/A	N/A	
1	1	Education to Career Counselor	N/A	Concrete Block Wall		Non Suspect ACM	140	SF	0	SF				N/A	N/A	N/A	
1	1	Education to Career Counselor	M	Floor Tile VAT 12" x 12"	8090/01/01/GG	Assumed	75	SF	0	SF	Brown			1	No	1/D	
1	1	Education to Career Counselor	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	75	SF	0	SF				N/A	N/A	N/A	
1	1	School Store-Home and School Associate Office	N/A	Sheetrock Wall		Non Suspect ACM	200	SF	0	SF		Update space # column		N/A	N/A	N/A	
1	1	School Store-Home and School Associate Office	N/A	Concrete Block Wall		Non Suspect ACM	750	SF	0	SF		Update space # column		N/A	N/A	N/A	
1	1	School Store-Home and School Associate Office	M	Floor Tile VAT 12" x 12"	8090/01/01/GG	Assumed	300	SF	4	SF	Tan	Update space # column		1	No	6/C	
1	1	School Store-Home and School Associate Office	M	Floor Tile VAT 12" x 12"	8090/01/01/GG	Assumed	150	SF	0	SF	Brown	Update space # column		1	No	1/D	
1	1	School Store-Home and School Associate Office	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	450	SF	0	SF		Update space # column		N/A	N/A	N/A	
1	1	Greenhouse Storage	N/A	Sheetrock Wall		Non Suspect ACM	400	SF	0	SF				N/A	N/A	N/A	
1	1	Greenhouse Storage	M	Floor Tile VAT 12" x 12"	8090/01/01/GG	Assumed	243	SF	0	SF	Tan			1	No	1/D	
1	1	Greenhouse Storage	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	243	SF	0	SF				N/A	N/A	N/A	
1	1	Greenhouse Storage	N/A	Sheetrock Wall		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A	
1	1	Greenhouse Storage	M	Floor Tile VAT 12" x 12"	8090/01/01/GG	Assumed	80	SF	0	SF	Tan			1	No	1/D	
1	1	Greenhouse Storage	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	80	SF	0	SF				N/A	N/A	N/A	
1	1	Classroom 125 Restroom	N/A	Concrete Block Wall		Non Suspect ACM	100	SF	0	SF				N/A	N/A	N/A	
1	1	Classroom 125 Restroom	N/A	Ceramic Tile Floors		Non Suspect ACM	54	SF	0	SF	Tan			N/A	N/A	N/A	
1	1	Classroom 125 Restroom	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	54	SF	0	SF				N/A	N/A	N/A	
1	1	Classroom 125 (Nursing)	N/A	Sheetrock Wall		Non Suspect ACM	2000	SF	0	SF				N/A	N/A	N/A	
1	1	Classroom 125(Nursing)	M	Floor Tile VAT 12" x 12"	8090/01/01/GG	Assumed	1000	SF	0	SF	Brown			1	No	1/D	
1	1	Classroom 125(Nursing)	M	Floor Tile VAT 12" x 12"	8090/01/01/GG	Assumed	200	SF	0	SF	Tan			1	No	1/D	
1	1	Classroom 125(Nursing)	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	1440	SF	0	SF				N/A	N/A	N/A	
1	1	Classroom 128 Storage Room	M	Floor Tile VAT 12" x 12"	8090/01/01/GG	Assumed	225	SF	0	SF	Tan			1	No	1/D	
1	1	Classroom 128 Storage Room	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	225	SF	0	SF				N/A	N/A	N/A	
1	1	Classroom 128 Storage Room	N/A	Concrete Block Wall		Non Suspect ACM	400	SF	0	SF				N/A	N/A	N/A	
1	1	Greenhouse Office	N/A	Concrete Block Wall		Non Suspect ACM	700	SF	0	SF				N/A	N/A	N/A	
1	1	Greenhouse Office	M	Floor Tile VAT 12" x 12"	8090/01/01/GG	Assumed	300	SF	0	SF	Tan			1	No	1/D	
1	1	Greenhouse Office	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	300	SF	0	SF				N/A	N/A	N/A	
1	1	Classroom 128	N/A	Sheetrock Wall		Non Suspect ACM	1300	SF	0	SF				N/A	N/A	N/A	
1	1	Classroom 128	M	Floor Tile VAT 12" x 12"	8090/01/01/GG	Assumed	900	SF	0	SF	Tan			1	No	1/D	
1	1	Classroom 128	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	900	SF	0	SF				N/A	N/A	N/A	
1	1	Classroom 130 (Greenhouse)	M	Floor Tile VAT 12" x 12"	8090/01/01/GG	Assumed	150	SF	0	SF	Tan			1	No	1/D	
1	1	Classroom 130 (Greenhouse)	N/A	Concrete Block Wall		Non Suspect ACM	300	SF	0	SF				N/A	N/A	N/A	
1	1	Classroom 130 (Greenhouse)	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	150	SF	0	SF				N/A	N/A	N/A	
1	1	Greenhouse Foyer	N/A	Sheetrock Wall		Non Suspect ACM	500	SF	0	SF				N/A	N/A	N/A	
1	1	Greenhouse Foyer	M	Floor Tile VAT 12" x 12"	8090/01/01/GG	Assumed	266	SF	0	SF	Tan			1	No	1/D	
1	1	Greenhouse Foyer	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	266	SF	0	SF				N/A	N/A	N/A	
1	1	Greenhouse Garage	N/A	Concrete Ceiling		Non Suspect ACM	400	SF	0	SF				N/A	N/A	N/A	
1	1	Greenhouse Garage	N/A	Concrete Block Wall		Non Suspect ACM	1000	SF	0	SF				N/A	N/A	N/A	
1	1	Greenhouse Garage	N/A	Cement Floor		Non Suspect ACM	400	SF	0	SF				N/A	N/A	N/A	

8090 Swenson Arts and Technology High School 2015-2016 AHERA Three Year Report

School District of Philadelphia			AHERA Three-Year Reinspection 2015-2016										Reinspection Date: 12/05/2015			
Swenson Arts and Technology High School (9-12)			Room by Room Location Log Report										Building Inspector: Norman Harrison			
2750 Red Lion Road, Philadelphia , PA 19114													Certificate Number: ACC-0915-6-011			
UCLS# 8090													Management Planner: Monique Causley			
Date Built: 1976													Certificate Number: ACC-0215-8-010			
Element	Floor	On Site Room Name	System Affected	Material Description	HID#	Confirmed Assumed NAD	Amount of Material	SF LF EA	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic / Crawl Space Ranking	Damage Potential (DP)	Newly Friable (NF)	Response Action (RA)
1	1	Classroom 130 Foyer Storage	N/A	Sheetrock Wall		Non Suspect ACM	300	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 130 Foyer Storage	M	Floor Tile VAT 12" x 12"	8090/01/01/GG	Assumed	130	SF	0	SF	Tan			1	No	1/D
1	1	Classroom 130 Foyer Storage	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	130	SF	0	SF				N/A	N/A	N/A
1	1	Office 150/Special Needs Counselor	N/A	Concrete Block Wall		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A
1	1	Office 150/Special Needs Counselor	M	Floor Tile VAT 12" x 12"	8090/01/01/GG	Assumed	100	SF	0	SF	Tan			1	No	1/D
1	1	Office 150/Special Needs Counselor	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	100	SF	0	SF				N/A	N/A	N/A
1	1	Office 150/Special Needs Counselor Restroom	N/A	Ceramic Tile Walls		Non Suspect ACM	25	SF	0	SF				N/A	N/A	N/A
1	1	Office 150/Special Needs Counselor Restroom	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	25	SF	0	SF				N/A	N/A	N/A
1	1	Office 150/Special Needs Counselor Restroom	N/A	Concrete Block Wall		Non Suspect ACM	50	SF	0	SF				N/A	N/A	N/A
1	1	Office 150/Special Needs Counselor Storage	N/A	Concrete Floor		Non Suspect ACM	20	SF	0	SF				N/A	N/A	N/A
1	1	Office 150/Special Needs Counselor Storage	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	20	SF	0	SF				N/A	N/A	N/A
1	1	Office 150/Special Needs Counselor Storage	N/A	Concrete Block Wall		Non Suspect ACM	45	SF	0	SF				N/A	N/A	N/A
1	1	Boys Restroom Outside Classroom 130	N/A	Ceramic Tile Floors		Non Suspect ACM	100	SF	0	SF				N/A	N/A	N/A
1	1	Boys Restroom Outside Classroom 130	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	100	SF	0	SF				N/A	N/A	N/A
1	1	Boys Restroom Outside Classroom 130	N/A	Concrete Block Wall		Non Suspect ACM	300	SF	0	SF				N/A	N/A	N/A
1	1	Hallway Storage Room at Classroom 130	N/A	Sheetrock Wall		Non Suspect ACM	250	SF	0	SF				N/A	N/A	N/A
1	1	Hallway Storage Room at Classroom 130	M	Floor Tile VAT 12" x 12"	8090/01/01/GG	Assumed	108	SF	0	SF	Tan			1	No	1/D
1	1	Hallway Storage Room at Classroom 130	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	108	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 140	N/A	Sheetrock Wall		Non Suspect ACM	1200	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 140	M	Floor Tile VAT 12" x 12"	8090/01/01/GG	Assumed	1632	SF	0	SF	Tan			1	No	1/D
1	1	Classroom 140	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	1632	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 140	N/A	Concrete Block Wall		Non Suspect ACM	1200	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 140	M	Blackboard Glue Dots	8090/01/01/CR/IML/2600	Assumed	5	SF	0	SF				1	No	1/D
1	1	Classroom 138	N/A	Sheetrock Wall		Non Suspect ACM	1000	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 138	M	Floor Tile VAT 12" x 12"	8090/01/01/GG	Assumed	1410	SF	0	SF	Tan			1	No	1/D
1	1	Classroom 138	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	1410	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 138	N/A	Concrete Block Wall		Non Suspect ACM	1000	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 138	M	Blackboard Glue Dots	8090/01/01/CR/IML/2600	Assumed	5	SF	0	SF				1	No	1/D
1	1	Men's Restroom	N/A	Ceramic Tile Floors		Non Suspect ACM	100	SF	0	SF				N/A	N/A	N/A
1	1	Men's Restroom	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	100	SF	0	SF				N/A	N/A	N/A
1	1	Men's Restroom	N/A	Concrete Block Wall		Non Suspect ACM	300	SF	0	SF				N/A	N/A	N/A
1	1	Boy's Restroom	N/A	Ceramic Tile Floors		Non Suspect ACM	60	SF	0	SF				N/A	N/A	N/A
1	1	Boy's Restroom	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	60	SF	0	SF				N/A	N/A	N/A
1	1	Boy's Restroom	N/A	Concrete Block Wall		Non Suspect ACM	150	SF	0	SF				N/A	N/A	N/A
1	1	Custodian Storage Room	N/A	Concrete Block Wall		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A
1	1	Custodian Storage Room	N/A	Cement Floor		Non Suspect ACM	80	SF	0	SF				N/A	N/A	N/A
1	1	Custodian Storage Room	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	80	SF	0	SF				N/A	N/A	N/A
1	1	Girl's Restroom	N/A	Ceramic Tile Floors		Non Suspect ACM	150	SF	0	SF				N/A	N/A	N/A
1	1	Girl's Restroom	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	150	SF	0	SF				N/A	N/A	N/A
1	1	Girl's Restroom	N/A	Concrete Block Wall		Non Suspect ACM	300	SF	0	SF				N/A	N/A	N/A
1	1	Women's Restroom	N/A	Ceramic Tile Floors		Non Suspect ACM	40	SF	0	SF				N/A	N/A	N/A
1	1	Women's Restroom	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	40	SF	0	SF				N/A	N/A	N/A
1	1	Women's Restroom	N/A	Concrete Block Wall		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A
1	1	Classroom 144	M	Floor Tile VAT 12" x 12"	8090/01/01/GG	Assumed	850	SF	0	SF	Tan	Update space # column		1	No	1/D
1	1	Classroom 144	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	850	SF	0	SF		Update space # column		N/A	N/A	N/A
1	1	Classroom 144	N/A	Concrete Block Wall		Non Suspect ACM	1200	SF	0	SF		Update space # column		N/A	N/A	N/A
1	1	Classroom 144 Storage Closet 141	M	Floor Tile VAT 12" x 12"	8090/01/01/GG	Assumed	400	SF	0	SF	Tan	Update space # column		N/A	N/A	N/A
1	1	Classroom 144 Storage Closet 141	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	300	SF	0	SF		Update space # column		1	No	1/D
1	1	Classroom 144 Storage Closet 141	N/A	Concrete Block Wall		Non Suspect ACM	300	SF	0	SF		Update space # column		N/A	N/A	N/A
1	1	Classroom 144 Storage Closet 141	N/A	Concrete Block Wall		Non Suspect ACM	500	SF	0	SF		Update space # column		N/A	N/A	N/A
1	1	Classroom 144 Men's Restroom	N/A	Ceramic Tile Floors		Non Suspect ACM	40	SF	0			Update space # column		N/A	N/A	N/A
1	1	Classroom 144 Men's Restroom	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	40	SF	0			Update space # column		N/A	N/A	N/A
1	1	Classroom 144 Men's Restroom	N/A	Concrete Block Wall		Non Suspect ACM	100	SF	0			Update space # column		N/A	N/A	N/A
1	1	Classroom 144 Storage Closet 143	M	Floor Tile VAT 12" x 12"	8090/01/01/GG	Assumed	75	SF	0	SF	Tan	Update space # column		1	No	1/D
1	1	Classroom 144 Storage Closet 143	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	75	SF	0	SF		Update space # column		N/A	N/A	N/A
1	1	Classroom 144 Storage Closet 143	N/A	Concrete Block Wall		Non Suspect ACM	140	SF	0	SF		Update space # column		N/A	N/A	N/A
1	1	Classroom 144 Storage Closet Next to Women's Restroom	M	Floor Tile VAT 12" x 12"	8090/01/01/GG	Assumed	60	SF	0	SF	Tan	Update space # column		1	No	1/D
1	1	Classroom 144 Storage Closet Next to Women's Restroom	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	60	SF	0	SF		Update space # column		N/A	N/A	N/A
1	1	Classroom 144 Storage Closet Next to Women's Restroom	N/A	Concrete Block Wall		Non Suspect ACM	120	SF	0	SF		Update space # column		N/A	N/A	N/A
1	1	Classroom 144 Girl's Restroom	N/A	Non Tile Floors		Non Suspect ACM	40	SF	0	SF		IS THIS RESTROOM IN A CLASSROOM???		N/A	N/A	N/A
1	1	Classroom 144 Girl's Restroom	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	40	SF	0			Update space # column		N/A	N/A	N/A
1	1	Classroom 144 Girl's Restroom	N/A	Concrete Block Wall		Non Suspect ACM	100	SF	0			Update space # column		N/A	N/A	N/A
1	1	Classroom 146	X	X		X	X	X	X	X	X			X	X	X
1	1	Swenson High School Conference Room	M	Floor Tile VAT 12" x 12"	8090/01/01/GG	Assumed	60	SF	0	SF	Tan	Update space # column		1	No	1/D
1	1	Swenson High School Conference Room	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	60	SF	0	SF		Update space # column		N/A	N/A	N/A
1	1	Swenson High School Conference Room	N/A	Concrete Block Wall		Non Suspect ACM	120	SF	0	SF		Update space # column		N/A	N/A	N/A
1	1	Bakery Kitchen	N/A	Ceramic Tile Walls		Non Suspect ACM	3000	SF	0	SF		Update space # column		N/A	N/A	N/A
1	1	Bakery Kitchen	N/A	Ceramic Tile Floors		Non Suspect ACM	1935	SF	0	SF		Update space # column		N/A	N/A	N/A
1	1	Bakery Kitchen	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	1935	SF	0	SF		Update space # column		N/A	N/A	N/A
1	1	Bakery Storage Room	N/A	Ceramic Tile Floors		Non Suspect ACM	75	SF	0	SF		Update space # column		N/A	N/A	N/A
1	1	Bakery Storage Room	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	75	SF	0	SF		Update space # column		N/A	N/A	N/A
1	1	Bakery Storage Room	N/A	Ceramic Tile Walls		Non Suspect ACM	150	SF	0	SF		Update space # column		N/A	N/A	N/A
1	1	Bakery Office	N/A	Ceramic Tile Floors		Non Suspect ACM	75	SF	0	SF		Update space # column		N/A	N/A	N/A
1	1	Bakery Office	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	75	SF	0	SF		Update space # column		N/A	N/A	N/A
1	1	Bakery Office	N/A	Ceramic Tile Walls		Non Suspect ACM	150	SF	0	SF		Update space # column		N/A	N/A	N/A
1	1	Girl's Bakery Kitchen Restroom	N/A	Ceramic Tile Floors		Non Suspect ACM	30	SF	0	SF		Update space # column		N/A	N/A	N/A

8090 Swenson Arts and Technology High School 2015-2016 AHERA Three Year Report

School District of Philadelphia			AHERA Three-Year Reinspection 2015-2016										Reinspection Date: 12/05/2015			
Swenson Arts and Technology High School (9-12)			Room by Room Location Log Report										Building Inspector: Norman Harrison			
2750 Red Lion Road, Philadelphia , PA 19114													Certificate Number: ACC-0915-6-011			
UCLS# 8090													Management Planner: Monique Causley			
Date Built: 1976													Certificate Number: ACC-0215-8-010			
Element	Floor	On Site Room Name	System Affected	Material Description	HID#	Confirmed Assumed NAD	Amount of Material	SF LF EA	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic / Crawl Space Ranking	Damage Potential (DP)	Newly Friable (NF)	Response Action (RA)
1	1	Girl's Bakery Kitchen Restroom	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	30	SF	0	SF		Update space # column		N/A	N/A	N/A
1	1	Girl's Bakery Kitchen Restroom	N/A	Concrete Block Wall		Non Suspect ACM	100	SF	0	SF		Update space # column		N/A	N/A	N/A
1	1	Culinary Supply Room Next to Girl's Restroom	N/A	Ceramic Tile Floors		Non Suspect ACM	50	SF	0	SF		Update space # column		N/A	N/A	N/A
1	1	Culinary Supply Room Next to Girl's Restroom	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	50	SF	0	SF		Update space # column		N/A	N/A	N/A
1	1	Culinary Supply Room Next to Girl's Restroom	N/A	Concrete Block Wall		Non Suspect ACM	100	SF	0	SF		Update space # column		N/A	N/A	N/A
1	1	Bakery Storage Closet Across from Girl's Restroom	N/A	Ceramic Tile Floors		Non Suspect ACM	30	SF	0	SF		Update space # column		N/A	N/A	N/A
1	1	Bakery Storage Closet Across from Girl's Restroom	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	30	SF	0	SF		Update space # column		N/A	N/A	N/A
1	1	Bakery Storage Closet Across from Girl's Restroom	N/A	Concrete Block Wall		Non Suspect ACM	60	SF	0	SF		Update space # column		N/A	N/A	N/A
1	1	Electrical Room in Culinary	N/A	Concrete Floor		Non Suspect ACM	30	SF	0	SF		Update space # column		N/A	N/A	N/A
1	1	Electrical Room in Culinary	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	30	SF	0	SF		Update space # column		N/A	N/A	N/A
1	1	Electrical Room in Culinary	N/A	Concrete Block Wall		Non Suspect ACM	60	SF	0	SF		Update space # column		N/A	N/A	N/A
1	1	Custodial Closet in Culinary	N/A	Concrete Floor		Non Suspect ACM	25	SF	0	SF		Update space # column		N/A	N/A	N/A
1	1	Custodial Closet in Culinary	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	25	SF	0	SF		Update space # column		N/A	N/A	N/A
1	1	Custodial Closet in Culinary	N/A	Concrete Block Wall		Non Suspect ACM	50	SF	0	SF		Update space # column		N/A	N/A	N/A
1	1	Culinary Kitchen	N/A	Ceramic Tile Walls		Non Suspect ACM	4000	SF	0	SF		Update space # column		N/A	N/A	N/A
1	1	Culinary Kitchen	N/A	Ceramic Tile Floors		Non Suspect ACM	1960	SF	0	SF		Update space # column		N/A	N/A	N/A
1	1	Culinary Kitchen	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	1960	SF	0	SF		Update space # column		N/A	N/A	N/A
1	1	Culinary Kitchen Office	M	Floor Tile VAT 12" x 12"	8090/01/01/GG	Assumed	60	SF	0	SF	Tan	Update space # column		1	No	1/D
1	1	Culinary Kitchen Office	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	60	SF	0	SF		Update space # column		N/A	N/A	N/A
1	1	Culinary Kitchen Office	N/A	Concrete Block Wall		Non Suspect ACM	120	SF	0	SF		Update space # column		N/A	N/A	N/A
1	1	Custodial Closet across from Culinary Kitchen Office	N/A	Concrete Floor		Non Suspect ACM	25	SF	0	SF		Update space # column		N/A	N/A	N/A
1	1	Custodial Closet across from Culinary Kitchen Office	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	25	SF	0	SF		Update space # column		N/A	N/A	N/A
1	1	Custodial Closet across from Culinary Kitchen Office	N/A	Concrete Block Wall		Non Suspect ACM	50	SF	0	SF		Update space # column		N/A	N/A	N/A
1	1	Boy's Restroom in Culinary	N/A	Ceramic Tile Floors		Non Suspect ACM	40	SF	0	SF		Update space # column		N/A	N/A	N/A
1	1	Boy's Restroom in Culinary	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	40	SF	0	SF		Update space # column		N/A	N/A	N/A
1	1	Boy's Restroom in Culinary	N/A	Concrete Block Wall		Non Suspect ACM	200	SF	0	SF		Update space # column		N/A	N/A	N/A
1	1	Food Storage Room Next to Boy's Restroom	X	X		X	X	X	X	X	X	No Access. Update space # column		X	X	X
1	1	Restaurant Classroom	N/A	Ceramic Tile Floors		Non Suspect ACM	700	SF	0	SF		Update space # column		N/A	N/A	N/A
1	1	Restaurant Classroom	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	900	SF	0	SF		Update space # column		N/A	N/A	N/A
1	1	Restaurant Classroom	N/A	Ceramic Tile Walls		Non Suspect ACM	400	SF	0	SF		Update space # column		N/A	N/A	N/A
1	1	Restaurant Classroom	N/A	Carpet		Non Suspect ACM	200	SF	0	SF		Update space # column		N/A	N/A	N/A
1	1	Restaurant Classroom	N/A	Metal Wall		Non Suspect ACM	1100	SF	0	SF		Update space # column		N/A	N/A	N/A
1	1	Restaurant Classroom Staff Lounge	M	Floor Tile VAT 12" x 12"	8090/01/01/GG	Assumed	300	SF	0	SF	Brown	Update space # column		1	No	1/D
1	1	Restaurant Classroom Staff Lounge	N/A	Concrete Block Wall		Non Suspect ACM	600	SF	0	SF		Update space # column		N/A	N/A	N/A
1	1	Restaurant Classroom Staff Lounge	N/A	Sheetrock Wall		Non Suspect ACM	100	SF	0	SF		Update space # column		N/A	N/A	N/A
1	1	Restaurant Classroom Staff Lounge	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	300	SF	0	SF		Update space # column		N/A	N/A	N/A
1	1	Bake Shop Theory Room	M	Floor Tile VAT 12" x 12"	8090/01/01/GG	Assumed	450	SF	0	SF	Tan	Update space # column		1	No	1/D
1	1	Bake Shop Theory Room	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	450	SF	0	SF		Update space # column		N/A	N/A	N/A
1	1	Bake Shop Theory Room	N/A	Concrete Block Wall		Non Suspect ACM	800	SF	0	SF		Update space # column		N/A	N/A	N/A
1	1	Bake Shop Theory Room Restroom	N/A	Ceramic Tile Floors		Non Suspect ACM	40	SF	0	SF		Update space # column		N/A	N/A	N/A
1	1	Bake Shop Theory Room Restroom	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	40	SF	0	SF		Update space # column		N/A	N/A	N/A
1	1	Bake Shop Theory Room Restroom	N/A	Concrete Block Wall		Non Suspect ACM	90	SF	0	SF		Update space # column		N/A	N/A	N/A
1	1	Bake Shop Theory Room Custodial Closet	N/A	Concrete Floor		Non Suspect ACM	65	SF	0			Update space # column		N/A	N/A	N/A
1	1	Bake Shop Theory Room Custodial Closet	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	65	SF	0			Update space # column		N/A	N/A	N/A
1	1	Bake Shop Theory Room Custodial Closet	N/A	Concrete Block Wall		Non Suspect ACM	110	SF	0			Update space # column		N/A	N/A	N/A
1	1	Bake Shop Theory Room Closet	X	X		X	X	X	X	X	X	No Access. Update space # column		X	X	X
1	1	Bake Shop Theory Room Office Across Restroom	M	Floor Tile VAT 12" x 12"	8090/01/01/GG	Assumed	150	SF	0	SF	Tan	Update space # column		1	No	1/D
1	1	Bake Shop Theory Room Office Across Restroom	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	150	SF	0	SF		Update space # column		N/A	N/A	N/A
1	1	Bake Shop Theory Room Office Across Restroom	N/A	Concrete Block Wall		Non Suspect ACM	300	SF	0	SF		Update space # column		N/A	N/A	N/A
1	1	Kitchen Cleaning and Cooking Supplies Next to Bake Shop Theory Room	M	Floor Tile VAT 12" x 12"	8090/01/01/GG	Assumed	100	SF	0	SF	Tan	Update space # column		1	No	1/D
1	1	Kitchen Cleaning and Cooking Supplies Next to Bake Shop Theory Room	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	100	SF	0	SF		Update space # column		N/A	N/A	N/A
1	1	Kitchen Cleaning and Cooking Supplies Next to Bake Shop Theory Room	N/A	Concrete Block Wall		Non Suspect ACM	200	SF	0	SF		Update space # column		N/A	N/A	N/A
1	1	Special Needs Room across from Bake Shop Theory Room	M	Floor Tile VAT 12" x 12"	8090/01/01/GG	Assumed	600	SF	0	SF	Tan	Update space # column		1	No	1/D
1	1	Special Needs Room across from Bake Shop Theory Room	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	600	SF	0	SF		Update space # column		N/A	N/A	N/A
1	1	Special Needs Room across from Bake Shop Theory Room	N/A	Concrete Block Wall		Non Suspect ACM	1200	SF	0	SF		Update space # column		N/A	N/A	N/A
1	1	Special Needs Room across from Bake Shop Theory Room Kitchen	M	Floor Tile VAT 12" x 12"	8090/01/01/GG	Assumed	60	SF	0	SF	Green	Update space # column		1	No	1/D
1	1	Special Needs Room across from Bake Shop Theory Room Kitchen	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	60	SF	0	SF		Update space # column		N/A	N/A	N/A
1	1	Special Needs Room across from Bake Shop Theory Room Kitchen	N/A	Concrete Block Wall		Non Suspect ACM	120	SF	0	SF		Update space # column		N/A	N/A	N/A
1	1	Special Needs Room across from Bake Shop Theory Room Restroom	N/A	Ceramic Tile Floors		Non Suspect ACM	40	SF	0	SF		Update space # column		N/A	N/A	N/A
1	1	Special Needs Room across from Bake Shop Theory Room Restroom	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	40	SF	0	SF		Update space # column		N/A	N/A	N/A
1	1	Special Needs Room across from Bake Shop Theory Room Restroom	N/A	Concrete Block Wall		Non Suspect ACM	90	SF	0	SF		Update space # column		N/A	N/A	N/A
1	1	Special Needs Room across from Bake Shop Theory Room Closet	M	Floor Tile VAT 12" x 12"	8090/01/01/GG	Assumed	60	SF	0	SF	Grey	Update space # column		1	No	1/D
1	1	Special Needs Room across from Bake Shop Theory Room Closet	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	60	SF	0	SF		Update space # column		N/A	N/A	N/A
1	1	Special Needs Room across from Bake Shop Theory Room Closet	N/A	Concrete Block Wall		Non Suspect ACM	120	SF	0	SF		Update space # column		N/A	N/A	N/A
1	1	Health Classroom in Cafeteria	M	Floor Tile VAT 12" x 12"	8090/01/01/GG	Assumed	400	SF	0	SF	Brown	Update space # column		1	No	1/D
1	1	Health Classroom in Cafeteria	M	Floor Tile VAT 12" x 12"	8090/01/01/GG	Assumed	400	SF	0	SF	Tan	Update space # column		1	No	1/D

8090 Swenson Arts and Technology High School 2015-2016 AHERA Three Year Report

School District of Philadelphia Swenson Arts and Technology High School (9-12) 2750 Red Lion Road, Philadelphia , PA 19114 UCLS# 8090 Date Built: 1976			AHERA Three-Year Reinspection 2015-2016 Room by Room Location Log Report										Reinspection Date: 12/05/2015 Building Inspector: Norman Harrison Certificate Number: ACC-0915-6-011 Management Planner: Monique Causley Certificate Number: ACC-0215-8-010							
Element	Floor	On Site Room Name	System Affected	Material Description	HID#	Confirmed Assumed NAD	Amount of Material	SF LF EA	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic / Crawl Space Ranking	Damage Potential (DP)	Newly Friable (NF)	Response Action (RA)				
1	1	Health Classroom in Cafeteria	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	800	SF	0	SF		Update space # column		N/A	N/A	N/A				
1	1	Health Classroom in Cafeteria	N/A	Concrete Block Wall		Non Suspect ACM	600	SF	0	SF		Update space # column		N/A	N/A	N/A				
1	1	Health Classroom in Cafeteria	N/A	Sheetrock Wall		Non Suspect ACM	800	SF	0	SF		Update space # column		N/A	N/A	N/A				
1	1	Student Cafeteria	M	Floor Tile VAT 12" x 12"	8090/01/01/GG	Assumed	8192	SF	10	SF	Multi			1	No	6/C				
1	1	Student Cafeteria	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	8192	SF	0	SF				N/A	N/A	N/A				
1	1	Student Cafeteria	N/A	Concrete Block Wall		Non Suspect ACM	9000	SF	0	SF				N/A	N/A	N/A				
1	1	Student Cafeteria	N/A	Sheetrock Wall		Non Suspect ACM	800	SF	0	SF				N/A	N/A	N/A				
1	1	Cafeteria Storage	M	Floor Tile VAT 12" x 12"	8090/01/01/GG	Assumed	5000	SF	0	SF	Tan			1	No	1/D				
1	1	Cafeteria Storage	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	5000	SF	0	SF				N/A	N/A	N/A				
1	1	Cafeteria Storage	N/A	Concrete Block Wall		Non Suspect ACM	7500	SF	0	SF				N/A	N/A	N/A				
1	1	Classroom 181	M	Floor Tile VAT 12" x 12"	8090/01/01/GG	Assumed	2925	SF	0	SF	Tan			1	No	1/D				
1	1	Classroom 181	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	2925	SF	0	SF				N/A	N/A	N/A				
1	1	Classroom 181	N/A	Concrete Block Wall		Non Suspect ACM	4000	SF	0	SF				N/A	N/A	N/A				
1	1	Special Needs Classroom	M	Floor Tile VAT 12" x 12"	8090/01/01/GG	Assumed	300	SF	0	SF	Brown			1	No	1/D				
1	1	Special Needs Classroom	M	Floor Tile VAT 12" x 12"	8090/01/01/GG	Assumed	300	SF	0	SF	Tan			1	No	1/D				
1	1	Special Needs Classroom	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	600	SF	0	SF				N/A	N/A	N/A				
1	1	Special Needs Classroom	N/A	Concrete Block Wall		Non Suspect ACM	650	SF	0	SF				N/A	N/A	N/A				
1	1	Special Needs Classroom	N/A	Sheetrock Wall		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A				
1	1	Cafeteria Kitchen	N/A	Ceramic Tile Walls		Non Suspect ACM	3000	SF	0	SF				N/A	N/A	N/A				
1	1	Cafeteria Kitchen	N/A	Ceramic Tile Floors		Non Suspect ACM	1500	SF	0	SF				N/A	N/A	N/A				
1	1	Cafeteria Kitchen	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	1500	SF	0	SF				N/A	N/A	N/A				
1	1	Boy's Restroom (Cafeteria)	N/A	Ceramic Tile Floors		Non Suspect ACM	140	SF	0	SF				N/A	N/A	N/A				
1	1	Boy's Restroom (Cafeteria)	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	140	SF	0	SF				N/A	N/A	N/A				
1	1	Boy's Restroom (Cafeteria)	N/A	Concrete Block Wall		Non Suspect ACM	300	SF	0	SF				N/A	N/A	N/A				
1	1	Girl's Restroom (Cafeteria)	N/A	Ceramic Tile Floors		Non Suspect ACM	140	SF	0	SF				N/A	N/A	N/A				
1	1	Girl's Restroom (Cafeteria)	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	140	SF	0	SF				N/A	N/A	N/A				
1	1	Girl's Restroom (Cafeteria)	N/A	Concrete Block Wall		Non Suspect ACM	300	SF	0	SF				N/A	N/A	N/A				
1	1	Cafeteria Kitchen Dry Storage	N/A	Ceramic Tile Floors		Non Suspect ACM	576	SF	0	SF				N/A	N/A	N/A				
1	1	Cafeteria Kitchen Dry Storage	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	576	SF	0	SF				N/A	N/A	N/A				
1	1	Cafeteria Kitchen Dry Storage	N/A	Concrete Block Wall		Non Suspect ACM	1000	SF	0	SF				N/A	N/A	N/A				
1	1	Can Wash	N/A	Concrete Floor		Non Suspect ACM	140	SF	0	SF				N/A	N/A	N/A				
1	1	Can Wash	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	140	SF	0	SF				N/A	N/A	N/A				
1	1	Can Wash	N/A	Concrete Block Wall		Non Suspect ACM	400	SF	0	SF				N/A	N/A	N/A				
1	1	Men's Restroom in Kitchen	N/A	Ceramic Tile Floors		Non Suspect ACM	168	SF	0	SF				N/A	N/A	N/A				
1	1	Men's Restroom in Kitchen	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	168	SF	0	SF				N/A	N/A	N/A				
1	1	Men's Restroom in Kitchen	N/A	Concrete Block Wall		Non Suspect ACM	300	SF	0	SF				N/A	N/A	N/A				
1	1	Women's Restroom in Kitchen	N/A	Ceramic Tile Floors		Non Suspect ACM	168	SF	0	SF				N/A	N/A	N/A				
1	1	Women's Restroom in Kitchen	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	168	SF	0	SF				N/A	N/A	N/A				
1	1	Women's Restroom in Kitchen	N/A	Concrete Block Wall		Non Suspect ACM	300	SF	0	SF				N/A	N/A	N/A				
1	1	Cafeteria Office	M	Floor Tile VAT 12" x 12"	8090/01/01/GG	Assumed	98	SF	0	SF	Green			1	No	1/D				
1	1	Cafeteria Office	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	98	SF	0	SF				N/A	N/A	N/A				
1	1	Cafeteria Office	N/A	Concrete Block Wall		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A				
1	1	IMC	N/A	Concrete Block Wall		Non Suspect ACM	3000	SF	0	SF				N/A	N/A	N/A				
1	1	IMC	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	1456	SF	0	SF				N/A	N/A	N/A				
1	1	IMC	N/A	Carpet		Non Suspect ACM	1456	SF	0	SF				N/A	N/A	N/A				
1	1	IMC Office	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	260	SF	0	SF				N/A	N/A	N/A				
1	1	IMC Office	N/A	Carpet		Non Suspect ACM	260	SF	0	SF				N/A	N/A	N/A				
1	1	IMC Office	N/A	Concrete Block Wall		Non Suspect ACM	400	SF	0	SF				N/A	N/A	N/A				
1	1	IMC Storage	N/A	Cement Floor		Non Suspect ACM	224	SF	0	SF				N/A	N/A	N/A				
1	1	IMC Storage	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	224	SF	0	SF				N/A	N/A	N/A				
1	1	IMC Storage	N/A	Concrete Block Wall		Non Suspect ACM	400	SF	0	SF				N/A	N/A	N/A				
1	1	Book Storage	N/A	Cement Floor		Non Suspect ACM	80	SF	0	SF				N/A	N/A	N/A				
1	1	Book Storage	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	80	SF	0	SF				N/A	N/A	N/A				
1	1	Book Storage	N/A	Concrete Block Wall		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A				
1	1	Mechanical Room	N/A	Concrete Ceiling		Non Suspect ACM	81	SF	0	SF				N/A	N/A	N/A				
1	1	Mechanical Room	N/A	Cement Floor		Non Suspect ACM	81	SF	0	SF				N/A	N/A	N/A				
1	1	Mechanical Room	N/A	Concrete Block Wall		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A				
1	1	Hallway between Main Office-Nurse's Office	N/A	Sheetrock Wall		Non Suspect ACM	250	SF	0	SF				N/A	N/A	N/A				
1	1	Hallway between Main Office-Nurse's Office	M	Floor Tile VAT 12" x 12"	8090/01/01/GG	Assumed	117	SF	0	SF	Tan			1	No	1/D				
1	1	Hallway between Main Office-Nurse's Office	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	117	SF	0	SF				N/A	N/A	N/A				
1	1	Hallway between Main Office-Nurse's Office	N/A	Concrete Block Wall		Non Suspect ACM	250	SF	0	SF				N/A	N/A	N/A				
1	1	Hallway Conference Room	N/A	Sheetrock Wall		Non Suspect ACM	300	SF	0	SF				N/A	N/A	N/A				
1	1	Hallway Conference Room	M	Floor Tile VAT 12" x 12"	8090/01/01/GG	Assumed	192	SF	0	SF	Tan			1	No	1/D				
1	1	Hallway Conference Room	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	192	SF	0	SF				N/A	N/A	N/A				
1	1	Hallway Conference Room	N/A	Concrete Block Wall		Non Suspect ACM	300	SF	0	SF				N/A	N/A	N/A				
1	1	Hallway Nursing Suite	N/A	Sheetrock Wall		Non Suspect ACM	250	SF	0	SF				N/A	N/A	N/A				
1	1	Hallway Nursing Suite	M	Floor Tile VAT 12" x 12"	8090/01/01/GG	Assumed	132	SF	0	SF	Tan			1	No	1/D				
1	1	Hallway Nursing Suite	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	132	SF	0	SF				N/A	N/A	N/A				
1	1	Hallway Nursing Suite	N/A	Concrete Block Wall		Non Suspect ACM	250	SF	0	SF				N/A	N/A	N/A				
1	1	Hallway Main Office Suite	N/A	Sheetrock Wall		Non Suspect ACM	1000	SF	0	SF				N/A	N/A	N/A				
1	1	Hallway Main Office Suite	M	Floor Tile VAT 12" x 12"	8090/01/01/GG	Assumed	808	SF	0	SF	Tan			1	No	1/D				
1	1	Hallway Main Office Suite	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	808	SF	0	SF				N/A	N/A	N/A				
1	1	Hallway Main Office Suite	N/A	Concrete Block Wall		Non Suspect ACM	800	SF	0	SF				N/A	N/A	N/A				
1	1	Hallway Connector Kitchen - Main Hallway	N/A	Sheetrock Wall		Non Suspect ACM	1200	SF	0	SF				N/A	N/A	N/A				
1	1	Hallway Connector Kitchen - Main Hallway	M	Floor Tile VAT 12" x 12"	8090/01/01/GG	Assumed	1431	SF	0	SF	Tan			1	No	1/D				
1	1	Hallway Connector Kitchen - Main Hallway	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	1431	SF	0	SF				N/A	N/A	N/A				

8090 Swenson Arts and Technology High School 2015-2016 AHERA Three Year Report

School District of Philadelphia Swenson Arts and Technology High School (9-12) 2750 Red Lion Road, Philadelphia , PA 19114 UCLS# 8090 Date Built: 1976			AHERA Three-Year Reinspection 2015-2016 Room by Room Location Log Report										Reinspection Date: 12/05/2015 Building Inspector: Norman Harrison Certificate Number: ACC-0915-6-011 Management Planner: Monique Causley Certificate Number: ACC-0215-8-010			
Element	Floor	On Site Room Name	System Affected	Material Description	HID#	Confirmed Assumed NAD Non Suspect ACM	Amount of Material	SF LF EA	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic / Crawl Space Ranking	Damage Potential (DP)	Newly Friable (NF)	Response Action (RA)
1	1	Hallway Connector Kitchen - Main Hallway	N/A	Concrete Block Wall		Non Suspect ACM	1200	SF	0	SF				N/A	N/A	N/A
1	1	Hallway Classroom 187	N/A	Sheetrock Wall		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A
1	1	Hallway Classroom 187	M	Floor Tile VAT 12" x 12"	8090/01/01/GG	Assumed	84	SF	0	SF	Tan			1	No	1/D
1	1	Hallway Classroom 187	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	84	SF	0	SF				N/A	N/A	N/A
1	1	Hallway Classroom 187	N/A	Concrete Block Wall		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A
1	1	Hallway Emergency Exit adjacent to Nurse's Office	N/A	Sheetrock Wall		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A
1	1	Hallway Emergency Exit adjacent to Nurse's Office	M	Floor Tile VAT 12" x 12"	8090/01/01/GG	Assumed	84	SF	0	SF	Tan			1	No	1/D
1	1	Hallway Emergency Exit adjacent to Nurse's Office	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	84	SF	0	SF				N/A	N/A	N/A
1	1	Hallway Emergency Exit adjacent to Nurse's Office	N/A	Concrete Block Wall		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A
1	1	Hallway Connector IMC	N/A	Sheetrock Wall		Non Suspect ACM	500	SF	0	SF				N/A	N/A	N/A
1	1	Hallway Connector IMC	M	Floor Tile VAT 12" x 12"	8090/01/01/GG	Assumed	328	SF	0	SF	Tan			1	No	1/D
1	1	Hallway Connector IMC	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	328	SF	0	SF				N/A	N/A	N/A
1	1	Hallway Connector IMC	N/A	Concrete Block Wall		Non Suspect ACM	500	SF	0	SF				N/A	N/A	N/A
1	1	Hallway Student Restrooms	N/A	Sheetrock Wall		Non Suspect ACM	350	SF	0	SF				N/A	N/A	N/A
1	1	Hallway Student Restrooms	M	Floor Tile VAT 12" x 12"	8090/01/01/GG	Assumed	160	SF	0	SF	Tan			1	No	1/D
1	1	Hallway Student Restrooms	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	160	SF	0	SF				N/A	N/A	N/A
1	1	Hallway Student Restrooms	N/A	Concrete Block Wall		Non Suspect ACM	350	SF	0	SF				N/A	N/A	N/A
1	1	Hallway Staff Restrooms	N/A	Sheetrock Wall		Non Suspect ACM	350	SF	0	SF				N/A	N/A	N/A
1	1	Hallway Staff Restrooms	M	Floor Tile VAT 12" x 12"	8090/01/01/GG	Assumed	192	SF	0	SF	Tan			1	No	1/D
1	1	Hallway Staff Restrooms	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	192	SF	0	SF				N/A	N/A	N/A
1	1	Hallway Staff Restrooms	N/A	Concrete Block Wall		Non Suspect ACM	350	SF	0	SF				N/A	N/A	N/A
1	1	Hallway between Classroom 124/124A	N/A	Sheetrock Wall		Non Suspect ACM	300	SF	0	SF				N/A	N/A	N/A
1	1	Hallway between Classroom 124/124A	M	Floor Tile VAT 12" x 12"	8090/01/01/GG	Assumed	210	SF	0	SF	Tan			1	No	1/D
1	1	Hallway between Classroom 124/124A	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	210	SF	0	SF				N/A	N/A	N/A
1	1	Hallway between Classroom 124/124A	N/A	Concrete Block Wall		Non Suspect ACM	300	SF	0	SF				N/A	N/A	N/A
1	1	Hallway between Classroom 124/124A	N/A	Sheetrock Wall		Non Suspect ACM	300	SF	0	SF				N/A	N/A	N/A
1	1	Hallway between Classroom 124/124A	M	Floor Tile VAT 12" x 12"	8090/01/01/GG	Assumed	210	SF	0	SF	Tan			1	No	1/D
1	1	Hallway between Classroom 124/124A	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	210	SF	0	SF				N/A	N/A	N/A
1	1	Hallway between Classroom 124/124A	N/A	Concrete Block Wall		Non Suspect ACM	300	SF	0	SF				N/A	N/A	N/A
1	1	Hallway between Classroom 131-140A	N/A	Sheetrock Wall		Non Suspect ACM	1000	SF	0	SF				N/A	N/A	N/A
1	1	Hallway between Classroom 131-140A	M	Floor Tile VAT 12" x 12"	8090/01/01/GG	Assumed	1296	SF	0	SF	Tan			1	No	1/D
1	1	Hallway between Classroom 131-140A	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	1296	SF	0	SF				N/A	N/A	N/A
1	1	Hallway between Classroom 131-140A	N/A	Concrete Block Wall		Non Suspect ACM	800	SF	0	SF				N/A	N/A	N/A
1	1	Hallway between Classroom 131	N/A	Sheetrock Wall		Non Suspect ACM	100	SF	0	SF				N/A	N/A	N/A
1	1	Hallway between Classroom 131	M	Floor Tile VAT 12" x 12"	8090/01/01/GG	Assumed	54	SF	0	SF	Tan			1	No	1/D
1	1	Hallway between Classroom 131	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	54	SF	0	SF				N/A	N/A	N/A
1	1	Hallway between Classroom 131	N/A	Concrete Block Wall		Non Suspect ACM	100	SF	0	SF				N/A	N/A	N/A
1	1	Hallway Culinary/Bakery(Kitchen)	N/A	Sheetrock Wall		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A
1	1	Hallway Culinary/Bakery(Kitchen)	M	Floor Tile VAT 12" x 12"	8090/01/01/GG	Assumed	125	SF	0	SF	Tan			1	No	1/D
1	1	Hallway Culinary/Bakery(Kitchen)	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	125	SF	0	SF				N/A	N/A	N/A
1	1	Hallway Culinary/Bakery(Kitchen)	N/A	Concrete Block Wall		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A
1	1	Hallway Culinary/Bakery (Wing)	N/A	Sheetrock Wall		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A
1	1	Hallway Culinary/Bakery (Wing)	M	Floor Tile VAT 12" x 12"	8090/01/01/GG	Assumed	150	SF	0	SF	Tan			1	No	1/D
1	1	Hallway Culinary/Bakery (Wing)	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	150	SF	0	SF				N/A	N/A	N/A
1	1	Hallway Culinary/Bakery (Wing)	N/A	Concrete Block Wall		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A
1	1	Hallway Main Lobby	N/A	Sheetrock Wall		Non Suspect ACM	1000	SF	0	SF				N/A	N/A	N/A
1	1	Hallway Main Lobby	M	Floor Tile VAT 12" x 12"	8090/01/01/GG	Assumed	1080	SF	0	SF	Tan			1	No	1/D
1	1	Hallway Main Lobby	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	1080	SF	0	SF				N/A	N/A	N/A
1	1	Hallway Main Lobby	N/A	Concrete Block Wall		Non Suspect ACM	1500	SF	0	SF				N/A	N/A	N/A
1	1	Hallway Connector IMC	N/A	Sheetrock Wall		Non Suspect ACM	2000	SF	0	SF				N/A	N/A	N/A
1	1	Hallway Connector IMC	M	Floor Tile VAT 12" x 12"	8090/01/01/GG	Assumed	1781	SF	0	SF	Tan			1	No	1/D
1	1	Hallway Connector IMC	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	1781	SF	0	SF				N/A	N/A	N/A
1	1	Hallway Connector IMC	N/A	Concrete Block Wall		Non Suspect ACM	1000	SF	0	SF				N/A	N/A	N/A
1	1	Stairs next to Main Office	N/A	Concrete Ceiling		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A
1	1	Stairs next to Main Office	N/A	Concrete Block Wall		Non Suspect ACM	500	SF	0	SF				N/A	N/A	N/A
1	1	Stairs next to Main Office	N/A	Cement Floor		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A
1	1	Stairs next to Classroom 120	N/A	Concrete Ceiling		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A
1	1	Stairs next to Classroom 120	N/A	Concrete Block Wall		Non Suspect ACM	500	SF	0	SF				N/A	N/A	N/A
1	1	Stairs next to Classroom 120	N/A	Cement Floor		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A
1	1	Stairs next to Classroom 128	N/A	Concrete Ceiling		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A
1	1	Stairs next to Classroom 128	N/A	Concrete Block Wall		Non Suspect ACM	500	SF	0	SF				N/A	N/A	N/A
1	1	Stairs next to Classroom 128	N/A	Cement Floor		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A
1	1	Stairs next to Classroom 175	N/A	Concrete Ceiling		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A
1	1	Stairs next to Classroom 175	N/A	Concrete Block Wall		Non Suspect ACM	500	SF	0	SF				N/A	N/A	N/A
1	1	Stairs next to Classroom 175	N/A	Cement Floor		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A
1	1	Stairs next to Classroom 171	N/A	Concrete Ceiling		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A
1	1	Stairs next to Classroom 171	N/A	Concrete Block Wall		Non Suspect ACM	500	SF	0	SF				N/A	N/A	N/A
1	1	Stairs next to Classroom 171	N/A	Cement Floor		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A
1	1	Stairs next to Classroom 181	N/A	Concrete Ceiling		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A
1	1	Stairs next to Classroom 181	N/A	Concrete Block Wall		Non Suspect ACM	500	SF	0	SF				N/A	N/A	N/A
1	1	Stairs next to Classroom 181	N/A	Cement Floor		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A
1	1	School Police Officer Office	M	Floor Tile VAT 12" x 12"	8090/01/01/GG	Assumed	225	SF	0	SF	Tan			1	No	1/D
1	1	School Police Officer Office	N/A	Concrete Block Wall		Non Suspect ACM	400	SF	0	SF				N/A	N/A	N/A
1	1	School Police Officer Office	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	225	SF	0	SF				N/A	N/A	N/A
1	1	Room 005 Automotive Technology	M	Floor Tile VAT 12" x 12"	8090/01/01/GG	Assumed	500	SF	0	SF	Tan	Update space # column		1	No	1/D
1	1	Room 005 Automotive Technology	N/A	Concrete Block Wall		Non Suspect ACM	100	SF	0	SF		Update space # column		N/A	N/A	N/A

8090 Swenson Arts and Technology High School 2015-2016 AHERA Three Year Report

School District of Philadelphia			AHERA Three-Year Reinspection 2015-2016										Reinspection Date: 12/05/2015			
Swenson Arts and Technology High School (9-12)			Room by Room Location Log Report										Building Inspector: Norman Harrison			
2750 Red Lion Road, Philadelphia , PA 19114													Certificate Number: ACC-0915-6-011			
UCLS# 8090													Management Planner: Monique Causley			
Date Built: 1976													Certificate Number: ACC-0215-8-010			
E l e m e n t	F l o o r	On Site Room Name	System Affected	Material Description	HID#	Confirmed Assumed NAD Non Suspect ACM	Amount of Material	SF LF EA	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic / Crawl Space Ranking	Damage Potential (DP)	Newly Friable (NF)	Response Action (RA)
1	1	Room 005 Automotive Technology	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	500	SF	0	SF		Update space # column		N/A	N/A	N/A
1	1	Room 005 Automotive Technology Storage	M	Floor Tile VAT 12" x 12"	8090/01/01/GG	Assumed	225	SF	0	SF	Tan	Update space # column		1	No	1/D
1	1	Room 005 Automotive Technology Storage	N/A	Concrete Block Wall		Non Suspect ACM	400	SF	0	SF		Update space # column		N/A	N/A	N/A
1	1	Room 005 Automotive Technology Storage	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	225	SF	0	SF		Update space # column		N/A	N/A	N/A
1	1	Paint Shop	N/A	Metal Wall		Non Suspect ACM	500	SF	0	SF				N/A	N/A	N/A
1	1	Paint Shop	N/A	Metal Ceiling		Non Suspect ACM	300	SF	0	SF				N/A	N/A	N/A
1	1	Paint Shop	N/A	Cement Floor		Non Suspect ACM	300	SF	0	SF				N/A	N/A	N/A
1	1	Auto Body Shop	N/A	Sheetrock Wall		Non Suspect ACM	1000	SF	0	SF				N/A	N/A	N/A
1	1	Auto Body Shop	N/A	Sheetrock Ceiling		Non Suspect ACM	800	SF	0	SF				N/A	N/A	N/A
1	1	Auto Body Shop	N/A	Cement Floor		Non Suspect ACM	800	SF	0	SF				N/A	N/A	N/A
1	1	Auto Body Storage	N/A	Sheetrock Wall		Non Suspect ACM	1000	SF	0	SF				N/A	N/A	N/A
1	1	Auto Body Storage	N/A	Sheetrock Ceiling		Non Suspect ACM	800	SF	0	SF				N/A	N/A	N/A
1	1	Auto Body Storage	N/A	Cement Floor		Non Suspect ACM	800	SF	0	SF				N/A	N/A	N/A
1	1	Automotive Shop	M	Vibration Damper Cloth	8090/01/01/06	Assumed	5	SF	0	SF				1	No	1/D
1	1	Automotive Shop	N/A	Concrete Ceiling		Non Suspect ACM	23660	SF	0	SF				N/A	N/A	N/A
1	1	Automotive Shop	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	101	LF	0	LF				N/A	N/A	N/A
1	1	Automotive Shop	N/A	Fiberglass Pipe Fitting Insulation		Non Suspect ACM	101	EA	0	EA				N/A	N/A	N/A
1	1	Automotive Shop	N/A	Cement Floor		Non Suspect ACM	23660	SF	0	SF				N/A	N/A	N/A
1	1	Automotive Shop	N/A	Concrete Block Wall		Non Suspect ACM	30000	SF	0	SF				N/A	N/A	N/A
1	1	Tire Storage	N/A	Sheetrock Wall		Non Suspect ACM	400	SF	0	SF				N/A	N/A	N/A
1	1	Tire Storage	N/A	Sheetrock Ceiling		Non Suspect ACM	240	SF	0	SF				N/A	N/A	N/A
1	1	Tire Storage	N/A	Cement Floor		Non Suspect ACM	240	SF	0	SF				N/A	N/A	N/A
1	1	Auto Shop Theory Classroom	N/A	Sheetrock Wall		Non Suspect ACM	1000	SF	0	SF				N/A	N/A	N/A
1	1	Auto Shop Theory Classroom	M	Floor Tile VAT 12" x 12"	8090/01/01/GG	Assumed	600	SF	0	SF	Tan			1	No	1/D
1	1	Auto Shop Theory Classroom	M	Floor Tile VAT 12" x 12"	8090/01/01/GG	Assumed	256	SF	0	SF	Tan			1	No	1/D
1	1	Auto Shop Theory Classroom	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	600	SF	0	SF				N/A	N/A	N/A
1	1	Auto Shop Office	N/A	Sheetrock Wall		Non Suspect ACM	400	SF	0	SF				N/A	N/A	N/A
1	1	Auto Shop Office	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	256	SF	0	SF				N/A	N/A	N/A
1	1	Auto Shop Office	M	Floor Tile VAT 12" x 12"	8090/01/01/GG	Assumed	256	SF	0	SF	Tan			1	No	1/D
1	1	Auto Shop Tool Storage	N/A	Sheetrock Wall		Non Suspect ACM	600	SF	0	SF				N/A	N/A	N/A
1	1	Auto Shop Tool Storage	N/A	Sheetrock Ceiling		Non Suspect ACM	320	SF	0	SF				N/A	N/A	N/A
1	1	Auto Shop Tool Storage	N/A	Cement Floor		Non Suspect ACM	320	SF	0	SF				N/A	N/A	N/A
1	1	Body Shop Tool Storage	N/A	Sheetrock Wall		Non Suspect ACM	1000	SF	0	SF				N/A	N/A	N/A
1	1	Body Shop Tool Storage	N/A	Sheetrock Ceiling		Non Suspect ACM	520	SF	0	SF				N/A	N/A	N/A
1	1	Body Shop Tool Storage	N/A	Cement Floor		Non Suspect ACM	520	SF	0	SF				N/A	N/A	N/A
1	1	Staff Restroom	N/A	Ceramic Tile Floors		Non Suspect ACM	70	SF	0	SF				N/A	N/A	N/A
1	1	Staff Restroom	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	70	SF	0	SF				N/A	N/A	N/A
1	1	Staff Restroom	N/A	Concrete Block Wall		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A
1	1	Girl's Restroom	N/A	Ceramic Tile Floors		Non Suspect ACM	117	SF	0	SF				N/A	N/A	N/A
1	1	Girl's Restroom	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	117	SF	0	SF				N/A	N/A	N/A
1	1	Girl's Restroom	N/A	Concrete Block Wall		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A
1	1	Boy's Restroom	N/A	Ceramic Tile Floors		Non Suspect ACM	170	SF	0	SF				N/A	N/A	N/A
1	1	Boy's Restroom	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	170	SF	0	SF				N/A	N/A	N/A
1	1	Boy's Restroom	N/A	Concrete Block Wall		Non Suspect ACM	300	SF	0	SF				N/A	N/A	N/A
1	1	Gym Storage Room #1	M	Floor Tile VAT 12" x 12"	8090/01/01/GG	Assumed	336	SF	0	SF	Tan			1	No	1/D
1	1	Gym Storage Room #1	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	336	SF	0	SF				N/A	N/A	N/A
1	1	Gym Storage Room #1	N/A	Concrete Block Wall		Non Suspect ACM	500	SF	0	SF				N/A	N/A	N/A
1	1	Welding Shop	M	Transite	8090/01/01/03	Confirmed	64	SF	0	SF				1	No	1/D
1	1	Welding Shop	N/A	Metal ceiling		Non Suspect ACM	5000	SF	0	SF				N/A	N/A	N/A
1	1	Welding Shop	N/A	Cement Floor		Non Suspect ACM	5000	SF	0	SF				N/A	N/A	N/A
1	1	Welding Shop	N/A	Concrete Block Wall		Non Suspect ACM	8000	SF	0	SF				N/A	N/A	N/A
1	1	Machine Shop	N/A	Metal ceiling		Non Suspect ACM	5000	SF	0	SF				N/A	N/A	N/A
1	1	Machine Shop	N/A	Cement Floor		Non Suspect ACM	5000	SF	0	SF				N/A	N/A	N/A
1	1	Machine Shop	N/A	Concrete Block Wall		Non Suspect ACM	8000	SF	0	SF				N/A	N/A	N/A
1	1	Gym Storage Room #2	M	Floor Tile VAT 12" x 12"	8090/01/01/GG	Assumed	336	SF	0	SF	Tan			1	No	1/D
1	1	Gym Storage Room #2	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	336	SF	0	SF				N/A	N/A	N/A
1	1	Gym Storage Room #2	N/A	Concrete Block Wall		Non Suspect ACM	500	SF	0	SF				N/A	N/A	N/A
1	1	Weight Room Storage	M	Floor Tile VAT 12" x 12"	8090/01/01/GG	Assumed	336	SF	0	SF	Tan			1	No	1/D
1	1	Weight Room Storage	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	336	SF	0	SF				N/A	N/A	N/A
1	1	Weight Room Storage	N/A	Concrete Block Wall		Non Suspect ACM	500	SF	0	SF				N/A	N/A	N/A
1	1	Boy's Restroom (Gym)	M	Floor Tile VAT 12" x 12"	8090/01/01/GG	Assumed	336	SF	0	SF	Tan			1	No	1/D
1	1	Boy's Restroom (Gym)	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	336	SF	0	SF				N/A	N/A	N/A
1	1	Boy's Restroom (Gym)	N/A	Concrete Block Wall		Non Suspect ACM	500	SF	0	SF				N/A	N/A	N/A
1	1	Girl's Restroom (Gym)	M	Floor Tile VAT 12" x 12"	8090/01/01/GG	Assumed	336	SF	0	SF	Tan			1	No	1/D
1	1	Girl's Restroom (Gym)	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	336	SF	0	SF				N/A	N/A	N/A
1	1	Girl's Restroom (Gym)	N/A	Concrete Block Wall		Non Suspect ACM	500	SF	0	SF				N/A	N/A	N/A
1	1	Women's Restroom (Gym)	M	Floor Tile VAT 12" x 12"	8090/01/01/GG	Assumed	336	SF	0	SF	Tan			1	No	1/D
1	1	Women's Restroom (Gym)	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	336	SF	0	SF				N/A	N/A	N/A
1	1	Women's Restroom (Gym)	N/A	Concrete Block Wall		Non Suspect ACM	500	SF	0	SF				N/A	N/A	N/A
1	1	Men's Restroom (Gym)	M	Floor Tile VAT 12" x 12"	8090/01/01/GG	Assumed	336	SF	0	SF	Tan			1	No	1/D
1	1	Men's Restroom (Gym)	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	336	SF	0	SF				N/A	N/A	N/A
1	1	Men's Restroom (Gym)	N/A	Concrete Block Wall		Non Suspect ACM	500	SF	0	SF				N/A	N/A	N/A
1	1	Health Classroom	M	Floor Tile VAT 12" x 12"	8090/01/01/GG	Assumed	500	SF	0	SF	Tan			1	No	1/D
1	1	Health Classroom	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	336	SF	0	SF				N/A	N/A	N/A
1	1	Health Classroom	N/A	Concrete Block Wall		Non Suspect ACM	500	SF	0	SF				N/A	N/A	N/A
1	1	Gym Office	M	Floor Tile VAT 12" x 12"	8090/01/01/GG	Assumed	336	SF	0	SF	Tan			1	No	1/D

8090 Swenson Arts and Technology High School 2015-2016 AHERA Three Year Report

School District of Philadelphia			AHERA Three-Year Reinspection 2015-2016										Reinspection Date: 12/05/2015			
Swenson Arts and Technology High School (9-12)			Room by Room Location Log Report										Building Inspector: Norman Harrison			
2750 Red Lion Road, Philadelphia, PA 19114													Certificate Number: ACC-0915-6-011			
UCLS# 8090													Management Planner: Monique Causley			
Date Built: 1976													Certificate Number: ACC-0215-8-010			
Element	Floor	On Site Room Name	System Affected	Material Description	HID#	Confirmed Assumed NAD	Amount of Material	SF LF EA	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic / Crawl Space Ranking	Damage Potential (DP)	Newly Friable (NF)	Response Action (RA)
1	1	Gym Office	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	336	SF	0	SF				N/A	N/A	N/A
1	1	Gym Office	N/A	Concrete Block Wall		Non Suspect ACM	500	SF	0	SF				N/A	N/A	N/A
1	1	Weight Room	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	336	SF	0	SF				N/A	N/A	N/A
1	1	Weight Room	N/A	Carpet		Non Suspect ACM	336	SF	0	SF				N/A	N/A	N/A
1	1	Weight Room	N/A	Concrete Block Wall		Non Suspect ACM	500	SF	0	SF				N/A	N/A	N/A
1	1	Boy's Locker Room	N/A	Ceramic Tile Floors		Non Suspect ACM	375	SF	0	SF				N/A	N/A	N/A
1	1	Boy's Locker Room	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	375	SF	0	SF				N/A	N/A	N/A
1	1	Boy's Locker Room	N/A	Concrete Block Wall		Non Suspect ACM	500	SF	0	SF				N/A	N/A	N/A
1	1	Boy's Restroom	N/A	Ceramic Tile Floors		Non Suspect ACM	104	SF	0	SF				N/A	N/A	N/A
1	1	Boy's Restroom	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	104	SF	0	SF				N/A	N/A	N/A
1	1	Boy's Restroom	N/A	Concrete Block Wall		Non Suspect ACM	300	SF	0	SF				N/A	N/A	N/A
1	1	Custodial Closet	N/A	Cement Floor		Non Suspect ACM	25	SF	0	SF				N/A	N/A	N/A
1	1	Custodial Closet	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	25	SF	0	SF				N/A	N/A	N/A
1	1	Custodial Closet	N/A	Concrete Block Wall		Non Suspect ACM	125	SF	0	SF				N/A	N/A	N/A
1	1	Girl's Restroom	N/A	Ceramic Tile Floors		Non Suspect ACM	96	SF	0	SF				N/A	N/A	N/A
1	1	Girl's Restroom	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	96	SF	0	SF				N/A	N/A	N/A
1	1	Girl's Restroom	N/A	Concrete Block Wall		Non Suspect ACM	300	SF	0	SF				N/A	N/A	N/A
1	1	Welding Shop Storage	N/A	Cement Floor		Non Suspect ACM	160	SF	0	SF				N/A	N/A	N/A
1	1	Welding Shop Storage	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	160	SF	0	SF				N/A	N/A	N/A
1	1	Welding Shop Storage	N/A	Concrete Block Wall		Non Suspect ACM	300	SF	0	SF				N/A	N/A	N/A
1	1	Machine Shop Storage	N/A	Cement Floor		Non Suspect ACM	270	SF	0	SF				N/A	N/A	N/A
1	1	Machine Shop Storage	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	270	SF	0	SF				N/A	N/A	N/A
1	1	Machine Shop Storage	N/A	Concrete Block Wall		Non Suspect ACM	400	SF	0	SF				N/A	N/A	N/A
1	1	Staff Restroom	N/A	Ceramic Tile Floors		Non Suspect ACM	100	SF	0	SF				N/A	N/A	N/A
1	1	Staff Restroom	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	100	SF	0	SF				N/A	N/A	N/A
1	1	Staff Restroom	N/A	Concrete Block Wall		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A
1	1	Welding Classroom Storage	N/A	Cement Floor		Non Suspect ACM	100	SF	0	SF				N/A	N/A	N/A
1	1	Welding Classroom Storage	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	100	SF	0	SF				N/A	N/A	N/A
1	1	Welding Classroom Storage	N/A	Concrete Block Wall		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A
1	1	Welding Classroom	N/A	Sheetrock Wall		Non Suspect ACM	1000	SF	0	SF				N/A	N/A	N/A
1	1	Welding Classroom	N/A	Sheetrock Ceiling		Non Suspect ACM	800	SF	0	SF				N/A	N/A	N/A
1	1	Welding Classroom	M	Floor Tile VAT 12" x 12"	8090/01/01/GG	Assumed	800	SF	0	SF	Tan			1	No	1/D
1	1	Shop Theory Classroom #1 Carpentry	N/A	Sheetrock Wall		Non Suspect ACM	500	SF	0	SF				N/A	N/A	N/A
1	1	Shop Theory Classroom #1 Carpentry	N/A	Sheetrock Ceiling		Non Suspect ACM	336	SF	0	SF				N/A	N/A	N/A
1	1	Shop Theory Classroom #1 Carpentry	M	Floor Tile VAT 12" x 12"	8090/01/01/GG	Assumed	336	SF	0	SF	Tan			1	No	1/D
1	1	Shop Theory Classroom #2 Plumbing	N/A	Sheetrock Wall		Non Suspect ACM	800	SF	0	SF				N/A	N/A	N/A
1	1	Shop Theory Classroom #2 Plumbing	N/A	Sheetrock Ceiling		Non Suspect ACM	360	SF	0	SF				N/A	N/A	N/A
1	1	Shop Theory Classroom #2 Plumbing	M	Floor Tile VAT 12" x 12"	8090/01/01/GG	Assumed	360	SF	0	SF	Tan			1	No	1/D
1	1	Shop Theory Classroom #3 Electrical	N/A	Sheetrock Wall		Non Suspect ACM	800	SF	0	SF				N/A	N/A	N/A
1	1	Shop Theory Classroom #3 Electrical	N/A	Sheetrock Ceiling		Non Suspect ACM	360	SF	0	SF				N/A	N/A	N/A
1	1	Shop Theory Classroom #3 Electrical	M	Floor Tile VAT 12" x 12"	8090/01/01/GG	Assumed	360	SF	0	SF	Tan			1	No	1/D
1	1	Tool Storage	N/A	Wood Floor		Non Suspect ACM	440	SF	0	SF				N/A	N/A	N/A
1	1	Tool Storage	N/A	Sheetrock Wall		Non Suspect ACM	1000	SF	0	SF				N/A	N/A	N/A
1	1	Tool Storage	N/A	Sheetrock Ceiling		Non Suspect ACM	440	SF	0	SF				N/A	N/A	N/A
1	1	Electrical Shop	N/A	Metal Ceiling		Non Suspect ACM	3808	SF	0	SF				N/A	N/A	N/A
1	1	Electrical Shop	N/A	Concrete Block Wall		Non Suspect ACM	5000	SF	0	SF				N/A	N/A	N/A
1	1	Electrical Shop	N/A	Cement Floor		Non Suspect ACM	3808	SF	0	SF				N/A	N/A	N/A
1	1	Carpentry / Plumbing Shop	N/A	Metal Ceiling		Non Suspect ACM	7740	SF	0	SF				N/A	N/A	N/A
1	1	Carpentry / Plumbing Shop	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	101	LF	0	LF				N/A	N/A	N/A
1	1	Carpentry / Plumbing Shop	N/A	Fiberglass Pipe Fitting Insulation		Non Suspect ACM	101	EA	0	EA				N/A	N/A	N/A
1	1	Carpentry / Plumbing Shop	N/A	Concrete Block Wall		Non Suspect ACM	9000	SF	0	SF				N/A	N/A	N/A
1	1	Carpentry / Plumbing Shop	N/A	Cement Floor		Non Suspect ACM	7740	SF	0	SF				N/A	N/A	N/A
1	1	Electrical Room	N/A	Concrete Ceiling		Non Suspect ACM	800	SF	0	SF				N/A	N/A	N/A
1	1	Electrical Room	N/A	Cement Floor		Non Suspect ACM	800	SF	0	SF				N/A	N/A	N/A
1	1	Electrical Room	N/A	Concrete Block Wall		Non Suspect ACM	1000	SF	0	SF				N/A	N/A	N/A
1	1	Boiler Room	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	101	LF	0	LF				N/A	N/A	N/A
1	1	Boiler Room	N/A	Concrete Ceiling		Non Suspect ACM	216	SF	0	SF				N/A	N/A	N/A
1	1	Boiler Room	N/A	Concrete Block Wall		Non Suspect ACM	500	SF	0	SF				N/A	N/A	N/A
1	1	Boiler Room	N/A	Cement Floor		Non Suspect ACM	216	SF	0	SF				N/A	N/A	N/A
1	1	Loading Dock	N/A	Concrete Ceiling		Non Suspect ACM	272	SF	0	SF				N/A	N/A	N/A
1	1	Loading Dock	N/A	Concrete Block Wall		Non Suspect ACM	4000	SF	0	SF				N/A	N/A	N/A
1	1	Loading Dock	N/A	Cement Floor		Non Suspect ACM	2720	SF	0	SF				N/A	N/A	N/A
1	1	Emergency Generator Room	T	Pipe Insulation 2-6 inch	8090/01/01/FF	Assumed	25	LF	0	SF				1	No	1/D
1	1	Emergency Generator Room	T	Pipe Insulation > 6 inch	8090/01/01/CC	Assumed	3	LF	0	SF				1	No	1/D
1	1	Emergency Generator Room	T	Pipe Fitting Insulation	8090/01/01/07	Assumed	4	EA	0	SF				1	No	1/D
1	1	Emergency Generator Room	N/A	Concrete Ceiling		Non Suspect ACM	240	SF	0	SF				N/A	N/A	N/A
1	1	Emergency Generator Room	N/A	Concrete Block Wall		Non Suspect ACM	101	SF	0	SF				N/A	N/A	N/A
1	1	Emergency Generator Room	N/A	Cement Floor		Non Suspect ACM	240	SF	0	SF				N/A	N/A	N/A
1	1	Custodial Closet	N/A	Concrete Ceiling		Non Suspect ACM	270	SF	0	SF				N/A	N/A	N/A
1	1	Custodial Closet	N/A	Concrete Block Wall		Non Suspect ACM	500	SF	0	SF				N/A	N/A	N/A
1	1	Custodial Closet	N/A	Cement Floor		Non Suspect ACM	270	SF	0	SF				N/A	N/A	N/A
1	1	FAC Office	N/A	Sheetrock Wall		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A
1	1	FAC Office	M	Floor Tile VAT 12" x 12"	8090/01/01/GG	Assumed	140	SF	0	SF	Tan			1	No	1/D
1	1	FAC Office	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	140	SF	0	SF				N/A	N/A	N/A
1	1	Building Engineer's Office	N/A	Sheetrock Wall		Non Suspect ACM	200	SF	0	SF				N/A	N/A	N/A
1	1	Building Engineer's Office	M	Floor Tile VAT 12" x 12"	8090/01/01/GG	Assumed	140	SF	0	SF	Tan			1	No	1/D

8090 Swenson Arts and Technology High School 2015-2016 AHERA Three Year Report

<div> <div>School District of Philadelphia</div> <div>Swenson Arts and Technology High School (9-12)</div> <div>2750 Red Lion Road, Philadelphia , PA 19114</div> <div>UCLS# 8090</div> <div>Date Built: 1976</div> </div>		<div> <div>AHERA Three-Year Reinspection 2015-2016</div> <div>Room by Room Location Log Report</div> </div>										<div> <div>Reinspection Date: 12/05/2015</div> <div>Building Inspector: Norman Harrison</div> <div>Certificate Number: ACC-0915-6-011</div> <div>Management Planner: Monique Causley</div> <div>Certificate Number: ACC-0215-8-010</div> </div>			
		System Affected	Material Description	HID#	Confirmed Assumed NAD Non Suspect ACM	Amount of Material	SF LF EA	Amount of Damage	SF LF EA	Color required for VAT	Comments/Description/Notes	Attic / Crawl Space Ranking	Damage Potential (DP)	Newly Friable (NF)	Response Action (RA)
		On Site Room Name													
1	1	Building Engineer's Office	N/A	Ceiling Tile 2' x 4'		140	SF	0	SF				N/A	N/A	N/A
1	1	Women's Restroom	M	Floor Tile VAT 12" x 12"	8090/01/01/GG	Assumed	140	SF	0	SF	Tan		1	No	1/D
1	1	Women's Restroom	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	140	SF	0	SF			N/A	N/A	N/A
1	1	Women's Restroom	N/A	Concrete Block Wall		Non Suspect ACM	300	SF	0	SF			N/A	N/A	N/A
1	1	Custodial Break Room	M	Floor Tile VAT 12" x 12"	8090/01/01/GG	Assumed	144	SF	0	SF	Tan		1	No	1/D
1	1	Custodial Break Room	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	144	SF	0	SF			N/A	N/A	N/A
1	1	Custodial Break Room	N/A	Concrete Block Wall		Non Suspect ACM	300	SF	0	SF			N/A	N/A	N/A
1	1	Women's Restroom	M	Floor Tile VAT 12" x 12"	8090/01/01/GG	Assumed	140	SF	0	SF	Tan		1	No	1/D
1	1	Women's Restroom	N/A	Ceiling Tile 2' x 4'		Non Suspect ACM	140	SF	0	SF			N/A	N/A	N/A
1	1	Women's Restroom	N/A	Concrete Block Wall		Non Suspect ACM	300	SF	0	SF			N/A	N/A	N/A
1	1	Gym	N/A	Fiberglass Pipe Insulation		Non Suspect ACM	101	LF	0	LF			N/A	N/A	N/A
1	1	Gym	N/A	Fiberglass Pipe Fitting Insulation		Non Suspect ACM	101	EA	0	EA			N/A	N/A	N/A
1	1	Gym	N/A	Concrete Block Wall		Non Suspect ACM	5000	SF	0	SF			N/A	N/A	N/A
1	1	Gym	N/A	Cement Floor		Non Suspect ACM	3933	SF	0	SF			N/A	N/A	N/A
1	1	Gym	N/A	Metal Deck		Non Suspect ACM	3933	SF	0	SF			N/A	N/A	N/A
1	A	Attic	X	X		X	X	X	X	X	No Attic	None	X	X	X
1	C	Crawl Space	X	X		X	X	X	X	X	No Crawl Space	None	X	X	X

Section III Certificates

A. Management Planner/Building Inspector Certificates

Section III – A

Management Planner/Building Inspector Certificates

These charts indicate the Name, Course Date, Expiration Date and Corresponding Certificate Number of the Management Planner and Building Inspector of individuals that participated in the AHERA 3 Year Inspection and Management Plan process of 2015/2016.

Management Planner	Date Granted	Expiration Date	Certificate Number
Monique Causley	2/15/2015	2/16/2016	ACC-0215-8-010
Monique Causley	2/16/2016	2/17/2017	ACC-0216-8-001
Megan Vala	5/22/2015	6/22/2016	740728
Mary Anne Lerro	4/5/2016	4/5/2017	742327

Building Inspector	Date Granted	Expiration Date	Certificate Number
Scott Magee	8/15/2015	8/15/2016	70016699C
William Garrity	8/15/2015	8/15/2016	70016699A
Bernard Brunner	10/2/2015	8/2/2016	45397
Mary Anne Lerro	3/3/2015	3/3/2016	740092
Mary Anne Lerro	4/5/2016	4/5/2017	742322
James Madden	12/11/2014	12/11/2015	ACC-1214-6-010
James Madden	12/3/2015	12/3/2016	ACC-1215-6-018
Troy Ray	3/15/2015	3/19/2016	ACC-0355-6-011
Ananth Vinjamuri	9/29/2015	9/29/2016	374
Shelton Williams	9/29/2015	9/29/2016	375
Paul Davis	2/12/2015	2/12/2016	ACC-0215-6-015
Paul Davis	2/2/2016	2/2/2017	741836
Bernard Bryson	2/16/2015	2/16/2016	ACC-0125-6-031
Bernard Bryson	2/15/2016	2/15/2017	ACC-0216-6-005
Alexander Roman	9/18/2015	9/18/2016	EHSBIR-150619-008
Norm Harrison	9/2/2015	9/2/2016	ACC-0915-6-011
Kelly Mayberry	2/20/2015	2/20/2016	EHSBIR-150220-005
Kelly Mayberry	2/18/2016	2/18/2017	EHSBIR-160218-006
Andrew Hine	5/6/2015	5/6/2016	AI05042015-3
Maryellen Leotta	2/12/2015	2/12/2016	ACC-0215-6-024

Certificate of Completion

awarded to

Monique Causley

for successfully completing the prescribed course of study in

Pennsylvania Asbestos Management Planner Refresher Course

under TSCA Title II

presented by

**ACCESS TRAINING SERVICES, INC.
7921 River Road, Pennsauken, NJ 08110
(856) 665-3449**

2/16/15

Course Date

N/A

Exam Date

2/16/16

Expiration Date

Not Provided

Social Security Number

ACC-0215-8-010

Certificate Number

**Mark K. Schlüger
Training Director**



Certificate of Completion

awarded to

Monique Causley

for successfully completing the prescribed course of study in

Pennsylvania Asbestos Management Planner Refresher Course

under TSCA Title II

presented by

ACCESS TRAINING SERVICES, INC.
7921 River Road, Pennsauken, NJ 08110
(856) 665-3449

2/15/16

Course Date

N/A

Exam Date

2/15/17

Expiration Date

Not Provided

Social Security Number

ACC-0216-8-001

Certificate Number

Mark K. Schlüger
Training Director

Certificate of Training

CRITERION LABORATORIES, INC.

HEREBY CERTIFIES THAT

Megan Vala

HAS SUCCESSFULLY COMPLETED A 16 HOUR COURSE ENTITLED

Asbestos Management Planner Initial

INCLUDING CLASSROOM INSTRUCTION

05/21/2015 to 05/22/2015


Exam passed on this 22nd day of May 2015 - Score - 94

Approved for AHERA Accreditation Under TSCA Title II

3370 Progress Drive, Suite J
Bensalem, PA 19020
(215) 244-1300 - Phone
(215) 244-4349 - Fax
www.criterionlabs.com

Course is conducted in English

DIRECTOR:



James A. Welts, CIH, President

Certificate of Training

CRITERION LABORATORIES, INC.

HEREBY CERTIFIES THAT

Mary Anne Lerro

HAS SUCCESSFULLY COMPLETED A 4 HOUR COURSE ENTITLED

Asbestos Management Planner Refresher

INCLUDING CLASSROOM INSTRUCTION


on this 5th day of April 2016

Approved for AHERA Accreditation Under TSCA Title II

3370 Progress Drive, Suite J
Bensalem, PA 19020
(215) 244-1300 - Phone
(215) 244-4349 - Fax
www.criterionlabs.com

Course is conducted in English

DIRECTOR:

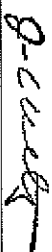

James A. Welts, CIH, President

EMSL ANALYTICAL, INC.

Certifies that

Scott Magee

has successfully completed the course of study for the

Asbestos Building Inspector Refresher Course

for Accreditation under TSCA Title II

EMSL Certificate No. 70016699C


Approved by:

PA Dept. of Labor and Industry
Accreditation # 137

Course Date: 8/15/2015
Granted: 8/15/2015
Expiration Date: 8/15/2016

Sponsored by:

EMSL Analytical, Inc.
200 Route 130 North
Cinnaminson, NJ 08077
Phone: (800) 220-3675
Fax: (856) 786-5973
www.emsl.com

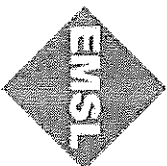

Michael P. Menz

Michael P. Menz, CIH
Training Director

Environmental, Mold, Bacteria, IAQ, Asbestos, Lead, Forensic and Materials Testing Since 1981

EMSL ANALYTICAL, INC.

Certifies that

William Garrity

has successfully completed the course of study for the

Asbestos Building Inspector Refresher Course

for Accreditation under TSCA Title II

EMSL Certificate No. 70016699A


Approved by:

PA Dept. of Labor and Industry
Accreditation # 137

Course Date: 8/15/2015
Granted: 8/15/2015
Expiration Date: 8/15/2016

Sponsored by:

EMSL Analytical, Inc.
200 Route 130 North
Cinnaminson, NJ 08077
Phone: (800) 220-3675
Fax: (856) 786-5973
www.emsl.com

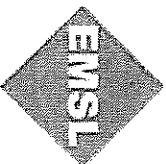

Michael P. Menz

Michael P. Menz, CIH
Training Director

Environmental, Mold, Bacteria, IAQ, Asbestos, Lead, Forensic and Materials Testing Since 1981

45397

National Asbestos & Environmental Training Institute

CERTIFICATE OF COMPLETION

AHERA/EPA Accredited Per 40 CFR Part 763
Asbestos Accreditation under TSCA Title II

This is to certify that


Bernard Brunner, Jr.

Successfully completed the course entitled

**1/2-Day New York State/EPA/AHERA Asbestos Building Inspector Annual Refresher on
October 2, 2015**

Examination Passed October 2, 2015

Expiration Date on October 2, 2016

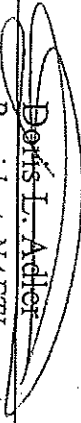
Doris L. Adler
President, NAEETI

Per 10 NYCRR Part 73.2 (L) (1), DOH 2832 Certificate of Completion of Asbestos
Safety Training is the only official record of training for N.Y.S. students.

Language: English

ABIH 1/2 CM POINT

3321 Doris Avenue, Building B, Ocean, NJ 07712

Phone (732) 531-5571

Fax (732) 531-5956

www.naeti.com

Number 740092

Expiration Date:
03/03/2016

Certificate of Training

CRITERION LABORATORIES, INC.

HEREBY CERTIFIES THAT

Mary Anne Lerro

HAS SUCCESSFULLY COMPLETED A 4 HOUR COURSE ENTITLED

Asbestos Building Inspector Refresher

on this 3rd day of March 2015

Exam passed on this 3rd day of March 2015 - Score - 84

Approved for AHERA Accreditation Under TSCA Title II

3370 Progress Drive, Suite J
Bensalem, PA 19020
(215) 244-1300 - Phone
(215) 244-4349 - Fax
www.criterionlabs.com

Course is conducted in English

DIRECTOR:

James A. Weltz
James A. Weltz, CIH, President

Certificate of Training

CRITERION LABORATORIES, INC.

HEREBY CERTIFIES THAT

Mary Anne Lerro

HAS SUCCESSFULLY COMPLETED A 4 HOUR COURSE ENTITLED

Asbestos Building Inspector Refresher

INCLUDING CLASSROOM INSTRUCTION

on this 5th day of April 2016

Exam passed on this 5th day of April 2016 - Score - 88

Approved for AHERA Accreditation Under TSCA Title II

3370 Progress Drive, Suite J
Bensalem, PA 19020
(215) 244-1300 - Phone
(215) 244-4349 - Fax
www.criterionlabs.com

Course is conducted in English

DIRECTOR:

James A. Welts

James A. Welts, CIH, President

Certificate of Completion

James Madden

for successfully completing the prescribed course of study in

Pennsylvania Asbestos Building Inspector Refresher Course

under TSCA Title II

presented by
ACCESS TRAINING SERVICES, INC.
7921 River Road, Pennsauken, NJ 08110
(856) 665-3449

12/11/14

Course Date

N/A

Exam Date

12/11/15

Expiration Date

Not Provided

Social Security Number

ACC-1214-6-010

Certificate Number

Mark K. Schlüger
Training Director

Certificate of Completion

James Madden

for successfully completing the prescribed course of study in

Pennsylvania Asbestos Building Inspector Refresher Course

under TSCA Title II

presented by

ACCESS TRAINING SERVICES, INC.
7921 River Road, Pennsauken, NJ 08110
(856) 665-3449

12/3/15

Course Date

N/A

Exam Date

12/3/16

Expiration Date

Not Provided

Social Security Number

ACC-1215-6-018

Certificate Number

Mark K. Schlüger
Training Director

Certificate of Completion

Troy A. Ray


for successfully completing the prescribed course of study in

Pennsylvania Asbestos Building Inspector Refresher Course

under TSCA Title II

presented by

ACCESS TRAINING SERVICES, INC.
7921 River Road, Pennsauken, NJ 08110
(856) 665-3449

3/19/15	N/A	3/19/16
<i>Course Date</i>	<i>Exam Date</i>	<i>Expiration Date</i>
Not Provided	ACC-0355-6-011	
<i>Social Security Number</i>	<i>Certificate Number</i>	Mark K. Schlager <i>Training Director</i>

CERTIFICATE NO 374

G&C Environmental Services, Inc. (#294)
2 Street Road, Newtown Square, Pennsylvania 19073
Telephone: (610) 993-9202 Facsimile: (610) 993-9232
Email: Training@gcenviro.com
www.GCenviro.com

This document certifies that Ananth K. Vinjamuri has successfully completed this
State of New York Department of Health Approved AHERA BUILDING INSPECTOR

REFRESHER COURSE, completed as required for asbestos accreditation under the Toxic

Substances Control Act, Title II. This course was held from 09/29/2015 to 09/29/2015.
MM DD YR MM DD YR

The examination date was 09/29/2015. This certificate expires one year from the date of
MM DD YR
successful completion of the examination 09/29/2016.
MM DD YR

*The official record of successful training completion is the New York State Department of
Health certificate of asbestos safety training completion (DPH 2832).*

Gail M. Conner
Training Director

Gail M. Conner

CERTIFICATE NO 375

G&C Environmental Services, Inc. (#294)
2 Street Road, Newtown Square, Pennsylvania 19073
Telephone: (610) 993-9202 Facsimile: (610) 993-9232
Email: Training@gcenviro.com
www.GCenviro.com

This document certifies that Shelton Williams has successfully completed this
State of New York Department of Health Approved AHERA BUILDING INSPECTOR

REFRESHER COURSE, completed as required for asbestos accreditation under the Toxic

Substances Control Act, Title II. This course was held from 09/29/2015 to 09/29/2015.
MM DD YR MM DD YR

The examination date was 09/29/2015. This certificate expires one year from the date of
MM DD YR MM DD YR
successful completion of the examination 09/29/2016.
MM DD YR

*The official record of successful training completion is the New York State Department of
Health certificate of asbestos safety training completion (DPH 2832).*

Gail M. Conner
Training Director

Gail M. Conner

Certificate of Completion

Paul M. Davis

for successfully completing the prescribed course of study in

Pennsylvania Asbestos Building Inspector Refresher Course

under TSCA Title II

presented by

ACCESS TRAINING SERVICES, INC.
7921 River Road, Pennsauken, NJ 08110
(856) 665-3449

2/12/15

Course Date

N/A

Exam Date

2/12/16

Expiration Date

Not Provided

Social Security Number

ACC-0215-6-015

Certificate Number

Mark K. Schlüger
Training Director

Certificate of Training

CRITERION LABORATORIES, INC.

HEREBY CERTIFIES THAT

Paul M. Davis

HAS SUCCESSFULLY COMPLETED A 4 HOUR COURSE ENTITLED

Asbestos Building Inspector Refresher

INCLUDING CLASSROOM INSTRUCTION

on this 2nd day of February 2016

Exam passed on this 2nd day of February 2016 - Score - 92

Approved for AHERA Accreditation Under TSCA Title II

3370 Progress Drive, Suite J
Bensalem, PA 19020
(215) 244-1300 - Phone
(215) 244-4349 - Fax
www.criterionlabs.com

Course is conducted in English

DIRECTOR:

James A. Welch

James A. Welch, CIH, President

Certificate of Completion

Bernard J. Bryson


for successfully completing the prescribed course of study in

Pennsylvania Asbestos Building Inspector Refresher Course

under TSCA Title II

presented by

ACCESS TRAINING SERVICES, INC.
7921 River Road, Pennsauken, NJ 08110
(856) 665-3449

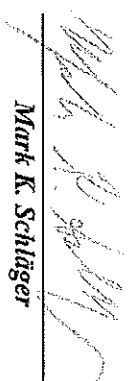2/16/15	N/A	2/16/16
<i>Course Date</i>	<i>Exam Date</i>	<i>Expiration Date</i>
Not Provided	ACC-0125-6-031	
<i>Social Security Number</i>	<i>Certificate Number</i>	Mark K. Schlager <i>Training Director</i>

Certificate of Completion

Bernard J. Bryson

for successfully completing the prescribed course of study in

Pennsylvania Asbestos Building Inspector Refresher Course

under TSCA Title II

presented by

ACCESS TRAINING SERVICES, INC.
7921 River Road, Pennsauken, NJ 08110
(856) 665-3449

2/15/16

Course Date

N/A

Exam Date

2/15/17

Expiration Date

Not Provided

Social Security Number

ACC-0216-6-005

Certificate Number

Mark K. Schlager
Training Director

EHS TRAINING INSTITUTE, INC.
A Division of BATTI, Inc.

Certificate of Completion

AHERA Building Inspector

(Refresher)

Awarded To:

Alexander Roman

SS#:XXX-XX-1743
Who has completed this 4-hour course and examination,
EPA Approved under TSCA Title II
AHERA / ASHARA Rule
40 CFR Part 763.

EHS TRAINING INSTITUTE, INC.

A Division of BATTI, Inc.

Delaware Industrial Park • 6 Garfield Way

Newark, DE 19713-5817

(302) 737-3376 • Fax (302) 737-5764

Course Date: September 18, 2015

Date of Expiration: September 18, 201

Certification Number : EHSBIR 150619-008


Todd K. Zeisloff, Instructor


Neeraj K. Batta, President

Certificate of Completion

Norman Harrison

for successfully completing the prescribed course of study in

Pennsylvania Asbestos Building Inspector Refresher Course

under TSCA Title II

presented by

**ACCESS TRAINING SERVICES, INC.
7921 River Road, Pennsauken, NJ 08109
(856) 665-3449**

9/2/15

Course Date

N/A

Exam Date

9/2/16


Expiration Date

Not Provided

Social Security Number

ACC-0915-6-011

Certificate Number


Mark K. Schlager
Training Director

EHS TRAINING INSTITUTE, INC.
A Division of BATTI, Inc.

Certificate of Completion

AHERA Building Inspector

(Refresher)

Awarded To:

Kelly Mayberry

SS#:XXX-XX-1551

Who has completed this 4-hour course and examination,

EPA Approved under TSCA Title II

AHERA / ASHARA Rule

40 CFR Part 763.

EHS TRAINING INSTITUTE, INC.

A Division of BATTI, Inc.

Delaware Industrial Park • 6 Garfield Way

Newark, DE 19713-5817

(302) 737-3376 • Fax (302) 737-5764

Course Date: February 20, 2015

Date of Expiration: February 20, 2016

Certification Number : EHSBIR 150220-005


Todd K. Zeislott, Instructor


Neeraj K. Batta, President

EHS TRAINING INSTITUTE, INC.

A Division of BATTI, Inc.

Certificate of Completion

AHERA Building Inspector

(Refresher)

Awarded To:

Kelly Mayberry

SS#:XXX-XX-1551

Who has completed this 4-hour course and examination,

EPA Approved under TSCA Title II

AHERA / ASHARA Rule

40 CFR Part 763.

EHS TRAINING INSTITUTE, INC.

A Division of BATTI, Inc.

Delaware Industrial Park • 6 Garfield Way

Newark, DE 19713-5817

(302) 737-3376 • Fax (302) 737-5764

Course Date: February 18, 2016

Date of Expiration: February 18, 2017

Certification Number : EHSBIR 160218-006

Todd K. Zeisloff
Todd K. Zeisloff, Instructor

Neeraj K. Batta
Neeraj K. Batta, President

AEROSOL MONITORING & ANALYSIS, INC.

This is to certify that
ANDREW HINE

has met the attendance requirements and successfully completed

the course entitled

3-DAY EPA AHERA INSPECTOR

For Accreditation Under TSCA Title II

05/04/2015 to 05/06/2015

Course Date

05/06/2015

Exam Date

5/6/2016

Expiration Date

STEVE SIERACKI

Principal Instructor

Steve Sieracki

A105042015-3

Certification No.

E. Rush Barnett

Course Director

E. Rush Barnett

1331 Ashton Road

P.O.Box 646

Hanover, MD 21076

P: 410-684-3327

F: 410-684-3724

www.amatraining.com

Certificate of Completion

Maryellen Leotta

for successfully completing the prescribed course of study in

Pennsylvania Asbestos Building Inspector Refresher Course

under TSCA Title II

presented by

ACCESS TRAINING SERVICES, INC.
7921 River Road, Pennsauken, NJ 08110
(856) 665-3449

2/12/15

Course Date

N/A

Exam Date

2/12/16

Expiration Date

Not Provided

Social Security Number

ACC-0215-6-024

Certificate Number

Mark K. Schlager
Training Director

Section IV

Cross Reference Table

Asbestos Hazard Emergency Response Act (AHERA) Environmental Compliance Audit Cross Reference Table

In response to the AHERA Environmental Compliance Audit a Cross Reference Table has been prepared for inclusion into the Environmental Management Plan. The purpose of this Cross Reference Table is to link the following documents to the AHERA Management Plan.

Cross Reference Table	
3 Year Reinspection Report follows this Cross Reference Table documentation.	
Subject Matter	Location of Required Documents
Designated Person	Pages 1 - 3
Annual Notification	Pages 4 - 5
6 Month Periodic Surveillance Outline of Events	Page 6
3 Year Re-inspections Outline of Events	Page 7
Asbestos Management Program (operations and maintenance)	Pages 8 - 19
Asbestos Investigation Report (AIR)	Attachment 1 Letter Dated August 4, 2006
Training (included in the Asbestos Management Program)	<p>The original records are centralized at the School District's Environmental Library. Copies are maintained on staff and are required to be maintained in the latest Reinspection Report.</p> <p>2 hour awareness training records for all Building Engineers, Custodian Assistants and maintenance personnel</p> <p>40 hour worker/supervisor training records for the OEMS A-Team and various AST tradesmen.</p>
Response Actions (monthly mailings if applicable)	The original documents are on file at the School District's Environmental Library.
	Copies of the original are mailed to the Schools Main Office for retention with the Management Plan documentation. These documents are typically kept separate from the management plan in an update binder due to the potential volume of response action reports.

SCHOOL DISTRICT OF PHILADELPHIA

ASBESTOS DESIGNATED PERSON

Gerald F Junod
Office of Capital Programs
Environmental Management & Services
440 N Broad Street, 3rd Floor
Philadelphia, PA 19130
Telephone: 215 400 6738
Fax: 215 400 4751

Drexel University- Asbestos Building Inspector Course	January 9-11, 1989 24 Hours
Drexel University- Asbestos Management Planner Course	January 12-13, 1989 16 Hours
Criterion Laboratories, Inc. - Asbestos Management Planner Course	October 11-12, 2012 16 Hours

<u>Annual Building Inspector Refreshers</u> 4 Hours Drexel University Criterion Laboratories, Inc Access Training Services, Inc.	1990 to Present
---	------------------------

<u>Annual Building Management Planner Refreshers</u> 4 Hours Drexel University Criterion Laboratories, Inc 4 Hours	1990 to 1994 2013 to Present
---	---

Environmental Manager, School District of Philadelphia

Manages the design and implementation of asbestos and lead projects for the Capital Improvement Program and other District Departments including Facilities & Operations and Information Technology. Ensures that asbestos abatement and lead remediation projects are expertly designed and executed in accordance with industry best management practice standards and regulations.

Manager, City of Philadelphia Asbestos Control Program

Served as the Asbestos Control Program Manager for the City of Philadelphia, Department of Public Health, Air Management Services, Asbestos Control Unit from August 1, 2003 through October 23, 2006.

Mid Atlantic Regional Environmental Consortium (MAREC)

Former member with attendance and participation commitments of all quarterly EPA Region III and yearly National Asbestos Regulatory Conferences sponsored by the EPA and the National Conference of State Legislators respectively as a representative for the City of Philadelphia Department of Public Health Air Management Services from 1994 through 2006.

Philadelphia Environmental Task Force


Former member of the Philadelphia Environmental Task force as a representative and point of contact for the City of Philadelphia Department of Public Health Air Management Services Asbestos Control Unit from 2002 through 2006.

Asbestos Instructor

Worked as the primary instructor for the initial and annual Asbestos Project Inspector training and licensing program as mandated by City of Philadelphia Department of Public Health Asbestos Control Regulations from August 1994 through October 2006.

Worked as a lead instructor with an Environmental Consulting Firm and approved by the US EPA for the initial and annual refresher training courses for various asbestos occupational disciplines such as the Building Inspector, Management Planner and Worker/Supervisor from 1991 through 1994.

I certify that the general, local agency responsibilities as stipulated in Section 763.84 will be met.

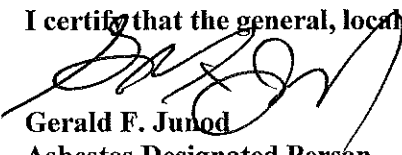

Gerald F. Junod
Asbestos Designated Person
Environmental Manager
Office of Environmental Management and Services

SCHOOL DISTRICT OF PHILADELPHIA

Accreditation Information Statement

All persons who inspect for Asbestos Containing Building Materials (ACBM) and who will design or carry out response actions with respect to assumed and confirmed ACBM, will be accredited by an EPA approved course and/or a State Contractors Accreditation Program under Sections 206 (c) and 206 (b) of Title II of the ACT.



**Gerald F. Junod
Asbestos Designated Person
Environmental Manager
Office of Environmental Management and Services**

SCHOOL DISTRICT OF PHILADELPHIA
OFFICE OF CAPITAL PROGRAMS
440 NORTH BROAD STREET, SUITE 373
PHILADELPHIA, PENNSYLVANIA 19130

OFFICE OF ENVIRONMENTAL MANAGEMENT AND SERVICES

PHONE (215)-400-4750

September 2015

TO: Principals
Building Administrators/Occupants
Parents/Guardians

FROM: Fran Burns
Chief Operating Officer

Francine Locke, M.S., Director
Office of Environmental Management and Services

SUBJECT: Annual EPA Notification Letter


Pursuant to the Federal Environmental Protection Agency (EPA) mandate, as required by 40 C.F.R. 763.84 (c)(d) of public access to environmental records, this letter is to acknowledge the availability of your facility's Asbestos Hazard Emergency Response Act (AHERA) Management Plan.

Each member of the school staff, parents/guardians, temporary workers and/or contractors, are required to receive a copy of the Notification Letter. At the direction of the Principal, a copy is to be posted on the bulletin boards and an appropriate amount of copies are to be generated for distribution.


Note: The AHERA Three-Year Reinspection reports, in colored binders; White with Pink, Tan, Black, Red, Dark Blue, Green, Yellow and White, are Federal EPA mandated inspection documents. The School District of Philadelphia is subject to severe monetary penalties if the reports and associated paperwork are not available to the EPA and the public upon request.

It is incumbent on designated school personnel to gather and retain this data as it is delivered, in one location for future review. Acceptable locations include the Principal's Office or Main Office for the primary data. The Building Engineer should maintain any secondary or duplicate copies.

If you have any questions, please call 215-400-4750. Thank you for your cooperation.



Fran Burns
Chief Operating Officer

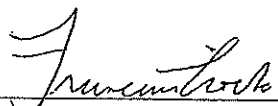

Francine Locke, M.S., Director
Office of Environmental Management
and Services

c: Danielle Floyd

AHERA-4
8/21/15



School District of Philadelphia
OFFICIAL NOTICE

PLEASE POST

September 2015

TO: Principals
Building Administrators
Building Engineers
Building Occupants
Parents/Guardians

FROM: Fran Burns
Chief Operating Officer

Francine Locke, M.S., Director
Office of Environmental Management and Services

SUBJECT: Annual Notification Letter: Asbestos Hazard Emergency Response Act

The Federal Register published on October 30, 1987, Subpart E, in Schools: Final Rule and Notice, 763.84 (c)(d) states that each local education agency shall ensure that workers and building occupants or guardians are to be informed at least once each school year about inspections, response actions and post-response action activities including re-inspections and periodic surveillance activities. The School District as the Local Education Agency (LEA), retains such reports that are available for public inspection in the Office of the Principal or Building Administrator.

The Principal or Building Administrator is required to do the following with this notification:

- 1) Post in a Public Place or Main Office
- 2) Inform Building Occupants
- 3) Send a copy of this notification to Parents or Guardians
- 4) Insert a copy into the latest AHERA Three-Year Reinspection report (white/pink binder) in your office or facility.

A handwritten signature of Fran Burns in black ink.

Fran Burns
Chief Operating Officer

A handwritten signature of Francine Locke in black ink.

Francine Locke, M.S., Director
Office of Environmental Management
and Services

c: Danielle Floyd

AHERA-4a
8/21/15

SCHOOL DISTRICT OF PHILADELPHIA
Education Center
440 North Broad Street
Philadelphia, Pennsylvania 19130

Office of Environmental Management and Services

215-400-4750

AHERA
Six Month Surveillance
Outline of Events

- Pursuant to the Federal Environmental Protection Agency (EPA) mandate, as required by 40 CFR 763.92(b), the following procedure is to be implemented. At least once every six (6) months after a Management Plan is in effect, each Local Education Agency (LEA) shall conduct a periodic surveillance in each building that it owns or leases that contains Asbestos Containing Building Materials (ACBM) or is assumed to contain ACBM.
- The first Bi-Annual Inspection starts in the Spring (March, April, May) and again in the Fall (October, November, December) of each year. The Building Engineer/Assistant should assist the Building Inspector with appropriate access to all areas including (Crawlspace/Attics) and rooms in the facility. There is no action required of the Principal.
- The Building Inspector shall visually inspect all areas that are identified in the Management Plan as ACBM or assumed ACBM. The date of the surveillance is recorded, the inspectors name and any changes in the conditions of the materials.
- The Building Inspector shall make a copy of the inspection document and insert into the front of the latest Management Plan (AHERA Three Year Reinspection report). The original document is returned to the LEA's Environmental Library and filed.

SCHOOL DISTRICT OF PHILADELPHIA
Education Center
440 North Broad Street
Philadelphia, Pennsylvania 19130

Office of Environmental Management and Services

215-400-4750

AHERA
Three Year Reinspection
Outline of Events

- Pursuant to the Federal Environmental Protection Agency (EPA) mandate, as required by 40 CFR 763.85(b) the following procedure is to be implemented. At least once every three (3) years after a Management Plan is in effect, each Local Education Agency (LEA) shall conduct a reinspection of each building that it owns or leases that contains Asbestos Containing Building Material's (ACBM's) or is assumed to contain ACBM.
- Subsequent Three Year Re-inspections (2009, 2012, 2015, etc) shall start in the Fall (October, November, December, January). The Building Engineer/Assistant should assist the Building Inspector with appropriate access to all areas including (Crawlspaces/Attics) and rooms in the facility. There is no action required of the Principal.
- An accredited Building Inspector shall visually inspect and touch to determine friability, all areas that are identified in the Management Plan as ACBM or assumed ACBM. The date of the surveillance is recorded, the inspectors name and any changes in the conditions of the materials. The Building Inspectors state of accreditation and license number is required.
- After the inspection, the Building Inspector shall make a copy of the inspection documents and insert into the front of the latest Management Plan (AHERA Three Year Reinspection report). The original document is returned to the LEA's Environmental Library and filed.
- The Building Inspector shall return the reinspection data to the Management Planner to be assessed and determine appropriate response actions and a report issued (AHERA Three Year Reinspection report). One copy of the report is delivered to the schools Principal to be permanently retained with all previous environmental data. Another copy is retained in the LEA's Environmental Library.



School District of Philadelphia
Office of Environmental Management & Services
440 North Broad Street
Philadelphia, PA 19130
(215) 400-4750

**School District of Philadelphia
Asbestos Management Program**

TABLE OF CONTENTS

Definitions.....	Page 9
1. Introduction.....	Page 10
2. Summary of Asbestos Management Plan	
3. Asbestos Management Plan Execution.....	Page 11
a. General Execution	
4. Summary of Program Execution	
a. Asbestos Management Plan Execution	
5. Responsibilities	
a. OEMS	
b. Asbestos Worker/Supervisor “A-TEAM”.....	Page 12
c. Asbestos Designated Person	
d. Supervisor or Project Manager (Capital, Maintenance & Facilities)	
e. Employee Capital.....	Page 13
f. Employee Maintenance	
g. Employee Facilities and Custodial	
6. Requirements.....	Page 14
a. Employee Exposure Monitoring	
b. Employee Notification	
c. Observation of Monitoring	
d. Training Program	
e. Access of Information	
f. Record Keeping	
7. AHERA O&M Plan.....	Page 15
a. Controls	
8. O&M Response Actions.....	Page 16
a. Facility Maintenance Isolation of Area	
b. Unlikely Contact with ACM/PACM	
c. Accidental Disturbance of ACM/PACM	
d. Planned Disturbance of ACM/PACM	
e. Miscellaneous ACM/PACM.....	Page 17
f. Vinyl Asbestos Floor Tile	
g. Mastic/Adhesives	
h. Woven Vibration Dampers	
i. Other Work Practices	
j. Fiber Release Episodes	
9. References and Resources.....	Page 18

DEFINITIONS / ACRONYMS

ACM/PACM:	Asbestos Containing Material/Potential Asbestos Containing Material
AHERA:	Asbestos Hazard Emergency Response Act
AIR FORM:	Asbestos Inspection Report Form
Amended Water:	Water to which a surfactant (soap) has been added
AMP:	Asbestos Management Program/Asbestos Management Plan
Asbestos Designate Person:	Individual assigned by the district to oversee asbestos related issues.
Asbestos Regulated Area:	Location that is posted as an asbestos work area in which only approved and accredited personnel are permitted to enter
AST:	Asbestos Support Team involving approved and accredited school district tradespersons personnel that are school district person
A-TEAM:	School District of Philadelphia asbestos workers
CIP:	Capital Improvement Program
Consultant:	Asbestos consulting firm hired by the District
Demolition Directive:	Memorandum – August 4, 2006 from Patrick Henwood
EPA:	Environmental Protection Agency
In House Personnel:	School District of Philadelphia asbestos workers
LEA:	Local Education Agency
O&M:	Operations and Maintenance
OEMS:	Office of Environmental Management and Services
OSHA:	Occupational Safety and Health Administration
PEL:	Permissible Exposure Limit
PSD or SDP:	Philadelphia School District/School District of Philadelphia
PSIT:	Philadelphia School Improvement Team
STEL:	Short Term Exposure Limit

1. Introduction

The School District of Philadelphia, Asbestos Policy Statement:

“The School District of Philadelphia is dedicated to providing a safe and healthful work environment for its employees, students, faculty, contractors and visitors. In recognition of the potential health problems associated with asbestos, the School District of Philadelphia is committed to a comprehensive asbestos control program. This program is implemented and maintained through the School District of Philadelphia's Office of Environmental Management and Services (OEMS).”

OEMS has the responsibility of establishing procedures for asbestos abatement, asbestos inspection, air monitoring, renovation and demolition activities within all School District of Philadelphia owned or leased facilities.

These procedures are developed to ensure that:

- (1) People are not exposed to significant levels of asbestos fibers
- (2) Asbestos waste is handled and disposed of properly
- (3) Members of the School District of Philadelphia community have access to the Office of Environmental Management and Services for information, assistance, guidance, and interpretation regarding asbestos related matters.
- (4) Members of the School District of Philadelphia community have access to the Asbestos Management Plans as required and outlined in the US EPA AHERA regulations including annual written notification to all parents.
- (5) Compliance with all applicable Federal, State and Local Asbestos Regulations

Requirements outlined in this manual are mandatory in nature where the word “SHALL” is used and are advisory in nature where the word “SHOULD” is used.

2. Summary of Asbestos Management Program

The School District of Philadelphia's Asbestos Management Program was established to meet the requirements of Federal, State, and Local Regulations.

These regulations include, but are not limited to:

- US Environmental Protection Agency Asbestos Hazard Emergency Response Act (US EPA AHERA) and National Emissions Standard for Hazardous Air Pollutants subpart M, Part 61 (NESHAP);
- US Department of Labor, Occupational Safety and Health Administration (OSHA) General Industry Standard (29 CFR 1910.1001) and the OSHA Asbestos Standard for the Construction Industry (29 CFR 1926.1101);
- The Commonwealth of Pennsylvania, Department of Labor and Industry, Asbestos Occupations, Accreditation and Certification Act;
- The City of Philadelphia, Department of Public Health, Asbestos Control Regulations.

3. Asbestos Management Program Execution

a) General Execution

The Office of Environmental Management and Services (OEMS) develops, implements and manages safety and health programs for the School District of Philadelphia faculty, staff and students and assists with ensuring that all contractors comply with Federal, State and Local Environmental Regulations. The OEMS provides the oversight of School District of Philadelphia employees (Asbestos A-Team), environmental consultants, and asbestos abatement contractors for all projects within the School District of Philadelphia concerning Asbestos Containing Materials.

The control of safety and health hazards at the School District of Philadelphia is primarily through the implementation of engineering, work practice and administrative controls. Personal Protective Equipment (PPE) is used to supplement these controls or whenever the controls are not feasible or are in the process of being implemented. PPE is also recommended whenever exposures to chemical, physical or biological agents can be prevented or reduced by its use.

This written program establishes the procedures necessary to:

- 1) meet established standards and federal regulations for occupational exposure to asbestos fibers;
- 2) meet the requirements of the City of Philadelphia Asbestos Control Regulations which encompasses the disturbance and/or abatement of asbestos containing building materials;
- 3) provide the necessary health and safety protection to the School District of Philadelphia staff, faculty, students, contractors and visitors.

This program is strengthened by input and cooperation with the Philadelphia Federation of Teachers (PFT), Health and Welfare Fund.

4. Summary of Program Execution

a) Asbestos Management Program Execution

The Asbestos Management Program is administered by the Office of Environmental Management and Services (OEMS). OEMS provides the following services primarily through professional consultants:

- (1) exposure monitoring services;
- (2) building inspection/surveys (bulk sampling) for the identification of asbestos containing materials;
- (3) asbestos project design services;
- (4) asbestos abatement project and air monitoring services;
- (5) emergency response to fiber release episodes;
- (6) education/information;
- (7) medical monitoring;
- (8) training for School District of Philadelphia personnel

5. Responsibilities

a) Office of Environmental Management and Services

OEMS is responsible for performing the following functions:

- (1) Developing and administering of the Asbestos Management Program.
- (2) Providing asbestos-related services to all School District of Philadelphia departments.
- (3) Conducting required training of the Asbestos Management Program and working jointly with departments to schedule training.
- (4) Identifying and posting areas where labeling/signage are required.
- (5) Medical Monitoring of OEMS "A-TEAM" and other departments "AST" Asbestos Program staff.

- (6) Certification and training as required for OEMS "A-TEAM" and other departments "AST" Asbestos program staff.
- (7) Record keeping as outlined in Section 3.5 and all records as by required by US EPA AHERA regulations.

b) Asbestos Worker/Supervisor - "A-TEAM"

- (1) OEMS shall ensure that all "A-TEAM" workers/supervisors adhere to the following requirements:
 - a) Attend an initial Worker/Supervisor Asbestos Course;
 - b) Maintain the annual re-certification per EPA AHERA requirements and Commonwealth of Pennsylvania Asbestos Occupations, Accreditation and Certifications Act;
 - c) Undergo an annual Asbestos Medical Evaluation;
 - d) Undergo an annual Respirator Medical Clearance;
 - e) Undergo an annual Respirator Fit Testing.

c) Asbestos Designated Person

The Asbestos Designated Person is responsible for:

- (1) Assuring the health and safety of employees, students and visitors in the School District of Philadelphia facilities under his/her control.
- (2) Being kept informed of all areas under his or her jurisdiction where potential asbestos exposures exist and initiating protection programs that adhere to the Asbestos Management Program requirements of this manual.
- (3) Assuring that Asbestos Management Program requirements are adhered to by principal investigators, project managers, supervisors, or division heads, and School District of Philadelphia personnel under their supervision.
- (4) Ensuring that all employees within the Asbestos Management Program comply with (OSHA 1910.1001 (j) (7) (iv)) and the US EPA AHERA regulations by attending the required training.
- (5) Ensure the posting of:
 - a) Warning labels/signage
 - b) Commonwealth of Pennsylvania Asbestos Abatement and Demolition/Renovation Notification form
 - c) Asbestos Inspection Reports (AIR) form (where required)
 - d) Ensuring that Construction Projects follow the Demolition Directive procedures as outlined in the August 4, 2006 letter.

d) Supervisor or Project Manager (Capital, Maintenance and Facilities)

Each person in charge of a project, maintenance/repair, renovation/demolition, or other activity from the Departments of Capital, Maintenance, and/or Facilities, where asbestos containing material may be present is responsible for:

Identifying, with the assistance of OEMS, asbestos containing building materials prior to any disturbance of these materials. Various Federal (EPA and OSHA) and Local (City of Philadelphia Asbestos Control Regulations) require Asbestos Inspections prior to renovation/demolition activities. This shall be accomplished by always following the Asbestos Management Program Procedures as follows:

- (1) Ensure that the requirements of the Asbestos Management Program Procedures are followed by all personnel, trades, and contractors who are involved with the project;

- (2) Review of the required Asbestos Inspection Report (AIR) form (Attachment 1) and AHERA Management Plan documents prior to activities that may disturb any Asbestos Containing Materials;
- (3) Perform all project related duties as outlined in the Project Management Responsibilities;
- (4) Keep the department chairperson or director informed on any actions proposed or taken regarding the Asbestos Management Plan;
- (5) Ensuring that Construction Projects follow the Demolition Directive procedure outlined in the August 4, 2006 letter.

e) Employee – Capital

School District of Philadelphia Capital employees and/or consultants shall:

- (1) Ensure that no suspect or asbestos containing building materials are disturbed in the course of the projects they are performing or managing. This shall be accomplished by notifying their supervisor and OEMS by issuance of a work order permit (a.k.a PSIT Service Request Form) and verifying that the materials which may be disturbed are non-asbestos containing. If this information is not available or verification has not been made, these materials should not be disturbed.
- (2) Immediately notify OEMS and their supervisor in the event of a potential fiber release episode upon discovery of visible damage to asbestos containing materials.
- (3) Ensuring that Construction Projects follow the Demolition Directive procedures as outlined in the August 4, 2006 letter.

The types of projects represented as part of the Capital Improvement Program are as follows:

- (1) Complete Renovation of an existing building that addresses all facility component concerns and educational program needs;
- (2) Major Renovation of an existing building addressing significant facility component and educational improvements;
- (3) Addition to an existing building (either as an attachment or stand-alone structure) to accommodate needed program space;
- (4) Conversion of an existing facility to accommodate a change in educational program;
- (5) Facility Component Improvement of specific facility needs (i.e. electrical or HVAC system upgrades, ADA improvements, life safety improvements, exterior renovations, etc.)

f) Employee – Maintenance

School District of Philadelphia Maintenance employees shall:

- (1) Ensure that no suspect or asbestos containing building materials are disturbed in the course of their duties or work they are performing. This shall be accomplished by notifying their supervisor and OEMS by issuance of a work order permit and verifying that the materials which may be disturbed are non-asbestos containing. If this information is not available or verification has not been made, these materials should not be disturbed.
- (2) Immediately notify OEMS and their supervisor in the event of a potential fiber release episode or upon discovery of visible damage to asbestos containing materials.
- (3) All employees involved in maintenance activities shall attend required Asbestos Awareness training program within 60 days of employment.

g) Employee – Facilities & Custodial

School District of Philadelphia Facilities and Custodial employees shall:

- (1) Ensure that no suspect or asbestos containing building materials are disturbed in the course of their duties or work they are performing. This shall be accomplished by notifying their supervisor and OEMS by issuance of a work permit and verifying that the materials which may be disturbed are non-asbestos containing. If this information is not available or verification has not been made, these materials should not be disturbed;
- (2) Immediately notify OEMS and their supervisor in the event of a potential fiber release episode or upon discovery of visible damage to asbestos containing materials.
- (3) All employees involved in Facilities and Custodial activities shall attend require Asbestos Awareness training program within 60 days of employment.

6. Requirements

a) Employee Exposure Monitoring

When information indicates that an employee's exposure to asbestos fibers may equal or exceed an 8-hour time-weighted average of 0.1 f/cc * (per OSHA 1910.1001 & 1926.1101), OEMS shall develop and implement an asbestos exposure monitoring program. The sampling strategy shall be designed to identify employees by work task (job classification) that is exposed to asbestos fibers that exceed an 8-hour time-weighted average of 0.1 f/cc.

b) Employee Notification

OEMS shall notify in writing, each employee exposed to asbestos fibers at or above an 8-hour time weighted average of 0.1 f/cc.

c) Observation and Monitoring

OEMS shall provide employees or their representatives with an opportunity to observe any exposure measurements conducted.

d) Training Program

OEMS shall institute a training program which meets the requirements of AHERA for all employees who perform maintenance operations in a facility/school which contains asbestos containing materials or presumed asbestos containing materials and 1910.1001 (j), and the Commonwealth of Pennsylvania Department of Labor and Industry and the City of Philadelphia Asbestos Control Regulations. The affected departments shall ensure employee participation in this program. The OEMS "A-TEAM" and other departments "AST" Asbestos Program staff training shall be conducted annually for each employee as required by all Federal, State and Local for each asbestos discipline.

All Asbestos Awareness training as required by AHERA shall be performed within 60 days of employment and shall include:

- Health effects of asbestos
- Locations of ACM and PACM in the building/facility
- Recognition of CM and PACM damage and deterioration
- Requirements of the OSHA 1910.1001 standard relating to maintenance
- Proper response to fiber release episodes
- Procedure to be followed to isolate areas affected by fiber release

e) Access to Information

OEMS shall make available to affected employees or their representative's copies of the Occupational Safety and Health Administration (OSHA) General Industry Standard Part 1910.1001 and the department shall post a copy in the workplace.

f) Record Keeping

OEMS shall maintain an accurate record of all employee exposure measurements. OEMS and/or the School District of Philadelphia Human Resources Department shall maintain records of employee medical monitoring program. OEMS shall maintain all employee training records. All records shall be provided upon request to employees, former employees, representatives designated by the individual employee.

7. AHERA OPERATIONS AND MAINTENANCE PLAN

a) CONTROLS

i. Work Order System

Minimizing disruption of ACM/PACM during maintenance and renovation activities is the primary goal and task encountered by OEMS. Operations and maintenance employees and contractors should be warned to avoid conducting any maintenance work which may disturb ACM/PACM. Initiating a work order system, where all work orders or requests are channeled through the Office of Environmental Management and Services (OEMS), will be the method used to control and minimize disruption of ACM/PACM.

Any work performed by in-house personnel or contractors that could or will impact ACM/PACM shall be coordinated by OEMS. A completed Asbestos Inspection Report Form (Attachment 1) shall be issued to in-house personnel and/or all contractors whose work could impact ACM/PACM. This form should accompany each contract issued to an outside contractor and posted on the jobsite.

All work order requests for maintenance and renovation activities in areas where ACM/PACM is suspected or known to be present are to be submitted to OEMS prior to proceeding with work. OEMS is responsible for reviewing asbestos survey records for information about the presence of ACM/PACM in the area where the work is to be performed. OEMS should physically inspect the area to ensure existing records reflect actual conditions. If no asbestos is present, a work order is not necessary and the planned actions can proceed. If ACM/PACM is found to be present in the area, OEMS will sign the work order application and obtain an approved and accredited asbestos contractor or assign OEMS "A-TEAM" to abate the ACM/PACM.

ii. Regulated Areas

The owner will identify and regulate all areas where airborne concentrations of ACM/PACM exceed the Permissible Exposure Limit (PEL)* (Per OSHA determined to be 0.1 f/cc) and/or short term exposure limit (STEL) (Per OSHA determined to be 0.1 f/cc), or there is reasonable possibility that the (PEL) and/or (STEL) may be exceeded. All ACM/PACM removal activities involving thermal system insulation ACM/PACM (Class I), surfacing ACM/PACM (Class I), and miscellaneous ACM/PACM such as floor tile, roofing, and siding mastic, etc. (Class II), and repair and maintenance operations where thermal system insulation and surfacing ACM/PACM is likely to be disturbed (Class III) will be performed in accordance with federal, state, and local regulations. All asbestos abatement work and activities will be designed and managed as asbestos regulated areas. These areas will be demarcated and labeled.

iii. Warning Signs

Warning signs shall be displayed at all approaches to each asbestos regulated area. The asbestos abatement contractor will provide OSHA warning signs in all regulated areas during removal, repair, and other maintenance activities. OEMS will provide AIRs to all contractors who must inform all employees and supervisors working in locations contiguous to asbestos regulated areas of the potential hazards and work practices required.

iv. Warning Labels

Warning labels and/or signage shall be affixed to all raw materials, mixtures, scrap, waste, debris, and other products containing asbestos fibers, or to their containers. Generally, the asbestos abatement contractor or OEMS A-Team personnel will provide all warning labels for ACM/PACM containment.

8. O & M RESPONSE ACTIONS

The Asbestos Management Program general O&M procedures are outlined in this section. Additional requirements specific to asbestos abatement activities are included in the Project Design documents for all Asbestos Abatement Work. Regular cleaning, inspection, and reporting of ACM/PACM deterioration or other problems must be diligently practiced by all employees including custodial and maintenance personnel.

a) Facility Maintenance Isolation of Area Responsibilities

Maintenance personnel are often required to work in areas where ACM/PACM may potentially be disturbed. Most maintenance activities are conducted by in-house staff, outside contractors, or a combination.

Emergency fiber release episodes, such as pipe fitting or valve breaks, emergency boiler work, or mechanical equipment repair will be responded to by OEMS A-Team personnel or asbestos abatement contractor personnel. The owner's maintenance staff will: (1) isolate the emergency fiber release area; (2) post warning signs to prevent unauthorized access, and (3) notify their supervisor and OEMS. OEMS will ensure that the fiber release area remains isolated and is properly cleaned by and approved and accredited abatement contractor or by OEMS A-TEAM personnel.

b) Unlikely Contact with ACM/PACM

Maintenance activities or repairs which can be performed without contacting or disturbing the ACM/PACM require little more than normal care and good workmanship. For example, valves which are either uncovered or covered with non-asbestos insulation can be packed or repaired without disturbing asbestos insulation on nearby pipes. The major precaution is to ensure that maintenance and custodial personnel are familiar with procedures such as isolating the area, posting warning signs, and notifying OEMS in the event of any accidental ACM/PACM disturbance.

c) Accidental Disturbance of ACM/PACM

Maintenance and facilities personnel shall notify OEMS any time a fiber release is suspected. If friable ACM/PACM becomes airborne in the building,

d) Planned Disturbance of ACM/PACM

Maintenance activities that may impact ACM/PACM include access to a valve, flange, duct, or related system component.

Where asbestos-containing insulation must be removed to maintain or repair the thermal system, the ACM/PACM will imminently be disturbed. ACM/PACM removal work shall be conducted by OEMS A-Team personnel or an approved and accredited asbestos abatement contractor.

If friable ACM/PACM becomes airborne in the building, maintenance and facilities personnel shall secure the area and contact OEMS. OEMS shall respond accordingly.

e) Miscellaneous ACM/PACM

Miscellaneous types of ACM/PACM may include vinyl asbestos floor tiles, mastics/adhesives and woven vibration dampers. Disturbance of these materials should be avoided. Routine maintenance activities involving these materials should not pose a problem if handled properly. Questions on the proper removal and disposal of miscellaneous ACM/PACM should be directed to OEMS. OEMS will contact an approved and accredited asbestos abatement contractor or utilize OEMS A-TEAM personnel to assist with miscellaneous ACM/PACM clean-up activities.

f) Vinyl Asbestos Floor Tile

Asbestos-containing floor tiles in good condition are considered non-friable unless they are crushed, drilled, sawed, sanded or disturbed by any activity that breaks up the material. Routine maintenance of these materials should employ the use of non-abrasive buffers and wet cleaning technique. Broken or loose floor tiles should be removed and disposed of as asbestos waste by OEMS. Remaining debris should be vacuumed with a HEPA vacuum and the area wet mopped using amended water.

g) Mastics/Adhesives

Mastics and adhesives containing asbestos in good condition are considered non-friable and do not pose a potential health concern unless crushed, drilled, sawed, sanded, or otherwise abraded. Questions on the proper removal should be directed to OEMS.

h) Woven Vibration Dampers

Woven vibration dampers in good condition are considered non-friable and do not pose a potential health concern unless cut, crushed, drilled, sawed, sanded, or otherwise abraded. Questions on the proper removal should be directed to OEMS.

i) Other Work Practices

Any special work not included in this section should be addressed to OEMS for review prior to the initiation of work that may involve the disturbance of ACM/PACM.

j) Fiber Release Episodes

Facilities and maintenance staff should report to OEMS the presence of asbestos debris, water or physical damage to ACM/PACM, or any other evidence of possible fiber release. OEMS should have the OEMS A-Team personnel or an approved and accredited abatement contractor respond to the site to clean up debris and make repairs as soon as possible. OEMS will also contact a consultant to conduct air monitoring and prepare a report and submit at project completion to OEMS for each episode. OEMS will forward the reports for each site location AHERA Management Plan accordingly.

9. REFERENCES and RESOURCES

Applicable regulations for asbestos projects impacted by renovation, demolition, and maintenance activities.

- **Philadelphia Air Management Services – Asbestos Control Unit**
<http://www.phila.gov/health/units/ams/Asbestos/asbestos.html>
- **Pennsylvania Asbestos Occupations, Accreditation and Certification Act**
<http://www.dli.state.pa.us/landi/cwp/view.asp?a=185&q=56262&landiNav=>
- **United States Environmental Protection Agency Asbestos Home Page**
<http://www.epa.gov/asbestos/>
- **Occupational Safety and Health Administration (OSHA) Asbestos Home**
<http://www.osha.gov/SLTC/asbestos>