



February 8, 2021

Mr. Eddie Escobio
Operations Project Manager
School District of Philadelphia
Office of Environmental Management & Services
440 North Broad Street
3rd Floor – Portal C Philadelphia, PA 19130

Reference: Lead Safe Certification Letter - Samuel Gompers School #4280

Dear Mr. Escobio,

Batta Environmental Associates, Inc. provided Lead Stabilization Oversight at the Samuel Gompers, School #4280, located at 5701 Wynnefield Avenue, Philadelphia, PA 19131. The stabilization scope of work was developed based on the Lead Safe Certification Assessment of the damaged paint observed and confirmed as lead-based paint by XRF analysis. The assessment scope was limited to the interior, below the suspended ceiling/enclosed ceiling, and student/teacher occupied areas only.

Ms. Jennifer Gabella, Ms. Justine James, and Mr. Emlyn Drake, all certified RRP Lead Dust Sampling Technicians, performed the oversight activities during the stabilization throughout the summer and fall of 2020. This letter certifies that the Samuel Gompers School is deemed "Lead Safe" and is valid only up to the day of the stabilization activities.

Please contact me if you have any questions at (302) 737-3376, extension 106.

Sincerely,

A handwritten signature in black ink, reading "Stephen C. Woronicak", written over a horizontal line.

Stephen C. Woronicak
Operations Manager
Batta Environmental Associates, Inc.

Attachments include:

Final Report - Summary of Paint & Plaster Stabilization Activities
Appendix A. Scope of Work Table
Appendix B. EPA Checklist Table
Appendix C. Oversight Table
Appendix D. Sample Results Table
Appendix E. Environmental Firm Certification Documentation of Training



SUMMARY OF PAINT & PLASTER STABILIZATION ACTIVITIES ENVIRONMENTAL SITE ASSESSMENT

for
Samuel Gompers School #4280
5701 Wynnefield Avenue, Philadelphia, PA 19131

Prepared For:
Mr. Eddie Escobio
Operations Project Manager
School District of Philadelphia
Office of Environmental Management & Services 440 North Broad Street
3rd Floor – Portal C Philadelphia, PA 19130

Submitted by:
BATTa ENVIRONMENTAL ASSOCIATES, INC.
Delaware Industrial Park
6 Garfield Way
Newark, Delaware 19713-5817

February 8, 2021

Project Number: 543519AV
Date of Project: June 1, 2020 through December 14, 2020

Prepared By:

A handwritten signature in black ink, appearing to read "Alyssa M. Cartagena".

Alyssa M. Cartagena
Project Manager

Reviewed By:

A handwritten signature in black ink, appearing to read "Steven C. Woronicak".

Steven C. Woronicak
Operations Manager



TABLE OF CONTENTS

- I. Introduction
- II. Methods Executive Summary
 - A. Preliminary Steps
 - i. Parent and Staff Notifications
 - ii. Decluttering
 - iii. Wall Hangings
 - iv. Swing Space
 - v. Facilities Building Cleaning Staff Training
 - B. Pre-Cleaning
 - C. Paint & Plaster Stabilization Procedures
 - i. Work Practices
 - ii. Oversight
 - D. Cleanup & Completion
 - i. Cleanup
- ii. Testing
- III. Oversight
 - A. Scope of Work
 - B. EPA Checklist
 - C. Oversight
 - D. Sample Results

Appendix A. Scope of Work Table

Appendix B. EPA Checklist Table

Appendix C. Oversight Table

Appendix D. Sample Results Table

Appendix E. Environmental Firm Certification Documentation of Training



I. INTRODUCTION

Batta Environmental Associates, Inc. (Batta), was requested by the School District of Philadelphia's Office of Environmental Management Services (OEMS) to perform oversight and clearance testing during a paint and plaster stabilization project being performed by the School District Painters at Samuel Gompers School #4280, located at 5701 Wynnefield Avenue, Philadelphia, PA 19131. The purpose of the oversight was to document that all parts of the US Environmental Protection Agency (EPA) Lead Renovation, Repair and Painting rules were being followed and documented.

II. METHODS EXECUTIVE SUMMARY

A. Preliminary Steps

i. Parent and Staff Notifications

Parents and staff were notified of the paint and plaster project by mail several weeks prior to the commencement of the project. Additionally, prior to the start of the project, parent and staff meetings were held by OEMS, Maintenance, and Operations to explain the process of the paint and plaster projects and to field any questions or concerns.

ii. Decluttering

Classrooms, closets and other storage areas were decluttered prior to the commencement of stabilization work. Coordination of the decluttering activities was made between teachers and facilities staff to ensure that outdated and unneeded academic materials were discarded, and that resources were provided to assist in the decluttering tasks such as support staff for heavy lifting and/or moving large furniture and additional recycling dumpsters.

iii. Wall Hangings

Posters, bulletin boards, framed art and other wall hangings were removed prior to the commencement of the paint stabilization project. This was coordinated with teachers by the Operations Division at the kick-off meeting, and during the phasing of the project, with the help of the Principal.

iv. Swing Space

Swing space was identified prior to the commencement of stabilization work to ensure that classrooms were available during the school year. A plan was created on a school- by-school basis to relocate students and teachers from classrooms during the course of this work. All work areas were scheduled for cleaning by facilities staff after the paint stabilization work was completed by Maintenance Painting Staff.

v. Facilities Building Cleaning Staff Training

Facilities Building Cleaning Staff were provided with information about this project and expectations for post-cleaning, including use of wet-wipes and HEPA vacuums.

B. Pre-Cleaning

On an as-needed basis, for areas such as cluttered storage closets, that required extensive movement of materials, HEPA vacuuming, and wet-wiping prior to paint and plaster stabilization, the Maintenance Environmental staff performed a pre-cleaning in advance of stabilization work. The intent of this task was to provide a clean work area prior to decluttering and stabilization.

Additionally, post-cleaning was conducted by facilities staff after paint and plaster stabilization was completed. This included the HEPA vacuuming and wet-wiping of all horizontal surfaces and polishing floors.

C. Paint & Plaster Stabilization Procedures

Paint and plaster stabilization work complied with the EPA's Lead RRP rule. All staff conducting this work were trained and/or certified as Lead RRP workers.

The following procedures were followed:

i. Work Practices

- Isolate work areas to restrict dust from impacting adjacent areas.
- Post signs/notifications as per EPA Lead RRP.
- Place "walk-off" pads at all access points into/out of work area.
- Seal all openings [windows, doors, and HVAC system registers/grilles] inside work areas as per direction from on-site environmental monitors and consistent with the EPA Lead RRP rules & guidelines.
- Workers are to wear disposable clothing and foot coverings while inside work areas and will not leave work areas wearing disposable clothing.
- Move/cover all remaining objects in work area to protect them. Including all open bins, shelves and boxes in the classroom.
- Employ/Erect "portable" dust containment barrier systems to limit the size of work areas requiring post-cleaning and limit testing and exposure.
- Place plastic floor coverings to extend at least 6 feet out from vertical surfaces being stabilized unless utilizing vertical barriers/containment systems.

- Perform all paint stabilization work in compliance with the EPA Lead RRP rules & guidelines and as per the directions of on-site environmental monitors to minimize dust contamination.
- Take all steps necessary to ensure that no dust or debris leaves the work area while the work is being performed.
- Use precautions to ensure that all employees, tools, and other items, including the exteriors of waste containers, are free of dust and debris before leaving the work area.
- Collect all paint chips & debris, fold up plastic floor coverings and any other plastic sheeting used on horizontal surfaces, without dispersing dust or debris and dispose of the material in heavy duty plastic waste bags.
- Do not use power tools.
- Do not use dry sweeping with brooms.
- Do use water/misting during stabilization to minimize dust.
- Do use HEPA vacuums and wet wiping/cleaning techniques.

ii. Oversight

The environmental technician will oversee paint and plaster stabilization work to ensure compliance with lead safe work practices. An oversight report will be completed at the end of every shift to record the work areas that were stabilized. The following tasks will be verified and recorded:

- Pre-cleaning
- Contents moved
- Work area prepped
- Surfaces stabilized
- Contents back in place
- Final inspection approval and photos

D. Cleanup & Completion

The following clean-up and completion procedures were performed for each work area following the completion of stabilization work:

i. Cleanup

- There should be no signs of loose, peeling, flaking, bubbling or crumbling paint or plaster visible on walls or ceilings or on any other painted surfaces.
- There should be no visible signs of paint chips, debris or dust of any kind on surfaces within "contained" and isolated work areas NOR outside of the contained and isolated work areas.
- Window sills, floors, baseboards, shelving units, tops of cabinets, desks, chairs, tables and all other horizontal surfaces

must be free of any visible signs of paint and plaster dust and/or debris.

- There must be absolutely no visible signs of paint chips, and/or paint/plaster dust or debris on academic/educational materials, including books, bins, toys, desks, chairs, carpets, papers, etc., after each work shift and to allow for re-occupancy the next day,
- Any remaining paint and plaster must be tightly adhered to wall and ceiling surfaces such that it cannot be further damaged, pried off or disturbed by "simple fingernail pressure" otherwise work will not be considered to be successfully completed.
- Newly painted surfaces should match the aesthetics of the area in total and should cover the entirety of the wall or ceiling area that was addressed through this work. No visible "patches" of paint should be observed.

ii. Testing

The District and the PFT's Environmental Consultant worked closely to develop an agreed upon approach to verify that stabilization work was performed in accordance with lead safe work practices, and that classrooms would be safe for re-occupancy by children and staff. This approach exceeds the EPA Lead RRP rule requirements in terms of the types of, and amounts of, testing performed. Testing will take place in work areas. The areas will be cleaned by general cleaners after the stabilization work is completed and the clearance testing is performed.

Qualitative testing methods, i.e., EPA RRP verification wipe testing and colorimetric wipe testing, will be compared with the quantitative testing method of Atomic Absorption Spectrophotometry (AAS) as indicated in the testing protocol below. If the comparison testing is consistently correlated, only qualitative testing will continue for the duration of the project.

a. Testing Protocol

Step 1 -- EPA RRP Verification Wipes and Colorimetric Wipes

The environmental consultant and painter foreman will coordinate the EPA RRP Verification Test Wipe in rooms/areas that have been stabilized and cleaned, and where plastic work area coverings have been removed and visual inspection conducted. After EPA RRP verification wipes pass the cleanliness standard for any surface and/or a 40 square feet (SF) section, the colorimetric testing will be conducted by the environmental consultant.

The colorimetric wipe tests will occur in "child-occupied areas" on approximately 10% of surfaces considered "clean" following the use of the verification wipes. These surfaces may include floors, window sills, or the tops

of any other immovable objects that were covered and cleaned in each work area (e.g. CUVs, immovable bookshelves). Additional colorimetric wipes may be collected on surfaces that had been moved and covered and placed outside of the work area. These surfaces may include desks, chairs, bookshelves, etc.

“Child-occupied areas” will include: classrooms, restrooms, cafeterias, gymnasiums, and auditoriums that are routinely used by children in PK-1st grade classrooms. Common areas that children in PK-1st grade classrooms only pass through, such as hallways, stairways, and garages are not included. “Child-occupied areas” will be identified by the Principal of each school.

Step 2 -- Response to Failed Tests

If colorimetric testing “fails,” then the 40 SF area will be re-wiped by EPA RRP Wipes. The process will continue until both testing methods confirm a “pass.”

Step 3 -- Flame Atomic Absorption Spectrophotometry (FAAS)

Flame Atomic Absorption Spectrophotometry (FAAS) will be used to verify and confirm the results of the colorimetric testing. FAAS will be used as a quality assurance/quality control for the colorimetric samples. Approximately 10% of the colorimetric samples should be submitted for FAAS analysis.

Step 4 -- Release Spaces Back to School/Operations

If EPA RRP wipes and colorimetric wipes are both acceptable, as determined on site, and if work was completed in accordance with this procedure, the room will be turned over to the District’s Operations team for “deep cleaning” and for re- occupancy.

Step 5 — Ongoing Review

All sampling and testing data, information and results will be readily available and accessible for review by school staff, parents and members of the Oversight Advisory Committee and will be reviewed on a regular basis. Any suggested modifications, changes or other revisions will be considered by the School District of Philadelphia.

The three testing methods were conducted as follows:

| Type of Clearance Tests | Building Component | Number of Sample Locations within Work | Type of Testing | Testing Specifications/ Limitations |
|---|--|--|-----------------|--|
| EPA RRP Cleaning Verification Wipe | Floors, Countertops, Desks, Tables, Window Sills | One (1) wipe every 40 square or entire surface of component if surface area is less than 40ft ² One (1) wipe for every window sill | Qualitative | <ul style="list-style-type: none"> • Qualitative testing based on (white glove test) • According to RRP, the areas pass after the 3rd cleaning, regardless of Verification |
| Colorimetric Wipe SKC, Inc. Full Disclosure® Instant Wipes | Floors, Countertops, Desks, Tables, Window Sills, Etc. | 10% of surfaces considered “clean” following the use of EPA RRP Cleaning Verification Wipes | Qualitative | <ul style="list-style-type: none"> • Qualitative testing based on colorimetric visual comparison • Lower Limit of Visual Detection is 18µg of lead • False positive and false negative interferences from silver, cadmium, barium, mercury, and titanium (percentages unknown) • Involves field preparation of sampling media using Reagents |
| Flame Atomic Absorption Spectrophotometry (AAS) | Analyze Colorimetric Wipes from locations listed above | A minimum of one and a maximum of 10% of wipes will also be subjected to laboratory analysis by FAAS for verification. This testing method will be used on a periodic basis to validate the the accuracy of qualitative methods above. | Quantitative | <ul style="list-style-type: none"> • Interior Floors and Desks: < 20 µg/ft² This is based upon a District and PFT agreement. This is half the current HUD and EPA standard. This is tied to the detection level for the colorimetric wipe which is 18µg per wipe. • Window Sills: < 100 µg/ft² D |

III. OVERSIGHT

A. Scope of Work

A scope of work was developed for Samuel Gompers School following a room-by-room inspection of Teacher/Student occupied areas of the school. During the inspection, the location and quantity of damaged paint and plaster, along with any associated debris and whether the damage was the result of an on-going moisture intrusion, were noted. This information was entered into a scope of work spreadsheet, which was provided to the School District Painting Department in order to create a schedule for the work to be completed.

During the paint and plaster stabilization project, additional areas of damage were found behind wall hangings, inside of closets that had now been decluttered, and behind furniture once it had been moved. These additional areas of work were added to the scope of work as they were observed.

The scope of work for Samuel Gompers School is included in the Appendix A of this report.

B. EPA Checklist

Throughout the paint and plaster stabilization project, Criterion's on-site inspector observed, documented, and signed-off on tasks required by the EPA RRP. Additional notes were added to the EPA Checklist to document different oversight tasks that took place. These included documenting that warning signs were posted at the entrance to the work area, that the work area had been contained to prevent the spread of dust and debris, that all objects in the work area had been removed or covered, that all HVAC ducts in the work area were closed and covered, that windows in the work area were closed, that doors in the work area were closed and sealed, that doors that must be used in the work area were covered to allow passage but prevent the spread of dust, that floors in the work area were covered with taped-down plastic, that waste was being contained while on-site and while being transported, that the work site was properly cleaned after the renovations, that all paint chips and debris were picked up and that the protective sheeting was misted, folded dirty-side inward, and taped for removal, that the work area surfaces and objects were cleaned using HEPA vacuums and/or wet-wiping or mopping, that a certified renovator performed the post-renovation cleaning verification, a description of the post-renovation cleaning verification, including the number of wet and dry cloths used, and if the dust clearance testing was performed.

The EPA Checklist for Samuel Gompers School is included in the Appendix B of this report.

C. Oversight

Throughout the paint and plaster stabilization project, Criterion's on-site inspector documented the day-to-day tasks performed for each work area. These tasks included the dates of pre-cleaning, the moving of the contents of the room, the prepping of the work area, the stabilization of the painted surfaces, and the final inspection.

The Oversight Table for Samuel Gompers School is included in the Appendix C of this report.



D. Sample Results

Throughout the paint and plaster stabilization project, Criterion's on-site inspector documented all sampling results for each work area location. This included all RRP verification wipes, colorimetric wipes, and wipes to be submitted for Flame AAS analysis. Wipe result below 10 microgram per square ft (ft²) for lead is a passing result.

The Sample Results Table for Samuel Gompers School is included in the Appendix D of this report.



Appendix A. Scope of Work Table

Lead Safe Certification for Samuel Gompers

| 117A : Principal's Office | | | | | Yes | Ceiling | Wood | White | Flaking | Wood | -0.5 | Negative | | | |
|---------------------------|---|-----------|---|------------|---|---------|----------|------------|-------------|---------------|----------|----------|----------|--------------------|--|
| 117A : Principal's Office | | | | | Yes | W1 | Concrete | Light Blue | Flaking | Concrete | -0.5 | Negative | | | |
| ULCS# | E | BldgElmt | F | Space Type | 211 : Classroom 211 | Yes | W2 | Concrete | | Flaking | Concrete | -0.5 | Negative | | |
| 4280 | 1 | B821001-1 | 3 | Primary | 208 : Classroom 208 | Yes | W1 | Concrete | Light Blue | Flaking | Concrete | -0.5 | Negative | | |
| 4280 | 1 | B821001-1 | 3 | Primary | 106 : Classroom 106 | Yes | W4 | Concrete | Light Blue | Chipping | Concrete | -0.4 | Negative | | |
| 4280 | 1 | B821001-1 | 3 | Primary | 119 : Office to Left of Copy Room on 1st Floor | Yes | W2 | Concrete | Blue | Flaking | Concrete | -0.4 | Negative | | |
| 4280 | 1 | B821001-1 | 3 | Primary | 201 : Classroom 201 | Yes | W3 | Concrete | Light Green | Chipping | Concrete | -0.4 | Negative | | |
| 4280 | 1 | B821001-1 | 3 | Primary | 202 : Classroom 202 | Yes | W2 | Concrete | Light Green | Chipping | Concrete | -0.4 | Negative | | |
| 4280 | | | | | 218 : Gymnasium | Yes | W1 | Concrete | White | Flaking | Concrete | -0.4 | Negative | | |
| 4280 | | | | | 204 : Classroom 204 | Yes | W2 | Concrete | Light Blue | Flaking | Concrete | -0.4 | Negative | | |
| 4280 | | | | | 213 : Classroom 213 | Yes | W4 | Concrete | Light Green | Chipping | Concrete | -0.4 | Negative | | |
| 4280 | | | | | 211 : Classroom 211 | Yes | W4 | Concrete | | Flaking | Concrete | -0.4 | Negative | | |
| 4280 | 1 | B821001-1 | 3 | Primary | 211A : Book Storage next to Classroom 212 | Yes | W3 | Concrete | Tan | Chipping | Concrete | -0.4 | Negative | | |
| 4280 | 1 | B821001-1 | 3 | Primary | S3 : Stairwell 3 next to Library | Yes | W2 | Concrete | Tan | Efflorescence | Concrete | -0.3 | Negative | | |
| 4280 | 1 | B821001-1 | 3 | Stairs | 107 : Classroom 107 | Yes | W2 | Concrete | Light Blue | Chipping | Concrete | -0.3 | Negative | | |
| 4280 | 1 | B821001-1 | 3 | Stairs | 107 : Classroom 107 | Yes | W3 | Concrete | Light Blue | Chipping | Concrete | -0.3 | Negative | | |
| 4280 | 1 | B821001-1 | 3 | Stairs | 107 : Classroom 107 | Yes | W4 | Concrete | Light Blue | Chipping | Concrete | -0.3 | Negative | | |
| 4280 | | | | | 106 : Classroom 106 | Yes | W1 | Metal | Blue | Chipping | Metal | -0.3 | Negative | Door Frame | |
| 4280 | | | | | Hall at Room 106 | Yes | W2 | Concrete | Muti | Chipping | Concrete | -0.3 | Negative | | |
| 4280 | 1 | B821001-1 | 3 | Stairs | Hall at Room 106 | Yes | W4 | Concrete | Light Blue | Flaking | Concrete | -0.3 | Negative | | |
| 4280 | 1 | B821001-1 | 3 | Stairs | JC1 : Custodial Closet to Left of Classroom 106 | Yes | W3 | Concrete | Tan | Intact | Concrete | -0.3 | Negative | | |
| 4280 | 1 | B821001-1 | 3 | Stairs | JC1 : Custodial Closet to Left of Classroom 106 | Yes | W2 | Concrete | Tan | Intact | Concrete | -0.3 | Negative | | |
| 4280 | 1 | B821001-1 | 3 | Stairs | 105A : Book Storage Closet Next to Room 106 | Yes | Ceiling | Concrete | White | Flaking | Concrete | -0.3 | Negative | | |
| 4280 | 1 | B821001-1 | 3 | Stairs | 105 : Classroom 105 | Yes | W2 | Concrete | Blue | Flaking | Concrete | -0.3 | Negative | | |
| 4280 | 1 | B821001-1 | 3 | Primary | 105 : Classroom 105 | Yes | W3 | Concrete | Blue | Flaking | Concrete | -0.3 | Negative | | |
| 4280 | 1 | B821001-1 | 3 | Primary | Room 135 Bathroom | Yes | W2 | Concrete | Blue | Flaking | Concrete | -0.3 | Negative | | |
| 4280 | 1 | B821001-1 | 3 | Primary | 114 : Auditorium | Yes | W2 | Concrete | Tan | Flaking | Concrete | -0.3 | Negative | | |
| 4280 | 1 | B821001-1 | 3 | Primary | 117A : Principal's Office | Yes | W1 | Concrete | Light Blue | Flaking | Concrete | -0.3 | Negative | | |
| 4280 | 1 | B821001-1 | 3 | Primary | 117A : Principal's Office | Yes | W2 | Concrete | Light Blue | Flaking | Concrete | -0.3 | Negative | | |
| 4280 | 1 | B821001-1 | 3 | Primary | 117A : Principal's Office | Yes | W4 | Concrete | Light Blue | Flaking | Concrete | -0.3 | Negative | | |
| 4280 | 1 | B821001-1 | 3 | Primary | 119 : Office to Left of Copy Room on 1st Floor | Yes | W1 | Concrete | Blue | Flaking | Concrete | -0.3 | Negative | | |
| 4280 | 1 | B821001-1 | 3 | Primary | 119 : Office to Left of Copy Room on 1st Floor | Yes | W4 | Concrete | Blue | Flaking | Concrete | -0.3 | Negative | | |
| 4280 | | | | | 112 : Classroom A | Yes | W2 | Concrete | Light Blue | Chipping | Concrete | -0.3 | Negative | | |
| 4280 | | | | | 123C : Custodial Closet next to Nurse's Office | Yes | W3 | Concrete | Tan | Flaking | Concrete | -0.3 | Negative | Wall Partition | |
| 4280 | | | | | 103D : Storage to Left of Classroom 103 | Yes | W2 | Wood | Blue | Flaking | Wood | -0.3 | Negative | Wall Partition | |
| 4280 | | | | | 102 : Classroom 102 | Yes | W4 | Concrete | Tan | Flaking | Concrete | -0.3 | Negative | | |
| 4280 | | | | | 3 : Boiler Room | Yes | W4 | Concrete | Light Gray | Intact | Concrete | -0.3 | Negative | Hall @ Boiler Room | |
| 4280 | | | | | Stairwell at Boiler Room | Yes | W4 | Concrete | Tan | Flaking | Concrete | -0.3 | Negative | | |
| 4280 | 1 | B821001-1 | 3 | Primary | 202 : Classroom 202 | Yes | W3 | Concrete | Light Green | Chipping | Concrete | -0.3 | Negative | | |
| 4280 | 1 | B821001-1 | 3 | Primary | 219 : Cafeteria | Yes | W4 | Concrete | Brown | Chipping | Concrete | -0.3 | Negative | | |
| 4280 | 1 | B821001-1 | 3 | Primary | 218 : Gymnasium | Yes | W2 | Concrete | White | Flaking | Concrete | -0.3 | Negative | | |
| 4280 | 1 | B821001-1 | 3 | Primary | 218 : Gymnasium | Yes | W4 | Concrete | White | Flaking | Concrete | -0.3 | Negative | | |
| 4280 | 1 | B821001-1 | 3 | Primary | 204 : Classroom 204 | Yes | W1 | Concrete | Light Blue | Flaking | Concrete | -0.3 | Negative | | |
| 4280 | 1 | B821001-1 | 3 | Primary | 204 : Classroom 204 | Yes | W3 | Concrete | Light Blue | Flaking | Concrete | -0.3 | Negative | | |
| 4280 | 1 | B821001-1 | 3 | Storage | 212 : Classroom 212 | Yes | W2 | Concrete | Light Blue | Flaking | Concrete | -0.3 | Negative | | |
| 4280 | | | | | 212 : Classroom 212 | Yes | W3 | Concrete | Light Blue | Flaking | Concrete | -0.3 | Negative | | |
| 4280 | | | | | 212 : Classroom 212 | Yes | W4 | Concrete | Light Blue | Flaking | Concrete | -0.3 | Negative | | |
| 4280 | | | | | 213 : Classroom 213 | Yes | W3 | Concrete | Light Green | Chipping | Concrete | -0.3 | Negative | | |
| 4280 | | | | | 207 : Classroom 207 | Yes | W3 | Concrete | Light Blue | Chipping | Concrete | -0.3 | Negative | | |
| 4280 | | | | | 211 : Classroom 211 | Yes | W3 | Concrete | | Flaking | Concrete | -0.3 | Negative | | |
| 4280 | | | | | 211A : Book Storage next to Classroom 212 | Yes | W4 | Concrete | Tan | Chipping | Concrete | -0.3 | Negative | | |
| 4280 | | | | | 209 : Music Classroom 209 | Yes | W1 | Concrete | Light Green | Flaking | Concrete | -0.3 | Negative | | |
| 4280 | | | | | 209 : Music Classroom 209 | Yes | W2 | Concrete | Light Green | Flaking | Concrete | -0.3 | Negative | | |
| 4280 | | | | | 107 : Classroom 107 | Yes | W1 | Concrete | Light Blue | Chipping | Concrete | -0.2 | Negative | | |

Lead Safe Certification for Samuel Gompers

| | | | | | | | | | | | | | | | |
|-------|---|-----------|---|------------|---|-----|---------|----------|-------------|----------|----------|------|----------|------------------------|------|
| | | | | | 117A : Principal's Office | Yes | Ceiling | Wood | White | Flaking | Wood | -0.5 | Negative | | |
| | | | | | 117A : Principal's Office | Yes | W1 | Concrete | Light Blue | Flaking | Concrete | -0.5 | Negative | | |
| ULCS# | E | BldgElmt | F | Space Type | 211 : Classroom 211 | Yes | W2 | Concrete | | Flaking | Concrete | -0.5 | Negative | | |
| 4280 | | | | | Hall at Room 106 | Yes | W2 | Concrete | Blue | Chipping | Concrete | -0.2 | Negative | | |
| 4280 | | | | | 104 : Classroom 104 | Yes | W1 | Concrete | Green | Flaking | Concrete | -0.2 | Negative | | |
| 4280 | | | | | 104 : Classroom 104 | Yes | W4 | Concrete | Green | Flaking | Concrete | -0.2 | Negative | | |
| 4280 | 1 | B821001-1 | 3 | Storage | 114 : Auditorium | Yes | W1 | Concrete | Tan | Flaking | Concrete | -0.2 | Negative | | |
| 4280 | 1 | B821001-1 | 3 | Storage | 114 : Auditorium | Yes | W4 | Concrete | Tan | Flaking | Concrete | -0.2 | Negative | | |
| 4280 | 1 | B821001-1 | 3 | Storage | 117A : Principal's Office | Yes | W3 | Concrete | Light Blue | Flaking | Concrete | -0.2 | Negative | | |
| 4280 | 1 | B821001-1 | 3 | Storage | 103 : Classroom 103 | Yes | W2 | Concrete | Light Green | Chipping | Concrete | -0.2 | Negative | | |
| 4280 | 1 | B821001-1 | 3 | Storage | 124 : 1st Floor Teacher's Lounge (SJS Room) | Yes | W3 | Concrete | Light Gray | Chipping | Concrete | -0.2 | Negative | | |
| 4280 | 1 | B821001-1 | 3 | Storage | 124 : 1st Floor Teacher's Lounge (SJS Room) | Yes | W4 | Concrete | Light Gray | Chipping | Concrete | -0.2 | Negative | | |
| 4280 | 1 | B821001-1 | 3 | Storage | 202 : Classroom 202 | Yes | W1 | Concrete | Light Green | Chipping | Concrete | -0.2 | Negative | | |
| 4280 | 1 | B821001-1 | 3 | Storage | 202 : Classroom 202 | Yes | W4 | Concrete | Light Green | Chipping | Concrete | -0.2 | Negative | | |
| 4280 | 1 | B821001-1 | 3 | Storage | 219 : Cafeteria | Yes | W2 | Concrete | Tan | Chipping | Concrete | -0.2 | Negative | | |
| 4280 | 1 | B821001-1 | 3 | Storage | 203 : Classroom 203 | Yes | W2 | Concrete | Light Green | Flaking | Concrete | -0.2 | Negative | | |
| 4280 | 1 | B821001-1 | 3 | Storage | 213 : Classroom 213 | Yes | W2 | Concrete | Light Green | Chipping | Concrete | -0.2 | Negative | | |
| 4280 | 1 | B821001-1 | 3 | Storage | 207 : Classroom 207 | Yes | W2 | Concrete | Light Blue | Chipping | Concrete | -0.2 | Negative | | |
| 4280 | 1 | B821001-1 | 3 | Primary | 207 : Classroom 207 | Yes | W4 | Concrete | Light Blue | Chipping | Concrete | -0.2 | Negative | | |
| 4280 | 1 | B821001-1 | 3 | Primary | 211 : Classroom 211 | Yes | W1 | Concrete | | Flaking | Concrete | -0.2 | Negative | | |
| 4280 | 1 | B821001-1 | 3 | Primary | 211A : Book Storage next to Classroom 212 | Yes | W2 | Concrete | Tan | Chipping | Concrete | -0.2 | Negative | | |
| 4280 | 1 | B821001-1 | 3 | Primary | 208 : Classroom 208 | Yes | W2 | Concrete | Light Blue | Flaking | Concrete | -0.2 | Negative | | |
| 4280 | 1 | B821001-1 | 3 | Primary | 210 : Classroom 210 | Yes | W1 | Concrete | Light Green | Chipping | Concrete | -0.2 | Negative | | |
| 4280 | 1 | B821001-1 | 3 | Primary | 210 : Classroom 210 | Yes | W2 | Concrete | Light Green | Chipping | Concrete | -0.2 | Negative | | |
| 4280 | | | | | 106 : Classroom 106 | Yes | W1 | Concrete | Light Blue | Chipping | Concrete | -0.1 | Negative | | |
| 4280 | | | | | 106 : Classroom 106 | Yes | W3 | Concrete | Light Blue | Chipping | Concrete | -0.1 | Negative | | |
| 4280 | | | | | 106 : Classroom 106 | Yes | W3 | Metal | Light Blue | Chipping | Metal | -0.1 | Negative | Radiator | |
| 4280 | | | | | 107 : Classroom 104 | Yes | W2 | Wood | Light Blue | Flaking | Wood | -0.1 | Negative | Chalkboard frame | |
| 4280 | | | | | 104 : Classroom 104 | Yes | W4 | Wood | Light Blue | Flaking | Wood | -0.1 | Negative | Chalkboard frame | |
| 4280 | | | | | 114 : Auditorium | Yes | W3 | Concrete | Tan | Flaking | Concrete | -0.1 | Negative | | |
| 4280 | | | | | 114 : Auditorium | Yes | Ceiling | Plaster | Tan | Flaking | Plaster | -0.1 | Negative | | |
| 4280 | | | | | H13 : Hallway at Visitor's Entrance Foyer | Yes | W2 | Metal | Blue | Chipping | Metal | -0.1 | Negative | Door | |
| 4280 | | | | | 103 : Classroom 103 | Yes | W1 | Concrete | Light Green | Chipping | Concrete | -0.1 | Negative | | |
| 4280 | 1 | B821001-1 | 3 | Primary | 103B : Back Storage to the Right in Classroom 103 | Yes | W3 | Concrete | Orange | Chipping | Concrete | -0.1 | Negative | | |
| 4280 | 1 | B821001-1 | 3 | Primary | 124 : 1st Floor Teacher's Lounge (SJS Room) | Yes | W1 | Concrete | Light Gray | Chipping | Concrete | -0.1 | Negative | | |
| 4280 | 1 | B821001-1 | 3 | Primary | 102 : Classroom 102 | Yes | W1 | Concrete | Tan | Flaking | Concrete | -0.1 | Negative | | |
| 4280 | 1 | B821001-1 | 3 | Primary | 102 : Classroom 102 | Yes | W3 | Concrete | Tan | Flaking | Concrete | -0.1 | Negative | | |
| 4280 | 1 | B821001-1 | 3 | Primary | 101 : Classroom 101 | Yes | W2 | Wood | Medium Blue | Intact | Wood | -0.1 | Negative | Closet Door Frame Trim | 4SF |
| 4280 | | | | | 125 : Classroom 101 Restroom | Yes | W1 | Concrete | Tan | Flaking | Concrete | -0.1 | Negative | | |
| 4280 | 1 | B821001-1 | 3 | Primary | 3 : Boiler Room | Yes | W2 | Concrete | Light Gray | Intact | Concrete | -0.1 | Negative | Hall @ Boiler Room | |
| 4280 | 1 | B821001-1 | 3 | Primary | Stairwell at Boiler Room | Yes | Ceiling | Concrete | Tan | Flaking | Concrete | -0.1 | Negative | | |
| 4280 | 1 | B821001-1 | 3 | Primary | 1A : Hallway next to Classrooms 101 through Classroom | Yes | W2 | Concrete | Tan | Flaking | Concrete | -0.1 | Negative | | |
| 4280 | 1 | B821001-1 | 3 | Stairs | 1A : Hallway next to Classrooms 101 through Classroom | Yes | W2 | Wood | Blue | Flaking | Wood | -0.1 | Negative | Chalkboard | 10SF |
| 4280 | 1 | B821001-1 | 3 | Stairs | 201 : Classroom 201 | Yes | W1 | Concrete | Tan | Flaking | Concrete | -0.1 | Negative | | |
| 4280 | 1 | B821001-1 | 3 | Stairs | 201 : Classroom 201 | Yes | W2 | Concrete | Tan | Flaking | Concrete | -0.1 | Negative | | |
| 4280 | 1 | B821001-1 | 3 | Stairs | 201 : Classroom 201 | Yes | W3 | Concrete | Tan | Flaking | Concrete | -0.1 | Negative | | |
| 4280 | 1 | B821001-1 | 3 | Stairs | 219 : Cafeteria | Yes | W4 | Concrete | Tan | Chipping | Concrete | -0.1 | Negative | | |
| 4280 | 1 | B821001-1 | 3 | Stairs | 219 : Cafeteria | Yes | W4 | Metal | Blue | Chipping | Metal | -0.1 | Negative | Electrical Panel | |
| 4280 | 1 | B821001-1 | 3 | Stairs | 218 : Gymnasium | Yes | W3 | Concrete | White | Flaking | Concrete | -0.1 | Negative | | |
| 4280 | 1 | B821001-1 | 3 | Stairs | 204 : Classroom 204 | Yes | W4 | Concrete | Light Blue | Flaking | Concrete | -0.1 | Negative | | |
| 4280 | 1 | B821001-1 | 3 | Primary | 212 : Classroom 212 | Yes | W1 | Concrete | Light Blue | Flaking | Concrete | -0.1 | Negative | | |
| 4280 | 1 | B821001-1 | 3 | Primary | 212 : Classroom 212 | Yes | W1 | Wood | Light Green | Chipping | Wood | -0.1 | Negative | Closet Door Trim | 6SF |
| 4280 | | | | | 213 : Classroom 213 | Yes | W2 | Wood | Light Green | Chipping | Wood | -0.1 | Negative | Board Trim | 6SF |
| 4280 | | | | | 213 : Classroom 213 | Yes | W4 | Wood | Blue | Flaking | Wood | -0.1 | Negative | Chalkboard Ledge | 8SF |

Lead Safe Certification for Samuel Gompers

| 117A : Principal's Office | | | | | Yes | Ceiling | Wood | White | Flaking | Wood | -0.5 | Negative | | | |
|---------------------------|---|-----------|---|----------------|---|---------|----------|------------|-------------|---------------|----------|----------|----------|-------------------|------|
| 117A : Principal's Office | | | | | Yes | W1 | Concrete | Light Blue | Flaking | Concrete | -0.5 | Negative | | | |
| ULCS# | E | BldgElmt | F | Space Type | 211 : Classroom 211 | Yes | W2 | Concrete | | Flaking | Concrete | -0.5 | Negative | | |
| 4280 | | | | | 211A : Book Storage next to Classroom 212 | Yes | W1 | Concrete | Tan | Chipping | Concrete | -0.1 | Negative | | |
| 4280 | | | | | 211A : Book Storage next to Classroom 212 | Yes | W4 | Wood | Brown | Chipping | Concrete | -0.1 | Negative | Shelf | |
| 4280 | | | | | 401 : R3 Portable Classroom | Yes | W3 | Metal | Red | Chipping | Metal | -0.1 | Negative | Door Frame | 6SF |
| 4280 | 1 | B821001-1 | 3 | Primary | 107 : Classroom 107 | Yes | W1 | Wood | Light Blue | Flaking | Wood | 0 | Negative | Closet Frame | |
| 4280 | 1 | B821001-1 | 3 | Primary | 106 : Classroom 106 | Yes | W1 | Wood | Blue | Chipping | Wood | 0 | Negative | Chalkboard | |
| 4280 | 1 | B821001-1 | 3 | Primary | Hall at Room 106 | Yes | W4 | Wood | Blue | Chipping | Wood | 0 | Negative | Chalkboard Frame | |
| 4280 | 1 | B821001-1 | 3 | Primary | 105 : Classroom 105 | Yes | W1 | Concrete | Blue | Flaking | Concrete | 0 | Negative | | |
| 4280 | 1 | B821001-1 | 3 | Primary | 105 : Classroom 105 | Yes | W3 | Metal | Light Blue | Chipping | Metal | 0 | Negative | Radiator | |
| 4280 | 1 | B821001-1 | 3 | Primary | 114A : Auditorium Stage | Yes | W2 | Wood | Dark Blue | Flaking | Wood | 0 | Negative | | |
| 4280 | 1 | B821001-1 | 3 | Primary | 117C : Conference Room | Yes | W1 | Metal | Dark Blue | Chipping | Metal | 0 | Negative | Door Frame | |
| 4280 | 1 | B821001-1 | 3 | Primary | 119A : Copy Room Staff Restroom near Main Office | Yes | W2 | Wood | Blue | Flaking | Wood | 0 | Negative | Door Trim | |
| 4280 | 1 | B821001-1 | 3 | Primary | 112 : Classroom A | Yes | Ceiling | Concrete | White | Cracking | Concrete | 0 | Negative | | |
| 4280 | 1 | B821001-1 | 3 | Primary | 103 : Classroom 103 | Yes | W4 | Brick | Light Green | Chipping | Brick | 0 | Negative | Columns | |
| 4280 | 1 | B821001-1 | 3 | Circulation | 103B : Back Storage to the Right in Classroom 103 | Yes | W1 | Concrete | Tan | Chipping | Concrete | 0 | Negative | | |
| 4280 | 1 | B821001-1 | 3 | Circulation | 103B : Back Storage to the Right in Classroom 103 | Yes | W4 | Concrete | Tan | Chipping | Concrete | 0 | Negative | | |
| 4280 | 1 | B821001-1 | 3 | Circulation | 124 : 1st Floor Teacher's Lounge (SJS Room) | Yes | W2 | Concrete | Light Gray | Chipping | Concrete | 0 | Negative | | |
| 4280 | 1 | B821001-1 | 3 | Circulation | 102 : Classroom 102 | Yes | W2 | Concrete | Tan | Flaking | Concrete | 0 | Negative | | |
| 4280 | 1 | B821001-1 | 3 | Circulation | 102 : Classroom 102 | Yes | W1 | Wood | Medium Blue | Chipping | Wood | 0 | Negative | Chalkboard frame | 8SF |
| 4280 | 1 | B821001-1 | 3 | Circulation | 101 : Classroom 101 | Yes | W1 | Wood | Medium Red | Intact | Wood | 0 | Negative | Door Frame Trim | 4SF |
| 4280 | | | | | 101 : Classroom 101 | Yes | W3 | Concrete | Tan | Deteriorating | Concrete | 0 | Negative | | |
| 4280 | | | | | 101 : Classroom 101 | Yes | W4 | Concrete | Tan | Deteriorating | Concrete | 0 | Negative | | |
| 4280 | 1 | B821001-1 | 3 | Administrative | 101 : Classroom 101 | Yes | W1 | Wood | Medium Blue | Flaking | Wood | 0 | Negative | Chalkboard frame | 24SF |
| 4280 | 1 | B821001-1 | 3 | Administrative | 100A : Storage Closet in Classroom 101 | Yes | W2 | Wood | Light Green | Chipping | Wood | 0 | Negative | Shelf Support | 6SF |
| 4280 | 1 | B821001-1 | 3 | Administrative | 125 : Classroom 101 Restroom | Yes | W1 | Wood | Tan | Flaking | Wood | 0 | Negative | Door | 8SF |
| 4280 | 1 | B821001-1 | 3 | Administrative | 7 : Building Engineer's Office | Yes | W1 | Concrete | Light Green | Deteriorating | Concrete | 0 | Negative | | |
| 4280 | 1 | B821001-1 | 3 | Administrative | 7 : Building Engineer's Office | Yes | W3 | Concrete | Light Green | Deteriorating | Concrete | 0 | Negative | | |
| 4280 | 1 | B821001-1 | 3 | Administrative | 7 : Building Engineer's Office | Yes | W1 | Wood | Dark Green | Chipping | Wood | 0 | Negative | Door Frame Trim | 5SF |
| 4280 | 1 | B821001-1 | 3 | Primary | 7B : Building Engineer's Restroom | Yes | W1 | Wood | Dark Green | Flaking | Wood | 0 | Negative | Door Trim | 4SF |
| 4280 | 1 | B821001-1 | 3 | Primary | 3 : Boiler Room | Yes | W3 | Concrete | Gray | Flaking | Concrete | 0 | Negative | | |
| 4280 | 1 | B821001-1 | 3 | Primary | Stairwell at Boiler Room | Yes | W3 | Metal | Blue | Flaking | Metal | 0 | Negative | Door Exit | |
| 4280 | 1 | B821001-1 | 3 | Primary | 1A : Hallway next to Classrooms 101 through Classroom | Yes | W4 | Metal | Red | Flaking | Metal | 0 | Negative | Radiator | 6SF |
| 4280 | 1 | B821001-1 | 3 | Primary | 202 : Classroom 202 | Yes | W3 | Concrete | Tan | Efflorescence | Concrete | 0 | Negative | | |
| 4280 | 1 | B821001-1 | 3 | Primary | 219 : Cafeteria | Yes | W3 | Concrete | Tan | Chipping | Concrete | 0 | Negative | | |
| 4280 | 1 | B821001-1 | 3 | Primary | 219 : Cafeteria | Yes | W3 | metal | Blue | Chipping | Metal | 0 | Negative | Door (Exit) | 8SF |
| 4280 | 1 | B821001-1 | 3 | Administrative | 218 : Gymnasium | Yes | | Wood | Black | Chipping | Wood | 0 | Negative | Baseboard | 24SF |
| 4280 | 1 | B821001-1 | 3 | Administrative | 212 : Classroom 212 | Yes | W1 | Wood | Blue | Chipping | Wood | 0 | Negative | Chalkboard Tray | 4SF |
| 4280 | 1 | B821001-1 | 3 | Administrative | 212 : Classroom 212 | Yes | W1 | Wood | Blue | Chipping | Wood | 0 | Negative | Door Trim | 6SF |
| 4280 | 1 | B821001-1 | 3 | Administrative | 212 : Classroom 212 | Yes | W1 | Wood | Blue | Chipping | Wood | 0 | Negative | Door | 8SF |
| 4280 | 1 | B821001-1 | 3 | Administrative | 213 : Classroom 213 | Yes | W1 | Concrete | Light Green | Chipping | Concrete | 0 | Negative | | |
| 4280 | 1 | B821001-1 | 3 | Administrative | 213 : Classroom 213 | Yes | W1 | Wood | Light Green | Chipping | Wood | 0 | Negative | Coat Rack | |
| 4280 | 1 | B821001-1 | 3 | Circulation | 213 : Classroom 213 | Yes | W1 | Wood | Light Green | Chipping | Wood | 0 | Negative | Closet Door Trim | 6SF |
| 4280 | 1 | B821001-1 | 3 | Circulation | 213 : Classroom 213 | Yes | W1 | Metal | Light Green | Chipping | Metal | 0 | Negative | Door Frame | 6SF |
| 4280 | 1 | B821001-1 | 3 | Circulation | 207 : Classroom 207 | Yes | Ceiling | Concrete | White | Chipping | Concrete | 0 | Negative | | |
| 4280 | 1 | B821001-1 | 3 | Circulation | 207 : Classroom 207 | Yes | W3 | Metal | Light Green | Chipping | Metal | 0 | Negative | Radiator | 8SF |
| 4280 | 1 | B821001-1 | 3 | Circulation | 207 : Classroom 207 | Yes | W1 | Metal | Light Green | Chipping | Metal | 0 | Negative | Closet Door Frame | 6SF |
| 4280 | 1 | B821001-1 | 3 | Circulation | 211 : Classroom 211 | Yes | W1 | Wood | Blue | Chipping | Wood | 0 | Negative | Chalkboard Tray | 6SF |
| 4280 | 1 | B821001-1 | 2 | Primary | 211 : Classroom 211 | Yes | W4 | Wood | Blue | Chipping | Wood | 0 | Negative | Chalkboard Tray | 6SF |
| 4280 | 1 | B821001-1 | 2 | Primary | 211 : Classroom 211 | Yes | W1 | Wood | Blue | Chipping | Wood | 0 | Negative | Coat Rack | 4SF |
| 4280 | 1 | B821001-1 | 2 | Primary | 208 : Classroom 208 | Yes | W2 | Wood | Light Blue | Chipping | Wood | 0 | Negative | Chalkboard Trim | 6SF |
| 4280 | 1 | B821001-1 | 2 | Primary | 208 : Classroom 208 | Yes | W1 | Wood | Light Green | Chipping | Wood | 0 | Negative | Closet Door Frame | 6SF |
| 4280 | 1 | B821001-1 | 2 | Primary | 210 : Classroom 210 | Yes | W1 | Wood | Blue | Chipping | Wood | 0 | Negative | Door | 8SF |

Lead Safe Certification for Samuel Gompers

| 117A : Principal's Office | | | | | Yes | Ceiling | Wood | White | Flaking | Wood | -0.5 | Negative | | | |
|---------------------------|---|-----------|---|-------------|---|---------|----------|------------|-------------|---------------|----------|----------|-------------|----------------------|-----|
| 117A : Principal's Office | | | | | Yes | W1 | Concrete | Light Blue | Flaking | Concrete | -0.5 | Negative | | | |
| ULCS# | E | BldgElmt | F | Space Type | 211 : Classroom 211 | Yes | W2 | Concrete | | Flaking | Concrete | -0.5 | Negative | | |
| 4280 | 1 | B821001-1 | 2 | Primary | 210 : Classroom 210 | Yes | W1 | Wood | Light Green | Chipping | Wood | 0 | Negative | Chalkboard Trim | 6SF |
| 4280 | 1 | B821001-1 | 2 | Primary | 210 : Classroom 210 | Yes | W1 | Wood | Light Green | Chipping | Wood | 0 | Negative | Closet Door | 8SF |
| 4280 | 1 | B821001-1 | 2 | Stairs | 209 : Music Classroom 209 | Yes | W4 | Concrete | Light Green | Flaking | Concrete | 0 | Negative | | |
| 4280 | 1 | B821001-1 | 2 | Stairs | S3 : Stairwell 3 next to Library | Yes | W3 | Metal | Blue | Flaking | Metal | 0.1 | Negative | Exit Door | |
| 4280 | 1 | B821001-1 | 2 | Stairs | S3 : Stairwell 3 next to Library | Yes | W3 | Metal | Blue | Chipping | Metal | 0.1 | Negative | Hall @ Stair | |
| 4280 | 1 | B821001-1 | 2 | Stairs | S3 : Stairwell 3 next to Library | Yes | W3 | Metal | Brown | Chipping | Metal | 0.1 | Negative | Railing | |
| 4280 | 1 | B821001-1 | 2 | Stairs | 108 : Library | Yes | W1 | Drywall | Light Gray | Intact | Drywall | 0.1 | Negative | | |
| 4280 | 1 | B821001-1 | 2 | Stairs | 108 : Library | Yes | W3 | Drywall | Light Gray | Intact | Drywall | 0.1 | Negative | | |
| 4280 | 1 | B821001-1 | 2 | Primary | 108 : Library | Yes | W1 | Wood | White | Peeling | Wood | 0.1 | Negative | Door | |
| 4280 | 1 | B821001-1 | 2 | Primary | 107 : Classroom 107 | Yes | Ceiling | Concrete | White | Chipping | Concrete | 0.1 | Negative | | |
| 4280 | 1 | B821001-1 | 2 | Primary | 107 : Classroom 107 | Yes | W3 | Metal | Blue | Chipping | Metal | 0.1 | Negative | Exit Door | |
| 4280 | | | | | 107 : Classroom 107 | Yes | W1 | Wood | Blue | Chipping | Wood | 0.1 | Negative | Wood | |
| 4280 | 1 | B821001-1 | 2 | Primary | Hall at Room 107 | Yes | W4 | Wood | Blue | Chipping | Wood | 0.1 | Negative | Bulletin Board Frame | |
| 4280 | 1 | B821001-1 | 2 | Primary | 106 : Classroom 106 | Yes | W2 | Concrete | Light Blue | Chipping | Concrete | 0.1 | Negative | | |
| 4280 | 1 | B821001-1 | 2 | Primary | 106 : Classroom 106 | Yes | W1 | Wood | Blue | Chipping | Wood | 0.1 | Negative | Door | |
| 4280 | 1 | B821001-1 | 2 | Primary | 106 : Classroom 106 | Yes | W1 | Wood | Light Blue | Chipping | Wood | 0.1 | Negative | Closet Door | |
| 4280 | 1 | B821001-1 | 2 | Primary | 106 : Classroom 106 | Yes | W2 | Wood | Light Blue | Chipping | Wood | 0.1 | Negative | Chalkboard Tray | |
| 4280 | 1 | B821001-1 | 2 | Primary | 106 : Classroom 106 | Yes | W3 | Metal | Blue | Chipping | Metal | 0.1 | Negative | Door Exit | |
| 4280 | 1 | B821001-1 | 2 | Primary | 105 : Classroom 105 | Yes | W4 | Concrete | Blue | Flaking | Concrete | 0.1 | Negative | | |
| 4280 | 1 | B821001-1 | 2 | Primary | 105 : Classroom 105 | Yes | W1 | Wood | Light Blue | Flaking | Wood | 0.1 | Negative | Coat Rack | |
| 4280 | 1 | B821001-1 | 2 | Primary | 105 : Classroom 105 | Yes | W3 | Metal | Blue | Chipping | Metal | 0.1 | Negative | Door (Exit) | |
| 4280 | 1 | B821001-1 | 2 | Primary | 105 : Classroom 105 | Yes | W1 | Wood | Light Blue | Chipping | Wood | 0.1 | Negative | Closet Door | |
| 4280 | 1 | B821001-1 | 2 | Primary | 105 : Classroom 105 | Yes | W4 | Wood | Light Blue | Chipping | Wood | 0.1 | Negative | Chalkboard Frame | |
| 4280 | 1 | B821001-1 | 2 | Primary | 104 : Classroom 104 | Yes | W1 | Wood | Light Blue | Flaking | Wood | 0.1 | Negative | Coat Shelf | |
| 4280 | 1 | B821001-1 | 2 | Primary | 104 : Classroom 104 | Yes | W1 | Wood | Blue | Flaking | Wood | 0.1 | Negative | Wood | |
| 4280 | 1 | B821001-1 | 2 | Primary | 114 : Auditorium | Yes | W1 | Wood | Red | Chipping | Wood | 0.1 | Negative | | |
| 4280 | 1 | B821001-1 | 2 | Primary | H12 : Auditorium and Main Office Hallway | Yes | W1 | Wood | Red | Chipping | Wood | 0.1 | Negative | Door | |
| 4280 | 1 | B821001-1 | 2 | Primary | H12 : Auditorium and Main Office Hallway | Yes | W4 | Wood | Red | Chipping | Wood | 0.1 | Negative | Trophy Frame | |
| 4280 | 1 | B821001-1 | 2 | Primary | 117C : Conference Room | Yes | W1 | Metal | Dark Blue | Chipping | Metal | 0.1 | Negative | Door | |
| 4280 | 1 | B821001-1 | 2 | Primary | 119 : Office to Left of Copy Room on 1st Floor | Yes | W3 | Concrete | Blue | Flaking | Concrete | 0.1 | Negative | | |
| 4280 | 1 | B821001-1 | 2 | Primary | 119A : Copy Room Staff Restroom near Main Office | Yes | W1 | Wood | Blue | Flaking | Wood | 0.1 | Negative | Window Frame | |
| 4280 | 1 | B821001-1 | 2 | Primary | 119A : Copy Room Staff Restroom near Main Office | Yes | W1 | Wood | Blue | Flaking | Wood | 0.1 | Negative | Door | |
| 4280 | 1 | B821001-1 | 2 | Primary | 113 : Classroom B | Yes | Ceiling | Concrete | White | Cracking | Concrete | 0.1 | Negative | | |
| 4280 | 1 | B821001-1 | 2 | Primary | 113 : Classroom B | Yes | W1 | Wood | Black | Chipping | Wood | 0.1 | Negative+N2 | | |
| 4280 | 1 | B821001-1 | 2 | Teacher | 103 : Classroom 103 | Yes | W3 | Concrete | Light Green | Chipping | Concrete | 0.1 | Negative | | |
| 4280 | 1 | B821001-1 | 2 | Teacher | 103B : Back Storage to the Right in Classroom 103 | Yes | W2 | Concrete | Tan | Chipping | Concrete | 0.1 | Negative | | |
| 4280 | 1 | B821001-1 | 2 | Teacher | 103B : Back Storage to the Right in Classroom 103 | Yes | W4 | Wood | Tan | Chipping | Wood | 0.1 | Negative | Wall Partition | |
| 4280 | 1 | B821001-1 | 2 | Teacher | 103B : Back Storage to the Right in Classroom 103 | Yes | W1 | Wood | Tan | Chipping | Wood | 0.1 | Negative | Door Trim | |
| 4280 | 1 | B821001-1 | 2 | Teacher | 103B : Back Storage to the Right in Classroom 103 | Yes | W1 | Wood | Orange | Chipping | Wood | 0.1 | Negative | Door | |
| 4280 | 1 | B821001-1 | 2 | Teacher | 124 : 1st Floor Teacher's Lounge (SJS Room) | Yes | W3 | Wood | Light Blue | Chipping | Wood | 0.1 | Negative | Closet Door Trim | |
| 4280 | 1 | B821001-1 | 2 | Circulation | 124 : 1st Floor Teacher's Lounge (SJS Room) | Yes | W1 | Wood | Light Blue | Chipping | Wood | 0.1 | Negative | | |
| 4280 | 1 | B821001-1 | 2 | Circulation | 124 : 1st Floor Teacher's Lounge (SJS Room) | Yes | W3 | Wood | Light Blue | Chipping | Wood | 0.1 | Negative | Shelf Support | |
| 4280 | 1 | B821001-1 | 2 | Circulation | 124 : 1st Floor Teacher's Lounge (SJS Room) | Yes | W3 | Wood | Light Blue | Chipping | Wood | 0.1 | Negative | Shelf Support | |
| 4280 | | | | | 124 : 1st Floor Teacher's Lounge (SJS Room) | Yes | W3 | Wood | Light Blue | Chipping | Wood | 0.1 | Negative | | |
| 4280 | 1 | B821001-1 | 2 | Circulation | 101 : Classroom 101 | Yes | W1 | Metal | Medium Blue | Deteriorating | Metal | 0.1 | Negative | Door Frame | 4SF |
| 4280 | 1 | B821001-1 | 2 | Circulation | 101 : Classroom 101 | Yes | W1 | Wood | Medium Blue | Deteriorating | Wood | 0.1 | Negative | Door | 6SF |
| 4280 | 1 | B821001-1 | 2 | Circulation | 101 : Classroom 101 | Yes | W2 | Wood | Medium Blue | Intact | Wood | 0.1 | Negative | Closet Door | 6SF |
| 4280 | 1 | B821001-1 | 2 | Circulation | 101 : Classroom 101 | Yes | W1 | Concrete | Tan | Deteriorating | Concrete | 0.1 | Negative | | |
| 4280 | 1 | B821001-1 | 2 | Teacher | 101 : Classroom 101 | Yes | W2 | Concrete | Tan | Deteriorating | Concrete | 0.1 | Negative | | |
| 4280 | 1 | B821001-1 | 2 | Teacher | 100A : Storage Closet in Classroom 101 | Yes | W1 | Wood | Medium Blue | Chipping | Wood | 0.1 | Negative | Door | 6SF |
| 4280 | 1 | B821001-1 | 2 | Teacher | 100A : Storage Closet in Classroom 101 | Yes | W1 | Concrete | Light Green | Chipping | Concrete | 0.1 | Negative | | |

Lead Safe Certification for Samuel Gompers

| | | | | | | | | | | | | | | | |
|---------------------------|---|-----------|---|------------|---|---------|----------|------------|-------------|---------------|----------|----------|----------|-------------------|------|
| 117A : Principal's Office | | | | | Yes | Ceiling | Wood | White | Flaking | Wood | -0.5 | Negative | | | |
| 117A : Principal's Office | | | | | Yes | W1 | Concrete | Light Blue | Flaking | Concrete | -0.5 | Negative | | | |
| ULCS# | E | BldgElmt | F | Space Type | 211 : Classroom 211 | Yes | W2 | Concrete | | Flaking | Concrete | -0.5 | Negative | | |
| 4280 | 1 | B821001-1 | 2 | Teacher | 125 : Classroom 101 Restroom | Yes | W4 | Concrete | Tan | Flaking | Concrete | 0.1 | Negative | Hall@ 125 Bath | |
| 4280 | 1 | B821001-1 | 2 | Teacher | 7 : Building Engineer's Office | Yes | W4 | Concrete | Light Green | Deteriorating | Concrete | 0.1 | Negative | | |
| 4280 | 1 | B821001-1 | 2 | Teacher | 7 : Building Engineer's Office | Yes | W1 | Wood | Light Blue | Chipping | Wood | 0.1 | Negative | Door | 8SF |
| 4280 | 1 | B821001-1 | 2 | Teacher | 7 : Building Engineer's Office | Yes | W1 | Metal | Light Blue | Chipping | Metal | 0.1 | Negative | Door Frame | 4SF |
| 4280 | 1 | B821001-1 | 2 | Kitchen | 7 : Building Engineer's Office | Yes | W4 | Concrete | Dark Green | Flaking | Concrete | 0.1 | Negative | | |
| 4280 | 1 | B821001-1 | 2 | Kitchen | 7B : Building Engineer's Restroom | Yes | W2 | Concrete | Light Green | Flaking | Concrete | 0.1 | Negative | | |
| 4280 | 1 | B821001-1 | 2 | Kitchen | 7B : Building Engineer's Restroom | Yes | W3 | Concrete | Light Green | Flaking | Concrete | 0.1 | Negative | | |
| 4280 | 1 | B821001-1 | 2 | Kitchen | 7B : Building Engineer's Restroom | Yes | W4 | Concrete | Light Green | Flaking | Concrete | 0.1 | Negative | | |
| 4280 | 1 | B821001-1 | 2 | Kitchen | 3 : Boiler Room | Yes | W2 | Concrete | Medium | Flaking | Concrete | 0.1 | Negative | | |
| 4280 | 1 | B821001-1 | 2 | Kitchen | 3 : Boiler Room | Yes | W1 | Concrete | Medium | Flaking | Concrete | 0.1 | Negative | | |
| 4280 | 1 | B821001-1 | 2 | Primary | 1 : Left Side Boiler Storage | Yes | W1 | Pipe | Tan | Flaking | Pipe | 0.1 | Negative | Wrap | |
| 4280 | 1 | B821001-1 | 2 | Primary | Stairwell at Boiler Room | Yes | W2 | Metal | Brown | Chipping | Metal | 0.1 | Negative | Riser | |
| 4280 | 1 | B821001-1 | 2 | Primary | 1A : Hallway next to Classrooms 101 through Classroom | Yes | W2 | Metal | Tan | Flaking | Metal | 0.1 | Negative | Hall @ 102 | |
| 4280 | 1 | B821001-1 | 2 | Primary | 201 : Classroom 201 | Yes | W2 | Concrete | Light Green | Chipping | Concrete | 0.1 | Negative | | |
| 4280 | 1 | B821001-1 | 2 | Primary | 201 : Classroom 201 | Yes | W3 | Metal | Light Green | Chipping | Metal | 0.1 | Negative | Radiator | 4SF |
| 4280 | 1 | B821001-1 | 2 | Primary | 201 : Classroom 201 | Yes | W1 | Wood | Light Blue | Flaking | Wood | 0.1 | Negative | Chalkboard Tray | 5SF |
| 4280 | 1 | B821001-1 | 2 | Primary | 201 : Classroom 201 | Yes | W1 | Wood | Light Blue | Flaking | Wood | 0.1 | Negative | Coat Rack | |
| 4280 | 1 | B821001-1 | 2 | Primary | 202 : Classroom 202 | Yes | W1 | Concrete | Tan | Flaking | Concrete | 0.1 | Negative | | |
| 4280 | 1 | B821001-1 | 2 | Primary | 202 : Classroom 202 | Yes | W1 | Wood | Light Green | Chipping | Wood | 0.1 | Negative | Closet Door | 8Sf |
| 4280 | 1 | B821001-1 | 2 | Primary | 219 : Cafeteria | Yes | W1 | Wood | White | Chipping | Wood | 0.1 | Negative | Trophy Case | 12SF |
| 4280 | 1 | B821001-1 | 2 | Primary | 219 : Cafeteria | Yes | W3 | Wood | Red | Chipping | Wood | 0.1 | Negative | Door | 8SF |
| 4280 | 1 | B821001-1 | 2 | Primary | 219 : Cafeteria | Yes | W4 | Wood | Blue | Chipping | Wood | 0.1 | Negative | Door Trim | 4SF |
| 4280 | 1 | B821001-1 | 2 | Primary | 203 : Classroom 203 | Yes | W1 | Wood | Blue | Wood | Wood | 0.1 | Negative | Chalkboard Tray | 10SF |
| 4280 | 1 | B821001-1 | 2 | Primary | 218 : Gymnasium | Yes | W3 | Wood | Light Blue | Flaking | Wood | 0.1 | Negative | Door | 8SF |
| 4280 | 1 | B821001-1 | 2 | Primary | 218 : Gymnasium | Yes | W4 | Wood | Light Blue | Flaking | Wood | 0.1 | Negative | Door Frame Trim | 10SF |
| 4280 | 1 | B821001-1 | 2 | Primary | 218 : Gymnasium | Yes | W3 | Wood | Blue | Chipping | Wood | 0.1 | Negative | Door | 8SF |
| 4280 | 1 | B821001-1 | 2 | Primary | 204 : Classroom 204 | Yes | W1 | Wood | Light Green | Chipping | Wood | 0.1 | Negative | Closet Door Trim | 6SF |
| 4280 | 1 | B821001-1 | 2 | Primary | 212 : Classroom 212 | Yes | W3 | Metal | | Chipping | Metal | 0.1 | Negative | Radiator | 10SF |
| 4280 | 1 | B821001-1 | 2 | Stairs | 212 : Classroom 212 | Yes | W1 | Wood | Light Blue | Chipping | Wood | 0.1 | Negative | Board Trim | 6SF |
| 4280 | 1 | B821001-1 | 2 | Stairs | 212 : Classroom 212 | Yes | W2 | Wood | Light Blue | Chipping | Wood | 0.1 | Negative | Board Trim | 6SF |
| 4280 | 1 | B821001-1 | 2 | Stairs | 212 : Classroom 212 | Yes | W4 | Wood | Light Blue | Chipping | Wood | 0.1 | Negative | Board Trim | 6SF |
| 4280 | 1 | B821001-1 | 2 | Stairs | 212 : Classroom 212 | Yes | Ceiling | Concrete | Tan | Flaking | Concrete | 0.1 | Negative | | |
| 4280 | 1 | B821001-1 | 2 | Stairs | 213 : Classroom 213 | Yes | W3 | Metal | Light Green | Chipping | Metal | 0.1 | Negative | Radiator | 12SF |
| 4280 | 1 | B821001-1 | 2 | Stairs | 207 : Classroom 207 | Yes | W1 | Concrete | Light Blue | Chipping | Concrete | 0.1 | Negative | | |
| 4280 | 1 | B821001-1 | 2 | Primary | 207 : Classroom 207 | Yes | W1 | Metal | Blue | Chipping | Metal | 0.1 | Negative | Door Frame | 6SF |
| 4280 | 1 | B821001-1 | 2 | Primary | 211 : Classroom 211 | Yes | W1 | Wood | Green | Chipping | Wood | 0.1 | Negative | Closet Door Frame | 6SF |
| 4280 | 1 | B821001-1 | 2 | Primary | 211 : Classroom 211 | Yes | W1 | Wood | Green | Chipping | Wood | 0.1 | Negative | Chalkboard Frame | 6SF |
| 4280 | 1 | B821001-1 | 2 | Primary | 211 : Classroom 211 | Yes | W2 | Wood | Green | Chipping | Wood | 0.1 | Negative | Chalkboard Frame | 6SF |
| 4280 | 1 | B821001-1 | 2 | Primary | 211 : Classroom 211 | Yes | W4 | Wood | Green | Chipping | Wood | 0.1 | Negative | Chalkboard frame | 6SF |
| 4280 | 1 | B821001-1 | 2 | Primary | 208 : Classroom 208 | Yes | Ceiling | Concrete | White | Flaking | Concrete | 0.1 | Negative | | |
| 4280 | 1 | B821001-1 | 2 | Computer - | 208 : Classroom 208 | Yes | W1 | Wood | Light Blue | Chipping | Wood | 0.1 | Negative | Coat Rack | 4SF |
| 4280 | | | | | 208 : Classroom 208 | Yes | W3 | Concrete | Light Green | Flaking | Concrete | 0.1 | Negative | Columns | 12SF |
| 4280 | | | | | 208 : Classroom 208 | Yes | W1 | Wood | Light Green | Chipping | Wood | 0.1 | Negative | Closet Door | 8SF |
| 4280 | | | | | 210 : Classroom 210 | Yes | W4 | Concrete | Light Green | Chipping | Concrete | 0.1 | Negative | | |
| 4280 | | | | | 210 : Classroom 210 | Yes | W1 | Wood | Blue | Chipping | Wood | 0.1 | Negative | Chalkboard Tray | 6SF |
| 4280 | | | | | 210 : Classroom 210 | Yes | W1 | Wood | Light Green | Chipping | Wood | 0.1 | Negative | Closet Door Trim | 6SF |
| 4280 | 1 | B821001-1 | 2 | Computer - | 210 : Classroom 210 | Yes | W1 | Wood | Light Green | Chipping | Wood | 0.1 | Negative | Coat Rack | 4SF |
| 4280 | 1 | B821001-1 | 2 | Computer - | 209 : Music Classroom 209 | Yes | W3 | Concrete | Light Green | Flaking | Concrete | 0.1 | Negative | | |
| 4280 | 1 | B821001-1 | 2 | Computer - | 402 : Classroom R3 Boy's Restroom | Yes | W3 | Concrete | Tan | Flaking | Concrete | 0.1 | Negative | | |
| 4280 | | | | | S3 : Stairwell 3 next to Library | Yes | W3 | Metal | Blue | Flaking | Metal | 0.2 | Negative | Door Frame | |
| 4280 | | | | | S3 : Stairwell 3 next to Library | Yes | W1 | Metal | Brown | Chipping | Metal | 0.2 | Negative | Post | |

Lead Safe Certification for Samuel Gompers

| | | | | | | | | | | | | | | |
|---------------------------|---|-----------|---|-------------|--|---------|----------|------------|-------------|----------|------|----------|-----------------------|------|
| 117A : Principal's Office | | | | | Yes | Ceiling | Wood | White | Flaking | Wood | -0.5 | Negative | | |
| 117A : Principal's Office | | | | | Yes | W1 | Concrete | Light Blue | Flaking | Concrete | -0.5 | Negative | | |
| ULCS# | E | BldgElmt | F | Space Type | 211 : Classroom 211 | Yes | W2 | Concrete | Flaking | Concrete | -0.5 | Negative | | |
| 4280 | | | | | 108 : Library | Yes | W4 | Drywall | Intact | Drywall | 0.2 | Negative | | |
| 4280 | | | | | 108 : Library | Yes | W4 | Wood | Intact | Wood | 0.2 | Negative | Wall Trim | |
| 4280 | | | | | 107 : Classroom 107 | Yes | W4 | Wood | Chipping | Wood | 0.2 | Negative | Chalkboard Frame | |
| 4280 | 1 | B821001-1 | 2 | Computer - | 107 : Classroom 107 | Yes | W1 | Metal | Blue | Metal | 0.2 | Negative | Door Frame | |
| 4280 | 1 | B821001-1 | 2 | Computer - | 107 : Classroom 107 | Yes | W1 | Wood | Light Blue | Wood | 0.2 | Negative | Coat Rack | |
| 4280 | 1 | B821001-1 | 2 | Computer - | 107 : Classroom 107 | Yes | W3 | Metal | Light Blue | Metal | 0.2 | Negative | Radiator | |
| 4280 | 1 | B821001-1 | 2 | Primary | 106 : Classroom 106 | Yes | W1 | Wood | Light Blue | Wood | 0.2 | Negative | Door Trim | |
| 4280 | 1 | B821001-1 | 2 | Primary | 106 : Classroom 106 | Yes | W1 | Wood | Light Blue | Wood | 0.2 | Negative | Coat Shelf | |
| 4280 | 1 | B821001-1 | 2 | Primary | 106 : Classroom 106 | Yes | W4 | Wood | Blue | Wood | 0.2 | Negative | Chalkboard Frame | |
| 4280 | 1 | B821001-1 | 2 | Primary | 105 : Classroom 105 | Yes | W1 | Wood | Blue | Wood | 0.2 | Negative | Chalkboard Tray | |
| 4280 | 1 | B821001-1 | 2 | Primary | 105 : Classroom 105 | Yes | W1 | Wood | Light Blue | Wood | 0.2 | Negative | Chalkboard frame | |
| 4280 | 1 | B821001-1 | 2 | Primary | 105 : Classroom 105 | Yes | W2 | Wood | Light Blue | Wood | 0.2 | Negative | Chalkboard Frame | |
| 4280 | 1 | B821001-1 | 2 | Primary | 105 : Classroom 105 | Yes | W3 | Metal | Light Blue | Metal | 0.2 | Negative | Radiator | |
| 4280 | | | | | 105 : Classroom 105 | Yes | W1 | Metal | Red | Metal | 0.2 | Negative | Door Frame | |
| 4280 | | | | | 104 : Classroom 104 | Yes | W1 | Wood | Light Blue | Wood | 0.2 | Negative | Chalk Shelf | |
| 4280 | | | | | 104 : Classroom 104 | Yes | W1 | Wood | Red | Wood | 0.2 | Negative | Door Trim | |
| 4280 | | | | | 104 : Classroom 104 | Yes | W1 | Wood | Blue | Wood | 0.2 | Negative | Door | |
| 4280 | 1 | B821001-1 | 2 | Primary | 117E : Principal's Restroom | Yes | W1 | Wood | Blue | Wood | 0.2 | Negative | Door | |
| 4280 | 1 | B821001-1 | 2 | Primary | 119A : Copy Room Staff Restroom near Main Office | Yes | W2 | Wood | Blue | Wood | 0.2 | Negative | Shelf | |
| 4280 | 1 | B821001-1 | 2 | Primary | 103 : Classroom 103 | Yes | W4 | Concrete | Light Green | Concrete | 0.2 | Negative | | |
| 4280 | 1 | B821001-1 | 2 | Primary | 102 : Classroom 102 | Yes | W3 | Concrete | Tan | Concrete | 0.2 | Negative | Columns | 15SF |
| 4280 | 1 | B821001-1 | 2 | Primary | 102 : Classroom 102 | Yes | W2 | Wood | Medium Blue | Wood | 0.2 | Negative | Chalkboard frame | 8SF |
| 4280 | 1 | B821001-1 | 2 | Primary | 101 : Classroom 101 | Yes | W1 | Wood | Medium Blue | Wood | 0.2 | Negative | Inner Door Frame Trim | 4SF |
| 4280 | 1 | B821001-1 | 2 | Storage | 101 : Classroom 101 | Yes | W4 | Metal | Medium Blue | Metal | 0.2 | Negative | Uni-vent | |
| 4280 | 1 | B821001-1 | 2 | Stairs | 101 : Classroom 101 | Yes | W2 | Metal | Tan | Metal | 0.2 | Negative | Riser | |
| 4280 | 1 | B821001-1 | 2 | Stairs | 100A : Storage Closet in Classroom 101 | Yes | W1 | Metal | Medium Blue | Metal | 0.2 | Negative | Door Frame | 4SF |
| 4280 | 1 | B821001-1 | 2 | Stairs | 100A : Storage Closet in Classroom 101 | Yes | W1 | Concrete | Light Green | Concrete | 0.2 | Negative | Columns | 15SF |
| 4280 | 1 | B821001-1 | 2 | Stairs | 7 : Building Engineer's Office | Yes | W2 | Concrete | Dark Green | Concrete | 0.2 | Negative | | |
| 4280 | 1 | B821001-1 | 2 | Stairs | 7 : Building Engineer's Office | Yes | Ceiling | Concrete | Light Gray | Concrete | 0.2 | Negative | | |
| 4280 | 1 | B821001-1 | 2 | Stairs | 7 : Building Engineer's Office | Yes | Ceiling | Concrete | Light Gray | Concrete | 0.2 | Negative | | |
| 4280 | 1 | B821001-1 | 2 | Circulation | 3 : Boiler Room | Yes | W2 | Concrete | Gray | Concrete | 0.2 | Negative | | |
| 4280 | 1 | B821001-1 | 2 | Circulation | 3 : Boiler Room | Yes | W4 | Concrete | Medium | Concrete | 0.2 | Negative | | |
| 4280 | 1 | B821001-1 | 2 | Circulation | 3 : Boiler Room | Yes | W4 | Concrete | Gray | Concrete | 0.2 | Negative | | |
| 4280 | 1 | B821001-1 | 2 | Circulation | Stairwell at Boiler Room | Yes | W1 | Metal | Brown | Metal | 0.2 | Negative | Post | |
| 4280 | 1 | B821001-1 | 2 | Circulation | 201 : Classroom 201 | Yes | W4 | Concrete | Light Green | Concrete | 0.2 | Negative | | |
| 4280 | 1 | B821001-1 | 2 | Circulation | 201 : Classroom 201 | Yes | W1 | Wood | Blue | Wood | 0.2 | Negative | Door | 8SF |
| 4280 | 1 | B821001-1 | 2 | Circulation | 201 : Classroom 201 | Yes | W1 | Wood | Light Blue | Wood | 0.2 | Negative | Door | 8SF |
| 4280 | 1 | B821001-1 | 1 | Stairs | 202 : Classroom 202 | Yes | W3 | Metal | Brown | Metal | 0.2 | Negative | Door Frame (Exit) | |
| 4280 | 1 | B821001-1 | 1 | Stairs | 202 : Classroom 202 | Yes | W1 | Metal | Brown | Metal | 0.2 | Negative | Door Frame | |
| 4280 | 1 | B821001-1 | 1 | Stairs | 202 : Classroom 202 | Yes | Ceiling | Concrete | White | Concrete | 0.2 | Negative | | |
| 4280 | 1 | B821001-1 | 1 | Stairs | 202 : Classroom 202 | Yes | W3 | Metal | Light Green | Metal | 0.2 | Negative | Radiator | 4SF |
| 4280 | 1 | B821001-1 | 1 | Stairs | 219 : Cafeteria | Yes | W2 | Metal | White | Metal | 0.2 | Negative | Radiator | 4SF |
| 4280 | 1 | B821001-1 | 1 | Stairs | 219 : Cafeteria | Yes | W1 | Wood | Red | Wood | 0.2 | Negative | Door Trim | 6SF |
| 4280 | 1 | B821001-1 | 1 | Primary | 203 : Classroom 203 | Yes | Ceiling | Concrete | Light Green | Concrete | 0.2 | Negative | | |
| 4280 | 1 | B821001-1 | 1 | Primary | 218 : Gymnasium | Yes | W3 | Metal | Blue | Metal | 0.2 | Negative | Door | 8SF |
| 4280 | 1 | B821001-1 | 1 | Primary | 218 : Gymnasium | Yes | W3 | Wood | Blue | Wood | 0.2 | Negative | Door | 8SF |
| 4280 | 1 | B821001-1 | 1 | Primary | 204 : Classroom 204 | Yes | Ceiling | Concrete | Tan | Concrete | 0.2 | Negative | | |
| 4280 | 1 | B821001-1 | 1 | Primary | 204 : Classroom 204 | Yes | W1 | Wood | Blue | Wood | 0.2 | Negative | Door | 8SF |
| 4280 | 1 | B821001-1 | 1 | Primary | 204 : Classroom 204 | Yes | W1 | Wood | Light Green | Wood | 0.2 | Negative | Closet Door | 8SF |
| 4280 | 1 | B821001-1 | 1 | Primary | 213 : Classroom 213 | Yes | Ceiling | Concrete | Tan | Concrete | 0.2 | Negative | | |
| 4280 | 1 | B821001-1 | 1 | Primary | 207 : Classroom 207 | Yes | W1 | Wood | Light Green | Wood | 0.2 | Negative | Chalkboard frame | 6Sf |

Lead Safe Certification for Samuel Gompers

| 117A : Principal's Office | | | | | Yes | Ceiling | Wood | White | Flaking | Wood | -0.5 | Negative | | | |
|---------------------------|---|-----------|---|---------------|---|---------|----------|------------|-------------|---------------|----------|----------|----------|-------------------|------|
| 117A : Principal's Office | | | | | Yes | W1 | Concrete | Light Blue | Flaking | Concrete | -0.5 | Negative | | | |
| ULCS# | E | BldgElmt | F | Space Type | 211 : Classroom 211 | Yes | W2 | Concrete | | Concrete | -0.5 | Negative | | | |
| 4280 | 1 | B821001-1 | 1 | Primary | 207 : Classroom 207 | Yes | W2 | Wood | Light Green | Chipping | Wood | 0.2 | Negative | Chalkboard frame | 6SF |
| 4280 | 1 | B821001-1 | 1 | Primary | 207 : Classroom 207 | Yes | W4 | Wood | Light Green | Chipping | Wood | 0.2 | Negative | Chalkboard frame | 6SF |
| 4280 | 1 | B821001-1 | 1 | Primary | 207 : Classroom 207 | Yes | W1 | Wood | Light Green | Chipping | Wood | 0.2 | Negative | Coat Rack | 4SF |
| 4280 | 1 | B821001-1 | 1 | Primary | 207 : Classroom 207 | Yes | W1 | Wood | Blue | Chipping | Wood | 0.2 | Negative | Chalkboard Tray | 6SF |
| 4280 | | | | | 207 : Classroom 207 | Yes | W4 | Wood | Blue | Chipping | Wood | 0.2 | Negative | Chalkboard Tray | 6SF |
| 4280 | 1 | B821001-1 | 1 | IMC (Library) | 211 : Classroom 211 | Yes | Ceiling | Concrete | White | Chipping | Concrete | 0.2 | Negative | | |
| 4280 | 1 | B821001-1 | 1 | IMC (Library) | 211A : Book Storage next to Classroom 212 | Yes | Ceiling | Concrete | White | Chipping | Concrete | 0.2 | Negative | | |
| 4280 | 1 | B821001-1 | 1 | IMC (Library) | 208 : Classroom 208 | Yes | W3 | Concrete | Light Blue | Flaking | Concrete | 0.2 | Negative | | |
| 4280 | 1 | B821001-1 | 1 | IMC (Library) | 208 : Classroom 208 | Yes | W1 | Metal | Blue | Chipping | Metal | 0.2 | Negative | Door Frame | 6SF |
| 4280 | 1 | B821001-1 | 1 | IMC (Library) | 210 : Classroom 210 | Yes | | Metal | Light Green | Chipping | Metal | 0.2 | Negative | Radiator | 10SF |
| 4280 | 1 | B821001-1 | 1 | IMC (Library) | 210 : Classroom 210 | Yes | Ceiling | Concrete | Tan | Flaking | Concrete | 0.2 | Negative | | |
| 4280 | 1 | B821001-1 | 1 | IMC (Library) | 209 : Music Classroom 209 | Yes | W2 | Wood | Light Green | Flaking | Wood | 0.2 | Negative | Chalkboard Tray | 6SF |
| 4280 | | | | | 209 : Music Classroom 209 | Yes | Ceiling | Concrete | Tan | Flaking | Concrete | 0.2 | Negative | | |
| 4280 | | | | | 209 : Music Classroom 209 | Yes | W2 | Wood | Blue | Flaking | Wood | 0.2 | Wood | Chalkboard Tray | 6SF |
| 4280 | | | | | 209 : Music Classroom 209 | Yes | W1 | Wood | Blue | Flaking | Wood | 0.2 | Wood | Door | 8SF |
| 4280 | | | | | 301C : Storage #3 in Classroom R-1 | Yes | Ceiling | Concrete | White | Flaking | Concrete | 0.2 | Negative | | |
| 4280 | | | | | 403 : Classroom R3 Girl's Restroom | Yes | W3 | Concrete | Tan | Flaking | Concrete | 0.2 | Negative | | |
| 4280 | | | | | S3 : Stairwell 3 next to Library | Yes | W3 | Metal | Blue | Flaking | Metal | 0.3 | Negative | Exit Door Frame | |
| 4280 | | | | | 108 : Library | Yes | W2 | Drywall | Light Gray | Intact | Drywall | 0.3 | Negative | | |
| 4280 | 1 | B821001-1 | 1 | Primary | 107 : Classroom 106 | Yes | Ceiling | Concrete | Tan | Chipping | Concrete | 0.3 | Negative | | |
| 4280 | 1 | B821001-1 | 1 | Primary | 107 : Classroom 105 | Yes | W1 | Wood | Blue | Flaking | Wood | 0.3 | Negative | | |
| 4280 | 1 | B821001-1 | 1 | Primary | 104 : Classroom 104 | Yes | W3 | Metal | Blue | Flaking | Metal | 0.3 | Negative | Radiator | |
| 4280 | 1 | B821001-1 | 1 | Primary | 104 : Classroom 104 | Yes | W1 | Wood | White | Flaking | Wood | 0.3 | Negative | Door Trim | |
| 4280 | 1 | B821001-1 | 1 | Primary | H13 : Hallway at Visitor's Entrance Foyer | Yes | W2 | Metal | BLue | Chipping | Metal | 0.3 | Negative | Door Frame | |
| 4280 | 1 | B821001-1 | 1 | Primary | 117E : Principal's Restroom | Yes | W1 | Metal | Light Green | Chipping | Metal | 0.3 | Negative | Door Frame | |
| 4280 | 1 | B821001-1 | 1 | Primary | 102 : Classroom 102 | Yes | W3 | Metal | Medium Blue | Chipping | Metal | 0.3 | Negative | Uni-vent | |
| 4280 | 1 | B821001-1 | 1 | Primary | 100A : Storage Closet in Classroom 101 | Yes | W1 | Wood | Medium Blue | Chipping | Wood | 0.3 | Negative | Door Trim | 4SF |
| 4280 | 1 | B821001-1 | 1 | Primary | 100A : Storage Closet in Classroom 101 | Yes | W1 | Wood | Medium Blue | Chipping | Wood | 0.3 | Negative | Door | 6SF |
| 4280 | 1 | B821001-1 | 1 | Primary | 100A : Storage Closet in Classroom 101 | Yes | W4 | Wood | Dark Blue | Chipping | Wood | 0.3 | Negative | Door Frame | 4SF |
| 4280 | | | | | 7 : Building Engineer's Office | Yes | W2 | Concrete | Light Green | Deteriorating | Concrete | 0.3 | Negative | | |
| 4280 | | | | | 3 : Boiler Room | No | W1 | Metal | Dark Green | Flaking | Metal | 0.3 | Negative | Door Frame | 6SF |
| 4280 | | | | | 3 : Boiler Room | Yes | W2 | Concrete | Gray | Flaking | Concrete | 0.3 | Negative | | |
| 4280 | | | | | Stairwell at Boiler Room | Yes | W1 | Metal | Red | Chipping | Metal | 0.3 | Negative | Door | 8SF |
| 4280 | | | | | 201 : Classroom 201 | Yes | W1 | Metal | Brown | Chipping | Metal | 0.3 | Negative | Closet Door Frame | 6SF |
| 4280 | | | | | 201 : Classroom 201 | Yes | W1 | Metal | Black | Chipping | Metal | 0.3 | Negative | Door Frame | 6SF |
| 4280 | | | | | 201 : Classroom 201 | Yes | W1 | Concrete | Light Green | Chipping | Concrete | 0.3 | Negative | | |
| 4280 | 1 | B821001-1 | 1 | Primary | 201 : Classroom 201 | Yes | Ceiling | Concrete | Tan | Flaking | Concrete | 0.3 | Negative | | |
| 4280 | 1 | B821001-1 | 1 | Primary | 202 : Classroom 202 | Yes | W1 | Metal | Brown | Chipping | Metal | 0.3 | Negative | Closet Door Frame | |
| 4280 | 1 | B821001-1 | 1 | Stairs | 219 : Cafeteria | Yes | W3 | Metal | Red | Chipping | Metal | 0.3 | Negative | Door Trim | 6SF |
| 4280 | 1 | B821001-1 | 1 | Stairs | 219 : Cafeteria | Yes | W4 | Metal | Blue | Chipping | Metal | 0.3 | Negative | Door | 8SF |
| 4280 | 1 | B821001-1 | 1 | Stairs | 218 : Gymnasium | Yes | W4 | Metal | Blue | Chipping | Metal | 0.3 | Negative | Door Frame | 10SF |
| 4280 | 1 | B821001-1 | 1 | Stairs | 207 : Classroom 207 | Yes | W1 | Metal | Light Green | Chipping | Metal | 0.3 | Negative | Door | 8SF |
| 4280 | 1 | B821001-1 | 1 | Stairs | 211 : Classroom 211 | Yes | W1 | Metal | Blue | Chipping | Metal | 0.3 | Negative | Door Frame | 6SF |
| 4280 | 1 | B821001-1 | 1 | Stairs | 210 : Classroom 210 | Yes | W3 | Concrete | Light Green | Chipping | Concrete | 0.3 | Negative | | |
| 4280 | 1 | B821001-1 | 1 | Stairs | 209 : Music Classroom 209 | Yes | W1 | Wood | Light Green | Flaking | Wood | 0.3 | Negative | Closet Door | 8SF |
| 4280 | 1 | B821001-1 | 1 | General | 209 : Music Classroom 209 | Yes | W3 | Metal | Blue | Flaking | Metal | 0.3 | Negative | Radiator | 10SF |
| 4280 | 1 | B821001-1 | 1 | General | S3 : Stairwell 3 next to Library | Yes | W3 | Metal | Blue | Flaking | Metal | 0.4 | Negative | Door | |
| 4280 | | | | | S3 : Stairwell 3 next to Library | Yes | W1 | Metal | Blue | Chipping | Metal | 0.4 | Negative | Door @209 | |
| 4280 | | | | | 108 : Library | Yes | Ceiling | Concrete | White | Intact | Concrete | 0.4 | Negative | | |
| 4280 | | | | | 105 : Classroom 105 | Yes | W1 | Metal | Blue | Chipping | Metal | 0.4 | Negative | Door Frame | |
| 4280 | | | | | 104 : Classroom 104 | Yes | W1 | Metal | Blue | Flaking | Metal | 0.4 | Negative | Door Frame | |

Lead Safe Certification for Samuel Gompers

| | | | | | 117A : Principal's Office | Yes | Ceiling | Wood | White | Flaking | Wood | -0.5 | Negative | | |
|-------|---|-----------|---|--------------------|---|-----|---------|----------|-------------|---------------|----------|------|----------|------------------|------|
| | | | | | 117A : Principal's Office | Yes | W1 | Concrete | Light Blue | Flaking | Concrete | -0.5 | Negative | | |
| ULCS# | E | BldgElmt | F | Space Type | | | | | | | | | | | |
| | | | | | 211 : Classroom 211 | Yes | W2 | Concrete | | Flaking | Concrete | -0.5 | Negative | | |
| 4280 | | | | | 114 : Auditorium | Yes | W3 | Metal | Red | Chipping | Metal | 0.4 | Door | | |
| 4280 | | | | | 103 : Classroom 103 | Yes | W1 | Wood | Brown | Chipping | Wood | 0.4 | Negative | Shelf Support | |
| 4280 | | | | | 103 : Classroom 103 | Yes | W2 | Wood | Brown | Chipping | Wood | 0.4 | Negative | Shelf | |
| 4280 | 1 | B821001-1 | 1 | General | 101 : Classroom 101 | Yes | W4 | Concrete | Tan | Deteriorating | Concrete | 0.4 | Negative | Columns | 15SF |
| 4280 | 1 | B821001-1 | 1 | General | Stairwell at Boiler Room | Yes | W1 | Metal | Blue | Chipping | Metal | 0.4 | Negative | Door | 8SF |
| 4280 | 1 | B821001-1 | 1 | General | 201 : Classroom 201 | Yes | W1 | Metal | Blue | Chipping | Metal | 0.4 | Negative | Door Frame | 6SF |
| 4280 | 1 | B821001-1 | 1 | General | 202 : Classroom 202 | Yes | W1 | Metal | Blue | Chipping | Metal | 0.4 | Negative | Door Frame | 6SF |
| 4280 | 1 | B821001-1 | 1 | General | 204 : Classroom 204 | Yes | W1 | Metal | Blue | Chipping | Metal | 0.4 | Negative | Door Frame | 6Sf |
| 4280 | 1 | B821001-1 | 1 | Principal/Director | 103 : Classroom 103 | Yes | W4 | Metal | Brown | Chipping | Metal | 0.5 | Negative | Drain Pipe | |
| 4280 | 1 | B821001-1 | 1 | Principal/Director | 103B : Back Storage to the Right in Classroom 103 | Yes | W1 | Metal | Tan | Chipping | Metal | 0.5 | Negative | Door Frame | |
| 4280 | 1 | B821001-1 | 1 | Principal/Director | 100A : Storage Closet in Classroom 101 | Yes | W1 | Metal | Medium Blue | Chipping | Metal | 0.5 | Negative | Door Frame | 4SF |
| 4280 | 1 | B821001-1 | 1 | Principal/Director | 100A : Storage Closet in Classroom 101 | Yes | W2 | Wood | Light Green | Chipping | Wood | 0.5 | Negative | Shelf | 6SF |
| 4280 | 1 | B821001-1 | 1 | Principal/Director | 3 : Boiler Room | Yes | W4 | Metal | Gray | Flaking | Metal | 0.5 | Negative | Railing | |
| 4280 | 1 | B821001-1 | 1 | Principal/Director | 3 : Boiler Room | Yes | W1 | Concrete | Gray | Flaking | Concrete | 0.5 | Negative | | |
| 4280 | 1 | B821001-1 | 1 | Principal/Director | 208 : Classroom 208 | Yes | W3 | Metal | Light Green | Chipping | Metal | 0.5 | Negative | Radiator | 4SF |
| 4280 | 1 | B821001-1 | 1 | Principal/Director | 7 : Building Engineer's Office | Yes | W2 | Metal | Tan | Flaking | Metal | 0.6 | Negative | Pipe | |
| 4280 | 1 | B821001-1 | 1 | Principal/Director | 1 : Left Side Boiler Storage | Yes | W1 | Metal | Dark Green | Flaking | Metal | 0.6 | Negative | Door Frame | 6SF |
| 4280 | 1 | B821001-1 | 1 | Principal/Director | 3 : Boiler Room | Yes | W4 | Metal | Dark Green | Flaking | Metal | 1 | Positive | Railing (steps) | 15SF |
| 4280 | 1 | B821001-1 | 1 | Principal/Director | 3 : Boiler Room | No | W2 | Metal | Dark Green | Flaking | Metal | 1.2 | Positive | Railing | 15SF |
| 4280 | 1 | B821001-1 | 1 | Primary | 3 : Boiler Room | No | W1 | Metal | Light Blue | Flaking | Metal | 2 | Positive | Hall Door | 8SF |
| 4280 | 1 | B821001-1 | 1 | Primary | 3 : Boiler Room | No | W1 | metal | Blue | Chipping | Metal | 2.4 | Positive | Exit Door @ Hall | 8SF |
| 4280 | 1 | B821001-1 | 1 | Primary | 3 : Boiler Room | No | W1 | Metal | Light Blue | Intact | Metal | 2.7 | Positive | Door | 2SF |
| 4280 | 1 | B821001-1 | 1 | Primary | 3 : Boiler Room | No | W3 | Metal | Gray | Flaking | Metal | 3.8 | Positive | Door | 8SF |
| 4280 | 1 | B821001-1 | 1 | Primary | 127 : Library Office | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | |
| 4280 | 1 | B821001-1 | 1 | Primary | 127 : Library Office | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | |
| 4280 | 1 | B821001-1 | 1 | Circulation | 127 : Library Office | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | |
| 4280 | 1 | B821001-1 | 1 | Circulation | 127 : Library Office | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | |
| 4280 | 1 | B821001-1 | 1 | Circulation | 127 : Library Office | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | |
| 4280 | 1 | B821001-1 | 1 | Circulation | 127 : Library Office | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | |
| 4280 | 1 | B821001-1 | 1 | Circulation | 127 : Library Office | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | |
| 4280 | | | | | JC1 : Custodial Closet to Left of Classroom 106 | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | |
| 4280 | | | | | JC1 : Custodial Closet to Left of Classroom 106 | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | |
| 4280 | | | | | JC1 : Custodial Closet to Left of Classroom 106 | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | |
| 4280 | | | | | 105A : Book Storage Closet Next to Room 106 | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | |
| 4280 | | | | | 105A : Book Storage Closet Next to Room 106 | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | |
| 4280 | | | | | 105A : Book Storage Closet Next to Room 106 | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | |
| 4280 | | | | | 105A : Book Storage Closet Next to Room 106 | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | |
| 4280 | 1 | B821001-1 | 1 | Circulation | 105A : Book Storage Closet Next to Room 106 | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | |
| 4280 | 1 | B821001-1 | 1 | Circulation | 104A : Electrical Room across from Classroom 104 | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | |
| 4280 | 1 | B821001-1 | 1 | Circulation | 104A : Electrical Room across from Classroom 104 | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | |
| 4280 | 1 | B821001-1 | 1 | Stairs | 104A : Electrical Room across from Classroom 104 | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | |
| 4280 | 1 | B821001-1 | 1 | Stairs | 104A : Electrical Room across from Classroom 104 | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | |
| 4280 | 1 | B821001-1 | 1 | Stairs | H11 : Hallway between Classroom 104 and Library | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | |
| 4280 | 1 | B821001-1 | 1 | Stairs | H11 : Hallway between Classroom 104 and Library | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | |
| 4280 | 1 | B821001-1 | 1 | Stairs | H11 : Hallway between Classroom 104 and Library | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | |
| 4280 | | | | | H11 : Hallway between Classroom 104 and Library | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | |
| 4280 | | | | | H11 : Hallway between Classroom 104 and Library | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | |
| 4280 | | | | | H11 : Hallway between Classroom 104 and Library | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | |
| 4280 | | | | | H11 : Hallway between Classroom 104 and Library | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | |
| 4280 | | | | | 104 : Classroom 104 | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | |
| 4280 | | | | | 111 : Girl's Restroom Across from Classroom 104 | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | |
| 4280 | | | | | 111 : Girl's Restroom Across from Classroom 104 | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | |
| 4280 | | | | | 111 : Girl's Restroom Across from Classroom 104 | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | |

Lead Safe Certification for Samuel Gompers

[illegible]

Lead Safe Certification for Samuel Gompers

| | | | | | 117A : Principal's Office | Yes | Ceiling | Wood | White | Flaking | Wood | -0.5 | Negative | |
|-------|---|-----------|---|----------------|--|-----|---------|----------|------------|---------|----------|------|----------|-----|
| | | | | | 117A : Principal's Office | Yes | W1 | Concrete | Light Blue | Flaking | Concrete | -0.5 | Negative | |
| ULCS# | E | BldgElmt | F | Space Type | 211 : Classroom 211 | Yes | W2 | Concrete | | Flaking | Concrete | -0.5 | Negative | |
| 4280 | 1 | B821001-1 | 1 | Storage | 118 : Office to Right of Main Office | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | 1 | B821001-1 | 1 | Storage | 118 : Office to Right of Main Office | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | 1 | B821001-1 | 1 | Storage | 119 : Office to Left of Copy Room on 1st Floor | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | 1 | B821001-1 | 1 | Stairs | 121 : Copy Room near Main Office | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | 1 | B821001-1 | 1 | Stairs | 121 : Copy Room near Main Office | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | 1 | B821001-1 | 1 | Stairs | 121 : Copy Room near Main Office | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | 1 | B821001-1 | 1 | Stairs | 121 : Copy Room near Main Office | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | 1 | B821001-1 | 1 | Stairs | 121 : Copy Room near Main Office | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | 1 | B821001-1 | 1 | Stairs | 121 : Copy Room near Main Office | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | 1 | B821001-1 | 1 | Stairs | 118A : Storage near Main Office Copy Room | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | 1 | B821001-1 | 1 | Stairs | 118A : Storage near Main Office Copy Room | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | 1 | B821001-1 | 1 | Stairs | 118A : Storage near Main Office Copy Room | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | 1 | B821001-1 | 1 | Primary | 122 : Nurse's Office | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | 1 | B821001-1 | 1 | Primary | 122 : Nurse's Office | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | 1 | B821001-1 | 1 | Primary | 122 : Nurse's Office | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | 1 | B821001-1 | 1 | Primary | 122 : Nurse's Office | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | 1 | B821001-1 | 1 | Primary | 122 : Nurse's Office | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | 1 | B821001-1 | 1 | Primary | H12A : Closet in Main Visitor Entrance Hallway | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | 1 | B821001-1 | 1 | Administrative | H12A : Closet in Main Visitor Entrance Hallway | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | 1 | B821001-1 | 1 | Administrative | H12A : Closet in Main Visitor Entrance Hallway | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | 1 | B821001-1 | 1 | Administrative | H12A : Closet in Main Visitor Entrance Hallway | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | 1 | B821001-1 | 1 | Administrative | H12A : Closet in Main Visitor Entrance Hallway | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | 1 | B821001-1 | 1 | Administrative | H12A : Closet in Main Visitor Entrance Hallway | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | 1 | B821001-1 | 1 | Administrative | H12B : Custodial Closet next to Main Office | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | 1 | B821001-1 | 1 | Administrative | H12B : Custodial Closet next to Main Office | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | 1 | B821001-1 | 1 | Health Service | H12B : Custodial Closet next to Main Office | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | 1 | B821001-1 | 1 | Health Service | S11 : Stairwell near Auditorium | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | 1 | B821001-1 | 1 | Health Service | S11 : Stairwell near Auditorium | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | 1 | B821001-1 | 1 | Health Service | S11 : Stairwell near Auditorium | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | 1 | B821001-1 | 1 | Health Service | S11 : Stairwell near Auditorium | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | 1 | B821001-1 | 1 | Health Service | 112 : Classroom A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | 1 | B821001-1 | 1 | Health Service | 112 : Classroom A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | 1 | B821001-1 | 1 | Health Service | 112 : Classroom A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | 1 | B821001-1 | 1 | Health Service | 112A : Classroom A Restroom | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | 1 | B821001-1 | 1 | Health Service | 112A : Classroom A Restroom | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | 1 | B821001-1 | 1 | Health Service | 112A : Classroom A Restroom | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | 1 | B821001-1 | 1 | Health Service | 113 : Classroom B | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | 1 | B821001-1 | 1 | Health Service | 113 : Classroom B | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | 1 | B821001-1 | 1 | Health Service | 113 : Classroom B | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | 1 | B821001-1 | 1 | Health Service | 113 : Classroom B | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | 1 | B821001-1 | 1 | Health Service | 113A : Classroom B Restroom | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | 1 | B821001-1 | 1 | Administrative | 113A : Classroom B Restroom | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | 1 | B821001-1 | 1 | Administrative | 113A : Classroom B Restroom | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | 1 | B821001-1 | 1 | Administrative | 113C : Storage Room to Left of Classroom B | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | 1 | B821001-1 | 1 | Administrative | 113C : Storage Room to Left of Classroom B | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | 1 | B821001-1 | 1 | Administrative | 113C : Storage Room to Left of Classroom B | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | 1 | B821001-1 | 1 | Administrative | 123C : Custodial Closet next to Nurse's Office | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | 1 | B821001-1 | 1 | Auditorium | 123C : Custodial Closet next to Nurse's Office | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | 1 | B821001-1 | 1 | Auditorium | 123C : Custodial Closet next to Nurse's Office | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | 1 | B821001-1 | 1 | Auditorium | 123C : Custodial Closet next to Nurse's Office | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | 1 | B821001-1 | 1 | Auditorium | 103D : Storage to Left of Classroom 103 | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | 1 | B821001-1 | 1 | Auditorium | 103D : Storage to Left of Classroom 103 | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | 1 | B821001-1 | 1 | Auditorium | 103D : Storage to Left of Classroom 103 | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |

Lead Safe Certification for Samuel Gompers

| | | | | | 117A : Principal's Office | Yes | Ceiling | Wood | White | Flaking | Wood | -0.5 | Negative | |
|-------|---|-----------|----|-------------|---|-----|---------|----------|------------|---------|----------|------|----------|-----|
| | | | | | 117A : Principal's Office | Yes | W1 | Concrete | Light Blue | Flaking | Concrete | -0.5 | Negative | |
| ULCS# | E | BldgElmt | F | Space Type | 211 : Classroom 211 | Yes | W2 | Concrete | | Flaking | Concrete | -0.5 | Negative | |
| 4280 | 1 | B821001-1 | 1 | Auditorium | 103D : Storage to Left of Classroom 103 | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | 1 | B821001-1 | 1 | Auditorium | 124A : Staff Restroom in Staff Lounge | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | 1 | B821001-1 | 1 | Auditorium | 124A : Staff Restroom in Staff Lounge | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | 1 | B821001-1 | 1 | Auditorium | 124A : Staff Restroom in Staff Lounge | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | 1 | B821001-1 | 1 | Auditorium | 124B : Storage in Staff Lounge | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | 1 | B821001-1 | 1 | Auditorium | 124B : Storage in Staff Lounge | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | 1 | B821001-1 | 1 | Auditorium | 124B : Storage in Staff Lounge | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | 1 | B821001-1 | 1 | Auditorium | 121 : Nurse's Office Storage | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | 1 | B821001-1 | 1 | Circulation | 121 : Nurse's Office Storage | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | 1 | B821001-1 | 1 | Circulation | 121 : Nurse's Office Storage | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | 1 | B821001-1 | 1 | Circulation | 121 : Nurse's Office Storage | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | 1 | B821001-1 | 1 | Circulation | 121 : Nurse's Office Storage | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | | | | | 121 : Nurse's Office Storage | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | | | | | 121A : Nurse's Storage Area Restroom | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | | | | | 121A : Nurse's Storage Area Restroom | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | | | | | 121A : Nurse's Storage Area Restroom | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | | | | | 4B : Radiator Room outside of Classroom 103 | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | | | | | 4B : Radiator Room outside of Classroom 103 | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | | | | | 4B : Radiator Room outside of Classroom 103 | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | 1 | B821001-1 | 1 | Circulation | 4B : Radiator Room outside of Classroom 103 | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | 1 | B821001-1 | 1 | Circulation | 4B : Radiator Room outside of Classroom 103 | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | 1 | B821001-1 | 1 | Circulation | 4A : Radiator Room to Right of Classroom C | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | 1 | B821001-1 | 1 | Circulation | 4A : Radiator Room to Right of Classroom C | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | 1 | B821001-1 | BS | Mechanical | 4A : Radiator Room to Right of Classroom C | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | 1 | B821001-1 | BS | Mechanical | 4A : Radiator Room to Right of Classroom C | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | 1 | B821001-1 | BS | Mechanical | 4A : Radiator Room to Right of Classroom C | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | 1 | B821001-1 | BS | Mechanical | 4 : Classroom C | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | 1 | B821001-1 | BS | Mechanical | 4 : Classroom C | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | 1 | B821001-1 | BS | Mechanical | 4 : Classroom C | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | 1 | B821001-1 | BS | Storage | 4 : Classroom C | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | 1 | B821001-1 | BS | Storage | 4 : Classroom C | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | 1 | B821001-1 | BS | Storage | 100 : Classroom 100 | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | 1 | B821001-1 | BS | Storage | 100 : Classroom 100 | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | 1 | B821001-1 | BS | Storage | 100 : Classroom 100 | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | 1 | B821001-1 | BS | Storage | 100 : Classroom 100 | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | 1 | B821001-1 | BS | Boiler Room | 100 : Classroom 100 | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | 1 | B821001-1 | BS | Boiler Room | 100 : Classroom 100 | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | 1 | B821001-1 | BS | Boiler Room | 100 : Classroom 100 | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | 1 | B821001-1 | BS | Boiler Room | 100 : Classroom 100 | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | 1 | B821001-1 | BS | Boiler Room | 100B : Storage Closet in Classroom 101 | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | 1 | B821001-1 | BS | Boiler Room | 100B : Storage Closet in Classroom 101 | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | 1 | B821001-1 | BS | Boiler Room | 100B : Storage Closet in Classroom 101 | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | 1 | B821001-1 | BS | Boiler Room | 7B : Building Engineer's Restroom | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | 1 | B821001-1 | BS | Mechanical | 6 : Staff Maintenance Lounge | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | 1 | B821001-1 | BS | Mechanical | 6 : Staff Maintenance Lounge | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | 1 | B821001-1 | BS | Mechanical | 6 : Staff Maintenance Lounge | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | 1 | B821001-1 | BS | Mechanical | 6 : Staff Maintenance Lounge | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | 1 | B821001-1 | BS | Mechanical | 6 : Staff Maintenance Lounge | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | 1 | B821001-1 | BS | Mechanical | 006A : Staff Maintenance Lounge Restroom | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | 1 | B821001-1 | BS | Mechanical | 006A : Staff Maintenance Lounge Restroom | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | 1 | B821001-1 | BS | Mechanical | 006A : Staff Maintenance Lounge Restroom | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |

Lead Safe Certification for Samuel Gompers

[illegible]

Lead Safe Certification for Samuel Gompers

| 117A : Principal's Office | | | | | Yes | Ceiling | Wood | White | Flaking | Wood | -0.5 | Negative | | | |
|---------------------------|---|-----------|----|------------|--|---------|----------|------------|---------|----------|----------|----------|----------|-----|--|
| 117A : Principal's Office | | | | | Yes | W1 | Concrete | Light Blue | Flaking | Concrete | -0.5 | Negative | | | |
| ULCS# | E | BldgElmt | F | Space Type | 211 : Classroom 211 | Yes | W2 | Concrete | | Flaking | Concrete | -0.5 | Negative | | |
| 4280 | | | | | 218C : Display Case Storage next to Custodial Closet at Cafe | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | |
| 4280 | | | | | 218C : Display Case Storage next to Custodial Closet at Cafe | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | |
| 4280 | | | | | 218C : Display Case Storage next to Custodial Closet at Cafe | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | |
| 4280 | | | | | 218C : Display Case Storage next to Custodial Closet at Cafe | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | |
| 4280 | 1 | B821001-1 | BS | Primary | 218C : Display Case Storage next to Custodial Closet at Cafe | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | |
| 4280 | 1 | B821001-1 | BS | Primary | 218D : Custodial Closet between Stairwell 1 and Cafeteria | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | |
| 4280 | 1 | B821001-1 | BS | Primary | 218D : Custodial Closet between Stairwell 1 and Cafeteria | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | |
| 4280 | 1 | B821001-1 | BS | Primary | 218D : Custodial Closet between Stairwell 1 and Cafeteria | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | |
| 4280 | 1 | B821001-1 | BS | Primary | 218E : Storage to Right of Gym Entrance | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | |
| 4280 | 1 | B821001-1 | BS | Primary | 218E : Storage to Right of Gym Entrance | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | |
| 4280 | 1 | B821001-1 | BS | Primary | 218E : Storage to Right of Gym Entrance | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | |
| 4280 | 1 | B821001-1 | BS | Primary | 218F : Math Book Storage Closet next to Gymnasium | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | |
| 4280 | 1 | B821001-1 | BS | Equipment | 218F : Math Book Storage Closet next to Gymnasium | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | |
| 4280 | 1 | B821001-1 | BS | Equipment | 218F : Math Book Storage Closet next to Gymnasium | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | |
| 4280 | 1 | B821001-1 | BS | Equipment | 8G : Storage at Front of Gym next to Math Storage Clo | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | |
| 4280 | 1 | B821001-1 | BS | Equipment | 8G : Storage at Front of Gym next to Math Storage Clo | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | |
| 4280 | 1 | B821001-1 | BS | Equipment | 8G : Storage at Front of Gym next to Math Storage Clo | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | |
| 4280 | 1 | B821001-1 | BS | Equipment | 8G : Storage at Front of Gym next to Math Storage Clo | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | |
| 4280 | 1 | B821001-1 | BS | Stairs | 8G : Storage at Front of Gym next to Math Storage Clo | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | |
| 4280 | | | | | 225 : Gym Office | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | |
| 4280 | | | | | 225 : Gym Office | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | |
| 4280 | 1 | B821001-1 | BS | Stairs | 225 : Gym Office | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | |
| 4280 | | | | | 224 : Storage behind Gym Office | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | |
| 4280 | | | | | 223 : Large Open Storage Area outside Girl's Restroom in G | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | |
| 4280 | | | | | 223 : Large Open Storage Area outside Girl's Restroom in G | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | |
| 4280 | 1 | B821001-1 | BS | Stairs | 223 : Large Open Storage Area outside Girl's Restroom in G | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | |
| 4280 | 1 | B821001-1 | BS | Stairs | 223A : Girl's Restrooms Stall Area | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | |
| 4280 | 1 | B821001-1 | BS | Stairs | 223A : Girl's Restrooms Stall Area | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | |
| 4280 | 1 | B821001-1 | BS | Stairs | 223A : Girl's Restrooms Stall Area | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | |
| 4280 | 1 | B821001-1 | BS | Stairs | 223B : Storage in Girl's Restroom to Left of Stalls | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | |
| 4280 | 1 | B821001-1 | BS | Student | 223B : Storage in Girl's Restroom to Left of Stalls | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | |
| 4280 | 1 | B821001-1 | BS | Student | 223B : Storage in Girl's Restroom to Left of Stalls | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | |
| 4280 | 1 | B821001-1 | BS | Student | 223B : Storage in Girl's Restroom to Left of Stalls | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | |
| 4280 | 1 | B821001-1 | BS | Student | 223B : Storage in Girl's Restroom to Left of Stalls | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | |
| 4280 | 1 | B821001-1 | BS | Student | 223B : Storage in Girl's Restroom to Left of Stalls | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | |
| 4280 | 1 | B821001-1 | BS | Student | 223B : Storage in Girl's Restroom to Left of Stalls | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | |
| 4280 | 1 | B821001-1 | BS | Student | 223B : Storage in Girl's Restroom to Left of Stalls | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | |
| 4280 | 1 | B821001-1 | BS | Student | 223B : Storage in Girl's Restroom to Left of Stalls | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | |
| 4280 | 1 | B821001-1 | BS | Student | 223B : Storage in Girl's Restroom to Left of Stalls | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | |
| 4280 | 1 | B821001-1 | BS | Student | 223B : Storage in Girl's Restroom to Left of Stalls | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | |
| 4280 | 1 | B821001-1 | BS | Student | 223B : Storage in Girl's Restroom to Left of Stalls | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | |
| 4280 | 1 | B821001-1 | BS | Student | 223B : Storage in Girl's Restroom to Left of Stalls | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | |
| 4280 | 1 | B821001-1 | BS | Student | 223B : Storage in Girl's Restroom to Left of Stalls | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | |
| 4280 | 1 | B821001-1 | BS | Student | 223B : Storage in Girl's Restroom to Left of Stalls | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | |
| 4280 | 1 | B821001-1 | BS | Student | 223B : Storage in Girl's Restroom to Left of Stalls | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | |
| 4280 | 1 | B821001-1 | BS | Student | 223B : Storage in Girl's Restroom to Left of Stalls | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | |
| 4280 | 1 | B821001-1 | BS | Student | 223B : Storage in Girl's Restroom to Left of Stalls | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | |
| 4280 | 1 | B821001-1 | BS | Student | 223B : Storage in Girl's Restroom to Left of Stalls | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | |
| 4280 | 1 | B821001-1 | BS | Student | 223B : Storage in Girl's Restroom to Left of Stalls | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | |
| 4280 | 1 | B821001-1 | BS | Student | 223B : Storage in Girl's Restroom to Left of Stalls | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | |
| 4280 | 1 | B821001-1 | BS | Student | 223B : Storage in Girl's Restroom to Left of Stalls | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | |
| 4280 | 1 | B821001-1 | BS | Student | 223B : Storage in Girl's Restroom to Left of Stalls | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | |
| 4280 | 1 | B821001-1 | BS | Student | 223B : Storage in Girl's Restroom to Left of Stalls | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | |
| 4280 | 1 | B821001-1 | BS | Student | 223B : Storage in Girl's Restroom to Left of Stalls | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | |
| 4280 | 1 | B821001-1 | BS | Student | 223B : Storage in Girl's Restroom to Left of Stalls | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | |
| 4280 | 1 | B821001-1 | BS | Student | 223B : Storage in Girl's Restroom to Left of Stalls | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | |
| 4280 | 1 | B821001-1 | BS | Student | 223B : Storage in Girl's Restroom to Left of Stalls | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | |
| 4280 | 1 | B821001-1 | BS | Student | 223B : Storage in Girl's Restroom to Left of Stalls | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | |
| 4280 | 1 | B821001-1 | BS | Student | 223B : Storage in Girl's Restroom to Left of Stalls | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | |
| 4280 | 1 | B821001-1 | BS | Student | 223B : Storage in Girl's Restroom to Left of Stalls | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | |
| 4280 | 1 | B821001-1 | BS | Student | 223B : Storage in Girl's Restroom to Left of Stalls | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | |
| 4280 | 1 | B821001-1 | BS | Student | 223B : Storage in Girl's Restroom to Left of Stalls | N/A | N/A | N/A | N/A | N/A | N/A | N/A | | | |

Lead Safe Certification for Samuel Gompers

| | | | | | 117A : Principal's Office | Yes | Ceiling | Wood | White | Flaking | Wood | -0.5 | Negative | |
|-------|---|-----------|----|-------------------|---|-----|---------|----------|------------|---------|----------|------|----------|-----|
| | | | | | 117A : Principal's Office | Yes | W1 | Concrete | Light Blue | Flaking | Concrete | -0.5 | Negative | |
| ULCS# | E | BldgElmt | F | Space Type | 211 : Classroom 211 | Yes | W2 | Concrete | | Flaking | Concrete | -0.5 | Negative | |
| 4280 | 1 | B821001-1 | BS | Gymnasium - | 216C : Storage Closet in Staff Lounge | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | 1 | B821001-1 | BS | Gymnasium - | 216A : Staff Restroom in Staff Lounge | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | 1 | B821001-1 | BS | Gymnasium - | 216A : Staff Restroom in Staff Lounge | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | 1 | B821001-1 | BS | Gymnasium - | 216A : Staff Restroom in Staff Lounge | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | 1 | B821001-1 | BS | Gymnasium - | 216A : Staff Restroom in Staff Lounge | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | | | | | 216B : Electrical Closet in Staff Lounge | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | | | | | 216B : Electrical Closet in Staff Lounge | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | | | | | 216B : Electrical Closet in Staff Lounge | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | | | | | S1 : Stairwell Next to Gym/Exit to Parking Lot | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | | | | | S1 : Stairwell Next to Gym/Exit to Parking Lot | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | | | | | S1 : Stairwell Next to Gym/Exit to Parking Lot | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | | | | | S1 : Stairwell Next to Gym/Exit to Parking Lot | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | 1 | B821001-1 | BS | Administrative | H21 : Hallway between Classroom 201 and 210 | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | | | | | H21 : Hallway between Classroom 201 and 210 | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | | | | | H21 : Hallway between Classroom 201 and 210 | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | | | | | H21 : Hallway between Classroom 201 and 210 | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | | | | | H21 : Hallway between Classroom 201 and 210 | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | 1 | B821001-1 | BS | Administrative | 26 : Entrance Lobby next to Parking Lot and Gymnasium | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | 1 | B821001-1 | BS | Administrative | 26 : Entrance Lobby next to Parking Lot and Gymnasium | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | 1 | B821001-1 | BS | Administrative | 26 : Entrance Lobby next to Parking Lot and Gymnasium | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | 1 | B821001-1 | BS | Administrative | 26 : Entrance Lobby next to Parking Lot and Gymnasium | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | 1 | B821001-1 | BS | Administrative | 26 : Entrance Lobby next to Parking Lot and Gymnasium | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | 1 | B821001-1 | BS | Cafeteria (Dining | 214 : Boy's Restroom to Right of Gym | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | | | | | 214 : Boy's Restroom to Right of Gym | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | | | | | 214 : Boy's Restroom to Right of Gym | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | | | | | 214A : Custodial Closet in between Boy's and Girl's Restroom ne | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | | | | | 214A : Custodial Closet in between Boy's and Girl's Restroom ne | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | | | | | 214A : Custodial Closet in between Boy's and Girl's Restroom ne | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | | | | | 215 : Girl's Restroom to Right of Gym | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | 1 | B821001-1 | BS | Cafeteria (Dining | 215 : Girl's Restroom to Right of Gym | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | 1 | B821001-1 | BS | Cafeteria (Dining | 215 : Girl's Restroom to Right of Gym | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | 1 | B821001-1 | BS | Cafeteria (Dining | 211A : Book Storage next to Classroom 212 | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | 1 | B821001-1 | BS | Cafeteria (Dining | 211A : Book Storage next to Classroom 212 | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | 1 | B821001-1 | BS | Cafeteria (Dining | 211A : Book Storage next to Classroom 212 | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | 1 | B821001-1 | BS | Cafeteria (Dining | 211A : Book Storage next to Classroom 212 | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | | | | | 206 : Classroom 206 | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | | | | | 206 : Classroom 206 | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | | | | | 206 : Classroom 206 | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | | | | | 206 : Classroom 206 | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | | | | | 206 : Classroom 206 | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | 1 | B821001-1 | BS | Cafeteria (Dining | 205 : Classroom 205 | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | 1 | B821001-1 | BS | Cafeteria (Dining | 205 : Classroom 205 | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | 1 | B821001-1 | BS | Kitchen and Dry | 205 : Classroom 205 | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | 1 | B821001-1 | BS | Kitchen and Dry | 205 : Classroom 205 | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | 1 | B821001-1 | BS | Kitchen and Dry | 205 : Classroom 205 | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | 1 | B821001-1 | BS | Kitchen and Dry | 205 : Classroom 205 | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | | | | | 206A : Science Materials Storage next to Classroom 207 | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | | | | | 206A : Science Materials Storage next to Classroom 207 | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | | | | | 206A : Science Materials Storage next to Classroom 207 | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |

Lead Safe Certification for Samuel Gompers

| 117A : Principal's Office | | | | | | Yes | Ceiling | Wood | White | Flaking | Wood | -0.5 | Negative | |
|---------------------------|---|-----------|----|-----------------|---|-----|---------|----------|------------|---------|----------|------|----------|-----|
| 117A : Principal's Office | | | | | | Yes | W1 | Concrete | Light Blue | Flaking | Concrete | -0.5 | Negative | |
| ULCS# | E | BldgElmt | F | Space Type | 211 : Classroom 211 | Yes | W2 | Concrete | | Flaking | Concrete | -0.5 | Negative | |
| 4280 | | | | | 206A : Science Materials Storage next to Classroom 207 | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | 1 | B821001-1 | BS | Kitchen and Dry | S3 : Stairwell next to Classroom 209 | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | 1 | B821001-1 | BS | Kitchen and Dry | S3 : Stairwell next to Classroom 209 | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | 1 | B821001-1 | BS | Kitchen | S3 : Stairwell next to Classroom 209 | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | 1 | B821001-1 | BS | Kitchen | S3 : Stairwell next to Classroom 209 | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | 1 | B821001-1 | BS | Kitchen | S3 : Stairwell next to Classroom 209 | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | 1 | B821001-1 | BS | Kitchen | S3 : Stairwell next to Classroom 209 | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | 1 | B821001-1 | BS | Kitchen | 206B : Custodial Closet next to Classroom 207 | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | 1 | B821001-1 | BS | Circulation | 206B : Custodial Closet next to Classroom 207 | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | 1 | B821001-1 | BS | Circulation | 206B : Custodial Closet next to Classroom 207 | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | 1 | B821001-1 | BS | Circulation | 206B : Custodial Closet next to Classroom 207 | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | 1 | B821001-1 | BS | Circulation | S22 : Stairwell next to Classroom 201 | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | 1 | B821001-1 | BS | Circulation | S22 : Stairwell next to Classroom 201 | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | 1 | B821001-1 | BS | Circulation | S22 : Stairwell next to Classroom 201 | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | | | | | S22 : Stairwell next to Classroom 201 | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | | | | | S22 : Stairwell next to Classroom 201 | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | | | | | 214B : Storage to Right of 2nd Floor Boy's Restroom | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | | | | | 214B : Storage to Right of 2nd Floor Boy's Restroom | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | | | | | 214B : Storage to Right of 2nd Floor Boy's Restroom | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | | | | | 218H : Gym Equipment Storage near Entrance at Parking Lot | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | | | | | 218H : Gym Equipment Storage near Entrance at Parking Lot | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | | | | | 218H : Gym Equipment Storage near Entrance at Parking Lot | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | | | | | 201 : Classroom 1 (R4) | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | | | | | 201 : Classroom 1 (R4) | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | | | | | 201 : Classroom 1 (R4) | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | | | | | 201 : Classroom 1 (R4) | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | | | | | 201 : Classroom 1 (R4) | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | | | | | 211 : Classroom 1 (R4) Boy's Restroom | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | | | | | 211 : Classroom 1 (R4) Boy's Restroom | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | | | | | 211 : Classroom 1 (R4) Boy's Restroom | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | | | | | 210 : Classroom 1(R4) Girl's Restroom | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | | | | | 210 : Classroom 1(R4) Girl's Restroom | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | | | | | 210 : Classroom 1(R4) Girl's Restroom | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | | | | | 204 : Classroom 1 (R4) Server Room | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | | | | | 204 : Classroom 1 (R4) Server Room | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | | | | | 204 : Classroom 1 (R4) Server Room | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | | | | | 205 : Classroom 1 (R4) Storage Closet | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | | | | | 205 : Classroom 1 (R4) Storage Closet | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | | | | | 205 : Classroom 1 (R4) Storage Closet | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | | | | | 205 : Classroom 1 (R4) Storage Closet | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | | | | | 205 : Classroom 1 (R4) Storage Closet | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | | | | | 202 : Classroom 2 (R5) | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | | | | | 202 : Classroom 2 (R5) | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | | | | | 202 : Classroom 2 (R5) | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | | | | | 202 : Classroom 2 (R5) | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | | | | | 202 : Classroom 2 (R5) | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | | | | | 208 : Classroom 2 (R5) Boy's Restroom | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | | | | | 208 : Classroom 2 (R5) Boy's Restroom | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | | | | | 208 : Classroom 2 (R5) Boy's Restroom | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |
| 4280 | | | | | 207 : Classroom 2 (R5) Girl's Restroom | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A | N/A |

Lead Safe Certification for Samuel Gompers

[illegible]



Appendix B: Samuel Gompers ES - EPA Checklist

[illegible]

[illegible]



Appendix C. Oversight Table

| Task ID | ULCS# | Element | BldgElm t ID | Floor | Space # (on Floor Plan) | Space Type | On Site Room Name | Primary Component | Work Area Prepped (date) | Surfaces Stabilized (date) | Final Inspection Approval and Photos (date) | Square Footage of Work Area | Number of Required RRP Wipes | Number of AAS Wipes Used to Pass | Final Wipe Submitted for AAS Analysis (yes/no) | AAS Analysis Results | Comments from Assessment |
|---------|-------|---------|--------------|-------|-------------------------|---------------|--|-------------------|--------------------------|----------------------------|---|-----------------------------|------------------------------|----------------------------------|--|----------------------|--------------------------|
| | 4280 | 1 | B821001 | 1 | | General | 006A : Staff Maintenance Lounge | All | 11/6/2020 | 11/10/2020 | 11/10/2020 | 200 | 5 | 0 | no | N/A | |
| | 4280 | 1 | B821001 | 1 | | Storage | 1 : Left Side Boiler Storage | | | | | | | | | | |
| | 4280 | 1 | B821001 | 1 | | Primary | 100 : Classroom 100 | All | 7/10/20 | 7/10/20 | 8/7/20 | 200 | 5 | 1 | yes | <5 | |
| | 4280 | 1 | B821001 | 1 | | Storage | 100A : Storage Closet in Classroom | All | 7/10/20 | 7/10/20 | 8/7/20 | 120 | 5 | 0 | no | N/A | |
| | 4280 | 1 | B821001 | 1 | | Storage | 100B : Storage Closet in Classroom | All | 7/10/20 | 7/10/20 | 8/7/20 | 120 | 5 | 0 | no | N/A | |
| | 4280 | 1 | B821001 | 1 | | IMC (Library) | 101 : Classroom 101 | All | 7/7/20 | 7/7/20 | 8/7/20 | 400 | 10 | 1 | yes | <5 | |
| | 4280 | 1 | B821001 | 1 | | IMC (Library) | 101 : Classroom 101 | Ceiling | 7/10/20 | 7/10/20 | 8/7/20 | 200 | 5 | 1 | yes | <5 | |
| | 4280 | 1 | B821001 | 1 | | Primary | 102 : Classroom 102 | All | 7/7/20 | 7/7/20 | 8/6/20 | 200 | 5 | 1 | yes | <5 | |
| | 4280 | 1 | B821001 | 1 | | Primary | 102 : Classroom 102 | Ceiling | 7/16/20 | 7/16/20 | 8/6/20 | 100 | 3 | 1 | yes | <5 | |
| | 4280 | 1 | B821001-1 | 1 | | Primary | 103A : Classroom 103A | All | 11/4/2020 | 11/6/2020 | 11/6/2020 | 360 | 9 | 1 | yes | <5 | |
| | 4280 | 1 | B821001-1 | 1 | | Primary | 103 : Classroom 103 | All | 10/27/2020 | 10/30/2020 | 11/2/2020 | 360 | 9 | 1 | yes | <5 | |
| | 4280 | 1 | B821001-1 | 1 | | Storage | 103B : Back Storage to the Right in Classroom 103 | No RRP | No RRP | No RRP | No RRP | No RRP | No RRP | 0 | No | N/A | |
| | 4280 | 1 | B821001 | 1 | | Storage | 103D : Storage to Left of Classroom | No RRP | No RRP | No RRP | No RRP | No RRP | No RRP | 0 | No | N/A | |
| | 4280 | 1 | B821001-1 | 1 | | Primary | 104 : Classroom 104 | All | 7/7/2020 | 7/7/2020 | 8/6/2020 | 150 | 4 | 1 | yes | <5 | |
| | 4280 | 1 | B821001-1 | 1 | | Primary | 104 : Classroom 104 | Ceiling | 7/15/2020 | 7/15/2020 | 8/6/2020 | 150 | 4 | 1 | yes | <5 | |
| | 4280 | 1 | B821001 | 1 | | Electrical | 104A : Electrical Room across from | No RRP | No RRP | No RRP | No RRP | No RRP | No RRP | 0 | No | N/A | |
| | 4280 | 1 | B821001 | 1 | | Storage | 105 : Classroom 105 | Ceiling | 7/15/2020 | 7/15/2020 | 8/6/2020 | 150 | 4 | 1 | yes | <5 | |
| | 4280 | 1 | B821001-1 | 1 | | Storage | 105A : Book Storage Closet Next to Room 106 | All | 11/9/2020 | 11/9/2020 | 11/9/2020 | 100 | 3 | 0 | no | <5 | |
| | 4280 | 1 | B821001-1 | 1 | | Primary | 106 : Classroom 106 | Ceiling | 7/15/2020 | 7/15/2020 | 8/6/2020 | 100 | 3 | 1 | yes | <5 | |
| | 4280 | 1 | B821001 | 1 | | Primary | 107 : Classroom 107 | Ceiling | 7/15/2020 | 7/15/2020 | 8/6/2020 | 400 | 10 | 1 | yes | <5 | |
| | 4280 | 1 | B821001 | 1 | | Primary | 107 : Classroom 107 | Ceiling | 7/16/2020 | 7/16/2020 | 8/6/2020 | 200 | 5 | 1 | yes | <5 | |
| | 4280 | 1 | B821001-1 | 1 | | Primary | 107 : Classroom 107 | Ceiling | 7/20/2020 | 7/20/2020 | 8/6/2020 | 100 | 3 | 1 | yes | <5 | |
| | 4280 | 1 | B821001-1 | 1 | | Primary | 108 : Library | No RRP | No RRP | No RRP | No RRP | No RRP | No RRP | 0 | No | N/A | |
| | 4280 | 1 | B821001-1 | 1 | | Restroom | 110 : Boy's Restroom to Right of Kindergarten Library | All | 8/5/2020 | 8/5/2020 | 8/18/2020 | 300 | 8 | 1 | yes | <5 | |
| | 4280 | 1 | B821001-1 | 1 | | Restroom | 111 : Girl's Restroom Across from Classroom 104 | All | 8/5/2020 | 8/5/2020 | 8/18/2020 | 200 | 5 | 1 | yes | <5 | |
| | 4280 | 1 | B821001-1 | 1 | | Primary | 112 : Classroom A | All | 10/27/2020 | 11/2/2020 | 11/2/2020 | 350 | 9 | 0 | no | N/A | |
| | 4280 | 1 | B821001-1 | 1 | | Primary | 112A : Classroom A Restroom | All | 10/27/2020 | 11/2/2020 | 11/2/2020 | 20 | 1 | 0 | no | N/A | |
| | 4280 | 1 | B821001 | 1 | | Primary | 113 : Classroom B | All | 10/27/2020 | 10/30/2020 | 10/30/2020 | 350 | 9 | 0 | no | N/A | |
| | 4280 | 1 | B821001-1 | 1 | | Primary | 113A : Classroom B Restroom | All | 10/27/2020 | 10/30/2020 | 10/30/2020 | 20 | 1 | 0 | no | N/A | |
| | 4280 | 1 | B821001 | 1 | | Storage | 113C : Storage Room to Left of | No RRP | No RRP | No RRP | No RRP | No RRP | No RRP | 0 | no | N/A | |
| | 4280 | 1 | B821001 | 1 | | Auditorium | 114 : Auditorium | Walls | 10/19/2020 | 10/19/2020 | | 1600 | 40 | 4 | | | |
| | 4280 | 1 | B821001 | 1 | | Primary | 114A : Auditorium Stage | Walls | 10/20/2020 | 10/20/2020 | | 600 | 15 | 2 | | | |
| | 4280 | 1 | B821001-1 | 1 | | Restroom | 115 : Men's Restroom near Visitor Entrance | Ceiling | 10/20/2020 | 10/21/2020 | | 100 | 3 | 0 | no | N/A | |
| | 4280 | 1 | B821001-1 | 1 | | Restroom | 116 : Women's Restroom near Visitor Entrance | Ceiling | 10/20/2020 | 10/21/2020 | | 100 | 3 | 0 | no | N/A | |
| | 4280 | 1 | B821001 | 1 | | Storage | 116A : Custodial Closet between | Ceiling | 10/20/2020 | 10/21/2020 | | 20 | 1 | 0 | no | N/A | |
| | 4280 | 1 | B821001-1 | 1 | | Storage | 116B : Storage Closet to Crawlspace in Visitor Entrance | Ceiling | 10/21/2020 | 10/21/2020 | 10/30/20 | 20 | 1 | 0 | no | N/A | |
| | 4280 | 1 | B821001 | 1 | | Primary | 117 : Main Office | Walls | 10/13/2020 | 10/16/2020 | 10/28/2020 | 400 | 10 | 0 | no | N/A | |
| | 4280 | 1 | B821001-1 | 1 | | Primary | 117A : Principal's Office | Walls | 10/22/2020 | 10/23/2020 | 10/30/20 | 200 | 5 | 0 | no | N/A | |
| | 4280 | 1 | B821001-1 | 1 | | Storage | 117B : Main Office Storage Book Closet | All | 10/22/2020 | 10/23/2020 | 10/30/20 | 20 | 1 | 0 | no | N/A | |
| | 4280 | 1 | B821001 | 1 | | Primary | 117C : Conference Room | Walls | 10/21/2020 | 10/22/2020 | 10/30/20 | 200 | 5 | 0 | no | N/A | |
| | 4280 | 1 | B821001-1 | 1 | | storage | 117D : Main Office Storage Closet near Entrance | | 10/22/2020 | 10/23/2020 | 10/30/20 | 50 | 1 | 0 | no | N/A | |
| | 4280 | 1 | B821001-1 | 1 | | Storage | 117D : Storage Closet at Visitor Entrance Conference Room entrance | No RRP | No RRP | No RRP | 10/23/2020 | No RRP | No RRP | 0 | no | N/A | |
| | 4280 | 1 | B821001 | 1 | | Primary | 117E : Principal's Restroom | Pipe | 10/20/2020 | 10/20/2020 | 10/30/20 | 40 | 1 | 0 | no | N/A | |

| Task ID | ULCS# | Element | BldgElm t ID | Floor | Space # (on Floor Plan) | Space Type | On Site Room Name | Primary Component | Work Area Prepped (date) | Surfaces Stabilized (date) | Final Inspection Approval and Photos (date) | Square Footage of Work Area | Number of Required RRP Wipes | Number of AAS Wipes Used to Pass | Final Wipe Submitted for AAS Analysis (yes/no) | AAS Analysis Results | Comments from Assessment |
|---------|-------|---------|--------------|-------|-------------------------|-----------------------|---|-------------------|--------------------------|----------------------------|---|-----------------------------|------------------------------|----------------------------------|--|----------------------|--------------------------|
| | 4280 | 1 | B821001 | 1 | | Primary | 118 : Office to Right of Main Office | Walls | 10/13/2020 | 10/16/2020 | 11/2/2020 | 150 | 4 | 0 | no | N/A | |
| | 4280 | 1 | B821001 | 1 | | Primary | 118A : Storage near Main Office Copy | Walls | 10/13/2020 | 10/16/2020 | 11/2/2020 | 12 | 1 | 0 | no | N/A | |
| | 4280 | 1 | B821001 | 1 | | Primary | 119 : Office to Left of Copy Room on | Walls | 10/13/2020 | 10/16/2020 | 11/2/2020 | 150 | 4 | 0 | no | N/A | |
| | 4280 | 1 | B821001 | 1 | | Primary | 119A : Copy Room Staff Restroom | No RRP | No RRP | No RRP | No RRP | No RRP | No RRP | 0 | no | N/A | |
| | 4280 | 1 | B821001-1 | 1 | | Teacher Lounge/Dining | 121 : Copy Room near Main Office | Walls | 10/13/2020 | 10/16/2020 | 10/27/2020 | 300 | 8 | 0 | no | N/A | |
| | 4280 | 1 | B821001-1 | 1 | | Storage | 121 : Nurse's Office Storage | Walls | 10/9/2020 | 10/12/2020 | 10/27/2020 | 150 | 4 | 0 | no | N/A | |
| | 4280 | 1 | B821001 | 1 | | Storage | 121A : Nurse's Storage Area Restroom | Walls | 10/9/2020 | 10/12/2020 | 10/28/2020 | 12 | 1 | 0 | no | N/A | |
| | 4280 | 1 | B821001-1 | 1 | | Health Service | 122 : Nurse's Office | Walls | 10/9/2020 | 10/12/2020 | 10/28/2020 | 150 | 4 | 0 | no | N/A | |
| | 4280 | 1 | B821001-1 | 1 | | Storage | 123C : Custodial Closet next to Nurse's Office | | 11/4/2020 | 11/4/2020 | 11/4/2020 | 50 | 2 | 0 | no | N/A | |
| | 4280 | 1 | B821001-1 | 1 | | Primary | 124 : 1st Floor Teacher's Lounge (SJS Room) | All | 10/27/2020 | 11/3/2020 | 11/3/2020 | 250 | 6 | 0 | no | N/A | |
| | 4280 | 1 | B821001 | 1 | | Primary | 124A : Staff Restroom in Staff Lounge | All | 10/27/2020 | 11/3/2020 | 11/3/2020 | 80 | 2 | 0 | no | N/A | |
| | 4280 | 1 | B821001 | 1 | | Storage | 124B : Storage in Staff Lounge | No RRP | No RRP | No RRP | No RRP | No RRP | No RRP | 0 | no | N/A | |
| | 4280 | 1 | B821001 | 1 | | Primary | 125 : Classroom 101 Restroom | All | 8/7/2020 | 8/7/2020 | 8/7/2020 | 40 | 1 | 1 | yes | <5 | |
| | 4280 | 1 | B821001-1 | 1 | | Primary | 127 : Library Office | No RRP | No RRP | No RRP | No RRP | No RRP | No RRP | 0 | No | N/A | |
| | 4280 | 1 | B821001-1 | 1 | | Storage | 2 : Right Side Boiler Storage Room | | | | | | | | | | |
| | 4280 | 1 | B821001-1 | 1 | | Boiler Room | 3 : Boiler Room | | | | | | | | | | |
| | 4280 | 1 | B821001 | 1 | | Primary | 4 : Classroom C | All | 11/4/2020 | 11/4/2020 | 11/6/2020 | 360 | 9 | 1 | Yes | <5 | |
| | 4280 | 1 | B821001 | 1 | | Mechanical | 4A : Radiator Room to Right of | No RRP | No RRP | No RRP | No RRP | No RRP | No RRP | 0 | No | N/A | |
| | 4280 | 1 | B821001 | 1 | | General | 6 : Staff Maintenance Lounge | All | 11/6/2020 | 11/10/2020 | 11/10/2020 | 30 | 5 | 0 | no | N/A | |
| | 4280 | 1 | B821001 | 1 | | General | 7 : Building Engineer's Office | All | 11/6/2020 | 11/11/2020 | 11/11/2020 | 200 | 5 | 0 | no | N/A | |
| | 4280 | 1 | B821001 | 1 | | General | 7B : Building Engineer's Restroom | All | 11/6/2020 | 11/11/2020 | 11/11/2020 | 30 | 1 | 0 | no | N/A | |
| | 4280 | 1 | B821001 | 1 | | Circulation | H11 : Hallway between Classroom 104 | Walls | 10/13/2020 | 10/14/2020 | 10/27/2020 | 500 | 13 | 0 | no | N/A | |
| | 4280 | 1 | B821001-1 | 1 | | Circulation (Hallway) | H11A : Hallway next to Classrooms 101 through Classroom B | Walls | 10/13/2020 | 10/14/2020 | 10/27/2020 | 500 | 13 | 0 | no | N/A | |
| | 4280 | 1 | B821001-1 | 1 | | Circulation (Hallway) | H12 : Auditorium and Main Office Hallway | Walls | 11/12/2020 | 11/12/2020 | 11/12/2020 | 500 | 13 | 0 | no | N/A | |
| | 4280 | 1 | B821001 | 1 | | Storage | H12A : Closet in Main Visitor Entrance | All | 11/12/2020 | 11/12/2020 | 11/12/2020 | 50 | 1 | 0 | no | N/A | |
| | 4280 | 1 | B821001 | 1 | | Storage | H12B : Custodial Closet next to Main | All | 11/12/2020 | 11/12/2020 | 11/12/2020 | 60 | 1 | 0 | no | N/A | |
| | 4280 | 1 | B821001 | 1 | | Circulation | H13 : Hallway at Visitor's Entrance | Walls | 10/21/2020 | 10/23/2020 | | 600 | 15 | 0 | no | N/A | |
| | 4280 | 1 | B821001 | 1 | | Circulation | Hall at Room 106 | Walls | 10/13/2020 | 10/14/2020 | 10/27/2020 | 500 | 13 | 0 | no | N/A | |
| | 4280 | 1 | B821001 | 1 | | Circulation | Hall at Room 107 | Walls | 10/13/2020 | 10/14/2020 | 10/27/2020 | 500 | 13 | 0 | no | N/A | |
| | 4280 | 1 | B821001 | 1 | | Storage | JC1 : Custodial Closet to Left of | Ceiling | 10/21/2020 | 10/21/2020 | 11/9/2020 | 20 | 1 | 0 | no | N/A | |
| | 4280 | 1 | B821001 | 1 | | Stairs | S11 : Stairwell near Auditorium | Walls | 8/4/2020 | 8/4/2020 | 8/4/2020 | 200 | 5 | 0 | No | N/A | |
| | 4280 | 1 | B821001 | 1 | | Stairs | S12 : Stairwell next to Building | Walls | 8/11/2020 | 8/11/2020 | 8/11/2020 | 300 | 8 | 0 | no | N/A | |
| | 4280 | 1 | B821001 | 1 | | Stairs | S3 : Stairwell 3 next to Library | All | 8/3/2020 | 8/3/2020 | 8/4/2020 | 400 | 10 | 0 | No | N/A | |
| | 4280 | 1 | B821001-1 | 1 | | Stairs | Stairwell at Boiler Room | | | | | | | | | | |
| | 4280 | 1 | B821001-1 | 2 | | Primary | 201 : Classroom 201 | All | 9/16/2020 | 9/18/2020 | 11/2/2020 | 500 | 13 | 0 | no | N/A | |
| | 4280 | 1 | B821001-1 | 2 | | Primary | 202 : Classroom 202 | All | 9/15/2020 | 9/21/2020 | 11/2/2020 | 500 | 13 | 0 | no | N/A | |
| | 4280 | 1 | B821001-1 | 2 | | Primary | 203 : Classroom 203 | All | 9/15/2020 | 9/15/2020 | 11/2/2020 | 500 | 13 | 0 | no | N/A | |
| | 4280 | 1 | B821001-1 | 2 | | Primary | 204 : Classroom 204 | All | 9/15/2020 | 9/16/2020 | 11/2/2020 | 500 | 13 | 0 | no | N/A | |
| | 4280 | 1 | B821001-1 | 2 | | Primary | 205 : Classroom 205 | All | 9/9/2020 | 9/9/2020 | 11/2/2020 | 500 | 13 | 0 | no | N/A | |
| | 4280 | 1 | B821001-1 | 2 | | Primary | 206 : Classroom 206 | All | 9/9/2020 | 9/9/2020 | 10/30/2020 | 500 | 13 | 0 | no | N/A | |
| | 4280 | 1 | B821001-1 | 2 | | Storage | 206A : Science Materials Storage next to Classroom 207 | Ceiling | 9/24/2020 | 9/28/2020 | 10/4/2020 | 120 | 3 | 0 | no | N/A | |
| | 4280 | 1 | B821001-1 | 2 | | Storage | 206B : Custodial Closet next to Classroom 207 | Walls | 9/24/2020 | 9/28/2020 | 10/4/2020 | 50 | 1 | | | | |
| | 4280 | 1 | B821001-1 | 2 | | Primary | 207 : Classroom 207 | All | 7/8/2020 | 7/8/2020 | 8/7/2020 | 600 | 15 | 0 | no | N/A | |

| Task ID | ULCS# | E l e m e n t | BldgElm t ID | F l o o r | Space # (on Floor Plan) | Space Type | On Site Room Name | Primary Component | Work Area Prepped (date) | Surfaces Stabilized (date) | Final Inspection Approval and Photos (date) | Square Footage of Work Area | Number of Required RRP Wipes | Number of AAS Wipes Used to Pass | Final Wipe Submitted for AAS Analysis (yes/no) | AAS Analysis Results | Comments from Assessment |
|---------|-------|---------------------------------|-----------------|-----------------------|----------------------------|------------|---|-----------------------------|-----------------------------|----------------------------------|--|-----------------------------------|------------------------------------|--|--|-----------------------------|------------------------------|
| | 4280 | 1 | B821001-1 | 2 | | Primary | 208 : Classroom 208 | All | 9/9/2020 | 9/9/2020 | 10/30/2020 | 500 | 13 | 0 | no | N/A | |
| | 4280 | 1 | B821001-1 | 2 | | Primary | 209 : Music Classroom 209 | All | 9/9/2020 | 9/9/2020 | 10/28/20 | 550 | 14 | 0 | no | N/A | |
| | 4280 | 1 | B821001-1 | 2 | | Primary | 210 : Classroom 210 | All | 9/9/2020 | 9/9/2020 | 10/30/2020 | 500 | 13 | 0 | no | N/A | |
| | 4280 | 1 | B821001-1 | 2 | | Primary | 211 : Classroom 211 | All | 7/9/2020 | 7/10/2020 | 8/7/2020 | 700 | 18 | 0 | no | N/A | |
| | 4280 | 1 | B821001-1 | 2 | | Storage | 211A : Book Storage next to Classroom 212 | Walls | 9/24/2020 | 9/28/2020 | 10/4/2020 | 120 | 3 | 0 | no | N/A | |
| | 4280 | 1 | B821001-1 | 2 | | Primary | 212 : Classroom 212 | All | 9/9/2020 | 9/9/2020 | 10/30/2020 | 500 | 13 | 0 | no | N/A | |
| | 4280 | 1 | B821001-1 | 2 | | Primary | 213 : Classroom 213 | All | 7/8/2020 | 7/8/2020 | 8/7/2020 | 500 | 13 | 0 | no | N/A | |
| | 4280 | 1 | B821001-1 | 2 | | Restroom | 214 : Boy's Restroom to Right of Gym | Walls | 8/11/2020 | 8/11/2020 | 8/18/2020 | 300 | 8 | 1 | yes | <5 | |
| | 4280 | 1 | B821001-1 | 2 | | Storage | 214A : Custodial Closet in between Boy's and Girl's Restroom near Gym | Ceiling | 9/24/2020 | 9/24/2020 | 10/23/2020 | 40 | 1 | 0 | no | N/A | |
| | 4280 | | | 2 | | Storage | 214B : Storage to Right of 2nd Floor Boy's Restroom | Shelves | 9/24/2020 | 9/24/2020 | 10/23/2020 | 30 | 1 | 0 | no | N/A | |
| | 4280 | 1 | B821001-1 | 2 | | Restroom | 215 : Girl's Restroom to Right of Gym | Walls | 8/5/2020 | 8/11/2020 | 8/18/2020 | 300 | 8 | 1 | yes | <5 | |
| | 4280 | 1 | B821001-1 | 2 | | Primary | 216 : Teacher's Lounge on 2nd Floor | All | 9/15/2020 | 9/16/2020 | 10/27/2020 | 250 | 7 | 0 | no | N/A | |
| | 4280 | 1 | B821001-1 | 2 | | Storage | 216A : Staff Restroom in Staff Lounge | Ceiling | 9/18/2020 | 9/18/2020 | 10/27/2020 | 50 | 2 | 0 | no | N/A | |
| | 4280 | 1 | B821001-1 | 2 | | Storage | 216B : Electrical Closet in Staff Lounge | Need SDP Approval to scrape | Need SDP Approval to scrape | Need SDP Approval to scrape | Need SDP Approval to scrape | Need SDP Approval to scrape | Need SDP Approval to scrape | Need SDP Approval to scrape | Need SDP Approval to scrape | Need SDP Approval to scrape | Need SDP Approval to scrape |
| | 4280 | 1 | B821001-1 | 2 | | Storage | 216C : Storage Closet in Staff Lounge | All | 9/18/2020 | 9/18/2020 | 10/27/2020 | 30 | 1 | 0 | no | N/A | |
| | 4280 | 1 | B821001-1 | 2 | | Primary | 218 : Gymnasium | Walls | 10/7/2020 | 10/9/2020 | 11/11/2020 | 2800 | 69 | 1 | Yes | <5 | 6 AAS wipes, all <5 |
| | 4280 | 1 | B821001-1 | 2 | | Storage | 218A : Storage Closet between Cafeteria and Gymnasium | Shelves | 9/24/2020 | 9/24/2020 | 9/24/2020 | 40 | 1 | 0 | no | N/A | |
| | 4280 | 1 | B821001-1 | 2 | | Storage | 218B : Display Case Storage Closet Next to Cafeteria | Walls | 9/24/2020 | 9/24/2020 | 9/24/2020 | 35 | 1 | 0 | no | N/A | |
| | 4280 | 1 | B821001-1 | 2 | | Storage | 218C : Display Case Storage next to Custodial Closet at Cafeteria | Ceiling | 9/24/2020 | 9/24/2020 | 9/28/2020 | 35 | 1 | 0 | no | N/A | |
| | 4280 | 1 | B821001-1 | 2 | | Primary | 218D : Custodial Closet between Stairwell 1 and Cafeteria | All | 9/24/2020 | 9/24/2020 | 10/26/2020 | 10 | 1 | 0 | no | N/A | |
| | 4280 | 1 | B821001-1 | 2 | | Primary | 218E : Storage to Right of Gym Entrance | Shelves | 9/24/2020 | 9/24/2020 | 10/26/2020 | 30 | 1 | 0 | no | N/A | |
| | 4280 | 1 | B821001-1 | 2 | | Storage | 218F : Math Book Storage Closet next to Gymnasium | Shelves | 9/24/2020 | 9/24/2020 | 10/26/2020 | 50 | 2 | 0 | no | N/A | |
| | 4280 | 1 | B821001-1 | 2 | | Storage | 218G : Storage at Front of Gym next to Math Storage Closet | Baseboard | 9/24/2020 | 9/24/2020 | 10/27/2020 | 40 | 1 | 0 | no | N/A | |
| | 4280 | | | 2 | | Storage | 218H : Gym Equipment Storage near Entrance at Parking Lot | Walls | 10/7/2020 | 10/7/2020 | 10/7/2020 | 40 | 1 | 0 | no | N/A | |
| | 4280 | 1 | B821001-1 | 2 | | Primary | 219 : Cafeteria | All | 9/21/2020 | 9/21/2020 | 11/5/2020 | 1500 | 35 | 1 | Yes | <5 | Floor=<5, Floor=<5, Sill=6.8 |
| | 4280 | 1 | B821001-1 | 2 | | Primary | 220 : Home School Office to Left of Cafeteria | Walls | 9/21/2020 | 9/21/2020 | 11/3/2020 | 600 | 15 | 0 | No | N/A | |
| | 4280 | 1 | B821001-1 | 2 | | Storage | 221 : Storage in Rear of Cafeteria at Exit Doors | Walls | 9/22/2020 | 9/22/2020 | 11/3/2020 | 110 | 3 | 0 | no | N/A | |
| | 4280 | 1 | B821001-1 | 2 | | Storage | 221A : Storage in Rear of Cafeteria by Exit Doors (Closer to Cafe) | Walls | 9/22/2020 | 9/23/2020 | 11/3/2020 | 20 | 1 | 0 | no | N/A | |
| | 4280 | 1 | B821001-1 | 2 | | Storage | 224 : Storage behind Gym Office | Walls | 10/7/2020 | 10/7/2020 | 10/7/2020 | 20 | 1 | 0 | no | N/A | |
| | 4280 | 1 | B821001-1 | 2 | | Primary | 225 : Gym Office | Walls | 10/7/2020 | 10/7/2020 | 10/7/2020 | 40 | 1 | 0 | no | N/A | |
| | 4280 | 1 | B821001-1 | 2 | | Primary | 226 : Entrance Lobby next to Parking Lot and Gymnasium | No RRP | No RRP | No RRP | 9/28/2020 | No RRP | No RRP | 0 | No | N/A | |
| | 4280 | 1 | B821001-1 | 2 | | Kitchen | 226 : Kitchen | Ceiling | 9/22/2020 | 9/22/2020 | 11/3/2020 | 260 | 7 | 0 | No | N/A | Serving Line/Children area |
| | 4280 | 1 | B821001-1 | 2 | | Storage | 226A : Storage in Rear Kitchen Area | Ceiling | 9/22/2020 | 9/28/2020 | 11/3/2020 | 400 | 10 | 0 | no | N/A | |
| | 4280 | 1 | B821001-1 | 2 | | Storage | 226B : Storage Area with Windows to Left of Kitchen | Ceiling | 9/22/2020 | 9/22/2020 | 11/3/2020 | 60 | 2 | 0 | no | N/A | |

| Task ID | ULCS# | Element | BldgElm t ID | Floor | Space # (on Floor Plan) | Space Type | On Site Room Name | Primary Component | Work Area Prepped (date) | Surfaces Stabilized (date) | Final Inspection Approval and Photos (date) | Square Footage of Work Area | Number of Required RRP Wipes | Number of AAS Wipes Used to Pass | Final Wipe Submitted for AAS Analysis (yes/no) | AAS Analysis Results | Comments from Assessment |
|---------|-------|---------|--------------|-------|-------------------------|-----------------------|--|-------------------|--------------------------|----------------------------|---|-----------------------------|------------------------------|----------------------------------|--|----------------------|--------------------------|
| | 4280 | 1 | B821001-1 | 2 | | Primary | 226C : Kitchen Office | No RRP | No RRP | No RRP | 9/24/2020 | No RRP | No RRP | 0 | no | N/A | |
| | 4280 | 1 | B821001-1 | 2 | | Mechanical | 4B : Radiator Room outside of Classroom 103 | No RRP | No RRP | No RRP | No RRP | No RRP | No RRP | 0 | no | N/A | |
| | 4280 | 1 | B821001-1 | 2 | | Circulation (Hallway) | H21 : Hallway between Classroom 201 and 210 | Walls | 9/28/2020 | 9/28/2020 | 10/29/2020 | 50 | 2000 | 0 | No | N/A | |
| | 4280 | 1 | B821001-1 | 2 | | Stairs | S1 : Stairwell Next to Gym/Exit to Parking Lot | Walls | 8/4/2020 | 8/4/2020 | 8/4/2020 | 200 | 5 | 0 | No | N/A | |
| | 4280 | 1 | B821001-1 | 2 | | Stairs | S22 : Stairwell next to Classroom 201 | Walls | 8/11/2020 | 8/11/2020 | 8/11/2020 | 600 | 15 | 0 | no | N/A | |
| | 4280 | 1 | B821001-1 | 2 | | Stairs | S3 : Stairwell next to Classroom 209 | All | 8/3/2020 | 8/3/2020 | 8/4/2020 | 400 | 10 | 0 | No | N/A | |
| | 4280 | 1 | B821001-1 | BS | | Storage | 222 : Large Open Storage Area outside Boy's Restroom in Gym | No RRP | No RRP | No RRP | 10/7/2020 | No RRP | No RRP | 0 | no | N/A | |
| | 4280 | 1 | B821001-1 | BS | | Restroom | 222A : Boy's Restrooms Stall Area | No RRP | No RRP | No RRP | 10/7/2020 | No RRP | No RRP | 0 | no | N/A | |
| | 4280 | 1 | B821001-1 | BS | | Storage | 222B : Storage in Boy's Restroom to Left of Stalls | No RRP | No RRP | No RRP | 10/7/2020 | No RRP | No RRP | 0 | no | N/A | |
| | 4280 | 1 | B821001-1 | BS | | Storage | 222C : Custodial Closet in Gymnasium Rear | walls | 10/7/2020 | 10/7/2020 | 10/7/2020 | 44 | 2 | 0 | no | N/A | |
| | 4280 | 1 | B821001-1 | BS | | Storage | 223 : Large Open Storage Area outside Girl's Restroom in Gym | No RRP | No RRP | No RRP | 10/7/2020 | No RRP | No RRP | 0 | no | N/A | |
| | 4280 | 1 | B821001-1 | BS | | Restroom | 223A : Girl's Restrooms Stall Area | No RRP | No RRP | No RRP | 10/7/2020 | No RRP | No RRP | 0 | no | N/A | |
| | 4280 | 1 | B821001-1 | BS | | Storage | 223B : Storage in Girl's Restroom to Left of Stalls | No RRP | No RRP | No RRP | 10/7/2020 | No RRP | No RRP | 0 | no | N/A | |
| | 4280 | | | | | | 201 : Classroom 1 (R4) | | | | | | | | | | |
| | 4280 | | | | | | 202 : Classroom 2 (R5) | | | | | | | | | | |
| | 4280 | | | | | | 203 : Foyer to Classrooms 1 and 2 (R4 and R5) | | | | | | | | | | |
| | 4280 | | | | | | 204 : Classroom 1 (R4) Server Room | | | | | | | | | | |
| | 4280 | | | | | | 205 : Classroom 1 (R4) Storage Closet | | | | | | | | | | |
| | 4280 | | | | | | 206 : Classroom 2 (R5) Storage Closet | | | | | | | | | | |
| | 4280 | | | | | | 207 : Classroom 2 (R5) Girl's Restroom | | | | | | | | | | |
| | 4280 | | | | | | 208 : Classroom 2 (R5) Boy's Restroom | | | | | | | | | | |
| | 4280 | | | | | | 209A : Classroom 2 (R5) Storage Closet | | | | | | | | | | |
| | 4280 | | | | | | 210 : Classroom 1(R4) Girl's Restroom | | | | | | | | | | |
| | 4280 | | | | | | 211 : Classroom 1 (R4) Boy's Restroom | | | | | | | | | | |
| | 4280 | | | | | | 301 : Classroom R-1 | | | | | | | | | | |
| | 4280 | | | | | | 301A : Storage #1 in Classroom R-2 | | | | | | | | | | |
| | 4280 | | | | | | 301B : Storage #2 in Classroom R-1 | | | | | | | | | | |
| | 4280 | | | | | | 301C : Storage #3 in Classroom R-1 | | | | | | | | | | |
| | 4280 | | | | | | 302 : Classroom R-2 | | | | | | | | | | |
| | 4280 | | | | | | 302A : Storage #1 in Classroom R-2 | | | | | | | | | | |
| | 4280 | | | | | | 302B : Storage #2 in Classroom R-2 | | | | | | | | | | |
| | 4280 | | | | | | 303 : Boy's Restroom near Classroom R-1 | | | | | | | | | | |
| | 4280 | | | | | | 304 : Girl's Restroom near Classroom R-1 | | | | | | | | | | |
| | 4280 | | | | | | 305 : Mechanical Room near Classroom R-1 | | | | | | | | | | |
| | 4280 | | | | | | 401 : R3 Portable Classroom | | | | | | | | | | |
| | 4280 | | | | | | 402 : Classroom R3 Boy's Restroom | | | | | | | | | | |
| | 4280 | | | | | | 403 : Classroom R3 Girl's Restroom | | | | | | | | | | |
| | 4280 | | | | | | 404 : Electrical Closet in Element 4 | | | | | | | | | | |
| | 4280 | | | | | | AT : Attic | | | | | | | | | | |
| | 4280 | | | | | | CS : Crawlspace-Boiler Room left | | | | | | | | | | |
| | 4280 | | | | | | CS : Crawlspace-Boiler Room right | | | | | | | | | | |

[illegible]



Appendix D: Sample Results

Sam Gompers ES



BATTA Laboratories, LLC

6 Lead Wipes

BL Sample Custody Transmittal Sheet

Project Information

| | | | |
|---|-----------------|--------------------|-----------------|
| BL Project # : | <u>L145320</u> | BEA Project # : | <u>543519AV</u> |
| Range of BATTA Lab Sample # : | <u>20080602</u> | | |
| Checked for Special Instructions (see CoC): | <u>IAA</u> | Initial if Checked | |

Date of Preliminary Results Requested By:

Rush

Date of Certificates Requested By:

Date & Lab Name for Outsourcing Sample(s):

Transmittal Information

| Quality Checked | Description of Activity | Date | Time | Initials |
|-------------------------------------|---------------------------------|---------------|--------------|------------|
| <input checked="" type="checkbox"/> | Sample Log-in by: | <u>8/6/20</u> | <u>15:05</u> | <u>IAA</u> |
| <input checked="" type="checkbox"/> | Sample Prep by: | <u>8/6/20</u> | <u>1506</u> | <u>SA</u> |
| <input checked="" type="checkbox"/> | Sample Analysis Completed by: | <u>8/6/20</u> | <u>1621</u> | <u>SA</u> |
| <input checked="" type="checkbox"/> | Report/Data Entry Completed by: | <u>8/6/20</u> | <u>1622</u> | <u>SA</u> |
| <input checked="" type="checkbox"/> | Report Scanned & Delivered by: | <u>8/6/20</u> | <u>1623</u> | <u>SA</u> |

Check a "✓" in the box to the right when you have quality-checked the package prior to handing off to the next station.

Results given:

☒ email

check those that apply

☐ verbals

Details:

Write details such as method of contact (email, verbal, etc.) and the person contacted

8/6/20
Date

1624
Time

RUE

8/13/20

1115

AB


QC and Signatory of Final Report

Date

Time

Initials

Dedicated to a Cleaner
Environment Since 1982

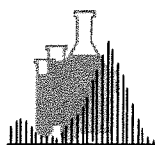


NY ELAP# 11993
PCM, PLM, TEM & LEAD



BATTA LABORATORIES, LLC
Delaware Industrial Park, 6 Garfield Way
Newark, DE 19713-5817
Tel. (302)737-3376 Fax (302)-737-5764
**Newark, DE - Columbia, MD -
Philadelphia, PA**

Web: <http://www.battaenv.com>
E-mail: battaenv@battaenv.com

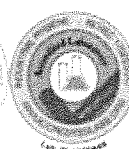

EPA Lab ID #DE004

NVLAP
Lab Code: 101032-0

REPORT OF ANALYSIS

| | | | |
|---------------------------|--------------------------------------|----------------------------|------------|
| Report#: | RP20080605 | Date Sampled: | 08/06/2020 |
| Project Number: | 20080602 | Sampled By: | C. Rhodes |
| Project Name: | Batta Environmental Associates | Date Received: | 08/06/2020 |
| Project Location: | 543519AV Gompers Elementary School | Date Analyzed: | 08/06/2020 |
| Analyte Requested: | Lead | Date Report Issued: | 08/06/2020 |
| Method | Test Method: NIOSH 9100 / NIOSH 7082 | | |
| Matrix: | Wipe | | |

| Lab Sample # | Client Sample ID | Sample Description | Sample Location | Sampled Area (ft ²) | µg / sample | µg/ft ² | Reporting Limit (µg/sample) |
|--------------|------------------|--------------------|-----------------|---------------------------------|-------------|--------------------|-----------------------------|
| 20080602.01 | Pb-01 | Room 107 | n/a | 1.00 | <5 | <5 | 5 |
| 20080602.02 | Pb-02 | Room 106 | n/a | 1.00 | <5 | <5 | 5 |
| 20080602.03 | Pb-03 | Room 105 | n/a | 1.00 | <5 | <5 | 5 |
| 20080602.04 | Pb-04 | Room 104 | n/a | 1.00 | <5 | <5 | 5 |
| 20080602.05 | Pb-05 | Room 102 | n/a | 1.00 | <5 | <5 | 5 |
| 20080602.06 | Pb-06 | Blank | n/a | | <5 | <5 | 5 |

Note: 1. Blank values were not subtracted from reported sample values; 2. Quality control results in this report are acceptable; 3. Results relate only to the items tested; 4. Batta Laboratories, Inc. is not responsible for sample collection, nor interpretations made by others; and 5. This report does not constitute endorsement by AIHA LAP, LLC., NVLAP and/or any other U.S. governmental agencies; 6. Lab results/calculations are reported in 2 significant figures. Clients data/measurements are reported as they were submitted; 7. EPA guidelines for clearance lead wipes have been set at the following levels: Floors not to exceed 10 ug/sq ft, window sills not to exceed 100 ug/sq ft, and window troughs not to exceed 400 ug/sq ft. Samples received in acceptable condition unless otherwise noted. 8. Clearance guidelines for OLHCHH, LBPHC and LHRD Grantees are set at the following levels: Floors not to exceed 10ug/sq ft, window sills not to exceed 100ug/sq ft, window troughs not to exceed 100ug/sq ft and porch floors not to exceed 40ug/sq ft. Samples received in acceptable condition unless otherwise noted. 9. This report must not be reproduced without the written approval of BATTA Laboratories.


Batta Lab strives on customer feedback to improve the quality of our services. Please e-mail your feedback to feedback@battaenv.com.

Analyst: Samusi Adediran

End of Report

QA/QC BY: RW

N.C. Batta/R Shumate (QA/QC Officer)

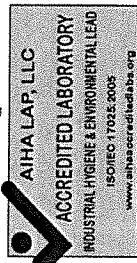

NVLAP #101032
AIHA LAP, LLC #100448
NY ELAP #11993
EPA Lab #DE004

Customer Billing Information Tel 1: SDP

Tel 2: _____

Customer Name: _____

Billing Address 1: _____

Billing Address 2: _____

Results To: Charles.chodes@battaenv.com

Results To: _____ Tel 2: _____

Emails: _____

Shipping Information

☒ Picked up by BATTAs

☐ Delivered by Customer

☐ Shipped by Customer

Turnaround Times (check one, refer to notes*)

☒ 4 Hours/Immediate (Note 3) ☐ 72 Hours (Note 5)

☐ 6 Hours/Same Day (Note 3) ☐ 5 Days (Note 6)

☐ 24 Hours (Note 3) ☐ 5 - 10 days

☐ 48 Hours (Note 4) ☐ Other _____

Notes Regarding Turnaround Times

1. Specific turnaround depends on the test requested. Turnaround not available for all types of analysis. Client must make prior arrangements with lab to guarantee turnaround time. Premium rate will apply.

2. Same day (by 5 p.m.) offered if samples are received by 12 noon. After that time, a 6-hour designation may be offered. A 6-hour/Same Day turnaround time may not be available with all analyses.

3. Unless a specific time is requested, results are guaranteed by 5 p.m. on the following business day. The turnaround time of 24 hours may not be available with all analyses.

4. Unless a specific time is requested, results are guaranteed by 5 p.m. on the 2nd business day.

5. Unless a specific time is requested, results are guaranteed by 5 p.m. on the 3rd business day.

6. Unless a specific time is requested, results are guaranteed by 5 p.m. on the 5th business day.

BEA Project #: 543519AV

Client Project #: L145320

Project Name: Gompers Elementary School

Project Location: 5701 Wyanfield Ave Phila

| BLI Use Only | Field Sample ID# | Sample Location / Description | Sampling Date / Time | Sampling Info (Air & Surface Samples) | | Sample Type | Test Method | Results | Lab Use Only | |
|--------------|------------------|-------------------------------|----------------------|---------------------------------------|-----------|--------------|-------------|---------|------------------|---------|
| | | | | Start Time | Stop Time | | | | Date of Analysis | Analyst |
| .01 | Pb-01 | Rm 107 | 8-6-20 10:01 | | | 12"x12" wipe | Pb | | | |
| .02 | Pb-02 | Rm 106 | 8-6-20 10:25 | | | 12"x12" wipe | Pb | | | |
| .03 | Pb-03 | Rm 105 | 8-6-20 11:05 | | | 12"x12" wipe | Pb | | | |
| .04 | Pb-04 | Rm 104 | 8-6-20 11:31 | | | 12"x12" wipe | Pb | | | |
| .05 | Pb-05 | Rm 102 | 8-6-20 13:10 | | | 12"x12" wipe | Pb | | | |
| .06 | Pb-06 | Blank | | | | | | | | |

Sample Relinquished By: Carol Date: 8-6-20 Time: 14:41

Sample Received By: IA Date: 8/6/20 Time: 14:42

Sample Relinquished By: _____ Date: _____ Time: _____

Sample Received By: _____ Date: _____ Time: _____

Special Instructions / Requests From Client (if applicable):

Note to Client: Batta Laboratories recommends that blanks be supplied by the client when mandated by published methods.

BLI Use Only

Logged-in By: _____ Log-in Date: _____ Date: _____

Lab Note: When building material layers are not specified by the client on the Chain of Custody, Batta will follow EPA 600 R-93/116, and make those determinations in the lab at the time of analysis. **Liability:** State/Federal Regulations mandate friability shall not be determined in labs.

For drinking water samples: for results to be valid, lab must receive samples on ice and within 48 hours of collection. For air samples collected by NIOSH 7400 and 7402: in accordance with these NIOSH methods, two field blanks (or 10% of the number of field samples submitted, whichever is greater) must be submitted and be analyzed with field samples.

Method of Payment

Are some samples not accepted? If so, check "No" and explain conditions in the box below.

☐ Yes ☐ No ☐ Received on Ice

Field Samples : Not Accepted : _____

Conditions : _____

Method of Payment

☐ Cash ☐ Cashier

☐ Visa / Mastercard / Discover

☐ Money Order

☐ Purchase Order # _____

☐ Check # _____

☐ Other _____

☐ Unit Price / Quote _____

☐ Total Payment _____

☐ Reference # _____

DEA
PHA - Gompers



④ Lead Wipes

BATTA Laboratories, LLC

RUSH

BL Sample Custody Transmittal Sheet

Project Information

| | |
|--|---------------------------------|
| BL Project # : <u>L145320</u> | BEA Project # : <u>543519AV</u> |
| Range of BATTA Lab Sample # : <u>20080702</u> | |
| Checked for Special Instructions (see CoC): <u>JES</u> | Initial if Checked |

Date of Preliminary Results Requested By:

8/7/20 RUSH

Date of Certificates Requested By:

Date & Lab Name for Outsourcing Sample(s):

Transmittal Information

| Quality Checked | Description of Activity | Date | Time | Initials |
|-------------------------------------|---------------------------------|---------------|-------------|------------|
| <input checked="" type="checkbox"/> | Sample Log-in by: | <u>8/7/20</u> | <u>1430</u> | <u>JES</u> |
| <input checked="" type="checkbox"/> | Sample Prep by: | <u>8/7/20</u> | <u>0820</u> | <u>SA</u> |
| <input checked="" type="checkbox"/> | Sample Analysis Completed by: | <u>8/7/20</u> | <u>1520</u> | <u>SA</u> |
| <input checked="" type="checkbox"/> | Report/Data Entry Completed by: | <u>8/7/20</u> | <u>1528</u> | <u>SA</u> |
| <input checked="" type="checkbox"/> | Report Scanned & Delivered by: | <u>8/7/20</u> | <u>1529</u> | <u>SA</u> |

Check a "✓" in the box to the right when you have quality-checked the package prior to handing off to the next station.

Results given:



email

check those that apply



verbals

Details:

Write details such as method of contact (email, verbal, etc.) and the person contacted

8/7/20
Date

1530
Time

RUSH

8/13/20

1055

NR

QC and Signatory of Final Report

Date

Time

Initials

Dedicated to a Cleaner
Environment Since 1982




NY ELAP# 11993
PCM, PLM, TEM & LEAD



BATTA LABORATORIES, LLC
Delaware Industrial Park, 6 Garfield Way
Newark, DE 19713-5817
Tel. (302)737-3376 Fax (302)-737-5764
**Newark, DE - Columbia, MD -
Philadelphia, PA**

Web: <http://www.battaenv.com>
E-mail: battaenv@battaenv.com

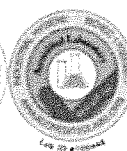

EPA Lab ID #DE004

NVLAP

Lab Code: 101032-0

REPORT OF ANALYSIS

| | | | |
|---------------------------|--------------------------------------|----------------------------|------------|
| Report#: | RP20080704 | Date Sampled: | 08/07/2020 |
| Project Number: | 20080702 | Sampled By: | J. Gabella |
| Project Name: | Batta Environmental Associates | Date Received: | 08/07/2020 |
| Project Location: | 543519AV Gompers Elementary School | Date Analyzed: | 08/07/2020 |
| Analyte Requested: | Lead | Date Report Issued: | 08/07/2020 |
| Method | Test Method: NIOSH 9100 / NIOSH 7082 | | |
| Matrix: | Wipe | | |

| Lab Sample # | Client Sample ID | Sample Description | Sample Location | Sampled Area (ft2) | µg / sample | µg/ft2 | Reporting Limit (µg/sample) |
|--------------|------------------|-----------------------|-----------------|--------------------|-------------|--------|-----------------------------|
| 20080702.01 | 01 | Room 101 | n/a | 1.00 | <5 | <5 | 5 |
| 20080702.02 | 02 | Room 101A (Coat Room) | n/a | 1.00 | <5 | <5 | 5 |
| 20080702.03 | 03 | Room 101D (Restroom) | n/a | 1.00 | <5 | <5 | 5 |
| 20080702.04 | 04 | Blank | | | <5 | <5 | 5 |

Note: 1. Blank values were not subtracted from reported sample values; 2. Quality control results in this report are acceptable; 3. Results relate only to the items tested; 4. Batta Laboratories, Inc. is not responsible for sample collection, nor interpretations made by others; and 5. This report does not constitute endorsement by AIHA LAP, LLC., NVLAP and/or any other U.S. governmental agencies; 6. Lab results/calculations are reported in 2 significant figures. Clients data/measurements are reported as they were submitted; 7. EPA guidelines for clearance lead wipes have been set at the following levels: Floors not to exceed 10 ug/sq ft, window sills not to exceed 100 ug/sq ft, and window troughs not to exceed 400 ug/sq ft. Samples received in acceptable condition unless otherwise noted. 8. Clearance guidelines for OLHCHH, LBPHC and LHRD Grantees are set at the following levels: Floors not to exceed 10ug/sq ft, window sills not to exceed 100ug/sq ft, window troughs not to exceed 100ug/sq ft and porch floors not to exceed 40ug/sq ft. Samples received in acceptable condition unless otherwise noted. 9. This report must not be reproduced without the written approval of BATTA Laboratories.

Batta Lab strives on customer feedback to improve the quality of our services. Please e-mail your feedback to feedback@battaenv.com.

Analyst: Samusi Adediran

End of Report



QA/QC BY: 
N.C. Batta/R Shumate (QA/QC Officer)



Corporate Headquarters
6 Garfield Way
Newark, DE. 19713

Ph: (855) 86-BATTA
Fx: (302) 737-5764

Email: BattaLaboratories@battaenv.com
Web: <https://battaenv.com>

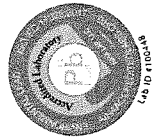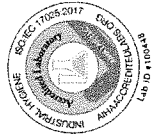

AIHA LAP, LL: 100448
NY ELAP: 11993
EPA Lab: DE004
MD Lab ID: 263

Page / of

CHAIN OF CUSTODY

BL Project #: L145320

| Customer Billing Information: | | Shipping Information | Turnaround Times (check one, refer to notes *) | Method of Payment |
|---|-------------------------------|--|---|---|
| Name: | SAP | <input checked="" type="checkbox"/> Picked up by BATTA <input type="checkbox"/> Delivered by customer <input type="checkbox"/> Shipped by customer | <input checked="" type="checkbox"/> 3 Hours / Rush (*Note 1) <input checked="" type="checkbox"/> 6-12 Hours (*Note 2) <input type="checkbox"/> 24 Hours (*Note 3) <input type="checkbox"/> 48 Hours (*Note 4) <input type="checkbox"/> 72 Hours (*Note 5) <input type="checkbox"/> 5-10 Days (*Note 6) <input type="checkbox"/> 5 Days (For Wholesale Clients Only) | <input type="checkbox"/> Cash <input type="checkbox"/> Visa/MasterCard/Discover <input type="checkbox"/> Money Order <input type="checkbox"/> Purchase Order # <input type="checkbox"/> Check # <input type="checkbox"/> Other |
| Billing Address 1: | | | | <input type="checkbox"/> Unit Price/Quote |
| Billing Address 2: | | | | <input type="checkbox"/> Total Payment |
| Phone: | | | | <input type="checkbox"/> Reference #: |
| Email: | jennifer.gabella@battaenv.com | | | |
| Results To: | Steve W. + J. Gabella | | | |
| * Notes Regarding Turnaround Times (TATs) Specific TATs depend on the test requested. TATs may not be available for all types of analysis. 1. Client must make arrangements with lab to guarantee 3 Hour/RUSH TAT - Call 1 (855)-862-2882 2. Unless a specific time is requested, results are guaranteed by 5pm on the same business day. 3. Unless a specific time is requested, results are guaranteed by 5pm on the following business day. 4. Unless a specific time is requested, results are guaranteed by 5pm on the 2nd business day. 5. Unless a specific time is requested, results are guaranteed by 5pm on the 3rd business day. 6. Unless a specific time is requested, results are guaranteed by 5 pm of the 10th business day. | | | | |

Client Project Information

| | | | | |
|---------------------------------------|--|---|--|--|
| Project Name: Gompers Elem. School | Project Location: 5701 Wynne Field Ave. Philadelphia, PA | If solid waste, will results be used for disposal in NJ? Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> | | Project #: 543519 AV Sampled By: J. Gabe/la |
| | | Were the samples collected in New York state? Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> | | |

Sample Information

[illegible]

Special Instructions From Client:

| | | | | | | | |
|--|--|--------------|------------|--|--|-------------------------|------------|
| Special Instructions From Client: | | | | Laboratory Use Only | | | |
| Sample Relinquished By: X <i>A. Sabella</i> | | Date: 8-7-20 | Time: 1418 | Logged-in by: JES | | Log-in Date: 8/7/20 | Date: 1430 |
| Sample Received By: | | Date: 8/7/20 | Time: 1425 | Field Samples Acceptable <input checked="" type="checkbox"/> Yes <input type="checkbox"/> No <input type="checkbox"/> On Ice | | Sample #: _____ | |
| | | | | | | Sample Condition: _____ | |

For drinking water samples: for results to be valid, lab must receive samples on ice and within 48 hours of collection. For air samples collected by NIOSH 7400 and 7402: in accordance with these NIOSH methods, two field blanks, (or 10% of the number of field samples submitted, whichever is greater) must be submitted and be analyzed with field samples.

For solid waste samples: Before solid waste materials such as soil, ash, sludge, dredge spoils, etc. are disposed in New Jersey, they must undergo analysis following TCLP protocol. BATTA Labs is not responsible for waste disposal misrepresentations on this document. Document Control Item AM5

BEA
JOP - 60 years



⑤ Lead Wipes

BATTA Laboratories, LLC

BL Sample Custody Transmittal Sheet

Project Information

| | |
|--|---------------------------------|
| BL Project # : <u>L145320</u> | BEA Project # : <u>5435194V</u> |
| Range of BATTA Lab Sample # : <u>10081901</u> | |
| Checked for Special Instructions (see CoC): <u>YES</u> | Initial if Checked |

Date of Preliminary Results Requested By:

8/21/20 1700

Date of Certificates Requested By:

Date & Lab Name for Outsourcing Sample(s):

Transmittal Information

Quality
Checked

Check a "✓" in the box to the right
when you have quality-checked the
package prior to handing off to the
next station.

| | Description of Activity | Date | Time | Initials |
|-------------------------------------|---------------------------------|----------------|-------------|------------|
| <input type="checkbox"/> | Sample Log-in by: | <u>8/19/20</u> | <u>1040</u> | <u>JES</u> |
| <input checked="" type="checkbox"/> | Sample Prep by: | <u>8/21/20</u> | <u>0830</u> | <u>SA</u> |
| <input checked="" type="checkbox"/> | Sample Analysis Completed by: | <u>8/21/20</u> | <u>1440</u> | <u>SA</u> |
| <input checked="" type="checkbox"/> | Report/Data Entry Completed by: | <u>8/21/20</u> | <u>1449</u> | <u>SA</u> |
| <input checked="" type="checkbox"/> | Report Scanned & Delivered by: | <u>8/21/20</u> | <u>1450</u> | <u>SA</u> |

Results given:

☒

email

check those that apply

☐

verbals

Details:

Write details such as
method of contact (email,
verbal, etc.) and the person
contacted

8/21/20

Date

1451

Time

RUE

8/25/20

Date

1200

Time

NR

Initials

QC and Signatory of Final Report

Dedicated to a Cleaner
Environment Since 1982





NY ELAP# 11993
PCM, PLM, TEM & LEAD



BATTA LABORATORIES, LLC
Delaware Industrial Park, 6 Garfield Way
Newark, DE 19713-5817
Tel. (302) 737-3376 Fax (302)-737-5764

Newark, DE - Columbia, MD -
Philadelphia, PA

Web: <http://www.battaenv.com>
E-mail: battaenv@battaenv.com

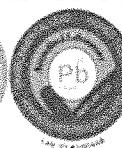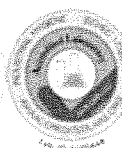

EPA Lab ID #DE004

NVLAP

Lab Code: 101032-0

REPORT OF ANALYSIS

| | | | |
|---------------------------|--------------------------------------|----------------------------|------------|
| Report#: | RP20082103 | Date Sampled: | 08/18/2020 |
| Project Number: | 20081901 | Sampled By: | C. Rhodes |
| Project Name: | Batta Environmental Associates | Date Received: | 08/19/2020 |
| Project Location: | 543519AV Gompers Elementary School | Date Analyzed: | 08/21/2020 |
| Analyte Requested: | Lead | Date Report Issued: | 08/21/2020 |
| Method | Test Method: NIOSH 9100 / NIOSH 7082 | | |
| Matrix: | Wipe | | |

| Lab Sample # | Client Sample ID | Sample Description | Sample Location | Sampled Area (ft ²) | µg / sample | µg/ft ² | Reporting Limit (µg/sample) |
|--------------|------------------|--------------------------|-----------------|---------------------------------|-------------|--------------------|-----------------------------|
| 20081901.01 | PB-01 | 2nd Floor Boys Bathroom | n/a | 1.00 | <5 | <5 | 5 |
| 20081901.02 | PB-02 | 2nd Floor Girls Bathroom | n/a | 1.00 | <5 | <5 | 5 |
| 20081901.03 | PB-03 | 1st Floor Boys Bathroom | n/a | 1.00 | <5 | <5 | 5 |
| 20081901.04 | PB-04 | 1st Floor Girls Bathroom | n/a | 1.00 | <5 | <5 | 5 |
| 20081901.05 | PB-05 | Blank | | | <5 | <5 | 5 |

Note: 1. Blank values were not subtracted from reported sample values; 2. Quality control results in this report are acceptable; 3. Results relate only to the items tested; 4. Batta Laboratories, Inc. is not responsible for sample collection, nor interpretations made by others; and 5. This report does not constitute endorsement by AIHA LAP, LLC., NVLAP and/or any other U.S. governmental agencies; 6. Lab results/calculations are reported in 2 significant figures. Clients data/measurements are reported as they were submitted; 7. EPA guidelines for clearance lead wipes have been set at the following levels: Floors not to exceed 10 ug/sq ft, window sills not to exceed 100 ug/sq ft, and window troughs not to exceed 400 ug/sq ft. Samples received in acceptable condition unless otherwise noted. 8. Clearance guidelines for OLHCHH, LBPHC and LHRD Grantees are set at the following levels: Floors not to exceed 10ug/sq ft, window sills not to exceed 100ug/sq ft, window troughs not to exceed 100ug/sq ft and porch floors not to exceed 40ug/sq ft. Samples received in acceptable condition unless otherwise noted. 9. This report must not be reproduced without the written approval of BATTA Laboratories.


Batta Lab strives on customer feedback to improve the quality of our services. Please e-mail your feedback to feedback@battaenv.com.

Analyst: Samusi Adediran

End of Report

QA/QC BY: [Signature]
N.C. Batta/R Shumate (QA/QC Officer)

Dedicated to a Cleaner
Environment Since 1982

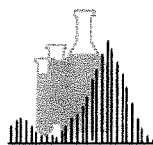

NY ELAP# 11993
PCM, PLM, TEM & LEAD




BATTA LABORATORIES, LLC
Delaware Industrial Park, 6 Garfield Way
Newark, DE 19713-5817
Tel. (302) 737-3376 Fax (302)-737-5764
Newark, DE - Columbia, MD -
Philadelphia, PA

Web: <http://www.battaenv.com>
E-mail: battaenv@battaenv.com



EPA Lab ID #DE004



NVLAP
Lab Code: 101032-D

REPORT OF ANALYSIS

Report#: RP20121602

Project Number: 20121611

Project Name: Batta Environmental Associates

Project Location: PSD-Gompers School

Analyte Requested: Lead

Method: Test Method: NIOSH 9100 / NIOSH 7082

Matrix: Wipe

Date Sampled: 12/14/2020

Sampled By: Cleint

Date Received: 12/16/2020

Date Analyzed: 12/16/2020

Date Report Issued: 12/16/2020

| Lab Sample # | Client Sample ID | Sample Description | Sample Location | Sampled Area (ft ²) | µg / sample | µg/ft ² | Reporting Limit (µg/sample) |
|--------------|------------------|-----------------------------|-----------------|---------------------------------|-------------|--------------------|-----------------------------|
| 20121611.01 | 01 | Rm R-1 Wall 2 Floor | Flr. | 1.00 | <5 | <5 | 5 |
| 20121611.02 | 02 | Rm R-2 Wall 2 Floor | Flr. | 1.00 | <5 | <5 | 5 |
| 20121611.03 | 03 | Rm R-3 Wall 4 Floor | Flr. | 1.00 | 9.10 | 9.10 | 5 |
| 20121611.04 | 04 | Rm R-3 Left Bath Floor | Flr. | 1.00 | <5 | <5 | 5 |
| 20121611.05 | 05 | Rm R-3 Right Bath Floor | Flr. | 1.00 | 7.10 | 7.10 | 5 |
| 20121611.06 | 06 | Left Classrm-Lower Portable | | 1.00 | <5 | <5 | 5 |
| 20121611.07 | 07 | Blank | | 1.00 | <5 | <5 | 5 |

Note: 1. Blank values were not subtracted from reported sample values; 2. Quality control results in this report are acceptable; 3. Results relate only to the items tested; 4. Batta Laboratories, Inc. is not responsible for sample collection, nor interpretations made by others; and 5. This report does not constitute endorsement by AIHA LAP, LLC., NVLAP and/or any other U.S. governmental agencies; 6. Lab results/calculations are reported in 2 significant figures. Clients data/measurements are reported as they were submitted; 7. EPA guidelines for clearance lead wipes have been set at the following levels: Floors not to exceed 10 ug/sq ft, window sills not to exceed 100 ug/sq ft, and window troughs not to exceed 400 ug/sq ft. Samples received in acceptable condition unless otherwise noted. 8. Clearance guidelines for OLHCHH, LBPHC and LHRD Grantees are set at the following levels: Floors not to exceed 10ug/sq ft, window sills not to exceed 100ug/sq ft, window troughs not to exceed 100ug/sq ft and porch floors not to exceed 40ug/sq ft. Samples received in acceptable condition unless otherwise noted. 9. This report must not be reproduced without the written approval of BATTA Laboratories.

Batta Lab strives on customer feedback to improve the quality of our services. Please e-mail your feedback to feedback@battaenv.com.

Analyst: Hadiya Jolly

End of Report

QA/QC BY: [Signature]
N.C. Batta/R Shumate (QA/QC Officer)

2012/6/11





Corporate Headquarters
6 Garfield Way
Newark, DE. 19713



Plh: (855) 86-BATTA
Email: Battalaboratories@battaenv.com
Web: <https://battaenv.com>

Lab Code: 101032-0

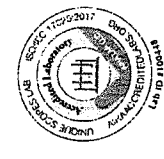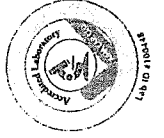

AIHA LAP, LL: 100448
NY ELAP: 11993
EPA Lab: DE004
MD Lab ID: 263

Page 1 of 1

CHAIN OF CUSTODY

| Customer Billing Information | | Shipping Information | | Turnaround Times (check one, refer to notes) | | Method of Payment | |
|--|----------------|--|--|--|--|---|--|
| Name: | BATTA | Picked up by BATTA | | <input type="checkbox"/> 3 Hours / Rush (*Note 1) | | <input type="checkbox"/> Cash | |
| Billing Address 1: | 6 Garfield Way | <input type="checkbox"/> Delivered by customer | | <input type="checkbox"/> 6-12 Hours (*Note 2) | | <input type="checkbox"/> Visa/MasterCard/Discover | |
| Billing Address 2: | | <input type="checkbox"/> Shipped by customer | | <input type="checkbox"/> 24 Hours (*Note 3) | | <input type="checkbox"/> Money Order | |
| Phone: | | | | <input checked="" type="checkbox"/> 48 Hours (*Note 4) | | <input type="checkbox"/> Purchase Order # | |
| Email: | | | | <input type="checkbox"/> 72 Hours (*Note 5) | | <input type="checkbox"/> Check # | |
| Results To: | Steve, Justin | | | <input type="checkbox"/> 5-10 Days (*Note 6) | | <input type="checkbox"/> Other | |
| * Notes Regarding Turnaround Times (TATs) | | | | (For Wholesale Clients Only) | | | |
| Specific TATs depend on the test requested. TATs may not be available for all types of analysis. | | | | | | | |
| 1. Client must make arrangements with lab to guarantee 3 Hour/RUSH TAT - Call 1 (855)-862-2882 | | | | | | | |
| 2. Unless a specific time is requested, results are guaranteed by 5pm on the same business day. | | | | | | | |
| 3. Unless a specific time is requested, results are guaranteed by 5pm on the following business day. | | | | | | | |
| 4. Unless a specific time is requested, results are guaranteed by 5pm on the 2nd business day. | | | | | | | |
| 5. Unless a specific time is requested, results are guaranteed by 5pm on the 3rd business day. | | | | | | | |
| 6. Unless a specific time is requested, results are guaranteed by 5pm on the 10th business day. | | | | | | | |
| Unit Price/Quote | | | | | | | |
| Total Payment | | | | | | | |
| Reference #: | | | | | | | |

| | | | |
|--|---|--|--------------------------|
| Project Name: Paint & Gypsum Plaster | Project Location: PSSD - Gompers School | Project #: 543519 AN | Sampled By: Justin James |
| If solid waste, will results be used for disposal in NJ? Yes <input type="checkbox"/> No <input checked="" type="checkbox"/> | | Were the samples collected in New York state? Yes <input type="checkbox"/> No <input type="checkbox"/> | |

Sample Information

| Lab Use Only | Field Sample ID# | Sample Location & Description | Sampling Date & Time | Sampling Info for Air / Surface Samples | | | | Sample Type | Test Method | Laboratory Use Only | |
|--------------|------------------|--------------------------------|----------------------|---|-----------|-----------|-------------|-------------|-------------|---------------------|------------------|
| | | | | Start Time | Stop Time | Flow Rate | Volume/Area | | | Results | Date of Analysis |
| | 01 | RM R-1 Wall 1 floor | 12/14/20 | | | | 12x12" | wipe | PLATE | | |
| | 02 | RM R-2 Wall 2 floor | | | | | | | | | |
| | 03 | RM R-3 Wall 3 floor | | | | | | | | | |
| | 04 | RM R-3 Left bath floor | | | | | | | | | |
| | 05 | RM R-3 Right bath floor | | | | | | | | | |
| | 06 | Left classroom - library port- | | | | | | | | | |
| | 07 | Blank | | | | | | | | | |

Special Instructions From Client:

| | | |
|---|----------------|------------|
| Sample Relinquished By: X [Signature] | Date: 12/14/20 | Time: 1615 |
| Sample Received By: [Signature] | Date: 12/14/20 | Time: 1615 |
| Logged-In by: [Signature] | | |
| Log-In Date: [Signature] | | |
| Field Samples Acceptable <input type="checkbox"/> Yes <input type="checkbox"/> No <input type="checkbox"/> On Ice | | |
| Sample #: | | |
| Sample Condition: | | |

For drinking water samples: for results to be valid, lab must receive samples on ice and within 48 hours of collection. For air samples collected by NIOSH 7400 and 7402: in accordance with these NIOSH methods, two field blanks. (or 10% of the number of field samples submitted, whichever is greater) must be submitted and be analyzed with field samples.

For solid waste samples: Before solid waste materials such as soil, ash, sludge, dredge spoils, etc. are disposed in New Jersey, they must undergo analysis following TCLP protocol. BATTA Labs is not responsible for waste disposal misrepresentations on this document. Document Control Item AM5



Appendix E. Environmental Firm Certification Documentation of Training

EHS TRAINING INSTITUTE, INC.

A Division of BATTA, Inc.

Certificate of Completion

1-Day Initial Delaware Lead Renovator (RRP)

English

Awarded To:

Justine James

6 Garfield Way, Newark, DE 19713

Who has successfully completed the attendance and testing requirements for this course.

EHS TRAINING INSTITUTE, INC.

A Division of BATTA, Inc.

Delaware Industrial Park • 6 Garfield Way

Newark, DE 19713-5817

(302) 737-3376 • Fax (302) 737-5764



Todd K. Zeisloft, Training Manager



Todd K. Zeisloft, Principal Instructor

Course Date: **December 4, 2018** Exam Date: **December 4, 2018**

Certification Number : **TP-RRP-I-18-0013R-00057**

DE Exp December 4, 2020

EPA Exp December 4, 2023

EHS TRAINING INSTITUTE, INC.

A Division of BATTA, Inc.

Certificate of Completion

4 Hour Refresher Delaware Lead Renovator (RRP)

English

Awarded To:

Jennifer Gabella

9945 Ravenhurst Rd, Baltimore, MD 21220

Who has successfully completed the attendance and testing requirements for this course.

EHS TRAINING INSTITUTE, INC.

A Division of BATTA, Inc.

Delaware Industrial Park • 6 Garfield Way

Newark, DE 19713-5817

(302) 737-3376 • Fax (302) 737-5764



Course Date: April 2, 2020 Exam Date: April 2, 2020

Certification Number : TP-RRP-R-18-0014R-20-00013

DE Exp April 2, 2022

EPA Exp April 2, 2025



Todd K. Zeisloft, Training Manager



Todd K. Zeisloft, Principal Instructor

EHS TRAINING INSTITUTE, INC.
A Division of BATTI, Inc.

Certificate of Completion

1-Day Initial

Delaware Dust Wipe Technician

EPA Lead Dust Sampling Technician

Awarded To:
English

Emlyn Drake

306 Buttonwood Road Landenberg, PA 19350

Who has successfully completed the attendance, hands-on, and testing requirements for this course.

EHS TRAINING INSTITUTE, INC.

A Division of BATTI, Inc.

Delaware Industrial Park • 6 Garfield Way
Newark, DE 19713-5817
(302) 737-3376 • Fax (302) 737-5764



Todd K. Zeisloft, Training Manager

Todd K. Zeisloft, Principal Instructor

Course Date: May 1, 2019 Exam Date: May 1, 2019
Certification Number : TP-DWT-I-18-0027-18-00001
DE Exp May 1, 2021 EPA Exp May 1, 2024

EHS TRAINING INSTITUTE, INC.
A Division of BATTI, Inc.

Certificate of Completion

1-Day Initial Delaware Lead Renovator (RRP)

English


Awarded To:
Emlyn Drake
306 Buttonwood Rd Landenberg, PA 19350


Who has successfully completed the attendance and testing requirements for this course.

EHS TRAINING INSTITUTE, INC.
A Division of BATTI, Inc.
Delaware Industrial Park • 6 Garfield Way
Newark, DE 19713-5817
(302) 737-3376 • Fax (302) 737-5764



Course Date: **March 21, 2019** Exam Date: **March 21, 2019**
Certification Number : **TP-RRP-I-18-0013R-00032**
DE Exp **March 21, 2021** EPA Exp **March 21, 2024**


Todd K. Zeisloft, Training Manager

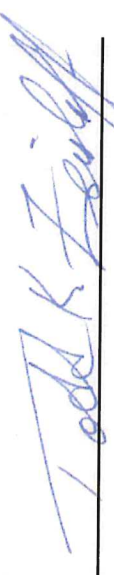
Todd K. Zeisloft, Principal Instructor