OVERSIGHT DURING LEAD PAINT STABILIZATION

For

Bodine High School for International Affairs #5150

1101 N. 4th Street Philadelphia, Pennsylvania

Prepared for:



SCHOOL DISTRICT OF PHILADELPHIA

Office of Environmental Management Services 440 North Broad Street Philadelphia, Pennsylvania 19130

Prepared by:



ACER ASSOCIATES, LLC

1012 Industrial Drive West Berlin, New Jersey 08091

September 6, 2022 EP# N/A Acer Project # SDP047

TABLE OF CONTENTS

- 1.0 EXECUTIVE SUMMARY
- 2.0 SCOPE OF WORK
- 3.0 ENGINEERING CONTROLS AND WORK PROCEDURES
- 4.0 ACER SURVEILLANCE
- **5.0 CLEARANCE**
- 6.0 SIGNATURES OF ENVIRONMENTAL PROFESSIONALS
- 7.0 APPENDICES

APPENDIX A DAILY LOGS

APPENDIX B SDP SPREADSHEETS

APPENDIX C ACER RRP CERTIFICATE

APPENDIX D SDP RRP CERTIFICATES

APPENDIX E LEAD SAFE CERTIFICATE



1.0 EXECUTIVE SUMMARY

Acer Associates, LLC (ACER) provided project oversight and related inspection services during the stabilization of lead-based paint at Bodine High School for International Affairs.

The lead-based paint stabilization was conducted by School District of Philadelphia Painters.

All work was completed in accordance with Section 18, Lead Reduction Plans, of the Project Safety Manual for the School District of Philadelphia, Office of Capital Program and EPA's Lead Renovation, Repair, and Painting (RRP) Rule.

ACER provided Certified Renovators Kevin Rumbol (R-I-18846-20-00009), Kevin Price (R-I-18846-20-00073), Ronald Rominski (R-I-99273-21-05559), Sal Procopio (R-I-99273-21-05558) and Ryan Hicks (R-I-99273-22-02457) throughout the duration of the project. These services were provided August 2, 2021, through August 31, 2021, September 17, 2021, through October 25, 2021 and July 1, 2022 through August 3, 2022.

2.0 SCOPE OF WORK

The scope of work included the stabilization of damaged lead-based paint throughout the school on various components of various substrates.

3.0 ENGINEERING CONTROLS AND WORK PROCEDURES

Engineering controls and work procedures were performed in accordance with Section 18, Lead Reduction Plans, of the Project Safety Manual for the School District of Philadelphia, Office of Capital Program and EPA's Lead Renovation, Repair, and Painting (RRP) Rule.

4.0 ACER SURVEILLANCE

Contractor oversight was conducted by ACER throughout the project. The purpose was to document Contractor's compliance with Section 18, Lead Reduction Plans, of the Project Safety Manual for the School District of Philadelphia, Office of Capital Program and EPA's Lead Renovation, Repair, and Painting (RRP) Rule.

Copies of ACER's daily logs, which include a summary of the stabilization activities, have been provided as Appendix A.

5.0 CLEARANCE

At the completion of the lead paint stabilization in each work area the certified renovator used a damp disposable cleaning cloth to wipe the horizontal surface to compare to the wipe to the verification card.



6.0 SIGNATURES OF ENVIRONMENTAL PROFESSIONALS

Prepared By:

Kristen Masotes, CMC

Project Manager

Review By:

Scott Horn, PG, CHMM, LSRP, CMC

President



7.0 APPENDICES



APPENDIX A

DAILY LOGS

ACER ASSOCIATES, LLC.

CONSTRUCTION REPORT

PROJECT: Bodine HS	DATE: 9/17/2021
CLIENT: SDP	TECHNICIAN: Kevin Rumbol
CONTRACTOR:	Tr 10
PROJECT #:	SIGNATURE: Kerrelinery
110JLC1 # .	SIGIVATORE.
Visitors	Representing
Kevin Rumbol	ACER Associates, LLC
TOTAL TOTAL	7.02.17, 1000010.100, 120
2:00 pm. Kavin Pumbal of ACEP and the lead shatement	contractors arrive on site and gain access to the building. The
lead contractors will wait for the building to empty of teache	
	ctivities. Workers will continue painting the hallway on the third
floor and in the stairwell across from 104 and will continue to	
abatement activities.	
5:00 pm - The lead contractors continue their activities.	
6:00 pm - The contractors go on break.	
7:00 pm - The contractors return from break and continue w	vith their activities.
8:00 pm - The lead contractors continue their activities.	
9:00 pm - The lead contractors continue their activities. 10:00 pm - The lead contractors continue their activities.	
11:00 pm - The lead contractors continue their activities.	aht and begin packing their equipment
11:30 pm - ACER and the lead abatemeth contractors depart	
12:00 am - ACER arrivess at their office in West Berlin, NJ.	

Page I of

PROJECT: Bodine HS	DATE: 10/12/2021
CLIENT: SDP	TECHNICIAN: Kevin Rumbol
CONTRACTOR:	71 10
PROJECT #:	- SIGNATURE: Kainflyner
Visitors	Representing
Kevin Rumbol	ACER Associates, LLC
3:00 pm - Kevin Rumbol of ACER and the SDP Lead contra	actors arrive on site.
,	ACER and the SDP lead contractors enter the building. The
contractors head to paint in the first floor hallway, the stairv	·
4:30 pm - The contractors continue painting and head to the abatement.	e second floor bathrooms to begin setting up for lead paint
5:30 pm - The contractors continue painting and continue s	setting up in the second floor bathrooms.
6:30 pm - The contractors continue painting and continue s	• •
7:30 pm - The contractors continue painting and continue s	
contractors will hold off on starting in the second floor men'	
•	red scraping the paint in the second floor women's bathroom.
9:30 pm - The contractors continue painting and continue s	nt in the second floor women's bathroom.
removing the plastic sheeting. The contractors continue par	
- · · · · · · · · · · · · · · · · · · ·	n's bathroom and the samples pass. The contractors begin
putting their equipment away for the day.	, ,
11:30 pm - ACER and the contractors depart from the site.	
12:00 am - ACER arrives at their office in West Berlin, NJ.	

Page I

PROJECT: Bodine HS	DATE:	10/13/2021
CLIENT: SDP	TECHNICIAN:	Kevin Rumbol
CONTRACTOR:	· -	7/ 10
PROJECT #:	SIGNATURE:	Kernfuner
Visitors	Represe	nting
Kevin Rumbol	ACER Associates, LI	LC
3:00 pm - Kevin Rumbol of ACER and the SDP Lead contra	actors arrive on site	
3:30 pm - The building has cleared of school workers and A		ad contractors enter the building. The
contractors head to paint in the first and fourth floor hallway	s and the stairwell do	ors and will continue their work in the
second floor women's bathroom. The contractors will be wo	orking on the damage	d plaster in the second floor women's
restroom. 4:30 pm - The contractors continue painting the first and fo	urth floor hallwavs and	d continue their work in the second floor
women's restroom.	,.	
5:30 pm - The contractors continue painting the first and for	urth floor hallways and	d continue their work in the second floor
women's restroom. 6:30 pm - The contractors continue painting the first and fo	urth floor hallways and	d continue their work in the second floor
women's restroom.	arar noor namayo an	
7:30 pm - The contractors continue painting the first and for	urth floor hallways and	d continue their work in the second floor
women's restroom. 8:30 pm - The contractors continue painting the first and fo	urth floor hallways and	d continue their work in the second floor
women's restroom.	arti noor namvayo ark	a continue their work in the cocona neer
9:30 pm - The contractors continue painting the first and for	urth floor hallways and	d continue their work in the second floor
women's restroom. 10:30 pm - The contractors continue painting the first and f	ourth floor hallways a	nd continue their work in the second floor
women's restroom.	·	
11:00 pm - The contractors begin putting their equipment a	way for the night.	
11:30 pm - ACER and the contractors depart from the site. 12:00 am - ACER arrives at their office in West Berlin, NJ.		
,,		

Page I

PROJECT: Bodine HS	DATE: 10/14/2021
CLIENT: SDP	TECHNICIAN: Kevin Rumbol
CONTRACTOR:	11 M
PROJECT #:	SIGNATURE: Karnfliner
	-
Visitors	Representing
Kevin Rumbol	ACER Associates, LLC
3:00 pm - Kevin Rumbol of ACER and the SDP Lead contra	actors arrive on site.
	ACER and the SDP lead contractors enter the building. The
	e stairwell doors and will continue their work in the second floor
women's bathroom. Work in the hallway from the fan room the school workers are done removing the trash from the b	to the boiler room in the basement will be started today after
_	and continue working on the paint in the second floor women's
bathroom. The contractors begin setting up the work area in	· · · · · · · · · · · · · · · · · · ·
basement.	•
5:30 pm - The contractors continue their painting activities	
women's bathroom and hallway from the fan room to the bo	
6:30 pm - The contractors continue their painting activities a women's bathroom and hallway from the fan room to the bo	e ,
7:30 pm - The contractors continue their painting activities	
women's bathroom and hallway from the fan room to the bo	e ,
8:30 pm - The contractors continue their painting activities	
women's bathroom and hallway from the fan room to the bo	
9:30 pm - The contractors continue their painting activities	e ,
women's bathroom and hallway from the fan room to the bo 10:30 pm - The contractors continue their painting activities	
women's bathroom and hallway from the fan room to the bo	
·	e boiler room in the basement has been completed and the
contractors begin putting their equipment away for the nigh	t.
11:30 pm - ACER and the contractors depart from the site.	
12:00 am - ACER arrives at their office in West Berlin, NJ.	

Page I

PROJECT: Bodine HS DATE: 10/15/2021 CLIENT: SDP TECHNICIAN: Kevin Rumbol CONTRACTOR: PROJECT #:

Visitors	Representing	
Kevin Rumbol	ACER Associates, LLC	

3:00 pm - Kevin Rumbol of ACER and the SDP Lead contractors arrive on site.

3:30 pm - The building has cleared of school workers and ACER and the SDP lead contractors enter the building. The contractors head to paint the hallway from the fan room to the boiler room in the basement, the first floor hallway, third floor hallway, and the fourth floor hallway.

4:30 pm - The contractors continue their painting activities.

5:30 pm - The contractors continue their painting activities and have started getting ready to scrape the paint in the Principal's Office. The contractors have also begun painting in the Main Office. No lead abatement will be done in the Main Office.

6:00 pm - The contractors have also started painting the Boy's Restroom in the basement. No lead abatement was done in this room either.

6:30 pm - The contractors have started setting up in the boy's bathroom on the second floor.

7:00 pm - ACER has cleared the stairwell on the boy's side

7:30 pm - The contractors continue scraping the paint in Scraping of the paint in the second floor Boy's bathroom

8:30 pm - The contractors continue scraping the paint in Scraping of the paint in the second floor Boy's Bathroom

9:30 pm - The contractors have finished scraping the pai abatement activities in the second floor Boy's Bathroom

10:30 pm - The contractors have finished their abatement ACER clears the work area.

11:00 pm - The contractors begin putting their equipmer

11:30 pm - ACER and the contractors depart from the si

12:00 am - ACER arrives at their office in West Berlin, N

the Principal's office and continue painting in the other areas. has started. the Principal's office and continue painting in the other areas. and in the Principal's Office continues. int in the Principal's Office. The contractors continue their anc continue painting in the other areas. In activities in the second floor Boy's bathroom for the night and		
nt away for the night. te. IJ.		
Page I of I		

PROJECT: Bodine HS	DATE:	10/19/2021
CLIENT: SDP	TECHNICIAN:	Kevin Rumbol
CONTRACTOR: SDP	_ _	11 12
PROJECT # : SDP048	SIGNATURE:	Kerellener
Visitors	Represe	nting
Kevin Rumbol	ACER Associates, L	
3:00 pm - Kevin Rumbol of ACER and the SDP Lead contr	rootoro arrivo an aita	
is contractors head to continue painting the main office and to contractors head to continue painting the main office and the second floor boy's bathroom. Another worker heads to the or lead paint removal. is 30 pm - The Vestibule outside Assistant Principal's Office (330 pm - Lead abatement in the Vestibule outside Assistant attarted. The contractors continue plastering in the second (330 pm - The contractors have finished painting in the Principal begin final cleaning of the work area. Plastering and pair (330 pm - The contractors have finished the final cleaning of the room passes inspection with 9 wet wipes. Plastering of the room passes inspection with 9 wet wipes. Plastering of the room passes inspection with 9 wet wipes. Plastering of the room passes inspection with 9 wet wipes. Plastering of the second floor boy's bathroom and the plastering in the second floor boy's bathroom and the plastering in the second floor boy's bathroom and the plastering in the second floor boy's bathroom and the plastering in the vestibule outside Assistant Principal (1) princi	ACER and the SDP le he principal's office an Vestibule outside Asse has been set up and ant Principal's Office has floor Boy's Bathroom ancipal's Office and have anting activities continued in the Principal's Office continues in the second been started in the second in the Vestibule outside in t	Id head to continue plastering in the istant Principal's Office to begin setting up lead paint removal is started. It is been completed and plastering is and painting activities continue. It is removed the plastic. The contractors ue. It is and a final verification is performed. If it is greatly a floor Boy's Restroom and in the econd floor Women's Restroom. It is is a Assistant Principal's Office continue. It is a Assistant Principal's Office continue. It is a Completed and the contractors have

Page I of

PROJECT: Bodine HS	DATE: 10/20/2021
CLIENT: SDP	TECHNICIAN: Kevin Rumbol
CONTRACTOR: SDP	71 6
PROJECT # : SDP048	SIGNATURE: Karalay
No. 1.	
Visitors Kevin Rumbol	Representing ACER Associates, LLC
(Cevili Nambol	AGENT ASSOCIATION, LEG
contractors head to the Gym Storage in the stairwell to be contractors head to the Large Library Closet closest to H 4:30 pm - The Gym storage in the stairwell has been set Closet closest to Hallway and second floor boy's bathroom 5:30 pm - Lead paint abatement in the Gym Storage in the Hallway and second floor boy's bathroom continue. 6:30 pm - Lead paint abatement in the Gym Storage in the Hallway and second floor boy's bathroom continue. The 67:30 pm - Lead paint abatement in the Gym Storage in the Walls. Painting activities continue 8:30 pm - Plastering in the Gym Storage in the stairwell and pm - Plastering in the Gym Storage in the stairwell and pm - Plastering in the Gym Storage in the stairwell and pm - Plastering in the Gym Storage in the stairwell and pm - Plastering in the Gym Storage in the stairwell and pm - Plastering in the Gym Storage in the stairwell and pm - Plastering in the Gym Storage in the stairwell and pm - Plastering in the Gym Storage in the stairwell and pm - Plastering in the Gym Storage in the stairwell and pm - Plastering in the Gym Storage in the stairwell and pm - Plastering in the Gym Storage in the stairwell and pm - Plastering in the Gym Storage in the stairwell and pm - Plastering in the Gym Storage in the stairwell and pm - Plastering in the Gym Storage in the Stairwell and pm - Plastering in the Gym Storage in the Stairwell and pm - Plastering in the Gym Storage in the Stairwell and pm - Plastering in the Gym Storage in the Stairwell and pm - Plastering in the Gym Storage in the Stairwell and pm - Plastering in the Gym Storage in the Stairwell and pm - Plastering in the Gym Storage in the Stairwell and pm - Plastering in the Gym Storage in the Stairwell and pm - Plastering in the Gym Storage in the Stairwell and pm - Plastering in the Gym Storage in the Stairwell and pm - Plastering in the Gym Storage in the Stairwell and pm - Plastering in the Gym Storage in the Stairwell and pm - Plastering in the Gym Storage in the Stairwell and pm - Plastering in the Gym Storage in the	d ACER and the SDP lead contractors enter the building. The begin setting up the work area to remove the lead paint. The other lallway and second floor boy's bathroom to paint. up and lead paint removal is started. Painting in the Large Library on continue. The stairwell and painting in the Large Library Closet closest to contractors return to painting the second floor women's restroom. The stairwell is completed and the contractors begin plastering the land painting activities contiue. The stairwell activities contiue.

Page _____ I ___ of _____

PROJECT: Bodine HS	DATE: 10/21/2021
CLIENT: SDP	TECHNICIAN: Kevin Rumbol
CONTRACTOR: SDP	7/ 10
PROJECT #: SDP048	- SIGNATURE: Karnfliner
•	-
Visitors	Representing
Kevin Rumbol	ACER Associates, LLC
3:00 pm - Kevin Rumbol of ACER and the SDP Lead contr	
•	ACER and the SDP lead contractors enter the building. The
· ·	and will continue painting in the second floor bathrooms, in airwell, and in the Large Library Closet closest to Hallway.
	Counselor's Office and have begun scrapoing the damaged
paint. Painting activities continue.	3 1 3 3
	npelted and the contracors begin plastering. Painting activities
continue.	a activities continue
5:30 pm - Plastering in the Counselor's Office and painting7:30 pm - Plastering in the Counselor's Office and painting	
3:30 pm - Plastering in the Counselor's Office and painting	
9:30 pm - Plastering in the Counselor's Office has been co	•
	Counselor's Office. The Counselor's Office has passed with 5
wet wipes. Painting activities continue.	oursy for the night
11:00 pm - The contractors begin putting their equipment at 11:30 pm - ACER and the contractors depart from the site.	
12:00 am - ACER arrives at their office in West Berlin, NJ.	

Page I

PROJECT: Bodine HS	DATE:	10/22/2021
CLIENT: SDP	TECHNICIAN:	Kevin Rumbol
CONTRACTOR: SDP		11 M
PROJECT #: SDP048	SIGNATURE:	Kernfuner
Visitors	Represe	nting
Kevin Rumbol	ACER Associates, L	
2:00 nm. Kovin Rumbol of ACER and an SDR contractor a	rrivo on cito	
3:00 pm - Kevin Rumbol of ACER and an SDP contractor all 3:30 pm - The building has cleared of school workers and A informed that the rest of the contractors will be arriving afer painting the Counselor's, the second floor Boy's Bathroom, Closet closest to Hallway. The contractors will also finish so Room. 4:00 pm - The rest of the contractors arrive on site and beg been performed in the Gym Storage in Stairwell. Both wet whas dried. The room passes with three dry wipes. 5:00 pm - Two SDP contractors head to the Gym Office (00 activities continue. 6:00 pm - Pre-cleaning in the Gym Office (005B) has been aer started in the Gym Office (005B). Abatement work in the activities continue. 7:00 pm - Abatement work in the Hallway from Fan Room to activities continue. 8:00 pm - Painting in the second floor Boy's Bathroom has second floor Boy's Bathroom passes with 5 wet wipes. Abatemed floor Boy's Bathroom passes with 5 wet wipes. Abatemed floor Boy's Bathroom passes with 5 wet wipes. Abatemed floor Boy's Bathroom passes with 5 wet wipes. Abatemed floor Boy's Bathroom passes with 5 wet wipes. Abatemed floor Boy's Bathroom has second floor Boy's Bathroom passes with 5 wet wipes. Abatemed floor Boy's Bathroom has second floor Boy's Bathroom passes with 5 wet wipes. Abatemed floor Boy's Bathroom has second floor Boy's Bathroom passes with 5 wet wipes. Painting activities from Fan Room to Boiler Room for the night. 11:00 pm - Clean up in the Hallway from Fan Room to Boil clean. The contractors begin putting their equipment away for the contractors depart from the site. 12:00 am - ACER arrives at their office in West Berlin, NJ.	ACER and the SDP was recieving COVID tests. Room 105, the confectaping and painting the craping and painting the properties of the craping and painting the craping and painting the present of the craping and painting the present work and the contraction of the completed and the contraction of the complete of the	ting. Today's activities will consist of brence room, and in the Large Library the Hallway from Fan Room to Boiler are areas listed. Verification testing has so dry wipes are used after the room uning for abatement activities. Painting area has been set up. Abatement activities from to Boiler Room and painting the Gym Office (005B) and painting a final verification test is performed. The sym Office (005B) has been completed to Boiler Room and painting activities come begin the final cleaning. Abatement ue. Perification test has been performed. The contractors begin cleaning up the Hallway

Page I

PROJECT: Sola 15. CLIENT: SOP CONTRACTOR: SOP 047	DATE: 7/20/22 TECHNICIAN: Byen Hilly SIGNATURE: FIRE
Visitors	Representing
Ryon Miks	Acer
SPP Printes Funk @ 11:00am Seson e 11:30	5 DP
7:00an Acer arrival onsite 7:00an Acer walker Let us into the 1 7:30 Acer walker test sailed. 8:00an Sixt Swiffer test Sailed. 8:55an Foreman, Season Sates Contacted in the Stage night room 10:15an Site Inspected, Realing Paint is 10:45an Acer in spected the 30 Sa 12:00pm Acer did a Final walk through	Sell worthern Sell worthern Short Right Chipaly on newly Right Pire Sive was Sixed 201 Swifter Soiled Siffering - Failure of of the days We to got Sit tested @ 2:00pm.

Page _____ of ____

PROJECT: Bodine M.S	DATE: 7//9/22	
CLIENT: SDP	TECHNICIAN: Byon H. W.S	
CONTRACTOR: SDP	SIGNATURE:	
PROJECT#: SDP 047		
Visitors	Representing	
Ryon Hichs	Ace	
SDP Painter	Ace-	
7:00an Acer on site		
7/14 m Acer enter Sthool with Pain	kis	
130am Acer walker though the ac	When to Check Agency	
1,115an Acr SPOKE with SPP Pair	was about swiffming	
Y. Our Her includ the wer Lea	15 of School & Chipped Part	
10:30m Ace inspected the audition		
henores.	<u> </u>	
12:13 Acen inspected the auditor		
3:00 Acr juglished the will are	a. Ader was told by SPP Printers	
3:190 Acer Left Ser the day with Rente	/	
3:100 Acer Left Sorthe day with Panks	}	
· / ·		
- / ///		
1 111		
1 41		

PROJECT: Bruing Its CLIENT: School Districts of Philly CONTRACTOR: PROJECT #:	TECHNICIAN: SIGNATURE: MACHINE MACHI
Visitors	Representing
Ayen Holy Vine Kisell SDP Palates	SOP
7:00 an Acer on Site (Vinu 3 Basen	
7/19am Azer eptis School	
7:25 cm Act did a wall through of the Of the School to Look at Puntchips	or bullstyre side rooms and other party
11/colon from Insteads Stage orens	
Kills Hear Insteer	
2:30 Ace Stake to SPP and they	Finished for the day Accorded
AC	
	Page of

PROJECT: Bodine HS	DATE:	10/25/2021
CLIENT: SDP	TECHNICIAN:	Kevin Rumbol
CONTRACTOR: SDP		7/ 10
PROJECT # : SDP048	SIGNATURE:	Kernfuner
Visitors	Represe	nting
Kevin Rumbol	ACER Associates, L	LC
200 and Maria Durahal of ACED and an CDD and an aced	mine an aite and anie	The CDD
3:00 pm - Kevin Rumbol of ACER and an SDP contractor a contractors head to the Hallway from Fan Room to Boiler R		_
ounge to start prepping for lead paint abatement.	Oom to misir their ac	uvities and to the mist hoof teachers
3:15 pm - The SDP contractors begin setting up to scrape t	he paint from the first	floor teacher's lounge.
4:30 pm - Scraping of the paint in the first floor teacher's lo	unge has been compl	eted and the contractors have started
plastering the wall. 5:30 pm - Plastering in the first floor teacher's lounge has b	oon stoorstad and the	appropriate return to pointing in the
Hallway from Fan Room to Boiler Room.	een staerned and the	contractors return to painting in the
6:30 pm - Plastering has been completed in the first floor te	acher's lounge and th	ne contractors have begun painting. The
contractors continue painting in the Hallway from Fan Roon	n to Boiler Room.	
7:30 pm - Painting activities continue.		
3:30 pm - Painting activities continue. 3:30 pm - Painting has been completed in both the first floo	ur teacher's lounge an	d in the Hallway from Fan Room to Roiler
Room. The contractors perform a final cleaning of the work		d in the Hallway hom i an Room to Boller
10:30 pm - Final verification has been performed and both		tractors begin putting their equipment
away for the night.		
11:00pm - ACER and the contractors depart from the site. 11:30 pm - ACER arrives at their office in West Berlin, NJ.		
11.30 pm - ACEIX arrives at their office in West Berlin, No.		

Page I

PROJECT: BODING H-S	DATE: 7/15/22
CLIENT: SOF	TECHNICIAN: SAL PROCODIO
CONTRACTOR: SNP	SIGNATURE: Selfry
PROJECT#: 500047	
Visitors	Representing
SAZ PROCOPIU	ACER
SOP PRINTERS (6)	
SPP FORENAN - SONSAN 19	1821
RINA HICK	ACRE
	NE OV
	DINTING IP- PRATEM
1:45 VORK BEBINS 1 + RIGHT STAIRWELL	NINI JULY JEST DE LES
900 WAZKTHEU, - NOR	E Kum DREW SPAKKING + DUST
on Right STAIR ROOM.	TALLED W/ SH (FREMON) + UNGO)
CTORE WILL WAR - JULIKK	ER ONED
10:30 RIGHT RM CIBARD.	unktiku OF LEXTRM-
WINDOWS ORN WHILE CIV	
11:15 ACER WALKER FAM	Cu. RT STAIRWELL cumple us
LEIST STRUCK PLASTIC S	STILL IN USE WICHIPS an
FLOOR. WINDOWS OPEN- AC	er suell Foremon
1:30 LET STIMELO -W	innou ceusep.
2:00 STOPE IN NUPIT.	
230 STATE CENTRE	ACK DEGIONED
1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1	

PROJECT: BODING H-S CLIENT: SOP CONTRACTOR: SOP PROJECT #: SOP 047	DATE: 7 14 82 TECHNICIAN: 5A2 PROCOPN SIGNATURE: Laff2
Visitors	Representing
SOP PAWDERS (6)	rcer
7:15 rue Name	>
545 PROJ RM PAINI	TING IN PRUTRESS (WALLS)
J READ RUNS - STREED	NO + SPOCKE IN PRUMIS UP - 2 DE SWIFTER CLARIC.
3 WIRES (3X), - AU FA	ILED W SILL ZX FRILED
FLOTA STRIN / SEAL	word out
11 or BLENK - POINTINE	on left
IPM NO CHANGES	- in tem
JAM NOWORK	
2:38 Area DEPOSTS -	STA)= COMMA
1	

of

Page

PROJECT: BODINO N-C	DATE: 7/12/27
	DATE ///3/
CLIENT: 500	TECHNICIAN: SAT PRICEDON
CONTRACTOR: 50f	SIGNATURE:
PROJECT #: 500047	
Visitors	Representing
SAL PROCEDIO	Acer
SERSAN PAUL	5DP KIREMON
SOP BAINTERS	6 STRFF
7:15 ACOR ON SITE -	deltes out in Audit
7:30 WORK GROW IN PEX	OR STAIR DROME-PLASTIC
900 PROJECTION RUM	PRATK REMINED
PAINTING IP.	- to a de Dion our
11 AM BREEZE - STATES	BIGUN: PAST RM-PANTINE
1) MISSING SCHOOLING	1014 SPRIADSAT
11:18 CATLED SEASAN ?	TO DSE ABOUT MUSING
SIGN PRINSTIC ON STELL	05.
11,25 Senson INDICATED	STEPS ARE SAKETY
BAZIRO SO NO PLAS	TIC SIGN TO BE RODER
I DM WORK IF KEM	C ROOMS; SIEN UP ON BOTH DM
2PM BREAK	

PROJECT: 1300) NO HS	DATE: 7/12/22	~
CLIENT: 50R	TECHNICIAN: SAL PROCOD	90
CONTRACTOR: 51	SIGNATURE:	
PROJECT #: 50P 047		
Visitors	Representing	
SAL PROLUND	acer	11
SEASAN HALL	SDD PONEMIN	1
SOP PRINTERS (8)		
1: DU ACER ON SIFE		/
L. OC.	IT -SWIFFER BEINS	(
800 Revew W/ Kesel	1 2 2 2 1 1 2 1	/
about SWIFFER, VER	IFUN UMIT 3x.	
	ne - PITIPOS TARRON	/
WAM SUPPER Rand	2 - PASS. Done	
11 AM BLEAK AUDIT =		/
I PM PLASTIC BECINS	IN LEFT STACE STAIRWELL	-
JIM MIKE (ENV OFFE	STOPPED IN UIU	/
WALTERALIA.	NO DECUN PLASTIC IR	
110 J	NG REEGIV, PENSII - II	
3:15 STAFF STUTOUM	IN QUAIT/RITE.	
3 20 NOR DEPART		+
10. 121		V
		1
		1
	1	- 1
+		
		. 1
		1
		1
		<
	Page) of	1

PROJECT: BODINE H-5	DATE: 7/11/22
CLIENT: SOP	TECHNICIAN: ISBILL PROEFIU
CONTRACTOR: 500	SIGNATURE: Colory
PROJECT#: SOP 047	- -
	Po-wee-ting
Visitors VIA - C - VIA	Representing
SAL PROCPIL SENSALIYALL	
1	500 Foremou
SDO PAINDERS	(7) STATE
7:10 NOR ON SITE	DID 7 1/15 COUNT I F IM COUNT
7:45 WERK BROWE IN 9:15 WILK IN AUDIT.	LEANING IP. STAYE ASTED
me TO LEAVE BURING	
11100 WALKTHRU DURING	
PICTUREL PLANTS WEI	FROM MOPPING
12:30 MORDING /CUANI	NE IP
1140 BOLAK NO C	of ANGO
hyo Lifes out	Nur Cuses
·	
	Page of

PROJECT: BOOING IN-5 CLIENT: 50P CONTRACTOR: 50P SIGNATURE: CONTRACTOR: SIGNATURE: CONTRACTOR: CONT	
CLIENT: 50P TECHNICIAN: SAZ PROTOPIO	
CONTRACTOR: SIGNATURE: SIGNATURE:	
CONTRACTOR: SIGNATURE: SIGNATURE:	
PROJECT #:	
Visitors Representing	
4.00	
SDP PAINTERS (4)	
SERSAN HALL SDO FOREMAN	61
	80
7:00 SOP STAFF IN LOT, MER APPINES >104	1
7:20 REVIEW W FERENTI. BER TD (SOP) TRASI	
UNDER JUD LBS CAN GO IN REG DUMPSTERS, SOF	
LANTE MURO DOTAIL.	
7:40 DOR OBSERVES WATER MIST GOINE ONTO	
PLUOR/PLASTIC	(
9:20 BREAK PICTURES PLASTIC REMOVAL IN PROPER	/
in PLASTIC REMINAR 18	
12:20 persoic in tresposites, incumine Plank	<
130 SERSAN STUPPED BY - WERK IP SOMEAN	/
WILL LET ME KNOW NEXT WEEK, WHEN SV 15	
Reno V.	
	-
2 PM COCRED FLIFES OUT	
./	
	>
4	
Page of	

	-1-1-
PROJECT: BODING H-5	DATE: 7/7/22
CLIENT: 50P	TECHNICIAN: 502 PROCESSION
CONTRACTOR: 505	SIGNATURE: Selfer
PROJECT #: SOF	
Visitors	Representing
SAL PROCUMON	week
SOP An invers	500
SOASAN 17 HLL	SOP FOREMAN
7:15 ACLR ON SIFE	· +x L vel D + 0 FOREMON
star Mant Reminder	TO USE WATER SPENCER
KUR REMOVAL OF PLAST!	C + More Sund PLASTIC
23 100.	at STAIRWAY.
7,40 WORK BEGINS 14	I AUDIT STAGE.
	TOPPE OU BRUNK
130 SOP TAKING DOWI	N PERSTIC ON STAGE
10',00 BILL 509 - FELLS	SCHOOL DUMPSFER. NUR
CTRASH) GOING INTO	ASAN TO VORIFY + ASH
+ 0 = 1 2011 dar	
	US JEN DOWNDED. RER
	GS TO GO IN BINS, NOT
Dump TSER	
12.0M MOPPING DON	
HAVE OUST, SO Jul MO	DOPNE DONNE, NOTER SWIFFERS
were DIRTV. TRUCK W/	STEEL BARRELLS NOW
ONSIDO EN TRASA	on site to review process.
I I I I SENTAN I	
3 BAGS IN OUNTS LOC IN	WILL BE REVIEWED W/ 500
FUREMANN + ACIR MINGIN	The me to the source of so
2130 SOP CLOSING LIFE	
240 Acor DOARTS	
1140 116016 20116	
	Prop.
	Page

PROJECT: BODING N-5	DATE: 7/6/22	
CLIENT: 506	TECHNICIAN: SXL PROCOPIU	
CONTRACTOR: SOF	SIGNATURE:	
PROJECT#: (DP		
	Representing	
Visitors	Representing	
SOP PRINTLARS (6) SAL PROROPIO		
SAL PROROPIO	nee 1	
	0 '/	
god ACOR ON 5148		
ARON + DUDIT - COLUMN	PIERS SPACKLED +	
TOUCHUR IP - NUBIT	5400	
That is a second	AIR RMS STILL HAVE	
50 MC ON R + 58005.	WIG FOR AUDIT TO	
KINISH RY CUST WIR	I Romove ITEMS	
3 AROAN		
2:30 LITES CLOSED -START DONE		
240 ACER DOPARTS		
h - /		
/		
	Page of]	

CONSTR	(OCTION REPORT
PROJECT: BODING H-5 CLIENT: SP CONTRACTOR: SDP PROJECT #: SDP	DATE: 7/5/22 TECHNICIAN: TAL PROCEDIO SIGNATURE: Cel Programme
Visitors	Representing
SAL PRUCEDIO SEASAN HALL	SOP FORMAN
SOP PAINTER	
7:15 ACER CN 5,75 7:40 WORK BOINS, 9 AM WALK THRU AU 11 AM PHATES TOKES	N AUDIT ISTAGE ADIT STAGE DOULE W BILL NO UT MINUM + CLISH LITES
	Pega / of /

PROJECT: BODING H-S CLIENT: SDP	DATE: 7/1/22 TECHNICIAN: Byen 11,249	
CONTRACTOR: SDP	SIGNATURE:	
PROJECT#:		
Visitors	Representing	
Ryon HZKZ	- Acer	
SOP Panks		
Contending		
	Bra 104	
7:05 Acet on Site - Setup in 7:40 Work Begins : Painting in Awit	Mas 10-1	
7:40 Work Begins : Painting in Awit	(eilar, mala, Bak and	
9.00 chatter Acer Walker though all	sites. Buck store seems to be Painted Slightly	
Block		
Dison: Ace wilker through all sites		
12: USPM & Acr Walked through all sites	146.1	
1:15 Panks 3 for done Serday	Heat	
1.		
16.11		
V /		
	\	

	(12+1-0	
PROJECT: BODING N-5	DATE: 6/50/22	
CLIENT: SOP	TECHNICIAN: SAL PROCEPIO	
CONTRACTOR: SDP	SIGNATURE: Sel Bly	
PROJECT #:		
Visitors	Representing	
SAL PROCOPIU	ACER	
RYAN HICKS	ACER.	
SOP PAINTER		
KNOW DAYS CERTAN A)		
7:15 A COR ON SITE.	Cerup IN RM 104.	
7:40 WORK REGINS 1	N publi PRINTING	
CONTINUES ON COILMS	- WAUS	
9:30 RYAN ON SIFE -6.	THE TOUR MET SAPER	
10:30 KOR TRIVED TO FOR	reman INTERPRICED RYAN +	
ACKED TO HAVE REVERS BY	RUPIT, CLEANED.	
11:20 NER WATHED TAKE		
STATE MEAN IN APPEARS	to Be SCRAPED, THERE IS	
NO PENSTIC ON VENIS,	SIDE DOOR +CURTAINS, WINDS	
ADD OTEN ON CONTRACT	many in the second	
Red Red Astroll		
IN AUDIT INSENCIONNIN - US GUISTIC BECUN		
JAM - WACKING COMPI	OFC. PRIMER ALMOST DON	
BACK STACE WIT COMPLETE. PRINCIPLE		
2: 20 - SPP PANTOR HID & TEMPER TINTRUM FOR		
UNKNOWN REMEDING LEKT MERT JU/ RH TCALLED		
VINCO.		
3 15 SOP PAINTERS LEFT JOD NER TROPER		
TOVINE - DONE COR DAY		
)		
3		
-0		
	Page of	

ACER ASSOCIATES, LLC.

PROJECT: BUPINE H-S CLIENT: SUP CONTRACTOR: SIP PROJECT #: SUP PROJECT #: SUP DATE: 5/2/2/2 TECHNICIAN: SIGNATURE:	
Visitors Representing	
SAZ PROCUBIO SOF BAINTER	88) Z
7:10 ACOR ONSITE - STAFF STARTS IN AUDIT	\leq
AT 7:35 9 AM ARA NEAR POOR 5 WE CLOAN -BUT NO PRASTIC ON EXTERISK-ASKING BILL 11 AM BLEAK. I TOOK PHOTOS. ACCOSS DOORS WED CLOANING as CHIPS, ON FLOOR (EXT SIDE) IPM I TALVED TO COMM (REMEAN) + REQUESTED PRATIC ON WALL BY FLOOR EXIT DOOK SOME EMBIL 5 PM PLASTIC PUT ON WALL THORN CLEANING 6 PM NO WERK CITES OUT ACOR DOTARTS	772/7

PROJECT: BODILO 14-5	DATE: 6-28-22
CLIENT:	TECHNICIAN: SAZ DEOLODIO
CONTRACTOR: SOP	SIGNATURE:
PROJECT#: 50/	
-	
Visitors ,	Representing
SAL Y'SLOCKY (U) KRISTEN	1 COR
SAL PROCESTO KRISTEN	
	V,50P
The Care a streng of	95 STREET BY CARS;
7 AM GATES BLOCKED A	STREET BY CARS;
	RED TO FIX PLASTIC AT
	LASTIC GOOD AT PATRANCE; BUN
LIT DOOR OPEN.	
10 pm WALKTHRU W/KK	rester in (ncer
11.30 LUNCH Brenk, Hee	R TOOK PHOTOC;
SCRAPING & PRINT ING 11	P (NURITE ON COILING)
12,30 TRIKES TO BILL: 1570	o to NOD PLASTIC TO
IDR AT FROM WESTES	
	RPHITOS OF COUR
PLASTIC -CALLED SEASAN	
CHIPS OUTSIDE OF OGOR	J AS THEHE HILL I WILL
	LOND CLERTED
	a WORK
- 24	
	Page of

PROJECT: BODINE A-5	DATE: 6-27-22
CLIENT: SOP	TECHNICIAN: SUL PROCOPIU
CONTRACTOR: 50P	SIGNATURE:
PROJECT#: 508	_
in the second se	
Visitors	Representing
INT DESCEDIO	men
ERSAN HALL	TENERNIN SOO
DP PAINTERS (2)	CHRIS BROTHLA (4130 PM)
1:10 ACER ONSITE, DE	WIEW W SERSAN, SCRAPING
O BOSIN TUDAY	
'30 WORF ROCINS BLAS	
gaskel) SEASAN TO VE	TIKY PENSTIL ON OUTSIDE
OF ENTRANCE + TACK M	T. PUPL
MAIN DONES ARE CLOSED	IRLOCKED OKE W/ SIGNS
AM SCRAPING BREWA	
	CRAPING TPRIMING 1P.
2:30 EPRAY PRONTING	IN AGRESS
JOM BACK DOURS LUCKE	D - PRINTERS ACCESS THRU
	-PLASTIC CUT
	SONT NOR TRIES PHOTOS
6,5 ACER DEPARTS	
	01

PROJECT: BodINE H.S.	DATE: 6-24-12
CLIENT: SDP	TECHNICIAN: BRINGING
CONTRACTOR: SDA	SIGNATURE: Many file
PROJECT#: SDP	VII
Visitors	Representing
8700 - ARRIVE SITE (BOSINE H.S.) 7	o oversoo lead sparement project. season: Season informs no that in the Auditorium
Meer of farman for survers	SEASON. SEASON INFORMS NO THAT
her crow will be doing preso,	in the Actionism
0880 NOPLENS arecting Schoppell	L'in AudoTORIUM.
1000- Frey CONTINUES.	*
1200 - SDP WORKERS ORPHATS	rire
/	
1	
	Page / of /

CONSTRU	CTION REPORT	
PROJECT: BODING H-5 CLIENT: SOP CONTRACTOR: 50P PROJECT#:	DATE: 8/23/22 TECHNICIAN: SALI PLOLUDIO SIGNATURE:	
Visitors	Representing	
SAL PROLIGIO JEARN HALL	ACER SOP FORENZON	
SDP PRINTERS (5)		
7:10 ACIR OVETER -PROLL 7:30 WORKROCING - PLASTK		
9-930 Brett		
11:30 1 TALKOO TO PRINCIPIO	resour schoon to (Burney)	
30 BHEAK -PLASTIC GOING ON DOTRS		
4 PM BROOK - SENT EMP	2 WATER DURING SCRAPING	
5 PM 3 Paincelle on NITO SETTING UP 24 SCHOLD		
6:30 DINNER BORAK	ACIR DEPORTS	
	Page of	

PROJECT: SAP	DATE: 6/22/22	
CLIENT: 5DP	TECHNICIAN: 500 PROUPIT	
CONTRACTOR: 508	SIGNATURE: LIOUN	
PROJECT#: BODING H-S		
Visitors	Representing	
SALPROCODIO NCER		
SEASAN HALL SOP KOLEMAN		
7 SOP STAFF		
2'10 ACID 010111 : A-	A SP S	
7:60 ACIR ONSITE DO	RS LUCKED	
7:05 SOP FORMAN OPENS	GATE; ACOR SOT UP IN	
PEACHERS KM.		
7:45 WORF RUBINS IN	AUDIT, PLASTIC NING	
Too BLOOK WALLS IN BACK		
THO STAFF REMOVING MI	RO SORTS ON LEFT 5100	
1100 BREAK - PICTURE		
12:20 WORK IP - PLAST		
3 pm custopial opener	and the project km	
	AKING MANY SPOTS (6x5')	
	CENT EMAIL	
500 PLASTIC IP CHRI	RS demoved	
6:18 MeN DONE - GATING	pinner	
6:30 NO WORK-DIE	FOR NITE - 8HOTOS	
6:45 ACOR REPARTS - 7	TRUCO TO SONSON GBIND	
AUDIT PROJECTOR ROOM	- PLAKINE PRINT IN MOST	
WALLS.		
	81	
	Page / of /	

CONSTRU	CTION REPORT	
PROJECT: 50 P	DATE: 6/21/22	
CLIENT: SOP	TECHNICIAN: SAL PROCEPIU	
CONTRACTOR: $50P$	SIGNATURE:	
PROJECT#: PODINED 17-5	0	
Visitors	Danuacantina .	
	Representing	1
SAL PROCORIC -ACER	8 SOP PNORS	, –
VINCE K	FRANDAVIS	\geq
SENSON HALL SOP FOR	Nam	>
		_
7AM ACER ON SITE -SET WI		_
715 ROVIEW W/VK(NOR)+.		
	eD DOGS, CHRS, RTC FROM	_
AUDIT CUST VACUUMED CONE	R Level TRIM FLOUR + UPPER	>
Level NOT DONE.	10 4-4 - 10 - 10 - 10 - 10 - 10 - 10 - 1	
81.ZU PAINDORS SUTUP SCAFFO PRAPLS +WINDONK	20 + ATTACKING PARTIC TO	_
	- AUDIT ATTIC LOCKED: STAIRWELL ()	7
BEHIND STARE - STORAGE		/
10:00 - New STREE (2) Removin	16 CARIRS FOR SCRAPPOLD NEEDS	
-PLASTIC IN PROGRESS BY		_
11 AM BREAK FOR SOF -TO	OK PAOTOS	>
1215 werks resures - plas	STIC. I TALKED TO BILL DECENT	_
Vents + HEATERS GUTTING	Courel)	>
CAPPENTERS REMOVED SO	me LEAD - COMPRETO,	_
1:30 PLASTIC IF -SMALL	100 LITES COVEDED W/	_
PLASTIC		>
4 pm NO CANNES	<u> </u>	
ELW NO WORK	the contract of	
7 OM ACAR DERACT	IN SURSAN/PICTURES 2	
The second second		
		1
		1
	Page of	

PROJECT: 300 MS CLIENT: Span CONTRACTOR: PROJECT #:	DATE: 1/25/22 TECHNICIAN: Byen Make SIGNATURE:
Visitors	Representing
Ryon Hiers Vincent Kirsull	Acu
SPP Prihus/Seigens	Fouren 15DP Palaks
SINGA VERLING AND PREVIOUS TO UND SINGA VIDER ACTUAL ORGING VIDER PREVIOUS MINK through and Other Concresses AIMS VIDER PREVIOUS SOM JOHNER INCOM ACT DID INSPECT ON ADED THAN INCOM ACT DID A WALK Through OF ANGEL HAD THEIR PLASTIC BOUNDAY DOWN THYM AREA LINE PLASTIC BOUNDAY DOWN THYM AREA LINES ACCT WALKER SOP PRINTER TO SOAL THE WORLD TOOM SOP PRINTER TO PAIT DOWN IN	My Ac units to be turned off, consirred water Means for use. Bit Across on Forty Lived doors, I Across on Forty Lived doors, where work areas 3 (completed all Record to the google (lest active work areas some Unactive work In SPP Painte war told when work beganin areas the Brildhay to Cook at after closest had its Plasts town, talked to 30 Sloor Banta Plasts Still not put Beall up th Sloor Jenter is not active or Plasts of the Plasts Being down, Issue

L

PROJECT: 300) NO 17-5	DATE: 7/26/22
CLIENT: 506	TECHNICIAN: 5AL PROCODI
CONTRACTOR: 508	SIGNATURE: felle
PROJECT#: SUP OY 7	
Visitors	Representing
AL PROCOPIU	ACER
SONEM HALL	SDP Kerenger
SAP PANFERS (5)	
7:15 NCOR ON CITE	
71 7 11	in a san to the san
7.30 WORK ROLING 4	ARMS IST FL W MASTIC
711-2018 2031 CKEP	- NA
	2013 SINK IP
27 Pl 23 179	
27 FT 54 5 +X1/K	2 NO INORK 1202/1
W 13 10 11 12 12	111181 0110
117:M 107A CMPL	ITE 5W PASS
I A CIANT	
1 10 An (107 51 / Pare	che 3 5W Fall
1177 0000	(3) 303 PASE (3)
2:30 pr FL 1P - 164 (7	SHW
2-01/1 = 104 11	11.0
245 LAZKTARY WS	eACAN
3:15 ACER DEPARTS	C/15 X/10
330 PHNI CALL WI RYAN	HICKS, HARN VINCEY (ACEN)
	ement wented wear
* ***	
Land to the second seco	A Commence of the Commence of

PROJECT: RODING 11-5 CLIENT: COR	DATE: //27/22
CONTRACTOR: 500	SIGNATURE: COMME
PROJECT#: 500047	SIGNATURE: Lellingia
-2000	
Visitors	Representing
SAL PROCESSO	rces
PISTED MASITES	neep
PASAN NALLS FORM	NO SOR + 8 SOR PRINTERS
Tacri,	now SOR + 8 SOP PRINTERS
1.10 Aced on SITE; ne	ets KRISTEN + PASKN
	DO WALKTHOU OF ALL RMS
	CQ, 303 WZ 10000, 309 WZ
DAM KRISTEN GCTS LE	
DZU KM REPRETS	DOGUNFORM 105-HOT
	SMITARONS IN PRANOS-SINK
	CT, GIRLS BATARM, 104 CLEANAP
THE HWAY /LOTRA) PRIVE ONLY
IM WORK IF GIRLIS	- RR
2:30 309 Compress 5	V Possed (1) = 3 PEL SINT IP.
	Y 12.1- 21.0
3 PM ACORT STAF	FLEKT BLOG.
	. /
)

PROJECT: BODING 11-5 DATE: CLIENT: TECHNICIAN: CONTRACTOR: SIGNATURE: PROJECT#: SOP 04 Visitors Representing SAL PRCENTIU Acer SOP FOREMAN SENGAN HALL SDP PAINTER WERRERS OUTSIRE MACKTHRU SENTAW

CLIENT: SOF	DATE: / LY / LZ TECHNICIAN: / C / Projector
PROJECT#: SUP D47	
Visitors 5DC PRUDIU 5DC PRIVTERS (5)	Representing
7:15 NCLR INSTR - PI 7:30 WORK IN BASONEN EAM SUIFFER PASS AT 8:30 NO CHANGES (SID	SIERS BATHRM) + RM 105 SIERS BATHRM + RM 105 WOND
1 M SCRADING 19 11 2030 NO CHANGE (S 3 PM DCER DOPARDS	V / V5

PROJECT: 1300) NO 175	DATE: 8/1/22
CLIENT: SOP	TECHNICIAN: FOR PROCIPIL
PROJECT #: SOPOY/	SIGNATURE: ()
Visitors	Representing
SXL PRONOW	ACER
SDP PAINTERS /89	
	11. 12.11.15
	ONVIS
7:15 DOR ON SIPE	- 50P STOPE IN PIET
	SMP WRLS BIHRIN, 105
9:00 MINTING ONLY 1.	N NORTH BASIM, HT. HATLUMY
1230 PITOUS - FRAN	CNSITE - DOVIEW PLANS
2 BM PAINTING IP	BASENINT, PORIMING IN KMID
3 0 1 1 1 2 2 3	16275
The second secon	
And a first the second	**************************************

PROJECT: 1300) WE N-S	DATE: 8/2/22
CLIENT: 50/	TECHNICIAN: 52 PROKNOW
CONTRACTOR: SOP	SIGNATURE: Sel Dage
PROJECT#: 508 047	
Visitors	Representing
SOP PRIVTERS (7)	
SAL PROSONO	ncer SI
SHE PICOSONO	1 Ven
3.11	
7:15 ACOR ONSITE	
7.4x UNK 11 14 6	35MT GIRLS BOTHRIM HADLINGY
-PANT ONLY. 105 IP	PLASTIC UP PRINTING -WTG
FOR SU = EST OF	8/3.
9130 NUCHANGE - INM	UCTHEN OF DUDIT MEAS.
PEAR STAGE +STORAGE	
1130 WASKITHING W/P	HOTOS -NO CAMPSES IN 102 1
+ BSMT.	(
1:50 WALKTHRU -CLEA,	NUT IN GIRLS BINEM; 105-
PRINTING IP	,
3: UN ACER DEPARTS -	START OUTSIDE
	X
. /	
-	
	Page

PROJECT: 15011 INC N-)	DATE: 8/3/22
CLIENT: 500	TECHNICIAN: SAL PROUBLE
CONTRACTOR: 500	SIGNATURE:
PROJECT #:	_
Visitors	Bannantina
	Representing
SOL PROUGIO,	nen
SOP PONTERS (6)	1 //
SENCAN MALL	508 Ecreman
Soul Will Timbe	DOI POPERINO
7:15 ACER ON 5178	X
7:30 ReR FOREMAN,	SHAPLLD BR COST DAY
WORK - CLAMIND IN BSI	MT HALLWY + EIRIS
BATHRIM; 105 PROUTING	1.8
960 105 PAITING 1P -S	SU at END H DAV?
HOT MCGARA	
IPM SUPPLIEL ROLLY RE	emireg from Stringe MRAE.
105 STILL IP PLAST	
2PM 105 IP BLACTIC	
11 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1	morphic one 5 WI VEFERE
FAI (20) M DASS H/	(4) PASS on 2 de FATRI
WINDOWSILL FAILED 2 B.	74 5h/
3:10 reak peganas	
	Page / of /

Sample Renovation Recordkeeping Checklist Form Approved OMB No. 2070-0195 Expires 2/29/24	
Name of Firm: ≤ 00	
	. ~1.2
Date and Location of Renovation: 7/1/22/500) We H-S LEKT SPAIR Brief Description of Renovation: GR & STABILITION A + STORAGE	WELL
Brief Description of Renovation: 48 5 TORRE	2 1cm
Name of Assigned Renovator: 50P PAINTURS	
Name(s) of Trained Worker(s), if used: 500 PROVECES	
Name of Dust Sampling Technician, Inspector, or Risk Assessor, if used: SOL PROGOTO OUT OUT OUT OUT OUT OUT OUT	
Copies of renovator and dust sampling technician qualifications (training certificates, certifications) on file.	
Certified renovator provided training to workers on (check all that apply):	
Posting warning signs	
Maintaining containment	
Waste handling Post-renovation cleaning	
Test kit or test results from an EPA-recognized laboratory on collected paint chip sample, used by certified renovator to determine whether lead was present on components affected by renovation (identify method used, type of test kit used (if applicable), laboratory used to conduct paint chip analysis, describe sampling locations and results):	
Warning signs posted at entrance to work area.	
Work area contained to prevent spread of dust and debris	
All objects in the work area removed or covered (interiors)	
HVAC ducts in the work area closed and covered (interiors)	
Windows in the work area closed (interiors)	
Windows in and within 20 feet of the work area closed (exteriors)	
Doors in and within 20 feet of the work area closed and sealed (exteriors)	
Doors that must be used in the work area covered to allow passage but prevent spread of dust	
Floors in the work area covered with taped-down plastic (interiors)	
Ground covered by plastic extending 10 feet from work area—plastic anchored to building and	
weighed down by heavy objects (exteriors)	
Vertical containment installed if property line prevents 10 feet of ground covering, or if necessary to prevent	
migration of dust and debris to adjacent property (exteriors) Waste contained on-site and while being transported off-site.	
Work site properly cleaned after renovation	
	
All chips and debris picked up, protective sheeting misted, folded dirty side inward, and taped for removal Work area surfaces and objects cleaned using HEPA vacuum and/or wet cloths or mops (interiors)	
Certified renovator performed post-renovation cleaning verification (describe results, including the number of wet and dry cloths used):	
If dus. clearance testing was performed instead, attach a copy of report	
I certify n ider penalty of law that the above information is true and complete.	
Sal Procopio	
Name and title Date	

Sample Renovation Recordkeeping Checklist Form Approved OMB No. 2070-0195 Expires 2/29/24
$\leq nP$
Name of Firm:
Date and Location of Renovation: 11/22 BODINE 14-5 [RIGHT 5781 RW
Brief Description of Renovation: LRP STABILITATION (RIGHT STAIRWE STORAGE R.
Name of Assigned Renovator: SDP DAINFLES
Name(s) of Trained Worker(s), if used: 5NP MINTERS
Name of Dust Sampling Technician, Inspector, or Risk Assessor, if used: SAL PROCEDIO, MCCOI
Copies of renovator and dust sampling technician qualifications (training certificates, certifications) on file.
Certified renovator provided training to workers on (check all that apply):
Posting warning signs Setting up plastic containment barriers
Waste handlingPost-renovation cleaning
Test kit or test results from an EPA-recognized laboratory on collected paint chip sample, used by certified renovator to determine whether lead was present on components affected by renovation (identify method used, type of test kit used (if applicable), laboratory used to conduct paint chip analysis, describe sampling locations and results):
Warning signs posted at entrance to work area.
Work area contained to prevent spread of dust and debris
All objects in the work area removed or covered (interiors)
HVAC ducts in the work area closed and covered (interiors)
Windows in the work area closed (interiors)
Windows in and within 20 feet of the work area closed (exteriors)
Doors in the work area closed and sealed (interiors)
Doors in and within 20 feet of the work area closed and sealed (exteriors) Doors that must be used in the work area covered to allow passage but prevent spread of dust
Floors in the work area covered with taped-down plastic (interiors)
Ground covered by plastic extending 10 feet from work area—plastic anchored to building and
weighed down by heavy objects (exteriors)
Vertical containment installed if property line prevents 10 feet of ground covering, or if necessary to prevent migration of dust and debris to adjacent property (exteriors)
Waste contained on-site and while being transported off-site.
Work site properly cleaned after renovation
All chips and debris picked up, protective sheeting misted, folded dirty side inward, and taped for removal
Work area surfaces and objects cleaned using HEPA vacuum and/or wet cloths or mops (interiors)
number of wet and dry cloths used): 9 WIPCS 4 MUPPING - 722 PRI 2019
If dust clearance testing was performed instead, attach a copy of report
I certify under penalty of law that the above information is true and complete
Name and title Date

Sample Renovation Recordkeeping Checklist Form Approved OMB No. 2070-0195 Expires 2/29/24
Name of Firm: $\int \mathcal{P}$
1.0
Date and Location of Renovation: BODINE H-S 2-12 PROJECTOR R
Brief Description of Renovation: Lead 57ABILIZATION
Name of Assigned Renovator: SOP PRINTERS
Name(s) of Trained Worker(s), if used: SOP PRINTERS
Name of Dust Sampling Technician, Inspector, or Risk Assessor, if used: SNL PROLADID NOCICE
Copies of renovator and dust sampling technician qualifications (training certificates, certifications) on file.
Certified renovator provided training to workers on (check all that apply):
Posting warning signs Setting up plastic containment barriers
Maintaining containment Avoiding spread of dust to adjacent areas
Waste handling Post-renovation cleaning
Test kit or test results from an EPA-recognized laboratory on collected paint chip sample, used by certified renovator to determine whether lead was present on components affected by renovation (identify method used, type of test kit used (if applicable), laboratory used to conduct paint chip analysis, describe sampling locations and results):
Warning signs posted at entrance to work area.
Work area contained to prevent spread of dust and debris
All objects in the work area removed or covered (interiors)
HVAC ducts in the work area closed and covered (interiors)
Windows in the work area closed (interiors)
Windows in and within 20 feet of the work area closed (exteriors)
Doors in and within 20 feet of the work area closed and sealed (exteriors)
Doors that must be used in the work area covered to allow passage but prevent spread of dust
Floors in the work area covered with taped-down plastic (interiors)
Ground covered by plastic extending 10 feet from work area—plastic anchored to building and weighed down by heavy objects (exteriors)
Vertical containment installed if property line prevents 10 feet of ground covering, or if necessary to prevent migration of dust and debris to adjacent property (exteriors)
Waste contained on-site and while being transported off-site.
Work site properly cleaned after renovation
All chips and debris picked up, protective sheeting misted, folded dirty side inward, and taped for removal Work area surfaces and objects cleaned using HEPA vacuum and/or wet cloths or mops (interiors)
Certified renovator performed post-renovation cleaning yerification (describe results, including the number of wet and dry cloths used):
It dust clear ince teating was performed instead, attach a copy of report
I certify under penalty of law that the above information is true and complete.
Name and title

Sample Renovation Recordkeeping Checklist Form Approved OMB No. 2070-0195 Expires 2/29/24
Name of Firm: SDP PA, NTCR
Date and Location of Renovation: 50P-Borne N-5 6/21/22
Brief Description of Renovation: NUDITOR UM LBP NBR FEMENT
Name of Assigned Renovator: 500 PAINTERS
Name(s) of Trained Worker(s), if used: $SOPINIMEPS$
Name of Dust Sampling Technician, Inspector, or Risk Assessor, if used: SAL PROCODIO, ACAR
Copies of renovator and dust sampling technician qualifications (training certificates, certifications) on file.
Certified renovator provided training to workers on (check all that apply):
Posting warning signs Setting up plastic containment barriers
Waste handling Post-renovation cleaning
Test kit or test results from an EPA-recognized laboratory on collected paint chip sample, used by certified renovator to determine whether lead was present on components affected by renovation (identify method used, type of test kit used (if applicable), laboratory used to conduct paint chip analysis, describe sampling locations and results):
Warning signs posted at entrance to work area.
Work area contained to prevent spread of dust and debris All objects in the work area removed or covered (interiors)
HVAC ducts in the work area closed and covered (interiors)
Windows in the work area closed (interiors)
Windows in and within 20 feet of the work area closed (exteriors)
Doors in the work area closed and sealed (interiors)
Doors in and within 20 feet of the work area closed and sealed (exteriors)
Doors that must be used in the work area covered to allow passage but prevent spread of dust
Floors in the work area covered with taped-down plastic (interiors)
Ground covered by plastic extending 10 feet from work area—plastic anchored to building and
weighed down by heavy objects (exteriors)
Vertical containment installed if property line prevents 10 feet of ground covering, or if necessary to prevent migration of dust and debris to adjacent property (exteriors)
Waste contained on-site and while being transported off-site.
Work site properly cleaned after renovation
All chips and debris picked up, protective sheeting misted, folded dirty side inward, and taped for removal
Work area surfaces and objects cleaned using HEPA vacuum and/or wet cloths or mops (interiors)
ertified renovator performed post-renovation cleaning verification (describe results, including the number of wet and dry cloths used): 100+ 5w/15505
If dust clearance testing was performed instead, attach a copy of report
certify under penalty of law that the above information is true and complete.
Sal Procopio
Name and title Date

Sample Renovation Recordkeeping Checklist Form Approved OMB No. 2070-0195 Expires 2/29/24 PRINTER Date and Location of Renovation: Brief Description of Renovation: 57860 Name of Assigned Renovator: Name(s) of Trained Worker(s), if used: Name of Dust Sampling Technician, Inspegtor, or Risk Assessor, if used: Copies of renovator and dust sampling technician qualifications (training certificates, certifications) on file. Certified renovator provided training to workers on (check all that apply): ____ Setting up plastic containment barriers Posting warning signs Maintaining containment ____ Avoiding spread of dust to adjacent areas Waste handling Post-renovation cleaning Test kit or test results from an EPA-recognized laboratory on collected paint chip sample, used by certified renovator to determine whether lead was present on components affected by renovation (identify method used, type of test kit used (if applicable), laboratory used to conduct paint chip analysis, describe sampling locations and results): Warning signs posted at entrance to work area. Work area contained to prevent spread of dust and debris All objects in the work area removed or covered (interiors) HVAC ducts in the work area closed and covered (interiors) Windows in the work area closed (interiors) Windows in and within 20 feet of the work area closed (exteriors) Boors in the work area closed and sealed (interiors) Doors in and within 20 feet of the work area closed and sealed (exteriors) Opors that must be used in the work area covered to allow passage but prevent spread of dust Floors in the work area covered with taped-down plastic (interiors) Ground covered by plastic extending 10 feet from work area—plastic anchored to building and weighed down by heavy objects (exteriors) Vertical containment installed if property line prevents 10 feet of ground covering, or if necessary to prevent migration of dust and debris to adjacent property (exteriors) Waste contained on-site and while being transported off-site. Work site properly cleaned after renovation thips and debris picked up, protective sheeting misted, folded dirty side inward, and taped for removal Work area surfaces and objects cleaned using HEPA vacuum and/or wet cloths or mops (interiors) Certified renovator performed post-renovation cleaning verification (describe results, including the number of wet and dry cloths used): 10 800 A If dust clearance testing was performed instead, attach a copy of report certify under penalty of law that the above information is true and complete.

Name and title



APPENDIX B

SDP SPREADSHEETS

E l e m e n t	F l o o r	On Site Room Name **** NOTE: Protections and formulas were deleted because oversight started before scope of work *******	Student/ Teacher Occupied	Component	Description of Paint and Plaster Damage	Name of Firm	Date of Renovation	Brief Description of Renovation	Name of Assigned Renovator	Name(s) of Trained Worker (s), if used	Name of Dust Sampling Technician, Inspector, or Risk Assessor, if used	Copies of renovator and dust sampling technician qualifications (training certificates, certifications) on file	Certified renovator provided training to workers on posting warning signs	Certified renovator provided training to workers on setting up plastic containment barriers	Certified renovator provided training to workers on maintaining containment	Certified renovator provided training to workers on avoiding spread of dust to adjacent areas	Certified renovator provided training to workers on waste handling	Certified renovator provided training to workers on post- renovation cleaning	Certified renovator provided training to workers on test kit or test results from an EPA-recognized laboratory on collected paint chip sample, used by certified renovator to determine whether lead was present on components affected by renovation	If yes to the previous, identify the method used, type of test kit used (if applicable), laboratory used to conduct paint chip analysis, describe sampling location and results	Warning signs posted at entrance to work area	Work area contained to prevent spread of dust and debris
1	2	Room 204 - Nurse's Office	yes	Walls/Ceiling	Flaking	ACER Associates, LLC	8/2/21	Paint/Plaster Stabilization	SDP	Vin Tonelli	Kevin Rumbol	yes	yes	yes	yes	yes	yes	yes	N/A	N/A	yes	yes
1	2	Room 204A - Nurse's Office Restroom	yes	Walls/Ceiling	Cracking	ACER Associates, LLC	8/2/21	Paint/Plaster Stabilization	SDP	Vin Tonelli	Kevin Rumbol	yes	yes	yes	yes	yes	yes	yes	N/A	N/A	yes	yes
1	2	Room 204B - Nurse's Office Vestibule	yes	Walls/Ceiling	Cracking	ACER Associates, LLC	8/2/21	Paint/Plaster Stabilization	SDP	Vin Tonelli	Kevin Rumbol	yes	yes	yes	yes	yes	yes	yes	N/A	N/A	yes	yes
1	2	Room 205	yes	Walls/Ceiling	Cracking	ACER Associates, LLC	8/18/21	Paint/Plaster Stabilization	SDP	Vin Tonelli	Kevin Price	yes	yes	yes	yes	yes	yes	yes	N/A	N/A	yes	yes
1	2	Room 206	yes	Walls, Ceiling	Cracking	ACER Associates, LLC	8/12/21	Paint/Plaster Stabilization	SDP	Vin Tonelli	Kevin Rumbol	yes	yes	yes	yes	yes	yes	yes	N/A	N/A	yes	yes
1	2	Room 207	yes	Walls, Ceiling	Cracking	ACER Associates, LLC	8/17/2021	Paint/Plaster Stabilization	SDP	Vin Tonelli	Kevin Price	yes	yes	yes	yes	yes	yes	yes	N/A	N/A	yes	yes
1	2	Room 206A	yes	Walls, Ceiling	Cracking	ACER Associates, LLC	8/12/21	Paint/Plaster Stabilization	SDP	Vin Tonelli	Kevin Rumbol	yes	yes	yes	yes	yes	yes	yes	N/A	N/A	yes	yes
1	2	Room 207A	yes	Walls, Ceiling	Flaking	ACER Associates, LLC	8/26/21	Paint/Plaster Stabilization	SDP	Vin Tonelli	Kevin Rumbol	yes	yes	yes	yes	yes	yes	yes	N/A	N/A	yes	yes
1	2	Room 208	yes	Walls, Ceiling	Cracking	ACER Associates, LLC	8/18/21	Paint/Plaster Stabilization	SDP	Vin Tonelli	Kevin Price	yes	yes	yes	yes	yes	yes	yes	N/A	N/A	yes	yes
1	2	Room 208A	yes	Walls, Ceiling	Alligatoring	ACER Associates, LLC	8/26/21	Paint/Plaster Stabilization	SDP	Vin Tonelli	Nicolas Lees	yes	yes	yes	yes	yes	yes	yes	N/A	N/A	yes	yes
1	2	Room 202	yes	Walls, Ceiling	Cracking	ACER Associates, LLC	8/11/21	Paint/Plaster Stabilization	SDP	Vin Tonelli	Kevin Rumbol	yes	yes	yes	yes	yes	yes	yes	N/A	N/A	yes	yes
1	2	Room 201	yes	Walls, Ceiling	Cracking	ACER Associates, LLC	8/18/2021	Paint/Plaster Stabilization	SDP	Vin Tonelli	Kevin Price	yes	yes	yes	yes	yes	yes	yes	N/A	N/A	yes	yes
1	1	Room 101	yes	Walls, Ceiling	Flaking	ACER Associates, LLC	8/12/21	Paint/Plaster Stabilization	SDP	Vin Tonelli	Kevin Rumbol	yes	yes	yes	yes	yes	yes	yes	N/A	N/A	yes	yes
1	1	Room 102A	yes	Walls, Ceiling	Flaking	ACER Associates, LLC	8/19/2021	Paint/Plaster Stabilization	SDP	Vin Tonelli	Nicolas Lees	yes	yes	yes	yes	yes	yes	yes	N/A	N/A	yes	yes
1	1	Room 102	yes	Walls, Ceiling	Flaking	ACER Associates, LLC	8/18/2021	Paint/Plaster Stabilization	SDP	Vin Tonelli	Kevin Price	yes	yes	yes	yes	yes	yes	yes	N/A	N/A	yes	yes
1	1	Room 108	yes	Walls, Ceiling	Cracking	ACER Associates, LLC	8/12/21	Paint/Plaster Stabilization	SDP	Vin Tonelli	Kevin Rumbol	yes	yes	yes	yes	yes	yes	yes	N/A	N/A	yes	yes
1	1	Room 109	yes	Walls, Ceiling	Flaking	ACER Associates, LLC	8/19/2021	Paint/Plaster Stabilization	SDP	Vin Tonelli	Nicolas Lees	yes	yes	yes	yes	yes	yes	yes	N/A	N/A	yes	yes
1	2	Room 202A	yes	Walls, Ceiling	Flaking	ACER Associates, LLC	8/12/21	Paint/Plaster Stabilization	SDP	Vin Tonelli	Kevin Rumbol	yes	yes	yes	yes	yes	yes	yes	N/A	N/A	yes	yes
1	2	Room 201A	yes	Walls, Ceiling	Flaking	ACER Associates, LLC	8/18/2021	Paint/Plaster Stabilization	SDP	Vin Tonelli	Kevin Price	yes	yes	yes	yes	yes	yes	yes	N/A	N/A	yes	yes
1	2	Room 205A	yes	Walls, Ceiling	Cracking	ACER Associates, LLC	8/18/2021	Paint/Plaster Stabilization	SDP	Vin Tonelli	Kevin Price	yes	yes	yes	yes	yes	yes	yes	N/A	N/A	yes	yes
1	2	Room 203	yes	Walls, Ceiling	Efflorescence	ACER Associates, LLC	8/20/21	Paint/Plaster Stabilization	SDP	Vin Tonelli	Nicolas Lees	yes	yes	yes	yes	yes	yes	yes	N/A	N/A	yes	yes
1	2	Room 109A	yes	Walls, Ceiling	Flaking	ACER Associates, LLC	8/19/21	Paint/Plaster Stabilization	SDP	Vin Tonelli	Nicolas Lees	yes	yes	yes	yes	yes	yes	yes	N/A	N/A	yes	yes
1	1	Room 108A	yes	Walls, Ceiling	Cracking	ACER Associates, LLC	8/16/2021	Paint/Plaster Stabilization	SDP	Vin Tonelli	Kevin Price	yes	yes	yes	yes	yes	yes	yes	N/A	N/A	yes	yes
1	1	Room 108B	yes	Walls, Ceiling	Flaking	ACER Associates, LLC	8/16/2021	Paint/Plaster Stabilization	SDP	Vin Tonelli	Kevin Price	yes	yes	yes	yes	yes	yes	yes	N/A	N/A	yes	yes
1	1	Women's Restroom adjacent to Classroom 108	yes	Walls, Ceiling	Flaking	ACER Associates, LLC	8/17/2021	Paint/Plaster Stabilization	SDP	Vin Tonelli	Kevin Price	yes	yes	yes	yes	yes	yes	yes	N/A	N/A	yes	yes
1	1	Teacher's Lounge Men's Restroom	yes	Walls, Ceiling	Flaking	ACER Associates,	8/23/21	Paint/Plaster Stabilization	SDP	Vin Tonelli	Nicolas Lees	yes	yes	yes	yes	yes	yes	yes	N/A	N/A	yes	yes
1	1	Main Entrance Stairwell	yes	Walls, Ceiling	Chipping	ACER Associates,	8/21/21	Paint/Plaster Stabilization	SDP	Vin Tonelli	Nicolas Lees	yes	yes	yes	yes	yes	yes	yes	N/A	N/A	yes	yes
1		Stairwell across Classroom 205	yes	Walls, Ceiling	Chipping	ACER Associates,	8/19/21	Paint/Plaster Stabilization	SDP	Vin Tonelli	Nicolas Lees	yes	yes	yes	yes	yes	yes	yes	N/A	N/A	yes	yes
1		Stairwell across Classroom 306	yes	Walls, Ceiling	Chipping	ACER Associates, LLC	8/19/21	Paint/Plaster Stabilization	SDP	Vin Tonelli	Nicolas Lees	yes	yes	yes	yes	yes	yes	yes	N/A	N/A	yes	yes
1	В	Room 009 Art Room	yes	Walls, Ceiling	Chipping	ACER Associates, LLC	8/19/21	Paint/Plaster Stabilization	SDP	Vin Tonelli	Nicolas Lees	yes	yes	yes	yes	yes	yes	yes	N/A	N/A	yes	yes
1	В	Room 009A Art Room Storage Room	yes	Walls, Ceiling	Chipping	ACER Associates, LLC	8/25/21	Paint/Plaster Stabilization	SDP	Vin Tonelli	Nicolas Lees	yes	yes	yes	yes	yes	yes	yes	N/A	N/A	yes	yes
1	3	Hallway outside Classrooms 308-309	yes	Walls, Ceiling	Flaking	ACER Associates, LLC	10/1/21	Paint/Plaster Stabilization	SDP	Vin Tonelli	Nicolas Lees	yes	yes	yes	yes	yes	yes	yes	N/A	N/A	yes	yes
1		Hallway from Classrooms 303-307	yes	Walls, Ceiling	Alligatoring	ACER Associates,	10/1/21	Paint/Plaster Stabilization	SDP	Vin Tonelli	Nicolas Lees	yes	yes	yes	yes	yes	yes	yes	N/A	N/A	yes	yes
1		Hallway outside Classrooms 301-302	yes	Walls, Ceiling	Efflorescence	ACER Associates, LLC ACER Associates,	10/1/21	Paint/Plaster Stabilization	SDP	Vin Tonelli	Nicolas Lees	yes	yes	yes	yes	yes	yes	yes	N/A	N/A	yes	yes
1		Hallway outside Boy's Restroom/Art Room	yes	Walls, Ceiling	Flaking	ACER Associates, LLC ACER Associates,	8/25/21	Paint/Plaster Stabilization Paint/Plaster	SDP	Vin Tonelli	Nicolas Lees	yes	yes	yes	yes	yes	yes	yes	N/A	N/A	yes	yes
1		Gym/Cafeteria	yes	Walls, Ceiling	Chipping, Flaking	LLC	8/23/21	Stabilization	SDP	Vin Tonelli	Nicolas Lees	yes	yes	yes	yes	yes	yes	yes	N/A	N/A	yes	yes
1		Girl's Side Stairwell Storage Room	yes	Walls, Ceiling	Flaking	ACER Associates, LLC	8/23/21	Paint/Plaster Stabilization	SDP	Vin Tonelli	Nicolas Lees	yes	yes	yes	yes	yes	yes	yes	N/A	N/A	yes	yes
1		Stairwell on Boy's Side	yes	Walls, Ceiling	Chipping	ACER Associates, LLC ACER Associates,	8/25/21	Paint/Plaster Stabilization Paint/Plaster	SDP	Vin Tonelli	Nicolas Lees	yes	yes	yes	yes	yes	yes	yes	N/A	N/A	yes	yes
1		Hallway outside Girl's Restroom/Kitchen	yes	Walls, Ceiling	Chipping	ACER Associates, LLC ACER Associates,	8/23/21	Stabilization Paint/Plaster	SDP	Vin Tonelli	Nicolas Lees	yes	yes	yes	yes	yes	yes	yes	N/A	N/A	yes	yes
1		Fire Tower near Classroom 109	yes	Walls, Ceiling	Chipping, Flaking	LLC ACER Associates,	8/24/21	Stabilization	SDP	Vin Tonelli	Nicolas Lees	yes	yes	yes	yes	yes	yes	yes	N/A	N/A	yes	yes
1		Fire Tower near Classroom 208	yes	Walls, Ceiling	Chipping, Flaking	ACER Associates, LLC ACER Associates,	8/24/21	Paint/Plaster Stabilization	SDP	Vin Tonelli	Nicolas Lees	yes	yes	yes	yes	yes	yes	yes	N/A	N/A	yes	yes
1	_	Fire Tower near Classroom 309	yes	Walls, Ceiling	Chipping, Flaking	LLC ACER Associates,	8/24/21	Paint/Plaster Stabilization	SDP	Vin Tonelli	Nicolas Lees	yes	yes	yes	yes	yes	yes	yes	N/A	N/A	yes	yes
1		Fire Tower near Classroom 409	yes	Walls, Ceiling	Chipping, Flaking	LLC	8/23/21	Paint/Plaster Stabilization	SDP	Vin Tonelli	Nicolas Lees	yes	yes	yes	yes	yes	yes	yes	N/A	N/A	yes	yes
1		Fire Tower near Classroom 102	yes	Walls, Ceiling		ACER Associates, LLC	8/24/21	Paint/Plaster Stabilization	SDP	Vin Tonelli	Nicolas Lees	yes	yes	yes	yes	yes	yes	yes	N/A	N/A	yes	yes
1		Fire Tower near Classroom 201	yes	Walls, Ceiling	Chipping, Flaking	ACER Associates, LLC ACER Associates,	8/24/21	Paint/Plaster Stabilization	SDP	Vin Tonelli	Nicolas Lees	yes	yes	yes	yes	yes	yes	yes	N/A	N/A	yes	yes
1	3	Fire Tower near Classroom 301	yes	Walls, Ceiling	Chipping, Flaking	LLC	8/24/21	Paint/Plaster Stabilization	SDP	Vin Tonelli	Nicolas Lees	yes	yes	yes	yes	yes	yes	yes	N/A	N/A	yes	yes

E l e m e n t	F l o o r	On Site Room Name **** NOTE: Protections and formulas were deleted because oversight started before scope of work *******	Student/ Teacher Occupied	Component	Description of Paint and Plaster Damage	Name of Firm	Date of Renovation	Brief Description of Renovation	Name of Assigned Renovator	Name(s) of Trained Worker (s), if used	Name of Dust Sampling Technician, Inspector, or Risk Assessor, if used	Copies of renovator and dust sampling technician qualifications (training certificates, certifications) on file	Certified renovator provided training to workers on posting warning signs	Certified renovator provided training to workers on setting up plastic containment barriers	Certified renovator provided training to workers on maintaining containment	Certified renovator provided training to workers on avoiding spread of dust to adjacent areas	Certified renovator provided training to workers on waste handling	Certified renovator provided training to workers on post- renovation cleaning	Certified renovator provided training to workers on test kit or test results from an EPA-recognized laboratory on collected paint chip sample, used by certified renovator to determine whether lead was present on components affected by renovation	If yes to the previous, identify the method used, type of test kit used (if applicable), laboratory used to conduct paint chip analysis, describe sampling location and results	Warning signs posted at entrance to work area	Work area contained to prevent spread of dust and debris
1	4	Fire Tower near Classroom 402	yes	Walls, Ceiling	Chipping, Flaking	ACER Associates, LLC	8/24/21	Paint/Plaster Stabilization	SDP	Vin Tonelli	Nicolas Lees	yes	yes	yes	yes	yes	yes	yes	N/A	N/A	yes	yes
1	4	Room 401A	yes	Wall	Flaking	ACER Associates, LLC	8/25/21	Paint/Plaster Stabilization	SDP	Vin Tonelli	Nicolas Lees	yes	yes	yes	yes	yes	yes	yes	N/A	N/A	yes	yes
1	3	Room 308A	yes	Walls, Ceiling	Flaking	ACER Associates, LLC	8/28/21	Paint/Plaster Stabilization	SDP	Vin Tonelli	Nicolas Lees	yes	yes	yes	yes	yes	yes	yes	N/A	N/A	yes	yes
1	1	Hallway from Counselor's Office to Principal's Office	yes	Ceiling	Chipping	ACER Associates, LLC	8/28/21	Paint/Plaster Stabilization	SDP	Vin Tonelli	Nicolas Lees	yes	yes	yes	yes	yes	yes	yes	N/A	N/A	yes	yes
1	1	Hallway by Classrooms 108-109	yes	Walls, Ceiling	cracking	ACER Associates, LLC	8/31/21	Paint/Plaster Stabilization	SDP	Vin Tonelli	Kevin Rumbol	yes	yes	yes	yes	yes	yes	yes	N/A	N/A	yes	yes
1	1	Hallway outside Classroom 102	yes	Walls, Ceiling	cracking	ACER Associates, LLC	8/31/21	Paint/Plaster Stabilization	SDP	Vin Tonelli	Kevin Rumbol	yes	yes	yes	yes	yes	yes	yes	N/A	N/A	yes	yes
1	В	Stairwell on Girl's Side	yes	Walls, Ceiling	cracking	ACER Associates, LLC	9/27/21	Paint/Plaster Stabilization	SDP	Vin Tonelli	Kevin Price	yes	yes	yes	yes	yes	yes	yes	N/A	N/A	yes	yes
1	1	Stairwell by Counselor's Office	yes	Walls, Ceiling	cracking	ACER Associates, LLC	9/27/21	Paint/Plaster Stabilization	SDP	Vin Tonelli	Kevin Price	yes	yes	yes	yes	yes	yes	yes	N/A	N/A	yes	yes
1	2	Stairwell across from Library	yes	Walls, Ceiling	cracking	ACER Associates, LLC	9/27/21	Paint/Plaster Stabilization	SDP	Vin Tonelli	Kevin Price	yes	yes	yes	yes	yes	yes	yes	N/A	N/A	yes	yes
1	3	Stairwell across from Classroom 304	yes	Walls, Ceiling	cracking	ACER Associates, LLC	9/27/21	Paint/Plaster Stabilization	SDP	Vin Tonelli	Kevin Price	yes	yes	yes	yes	yes	yes	yes	N/A	N/A	yes	yes
1	2	Hallway outside Classrooms 201-202	yes	Walls, Ceiling	cracking	ACER Associates, LLC	9/27/21	Paint/Plaster Stabilization	SDP	Vin Tonelli	Kevin Price	yes	yes	yes	yes	yes	yes	yes	N/A	N/A	yes	yes
1	2	Boy's Restroom adjacent to IMC	yes	Walls, Ceiling	Flaking	ACER Associates, LLC	10/15/21	Paint/Plaster Stabilization	SDP	Vin Tonelli	Kevin Rumbol	yes	yes	yes	yes	yes	yes	yes	N/A	N/A	yes	yes
1	2	Women's Restroom adjacent to Classroom 206	yes	Walls, Ceiling	Flaking	ACER Associates, LLC	10/14/21	Paint/Plaster Stabilization	SDP	Vin Tonelli	Kevin Rumbol	yes	yes	yes	yes	yes	yes	yes	N/A	N/A	yes	yes
1	В	Hallway from Fan Room to Boiler Room	yes	Walls, Ceiling	cracking	ACER Associates, LLC	10/15/21	Paint/Plaster Stabilization	SDP	Vin Tonelli	Kevin Rumbol	yes	yes	yes	yes	yes	yes	yes	N/A	N/A	yes	yes
1	1	Principal/Directors Office	yes	Walls, Ceiling	Flaking	ACER Associates, LLC	10/15/21	Paint/Plaster Stabilization	SDP	Vin Tonelli	Kevin Rumbol	yes	yes	yes	yes	yes	yes	yes	N/A	N/A	yes	yes
1	1	Vestibule outside Assistant Principal's Office	yes	Walls, Ceiling	Efflorescence	ACER Associates, LLC	10/19/21	Paint/Plaster Stabilization	SDP	Vin Tonelli	Kevin Rumbol	yes	yes	yes	yes	yes	yes	yes	N/A	N/A	yes	yes
1	В	Gym Storage in Stairwell	yes	Walls, Ceiling	Flaking	ACER Associates, LLC	10/20/21	Paint/Plaster Stabilization	SDP	Vin Tonelli	Kevin Rumbol	yes	yes	yes	yes	yes	yes	yes	N/A	N/A	yes	yes
1	2	Large Library Closet closest to Hallway	yes	Walls, Ceiling	cracking	ACER Associates, LLC	10/18/21	Paint/Plaster Stabilization	SDP	Vin Tonelli	Kevin Rumbol	yes	yes	yes	yes	yes	yes	yes	N/A	N/A	yes	yes
1	1	Counselor's Office	yes	Walls, Ceiling	cracking	ACER Associates, LLC	10/21/21	Paint/Plaster Stabilization	SDP	Vin Tonelli	Kevin Rumbol	yes	yes	yes	yes	yes	yes	yes	N/A	N/A	yes	yes
1	В	Gym Office	yes	Walls, Ceiling	Flaking	ACER Associates, LLC	10/22/21	Paint/Plaster Stabilization	SDP	Vin Tonelli	Kevin Rumbol	yes	yes	yes	yes	yes	yes	yes	N/A	N/A	yes	yes
1	1	Teacher's Lounge (104)	yes	Walls, Ceiling	cracking	ACER Associates, LLC	10/25/21	Paint/Plaster Stabilization	SDP	Vin Tonelli	Kevin Rumbol	yes	yes	yes	yes	yes	yes	yes	N/A	N/A	yes	yes
1	1	Auditorium	yes	Walls, Ceiling	cracking	ACER Associates, LLC	6/21/22	Paint/Plaster Stabilization	SDP	Seasan Hall	Sal Procopio	yes	yes	yes	yes	yes	yes	yes	N/A	N/A	yes	yes
1	1	Auditorium Stage	yes	Walls, Ceiling	cracking	ACER Associates, LLC	6/30/22	Paint/Plaster Stabilization	SDP	Seasan Hall	Sal Procopio	yes	yes	yes	yes	yes	yes	yes	N/A	N/A	yes	yes
1	1	Stairs to Right of Stage	yes	Walls, Ceiling	cracking	ACER Associates, LLC	7/12/22	Paint/Plaster Stabilization	SDP	Seasan Hall	Sal Procopio	yes	yes	yes	yes	yes	yes	yes	N/A	N/A	yes	yes
1	1	Stairs to Left of Stage	yes	Walls, Ceiling	cracking	ACER Associates,	7/12/22	Paint/Plaster Stabilization	SDP	Seasan Hall	Sal Procopio	yes	yes	yes	yes	yes	yes	yes	N/A	N/A	yes	yes
1	2	Upper Storage Rm to Right of Stage	yes	Walls, Ceiling	cracking	ACER Associates,	7/12/22	Paint/Plaster Stabilization	SDP	Seasan Hall	Sal Procopio	yes	yes	yes	yes	yes	yes	yes	N/A	N/A	yes	yes
1	2	Upper Storage Rm to Left of Stage	yes	Walls, Ceiling	cracking	ACER Associates,	7/12/22	Paint/Plaster Stabilization	SDP	Seasan Hall	Sal Procopio	yes	yes	yes	yes	yes	yes	yes	N/A	N/A	yes	yes
1	2	Projector Rm	yes	Walls, Ceiling	cracking	ACER Associates,	7/11/22	Paint/Plaster Stabilization	SDP	Seasan Hall	Sal Procopio	yes	yes	yes	yes	yes	yes	yes	N/A	N/A	yes	yes
1	1	Room 107A	yes	Ceiling	cracking	ACER Associates, LLC	7/25/22	Paint/Plaster Stabilization	SDP	Seasan Hall	Ryan Hicks	yes	yes	yes	yes	yes	yes	yes	N/A	N/A	yes	yes
1	1	Hallway 13	yes	pipe	cracking	ACER Associates,	7/25/22	Paint/Plaster Stabilization	SDP	Seasan Hall	Ryan Hicks	yes	yes	yes	yes	yes	yes	yes	N/A	N/A	yes	yes
1	1	Stair well	yes	Walls	flaking	ACER Associates,	7/25/22	Paint/Plaster Stabilization	SDP	Seasan Hall	Ryan Hicks	yes	yes	yes	yes	yes	yes	yes	N/A	N/A	yes	yes
-		Janitors closet 110a	no	Walls, Ceiling	flaking	ACER Associates, LLC	7/25/22	Paint/Plaster Stabilization	SDP	Seasan Hall	Ryan Hicks	yes	yes	yes	yes	yes	yes	yes	N/A	N/A	yes	yes
		Room 104 D	yes	Walls	cracking	ACER Associates, LLC	7/25/22	Paint/Plaster Stabilization	SDP	Seasan Hall	Ryan Hicks	yes	yes	yes	yes	yes	yes	yes	N/A	N/A	yes	yes
		Rm 105	yes	Walls, Ceiling	flaking	ACER Associates, LLC	7/26/22	Paint/Plaster Stabilization	SDP	Seasan Hall	Sal Procopio	yes	yes	yes	yes	yes	yes	yes	N/A	N/A	yes	yes
		Hallway 23	yes	pipe	flaking	ACER Associates, LLC ACER Associates,	7/25/22	Paint/Plaster Stabilization Paint/Plaster	SDP	Seasan Hall	Ryan Hicks	yes	yes	yes	yes	yes	yes	yes	N/A	N/A	yes	yes
		2nd fl Library	yes	W2	flaking	LLC	7/27/22	Stabilization	SDP	Seasan Hall	Sal Procopio	yes	yes	yes	yes	yes	yes	yes	N/A	N/A	yes	yes
		Janitors closet 207b	no	Walls, Ceiling	flaking	ACER Associates, LLC ACER Associates,	7/25/22	Paint/Plaster Stabilization	SDP	Seasan Hall	Sal Procopio	yes	yes	yes	yes	yes	yes	yes	N/A	N/A	yes	yes
		Room 303	yes	Walls, Ceiling	cracking	ACER Associates, LLC ACER Associates,	7/25/22	Paint/Plaster Stabilization	SDP	Seasan Hall	Ryan Hicks	yes	yes	yes	yes	yes	yes	yes	N/A	N/A	yes	yes
		Janitors closet 312a	no	Walls, Ceiling	flaking	LLC ACER Associates,	7/25/22	Paint/Plaster Stabilization	SDP	Seasan Hall	Ryan Hicks	yes	yes	yes	yes	yes	yes	yes	N/A	N/A	yes	yes
		Rm 309	yes	w2	cracking	LLC	7/27/22	paint only Paint/Plaster	SDP	Seasan Hall	Sal Procopio	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A
		Stairwell S4	yes	Walls	flaking	ACER Associates, LLC ACER Associates,	7/25/22	Stabilization Paint/Plaster	SDP	Seasan Hall	Ryan Hicks	yes	yes	yes	yes	yes	yes	yes	N/A	N/A	yes	yes
		Room 403	yes	Walls, Ceiling	cracking	LLC ACER Associates,	7/25/22	Stabilization Paint/Plaster	SDP	Seasan Hall	Ryan Hicks	yes	yes	yes	yes	yes	yes	yes	N/A	N/A	yes	yes
-		Janitors closet 410a	no	Walls, Ceiling	flaking	LLC ACER Associates,	7/25/22	Stabilization Paint/Plaster	SDP	Seasan Hall	Ryan Hicks	yes	yes	yes	yes	yes	yes	yes	N/A	N/A	yes	yes
		Girls Bathroom	yes	Walls, Ceiling	flaking	LLC	7/27/22	Stabilization	SDP	Seasan Hall	sal procopio	yes	yes	yes	yes	yes	yes	yes	N/A	N/A	yes	yes
-		Art Rm closet	yes	Wall	flaking	ACER Associates, LLC ACER Associates,	7/27/22	Paint/Plaster Stabilization Paint/Plaster	SDP	Seasan Hall	sal procopio	yes	yes	yes	yes	yes	yes	yes	N/A	N/A	yes	yes
1	В	closet next to sinks	no	Walls, Ceiling	flaking	LLC	7/27/22	Stabilization	SDP	Seasan Hall	sal procopio	yes	yes	yes	yes	yes	yes	yes	N/A	N/A	yes	yes

E I e m e n t			All objects in the work area removed or covered (interiors)	HVAC ducts in the work area closed and covered (interiors)	Windows in the work area closed (interiors)	Doors in the work area closed and sealed (interiors)	Doors that must be used in the work area covered to allow passage but prevent spread of dust	Floors in the work area covered with taped-down plastic (interiors)	Waste contained on- site and while being transported off-site	Work site properly cleaned after renovation	All chips and debris picked up, protective sheeting misted, folded dirty side inward, and taped for removal	Light lenses inspected (Y/N)	Surfaces above light fixtures inspected (Y/N)	Work area surfaces and objects cleaned using HEPA vacuum and/or wet cloths or mops (interior)	Certified renovator performed post- renovation cleaning verification	Describe the results of post-renovation cleaning verification, including the number of wet and dry cloths used	If dust clearance testing was performed instead, attach a copy of the report	I certify under penalty of law that the previous information is true and complete (name and title)	Date signed
1	2 R	Room 204 - Nurse's Office	yes	yes	yes	yes	yes	yes	yes	yes	yes	N/A	N/A	yes	yes	Pass - 8 wet wipes	N/A	Kevin Rumbol	8/4/21
1	2 R	Room 204A - Nurse's Office Restroom	yes	yes	yes	yes	yes	yes	yes	yes	yes	N/A	N/A	yes	yes	Pass - 1 Wet Wipe	N/A	Kevin Rumbol	8/4/21
1	2 R	Room 204B - Nurse's Office Vestibule	yes	yes	yes	yes	yes	yes	yes	yes	yes	Y	Y	yes	yes	Pass - 1 Wet Wipe	N/A	Kevin Rumbol	8/4/21
1	2 R	Room 205	yes	yes	yes	yes	yes	yes	yes	yes	yes	Y	Y	yes	yes	Pass - 16 Wet Wipes	N/A	Kevin Price	8/21/21
1	2 R	Room 206	yes	yes	yes	yes	yes	yes	yes	yes	yes	Y	Y	yes	yes	Pass - 18 Wet Wipes	N/A	Kevin Rumbol	8/21/21
1	2 R	Room 207	yes	yes	yes	yes	yes	yes	yes	yes	yes	Y	Y	yes	yes	Pass - 18 Wet Wipes	N/A	Kevin Price	8/21/21
1	2 R	Room 206A	yes	yes	yes	yes	yes	yes	yes	yes	yes	Y	Y	yes	yes	Pass - 3 Wet Wipes	N/A	Kevin Rumbol	8/21/21
1	2 R	Room 207A	yes	yes	yes	yes	yes	yes	yes	yes	yes	Y	Y	yes	yes	Pass - 3 Wet Wipes	N/A	Kevin Rumbol	8/26/21
1	2 R	Room 208	yes	yes	yes	yes	yes	yes	yes	yes	yes	Y	Y	yes	yes	Pass - 14 Wet Wipes	N/A	Kevin Price	8/19/21
1	2 R	Room 208A	yes	yes	yes	yes	yes	yes	yes	yes	yes	Y	Y	yes	yes	Pass - 3 Wet Wipes	N/A	Nicolas Lees	8/20/21
1	2 R	Room 202	yes	yes	yes	yes	yes	yes	yes	yes	yes	Y	Y	yes	yes	Pass - 19 Wet Wipes	N/A	Kevin Rumbol	8/12/21
1	2 R	Room 201	yes	yes	yes	yes	yes	yes	yes	yes	yes	Y	Y	yes	yes	Pass - 17 Wet Wipes	N/A	Kevin Price	8/18/21
1	1 R	Room 101	yes	yes	yes	yes	yes	yes	yes	yes	yes	Y	Y	yes	yes	Pass - 11 Wet Wipes	N/A	Kevin Rumbol	8/14/21
1	1 R	Room 102A	yes	yes	yes	yes	yes	yes	yes	yes	yes	Y	Y	yes	yes	pass - 2 Wet Wipes	N/A	Nicolas Lees	8/19/21
1	1 R	Room 102	yes	yes	yes	yes	yes	yes	yes	yes	yes	Y	Y	yes	yes	Pass - 27 Wet Wipes	N/A	Kevin Price	8/18/21
1	1 R	Room 108	yes	yes	yes	yes	yes	yes	yes	yes	yes	Y	Y	yes	yes	Pass - 19 Wet Wipes	N/A	Kevin Rumbol	8/14/21
1	1 R	Room 109	yes	yes	yes	yes	yes	yes	yes	yes	yes	Y	Y	yes	yes	Pass - 16 Wet Wipes	N/A	Nicolas Lees	8/19/21
1	2 R	Room 202A	yes	yes	yes	yes	yes	yes	yes	yes	yes	Y	Y	yes	yes	Pass - 2 Wet Wipes	N/A	Kevin Rumbol	8/12/21
1	2 R	Room 201A	yes	yes	yes	yes	yes	yes	yes	yes	yes	Y	Y	yes	yes	Pass - 2 Wet Wipes	N/A	Kevin Price	8/18/21
1	2 R	Room 205A	yes	yes	yes	yes	yes	yes	yes	yes	yes	Y	Y	yes	yes	Pass - 2 Wet Wipes	N/A	Kevin Price	8/24/21
1	2 R	Room 203	yes	yes	yes	yes	yes	yes	yes	yes	yes	N/A	N/A	yes	yes	Pass - 35 Wet Wipes	N/A	Nicolas Lees	8/20/21
1	2 R	Room 109A	yes	yes	yes	yes	yes	yes	yes	yes	yes	Y	Y	yes	yes	Pass - 2 Wet Wipes	N/A	Nicolas Lees	8/19/21
1	1 R	Room 108A	yes	yes	yes	yes	yes	yes	yes	yes	yes	N/A	N/A	yes	yes	Pass - 2 Wet Wipes	N/A	Kevin Price	8/16/21
1	1 R	Room 108B	yes	yes	yes	yes	yes	yes	yes	yes	yes	Y	Y	yes	yes	Pass - 3 Wet Wipes	N/A	Kevin Price	8/16/21
1	1 W	Vomen's Restroom adjacent to Classroom	yes	yes	yes	yes	yes	yes	yes	yes	yes	Y	Y	yes	yes	Pass - 5 Wet Wipes	N/A	Kevin Price	8/23/21
1	1 Te	eacher's Lounge Men's Restroom	yes	yes	yes	yes	yes	yes	yes	yes	yes	Y	Y	yes	yes	Pass - 3 Wet Wipes	N/A	Nicolas Lees	8/24/21
1	1 M	Main Entrance Stairwell	yes	yes	yes	yes	yes	yes	yes	yes	yes	N/A	N/A	yes	yes	Pass - 12 Wet Wipes	N/A	Nicolas Lees	8/21/21
1	2 S	Stairwell across Classroom 205	yes	yes	yes	yes	yes	yes	yes	yes	yes	N/A	N/A	yes	yes	Pass - 7 Wet Wipes	N/A	Nicolas Lees	10/15/21
1	3 S	Stairwell across Classroom 306	yes	yes	yes	yes	yes	yes	yes	yes	yes	N/A	N/A	yes	yes	Pass - 7 Wet Wipes	N/A	Nicolas Lees	10/15/21
1	B R	Room 009 Art Room	yes	yes	yes	yes	yes	yes	yes	yes	yes	N/A	N/A	yes	yes	Pass - 24 Wet Wipes	N/A	Nicolas Lees	8/25/21
1	B R	Room 009A Art Room Storage Room	yes	yes	yes	yes	yes	yes	yes	yes	yes	N/A	N/A	yes	yes	Pass - 6 Wet Wipes	N/A	Nicolas Lees	8/25/21
1	3 н	Hallway outside Classrooms 308-309	yes	yes	yes	yes	yes	yes	yes	yes	yes	Y	Y	yes	yes	Pass - 34 Wet Wipes	N/A	Nicolas Lees	10/1/21
1	3 н	Hallway from Classrooms 303-307	yes	yes	yes	yes	yes	yes	yes	yes	yes	Y	Y	yes	yes	Pass - 52 Wet Wipes	N/A	Nicolas Lees	10/2/21
1	3 H	Hallway outside Classrooms 301-302	yes	yes	yes	yes	yes	yes	yes	yes	yes	Y	Y	yes	yes	Pass - 34 Wet Wipes	N/A	Nicolas Lees	10/3/21
1	ВН	Hallway outside Boy's Restroom/Art Room	yes	yes	yes	yes	yes	yes	yes	yes	yes	Y	Y	yes	yes	Pass - 13 Wet Wipes	N/A	Nicolas Lees	8/26/21
1	B G	Gym/Cafeteria	yes	yes	yes	yes	yes	yes	yes	yes	yes	N/A	N/A	yes	yes	Pass - 73 Dry Cloths	N/A	Nicolas Lees	8/31/21
1	В Б	Girl's Side Stairwell Storage Room	yes	yes	yes	yes	yes	yes	yes	yes	yes	N/A	N/A	yes	yes	Pass - 3 Wet Wipes	N/A	Nicolas Lees	8/27/21
1	B S	Stairwell on Boy's Side	yes	yes	yes	yes	yes	yes	yes	yes	yes	N/A	N/A	yes	yes	Pass - 11 Wet Wipes	N/A	Nicolas Lees	10/15/21
1	ВН	Hallway outside Girl's Restroom/Kitchen	yes	yes	yes	yes	yes	yes	yes	yes	yes	N/A	N/A	yes	yes	Pass - 3 Wet Wipes	N/A	Nicolas Lees	8/24/21
1	1 Fi	ire Tower near Classroom 109	yes	yes	yes	yes	yes	yes	yes	yes	yes	N/A	N/A	yes	yes	Pass - 11 Dry Wipes	N/A	Nicolas Lees	10/1/21
1	2 Fi	Fire Tower near Classroom 208	yes	yes	yes	yes	yes	yes	yes	yes	yes	N/A	N/A	yes	yes	Pass - 7 Dry Wipes	N/A	Nicolas Lees	10/1/21
1	3 Fi	Fire Tower near Classroom 309	yes	yes	yes	yes	yes	yes	yes	yes	yes	N/A	N/A	yes	yes	Pass - 7 Dry Wipes	N/A	Nicolas Lees	10/1/21
1	4 Fi	Fire Tower near Classroom 409	yes	yes	yes	yes	yes	yes	yes	yes	yes	N/A	N/A	yes	yes	Pass - 3 Dry Wipes	N/A	Nicolas Lees	10/1/21
1	1 Fi	Fire Tower near Classroom 102	yes	yes	yes	yes	yes	yes	yes	yes	yes	N/A	N/A	yes	yes	Pass - 11 Dry Wipes	N/A	Nicolas Lees	10/21/21
1		Fire Tower near Classroom 201	yes	yes	yes	yes	yes	yes	yes	yes	yes	N/A	N/A	yes	yes	Pass - 7 Dry Wipes	N/A	Nicolas Lees	10/21/21
		ire Tower near Classroom 301	yes	yes	yes	yes	yes	yes	yes	yes	yes	N/A	N/A	yes	yes	Pass - 7 Dry Wipes	N/A	Nicolas Lees	10/21/21

E l e m e n t	F 1 0 1 **** NOTE: Protections and formulas were deleted because oversight started before scope of work *******	All objects in the work area removed or covered (interiors)		Windows in the work area closed (interiors)	Doors in the work area closed and sealed (interiors)	Doors that must be used in the work area covered to allow passage but prevent spread of dust	Floors in the work area covered with taped-down plastic (interiors)	Waste contained on- site and while being transported off-site	Work site properly cleaned after renovation	All chips and debris picked up, protective sheeting misted, folded dirty side inward, and taped for removal	Light lenses inspected (Y/N)	Surfaces above light fixtures inspected (Y/N)	Work area surfaces and objects cleaned using HEPA vacuum and/or wet cloths or mops (interior)	Certified renovator performed post- renovation cleaning verification	Describe the results of post-renovation cleaning verification, including the number of wet and dry cloths used	If dust clearance testing was performed instead, attach a copy of the report	I certify under penalty of law that the previous information is true and complete (name and title)	Date signed
1	4 Fire Tower near Classroom 402	yes	yes	yes	yes	yes	yes	yes	yes	yes	N/A	N/A	yes	yes	Pass - 3 Dry Wipes	N/A	Nicolas Lees	10/21/21
1	4 Room 401A	yes	yes	yes	yes	yes	yes	yes	yes	yes	Y	Y	yes	yes	Pass - 2 Wipes	N/A	Nicolas Lees	10/14/21
1	3 Room 308A	yes	yes	yes	yes	yes	yes	yes	yes	yes	Y	Y	yes	yes	Pass - 1 Wet Wipe	N/A	Nicolas Lees	8/28/21
1	1 Hallway from Counselor's Office to Principal's Office	yes	yes	yes	yes	yes	yes	yes	yes	yes	N/A	N/A	yes	yes	Pass - 10 Wet Wipe	N/A	Nicolas Lees	8/28/21
1	1 Hallway by Classrooms 108-109	yes	yes	yes	yes	yes	yes	yes	yes	yes	Y	Y	yes	yes	Pass - 15 Wet Wipes	N/A	Kevin Rumbol	10/8/21
1	1 Hallway outside Classroom 102	yes	yes	yes	yes	yes	yes	yes	yes	yes	Y	Y	yes	yes	Pass - 15 Wet Wipe	N/A	Kevin Rumbol	9-28-2021
1	B Stairwell on Girl's Side	yes	yes	yes	yes	yes	yes	yes	yes	yes	N/A	N/A	yes	yes	Pass - 14 Wet Wipe	N/A	Kevin Price	9-28-2021
1	1 Stairwell by Counselor's Office	yes	yes	yes	yes	yes	yes	yes	yes	yes	N/A	N/A	yes	yes	Pass - 16 Wet Wipe	N/A	Kevin Price	9-28-2021
1	2 Stairwell across from Library	yes	yes	yes	yes	yes	yes	yes	yes	yes	N/A	N/A	yes	yes	Pass - 16 Wet Wipe	N/A	Kevin Price	9-28-2021
1	3 Stairwell across from Classroom 304	yes	yes	yes	yes	yes	yes	yes	yes	yes	N/A	N/A	yes	yes	Pass - 16 Wet Wipe	N/A	Kevin Price	9-28-2021
1	2 Hallway outside Classrooms 201-202	yes	yes	yes	yes	yes	yes	yes	yes	yes	Y	Y	yes	yes	Pass - 30 Wet Wipe	N/A	Kevin Price	9-28-2021
1	2 Boy's Restroom adjacent to IMC	yes	yes	yes	yes	yes	yes	yes	yes	yes	Y	Y	yes	yes	Pass - 5 Wet Wipes	N/A	Kevin Rumbol	10/22/21
1	2 Women's Restroom adjacent to Classroom	yes	yes	yes	yes	yes	yes	yes	yes	yes	Y	Y	yes	yes	Pass - 5 Wet Wipes	N/A	Kevin Rumbol	10/21/21
1	B Hallway from Fan Room to Boiler Room	yes	yes	yes	yes	yes	yes	yes	yes	yes	Y	Y	yes	yes	Pass - 21 Dry Wipes	N/A	Kevin Rumbol	10/25/21
1	Principal/Directors Office	yes	yes	yes	yes	yes	yes	yes	yes	yes	N/A	N/A	yes	yes	Pass - 9 Wet Wipes	N/A	Kevin Rumbol	10-19-21
1	1 Vestibule outside Assistant Principal's	yes	yes	yes	yes	yes	yes	yes	yes	yes	N/A	N/A	yes	yes	Pass - 5 Wet Wipes	N/A	Kevin Rumbol	10-20-21
1	B Gym Storage in Stairwell	yes	yes	yes	yes	yes	yes	yes	yes	yes	N/A	N/A	yes	yes	Pass - 3 Dry Wipes	N/A	Kevin Rumbol	10/22/21
1	2 Large Library Closet closest to Hallway	yes	yes	yes	yes	yes	yes	yes	yes	yes	N/A	N/A	yes	yes	Pass - 3 Dry Wipes	N/A	Kevin Rumbol	10/22/21
1	1 Counselor's Office	yes	yes	yes	yes	yes	yes	yes	yes	yes	N/A	N/A	yes	yes	Pass - 5 Wet Wipes	N/A	Kevin Rumbol	10/21/21
1	B Gym Office	yes	yes	yes	yes	yes	yes	yes	yes	yes	N/A	N/A	yes	yes	Pass - 5 Wet Wipes	N/A	Kevin Rumbol	10/22/21
1	1 Teacher's Lounge (104)	yes	yes	yes	yes	yes	yes	yes	yes	yes	N/A	N/A	yes	yes	Pass - 4 Wet Wipes	N/A	Kevin Rumbol	10/25/21
1	1 Auditorium	yes	yes	yes	yes	yes	yes	N/A	yes	yes	N/A	N/A	yes	yes	Pass - 15 Wet Wipes	N/A	sal procopio	7/13/22
1	1 Auditorium Stage	yes	yes	yes	yes	yes	yes	N/A	yes	yes	N/A	N/A	yes	yes	Pass - 100+ Wet	N/A	sal procopio	7/13/22
1	1 Stairs to Right of Stage	yes	yes	yes	yes	yes	yes	N/A	yes	yes	N/A	N/A	yes	yes	Wipes failed-10wipes	N/A	sal procopio	7/27/22
1	1 Stairs to Left of Stage	yes	yes	yes	yes	yes	yes	N/A	yes	yes	N/A	N/A	yes	yes	failed- 10 wipes	N/A	sal procopio	7/27/22
1	2 Upper Storage Rm to Right of Stage	yes	yes	yes	yes	yes	yes	N/A	yes	yes	N/A	N/A	yes	yes	failed- 3 wipes	N/A	sal procopio	7/27/22
1	2 Upper Storage Rm to Left of Stage	yes	yes	yes	yes	yes	yes	N/A	yes	yes	N/A	N/A	yes	yes	failed- 3 wipes	N/A	sal procopio	7/27/22
1	2 Projector Rm	yes	yes	yes	yes	yes	yes	N/A	yes	yes	N/A	N/A	yes	yes	pass-2 wipes	N/A	sal procopio	7/27/22
1	1 Room 107A	yes	yes	yes	yes	yes	yes	N/A	yes	yes	N/A	N/A	yes	yes	pass-2 wipes	N/A	sal procopio	7/27/22
1	1 Hallway 13	yes	yes	yes	yes	yes	yes	N/A	yes	yes	N/A	N/A	yes	yes	pass-3 wipes	N/A	sal procopio	7/27/22
1	1 Stair well	yes	yes	yes	yes	yes	yes	N/A	yes	yes	N/A	N/A	yes	yes	pass-3 wipes	N/A	sal procopio	7/27/22
1	1 Janitors closet 110a	yes	yes	yes	yes	yes	yes	N/A	yes	yes	N/A	N/A	yes	yes	pass-1 wipes	N/A	sal procopio	7/28/22
1	1 Room 104 D	yes	yes	yes	yes	yes	yes	N/A	yes	yes	N/A	N/A	yes	yes	failed - 6 wipes	N/A	sal procopio	7/27/22
1	1 Rm 105	yes	yes	yes	yes	yes	yes	N/A	yes	yes	N/A	N/A	yes	yes	pass 8 wipes 4x2	N/A	sal procopio	8/4/22
1	2 Hallway 23	yes	yes	yes	yes	yes	yes	N/A	yes	yes	N/A	N/A	yes	yes	pass-2 wipes	N/A	sal procopio	7/27/22
1	2 2nd fl Library	yes	yes	yes	yes	yes	yes	N/A	yes	yes	N/A	N/A	yes	yes	pass -4 wipes	N/A	sal procopio	7/28/22
1	2 Janitors closet 207b	yes	yes	yes	yes	yes	yes	N/A	yes	yes	N/A	N/A	yes	yes	pass-3 wipes	N/A	sal procopio	7/27/22
1	3 Room 303	yes	yes	yes	yes	yes	yes	N/A	yes	yes	N/A	N/A	yes	yes	pass-2 wipes	N/A	sal procopio	7/28/22
1	3 Janitors closet 312a	yes	yes	yes	yes	yes	yes	N/A	yes	yes	N/A	N/A	yes	yes	pass -2 wipes	N/A	sal procopio	7/29/22
1	3 Rm 309	N/A	N/A	N/A	N/A	N/A	N/A	N/A	yes	N/A	N/A	N/A	N/A	N/A	paint only	N/A	sal procopio	7/27/22
1	3 Stairwell S4	yes	yes	yes	yes	yes	yes	N/A	yes	yes	N/A	N/A	n/a	n/a	paint only	N/A	sal procopio	7/28/22
1	4 Room 403	yes	yes	yes	yes	yes	yes	N/A	yes	yes	N/A	N/A	yes	yes	pass-2 wipes	N/A	sal procopio	7/20/22
1	4 Janitors closet 410a	yes	yes	yes	yes	yes	yes	N/A	yes	yes	N/A	N/A	yes	yes	pass-2 wipes	N/A	sal procopio	7/27/22
1	B Girls Bathroom	yes	yes	yes	yes	yes	yes	N/A	yes	yes	N/A	N/A	yes	yes	faill 30 wipes	N/A	sal procopio	7/27/22
1	B Art Rm closet	yes	yes	n/a		n/a	n/a	n/a			n/a	n/a	n/a	n/a	paint only	n/a	sal procopio	7/28/22
1	B closet next to sinks				yes				yes	yes								
'_	D Closet hext to sirks	yes	yes	n/a	yes	n/a	n/a	n/a	yes	yes	n/a	n/a	n/a	n/a	paint only	n/a	sal procopio	7/28/22

E F m o e o n r t		Component	Description of Paint and Plaster Damage	Pre-Cleaning Completed (date)	Contents Moved (date)	Work Area Prepped (date)	Surfaces Stabilized (date)	Contents Back in Place (date)	Final Inspection Approval and Photos (date)	Square Footage of Work Area	Number of Required RRP Wipes	Number of Colorimetric Wipes Used to Pass	Final Colorimetric Wipe Submitted for AAS Analysis (yes/no)	AAS Analysis Results	Comments from Oversite
1 2	Room 204 - Nurse's Office	Walls, Ceiling	Flaking	8/2/21	8/2/21	8/2/21	8/4/21	8/5/21	8/4/21	285	8	N/A	N/A	N/A	
1 2	Room 204A - Nurse's Office Restroom	Walls, Ceiling	Cracking	8/2/21	8/2/21	8/2/21	8/4/21	8/5/21	8/4/21	33	1	N/A	N/A	N/A	
1 2	Room 204B - Nurse's Office Vestibule	Walls, Ceiling	Cracking	8/2/21	8/2/21	8/2/21	8/4/21	8/5/21	8/4/21	40	1	N/A	N/A	N/A	
1 2	Room 205	Walls, Ceiling	Cracking	8/4/21	8/3/21	8/4/21	8/18/2021	8/21/2021	8/18/2021	525	16	N/A	N/A	N/A	
1 2	Room 206	Walls, Ceiling	Cracking	8/5/21	8/3/21	8/5/21	8/12/21	8/21/2021	8/12/21	642	18	N/A	N/A	N/A	
1 2	Room 207	Walls, Ceiling	Cracking	8/5/21	8/3/21	8/5/21	8/17/2021	8/21/2021	8/17/2021	750	22	N/A	N/A	N/A	
1 2	Room 208	Walls, Ceiling	Cracking	8/5/21	8/3/21	8/5/21	8/19/2021	8/19/2021	8/19/2021	475	14	N/A	N/A	N/A	
1 2	Room 206A	Walls, Ceiling	Cracking	8/5/21	8/3/21	8/5/21	8/12/21	8/21/2021	8/12/21	76	3	N/A	N/A	N/A	
1 2	Room 207A	Walls, Ceiling	Flaking	8/5/21	8/3/21	8/5/21	8/26/21	8/26/21	8/26/21	72	3	N/A	N/A	N/A	
1 2	Room 208A	Walls, Ceiling	Alligatoring	8/26/21	8/26/21	8/26/21	8/26/21	8/26/21	8/26/21	72	3	N/A	N/A	N/A	
1 2	Room 202	Walls, Ceiling	Cracking	8/6/21	8/3/21	8/6/21	8/11/21	8/21/2021	8/12/21	667	19	N/A	N/A	N/A	
1 2	Room 201	Walls, Ceiling	Cracking	8/6/21	8/3/21	8/6/21	8/18/2021	8/21/2021	8/18/2021	567	17	N/A	N/A	N/A	
1 1	Room 101	Walls, Ceiling	Flaking	8/10/21	8/4/21	8/10/21	8/12/21	8/12/21	8/12/21	380	11	N/A	N/A	N/A	
1 1	Room 102	Walls, Ceiling	Flaking	8/10/21	8/4/21	8/10/21	8/18/2021	8/21/2021	8/18/2021	924	27	N/A	N/A	N/A	
1 1	Room 108	Walls, Ceiling	Cracking	8/10/21	8/4/21	8/10/21	8/12/21	8/21/2021	8/21/21	660	19	N/A	N/A	N/A	
1 1	Room 109	Walls, Ceiling	Flaking	8/10/21	8/4/21	8/10/21	8/19/21	8/19/21	8/19/21	540	16	N/A	N/A	N/A	
1 2	Room 202A	Walls, Ceiling	Flaking	8/6/21	8/3/21	8/6/21	8/12/21	8/21/2021	8/12/21	32	2	N/A	N/A	N/A	
1 2	Room 201A	Walls, Ceiling	Flaking	8/6/21	8/3/21	8/6/21	8/18/2021	8/21/2021	8/18/2021	80	2	N/A	N/A	N/A	
1 2	Room 205A	Walls, Ceiling	Cracking	8/4/21	8/3/21	8/4/21	8/18/2021	8/21/2021	8/18/2021	80	2	N/A	N/A	N/A	
1 2	Room 203	Walls, Ceiling	Efflorescence	8/5/21	8/5/21	8/5/21	8/20/2021	8/20/2021	8/20/2021	1231	35	N/A	N/A	N/A	
1 2	Room 102A	Walls, Ceiling	Flaking	8/10/21	8/4/21	8/10/21	8/19/21	8/19/21	8/19/21	40	2	N/A	N/A	N/A	
1 2	Room 109A	Walls, Ceiling	Flaking	8/10/21	8/4/21	8/10/21	8/19/21	8/19/21	8/19/21	68	2	N/A	N/A	N/A	
1 1	Room 108A	Walls, Ceiling	Cracking	8-13-2021	8-13-2021	8-13-2021	8-16-2021	8/21/2021	8-16-2021	55	2	N/A	N/A	N/A	
1 1	Room 108B	Walls, Ceiling	Flaking	8-13-2021	8-13-2021	8-13-2021	8-16-2021	8/21/2021	8-16-2021	50	3	N/A	N/A	N/A	
1 1	Women's Restroom adjacent to Classroom 108	Walls, Ceiling	Flaking	8/17/2021	8/17/2021	8/17/2021	8/23/21	8/23/21	8/23/21	160	5	N/A	N/A	N/A	
1 1	Teacher's Lounge Men's Restroom	Walls, Ceiling	Flaking	8/17/2021	8/17/2021	8/17/2021	8/24/21	8/24/21	8/24/21	50	3	N/A	N/A	N/A	
1 3	Hallway outside Classrooms 308-309	Walls, Ceiling	Flaking	8/19/2021	8/19/2021	8/19/2021	10/1/2021	10/1/2021	10/1/2021	600	34	N/A	N/A	N/A	
1 3	Hallway from Classrooms 303-307	Walls, Ceiling	Alligatoring/Chipping	8/19/2021	8/19/2021	8/19/2021	10/1/2021	10/1/2021	10/1/2021	960	52	N/A	N/A	N/A	
1 3	Hallway outside Classrooms 301-302	Walls, Ceiling	Alligatoring/Chipping/Efflo resence	8/19/2021	8/19/2021	8/19/2021	10/1/2021	10/1/2021	10/1/2021	600	34	N/A	N/A	N/A	
1 2	Stairwell across from Classroom 205	Walls, Ceiling	alligatoring/chipping/flakin g	8/19/21	8/19/21	8/19/21	8/27/21	8/27/21	10/15/21	223	7	N/A	N/A	N/A	
1 3	Stairwell across from Classroom 306	Walls, Ceiling	alligatoring/chipping/flakin g	8/19/21	8/19/21	8/19/21	8/27/21	8/27/21	10/15/21	223	7	N/A	N/A	N/A	
1 B	009 Art Room	Walls, Ceiling	Flaking	8/19/21	8/19/21	8/19/21	8/25/21	8/25/21	8/25/21	816	24	N/A	N/A	N/A	
1 B	009A Art Room Storage Room	Walls, Ceiling	Chipping, Flaking	8/19/21	8/19/21	8/19/21	8/25/21	8/25/21	8/25/21	160	6	N/A	N/A	N/A	
1 B	Hallway outside Boy's Restroom/Art Room	Walls, Ceiling	Flaking, Efflorensence	8/20/21	8/20/21	8/20/21	8/26/21	8/26/21	8/26/21	504	13	N/A	N/A	N/A	
1 B		Walls, Ceiling	Flaking, Chipping	8/23/21	8/23/21	8/23/21	8/27/21	8/27/21	8/31/21	2800	73	N/A	N/A	N/A	
1 B	Girl's Side Stairwell Storage Room	Walls, Ceiling	Flaking	8/23/21	8/23/21	8/23/21	8/25/21	8/25/21	8/25/21	96	3	N/A	N/A	N/A	
1 B	Stairwell on Boy's Side	Walls, Ceiling	Chipping	8/25/21	8/25/21	8/25/21	9/27/21	9/27/21	10/15/21	437	11	N/A	N/A	N/A	
1 B	Hallway outside Girl's Restroom/Kitchen	Walls, Ceiling	Chipping, Flaking	8/23/21	8/23/21	8/23/21	8/24/21	8/24/21	8/24/21	117	3	N/A	N/A	N/A	
1 1	Fire Tower near Classroom 109	Walls, Ceiling	Chipping, Flaking	8/24/21	8/24/21	8/24/21	9/27/21	9/27/21	10/1/2021	322	11	N/A	N/A	N/A	
1 2	Fire Tower near Classroom 208	Walls, Ceiling	Chipping, Flaking	8/24/21	8/24/21	8/24/21	9/27/21	9/27/21	10/1/2021	215	7	N/A	N/A	N/A	
1 3	Fire Tower near Classroom 309	Walls, Ceiling	Chipping, Flaking	8/24/21	8/24/21	8/24/21	9/27/21	9/27/21	10/1/2021	215	7	N/A	N/A	N/A	

E I e m e n t	F I O O r	On Site Room Name **** NOTE: Protections and formulas were deleted because oversight started before scope of work *******	Component	Description of Paint and Plaster Damage	Pre-Cleaning Completed (date)	Contents Moved (date)	Work Area Prepped (date)	Surfaces Stabilized (date)	Contents Back in Place (date)	Final Inspection Approval and Photos (date)	Square Footage of Work Area	Number of Required RRP Wipes	Number of Colorimetric Wipes Used to Pass	Final Colorimetric Wipe Submitted for AAS Analysis (yes/no)	AAS Analysis Results	Comments from Oversite
1	4	Fire Tower near Classroom 409	Walls, Ceiling	Chipping, Flaking	8/23/21	8/23/21	8/23/21	9/27/21	9/27/21	10/1/2021	52	3	N/A	N/A	N/A	
1	1	Fire Tower near Classroom 102	Walls, Ceiling	Chipping, Flaking	8/24/21	8/24/21	8/24/21	10/8/21	10/8/21	10/21/21	322	11	N/A	N/A	N/A	
1	2	Fire Tower near Classroom 201	Walls, Ceiling	Chipping, Flaking	8/23/21	8/23/21	8/23/21	10/8/21	10/8/21	10/22/21	215	7	N/A	N/A	N/A	
1	3	Fire Tower near Classroom 301	Walls, Ceiling	Chipping, Flaking	8/23/21	8/23/21	8/23/21	10/8/21	10/8/21	10/23/21	215	7	N/A	N/A	N/A	
1	4	Fire Tower near Classroom 402	Walls, Ceiling	Chipping, Flaking	8/23/21	8/23/21	8/23/21	10/8/21	10/8/21	10/24/21	52	3	N/A	N/A	N/A	
1	4	Room 401A	Wall	Flaking	8/25/21	8/25/21	8/25/21	9/15/21	9/15/21	10/14/21	64	2	N/A	N/A	N/A	
1	1	Main Entrance Stairwell	Walls, Ceiling	Chipping, Flaking	8/18/21	8/18/21	8/18/21	8/21/21	8/21/21	8/21/21	450	12	N/A	N/A	N/A	
1	3	Room 308A	Walls, Ceiling	Chipping	8/28/21	8/28/21	8/28/21	8/28/21	8/28/21	8/28/21	40	1	N/A	N/A	N/A	
1	1	Hallway from Counselor's Office to Principal's Office	Ceiling	Chipping	8/28/21	8/28/21	8/28/21	10/8/21	10/8/21	10/8/21	360	10	N/A	N/A	N/A	
1	1	Hallway by Classrooms 108-109	Walls, Ceiling	cracking	8/31/21	8/31/21	8/31/21	10/8/21	10/8/21	10/8/21	502	15	N/A	N/A	N/A	
1	1	Hallway outside Classroom 102	Walls, Ceiling	cracking	8/31/21	8/31/21	8/31/21	10/8/21	10/8/21	10/8/21	502	15	N/A	N/A	N/A	
1	В	Stairwell on Girl's Side	Walls, Ceiling	cracking	8/25/21	8/25/21	8/25/21	9/27/21	9/28/2021	9/28/2021	260	14	N/A	N/A	N/A	
1	1	Stairwell by Counselor's Office	Walls, Ceiling	cracking	8/25/21	8/25/21	8/25/21	9/27/21	9/28/2021	9/28/2021	308	16	N/A	N/A	N/A	
1		Stairwell across from Library	Walls, Ceiling	cracking	8/25/21	8/25/21	8/25/21	9/27/21	9/28/2021	9/28/2021	308	16	N/A	N/A	N/A	
1	3	Stairwell across from Classroom 304	Walls, Ceiling	cracking	8/25/21	8/25/21	8/25/21	9/27/21	9/28/2021	9/28/2021	308	16	N/A	N/A	N/A	
1	2	Hallway outside Classrooms 201-202	Walls, Ceiling	cracking	8/25/21	8/25/21	8/25/21	9/27/21	9/28/2021	9/28/2021	500	30	N/A	N/A	N/A	
1	2	Boy's Restroom adjacent to IMC	Walls, Ceiling	Flaking	10/12/21	10/12/21	10/15/21	10/20/21	10/22/21	10/22/21	129	5	N/A	N/A	N/A	
1	2	Women's Restroom adjacent to Classroom 206	Walls, Ceiling	Flaking	10/12/21	10/12/21	10/12/21	10/14/21	10/21/21	10/22/21	155	5	N/A	N/A	N/A	
1	В	Hallway from Fan Room to Boiler Room	Walls, Ceiling	cracking	10/14/21	10/14/21	10/14/21	10/22/21	10/25/21	10/25/21	632	21	N/A	N/A	N/A	
1	1	Principal/Directors Office	Walls, Ceiling	Flaking	10/15/21	10/15/21	10/15/21	10/19/21	10/19/21	10/19/21	286	9	N/A	N/A	N/A	
1	1	Vestibule outside Assistant Principal's Office	Walls, Ceiling	Efflorescence	10/19/21	10/19/21	10/19/21	10/19/21	10/19/21	10/22/21	166	5	N/A	N/A	N/A	
1		Gym Storage in Stairwell	Walls, Ceiling	Flaking	10/20/21	10/20/21	10/20/21	10/21/21	10/22/21	10/22/21	74	3	N/A	N/A	N/A	
1	2	Large Library Closet closest to Hallway	Walls, Ceiling	cracking	10/18/21	10/18/21	10/18/21	10/22/21	10/22/21	10/22/21	120	3	N/A	N/A	N/A	
1	1	Counselor's Office	Walls, Ceiling	cracking	10/21/21	10/21/21	10/21/21	10/21/21	10/21/21	10/22/21	142	5	N/A	N/A	N/A	
1	В	Gym Office	Walls, Ceiling	Flaking	10/22/21	10/22/21	10/22/21	10/22/21	10/22/21	10/22/21	168	5	N/A	N/A	N/A	
1	1	Teacher's Lounge (104)	Walls, Ceiling	Cracking	10/25/21	10/25/21	10/25/21	10/25/21	10/25/21	10/25/21	110	4	N/A	N/A	N/A	
1	1	Auditorium	Walls,Ceiling	flaking	na	6/21/22	6/22/22	7/12/22	7/14/22	7/12/22	2400	60	N/A	N/A	N/A	
1	1	Auditorium Stage	Walls,Ceiling	flaking	na	6/22/22	6/30/22	7/12/22	7/14/22	7/12/22	450	12	N/A	N/A	N/A	
1	1	Stairs to Right of Stage	Walls,Ceiling	flaking	na	7/14/22	7/13/22	7/14/22	7/14/22	7/14/22	80	2	N/A	N/A	N/A	
1	1	Stairs to Left of Stage	Walls,Ceiling	flaking	na	7/12/22	7/13/22	7/14/22	7/14/22	7/14/22	80	2	N/A	N/A	N/A	
1	2	Upper Storage Rm to Right of Stage	Walls,Ceiling	flaking	na	7/14/22	7/13/22	7/14/22	7/14/22	7/14/22	30	1	N/A	N/A	N/A	
1	2	Upper Storage Rm to Left of Stage	Walls,Ceiling	flaking	na	7/12/22	7/13/22	7/14/22	7/14/22	7/14/22	30	1	N/A	N/A	N/A	
1	2	Projector Rm	Walls,Ceiling	flaking	na	6/30/22	7/11/22	7/14/22	7/14/22	7/14/22	40	1	N/A	N/A	N/A	



APPENDIX C

ACER RRP CERTIFICATE

THIS CERTIFICATE IS AWARDED TO

RONALD J. ROMINSKI

3104 LIMESTONE WAY, MT. LAUREL, NJ 08054

FOR SUCCESSFULLY COMPLETING THE PRESCRIBED COURSE OF STUDY IN

DUST SAMPLING TECHNICIAN INITIAL- ENGLISH

PRESENTED BY
ACCESS TRAINING SERVICES, INC.
7921 RIVER ROAD, PENNSAUKEN, NEW JERSEY 08110
(856) 665-3449

CERTIFICATE NUMBER: <u>D-I-18846-21-00322</u>

COURSE DATE 11/22/21 EXAM DATE 11/22/21 EXPIRATION DATE 11/22/26

Mark Schlager Training Manager



THIS CERTIFICATE IS AWARDED TO

RYAN HICKS

1012 INDUSTRIAL DRIVE, WEST BERLIN, NJ 08091

FOR SUCCESSFULLY COMPLETING THE PRESCRIBED COURSE OF STUDY IN

DUST SAMPLING TECHNICIAN INITIAL- ENGLISH

PRESENTED BY
ACCESS TRAINING SERVICES, INC.
7921 RIVER ROAD, PENNSAUKEN, NEW JERSEY 08110
(856) 665-3449

CERTIFICATE NUMBER: <u>D-I-18846-22-00057</u>

COURSE DATE 6/17/22 EXAM DATE 6/16/22 EXPIRATION DATE 6/17/27

Mark Schlager Training Manager





THIS CERTIFICATE IS AWARDED TO

KEVIN RUMBOL

97 CANDLEWOOD DRIVE, MANTUA, NJ 08051

FOR SUCCESSFULLY COMPLETING THE PRESCRIBED COURSE OF STUDY IN


DUST SAMPLING TECHNICIAN INITIAL- ENGLISH

PRESENTED BY
ACCESS TRAINING SERVICES, INC.
7925 RIVER ROAD, PENNSAUKEN, NEW JERSEY 08110
(856) 665-3449

CERTIFICATE NUMBER: D-I-18846-20-00025

COURSE DATE 2/4/20 EXAM DATE 2/4/20 EXPIRATION DATE 2/4/25

Mark Schlager Training Manager _

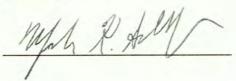



THIS CERTIFICATE IS AWARDED TO

SALVATORE PROCOPIO

335 HANBY CIRCLE, BOOTHWYN, PA 19061

FOR SUCCESSFULLY COMPLETING THE PRESCRIBED COURSE OF STUDY IN

DUST SAMPLING TECHNICIAN INITIAL- ENGLISH

PRESENTED BY
ACCESS TRAINING SERVICES, INC.
7921 RIVER ROAD, PENNSAUKEN, NEW JERSEY 08110
(856) 665-3449

CERTIFICATE NUMBER: <u>D-I-18846-22-00021</u>

COURSE DATE 3/4/22 EXAM DATE 3/4/22 EXPIRATION DATE 3/4/27

Mark Schlager Training Manager



THIS CERTIFICATE IS AWARDED TO

KEVIN RUMBOL

97 CANDLEWOOD DRIVE, MANTUA, NJ 08051

FOR SUCCESSFULLY COMPLETING THE PRESCRIBED COURSE OF STUDY IN

RENOVATOR INITIAL- ENGLISH

PER 40 CFR 745.225, LEAD RRP RULE

PRESENTED BY
ACCESS TRAINING SERVICES, INC.
7921 RIVER ROAD, PENNSAUKEN, NEW JERSEY 08110

CERTIFICATE NUMBER: R-I-18846-20-00009

Course Date 2/7/20

EXPIRATION DATE 2/7 /25

Mark Schlager Training Manager _







proActive Safety Services

3557 Springdale Rd. Suite E Cincinnati, Ohio 45251 Phone: (513) 372-6232

Certificate of Attendance and Successful Completion

Renovator Initial – English

Per 40 CFR Part 745.225

Salvatore Procopio

1012 Industrial Dr., West Berlin, NJ 08091

Certificate Number: R-I-99273-21-05558

Course Date: 11/10/2021


Examination Date: 11/10/2021

Expiration Date: 11/10/2026

Scott Teepe Jr.



Joe McAndrews Jaga Mount

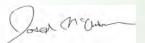

Training Manager / Principle Instructor



proActive Safety Services

3557 Springdale Rd. Suite E Cincinnati, Ohio 45251 Phone: (513) 372-6232

Certificate of Attendance and Successful Completion

Renovator Initial – English

Per 40 CFR Part 745.225

Ryan Hicks

1012 Industrial Dr., West Berlin, NJ 8091

Certificate Number: R-I-99273-22-02457

Course Date: 06/23/2022

Examination Date: 06/23/2022

Expiration Date: 06/23/2027

Scott Teepe Jr.



Martin Smith



Training Manager / Principle Instructor



proActive Safety Services

3557 Springdale Rd. Suite E Cincinnati, Ohio 45251 Phone: (513) 372-6232

Certificate of Attendance and Successful Completion

Renovator Initial – English

Per 40 CFR Part 745.225

Ronald Rominski

1012 Industrial Dr., West Berlin, NJ 08091

Certificate Number: R-I-99273-21-05559

Course Date: 11/10/2021


Examination Date: 11/10/2021

Expiration Date: 11/10/2026

Scott Teepe Jr.



Joe McAndrews Jaga Mount

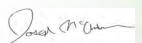

Training Manager / Principle Instructor

THIS CERTIFICATE IS AWARDED TO

KEVIN PRICE

844 NORTH 26TH STREET, PHILADELPHIA, PA 19130

FOR SUCCESSFULLY COMPLETING THE PRESCRIBED COURSE OF STUDY IN

RENOVATOR INITIAL - ENGLISH

PER 40 CFR 745.225, LEAD RRP RULE

PRESENTED BY
ACCESS TRAINING SERVICES, INC.
7921 RIVER ROAD, PENNSAUKEN, NEW JERSEY 08110

CERTIFICATE NUMBER: R-I-18846-20-00073

COURSE DATE: 11/6/20

EXPIRATION DATE: 11/6/25

Mark Schlager Training Manager _







APPENDIX D

SDP RRP CERTIFICATE

CRITERION LABORATORIES, INC.

400 STREET ROAD, BENSALEM, PA 19020 PHONE: (215) 244-1300, FAX: (215) 244-4349 WWW.CRITERIONLABS.COM

Certificate of Attendance and Successful Completion

Lead RRP Initial – English Per 40 CFR Part 745.225

Jamel Haggins

533 Rosalie St., Philadelphia, PA 19120

Certificate Number: R-I-19014-19-748930

Course Date: 5/31/2019 Examination Date: 5/31/2019 Expiration Date: 5/31/2024

g-cuety-

CRITERION LABORATORIES, INC.

400 STREET ROAD, BENSALEM, PA 19020 PHONE: (215) 244-1300, FAX: (215) 244-4349 WWW.CRITERIONLABS.COM

Certificate of Attendance and Successful Completion

Lead RRP Initial – English Per 40 CFR Part 745.225

Season Hall

1916 Monument Street, Philadelphia, PA 19121

Certificate Number: R-I-19014-20-750791

Course Date: 3/11/2020 Examination Date: 3/11/2020 Expiration Date: 3/11/2025

g-cuelt



400 STREET ROAD, BENSALEM, PA 19020 PHONE: (215) 244-1300, FAX: (215) 244-4349 WWW-CRITERIONLABS.COM

Certificate of Attendance and Successful Completion

Lead RRP Initial – English Per 40 CFR Part 745.225

John Petrucci

4610 Smick St., Philadelphia, PA 19127

Centificate Number: R-I-19014-22-753594



Course Date: 2/2/2022
Examination Date: 2/2/2022

Expiration Date: 2/2/2027

g-cuelt



400 STREET ROAD, BENSALEM, PA 19020 PHONE: (215) 244-1300, FAX: (215) 244-4349 WWW-CRITERIONLABS.COM

Certificate of Attendance and Successful Completion

Lead RRP Initial – English Per 40 CFR Part 745.225

Christian Kahlert


3007 Mercer Street, Philadelphia, PA 19134

Centificate Number: R-I-19014-21-752903

|| Course Date: 9/28/2021 Examination Date: 9/28/2021

Expiration Date: 9/28/2026

g-cuelt

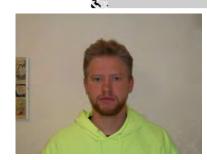



PHONE: (215) 244-1300, FAX: (215) 244-434

WWW-CRITERIONLABS.COM

Certificate of Attendance and Successful Completion

Lead RRP Initial – English Per 40 CFR Part 745.225

Charles Lawrence

6543 Guyer Ave., Philadelphia, PA 19142

extificate Number: R-I-19014-21-752905

Course Date: 9/28/2021

Examination Date: 9/28/2021

Expiration Date: 9/28/2026





400 STREET ROAD, BENSALEM, PA 19020. PHONE: (215) 244-1300, FAX: (215) 244-4349 WWW-CRITERIONLABS.CQM

Certificate of Attendance and Successful Completion

Lead RRP Initial – English Per 40 CFR Part 745.225

Tomasz Lopata

2015 ELetterly Street, Philadelphia, PA 19125

Centificate Number: R-I-19014-20-781745

Course Date: 11/6/2020

Examination Date: 11/6/2020

Expiration Date: 11/6/2025

g-custo

400 STREET ROAD, BENSALEM, PA 19020 PHONE: (215) 244-1300, FAX: (215) 244-4349 WWW.CRITERIONLABS.COM

Certificate of Attendance and Successful Completion

Lead RRP Initial — English Per 40 CFR Part 745.225

Harry Lowe, III

2841 S. 11th Street, Philadelphia, PA 19148

Certificate Number: R-I-19014-20-750796

Course Date: 3/11/2020 Examination Date: 3/11/2020 Expiration Date: 3/11/2025

g-cuetz-

400 STREET ROAD, BENSALEM, PA 19020 PHONE: (215) 244-1300, FAX: (215) 244-4349 WWW.CRITERIONLABS.COM

Certificate of Attendance and Successful Completion

Lead RRP Initial – English Per 40 CFR Part 745.225

Harry Lowe, Jr.


822 Pen-Ambler Rd., Blue Bell, PA 19422

Certificate Number: R-I-19014-18-746323

Course Date: 4/20/2018 Examination Date: 4/20/2018

Expiration Date: 4/20/2023

g-cueta

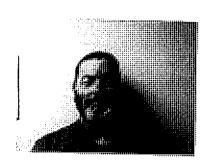

400 STREET ROAD, BENSALEM, PA 19020 PHONE: (215) 244-1300, FAX: (215) 244-4349 WWW.CRITERIONLABS.COM

Certificate of Attendance and Successful Completion

Lead RRP Initial – English Per 40 CFR Part 745.225

Robert Broadnax

322 Tavistock Drive, Royersford, PA 19468

Certificate Number: R-I-19014-18-746320

Course Date: 4/20/2018 Examination Date: 4/20/2018 Expiration Date: 4/20/2023

g-cuety-

400 STREET ROAD, BENSALEM, PA 19020 PHONE: (215) 244-1300, FAX: (215) 244-4349 WWW.CRITERIONLABS.COM

Certificate of Attendance and Successful Completion

Lead RRP Initial – English Per 40 CFR Part 745.225

William Soda

451 Harmon Rd., Philadelphia, PA 19128

Certificate Number: R-I-19014-18-746326

Course Date: 4/20/2018 Examination Date: 4/20/2018

Expiration Date: 4/20/2023

JAMES A. WELTZ, CIH

400 STREET ROAD, BENSALEM, PA 19020 PHONE: (215) 244-1300, FAX: (215) 244-4349 WWW.CRITERIONLABS.COM

Certificate of Attendance and Successful Completion

Lead RRP Initial – English Per 40 CFR Part 745.225

Ineshia Atwell

2854 N. Mareston St., Philadelphia, PA 19132

Certificate Number: R-I-19014-19-748077



Course Date: 2/6/2019 Examination Date: 2/6/2019

Expiration Date: 2/6/2024

g-cuety

400 STREET ROAD, BENSALEM, PA 19020 PHONE: (215) 244-1300, FAX: (215) 244-4349 WWW.CRITERIONLABS.COM

Certificate of Attendance and Successful Completion

Lead RRP Initial – English Per 40 CFR Part 745.225

Scott Yannatell

234 Leverington Ave., Apt. 1F, Philadelphia, PA 19127

Certificate Number: R-I-19014-18-747539

Course Date: 12/17/2018

Examination Date: 12/17/2018

Expiration Date: 12/17/2023



g-cuety

400 STREET ROAD, BENSALEM, PA 19020 PHONE: (215) 244-1300, FAX: (215) 244-4349 WWW.CRITERIONLABS.COM

Certificate of Attendance and Successful Completion

Lead RRP Initial – English Per 40 CFR Part 745,225

Michael Minogue

3161 S. 17th Street, Phlladelphia, PA 19010

Certificate Number: R-I-19014-18-747540

Course Date: 12/17/2018 Examination Date: 12/17/2018

Expiration Date: 12/17/2023



JAMES A. WELTZ, CIH Training Manager / Principal Instructor

Q-Club

400 STREET ROAD, BENSALEM, PA 19020 PHONE: (215) 244-1300, FAX: (215) 244-4349 WWW.CRITERIONLABS.COM

Certificate of Attendance and Successful Completion

Lead RRP Initial – English Per 40 CFR Part 745.225

Michael Moore

4633 Silverwood Street, Philadelphia, PA 19128

Certificate Number: R-I-19014-18-747538

Course Date: 12/17/2018 Examination Date: 12/17/2018

Expiration Date: 12/17/2023

JAMES A WELTZ CIH

400 STREET ROAD, BENSALEM, PA 19020 PHONE: (215) 244-1300, FAX: (215) 244-4349 WWW.CRITERIONLABS.COM

Certificate of Attendance and Successful Completion

Lead RRP Initial – English Per 40 CFR Part 745.225

Thomas Malkowski

12428 Academy Road, Philadelphia, PA 19159

Certificate Number: R-I-19014-17-745265

Course Date: 11/3/2017 Examination Date: 11/3/2017 Expiration Date: 11/3/2022

g-cuelty-

400 STREET ROAD, BENSALEM, PA 19020 PHONE: (215) 244-1300, FAX: (215) 244-4349 WWW.CRITERIONLABS.COM

Certificate of Attendance and Successful Completion

Lead RRP Initial – English Per 40 CFR Part 745,225

Michael Minogue

3161 S. 17th Street, Phlladelphia, PA 19010

Certificate Number: R-I-19014-18-747540

Course Date: 12/17/2018 Examination Date: 12/17/2018

Expiration Date: 12/17/2023



JAMES A. WELTZ, CIH Training Manager / Principal Instructor

Q-Club

400 STREET ROAD, BENSALEM, PA 19020 PHONE: (215) 244-1300, FAX: (215) 244-4349 WWW.CRITERIONLABS.COM

Certificate of Attendance and Successful Completion

Lead RRP Initial – English Per 40 CFR Part 745.225

Michael Moore

4633 Silverwood Street, Philadelphia, PA 19128

Certificate Number: R-I-19014-18-747538

Course Date: 12/17/2018 Examination Date: 12/17/2018

Expiration Date: 12/17/2023

JAMES A WELTZ CIH

400 STREET ROAD, BENSALEM, PA 19020 PHONE: (215) 244-1300, FAX: (215) 244-4349 WWW.CRITERIONLABS.COM

Certificate of Attendance and Successful Completion

Lead RRP Initial – English Per 40 CFR Part 745.225

Jorge Naveiro

2217 Berwyn Place, Philadelphia, PA 19115

Certificate Number: R-I-19014-17-745436

Course Date: 11/17/2017 Examination Date: 11/17/2017

Expiration Date: 11/17/2022

g-cuelto





400 STREET ROAD, BENSALEM, PA 19020. PHONE: (215) 244-1300, FAX: (215) 244-4349 WWW-CRITERIONLABS.COM

Certificate of Attendance and Successful Completion

Lead RRP Initial – English Per 40 CFR Part 745.225

Nicholas Ciccolone

330 Roxborough Ave., Philadelphia, PA 19128

Centificate Number: R-I-19014-22-753596



Course Date: 2/2/2022 Examination Date: 2/2/2022

Expiration Date: 2/2/2027

g-cuelt



400 STREET ROAD, BENSALEM, PA 19020 PHONE: (215) 244-1300, FAX: (215) 244-4349 WWW-CRITERIONLABS.COM

Certificate of Attendance and Successful Completion

Lead RRP Initial – English Per 40 CFR Part 745.225

Derik Owens

6123 Hawthorne St., Apt. B, Philadelphia, PA 19135

Centificate Number: R-I-19014-21-752906



Course Date: 9/28/2021

Examination Date: 9/28/2021

Expiration Date: 9/28/2026

g-cueto



PHONE: (215) 244-1300, FAX: (215) 244-434

WWW-CRITERIONLABS.COM

Certificate of Attendance and Successful Completion

Lead RRP Initial – English Per 40 CFR Part 745.225

Andrew Patterson

5217 N. 11th Street, Philadelphia, PA 19141

extificate Number: R-I-19014-21-782908



Course Date: 9/28/2021

Examination Date: 9/28/2021

Expiration Date: 9/28/2026

400 STREET ROAD, BENSALEM, PA 19020 PHONE: (215) 244-1300, FAX: (215) 244-4349 WWW.CRITERIONLABS.COM

Certificate of Attendance and Successful Completion

Lead RRP Initial – English Per 40 CFR Part 745.225

Matt Phillips

1945 E. Somerset Street, Philadelphia, PA 19134

Certificate Number: R-I-19014-20-750801



Course Date: 3/11/2020 Examination Date: 3/11/2020 Expiration Date: 3/11/2025

g-cuelt

400 STREET ROAD, BENSALEM, PA 19020 PHONE: (215) 244-1300, FAX: (215) 244-4349 WWW.CRITERIONLABS.COM

Certificate of Attendance and Successful Completion

Lead RRP Initial – English Per 40 CFR Part 745.225

David Sienko

461 Paoli Ave., Philadelphia, PA 19128

Certificate Number: R-I-19014-17-745424

Course Date: 11/17/2017 Examination Date: 11/17/2017 Expiration Date: 11/17/2022

g-cueta-



400 STREET ROAD, BENSALEM, PA 19020 PHONE: (215) 244-1300, FAX: (215) 244-4349 WWW.CRITERIONLABS.COM

Certificate of Attendance and Successful Completion

Lead RRP Initial – English Per 40 CFR Part 745.225

William Soda

451 Harmon Rd., Philadelphia, PA 19128

Certificate Number: R-I-19014-18-746326

Course Date: 4/20/2018 Examination Date: 4/20/2018

Expiration Date: 4/20/2023

JAMES A. WELTZ, CIH

400 STREET ROAD, BENSALEM, PA 19020 PHONE: (215) 244-1300, FAX: (215) 244-4349 WWW.CRITERIONLABS.COM

Certificate of Attendance and Successful Completion

Lead RRP Initial – English Per 40 CFR Part 745.225

Christopher Stackhouse

2545 East Somerset Street, Philadelphia, PA 19134

Certificate Number: R-I-19014-20-750803

Course Date: 3/11/2020 Examination Date: 3/11/2020 Expiration Date: 3/11/2025

g-cuety

400 STREET ROAD, BENSALEM, PA 19020 PHONE: (215) 244-1300, FAX: (215) 244-4349 WWW.CRITERIONLABS.COM

Certificate of Attendance and Successful Completion

Lead RRP Initial – English Per 40 CFR Part 745.225

Ricardo Tomlinson

1735 Georges Lane, Philadelphia, PA 19131

Certificate Number: R-I-19014-20-750806

Course Date: 3/11/2020 Examination Date: 3/11/2020 Expiration Date: 3/11/2025

g-cuety



400 STREET ROAD, BENSALEM, PA 19020 PHONE: (215) 244-1300, FAX: (215) 244-4349 WWW.CRITERIONLABS.COM

Certificate of Attendance and Successful Completion

Lead RRP Initial – English Per 40 CFR Part 745.225

Vin Tonelli

1933 Hoffman Street, Philadelphia, PA 19145

Certificate Number: R-I-19014-17-745427

Course Date: 11/17/2017 Examination Date: 11/17/2017 Expiration Date: 11/17/2022

g-coety

400 STREET ROAD, BENSALEM, PA 19020 PHONE: (215) 244-1300, FAX: (215) 244-4349 WWW.CRITERIONLABS.COM

Certificate of Attendance and Successful Completion

Lead RRP Initial – English Per 40 CFR Part 745.225

Stephen M. Weiss

1860 Foster Street, Philadelphia, PA 19116

Certificate Number: R-I-19014-17-745428

Course Date: 11/17/2017 Examination Date: 11/17/2017 Expiration Date: 11/17/2022

g-cuelty-



400 STREET ROAD, BENSALEM, PA 19020 PHONE: (215) 244-1300, FAX: (215) 244-4349 WWW.CRITERIONLABS.COM

Certificate of Attendance and Successful Completion

Lead RRP Initial – English Per 40 CFR Part 745.225

George Weissman

6355 Cottage Street, Philadelphia, PA 19135

Certificate Number: R-I-19014-17-745434

Course Date: 11/17/2017 Examination Date: 11/17/2017 Expiration Date: 11/17/2022

g-cuelt

400 STREET ROAD, BENSALEM, PA 19020 PHONE: (215) 244-1300, FAX: (215) 244-4349 WWW.CRITERIONLABS.COM

Certificate of Attendance and Successful Completion

Lead RRP Initial – English Per 40 CFR Part 745.225

Gordon White

1638 S. 24th Street, Philadelphia, PA 19145

Certificate Number: R-I-19014-20-750805

Course Date: 3/11/2020 Examination Date: 3/11/2020 Expiration Date: 3/11/2025

g-cuety



400 STREET ROAD, BENSALEM, PA 19020 PHONE: (215) 244-1300, FAX: (215) 244-4349 WWW.CRITERIONLABS.COM

Certificate of Attendance and Successful Completion

Lead RRP Initial – English Per 40 CFR Part 745.225

Denice Witkowski

2616 Wilder Street, Philadelphia, PA 19146

Certificate Number: R-I-19014-17-745430

Course Date: 11/17/2017 Examination Date: 11/17/2017 Expiration Date: 11/17/2022

g-cuely



400 STREET ROAD, BENSALEM, PA 19020 PHONE: (215) 244-1300, FAX: (215) 244-4349 WWW.CRITERIONLABS.COM

Certificate of Attendance and Successful Completion

Lead RRP Initial – English Per 40 CFR Part 745.225

Scott Yannatell

234 Leverington Ave., Apt. 1F, Philadelphia, PA 19127

Certificate Number: R-I-19014-18-747539

Course Date: 12/17/2018

Examination Date: 12/17/2018

Expiration Date: 12/17/2023



g-cuety

KATATATATATATATATATATATA

THIS CERTIFICATE IS AWARDED TO

CHRISTOPHER BARTELLA

3152 SOUTH SMEDLEY STREET, PHILADELPHIA, PA 19145

FOR SUCCESSFULLY COMPLETING THE PRESCRIBED COURSE OF STUDY IN

RENOVATOR INITIAL- ENGLISH

PER 40 CFR 745.225, LEAD RRP RULE

PRESENTED BY
ACCESS TRAINING SERVICES, INC.
7921 RIVER ROAD, PENNSAUKEN, NEW JERSEY 08110

CERTIFICATE NUMBER: R-1-18846-21-00077

COURSE DATE: 10/22/21 EXAM DATE: 10/22/21

EXPIRATION DATE: 10/22/26

Mark Schlager
Training Manager





THIS CERTIFICATE IS AWARDED TO

JAMES J. DUGAN

215 MONTGOMERY AVENUE, ORELAND, PA 19075

FOR SUCCESSFULLY COMPLETING THE PRESCRIBED COURSE OF STUDY IN

RENOVATOR INITIAL- ENGLISH

PER 40 CFR 745.225, LEAD RRP RULE

PRESENTED BY

ACCESS TRAINING SERVICES, INC.


7921 RIVER ROAD, PENNSAUKEN, NEW JERSEY 08110

CERTIFICATE NUMBER: R-I-18846-21-00082

COURSE DATE: 10/22/21 EXAM DATE: 10/22/21

EXPIRATION DATE: 10/22/26

Mark Schlager Training Manager

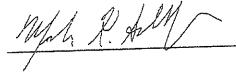



ABABBBBBBBBBBBB

THIS CERTIFICATE IS AWARDED TO

GERALD JONIEC

166 HOLLY AVENUE, LANGHORNE, PA 19047

FOR SUCCESSFULLY COMPLETING THE PRESCRIBED COURSE OF STUDY IN

RENOVATOR INITIAL- ENGLISH

PER 40 CFR 745.225, LEAD RRP RULE

PRESENTED BY

ACCESS TRAINING SERVICES, INC.


7921 RIVER ROAD, PENNSAUKEN, NEW JERSEY 08110

CERTIFICATE NUMBER: R-1-18846-21-00081

COURSE DATE: 10/22/21 EXAM DATE: 10/22/21

EXPIRATION DATE: 10/22/26

Mark Schlager Training Manager _

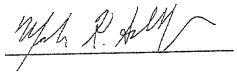



THIS CERTIFICATE IS AWARDED TO

MICHAEL LOWE

1221 TRISTRAM CIRCLE, MANTUA, NJ 08051

FOR SUCCESSFULLY COMPLETING THE PRESCRIBED COURSE OF STUDY IN

RENOVATOR INITIAL- ENGLISH

PER 40 CFR 745.225, LEAD RRP RULE

PRESENTED BY

ACCESS TRAINING SERVICES, INC.


7921 RIVER ROAD, PENNSAUKEN, NEW JERSEY 08110

CERTIFICATE NUMBER: R-1-18846-21-00083

COURSE DATE: 10/22/21 EXAM DATE: 10/22/21

EXPIRATION DATE: 10/22/26

Mark Schlager Training Manager

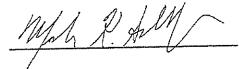





400 STREET ROAD, BENSALEM, PA 19020 PHONE: (215) 244-1300, FAX: (215) 244-434

WWW-CRITERIONLABS.COM

Certificate of Attendance and Successful Completion

Lead RRP Initial – English Per 40 CFR Part 745.225

Ronald Akines

6838 Qakley Street, Apt. #2, Philadelphia, PA 19111

Centificate Number: R-I-19014-20-781744

Course Date: 11/6/2020

Examination Date: 11/6/2020

Expiration Date: 11/6/2025

400 STREET ROAD, BENSALEM, PA 19020 PHONE: (215) 244-1300, FAX: (215) 244-4349 WWW.CRITERIONLABS.COM

Certificate of Attendance and Successful Completion

Lead RRP Initial – English Per 40 CFR Part 745.225

Ben Amodei

4112 Houghton St., Philadelphia, PA 19128

Certificate Number: R-I-19014-19-748935

Course Date: 5/31/2019 Examination Date: 5/31/2019 Expiration Date: 5/31/2024



g-cueta-



400 STREET ROAD, BENSALEM, PA 19020 PHONE: (215) 244-1300, FAX: (215) 244-4349 WWW-CRITERIONLABS.COM

Certificate of Attendance and Successful Completion

Lead RRP Initial – English Per 40 CFR Part 745.225

David Angelo

4732 Umbria Street, Philadelphia, PA 19127

Centificate Number: R-I-19014-21-752902



Course Date: 9/28/2021

Exam<mark>ination Date: 9/28/2</mark>@21

Expiration Date: 9/28/2026

g-cuelto

400 STREET ROAD, BENSALEM, PA 19020 PHONE: (215) 244-1300, FAX: (215) 244-4349 WWW.CRITERIONLABS.COM

Certificate of Attendance and Successful Completion

Lead RRP Initial – English Per 40 CFR Part 745.225

Demetrius Atwell

1328 N. Taney, Philadelphia, PA 19121

Certificate Number: R-I-19014-17-745433

Course Date: 11/17/2017 Examination Date: 11/17/2017 Expiration Date: 11/17/2022

g-cuelty-



400 STREET ROAD, BENSALEM, PA 19020 PHONE: (215) 244-1300, FAX: (215) 244-4349 WWW.CRITERIONLABS.COM

Certificate of Attendance and Successful Completion

Lead RRP Initial – English Per 40 CFR Part 745.225

Ineshia Atwell

2854 N. Mareston St., Philadelphia, PA 19132

Certificate Number: R-I-19014-19-748077



Course Date: 2/6/2019 Examination Date: 2/6/2019

Expiration Date: 2/6/2024

g-cuety

400 STREET ROAD, BENSALEM, PA 19020 PHONE: (215) 244-1300, FAX: (215) 244-4349 WWW.CRITERIONLABS.COM

Certificate of Attendance and Successful Completion

Lead RRP Initial – English Per 40 CFR Part 745.225

Paul Bady

318 Rices Mill Road, Wyncote, PA 19095

Certificate Number: R-I-19014-20-750804

Course Date: 3/11/2020 Examination Date: 3/11/2020 Expiration Date: 3/11/2025



g-cuety-

United States Environmental Protection Agency This is to certify that



School District of Philadelphia Office of Environmental Management Services

has fulfilled the requirements of the Toxic Substances Control Act (TSCA) Section 402, and has received certification to conduct lead-based paint renovation, repair, and painting activities pursuant to 40 CFR Part 745.89

In the Jurisdiction of:

All EPA Administered States, Tribes, and Territories

This certification is valid from the date of issuance and expires

January 25, 2027

NAT-50914-3

Certification #

January 11, 2022

Issued On



Michelle Price, Chief

Lead, Heavy Metals, and Inorganics Branch

400 STREET ROAD, BENSALEM, PA 19020 PHONE: (215) 244-1300, FAX: (215) 244-4349 WWW.CRITERIONLABS.COM

Certificate of Attendance and Successful Completion

Lead RRP Initial – English Per 40 CFR Part 745.225

Joseph Beavers

2601 S. Iseminger Street, Philadelphia, PA 19148

Certificate Number: R-I-19014-20-750792

Course Date: 3/11/2020 Examination Date: 3/11/2020 Expiration Date: 3/11/2025



g-cuety

400 STREET ROAD, BENSALEM, PA 19020 PHONE: (215) 244-1300, FAX: (215) 244-4349 WWW.CRITERIONLABS.COM

Certificate of Attendance and Successful Completion

Lead RRP Initial – English Per 40 CFR Part 745.225

Robert Broadnax

322 Tavistock Drive, Royersford, PA 19468

Certificate Number: R-I-19014-18-746320

Course Date: 4/20/2018 Examination Date: 4/20/2018 Expiration Date: 4/20/2023

g-cuety-

400 STREET ROAD, BENSALEM, PA 19020 PHONE: (215) 244-1300, FAX: (215) 244-4349 WWW.CRITERIONLABS.COM

Certificate of Attendance and Successful Completion

Lead RRP Initial – English Per 40 CFR Part 745.225

Jonathan C. Byram 4234 L Street, Philadelphia, PA 19124

Certificate Number: R-I-19014-20-750799

Course Date: 3/11/2020 Examination Date: 3/11/2020 Expiration Date: 3/11/2025



g-cuelt

400 STREET ROAD, BENSALEM, PA 19020 PHONE: (215) 244-1300, FAX: (215) 244-4349 WWW.CRITERIONLABS.COM

Certificate of Attendance and Successful Completion

Lead RRP Initial – English Per 40 CFR Part 745.225

Okang Cambridge

144 W. Queen Lane, Apt. #1, Philadelphia, PA 19144

Certificate Number: R-I-19014-17-745437

Course Date: 11/17/2017 Examination Date: 11/17/2017 Expiration Date: 11/17/2022

g-cuety-

400 STREET ROAD, BENSALEM, PA 19020 PHONE: (215) 244-1300, FAX: (215) 244-4349 WWW.CRITERIONLABS.COM

Certificate of Attendance and Successful Completion

Lead RRP Initial – English Per 40 CFR Part 745.225

James Capers

3010 N. Stillman Street, Philadelphia, PA 19132

Certificate Number: R-I-19014-17-745267



Course Date: 11/3/2017 Examination Date: 11/3/2017 Expiration Date: 11/3/2022

g-cuelt

400 STREET ROAD, BENSALEM, PA 19020 PHONE: (215) 244-1300, FAX: (215) 244-4349 WWW.CRITERIONLABS.COM

Certificate of Attendance and Successful Completion

Lead RRP Initial – English Per 40 CFR Part 745.225

Gabrielle Cecaia

807 McKean Street, Philadelphia, PA 19148

Certificate Number: R-I-19014-17-745435

Course Date: 11/17/2017 Examination Date: 11/17/2017 Expiration Date: 11/17/2022

g-cueta-



400 STREET ROAD, BENSALEM, PA 19020 PHONE: (215) 244-1300, FAX: (215) 244-4349 WWW.CRITERIONLABS.COM

Certificate of Attendance and Successful Completion

Lead RRP Initial – English Per 40 CFR Part 745.225

Jahmai Crawley

6131 Catharine Street, Philadelphia, PA 19143

Certificate Number: R-I-19014-17-745262

Course Date: 11/3/2017 Examination Date: 11/3/2017 Expiration Date: 11/3/2022



g-cuels

JAMES A. WELTZ, CIH
Training Manager / Principal Instructor

400 STREET ROAD, BENSALEM, PA 19020 PHONE: (215) 244-1300, FAX: (215) 244-4349 WWW.CRITERIONLABS.COM

Certificate of Attendance and Successful Completion

Lead RRP Initial – English Per 40 CFR Part 745.225

Timothy Creighton

4414 Edgemont Street, Philadelphia, PA 19137

Certificate Number: R-I-19014-17-745423

Course Date: 11/17/2017 Examination Date: 11/17/2017 Expiration Date: 11/17/2022

g-cuelt

400 STREET ROAD, BENSALEM, PA 19020 PHONE: (215) 244-1300, FAX: (215) 244-4349 WWW.CRITERIONLABS.COM

Certificate of Attendance and Successful Completion

Lead RRP Initial – English Per 40 CFR Part 745.225

Sean Donahue

12864 Elnora Road, Philadelphia, PA 19154

Certificate Number: R-I-19014-19-748939

Course Date: 5/31/2019 Examination Date: 5/31/2019 Expiration Date: 5/31/2024

g-cuelto



400 STREET ROAD, BENSALEM, PA 19020 PHONE: (215) 244-1300, FAX: (215) 244-4349 WWW.CRITERIONLABS.COM

Certificate of Attendance and Successful Completion

Lead RRP Initial – English Per 40 CFR Part 745.225

Vincent Finn

11713 Denman Road, Philadelphia, PA 19154

Certificate Number: R-I-19014-20-750794

Course Date: 3/11/2020 Examination Date: 3/11/2020 Expiration Date: 3/11/2025



g-cuety

400 STREET ROAD, BENSALEM, PA 19020 PHONE: (215) 244-1300, FAX: (215) 244-4349 WWW.CRITERIONLABS.COM

Certificate of Attendance and Successful Completion

Lead RRP Initial – English Per 40 CFR Part 745.225

Sean Flannery

537 Dupont St., Philadelphia, PA 19128

Certificate Number: R-I-19014-19-748936

Course Date: 5/31/2019 Examination Date: 5/31/2019 Expiration Date: 5/31/2024

g-cuety



400 STREET ROAD, BENSALEM, PA 19020 PHONE: (215) 244-1300, FAX: (215) 244-4349 WWW-CRITERIONLABS.COM

Certificate of Attendance and Successful Completion

Lead RRP Initial – English
Per 40 CFR Part 745.225

Joseph Gardiner

610 Ash St., Glassboro, NJ 08028

Certificate Number: R-I-19014-21-752904

Course Date: 9/28/2021

Examination Date: 9/28/2021

Expiration Date: 9/28/2026



g-cuelto

400 STREET ROAD, BENSALEM, PA 19020 PHONE: (215) 244-1300, FAX: (215) 244-4349 WWW.CRITERIONLABS.COM

Certificate of Attendance and Successful Completion

Lead RRP Initial – English Per 40 CFR Part 745.225

Raynaldo Gonzalez

434 Pierce Street, Lansdale, PA 19446

Certificate Number: R-I-19014-17-745429

Course Date: 11/17/2017 Examination Date: 11/17/2017 Expiration Date: 11/17/2022

g-cuelt



APPENDIX E

LEAD SAFE CERTIFICATE

FOR ADMIN	USE ONLY:	
01111111	CDE CITE	



Philadelphia Department of Public Health Certification of School Lead Safe Status

By signing this certificate, I confirm that I have done a visual inspection of the areas where children have access, including contact surfaces where children store their equipment or materials, and confirm these areas do not have deteriorated lead-based paint. A certified risk assessor or lead dust sampling technician completed verification wipe tests in accordance with the EPA's RRP guidelines and confirms they meet the EPA's cleanliness standard. A certified risk assessor or lead dust sampling technician collected interior dust wipe samples in compliance with EPA regulations in work areas and confirms they did not contain lead contaminated dust in excess of EPA dust lead standards in Pre-K, Kindergarten, and 1st Grade classrooms as well as the restrooms, offices, cafeterias, gymnasiums, and auditoriums these children routinely occupy. This certificate is valid for 4 years from date of verification.

Bodine High School for International Affairs		1101 N. 4 th Street, Philadelphia, PA	
School Name		Street Address	
Acer Associates, LLC	Kristen 1	Masotes, PA License #058358	
Certifying Company (print)	Risk Assessor, Lead Inspec	ctor PA Lic. #, EPA Firm Certification or Lead Dust Sampling Technician Cert	ification #
Knister Wasoles		September 6, 2022	
Inspector/Risk Assessor or Dust Wipe Sampling Technician	Name (Signature)	Date of Verification	
Steve Link, 215-400-5768, slink@philasd.org			
School Official Name, Telephone and E-mail Address			